

Chicago Public Schools

6 Month Asbestos Surveillance

2016 - Fall

School: Edgebrook School
Address: 6525 N Hiawatha Avenue

Oracle Unit: 23071
Region: 01

Building ID: 3170
Mail Room: 30

Asbestos Surveyor: Travers, Mr. Patrick D.
Survey Date: 12/19/2016
Email Address: _____

☒ **CHECK HERE IF NO CHANGE TO ASBESTOS**

A copy of the 2016/2017 notice to parents and staff regarding the asbestos management plan notifications was distributed via:

☐ Each child's backpack ☒ Notice printed in school's newsletter ☐ Notice printed in school's calendar ☐ Other |

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
01	Hard Coat Plaster	0		Throughout - 1939 Bldg.							☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
02	Spray-On Acoustical Plaster Ceiling	2400	SF	1st Floor Gymnasium - 1953 Bldg.		Surface	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

Oracle Unit: 23071

Page 1

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
04	MJP E/F/V on Felt Pipe Insulation	46	LF	1st & 2nd Floors: Boy's & Girl's Toilets Pipe Chases, Room 106 Toilet - 1939 Bldg.		TSI	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
05	Mag Block Pipe Insulation	250	LF	NNE & NE Unexcavated Areas - 1953 Bldg.		TSI	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
07	Aircell Pipe Insulation	160	LF	Unexcavated Areas, Engineer Storage, & Engineer Office, Toilet - 1939		TSI	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
09	Duct Insulation-Lining between Canvas & Fiberglass	3410	SF	Unexcavated Areas - 1939 Bldg.		TSI	Yes	Dist	350		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
13	Aircell Duct Insulation	1800	SF	Unexcavated Space - 1953 Bldg.		TSI	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
14	Felt Pipe Insulation	100	LF	1st & 2nd Fl: Boy's & Girl's Toilets Pipe Chases, Rm 106 Toilet - 1939 Bldg.		TSI	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
18	Hard Coat Plaster	0		Throughout - 1953 Bldg.							☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
19	12"x12" White w/Tan Spots VFT - ABATED			Rooms 107 (under HA 33) & 207 (Tiled Over) (under HA36)- 1953 Bldg. - ABATED							☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
19A	12"x12" White w/Tan Spots VFT Mastic - ABATED			Rooms 107 (under HA 33) & 207 (Tiled Over) (under HA 36)- 1953 Bldg. - ABATED							☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
20	12"x12" Tan VFT	3300	SF	Rooms: 108, 200, 201, 202 (under HA #37 and #37A) - 1953 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
20A	12"x12" Tan VFT Mastic	3300	SF	Rooms: 108, 200, 201, 202 (under HA #37 and #37A) - 1953 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
21	12"x12" Beige VFT	3300	SF	Rooms: 100, 101, 102; Rms 108, 200, 201, 202, 208 (under HA# 37 & 37A) - 1953 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
21A	12"x12" Beige VFT Mastic	3300	SF	Rooms: 100, 101, 102; Rms 108, 200, 201, 202, 208 (under HA# 37 & 37A) - 1953 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
22	9"x9" Tan VFT	2000	SF	Rms:100, 101,102 (Under HA37) - 1953 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
22A	9"x9" Tan VFT Mastic	2000	SF	Rms:100, 101,102 (Under HA37) - 1953 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
23	9"x9" Beige VFT	2000	SF	Rms:100, 101,102 (Under HA37) - 1953 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
23A	9"x9" Beige VFT Mastic	2000	SF	Rms:100, 101,102 (Under HA37) - 1953 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
24	12"x12" Sand VFT	400	SF	1st Fl: NW Locker Rm; 2nd Fl: NW Locker Rm - 1953 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
24A	12"x12" Sand VFT Mastic	400	SF	1st Fl: NW Locker Rm; 2nd Fl: NW Locker Rm - 1953 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
25	12"x12" Tan w/White Spots VFT	1600	SF	Rooms 105 & 206 (under HA#36) - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
25A	12"x12" Tan w/White Spots VFT Mastic	1600	SF	Rooms 105 & 206 (under HA#36) - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
26	12"x12" Sand VFT	4500	SF	1st Fl: Office, Principal's Office (Under HA#41), Principal's office Hall, 2nd Fl: Teacher's Lounge; 1st and 2nd Floor Corridors - 1939 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
26A	12"x12" Sand VFT Mastic	4500	SF	1st Fl: Office, Principal's Office (Under HA#41), Principal's office Hall, 2nd Fl: Teacher's Lounge; 1st and 2nd Floor Corridors - 1939 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
27	12"x12" Tan VFT	800	SF	Room 103 (under HA#36); Vault - 1939 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
27A	12"x12" Tan VFT Mastic	800	SF	Room 103 (under HA#36); Vault - 1939 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
28	12"x12" Brown VFT	800	SF	Room 104 & 206 (Under HA 36); Vault - 1939 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
28A	12"x12" Brown VFT Mastic	800	SF	Rooms 104 & 206 (Under HA 36); Vault - 1939 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
29	12"x12" White VFT	800	SF	Room 104 (under HA#36) - 1939 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
29A	12"x12" White VFT Mastic	800	SF	Room 104 (under HA#36) - 1939 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
30	12"x12" White w/Tan Streaks VFT	550	SF	Room 204 (Under HA#36) - 1939 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
30A	12"x12" White w/Tan Streaks VFT Mastic	550	SF	Room 204 (Under HA36) - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
31	12"x12" Taupe VFT	550	SF	Room 204 (Under HA36) - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
31A	12"x12" Taupe VFT Mastic	550	SF	Room 204 (Under HA36) - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
33	12"x12" Light Brown VFT - ABATED			Room 107 (Under HA37) - 1953 Bldg. ABATED		Miscellaneous					☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
33A	12"x12" Light Brown VFT Mastic - ABATED			Room 107 (Under HA37) - 1953 Bldg. - ABATED							☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
34	12"x12" Dark Brown VFT	550	SF	Room 105 (Under HA36) - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
34A	12"x12" Dark Brown VFT Mastic	550	SF	Room 105 (Under HA36) - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
35	12"x12" Brown VFT - ABATED			Room 107 - 1953 Bldg. ABATED		Miscellaneous					☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
35A	12"x12" Brown VFT Mastic - ABATED			Room 107 - 1939 Bldg. ABATED		Miscellaneous					☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
36	12"x12" Off White w/ Brown Specks VFT	4800	SF	Rooms 103, 104, 105, 203, 204, & 206 - 1939 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
36A	12"x12" Off White w/ Brown Specks VFT Mastic	4800	SF	Rooms 103, 104, 105, 203, 204, & 206 - 1939 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
37	12"x12" Off White w/ Brown Specks VFT	6400	SF	Rooms 100, 101, 102, 108, 200, 201, 202, & 208 - 1953 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
37A	12"x12" Off White w/ Brown Specks VFT Mastic	6400	SF	Rooms 100, 101, 102, 108, 200, 201, 202, & 208 - 1953 Bldg		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
38	12"x12" Grey w/ Specks - ABATED			Room 207 - 1953 - ABATED							☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
38A	12"x12" Grey w/ Specks Mastic - ABATED			Room 207 - 1953 - ABATED							☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
39	Terrazzo	1500	SF	Stairwells 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
40	Drywall, Tape & Compound	200	SF	1st Floor Room 103 1939 - Bldg.		Miscellaneous	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
41	Carpet Mastic	1900	SF	Main Office, Principals Office & Engineers Office, 205 - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
42	12"x12" Dark blue floor tile	800	SF	Room 205 (under HA# 41) - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
42A	12"x12" Dark blue floor tile mastic	800	SF	Room 205 (under HA# 41) - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
49	Fiberglass duct seam tape	1000	LF	Unexcavated space - 1939 Bldg.		TSI	Yes	Loc	100		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
50	Duct insulation between canvas & fiberglass	3000	SF	Unexcavated spaces - 1939 Bldg		TSI	Yes	Loc	300		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
51	12" X 12" light beige with tan streaks VFT	1250	SF	Rm 107, NE Corridor by 107 Gym Storage (1953 Bldg)		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
52	12" X 12" light beige with tan streaks VFT MASTIC	1250	SF	Rm 107, NE Corridor by 107 Gym Storage (1953 Bldg)		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
53	12" X 12" white with gray specks VFT	1200	SF	Rm 207, corridor by 207 (1953 Bldg)		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
54	under 12' X 12" white with gray specks VFT MASTIC	1200	SF	Rm 207, corridor by 207 (1953 Bldg)		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change

Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
A	12"x12" Beige VFT	550	SF	Room 103 (under HA# 36) - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
B	12"x12" Beige VFT Mastic	550	SF	Room 103 (under HA# 36) - 1939 Bldg.		Miscellaneous	No	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
C	MJP E/F/V on Mag Block Pipe Insulation	34	LF	NNE & NE Unexcavated Areas - 1953 Bldg.		TSI	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
D	MJP E/F/V on Aircell Pipe Insulation	31	LF	Unexcavated Area, 1st & 2nd Fl Girl's Toilets, 2nd Fl Boy's Toilet, Eng. Office Attic - 1939 Bldg.		TSI	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
E	Cardboard Pipe Insulation	100	LF	Unexcavated Area - 1939 Bldg.		TSI	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
F	MJP E/F/V on Cardboard Pipe Insulation	12	LF	Unexcavated Area - 1939 Bldg.		TSI	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
G	Fiberglass Duct Seam Tape	1020	LF	Unexcavated Space - 1953 Bldg.		Miscellaneous	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
H	Cardboard Pipe Insulation	100	LF	NNE, NE Unexcavated Areas - 1953 Bldg. Unexcavated Areas - 1939 Bldg.		TSI	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
I	MJP E/F/V on Cardboard Pipe Insulation	10	LF	NNE, NE Unexcavated Areas - 1953 Bldg.		TSI	Yes	None	0		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
J	Fiberglass duct seam tape	1020	SF	Unexcavated areas - 1953 bldg.		TSI	Yes	None	120		☐ YES ☒ NO

2016 - Fall: No Change
Comments:same

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

ALL LEA Responsibilities, for this school, will be met.

A handwritten signature in black ink, appearing to read 'R. Christlieb', written over a horizontal line.

Robert Christlieb

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

NOTICE TO PARENTS AND STAFF REGARDING THE
ASBESTOS MANAGEMENT PLAN NOTIFICATION

School: Edgebrook School

Date: 12/19/2016

This is to notify you in accordance with Illinois and Federal Asbestos Regulations, that a copy of the Asbestos Management Plan is available at each school during school hours by appointment. Requests to review the Asbestos Management Plan must be made at least 24 hours in advance.

Also please be advised that CPS conducts asbestos inspections of all Schools every three years. The last inspection was completed in 2016.
Asbestos surveillances are conducted every six months.

CHECK ONE

- ☐ A copy of this notice was sent home in each child's backpack.
- ☒ A copy of this notice was printed in the school's newsletter and sent home with each child
- ☐ A copy of this notice was printed in the school's calendar and sent home with each child
- ☐ Other.
-

A COPY OF THIS NOTICE MUST BE PLACED IN THE
SCHOOL'S ASBESTOS MANAGEMENT PLAN.

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.