

# Chicago Public Schools

## 6 Month Asbestos Surveillance

Fall 2011

**School** Hancock High School  
**Address** 4034 W. 56th St.

**Oracle Unit** 46021 **Building ID** 1200  
**Region** 5 **General Services Route** 44

*Asbestos Surveyor:* \_\_\_\_\_

*Survey Date:* \_\_\_\_\_

*E-mail Address:* \_\_\_\_\_

**CHECK HERE IF NO CHANGE TO ASBESTOS**

**A copy of the 2011/2012 notice to parents and staff regarding the asbestos management plan notification was distributed via:**

*Each child's backpack*

*Notice printed in school's newsletter/calendar*

*Other* \_\_\_\_\_

**Principal Signature** \_\_\_\_\_

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	<b>Change in Assessment Category</b>	
1	1' x 1' ceiling tile REMOVED	0	SF	music practice rooms	Assumed	MISC	Yes					
<small>3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed in July 2007 by Tecnica Env.</small>												
Condition Not Changed in Fall 2010			SF		Assumed	MISC						
<small>Comments:</small>												
Condition Not Changed in Spring 2011			SF		Assumed	MISC						
<small>Comments:</small>												
<b>Fall 2011</b>											<b>YES</b>	<b>NO</b>
<small>Comment:</small>												

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

Oracle Unit: 46021

Page 1

Please send a copy of this report to Lynn Crivello, 125 S. Clark St., 17th Floor, GSR #125

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
10	12"x12" Gray VFT	900	SF	Original Bldg: Room A434 ( new number Rm. 412, 416)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rm.412											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
100	PLASTER CEILING PATCH	50	SF	CONVENT BASEMENT, STUDENT ACTIVITY ROOM	Assumed	SURFACE	Yes	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed in June 2006 by JVI											
Condition Not Changed in Fall 2010			SF		Assumed	SURFACE				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	SURFACE				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
101	PIPE JOINT COMPOUND	500	LF	CONVENT BASEMENT	Assumed	TSI	Yes	None	0	LF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI											
Condition Not Changed in Fall 2010			LF		Assumed	TSI				LF	
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	TSI				LF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
102	12x12 RED VFT	25	SF	ROOM A423 (new room number 420)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rm.420											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
103	12x12 RED VFT-MASTIC	25	SF	ROOM A423 (new room number 420)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rm.420											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
104	12x12 OFF WHITE VFT	3900	SF	ROOMS 125, A322, A316, 301, 441, 409, 317, 307, A227 (new room numbers 125, 301, 305, 313, 401, East Corridor)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rooms: 125, 301, 305, 313, 401, East Corridor											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
104-M	12x12 OFF WHITE VFT-MASTIC	3900	SF	ROOMS 125, A322, A316, 301, 441, A227 (new room numbers 125, 301, 305, 313, 401, East Corridor)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rooms: 125, 301, 305, 313, 401, East Corridor											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
105	9x9 GREEN & GRAY CHECKERBOARD W/ BLACK BORDER VFT	5700	SF	4TH FLR OF ORIGINAL BLDG, A313, A310, 207, 103 (new room numbers: 121, 207, 125)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rooms: 307, 309, 207, 125											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
105-M	MASTIC FOR HA #105	5700	SF	4TH FLR OF ORIGINAL BLDG, A313, A310, 207, 103 (new room numbers: 121, 207, 125)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rooms: 307, 309, 207, 125											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
107	PURPLE CARPET MASTIC	900	SF	ROOM A152 (new room number 101)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Room 101											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
108	GRAY CARPET MASTIC	6000	SF	ROOMS A141, 155, 144, 146, 148, 147 (new room numbers A141, 101A, 1-7, 105, 103, 109)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rooms: A141, 101A, 1-7, 105, 103, 109											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
109	TAN CARPET MASTIC	1800	SF	ROOMS 114, 121 (new room numbers 110, 115)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rooms: 110, 115											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
11	9"x9" Gray Floor tile	2800	SF	ROOMS: A434 411, 415, 417, 419, 421, 422A, 442, 428, 412, 413, 406, A323, 225, 113, 150 (new room numbers: see inspector's comment)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rooms: 412, 400, 416, 428A, 426C, 415, 300, Jan. closet, 113, 150											
Condition Not Changed in Fall 2010			SF		Assumed	MISC					SF
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC					SF
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
110	12x12 WHITE & BLACK CHECKERBOARD VFT	700	SF	ROOM 119	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Room 123											
Condition Not Changed in Fall 2010			SF		Assumed	MISC					SF
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC					SF
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
111	12x12 WHITE & BLACK CHECKERBOARD VFT-MASTIC	700	SF	ROOM 119	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Room 123											
Condition Not Changed in Fall 2010			SF		Assumed	MISC					SF
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC					SF
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
112	12x12 MARBLE LOOKING TAN VFT	1200	SF	LOBBY OF AUDITORIUM	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
113	12x12 MARBLE LOOKING BLACK VFT	1200	SF	LOBBY OF AUDITORIUM	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
114	MASTIC FOR HA #112 & 113	2400	SF	LOBBY OF AUDITORIUM	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
115	9x9 DARK GREEN VFT	6250	SF	AUDITORIUM FLOOR & WALLS & BALCONY	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
116	9x9 RED VFT	2500	SF	AUDITORIUM FLOOR & WALLS	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
117	MASTIC FOR HA #115 & 116	8750	SF	AUDITORIUM FLOOR & WALLS	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
118	9x9 BROWN & TAN CHECKERBOARD VFT	2500	SF	ROOMS 401, 403, C406, C404, C204, C205 (new rm. 415, corridor and Library work and storage rooms)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in the rm. 415, corridor, Library Rooms (work and book storage)											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
119	9x9 BROWN & TAN CHECKERBOARD VFT-MASTIC	2500	SF	ROOMS 101, C406, C404, C204, C205 (new rm. 415, corridor and Library work and storage rooms)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in the rm. 415, corridor, Library Rooms (work and book storage)											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
12	12x 12 Tan VFT	6000	SF	ROOMS: 420B, 420A, 424, 423, 425, 426, 422A, 422B, 405, 407, 305, 412,413,415,420,432,445,444,405,401,402,403,325,326,327 new rm,numbers - see ins's comments	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rooms: 428A, 426C, 426B, 426A, 414, 406, 444, 417, 423, 421,419, 312 (?), 302A, 302B											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
120	GRAY CARPET MASTIC	900	SF	ROOM C307 (new room 342)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Room 342											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
121	12x12 White w/ Red & Blue Specks FT	800	SF	Convent Basement	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
122	12x12 White w/ Red & Blue Specks FT Mastic	800	SF	Convent Basement	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
123	12x12 Purple FT	200	SF	Convent Basement	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
124	12x12 Purple FT Mastic	200	SF	Convent Basement	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
125	12x12 Light Grey w/ White FT	1500	SF	Room 412, 416	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
126	12x12 Light Grey w/White FT Mastic	1500	SF	Room 412, 416	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
127	Grey Mix Terrazzo	4500	SF	1st, 2nd, 3rd Floor Hallways	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
128	Green Carpet Adhesive	800	SF	Room 310	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
129	Peach Linoleum	3400	SF	Room 302, 308, 313, 315	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
13	9"x9" green VFT	8000	SF	Library entrance,. ROOMS: 411, 416,424,427,430,433,435,312,314,315 ,318 - new room numbers - see inspector's comments	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rooms: 413, 411, 409, corridor, 405, 403, 308, 308A, 308B, 303											
Condition Not Changed in Fall 2010			SF		Assumed	MISC					SF
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC					SF
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
130	Peach Linoleum Adhesive	3400	SF	Rooms 302, 308, 313, 315	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC					SF
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC					SF
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
131	Brown Carpet Adhesive	2000	SF	Offices & Room 109	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC					SF
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC					SF
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
14	Cottage Cheese Sprayed on Material	11600	SF	Annex: basement corridor, 2nd flr. Library, CL10, CL07	Assumed	SURFACE	Yes	None	0	SF	
3YR Inspector Comments: Roof leak caused some material to fall. O&M report dated 02/24/89 & 05/08/89. Student library ceiling painted June 1996. 2007 COMMENTS=no damage found. 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was actually located in basement corridor, Library and Toilet and Boiler Room. Abatement was done by Tecnica env. In July 2007.											
Condition Not Changed in Fall 2010			SF		Assumed	SURFACE				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	SURFACE				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
15	Cove base molding	2000	LF	Annex: Rooms 405,402,104,106,406,404,102,105,305,302,304 - room numbers - see inspector's comments	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material is actually located in Rooms: 417, 421, 140, 142, 415, corridor, 141, 143, 343, 341, 311B											
Condition Not Changed in Fall 2010			LF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
16	Exposed aicell pipe insulation	200	LF	Original Building: Classrms	Assumed	TSI	Yes	None	0	LF	
3YR Inspector Comments: 2007 COMMENTS=material appears to have been abated. None visibly found, but material may still remain behind walls, pipe chases, inaccessible areas, etc. 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was actually removed by JVI in July 2005 2010- Removed from classrooms 133-135, 235-236, 335-336, 435-436, Lab, 313											
Condition Not Changed in Fall 2010			LF		Assumed	TSI				LF	
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	TSI				LF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
17	Trowled on plaster mateial	10000	SF	Annex: Auditorium, Lobby	Assumed	SURFAC E	Yes	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	SURFAC E				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	SURFAC E				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
2	1'x1' Acoustical Wall Tiles	4500	SF	Annex: Corridors, Lobby to auditorium, CL17,CL18,CL20,CL21,CL07,CL10 See ins's comments for changes	Assumed	MISC	Yes	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that room numbers have been changed, check on site for correct material location (such as CL07- Boiler Rm., CL10 - Toilet)											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											<b>YES      NO</b>
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
20	Transite Ceiling Panels	500	SF	Original Building: Gym Storage room	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											<b>YES      NO</b>
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
22	Pipe Joint Compound	1000	LF	Annex: Pipe Tunnel, basement above ceilings	Assumed	TSI	Yes	None	0	LF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			LF		Assumed	TSI					LF
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	TSI					LF
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
23	Mag Block Insulation	1000	LF	Annex: Pipe Tunnel	Assumed	TSI	Yes	Dist	100	LF	
3YR Inspector Comments: 2007 COMMENTS=total damage quantity could not be determined, damage is assumed											
Condition Not Changed in Fall 2010			LF		Assumed	TSI					LF
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	TSI					LF
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
24	Aircell Pipe Insulation	500	LF	Original Building: Pipe Tunnels	Assumed	TSI	Yes	Loc	100	LF	
3YR Inspector Comments: 2007 COMMENTS=material abated from Boiler Room only in 2006, pipe tunnel pipes could not be fully accessed. Damage quantity is unknown for pipe tunnels. 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI in June 2005											
Condition Not Changed in Fall 2010			LF		Assumed	TSI				LF	
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	TSI				LF	
Comments:											
<b>Fall 2011</b>											YES      NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
25	Exposed Aircell	30	LF	Original Building: Boiler rm and Pipe Tunnels	Assumed	TSI	Yes				
3YR Inspector Comments: 2007 COMMENTS=boiler room abated in 2006. could not fully access material in pipe tunnels, damage is assumed. 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI in June 2005. 2010- Boiler Rm - Fiberglass; TSI remains in small crawl/Tunnel adj. to Boiler Room.											
Condition Not Changed in Fall 2010			LF		Assumed	TSI					
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	TSI					
Comments:											
<b>Fall 2011</b>											YES      NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	
26	Pipe Joint Compound	0	LF	Original Building: Boiler Rm	Assumed	TSI	Yes	None	0	LF		
3YR Inspector Comments: 2007 COMMENTS=exposed material abated from boiler room in 2006. Possible that material exist in inaccessible/not visible areas of basement, damage is assumed the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI										2008 - During		
Condition Not Changed in Fall 2010											LF	
Comments:												
Condition Not Changed in Spring 2011											LF	
Comments:												
<b>Fall 2011</b>											YES	NO
Comment:												

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	
27	Mag Block Insulation-removed			Original Building: Boiler Rm: Boiler #1, Boiler #2	Assumed	TSI	Yes					
3YR Inspector Comments: Mag Block Insulation-REMOVED. Foil wrap over fiberglass. 2007 COMMENTS=material has been removed from Boiler #1 & #2, boilers now have fiberglass insulation covered in foil wrap. During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI in June 2005										2008 -		
Condition Not Changed in Fall 2010												
Comments:												
Condition Not Changed in Spring 2011												
Comments:												
<b>Fall 2011</b>											YES	NO
Comment:												

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
29	Mag Block Insulation	1000	LF	Original Building: Boiler Rm & ADJACENT RMS IN BASEMENT, tunnels to boiler	Assumed	TSI	Yes	Dist	30	LF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI in June 2005 2010- Fiberglass in boiler room/ Tunnels. TSI remains in tunnel - damaged around pipe hangers. (adj. to boiler Rm)											
Condition Not Changed in Fall 2010			LF		Assumed	TSI				LF	
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	TSI				LF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
3	1'x1' Solid Act Ceiling Tile	1000	SF	Rooms 307,309 (above new drop ceiling)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
30	Boiler Breeching Material	0		Original Building: Boiler Rm in basement	Assumed	TSI	Yes				
3YR Inspector Comments: 2007 COMMENTS=material abated 04/06. 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI											
Condition Not Changed in Fall 2010					Assumed	TSI					
Comments:											
Condition Not Changed in Spring 2011					Assumed	TSI					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
31	Mag Block Insulation	0	SF	Original Building: Boiler Rm: Oil Preheater	Assumed	TSI	Yes				
3YR Inspector Comments: 2007 COMMENTS=material abated 04/06. 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI											
Condition Not Changed in Fall 2010			SF		Assumed	TSI					
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	TSI					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
32	Gasket Material	0	LF	Original Building: Boiler Rm:	Assumed	TSI	Yes				
3YR Inspector Comments: 2007 COMMENTS=material abated 04/06. 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI											
Condition Not Changed in Fall 2010			LF		Assumed	TSI					
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	TSI					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
33	Chiller Pump piping	0	LF	Annex: Pump Rm Basement	Assumed	TSI	Yes				
3YR Inspector Comments: 2007 COMMENTS=all exposed/visible material has been removed. Date unknown.											
Condition Not Changed in Fall 2010			LF		Assumed	TSI					
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	TSI					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
34	Heat Pump insulation	0		Annx: Basement pump room	Assumed	TSI	Yes				
3YR Inspector Comments: 2007 COMMENTS=all exposed/visible material has been removed. Date unknown.											
Condition Not Changed in Fall 2010					Assumed	TSI					
Comments:											
Condition Not Changed in Spring 2011					Assumed	TSI					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
35	Pipe joint compound	0		Annex: Pump Room basement	Assumed	TSI	Yes				
3YR Inspector Comments: 2007 COMMENTS=all exposed/visible material has been removed. Date unknown. 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by Tecnica in June 2007											
Condition Not Changed in Fall 2010					Assumed	TSI					
Comments:											
Condition Not Changed in Spring 2011					Assumed	TSI					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
36	Aircell Pipe Insulation	1500	LF	Convent: basement	Assumed	TSI	Yes	Loc	10	LF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI in June of 2006											
Condition Not Changed in Fall 2010			LF		Assumed	TSI				LF	
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	TSI				LF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
37	Cold Water Reservoir Tank Insulation	250	SF	Convent: Pump/Tank Storage Rm	Assumed	TSI	Yes	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	TSI				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	TSI				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
38	Insulation on Cold Water Circulation Pumps	0	LF	Convent: Pump/Tank Storage Rm	Assumed	TSI	Yes		0		
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			LF		Assumed	TSI					
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	TSI					
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
39	Plaster	5000	SF	Convent: Student Cafeteria	Assumed	SURFACE	Yes	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI in August 2006											
Condition Not Changed in Fall 2010			SF		Assumed	SURFACE				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	SURFACE				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
4	1'x1' Holed Act.	5000	SF	Original Building 1st, 2nd,3rd,4th floor & corridor (above new tile)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
40	Cottage Cheese Sprayed on Material, acoustical ceiling	0	SF	Convent: Student Cafeteria	Assumed	SURFACE	Yes				
3YR Inspector Comments: 2007 COMMENTS=material abated in 2006, exact date unknown.											
Condition Not Changed in Fall 2010			SF		Assumed	SURFACE					
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	SURFACE					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
41	9x9 Red Vft	0		Convent: Student Actviity Rm, Basement, Balcony	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material abated 2006, exact date unknown 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI in June of 2006											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
42	cove base molding	0		Convent: Student Activity Rm, Basement	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material abated, exact date unknown 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI in June of 2006											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
43	Exposed Aircell	0		Convent: student activity Rm basement.	Assumed	TSI	Yes				
3YR Inspector Comments: 2007 COMMENTS=material abated exact date unknwn. Possible that material exists behind walls, pipe chases, etc (non visible areas). 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI in June of 2006											
Condition Not Changed in Fall 2010					Assumed	TSI					
Comments:											
Condition Not Changed in Spring 2011					Assumed	TSI					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
44	Chemical Flow Hood-ABATED	0		Original Building: Science Rm	Assumed	MISC	No				
3YR Inspector Comments: Could not find-removed. 2007 COMMENTS=material not found, possible that it was removed previously.											
Condition Changed in Fall 2010					Assumed	MISC					
Comments: Hood Removed During ADA Project July of 2009											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
45	Fire Curtain, baby blue	3500	SF	Annex: Auditorium	Assumed	MISC	Yes	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
46	Asbestos Oven	0		Original Building: Science Room	Assumed	MISC	No				
3YR Inspector Comments: Could Not Find-Removed. 2007 COMMENTS=material not found, possibly abated previously. 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed approx. in 2004											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
47	Fire Brick	0		Original Building: Art Rm Kiln	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not found, possibly abated, no record of removal.											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
48	9"x9" White w/ Green Floor Tile	0	SF	Annex:	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material doesn't exist											
Condition Not Changed in Fall 2010			SF		Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
5	1x1 Metal Pan Act.	0	SF	Faculty Lounge, Faculty lounge	Assumed	MISC	Yes				
3YR Inspector Comments: 2007 COMMENTS=material removed, date unknown.											
Condition Not Changed in Fall 2010			SF		Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
50	9"x9" Tan w/ Red & White: Floor Tile	0		Annex: Library	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material does not exist											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
51	9"x9" Brown w/ Tan: Floor tile	2000	SF	Annex: Library	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that 100 s.f. of this material was removed in June of 2007											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
53	9x9 Green, Tan, Black & orange: Floor	400	SF	Annex: corridor to convent, rooms A413, 318 (new room numbers: 426C, 303, corridor to convent)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was actually located in rooms 426C, 303 corridor to convent											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
54	9"x9" light Green: Floor	8300	SF	Original Building: Rooms A426,317,202,204,223,203,205,224,228,222 - new rm numbers - see ins's com-s	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was actually located in rooms: 418, 306, 218, 216, 208, 213, 209, 203, 201, 205											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
55	12"x12" tan with Black & White: Floor Tile	200	SF	Original Building; Corridors to Annex on 3rd floor	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
56	12"x12" Brown tan w/dark & white streaks VFT	50	SF	Original Building: Corridor leading to library, 2nd floor	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
57	5"x5" swirl pattern Floor tile: blue	0	SF	Original Building: Parenta Supervisor's teachers Lounge	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed. 2010- Not identified											
Condition Not Changed in Fall 2010			SF		Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
58	5"x5" Gold & Brown Tile: Floor Tile	0	SF	Original Building: teachers. Lounge	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed. 2010-not identified											
Condition Not Changed in Fall 2010			SF		Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
6	1'x1' Ceiling Tile: pocked Act.	600	SF	Original Building: Ground Floor Lobby, south entrance.	Assumed	MISC	Yes	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
60	Lab Table Tops	150	SF	Original Building: Science Room 312 (new room 308)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was actually located in room 308											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
62	9"x9" Green swirl Vft.	3000	SF	Convent: Student Cafeteria, rm 306, 211, 208, 205, 204, 203, 201	Assumed	MISC	No	Loc	10	SF	
3YR Inspector Comments: 2010- 10SF damaged in rm 208											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
63	9"x9" Tan swirl VFT.	3000	SF	Convent: Student Cafeteria	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
64	12"x12" Gray and White Vft	500	SF	Original Building: Cafeteria Snack Bar	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
65	Mastic for HA #8 Floor Tile	15500	SF	Annex: Halls & Rm's 102,105,104,106,302,305,304,405,402 .auditorium ramps & stairwells	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
66	9x9 green w/white vft MASTIC FOR HA #9	5280	SF	Annex: stairwells, 1st, 2nd, 3rd, 4th flr corridors, auditorium stairwells	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
67	Mastic for HA #13	8000	SF	ROOMS: 416,424,427,430,433,435,312,314,315,318	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
68	Mastic for HA #10	900	SF	Original Bldg: Room A434 (new room number 412)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was actually located in room 412											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
69	Mastic for HA #11	2800	SF	ROOMS: A434, 442, 428, 412, 413, 406, A323, 225, 113, 150 (see new rm. numbers in comments)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was actually located in rooms: 412, 400, 416, 428A, 426, 415, 300, Jan.closet, 113, 150											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

Oracle Unit: 46021

Page 36

Please send a copy of this report to Lynn Crivello, 125 S. Clark St., 17th Floor, GSR #125

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
7	2x4 Ceiling Tile	900	SF	2nd floor Workout room above gym offices, library	Assumed	MISC	Yes	None	0	SF	
3YR Inspector Comments: 2007 COMMENTS=room was not accessible at time of inspection, therefore condition of material could not be assessed.											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
70	Mastic for HA #12 Floor Tile	6000	SF	ROOMS: 412,413,415,420,432,445,444,405,401 ,402,403,325,326,327 (see new rm.numbers in insp comments)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was actually located in rooms: 428A, 426C, 426B, 426A, 414, 406, 417, 423, 421, 419, 302, 302A, 302B											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
71	9x9 red vft mastic	0		Convent: Basement activity room	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material abated 2006, exact date unknown 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was removed by JVI in June 2006											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
72	9x9 Mastic for Type d Floor Tile	0		Annex: Storage Rm	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed.											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
73	Mastic for Type E Floor Tile	0		Annex: Natural Gas main	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed.											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
74	Mastic for Type F Floor Tile	0		Annex: Student Library	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed.											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
75	Mastic for Type G Floor Tile	0		Annex: Student Library	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed.											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
76	Mastic for Type H Floor Tile	0		Annex: Classroom	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed.											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
77	Mastic for Type M Floor Tile	0		Original Building: Classroom	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed.											
Condition Changed in Fall 2010					Assumed	MISC					
Comments: Floor Tile was Removed in Rooms 308, 309, and 311 During ADA Project July of 2009											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
78	Mastic for Type N Floor Tile	0		Original Building: Classroom	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed.											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
79	Mortar for terrazzo	4000	SF	Original Building: corridor	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
8	9"x9" Grey w/White Streaks Floor Tile	15500	SF	Annex: Halls & Rm's 102,105,104,106,302,305,304,405,402, .406,304,400,304,303,301,102, 101,104,103, auditorium ramps & stairwells	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
80	Mastic for Type P Floor Tile	0		Original Building: Hallway	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
81	5x5 blue swirl pattern vft mastic	150	SF	Original Building: Non Smoking Faculty Lounge	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed 2010- Not identified											
Condition Not Changed in Fall 2010			SF		Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
82	5x5 gold/brown vft mastic	400	SF	Original Building: Non Smoking Faculty Lounge	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2007 COMMENTS=material not observed											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
83	Mastic for Type S Floor Tile	0		Original Building: Gym Offices/Locker Rm	Assumed	MISC	No				
3YR Inspector Comments: 2007 COMMENTS=material not observed											
Condition Not Changed in Fall 2010					Assumed	MISC					
Comments:											
Condition Not Changed in Spring 2011					Assumed	MISC					
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
84	Green swirl vft mastic	3000	SF	Convent: Student Cafeteria	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
85	Tan swirl vft mastic	3000	SF	Convent: Student Cafeteria	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
86	12x 12 gray & white vft mastic	500	SF	Original Building: Cafeteria Snack Bar	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
87	Mastic for Type A Cove Base Molding	0	LF	Original Building and Annex: Classrms and Corridors	Assumed	MISC	No	None	0	LF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			LF		Assumed	MISC				LF	
Comments:											
Condition Not Changed in Spring 2011			LF		Assumed	MISC				LF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
89	12"x12" Brown tan w/dark & white streaks VFT-MASTIC	50	SF	Original Building: Corridor leading to library, 2nd floor	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
9	9"x9" Green w/White Floor Tile	5280	SF	Annex: stairwells, 1st, 2nd, 3rd, 4th flr corridors, auditorium stairwells	Assumed	MISC	No	Loc	30	SF	
3YR Inspector Comments: 2010- 30 SF Damaged 4th Floor Hall											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
90	12x12 tan speckled Vft.	1000	SF	2nd flr. Corridor leading to library, rm 209	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: New Material.											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
91	12x12 tan speckled Vft mastic	90	SF	2nd flr corridor leading to library	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: New Material.											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
92	9x9m brown w/white & red streaks Vft	100	SF	original bldg. Cafeteria snack bar.	Assumed	MISC	Yes	None	0	SF	
3YR Inspector Comments: New Material.											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
93	9x9m brown w/white & red streaks Vft mastic	100	SF	original bldg. Cafeteria snack bar.	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: New Material.											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
94	12x12 BLACK W/ WHITE STREAKS VFT	100	SF	ROOM 106B (new room 142)	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was actually located in rm. 142											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
95	12x12 BLACK W/ WHITE STREAKS VFT-MASTIC	100	SF	ROOM 106B	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
96	12x12 GRAYISH GREEN VFT	2500	SF	ANNEX: BASEMENT, DRESSING ROOM, CL07, RM 210	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments: 2008 - During the 11/20/07 audit visit inspector was informed by the Engineer that this material was not present in Rm. CL07 - boiler room											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
97	12x12 GRAYISH GREEN VFT-MASTIC	2500	SF	ANNEX: BASEMENT, DRESSING ROOM, CL07, RM 210	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
<b>Comment:</b>											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
98	12x12 BLUE VFT	2500	SF	ANNEX: BASEMENT UNDER AUDITORIUM	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
99	12x12 BLUE VFT-MASTIC	2500	SF	ANNEX: BASEMENT UNDER AUDITORIUM	Assumed	MISC	No	None	0	SF	
3YR Inspector Comments:											
Condition Not Changed in Fall 2010			SF		Assumed	MISC				SF	
Comments:											
Condition Not Changed in Spring 2011			SF		Assumed	MISC				SF	
Comments:											
<b>Fall 2011</b>											YES NO
Comment:											

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

*All LEA Responsibilities, for this school, will be met.*

  
\_\_\_\_\_

*Lynn A. Crivello*

**VFT = Vinyl Floor Tile**

**Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.**

Oracle Unit: 46021

Page 49

**Please send a copy of this report to Lynn Crivello, 125 S. Clark St., 17th Floor, GSR #125**

**NOTICE TO PARENTS AND STAFF REGARDING THE  
ASBESTOS MANAGEMENT PLAN NOTIFICATION**

School: \_\_\_\_\_

Date: \_\_\_\_\_

\_\_\_\_\_

This is to notify you in accordance with Illinois and Federal Asbestos Regulations, that a copy of the Asbestos Management Plan is available at each school during school hours by appointment. Requests to review the Asbestos Management Plan must be made at least 24 hours in advance.

Also please be advised that CPS conducts asbestos inspections of all schools every three years. The last inspection was completed in 2010. Asbestos surveillances are conducted every six months.

CHECK ONE

- A copy of this notice was sent home in each child's backpack.
- A copy of this notice was printed in the school's newsletter or calendar and sent home with each child.
- Other – Please indicate how this notice was delivered to parents and staff.

\_\_\_\_\_

**A COPY OF THIS NOTICE MUST BE PLACED IN THE  
SCHOOL'S ASBESTOS MANAGEMENT PLAN.**

*VFT = Vinyl Floor Tile*

*Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.*