

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2182
SCHOOL NAME: Ebinger School
ADDRESS OF SCHOOL: 7350 W Pratt Avenue
CITY: Chicago, IL, 60631

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 2/21/2013

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 5/23/2016 ENROLLMENT 798
IDPH INSPECTOR LICENSE NUMBER: 100-11089
IDPH LICENSED INSPECTOR NAME (Please Print): Panfilo Carrazco
IDPH MP LICENSE NUMBER: 100-01786
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Guillermo Garcia

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



5/23/2016

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Ebinger School

7350 W Pratt Avenue
Chicago, IL, 60631

Unit: 23051
Building ID: 3150

IDPH ID Number: 14-016-2990-2182

REPORT DATE:

Monday, May 23, 2016

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone (312) 733-6262

Fax (312) 733-5612

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

February 23, 2016

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

GSG Consultants, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1,2,6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 23051 Region: 01 IDPH ID: 14-016-2990-2182

School: Ebinger School Building ID: 3150

Address: 7350 W Pratt Avenue
Chicago, IL, 60631

Building Contact: Clancy, June Contact Phone: 773-330-3661

Current Building Owners: Chicago Public Schools

Review Date: 05/20/2016

Inspector: Panfilo Carrazco Inspector IDPH License: 100-11089
Management Planner: Guillermo Garcia Management Planner IDPH License: 100-01786

If you have any questions or comments, please contact us at (312) 733-6262

Sincerely,
GSG Consultants, Inc.



Guillermo Garcia
100-01786

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: February 23, 2016

RE: Ebinger School, Unit 23051
7350 W Pratt Avenue
Chicago, IL, 60631

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Ebinger School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Ebinger School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Ebinger School
Address: 7350 W Pratt Avenue
IDPH ID: 14-016-2990-2182
Contact: Clancy, June

Unit: 23051
Chicago, IL, 60631
Building ID: 3150
Phone: 773-330-3661

Region: 01

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: 4900 No of Floors: 1
Current Occupancy: 798

3. LEA Designated Person

Contact: Robert Christlieb
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603

Phone: (773) 553-3197

4. Managing Environmental Consultant


MEC: GSG Consultants, Inc.
Contact: Arturo Saenz
Address 855 W. Adams St., Ste. 200
Phone: (312) 733-6262

Fax: (312) 733-5612

5. Inspector

Inspector Name: Panfilo Carrazco


Inspector IDPH license # 100-11089

Signature: 
Date: 2/23/2016

6. Management Planner

Management Planner Name: Guillermo Garcia

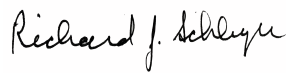
Management Planner IDPH license # 100-01786

Signature: 
Date: 05/20/2016

7. Review Date: 05/20/2016

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 5/23/2016

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

GSG Consultants, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Ebinger School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3150:

B. The following new homogenous areas have been identified for Building 3150:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

10	2'X2' White Ceiling Tiles
11	Linoleum Flooring
11A	Linoleum Flooring Mastic
12	Pink Linoleum Flooring
12A	Pink Linoleum Flooring Mastic
13	Blue Linoleum Flooring
13A	Blue Linoleum Flooring Mastic
14	Drywall and Joint Compound
15	12"x12" Dark Blue VFT
16	12"x12" Dark Blue Mastic
17	12"x12" Light blue w/white, red and blue speckles VFT
18	12"x12" Light blue w/white, red and blue speckles Mastic
19	12"x12" Blue w/black and white speckles VFT
20	12"x12" Blue w/black and white speckles Mastic
21	12"x12" Sand VFT
22	12"x12" Sand Mastic
23	12"x12" Tan VFT
24	12"x12" Tan Mastic
25	12"x12" White w/ gray speckles VFT
26	12"x12" White w/gray speckles Mastic
27	12"x12" Gray w/black and white streaks VFT
28	12"x12" Gray w/black and white streaks Mastic
29	Blown-In Insulation on Duct Work
2B	12"x12" Gray w/ Beige Streaks VFT
2C	12"x12" White VFT
2D	12"x12" Tan w/ White Spots VFT
2E	12"x12" White w/ Gray Streaks VFT
3C	12"x12" White VFT Mastic
3D	12"x12" Tan w/ White Spots VFT Mastic
6	Terrazzo Flooring
7	Textured Plaster
9	12"X12" White w/Specks VFT
9A	12"X12" White w/Specks VFT Mastic

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Panfilo Carrazco, IDPH License # 100-11089. The Management Plan was updated by Guillermo Garcia, IDPH License # 100-01786. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Ebinger School Building 3150 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Ebinger School Unit 23051 Building ID 3150

Address 7350 W Pratt Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
04	Exterior Caulk			Exterior Windows	NO_ACBM						No			
05	Interior Caulk			Interior Windows	NO_ACBM						No			
10	2'X2' White Ceiling Tiles	5,000	SF	Throughout Mobile Units A and B	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
11	Linoleum Flooring	400	SF	Boys and Girls Toilets, Mobile Unit B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11A	Linoleum Flooring Mastic	400	SF	Boys and Girls Toilets, Mobile Unit B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	Pink Linoleum Flooring	200	SF	Womens Toilet, Mobile Unit A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12A	Pink Linoleum Flooring Mastic	200	SF	Womens Toilet, Mobile Unit A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	Blue Linoleum Flooring	200	SF	Men's Toilet, Mobile Unit A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13A	Blue Linoleum Flooring Mastic	200	SF	Men's Toilet, Mobile Unit A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	Drywall and Joint Compound	5,000	SF	Throughout Mobile Units A and B	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
15	12"x12" Dark Blue VFT	600	SF	Assembly Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
16	12"x12" Dark Blue Mastic	600	SF	Assembly Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	12"x12" Light blue w/white, red and blue speckles VFT	600	SF	Assembly Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
18	12"x12" Light blue w/white, red and blue speckles Mastic	600	SF	Assembly Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12"x12" Blue w/black and white speckles VFT	24	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
20	12"x12" Blue w/black and white speckles Mastic	24	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12"x12" Sand VFT	24	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
22	12"x12" Sand Mastic	24	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	12"x12" Tan VFT	25	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
24	12"x12" Tan Mastic	25	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12"x12" White w/ gray speckles VFT	24	SF	Engineer's Office Toilet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
26	12"x12" White w/gray speckles Mastic	24	SF	Engineer's Office Toilet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Ebinger School Unit 23051 Building ID 3150

Address 7350 W Pratt Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
27	12"x12" Gray w/black and white streaks VFT	12	SF	Engineer's Office Toilet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
28	12"x12" Gray w/black and white streaks Mastic	12	SF	Engineer's Office Toilet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	Blown-In Insulation on Duct Work	2,500	SF	Attic	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
2A	12"x12" White w/ Beige Streaks VFT	850	SF	Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
2B	12"x12" Gray w/ Beige Streaks VFT	850	SF	Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
2C	12"x12" White VFT	600	SF	Faculty Lounge (1st floor)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
2D	12"x12" Tan w/ White Spots VFT	800	SF	Kitchen (Room 100)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
2E	12"x12" White w/ Gray Streaks VFT	7,500	SF	1st and 2nd Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
3A	12"x12" White w/ Beige Streaks VFT Mastic	850	SF	Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
3B	12"x12" Gray w/ Beige Streaks VFT Mastic	850	SF	Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
3C	12"x12" White VFT Mastic	600	SF	Faculty Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
3D	12"x12" Tan w/ White Spots VFT Mastic	800	SF	Kitchen (Room 100)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
3E	12"x12" White w/ Gray Streaks VFT Mastic	7,500	SF	1st & 2nd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
6	Terrazzo Flooring	5,000	SF	All Stairwells, 2nd Floor Corridors Around Boarders, 1st Floor Corridors Around Boarders, Stage Stairs,	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Ebinger School Unit 23051 Building ID 3150

Address 7350 W Pratt Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Assembly Hall Stairs and Vestibule, Room 200										
7	Textured Plaster	2,000	SF	Stage Walls	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		LOW
8	Carpet Mastic - Removed 12/2010			Assembly Hall - Removed 12/2010	ABATED	MISC		None						Low
9	12"X12" White w/Specks VFT	5,000	SF	Throughout Mobile Units A and B, Except Boys and Girls Toilets	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
9A	12"X12" White w/Specks VFT Mastic	5,000	SF	Throughout Mobile Units A and B, Except Boys and Girls Toilets	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A	Mag Block Tank Insulation (Two)	250	SF	Boiler Room	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
B	Mag Block Condensation Tank Insulation	125	SF	Boiler Room	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
E	Aircell Pipe Insulation	40	LF	Unex. Spaces, Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
F	MJP E/F/V on Aircell Pipe Insulation	30	LF	Unex. Spaces, Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
G	Aircell Duct Wrap Insulation	800	SF	East and Main Unexcavated Crawl Space	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
H	Cardboard Pipe Insulation	100	LF	Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
I	MJP E/F/V on Cardboard Pipe Insulation	45	LF	Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
J	Mag Pipe Insulation	60	LF	Basement S. Center	CHR	TSI	Y	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Ebinger School Unit 23051 Building ID 3150

Address 7350 W Pratt Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Hall, Boiler Room & Tunnel, NE & NW Corners Of Basement								potential for damage		
K	MJP E/F/V on Mag Pipe Insulation	20	LF	Basement S. Center Hall, Boiler Room & Tunnel, NE & NW Corners Of Basement	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
L	MJP E/F/V on Fiberglass Pipe Insulation			Throughout	NO_ACBM	TSI	Y							

Chicago Public Schools

School Ebinger School Unit 23051 Building ID 3150

Address 7350 W Pratt Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

Reinspection Date <u>2/23/2016</u>
Inspector Name <u>Panfilo Carrazco</u>
<u>100-11089</u> <u>2/13/2017</u>
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
04	
05	
10	
11	
11A	
12	
12A	
13	
13A	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	

Chicago Public Schools

School Ebinger School Unit 23051 Building ID 3150

Address 7350 W Pratt Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
29	
2A	
2B	
2C	
2D	
2E	
3A	
3B	
3C	
3D	
3E	
6	
7	
8	
9	
9A	
A	
B	
E	
F	
G	
H	
I	
J	
K	
L	

Chicago Public Schools

School Ebinger School **Unit** 23051 **Building ID** 3150

Address 7350 W Pratt Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School Ebinger School
Address 7350 W Pratt Avenue

Unit 23051
Chicago, IL, 60631

Building ID 3150
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
04	Exterior Caulk			Exterior Windows	No ACBM						
05	Interior Caulk			Interior Windows	No ACBM						
10	2'X2' White Ceiling Tiles	5,000	SF	Throughout Mobile Units A and B	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	Linoleum Flooring	400	SF	Boys and Girls Toilets, Mobile Unit B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11A	Linoleum Flooring Mastic	400	SF	Boys and Girls Toilets, Mobile Unit B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	Pink Linoleum Flooring	200	SF	Womens Toilet, Mobile Unit A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12A	Pink Linoleum Flooring Mastic	200	SF	Womens Toilet, Mobile Unit A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	Blue Linoleum Flooring	200	SF	Men's Toilet, Mobile Unit A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13A	Blue Linoleum Flooring Mastic	200	SF	Men's Toilet, Mobile Unit A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	Drywall and Joint Compound	5,000	SF	Throughout Mobile Units A and B	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12"x12" Dark Blue VFT	600	SF	Assembly Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	12"x12" Dark Blue Mastic	600	SF	Assembly Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	12"x12" Light blue w/white, red and blue speckles VFT	600	SF	Assembly Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12"x12" Light blue w/white, red and blue speckles Mastic	600	SF	Assembly Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12"x12" Blue w/black and white speckles VFT	24	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12"x12" Blue w/black and white speckles Mastic	24	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12"x12" Sand VFT	24	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12"x12" Sand Mastic	24	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12"x12" Tan VFT	25	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12"x12" Tan Mastic	25	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12"x12" White w/ gray speckles VFT	24	SF	Engineer's Office Toilet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12"x12" White w/gray speckles Mastic	24	SF	Engineer's Office Toilet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12"x12" Gray w/black and white streaks VFT	12	SF	Engineer's Office Toilet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	12"x12" Gray w/black and white streaks Mastic	12	SF	Engineer's Office Toilet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	Blown-In Insulation on Duct Work	2,500	SF	Attic	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2A	12"x12" White w/ Beige Streaks VFT	850	SF	Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2B	12"x12" Gray w/ Beige Streaks VFT	850	SF	Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2C	12"x12" White VFT	600	SF	Faculty Lounge (1st floor)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2D	12"x12" Tan w/ White Spots VFT	800	SF	Kitchen (Room 100)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
2E	12"x12" White w/ Gray Streaks VFT	7,500	SF	1st and 2nd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3A	12"x12" White w/ Beige Streaks VFT Mastic	850	SF	Kitchen Under Existing VFT (Room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Ebinger School
Address 7350 W Pratt Avenue

Unit 23051
Chicago, IL, 60631

Building ID 3150
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				100), Lunchroom (Room 101 & 103)							
3B	12"x12" Gray w/ Beige Streaks VFT Mastic	850	SF	Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3C	12"x12" White VFT Mastic	600	SF	Faculty Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3D	12"x12" Tan w/ White Spots VFT Mastic	800	SF	Kitchen (Room 100)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3E	12"x12" White w/ Gray Streaks VFT Mastic	7,500	SF	1st & 2nd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
6	Terrazzo Flooring	5,000	SF	All Stairwells, 2nd Floor Corridors Around Boarders, 1st Floor Corridors Around Boarders, Stage Stairs, Assembly Hall Stairs and Vestibule, Room 200	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
7	Textured Plaster	2,000	SF	Stage Walls	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8	Carpet Mastic - Removed 12/2010			Assembly Hall - Removed 12/2010	Abated	MISC					
9	12"X12" White w/Specks VFT	5,000	SF	Throughout Mobile Units A and B, Except Boys and Girls Toilets	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
9A	12"X12" White w/Specks VFT Mastic	5,000	SF	Throughout Mobile Units A and B, Except Boys and Girls Toilets	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Mag Block Tank Insulation (Two)	250	SF	Boiler Room	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
B	Mag Block Condensation Tank Insulation	125	SF	Boiler Room	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
E	Aircell Pipe Insulation	40	LF	Unex. Spaces, Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
F	MJP E/F/V on Aircell Pipe Insulation	30	LF	Unex. Spaces, Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
G	Aircell Duct Wrap Insulation	800	SF	East and Main Unexcavated Crawl Space	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
H	Cardboard Pipe Insulation	100	LF	Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
I	MJP E/F/V on Cardboard Pipe Insulation	45	LF	Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
J	Mag Pipe Insulation	60	LF	Basement S. Center Hall, Boiler Room & Tunnel, NE & NW Corners Of Basement	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Ebinger School
Address 7350 W Pratt Avenue

Unit 23051
 Chicago, IL, 60631

Building ID 3150
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
K	MJP E/F/V on Mag Pipe Insulation	20	LF	Basement S. Center Hall, Boiler Room & Tunnel, NE & NW Corners Of Basement	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
L	MJP E/F/V on Fiberglass Pipe Insulation			Throughout	No ACBM	TSI	Yes				

Review Date 5/20/2016

HA Number	Management Comments
-----------	---------------------

Chicago Public Schools

School Ebinger School
Address 7350 W Pratt Avenue

Unit 23051
 Chicago, IL, 60631

Building ID 3150
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

Manager Planner Name	Guillermo Garcia
100-01786	3/21/2017
Manager IDPH License No/Expiration	

HA Number	Management Comments
04	
05	
10	
11	
11A	
12	
12A	
13	
13A	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
2A	
2B	

Chicago Public Schools

School Ebinger School
Address 7350 W Pratt Avenue

Unit 23051
 Chicago, IL, 60631

Building ID 3150
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
2C	
2D	
2E	
3A	
3B	
3C	
3D	
3E	
6	
7	
8	
9	
9A	
A	
B	
E	
F	
G	
H	
I	
J	
K	
L	

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **Exterior Caulk**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior Windows**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/23/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **04**

MATERIAL DESCRIPTION: **Exterior Caulk**

MATERIAL LOCATION: **Exterior Windows**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **Interior Caulk**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Interior Windows**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/23/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **05**

MATERIAL DESCRIPTION: **Interior Caulk**

MATERIAL LOCATION: **Interior Windows**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **2'X2' White Ceiling Tiles**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Mobile Units A and B**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **2'X2' White Ceiling Tiles**
MATERIAL LOCATION: **Throughout Mobile Units A and B**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Linoleum Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boys and Girls Toilets, Mobile Unit B**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Linoleum Flooring**
MATERIAL LOCATION: **Boys and Girls Toilets, Mobile Unit B**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11A**
MATERIAL DESCRIPTION: **Linoleum Flooring Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boys and Girls Toilets, Mobile Unit B**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **11A**
MATERIAL DESCRIPTION: **Linoleum Flooring Mastic**
MATERIAL LOCATION: **Boys and Girls Toilets, Mobile Unit B**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Pink Linoleum Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Womens Toilet, Mobile Unit A**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Pink Linoleum Flooring**
MATERIAL LOCATION: **Womens Toilet, Mobile Unit A**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12A**
MATERIAL DESCRIPTION: **Pink Linoleum Flooring Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Womens Toilet, Mobile Unit A**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **12A**
MATERIAL DESCRIPTION: **Pink Linoleum Flooring Mastic**
MATERIAL LOCATION: **Womens Toilet, Mobile Unit A**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Blue Linoleum Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Men's Toilet, Mobile Unit A**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Blue Linoleum Flooring**
MATERIAL LOCATION: **Men's Toilet, Mobile Unit A**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13A**
MATERIAL DESCRIPTION: **Blue Linoleum Flooring Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Men's Toilet, Mobile Unit A**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **13A**
MATERIAL DESCRIPTION: **Blue Linoleum Flooring Mastic**
MATERIAL LOCATION: **Men's Toilet, Mobile Unit A**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Drywall and Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Mobile Units A and B**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Drywall and Joint Compound**
MATERIAL LOCATION: **Throughout Mobile Units A and B**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" Dark Blue VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" Dark Blue VFT**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Dark Blue Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Dark Blue Mastic**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12"x12" Light blue w/white, red and blue speckles VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Assembly Hall**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12"x12" Light blue w/white, red and blue speckles VFT**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"x12" Light blue w/white, red and blue speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"x12" Light blue w/white, red and blue speckles Mastic**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12"x12" Blue w/black and white speckles VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY: **24**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12"x12" Blue w/black and white speckles VFT**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12"x12" Blue w/black and white speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12"x12" Blue w/black and white speckles Mastic**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12"x12" Sand VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY: **24**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12"x12" Sand VFT**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12"x12" Sand Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12"x12" Sand Mastic**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12"x12" Tan VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY: **25**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12"x12" Tan VFT**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12"x12" Tan Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12"x12" Tan Mastic**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" White w/ gray speckles VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Engineer's Office Toilet**

MATERIAL QUANTITY: **24**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" White w/ gray speckles VFT**
MATERIAL LOCATION: **Engineer's Office Toilet**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12"x12" White w/gray speckles Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office Toilet**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12"x12" White w/gray speckles Mastic**
MATERIAL LOCATION: **Engineer's Office Toilet**
MATERIAL QUANTITY: **24** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12"x12" Gray w/black and white streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Engineer's Office Toilet**

MATERIAL QUANTITY: **12**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12"x12" Gray w/black and white streaks VFT**
MATERIAL LOCATION: **Engineer's Office Toilet**
MATERIAL QUANTITY: **12** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12"x12" Gray w/black and white streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office Toilet**
MATERIAL QUANTITY: **12** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12"x12" Gray w/black and white streaks Mastic**
MATERIAL LOCATION: **Engineer's Office Toilet**
MATERIAL QUANTITY: **12** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Blown-In Insulation on Duct Work**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Attic**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Blown-In Insulation on Duct Work**
MATERIAL LOCATION: **Attic**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2A**
MATERIAL DESCRIPTION: **12"x12" White w/ Beige Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **2A**
MATERIAL DESCRIPTION: **12"x12" White w/ Beige Streaks VFT**
MATERIAL LOCATION: **Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2B**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Beige Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **2B**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Beige Streaks VFT**
MATERIAL LOCATION: **Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2C**
MATERIAL DESCRIPTION: **12"x12" White VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Faculty Lounge (1st floor)**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **2C**
MATERIAL DESCRIPTION: **12"x12" White VFT**
MATERIAL LOCATION: **Faculty Lounge (1st floor)**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2D**
MATERIAL DESCRIPTION: **12"x12" Tan w/ White Spots VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Kitchen (Room 100)**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **2D**
MATERIAL DESCRIPTION: **12"x12" Tan w/ White Spots VFT**
MATERIAL LOCATION: **Kitchen (Room 100)**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2E**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st and 2nd Floor Corridors**
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **2E**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT**
MATERIAL LOCATION: **1st and 2nd Floor Corridors**
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3A**
MATERIAL DESCRIPTION: **12"x12" White w/ Beige Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **3A**
MATERIAL DESCRIPTION: **12"x12" White w/ Beige Streaks VFT Mastic**
MATERIAL LOCATION: **Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3B**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Beige Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **3B**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Beige Streaks VFT Mastic**
MATERIAL LOCATION: **Kitchen Under Existing VFT (Room 100), Lunchroom (Room 101 & 103)**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3C**
MATERIAL DESCRIPTION: **12"x12" White VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Faculty Lounge**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **3C**
MATERIAL DESCRIPTION: **12"x12" White VFT Mastic**
MATERIAL LOCATION: **Faculty Lounge**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3D**
MATERIAL DESCRIPTION: **12"x12" Tan w/ White Spots VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen (Room 100)**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **3D**
MATERIAL DESCRIPTION: **12"x12" Tan w/ White Spots VFT Mastic**
MATERIAL LOCATION: **Kitchen (Room 100)**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3E**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st & 2nd Floor Corridors**
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **3E**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT Mastic**
MATERIAL LOCATION: **1st & 2nd Floor Corridors**
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **Terrazzo Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **All Stairwells, 2nd Floor Corridors Around Boarders, 1st Floor Corridors Around Boarders, Stage Stairs, Assembly Hall Stairs and Vestibule, Room 200**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **Terrazzo Flooring**
MATERIAL LOCATION: **All Stairwells, 2nd Floor Corridors Around Boarders, 1st Floor Corridors Around Boarders, Stage Stairs, Assembly Hall Stairs and Vestibule, Room 200**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **Textured Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Stage Walls**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **Textured Plaster**
MATERIAL LOCATION: **Stage Walls**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **Carpet Mastic - Removed 12/2010**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Assembly Hall - Removed 12/2010**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: **02/23/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **8**

MATERIAL DESCRIPTION: **Carpet Mastic - Removed 12/2010**

MATERIAL LOCATION: **Assembly Hall - Removed 12/2010**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **12"X12" White w/Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout Mobile Units A and B, Except Boys and Girls Toilets**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **12"X12" White w/Specks VFT**
MATERIAL LOCATION: **Throughout Mobile Units A and B, Except Boys and Girls Toilets**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9A**
MATERIAL DESCRIPTION: **12"X12" White w/Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Mobile Units A and B, Except Boys and Girls Toilets**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **9A**
MATERIAL DESCRIPTION: **12"X12" White w/Specks VFT Mastic**
MATERIAL LOCATION: **Throughout Mobile Units A and B, Except Boys and Girls Toilets**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Mag Block Tank Insulation (Two)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Mag Block Tank Insulation (Two)**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Mag Block Condensation Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Mag Block Condensation Tank Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Unex. Spaces, Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Unex. Spaces, Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Unex. Spaces, Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
MATERIAL LOCATION: **Unex. Spaces, Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Aircell Duct Wrap Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **East and Main Unexcavated Crawl Space**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Aircell Duct Wrap Insulation**
MATERIAL LOCATION: **East and Main Unexcavated Crawl Space**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
MATERIAL LOCATION: **Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall**

MATERIAL QUANTITY: **45** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
MATERIAL LOCATION: **Boiler Rm, & Boiler Tunnel, Basement NE and NW Corner Spaces, Basement S. Center Hall**
MATERIAL QUANTITY: **45** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Mag Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Basement S. Center Hall, Boiler Room & Tunnel, NE & NW Corners Of Basement**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUILDING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Mag Pipe Insulation**
MATERIAL LOCATION: **Basement S. Center Hall, Boiler Room & Tunnel, NE & NW Corners Of Basement**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **MJP E/F/V on Mag Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Basement S. Center Hall, Boiler Room & Tunnel, NE & NW Corners Of Basement**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 02/23/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **MJP E/F/V on Mag Pipe Insulation**
MATERIAL LOCATION: **Basement S. Center Hall, Boiler Room & Tunnel, NE & NW Corners Of Basement**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Panfilo Carrazco**
SCHOOL NAME: **Ebinger School** INSPECTION DATE: **2/23/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **02/23/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23051** BUIDLING ID: **3150**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Guillermo Garcia**
SCHOOL NAME: **Ebinger School** REVIEW DATE: **5/20/2016**
ADDRESS: **7350 W Pratt Avenue** IDPH LICENSE NO: **100-11089**

HOMOGENEOUS AREA: **L**

MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PANFILO CARRAZCO
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 02/13/2016 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

02/13/2016

Course Dates:

02/13/2017

Expires:

1602BIR10

Certificate Number:



PUBLIC HEALTH & SAFETY inc.

Environmental and Occupational Services
105 S. Ashland Ave., Chicago, IL 60607

N. Penneff

Director of Training

Nicholas J. Penneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois 62761-0201 • www.dph.illinois.gov

4/18/2016

PANFILO CARRAZCO
 855 W ADAMS STREET, SUITE 200
 CHICAGO, IL 60607



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11089

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
			INSPECTOR	2/13/2017
ID NUMBER 100 - 11089	ISSUED 4/18/2016	EXPIRES 05/15/2017	PROJECT MANAGER AIR SAMPLING PROFESSIONAL	2/6/2017
PANFILO CARRAZCO 855 W ADAMS STREET, SUITE CHICAGO, IL 60607 Environmental Health			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
 EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH. IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that GUILLERMO GARCIA
has completed the Asbestos Management Planner Refresher course and passed the examination
on 03/21/2016 with a minimum score of 70% or better. Training was in accordance with U.S.
E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model
Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/21/2016

Course Dates:

03/21/2017

Expires:

1603MPR02

Certificate Number:



PUBLIC HEALTH & SAFETY inc.

Environmental and Occupational Services
105 S. Ashland Ave., Chicago, IL 60607

Nicholas J. Penoff

Director of Training

Nicholas J. Penoff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-011



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

4/20/2016

GUILLERMO GARCIA
855 W ADAMS ST SUITE 100
CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 01786

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 <p>ASBESTOS PROFESSIONAL LICENSE</p>			<p>ENDORSEMENTS</p>	<p>TC EXPIRES</p>
<p>ID NUMBER 100 - 01733</p>	<p>ISSUED 4/20/2016</p>	<p>EXPIRES 05/15/2017</p>	<p>INSPECTOR</p>	<p>3/21/2017</p>
<p>GUILLERMO GARCIA 855 W ADAMS ST SUITE 100 CHICAGO, IL 60607 Environmental Health</p>			<p>MANAGEMENT PLANNER</p>	<p>3/21/2017</p>
			<p>PROJECT MANAGER</p>	<p>2/6/2017</p>
			<p>AIR SAMPLING PROFESSIONAL</p>	
			<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed