

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2239
SCHOOL NAME: Hale School
ADDRESS OF SCHOOL: 6140 S. Melvina
CITY: Chicago, IL, 60638

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/4/2013**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/4/2016 ENROLLMENT 974
IDPH INSPECTOR LICENSE NUMBER: 100-10882
IDPH LICENSED INSPECTOR NAME (Please Print): Beinville Brooks
IDPH MP LICENSE NUMBER: 100-19466
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



4/4/2016

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Hale School

6140 S. Melvina
Chicago, IL, 60638

Unit: 23491
Building ID: 3710

IDPH ID Number: 14-016-2990-2239

REPORT DATE:

Monday, April 04, 2016

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

March 17, 2016

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 23491 Region: 05 IDPH ID: 14-016-2990-2239

School: Hale School Building ID: 3710

Address: 6140 S. Melvina
Chicago, IL, 60638

Building Contact: Doyle, Robert Contact Phone: 708-646-5249

Current Building Owners: Chicago Public Schools

Review Date: 04/04/2016

Inspector: Beinville Brooks Inspector IDPH License: 100-10882
Management Planner: Evan Christian Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates

Evan Christian
100-19466

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 17, 2016

RE: Hale School, Unit 23491
6140 S. Melvina
Chicago, IL, 60638

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Hale School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Hale School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Hale School Unit: 23491 Region: 05
Address: 6140 S. Melvina Chicago, IL, 60638
IDPH ID: 14-016-2990-2239 Building ID: 3710
Contact: Doyle, Robert Phone: 708-646-5249

2. Description of Facility

Original Construction: 1953 Additional Construction:
Total Square Footage: 63323 No of Floors: 3
Current Occupancy: 974

3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603


4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Beinville Brooks

Inspector IDPH license # 100-10882


Signature:
Date: 3/17/2016

6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466

Signature:
Date: 04/04/2016

7. Review Date: 04/04/2016

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 4/4/2016

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Hale School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3710:

A	Aircell pipe covering
B	Aircell pipe joints
C	Felt covering
F	Tank insulation
L	Troweled applied plaster material

B. The following new homogenous areas have been identified for Building 3710:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

33A	Mastic 12x12 offwhite speckled flr tile
33E	12x12 beige flr tile mastic-
35A	12x12 offwhite speckled flr tile
35E	12x12 beige flr tile
39A	Brown mopboard
39B	Black mopboard
40A	Mastic under brn mopboard
40B	Black mopboard mastic
43	12"x12" VFT Red w/ Streaks
43A	12"x12" VFT Red w/ Streaks Mastic
44	12"x12" Light Brown w/ Streaks
44A	12"x12" Light Brown w/ Streaks Mastic
45	Grey Multicolor Carpet Mastic
46	12"x12" Brown w/ Streaks
46A	12"x12" Brown w/ Streaks Mastic
47	9x9 Blueish Green w/ Black Specks
47A	9x9 Blueish Green w/ Black Specks
FT-1	12x12 white w/grey specks
FTM-1	12x12 white mastic

The following areas were deemed to be inaccessible:

32A	Mastic 9x9 flr tile gray w/black & white
33A	Mastic 12x12 offwhite speckled flr tile
33B	Mastic 12x12 gray w/black& white flr tile
33C	Mastic 12x12 tan w/brown and white flr tile
33E	12x12 beige flr tile mastic-
34	12x12 flr tile mastic grn w'black
40A	Mastic under brn mopboard
40B	Black mopboard mastic
43A	12"x12" VFT Red w/ Streaks Mastic
44A	12"x12" Light Brown w/ Streaks Mastic
45	Grey Multicolor Carpet Mastic
46A	12"x12" Brown w/ Streaks Mastic
A	Aircell pipe covering
C	Felt covering
F	Tank insulation
FTM-1	12x12 white mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Beinville Brooks, IDPH License # 100-10882. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Hale School Building 3710 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Hale School Unit 23491 Building ID 3710

Address 6140 S. Melvina Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
32A	Mastic 9x9 flr tile gray w/black & white	515	SF	Rms 202 and 204	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32B	Mastic 9x9 tan w/brown and white flr tile			Rms 202 & 204	CHR	MISC								
32C	Mastic 9x9 flr tile tan	1,700	SF	Auditorium aisles, engineers office	CHR	MISC	N	DIST	30		No	ACBM with the potential for damage	5	LOW
33A	Mastic 12x12 offwhite speckled flr tile	3,500	SF	Lunchroom, basement classroom, coat check room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33B	Mastic 12x12 gray w/black& white flr tile	10,300	SF	Main and principal's office,rms 200-213, 102-113	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33C	Mastic 12x12 tan w/brown and white flr tile	12,000	SF	Library,2nd floor teachers restrm,rooms 100,102-106,108,110-113,200,201,203,205-213, pmcp	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33D	Mastic 12x12 beige speckled floor tile - Abated			1st flr corridor in front of fountains and at north end	ABATED	MISC		None						Low
33E	12x12 beige flr tile mastic-	130	SF	Patches in auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12x12 flr tile mastic grn w/black	1,620	SF	Stockroom, storage closet, janitors room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35A	12x12 offwhite speckled flr tile	3,500	SF	Lunchroom basement classroom, auditorium coatcheck	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35B	12x12 gray w/black and white floor tile	10,300	SF	1st/2nd floor corridors, library, main and principal's office,rms 200,201,203-213, 102-113	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35C	12x12 tan w/brown and white	12,000	SF	Libr.,2nd flr teach restrm,rms 100,102-106,108,110-113,200,201,203,205-213, pmcp	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35D	12x12 beige speckled floor tile - Abated			1st flr corridor in front of fountains and at north end	ABATED	MISC								
35E	12x12 beige flr tile	130	SF	Patches in	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Hale School Unit 23491 Building ID 3710

Address 6140 S. Melvina Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				auditorium								potential for damage		
36A	9x9 flr tile gray w/black/white	515	SF	Rms 202 & 204	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36B	9x9 tan w/brown and white floor tile			Rms 202 and 204	CHR	MISC		None						Low
36C	9x9 tan floor tile	1,700	SF	Auditorium aisles, engineers office	CHR	MISC	N	DIST	50		No	ACBM with the potential for damage	5	LOW
37	12x12 ft grn w/black	600	SF	storeroom, storage closet, Janitors room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39A	Brown mopboard	450	LF	Rm 202, 204, lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39B	Black mopboard	1,200	LF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40A	Mastic under brn mopboard	450	LF	Rm 202, 204, lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40B	Black mopboard mastic	1,200	LF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	Window glaze throughout 1st and 2nd flr windows - Non AHERA			Throughout	CHR	MISC		None						Low
42	Fire brick			Boiler room	ABATED	MISC								
43	12"x12" VFT Red w/ Streaks	3,000	SF	1st and 2nd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43A	12"x12" VFT Red w/ Streaks Mastic	3,000	SF	1st and 2nd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	12"x12" Light Brown w/ Streaks	1,500	SF	1st and 2nd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44A	12"x12" Light Brown w/ Streaks Mastic	1,500	SF	1st and 2nd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	Grey Multicolor Carpet Mastic	600	SF	Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	12"x12" Brown w/ Streaks	55	SF	Room 202, 204	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46A	12"x12" Brown w/ Streaks Mastic	55	SF	Room 202, 204	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	9x9 Blueish Green w/ Black Specks	10	SF	Room 202, 204	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47A	9x9 Blueish Green w/ Black Specks	10	SF	Room 202, 204	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A	Aircell pipe covering	4,292	LF	Fan room, driving room, throughout basement, airtunnels, art room	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
B	Aircell pipe joints	310	LF	Unfinished pipe space, fan room, art room	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Hale School Unit 23491 Building ID 3710

Address 6140 S. Melvina Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
C	Felt covering	2,580	LF	Fan rooms, unfinished pipe space, gym	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
D	Felt pipe packing-ABATED			Boiler room	ABATED	TSI								
E	fiberglass pipe packing-ABATED			Boiler room	ABATED	TSI								
F	Tank insulation	180	SF	Boiler room	AMO	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
FT-1	12x12 white w/grey specks	3,500	SF	Modular classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-1	12x12 white mastic	3,500	SF	Modular classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
G	Tank packing-ABATED			Boiler room	ABATED	TSI								
H	Boiler insulation-ABATED			Boiler room	ABATED	TSI								
I	Boiler packing-ABATED			Boiler room	ABATED	TSI								
J	Mag block elbows-ABATED			Boiler room	ABATED	TSI								
K	Mag pipe insulation-ABATED			Boiler room	ABATED	TSI								
L	Troweled applied plaster material	3,200	SF	Auditorium ceiling	CHR	SURFACE	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
O	Boiler gasket			Boiler room	ABATED	TSI								
P	mag block elbows			asst. principal washroom	ABATED	TSI		None						Low

Chicago Public Schools

School Hale School Unit 23491 Building ID 3710

Address 6140 S. Melvina Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 3/17/2016
Inspector Name Beinville Brooks
100-10882 5/15/2017
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
32A	
32B	Not observed 2016
32C	Damage is located in the auditorium aisles (20SF) and in the engineer's office (10SF)
33A	
33B	
33C	
33D	
33E	
34	
35A	
35B	
35C	
35D	
35E	
36A	
36B	Not observed 2016
36C	Damage is located in the auditorium aisles (45SF) and the engineer's office (5SF)
37	
39A	
39B	
40A	
40B	
41	
42	

Chicago Public Schools

School Hale School Unit 23491 Building ID 3710

Address 6140 S. Melvina Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
43	
43A	
44	
44A	
45	
46	
46A	
47	
47A	
A	
B	
C	
D	
E	
F	
FT-1	
FTM-1	
G	
H	
I	
J	
K	
L	
O	
P	

Chicago Public Schools

School Hale School **Unit** 23491 **Building ID** 3710

Address 6140 S. Melvina **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School Hale School
Address 6140 S. Melvina

Unit 23491
Chicago, IL, 60638

Building ID 3710
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
32A	Mastic 9x9 flr tile gray w/black & white	515	SF	Rms 202 and 204	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32B	Mastic 9x9 tan w/brown and white flr tile			Rms 202 & 204	Chrysotile	MISC					Follow O&M Plan
32C	Mastic 9x9 flr tile tan	1,700	SF	Auditorium aisles, engineers office	Chrysotile	MISC	No	30	SF	6 ACBM with the potential for damage	Repair
33A	Mastic 12x12 offwhite speckled flr tile	3,500	SF	Lunchroom, basement classroom, coat check room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33B	Mastic 12x12 gray w/black& white flr tile	10,300	SF	Main and principal's office,rms 200-213, 102-113	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33C	Mastic 12x12 tan w/brown and white flr tile	12,000	SF	Library,2nd floor teachers restrm,rooms 100,102-106,108,110-113,200,201,203,205-213, prncp	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33D	Mastic 12x12 beige speckled floor tile - Abated			1st flr corridor in front of fountains and at north end	Abated	MISC					
33E	12x12 beige flr tile mastic-	130	SF	Patches in auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12x12 flr tile mastic grn w/black	1,620	SF	Stockroom, storage closet, janitors room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35A	12x12 offwhite speckled flr tile	3,500	SF	Lunchroom basement classroom, auditorium coatcheck	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35B	12x12 gray w/black and white floor tile	10,300	SF	1st/2nd floor corridors, library, main and principal's office,rms 200,201,203-213, 102-113	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35C	12x12 tan w/brown and white	12,000	SF	Libr.,2nd flr teach restrm,rms 100,102-106,108,110-113,200,201,203,205-213, prncp	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35D	12x12 beige speckled floor tile - Abated			1st flr corridor in front of fountains and at north end	Abated	MISC					
35E	12x12 beige flr tile	130	SF	Patches in auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36A	9x9 flr tile gray w/black/white	515	SF	Rms 202 & 204	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36B	9x9 tan w/brown and white floor tile			Rms 202 and 204	Chrysotile	MISC					Follow O&M Plan
36C	9x9 tan floor tile	1,700	SF	Auditorium aisles, engineers office	Chrysotile	MISC	No	50	SF	6 ACBM with the potential for damage	Repair
37	12x12 ft grn w/black	600	SF	storeroom, storage closet. Janitors room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39A	Brown mopboard	450	LF	Rm 202, 204, lunchroom	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
39B	Black mopboard	1,200	LF	Throughout	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
40A	Mastic under brn mopboard	450	LF	Rm 202, 204, lunchroom	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
40B	Black mopboard mastic	1,200	LF	Throughout	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
41	Window glaze throughout 1st and 2nd flr windows -			Throughout	Chrysotile	MISC					

Chicago Public Schools

School Hale School
Address 6140 S. Melvina

Unit 23491
Chicago, IL, 60638

Building ID 3710
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
	Non AHERA										
42	Fire brick			Boiler room	Abated	MISC					
43	12"x12" VFT Red w/ Streaks	3,000	SF	1st and 2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43A	12"x12" VFT Red w/ Streaks Mastic	3,000	SF	1st and 2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	12"x12" Light Brown w/ Streaks	1,500	SF	1st and 2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44A	12"x12" Light Brown w/ Streaks Mastic	1,500	SF	1st and 2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	Grey Multicolor Carpet Mastic	600	SF	Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	12"x12" Brown w/ Streaks	55	SF	Room 202, 204	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46A	12"x12" Brown w/ Streaks Mastic	55	SF	Room 202, 204	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	9x9 Blueish Green w/ Black Specks	10	SF	Room 202, 204	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47A	9x9 Blueish Green w/ Black Specks	10	SF	Room 202, 204	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Aircell pipe covering	4,292	LF	Fan room, driving room, throughout basement, airtunnels, art room	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
B	Aircell pipe joints	310	LF	Unfinished pipe space, fan room, art room	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
C	Felt covering	2,580	LF	Fan rooms, unfinished pipe space, gym	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
D	Felt pipe packing-ABATED			Boiler room	Abated	TSI					
E	fiberglass pipe packing-ABATED			Boiler room	Abated	TSI					
F	Tank insulation	180	SF	Boiler room	Amosite	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
FT-1	12x12 white w/grey specks	3,500	SF	Modular classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-1	12x12 white mastic	3,500	SF	Modular classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	Tank packing-ABATED			Boiler room	Abated	TSI					
H	Boiler insulation-ABATED			Boiler room	Abated	TSI					
I	Boiler packing-ABATED			Boiler room	Abated	TSI					
J	Mag block elbows-ABATED			Boiler room	Abated	TSI					
K	Mag pipe insulation-ABATED			Boiler room	Abated	TSI					
L	Troweled applied plaster material	3,200	SF	Auditorium ceiling	Chrysotile	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
O	Boiler gasket			Boiler room	Abated	TSI					
P	mag block elbows			asst. principal washroom	Abated	TSI					

Chicago Public Schools

School Hale School
Address 6140 S. Melvina

Unit 23491
 Chicago, IL, 60638

Building ID 3710
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	4/4/2016
Manager Planner Name	Evan Christian
100-19466	5/15/2016
Manager IDPH License No/Expiration	

HA Number	Management Comments
32A	
32B	If identified follow O&M plan.
32C	Repair as needed then follow O&M plan.
33A	
33B	
33C	
33D	If identified follow O&M plan.
33E	
34	

Chicago Public Schools

School Hale School
Address 6140 S. Melvina

Unit 23491
 Chicago, IL, 60638

Building ID 3710
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
 600 West Van Buren St., Ste 500
 Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
35A	
35B	
35C	
35D	If identified follow O&M plan.
35E	
36A	
36B	If identified follow O&M plan.
36C	Repair as needed then follow O&M plan.
37	
39A	
39B	
40A	
40B	
41	
42	If identified follow O&M plan.
43	
43A	
44	
44A	
45	
46	
46A	
47	
47A	
A	
B	
C	

Chicago Public Schools

School Hale School
Address 6140 S. Melvina

Unit 23491
 Chicago, IL, 60638

Building ID 3710
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
D	If identified follow O&M plan.
E	If identified follow O&M plan.
F	
FT-1	
FTM-1	
G	If identified follow O&M plan.
H	If identified follow O&M plan.
I	If identified follow O&M plan.
J	If identified follow O&M plan.
K	If identified follow O&M plan.
L	
O	If identified follow O&M plan.
P	If identified follow O&M plan.

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32A**
MATERIAL DESCRIPTION: **Mastic 9x9 flr tile gray w/black & white**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rms 202 and 204**

MATERIAL QUANTITY: **515**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **32A**
MATERIAL DESCRIPTION: **Mastic 9x9 flr tile gray w/black & white**
MATERIAL LOCATION: **Rms 202 and 204**
MATERIAL QUANTITY: **515** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32B**
MATERIAL DESCRIPTION: **Mastic 9x9 tan w/brown and white flr tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rms 202 & 204**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **32B**

MATERIAL DESCRIPTION: **Mastic 9x9 tan w/brown and white flr tile**

MATERIAL LOCATION: **Rms 202 & 204**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32C**
MATERIAL DESCRIPTION: **Mastic 9x9 flr tile tan**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Auditorium aisles, engineers office**
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **1700** DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in the auditorium aisles (20SF) and in the engineer's office (10SF)**

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **32C**
MATERIAL DESCRIPTION: **Mastic 9x9 flr tile tan**
MATERIAL LOCATION: **Auditorium aisles, engineers office**
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33A**
MATERIAL DESCRIPTION: **Mastic 12x12 offwhite speckled flr tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom, basement classroom, coat check room**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **33A**
MATERIAL DESCRIPTION: **Mastic 12x12 offwhite speckled flr tile**
MATERIAL LOCATION: **Lunchroom, basement classroom, coat check room**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33B**
MATERIAL DESCRIPTION: **Mastic 12x12 gray w/black& white flr tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main and principal's office,rms 200-213, 102-113**
MATERIAL QUANTITY: **10300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **33B**
MATERIAL DESCRIPTION: **Mastic 12x12 gray w/black& white flr tile**
MATERIAL LOCATION: **Main and principal's office,rms 200-213, 102-113**
MATERIAL QUANTITY: **10300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33C**
MATERIAL DESCRIPTION: **Mastic 12x12 tan w/brown and white flr tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Library,2nd floor teachers restrm,rooms 100,102-106,108,110-113,200,201,203,205-213, prncp**

MATERIAL QUANTITY: **12000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **33C**
MATERIAL DESCRIPTION: **Mastic 12x12 tan w/brown and white flr tile**
MATERIAL LOCATION: **Library,2nd floor teachers restrm,rooms 100,102-106,108,110-113,200,201,203,205-213, prncp**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33D**
MATERIAL DESCRIPTION: **Mastic 12x12 beige speckled floor tile - Abated**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **1st flr corridor in front of fountains and at north end**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: **03/17/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **33D**

MATERIAL DESCRIPTION: **Mastic 12x12 beige speckled floor tile - Abated**

MATERIAL LOCATION: **1st flr corridor in front of fountains and at north end**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33E**
MATERIAL DESCRIPTION: **12x12 beige flr tile mastic-**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Patches in auditorum**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **33E**
MATERIAL DESCRIPTION: **12x12 beige flr tile mastic-**
MATERIAL LOCATION: **Patches in auditorum**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12x12 flr tile mastic grn w'black**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Stockroom, storage closet, janitors room**

MATERIAL QUANTITY: **1620**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12x12 flr tile mastic grn w'black**
MATERIAL LOCATION: **Stockroom, storage closet, janitors room**
MATERIAL QUANTITY: **1620** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35A**
MATERIAL DESCRIPTION: **12x12 offwhite speckled flr tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom basement classroom, auditorium coatcheck**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **35A**
MATERIAL DESCRIPTION: **12x12 offwhite speckled flr tile**
MATERIAL LOCATION: **Lunchroom basement classroom, auditorium coatcheck**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35B**
MATERIAL DESCRIPTION: **12x12 gray w/black and white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st/2nd floor corridors, library, main and principal's office,rms 200,201,203-213, 102-113**

MATERIAL QUANTITY: **10300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **35B**
MATERIAL DESCRIPTION: **12x12 gray w/black and white floor tile**
MATERIAL LOCATION: **1st/2nd floor corridors, library, main and principal's office,rms 200,201,203-213, 102-113**
MATERIAL QUANTITY: **10300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35C**
MATERIAL DESCRIPTION: **12x12 tan w/brown and white**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Libr.,2nd flr teach restrm,rms 100,102-106,108,110-113,200,201,203,205-213, prncp**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **35C**
MATERIAL DESCRIPTION: **12x12 tan w/brown and white**
MATERIAL LOCATION: **Libr.,2nd flr teach restrm,rms 100,102-106,108,110-113,200,201,203,205-213, prncp**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35D**
MATERIAL DESCRIPTION: **12x12 beige speckled floor tile - Abated**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **1st flr corridor in front of fountains and at north end**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

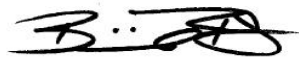

Date: **03/17/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **35D**
MATERIAL DESCRIPTION: **12x12 beige speckled floor tile - Abated**
MATERIAL LOCATION: **1st flr corridor in front of fountains and at north end**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35E**
MATERIAL DESCRIPTION: **12x12 beige flr tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Patches in auditorium**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **35E**
MATERIAL DESCRIPTION: **12x12 beige flr tile**
MATERIAL LOCATION: **Patches in auditorium**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36A**
MATERIAL DESCRIPTION: **9x9 flr tile gray w/black/white**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rms 202 & 204**
MATERIAL QUANTITY: **515** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **36A**
MATERIAL DESCRIPTION: **9x9 flr tile gray w/black/white**
MATERIAL LOCATION: **Rms 202 & 204**
MATERIAL QUANTITY: **515** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36B**
MATERIAL DESCRIPTION: **9x9 tan w/brown and white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Rms 202 and 204**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____



Date: **03/17/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **36B**

MATERIAL DESCRIPTION: **9x9 tan w/brown and white floor tile**

MATERIAL LOCATION: **Rms 202 and 204**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36C**
MATERIAL DESCRIPTION: **9x9 tan floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Auditorium aisles, engineers office**
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **1700** DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in the auditorium aisles (45SF) and the engineer's office (5SF)**

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **36C**
MATERIAL DESCRIPTION: **9x9 tan floor tile**
MATERIAL LOCATION: **Auditorium aisles, engineers office**
MATERIAL QUANTITY: **1700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **12x12 ft grn w/black**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **storeroom, storage closet. Janitors room**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **12x12 ft grn w/black**
MATERIAL LOCATION: **storeroom, storage closet. Janitors room**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39A**
MATERIAL DESCRIPTION: **Brown mopboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 202, 204, lunchroom**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **39A**
MATERIAL DESCRIPTION: **Brown mopboard**
MATERIAL LOCATION: **Rm 202, 204, lunchroom**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39B**
MATERIAL DESCRIPTION: **Black mopboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **39B**

MATERIAL DESCRIPTION: **Black mopboard**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **1200**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40A**
MATERIAL DESCRIPTION: **Mastic under brn mopboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 202, 204, lunchroom**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **40A**
MATERIAL DESCRIPTION: **Mastic under brn mopboard**
MATERIAL LOCATION: **Rm 202, 204, lunchroom**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40B**
MATERIAL DESCRIPTION: **Black mopboard mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **1200**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **40B**
MATERIAL DESCRIPTION: **Black mopboard mastic**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Window glaze throughout 1st and 2nd flr windows - Non AHERA**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **Window glaze throughout 1st and 2nd flr windows - Non AHERA**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Fire brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/17/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **Fire brick**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12"x12" VFT Red w/ Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st and 2nd Floor Corridor**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12"x12" VFT Red w/ Streaks**
MATERIAL LOCATION: **1st and 2nd Floor Corridor**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43A**
MATERIAL DESCRIPTION: **12"x12" VFT Red w/ Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st and 2nd Floor Corridor**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **43A**
MATERIAL DESCRIPTION: **12"x12" VFT Red w/ Streaks Mastic**
MATERIAL LOCATION: **1st and 2nd Floor Corridor**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12"x12" Light Brown w/ Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st and 2nd Floor Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12"x12" Light Brown w/ Streaks**
MATERIAL LOCATION: **1st and 2nd Floor Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44A**
MATERIAL DESCRIPTION: **12"x12" Light Brown w/ Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st and 2nd Floor Corridor**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **44A**
MATERIAL DESCRIPTION: **12"x12" Light Brown w/ Streaks Mastic**
MATERIAL LOCATION: **1st and 2nd Floor Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **Grey Multicolor Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **Grey Multicolor Carpet Mastic**

MATERIAL LOCATION: **Library**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 202, 204**
MATERIAL QUANTITY: **55** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **12"x12" Brown w/ Streaks**

MATERIAL LOCATION: **Room 202, 204**

MATERIAL QUANTITY: **55**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46A**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 202, 204**
MATERIAL QUANTITY: **55** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **46A**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Streaks Mastic**
MATERIAL LOCATION: **Room 202, 204**
MATERIAL QUANTITY: **55** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **9x9 Blueish Green w/ Black Specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 202, 204**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **9x9 Blueish Green w/ Black Specks**

MATERIAL LOCATION: **Room 202, 204**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47A**
MATERIAL DESCRIPTION: **9x9 Blueish Green w/ Black Specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 202, 204**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **47A**
MATERIAL DESCRIPTION: **9x9 Blueish Green w/ Black Specks**
MATERIAL LOCATION: **Room 202, 204**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Aircell pipe covering**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Fan room, driving room, throughout basement, airtunnels, art room**
MATERIAL QUANTITY: **4292** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Aircell pipe covering**
MATERIAL LOCATION: **Fan room, driving room, throughout basement, airtunnels, art room**
MATERIAL QUANTITY: **4292** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Aircell pipe joints**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Unfinished pipe space, fan room, art room**
MATERIAL QUANTITY: **310** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Aircell pipe joints**
MATERIAL LOCATION: **Unfinished pipe space, fan room, art room**
MATERIAL QUANTITY: **310** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Felt covering**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Fan rooms, unfinished pipe space, gym**
MATERIAL QUANTITY: **2580** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Felt covering**
MATERIAL LOCATION: **Fan rooms, unfinished pipe space, gym**
MATERIAL QUANTITY: **2580** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Felt pipe packing-ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **Felt pipe packing-ABATED**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **fiberglass pipe packing-ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

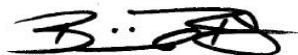

Date: **03/17/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **fiberglass pipe packing-ABATED**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Tank insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler room**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Tank insulation**
MATERIAL LOCATION: **Boiler room**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-1**
MATERIAL DESCRIPTION: **12x12 white w/grey specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Modular classrooms**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **FT-1**
MATERIAL DESCRIPTION: **12x12 white w/grey specks**
MATERIAL LOCATION: **Modular classrooms**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-1**
MATERIAL DESCRIPTION: **12x12 white mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Modular classrooms**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **FTM-1**
MATERIAL DESCRIPTION: **12x12 white mastic**
MATERIAL LOCATION: **Modular classrooms**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Tank packing-ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/17/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **Tank packing-ABATED**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Boiler insulation-ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/17/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **H**

MATERIAL DESCRIPTION: **Boiler insulation-ABATED**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Boiler packing-ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **Boiler packing-ABATED**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Mag block elbows-ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: **03/17/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **J**

MATERIAL DESCRIPTION: **Mag block elbows-ABATED**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Mag pipe insulation-ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/17/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **K**

MATERIAL DESCRIPTION: **Mag pipe insulation-ABATED**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **Troweled applied plaster material**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Auditorium ceiling**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **L**

MATERIAL DESCRIPTION: **Troweled applied plaster material**

MATERIAL LOCATION: **Auditorium ceiling**

MATERIAL QUANTITY: **3200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**
MATERIAL DESCRIPTION: **Boiler gasket**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/17/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **O**

MATERIAL DESCRIPTION: **Boiler gasket**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**
SCHOOL NAME: **Hale School** INSPECTION DATE: **3/17/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P**
MATERIAL DESCRIPTION: **mag block elbows**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**


MATERIAL LOCATION: **asst. principal washroom**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

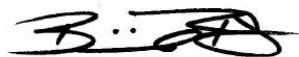

Date: 03/17/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23491** BUIDLING ID: **3710**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Hale School** REVIEW DATE: **4/4/2016**
ADDRESS: **6140 S. Melvina** IDPH LICENSE NO: **100-10882**

HOMOGENEOUS AREA: **P**

MATERIAL DESCRIPTION: **mag block elbows**

MATERIAL LOCATION: **asst. principal washroom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 10882

ISSUED
3/11/2015

EXPIRES
05/15/2016

BEINVILLE S BROOKS
PO BOX 1373
CALUMET, IL 60409

Environmental Health



ENDORSEMENTS

SUPERVISOR/WORKER
INSPECTOR

TC EXPIRES

1/30/2016
2/14/2016

PROJECT MANAGER
AIR SAMPLING PROFESSIONAL

1/30/2016

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that BENVILLE BROOKS
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/06/2016 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

01/06/2016

Course Dates:

01/06/2017

Expires:

1601BIR01

Certificate Number:



M. DeLuca


Phone: 312-491-0081

Director of Training
Nicholas J. Penell
Doctor of Public Health

FORM # A-010B

Evan Christian

Illinois Licensed Project Manager, and Air Sampling Professional

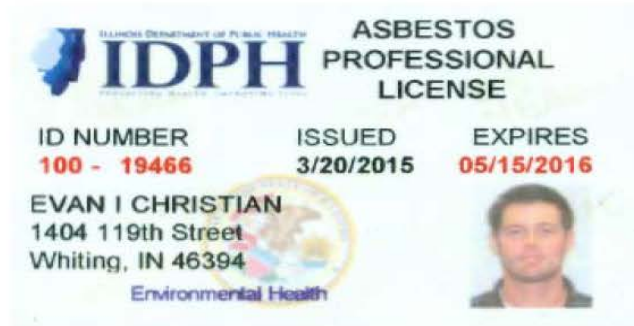

ENDORSEMENTS	TC EXPIRES
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	12/12/2015
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

**CARNOW
CONIBEAR**

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024159


Katy DeSalvo, Director

Reliable
Environmental
Solutions, Inc. **RES**

This is to certify that **Evan Christian**

*has on January 28 & 29, 2016, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Initial Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: January 28 & 29, 2016

Examination Date: January 29, 2016

Expiration Date: January 29, 2017

Certificate Number: MP/0103

William S. Williams

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ www.ReliableEnv.com

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed