

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2212
SCHOOL NAME: Gale Academy
ADDRESS OF SCHOOL: 1631 W Jonquil Terrace
CITY: Chicago, IL, 60626

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **4/8/2013**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 6/7/2016 ENROLLMENT 371
IDPH INSPECTOR LICENSE NUMBER: 100-11093
IDPH LICENSED INSPECTOR NAME (Please Print): David Avila
IDPH MP LICENSE NUMBER: 100-04019
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Arturo Saenz

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



6/7/2016

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Gale Academy

1631 W Jonquil Terrace
Chicago, IL, 60626

Unit: 31081
Building ID: 3480

IDPH ID Number: 14-016-2990-2212

REPORT DATE:

Tuesday, June 07, 2016

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone (312) 733-6262

Fax (312) 733-5612

DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 18, 2016

RE: Gale Academy, Unit 31081
1631 W Jonquil Terrace
Chicago, IL, 60626

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Gale Academy, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Gale Academy, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School:	Gale Academy	Unit:	31081	Region:	01
Address:	1631 W Jonquil Terrace		Chicago, IL, 60626		
IDPH ID:	14-016-2990-2212		Building ID:	3480	
Contact:	Lee, Michael		Phone:	773-412-7155	

2. Description of Facility

Original Construction:	1997	Additional Construction:	1922,1979
Total Square Footage:		No of Floors:	
Current Occupancy:	371		

3. LEA Designated Person

Contact:	Robert Christlieb	Phone:	(773) 553-3197
Address:	125 South Clark Street, 17th Floor		
	Chicago, IL 60603		


4. Managing Environmental Consultant

MEC:	GSG Consultants, Inc.		
Contact:	Arturo Saenz		
Address	855 W. Adams St., Ste. 200		
Phone:	(312) 733-6262	Fax:	(312) 733-5612

5. Inspector

Inspector Name: David Avila


Inspector IDPH license # 100-11093

Signature: 
Date: 3/18/2016

6. Management Planner

Management Planner Name: Arturo Saenz


Management Planner IDPH license # 100-04019

Signature: 
Date: 06/05/2016

7. Review Date: 06/05/2016

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 6/7/2016

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

GSG Consultants, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Gale Academy. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3480:

B. The following new homogenous areas have been identified for Building 3480:

- | | |
|----|---|
| 53 | 12" X 12" Blue w/ Beige Specks VFT |
| 54 | 12" X 12" Blue w/ Beige Specks VFT Mastic |

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01	12"x12" White w/ Black Specks VFT
03	12"x12" Brown w/ White & Brown Specks VFT
06	12"x12" Cream w/ Light Brown Specks VFT Mastic
07	12"x12" Dark Tan w/ White Specks VFT
08	12"x12" Dark Tan w/ White Specks VFT Mastic
09	12"x12" Gray w/ White Specks VFT
10	12"x12" Gray w/ White Specks VFT Mastic
21	12"x12" Beige VFT
22	12"x12" Beige VFT Mastic
29	12" X 12" Cream w/ Blue & Purple Specks VFT
30	12" X 12" Cream w/ Blue & Purple Specks VFT Mastic
31	12" X 12" Blue VFT
32	12" X 12" Blue VFT Mastic
33	2' x 4' Ceiling Tile
34	2' x 2' Ceiling Tile
35	Grey Linoleum
36	Grey Linoleum Mastic
37	Spray on Fireproofing
38	Baseboard
39	Baseboard Mastic
40	Drywall
41	Drywall Joint Compound
42	Light Blue Rubber Flooring
43	Light Blue Rubber Flooring Mastic
44	Carpet Mastic
45	Carpet Mastic
46	12 x 12 inch Light Blue VFT
46A	12 x 12 inch Light Blue VFT Mastic
47	Terrazzo
48	Fire Doors
49	Carpet Mastic
50	Decorative Plaster
51	Terrazzo
52	12" x 12" Sand VFT
52A	12" x 12" Sand VFT Mastic
53	12" X 12" Blue w/ Beige Specks VFT
54	12" X 12" Blue w/ Beige Specks VFT Mastic
C	Cardboard Pipe Insulation

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by David Avila, IDPH License # 100-11093. The Management Plan was updated by Arturo Saenz, IDPH License # 100-04019. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Gale Academy Building 3480 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Gale Academy Unit 31081 Building ID 3480

Address 1631 W Jonquil Terrace Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	12"x12" White w/ Black Specks VFT	6,138	SF	Room 311, 311 Kitchen, Auditorium & Balcony - 1921	ASSUMED	MISC	N	LOC	3		No	ACBM with the potential for damage	5	MODERATE
02	12"x12" White w/ Black Specks VFT Mastic	6,138	SF	Room 311, 311 Kitchen, Auditorium & Balcony - 1921	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
03	12"x12" Brown w/ White & Brown Specks VFT	1,620	SF	Room 201, 208 - 1921	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
04	12"x12" Brown w/ White & Brown Specks VFT Mastic	1,620	SF	Room 201, 208 - 1921	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05	12"x12" Cream w/ Light Brown Specks VFT	425	SF	Room 107 (Under HA 46 & 46A) - 1921	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
06	12"x12" Cream w/ Light Brown Specks VFT Mastic	425	SF	Room 107 (Under HA 46 & 46A) - 1921	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07	12"x12" Dark Tan w/ White Specks VFT	425	SF	Room 107 (Under HA 46 & 46 A) - 1921	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
08	12"x12" Dark Tan w/ White Specks VFT Mastic	425	SF	Room 107 (Under HA 46 & 46 A) - 1921	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09	12"x12" Gray w/ White Specks VFT	275	SF	Main Office Public Area - 1921	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
10	12"x12" Gray w/ White Specks VFT Mastic	275	SF	Main Office Public Area - 1921	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	9"x9" Brown w/ Cream Stripes VFT	415	SF	Principal's Office & Main Office (Under HA # 44) - 1921	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
12	9"x9" Brown w/ Cream Stripes VFT Mastic	415	SF	Principal's Office & Main Office (Under HA # 44) - 1921	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	Brown Linoleum	0		Counselor Office (Under HA # 44) - 1921	NO_ACBM									
14	Brown Linoleum Mastic	0		Counselor Office (Under HA # 44) - 1921	NO_ACBM									
15	Hard Coat Plaster	0		Throughout - 1921	NO_ACBM									
16	Drywall Joint Compound	0		Throughout - 1978	NO_ACBM									
17	12"x12" Blue VFT	5,380	SF	Lunchroom, & Lunchroom Upper Hall, 2nd Floor Teachers	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Gale Academy Unit 31081 Building ID 3480

Address 1631 W Jonquil Terrace Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Lunchroom Bathrooms- 1978										
18	12"x12" Blue VFT Mastic	5,380	SF	Lunchroom, & Lunchroom Upper Hall, 2nd Floor Teachers Lunchroom Bathrooms- 1978	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12"x12" Brown VFT	100	SF	Lunchroom- 1978	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
20	12"x12" Brown VFT Mastic	100	SF	Lunchroom- 1978	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12"x12" Beige VFT	100	SF	Main Office (Under HA # 44) - 1921	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
22	12"x12" Beige VFT Mastic	100	SF	Main Office (Under HA # 44) - 1921	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	2'x4' Ceiling Tile	0		Kitchen, Kitchen Office, Kitchen Prep Area - 1978	NO_ACBM									
29	12" X 12" Cream w/ Blue & Purple Specks VFT	16,000	SF	Throughout 1st, 2nd, 3rd, 4th floors & Elevator - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
30	12" X 12" Cream w/ Blue & Purple Specks VFT Mastic	16,000	SF	Throughout 1st, 2nd, 3rd, 4th floors & Elevator - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	12" X 12" Blue VFT	1,700	SF	Throughout 1st, 2nd, 3rd, 4th floors - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
32	12" X 12" Blue VFT Mastic	1,700	SF	Throughout 1st, 2nd, 3rd, 4th floors - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	2' x 4' Ceiling Tile	34,000	SF	Throughout - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	2' x 2' Ceiling Tile	2,100	SF	Kitchen - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	Grey Linoleum	800	SF	Kitchen Serving Area - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
36	Grey Linoleum Mastic	800	SF	Kitchen Serving Area - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	Spray on Fireproofing	26,000	SF	Throughout - 1998	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		LOW
38	Baseboard	3,500	LF	Throughout - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	Baseboard Mastic	3,500	LF	Throughout - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Gale Academy Unit 31081 Building ID 3480

Address 1631 W Jonquil Terrace Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
40	Drywall	500	SF	Throughout - 1998	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
41	Drywall Joint Compound	100	LF	Throughout -1998	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
42	Light Blue Rubber Flooring	1,500	SF	Gym - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
43	Light Blue Rubber Flooring Mastic	1,500	SF	Gym - 1998	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	Carpet Mastic	1,200	SF	Principals Office, Main Office, Counselors Office, Room 103 & Engineers Office - 1921	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	Carpet Mastic	1,200	SF	Room 250 (Library) - 1998 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	12 x 12 inch Light Blue VFT	850	SF	Room 107-1921 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
46A	12 x 12 inch Light Blue VFT Mastic	850	SF	Room 107-1921 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	Terrazzo	15,000	SF	1st through 4th Fl. Corridors, Restrooms, Stairwells & Vestibules - 1998 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
48	Fire Doors	16	EA	Stairwells - 1998 Bldgs.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	Carpet Mastic	600	SF	Teacher's Lounge - 1978 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
50	Decorative Plaster	1,800	SF	Auditorium & Stage- 1921 bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51	Terrazzo	5,356	SF	1st Floor Corridors, Entrance Vestibules. Toilet under the stairs - 1921 bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
52	12" x 12" Sand VFT	180	SF	Lunchroom Hallway - 1978 bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
52A	12" x 12" Sand VFT Mastic	180	SF	Lunchroom Hallway - 1978 bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	12" X 12" Blue w/ Beige Specks VFT	200	SF	Teacher Toilet Rooms - 1978 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
54	12" X 12" Blue w/ Beige Specks VFT	200	SF	Teacher Toilet	ASSUMED	MISC	N	NONE	0			ACBM with the		LOW

Chicago Public Schools

School Gale Academy Unit 31081 Building ID 3480

Address 1631 W Jonquil Terrace Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
B	Mastic MJP E/F/V on Fiberglass Pipe Insulation	216	LF	Rooms - 1978 Bldg 1st - 3rd Flr. Boy's & Girl's Toilets, Boiler Rm, E. and W. Air Tunnels, Tank Rm, Engine Rm- 1921	CHR	TSI	Y	NONE	0		No	potential for damage ACBM with the potential for damage		LOW
C	Cardboard Pipe Insulation	250	LF	Boiler Rm, Tank Rm, Coal Rm, Elect. Rm, 103 Tlt, Princ. Tlt, 2nd Flr Jan. closet by Boys Tlt - 1921	ASSUMED	TSI	Y	LOC	5		No	Damaged or significantly damaged friable thermal system insulating ACBM	5	MODERATE
D	MJP E/F/V on Cardboard Pipe Insulation	99	LF	Boiler Rm, Tank Rm, Coal Rm, Elect. Rm, 103 Tlt, Princ. Tlt, 2nd Flr Jan. closet by Boys Tlt - 1921	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
E	Aircell Pipe Insulation	1,800	LF	Rm 105 Tlt, 1st Fl Jan Clst By Rm 105, Rm 102, 1st Fl Corr., Mn Ofc, Basement- 1921	CHR	TSI	Y	DIST	45		No	Damaged or significantly damaged friable thermal system insulating ACBM	2	LOW
F	MJP E/F/V on Aircell Pipe Insulation	240	LF	Rm 105 Tlt, 1st Fl Jan Clst By Rm 105, Rm 102, 1st Fl Corr., Mn Ofc, Basement- 1921	CHR	TSI	Y	DIST	30		No	Damaged or significantly damaged friable thermal system insulating ACBM	2	LOW
G	Boiler Gaskets #1 & #2	10	LF	Boiler Room- 1921	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
H	MJP E/F/V on Fiberglass Pipe Insulation	2	LF	Teacher's Lounge - 1978	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
I	Mag Block Tank Insulation	250	SF	Tank Room- 1921	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Gale Academy Unit 31081 Building ID 3480

Address 1631 W Jonquil Terrace Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

Reinspection Date **3/18/2016**

Inspector Name **David Avila**

100-11093

5/15/2017

Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	Damaged area located in 311 Kitchen
02	
03	
04	
05	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
29	

Chicago Public Schools

School Gale Academy **Unit** 31081 **Building ID** 3480

Address 1631 W Jonquil Terrace **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
46A	
47	
48	
49	
50	
51	
52	
52A	
53	
54	
B	
C	Damage Location: Janitor's Closet; Inspector Response: REPAIR

Chicago Public Schools

School Gale Academy **Unit** 31081 **Building ID** 3480

Address 1631 W Jonquil Terrace **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
D	
E	
F	
G	
H	
I	

Table II

Management Planner's Review

Chicago Public Schools

School Gale Academy

Unit 31081

Building ID 3480

Address 1631 W Jonquil Terrace

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	12"x12" White w/ Black Specks VFT	6,138	SF	Room 311, 311 Kitchen, Auditorium & Balcony - 1921	Assumed	MISC	No	3	SF	6 ACBM with the potential for damage	Repair
02	12"x12" White w/ Black Specks VFT Mastic	6,138	SF	Room 311, 311 Kitchen, Auditorium & Balcony - 1921	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	12"x12" Brown w/ White & Brown Specks VFT	1,620	SF	Room 201, 208 - 1921	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	12"x12" Brown w/ White & Brown Specks VFT Mastic	1,620	SF	Room 201, 208 - 1921	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	12"x12" Cream w/ Light Brown Specks VFT	425	SF	Room 107 (Under HA 46 & 46A) - 1921	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	12"x12" Cream w/ Light Brown Specks VFT Mastic	425	SF	Room 107 (Under HA 46 & 46A) - 1921	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	12"x12" Dark Tan w/ White Specks VFT	425	SF	Room 107 (Under HA 46 & 46 A) - 1921	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	12"x12" Dark Tan w/ White Specks VFT Mastic	425	SF	Room 107 (Under HA 46 & 46 A) - 1921	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	12"x12" Gray w/ White Specks VFT	275	SF	Main Office Public Area - 1921	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	12"x12" Gray w/ White Specks VFT Mastic	275	SF	Main Office Public Area - 1921	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	9"x9" Brown w/ Cream Stripes VFT	415	SF	Principal's Office & Main Office (Under HA # 44) - 1921	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	9"x9" Brown w/ Cream Stripes VFT Mastic	415	SF	Principal's Office & Main Office (Under HA # 44)- 1921	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	Brown Linoleum	0		Counselor Office (Under HA # 44) - 1921	No ACBM						
14	Brown Linoleum Mastic	0		Counselor Office (Under HA # 44) - 1921	No ACBM						
15	Hard Coat Plaster	0		Throughout - 1921	No ACBM						
16	Drywall Joint Compound	0		Throughout - 1978	No ACBM						
17	12"x12" Blue VFT	5,380	SF	Lunchroom, & Lunchroom Upper Hall, 2nd Floor Teachers Lunchroom Bathrooms- 1978	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12"x12" Blue VFT Mastic	5,380	SF	Lunchroom, & Lunchroom Upper Hall, 2nd Floor Teachers Lunchroom Bathrooms- 1978	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12"x12" Brown VFT	100	SF	Lunchroom- 1978	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12"x12" Brown VFT Mastic	100	SF	Lunchroom- 1978	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12"x12" Beige VFT	100	SF	Main Office (Under HA # 44) - 1921	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Gale Academy

Unit 31081

Building ID 3480

Address 1631 W Jonquil Terrace

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
22	12"x12" Beige VFT Mastic	100	SF	Main Office (Under HA # 44) - 1921	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	2'x4' Ceiling Tile	0		Kitchen, Kitchen Office, Kitchen Prep Area - 1978	No ACBM						
29	12" X 12" Cream w/ Blue & Purple Specks VFT	16,000	SF	Throughout 1st, 2nd, 3rd, 4th floors & Elevator - 1998	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	12" X 12" Cream w/ Blue & Purple Specks VFT Mastic	16,000	SF	Throughout 1st, 2nd, 3rd, 4th floors & Elevator - 1998	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12" X 12" Blue VFT	1,700	SF	Throughout 1st, 2nd, 3rd, 4th floors - 1998	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12" X 12" Blue VFT Mastic	1,700	SF	Throughout 1st, 2nd, 3rd, 4th floors - 1998	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	2' x 4' Ceiling Tile	34,000	SF	Throughout - 1998	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	2' x 2' Ceiling Tile	2,100	SF	Kitchen - 1998	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	Grey Linoleum	800	SF	Kitchen Serving Area - 1998	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	Grey Linoleum Mastic	800	SF	Kitchen Serving Area - 1998	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Spray on Fireproofing	26,000	SF	Throughout - 1998	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	Baseboard	3,500	LF	Throughout - 1998	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
39	Baseboard Mastic	3,500	LF	Throughout - 1998	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
40	Drywall	500	SF	Throughout - 1998	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	Drywall Joint Compound	100	LF	Throughout -1998	Assumed	MISC	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
42	Light Blue Rubber Flooring	1,500	SF	Gym - 1998	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	Light Blue Rubber Flooring Mastic	1,500	SF	Gym - 1998	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	Carpet Mastic	1,200	SF	Principals Office, Main Office, Counselors Office, Room 103 & Engineers Office - 1921	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	Carpet Mastic	1,200	SF	Room 250 (Library) - 1998 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	12 x 12 inch Light Blue VFT	850	SF	Room 107-1921 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46A	12 x 12 inch Light Blue VFT Mastic	850	SF	Room 107-1921 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	Terrazzo	15,000	SF	1st through 4th Fl. Corridors, Restrooms, Stairwells & Vestibules - 1998 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	Fire Doors	16	EA	Stairwells - 1998 Bldgs.	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
49	Carpet Mastic	600	SF	Teacher's Lounge - 1978 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	Decorative Plaster	1,800	SF	Auditorium & Stage- 1921 bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	Terrazzo	5,356	SF	1st Floor Corridors, Entrance	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Gale Academy

Unit 31081

Building ID 3480

Address 1631 W Jonquil Terrace

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Vestibules. Toilet under the stairs - 1921 bldg							
52	12" x 12" Sand VFT	180	SF	Lunchroom Hallway - 1978 bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52A	12" x 12" Sand VFT Mastic	180	SF	Lunchroom Hallway - 1978 bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	12" X 12" Blue w/ Beige Specks VFT	200	SF	Teacher Toilet Rooms - 1978 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	12" X 12" Blue w/ Beige Specks VFT Mastic	200	SF	Teacher Toilet Rooms - 1978 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
B	MJP E/F/V on Fiberglass Pipe Insulation	216	LF	1st - 3rd Flr. Boy's & Girl's Toilets, Boiler Rm, E. and W. Air Tunnels, Tank Rm, Engine Rm- 1921	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
C	Cardboard Pipe Insulation	250	LF	Boiler Rm, Tank Rm, Coal Rm, Elect. Rm, 103 Tlt, Princ. Tlt, 2nd Flr Jan. closet by Boys Tlt -1921	Assumed	TSI	Yes	5	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
D	MJP E/F/V on Cardboard Pipe Insulation	99	LF	Boiler Rm, Tank Rm, Coal Rm, Elect. Rm, 103 Tlt, Princ. Tlt, 2nd Flr Jan. closet by Boys Tlt -1921	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
E	Aircell Pipe Insulation	1,800	LF	Rm 105 Tlt, 1st Fl Jan Clst By Rm 105, Rm 102, 1st Fl Corr., Mn Offc, Basement- 1921	Chrysotile	TSI	Yes	45	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
F	MJP E/F/V on Aircell Pipe Insulation	240	LF	Rm 105 Tlt, 1st Fl Jan Clst By Rm 105, Rm 102, 1st Fl Corr., Mn Offc, Basement- 1921	Chrysotile	TSI	Yes	30	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
G	Boiler Gaskets #1 & #2	10	LF	Boiler Room- 1921	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
H	MJP E/F/V on Fiberglass Pipe Insulation	2	LF	Teacher's Lounge - 1978	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
I	Mag Block Tank Insulation	250	SF	Tank Room- 1921	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Gale Academy

Unit 31081

Building ID 3480

Address 1631 W Jonquil Terrace

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

Review Date	6/5/2016
Manager Planner Name	Arturo Saenz
100-04019	1/19/2017
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	
04	
05	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	

Chicago Public Schools

School Gale Academy

Unit 31081

Building ID 3480

Address 1631 W Jonquil Terrace

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
17	
18	
19	
20	
21	
22	
23	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
46A	
47	

Chicago Public Schools

School Gale Academy

Unit 31081

Building ID 3480

Address 1631 W Jonquil Terrace

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
48	
49	
50	
51	
52	
52A	
53	
54	
B	
C	
D	
E	
F	
G	
H	
I	

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01		
MATERIAL DESCRIPTION:	12"x12" White w/ Black Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Physical Damage		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 311, 311 Kitchen, Auditorium & Balcony - 1921		
MATERIAL QUANTITY:	6138	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Damaged area located in 311 Kitchen		

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	01				
MATERIAL DESCRIPTION:	12"x12" White w/ Black Specks VFT				
MATERIAL LOCATION:	Room 311, 311 Kitchen, Auditorium & Balcony - 1921				
MATERIAL QUANTITY:	6138	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	3	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02		
MATERIAL DESCRIPTION:	12"x12" White w/ Black Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 311, 311 Kitchen, Auditorium & Balcony - 1921		
MATERIAL QUANTITY:	6138	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	02		
MATERIAL DESCRIPTION:	12"x12" White w/ Black Specks VFT Mastic		
MATERIAL LOCATION:	Room 311, 311 Kitchen, Auditorium & Balcony - 1921		
MATERIAL QUANTITY:	6138	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	03		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White & Brown Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 201, 208 - 1921		
MATERIAL QUANTITY:	1620	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	03				
MATERIAL DESCRIPTION:	12"x12" Brown w/ White & Brown Specks VFT				
MATERIAL LOCATION:	Room 201, 208 - 1921				
MATERIAL QUANTITY:	1620	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White & Brown Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 201, 208 - 1921		
MATERIAL QUANTITY:	1620	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	04				
MATERIAL DESCRIPTION:	12"x12" Brown w/ White & Brown Specks VFT Mastic				
MATERIAL LOCATION:	Room 201, 208 - 1921				
MATERIAL QUANTITY:	1620	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	12"x12" Cream w/ Light Brown Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 107 (Under HA 46 & 46A) - 1921		
MATERIAL QUANTITY:	425	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	12"x12" Cream w/ Light Brown Specks VFT		
MATERIAL LOCATION:	Room 107 (Under HA 46 & 46A) - 1921		
MATERIAL QUANTITY:	425	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	06		
MATERIAL DESCRIPTION:	12"x12" Cream w/ Light Brown Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 107 (Under HA 46 & 46A) - 1921		
MATERIAL QUANTITY:	425	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	06		
MATERIAL DESCRIPTION:	12"x12" Cream w/ Light Brown Specks VFT Mastic		
MATERIAL LOCATION:	Room 107 (Under HA 46 & 46A) - 1921		
MATERIAL QUANTITY:	425	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07		
MATERIAL DESCRIPTION:	12"x12" Dark Tan w/ White Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 107 (Under HA 46 & 46 A) - 1921		
MATERIAL QUANTITY:	425	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	07		
MATERIAL DESCRIPTION:	12"x12" Dark Tan w/ White Specks VFT		
MATERIAL LOCATION:	Room 107 (Under HA 46 & 46 A) - 1921		
MATERIAL QUANTITY:	425	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	12"x12" Dark Tan w/ White Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 107 (Under HA 46 & 46 A) - 1921		
MATERIAL QUANTITY:	425	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	08				
MATERIAL DESCRIPTION:	12"x12" Dark Tan w/ White Specks VFT Mastic				
MATERIAL LOCATION:	Room 107 (Under HA 46 & 46 A) - 1921				
MATERIAL QUANTITY:	425	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Main Office Public Area - 1921		
MATERIAL QUANTITY:	275	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White Specks VFT		
MATERIAL LOCATION:	Main Office Public Area - 1921		
MATERIAL QUANTITY:	275	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office Public Area - 1921		
MATERIAL QUANTITY:	275	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White Specks VFT Mastic		
MATERIAL LOCATION:	Main Office Public Area - 1921		
MATERIAL QUANTITY:	275	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **9"x9" Brown w/ Cream Stripes VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Principal's Office & Main Office (Under HA # 44) - 1921**

MATERIAL QUANTITY: **415**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	9"x9" Brown w/ Cream Stripes VFT		
MATERIAL LOCATION:	Principal's Office & Main Office (Under HA # 44) - 1921		
MATERIAL QUANTITY:	415	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	9"x9" Brown w/ Cream Stripes VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principal's Office & Main Office (Under HA # 44)- 1921		
MATERIAL QUANTITY:	415	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	9"x9" Brown w/ Cream Stripes VFT Mastic		
MATERIAL LOCATION:	Principal's Office & Main Office (Under HA # 44)- 1921		
MATERIAL QUANTITY:	415	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	13	
MATERIAL DESCRIPTION:	Brown Linoleum	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Counselor Office (Under HA # 44) - 1921

MATERIAL QUANTITY: 0 MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	13	
MATERIAL DESCRIPTION:	Brown Linoleum	
MATERIAL LOCATION:	Counselor Office (Under HA # 44) - 1921	
MATERIAL QUANTITY:	0	MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Brown Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Counselor Office (Under HA # 44) - 1921**

MATERIAL QUANTITY: **0**

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	14	
MATERIAL DESCRIPTION:	Brown Linoleum Mastic	
MATERIAL LOCATION:	Counselor Office (Under HA # 44) - 1921	
MATERIAL QUANTITY:	0	MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout - 1921**

MATERIAL QUANTITY: **0**

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	15	
MATERIAL DESCRIPTION:	Hard Coat Plaster	
MATERIAL LOCATION:	Throughout - 1921	
MATERIAL QUANTITY:	0	MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16	
MATERIAL DESCRIPTION:	Drywall Joint Compound	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout - 1978

MATERIAL QUANTITY: 0

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	16	
MATERIAL DESCRIPTION:	Drywall Joint Compound	
MATERIAL LOCATION:	Throughout - 1978	
MATERIAL QUANTITY:	0	MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	12"x12" Blue VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Lunchroom, & Lunchroom Upper Hall, 2nd Floor Teachers Lunchroom Bathrooms-1978**

MATERIAL QUANTITY: **5380**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	12"x12" Blue VFT		
MATERIAL LOCATION:	Lunchroom, & Lunchroom Upper Hall, 2nd Floor Teachers Lunchroom Bathrooms- 1978		
MATERIAL QUANTITY:	5380	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	12"x12" Blue VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunchroom, & Lunchroom Upper Hall, 2nd Floor Teachers Lunchroom Bathrooms-1978**

MATERIAL QUANTITY: **5380**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	12"x12" Blue VFT Mastic		
MATERIAL LOCATION:	Lunchroom, & Lunchroom Upper Hall, 2nd Floor Teachers Lunchroom Bathrooms-	1978	
MATERIAL QUANTITY:	5380	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	12"x12" Brown VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Lunchroom- 1978		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	12"x12" Brown VFT		
MATERIAL LOCATION:	Lunchroom- 1978		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/05/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	12"x12" Brown VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom- 1978		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	12"x12" Brown VFT Mastic		
MATERIAL LOCATION:	Lunchroom- 1978		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	12"x12" Beige VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Main Office (Under HA # 44) - 1921		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	12"x12" Beige VFT		
MATERIAL LOCATION:	Main Office (Under HA # 44) - 1921		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	12"x12" Beige VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office (Under HA # 44) - 1921		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	12"x12" Beige VFT Mastic		
MATERIAL LOCATION:	Main Office (Under HA # 44) - 1921		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23	
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Kitchen, Kitchen Office, Kitchen Prep Area - 1978

MATERIAL QUANTITY: 0 MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	23	
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile	
MATERIAL LOCATION:	Kitchen, Kitchen Office, Kitchen Prep Area - 1978	
MATERIAL QUANTITY:	0	MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	12" X 12" Cream w/ Blue & Purple Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout 1st, 2nd, 3rd, 4th floors & Elevator - 1998		
MATERIAL QUANTITY:	16000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	12" X 12" Cream w/ Blue & Purple Specks VFT		
MATERIAL LOCATION:	Throughout 1st, 2nd, 3rd, 4th floors & Elevator - 1998		
MATERIAL QUANTITY:	16000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	12" X 12" Cream w/ Blue & Purple Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout 1st, 2nd, 3rd, 4th floors & Elevator - 1998		
MATERIAL QUANTITY:	16000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	12" X 12" Cream w/ Blue & Purple Specks VFT Mastic		
MATERIAL LOCATION:	Throughout 1st, 2nd, 3rd, 4th floors & Elevator - 1998		
MATERIAL QUANTITY:	16000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	12" X 12" Blue VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout 1st, 2nd, 3rd, 4th floors - 1998		
MATERIAL QUANTITY:	1700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	12" X 12" Blue VFT		
MATERIAL LOCATION:	Throughout 1st, 2nd, 3rd, 4th floors - 1998		
MATERIAL QUANTITY:	1700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	12" X 12" Blue VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout 1st, 2nd, 3rd, 4th floors - 1998		
MATERIAL QUANTITY:	1700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	12" X 12" Blue VFT Mastic		
MATERIAL LOCATION:	Throughout 1st, 2nd, 3rd, 4th floors - 1998		
MATERIAL QUANTITY:	1700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	2' x 4' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1998		
MATERIAL QUANTITY:	34000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	2' x 4' Ceiling Tile		
MATERIAL LOCATION:	Throughout - 1998		
MATERIAL QUANTITY:	34000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	2' x 2' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen - 1998		
MATERIAL QUANTITY:	2100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	2' x 2' Ceiling Tile		
MATERIAL LOCATION:	Kitchen - 1998		
MATERIAL QUANTITY:	2100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	Grey Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Kitchen Serving Area - 1998		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	Grey Linoleum		
MATERIAL LOCATION:	Kitchen Serving Area - 1998		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	Grey Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen Serving Area - 1998		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	Grey Linoleum Mastic		
MATERIAL LOCATION:	Kitchen Serving Area - 1998		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	Spray on Fireproofing		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1998		
MATERIAL QUANTITY:	26000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	Spray on Fireproofing		
MATERIAL LOCATION:	Throughout - 1998		
MATERIAL QUANTITY:	26000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1998		
MATERIAL QUANTITY:	3500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	Baseboard		
MATERIAL LOCATION:	Throughout - 1998		
MATERIAL QUANTITY:	3500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout - 1998**

MATERIAL QUANTITY: **3500**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	Baseboard Mastic		
MATERIAL LOCATION:	Throughout - 1998		
MATERIAL QUANTITY:	3500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	Drywall		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1998		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	Drywall		
MATERIAL LOCATION:	Throughout - 1998		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout -1998**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	41		
MATERIAL DESCRIPTION:	Drywall Joint Compound		
MATERIAL LOCATION:	Throughout -1998		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	Light Blue Rubber Flooring		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Gym - 1998		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	Light Blue Rubber Flooring		
MATERIAL LOCATION:	Gym - 1998		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	Light Blue Rubber Flooring Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gym - 1998		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	Light Blue Rubber Flooring Mastic		
MATERIAL LOCATION:	Gym - 1998		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principals Office, Main Office, Counselors Office, Room 103 & Engineers Office - 1921		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	Carpet Mastic		
MATERIAL LOCATION:	Principals Office, Main Office, Counselors Office, Room 103 & Engineers Office - 1921		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 250 (Library) - 1998 Annex**

MATERIAL QUANTITY: **1200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	Carpet Mastic		
MATERIAL LOCATION:	Room 250 (Library) - 1998 Annex		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	12 x 12 inch Light Blue VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 107-1921 Building		
MATERIAL QUANTITY:	850	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	12 x 12 inch Light Blue VFT		
MATERIAL LOCATION:	Room 107-1921 Building		
MATERIAL QUANTITY:	850	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46A		
MATERIAL DESCRIPTION:	12 x 12 inch Light Blue VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 107-1921 Building		
MATERIAL QUANTITY:	850	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	46A		
MATERIAL DESCRIPTION:	12 x 12 inch Light Blue VFT Mastic		
MATERIAL LOCATION:	Room 107-1921 Building		
MATERIAL QUANTITY:	850	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st through 4th Fl. Corridors, Restrooms, Stairwells & Vestibules - 1998 Bldg.**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	47		
MATERIAL DESCRIPTION:	Terrazzo		
MATERIAL LOCATION:	1st through 4th Fl. Corridors, Restrooms, Stairwells & Vestibules - 1998 Bldg.		
MATERIAL QUANTITY:	15000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	Fire Doors		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stairwells - 1998 Bldgs.		
MATERIAL QUANTITY:	16	MATERIAL UNITS:	EA
DAMAGE QUANTITY:		DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	Fire Doors		
MATERIAL LOCATION:	Stairwells - 1998 Bldgs.		
MATERIAL QUANTITY:	16	MATERIAL UNITS:	EA
DAMAGE QUANTITY:	0	DAMAGE UNITS:	EA

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Teacher's Lounge - 1978 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	Carpet Mastic		
MATERIAL LOCATION:	Teacher's Lounge - 1978 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	Decorative Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium & Stage- 1921 bldg		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	Decorative Plaster		
MATERIAL LOCATION:	Auditorium & Stage- 1921 bldg		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st Floor Corridors, Entrance Vestibules. Toilet under the stairs - 1921 bldg**
MATERIAL QUANTITY: **5356** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	51		
MATERIAL DESCRIPTION:	Terrazzo		
MATERIAL LOCATION:	1st Floor Corridors, Entrance Vestibules. Toilet under the stairs - 1921 bldg		
MATERIAL QUANTITY:	5356	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	52		
MATERIAL DESCRIPTION:	12" x 12" Sand VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Lunchroom Hallway - 1978 bldg		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	52		
MATERIAL DESCRIPTION:	12" x 12" Sand VFT		
MATERIAL LOCATION:	Lunchroom Hallway - 1978 bldg		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	52A		
MATERIAL DESCRIPTION:	12" x 12" Sand VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom Hallway - 1978 bldg		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	52A		
MATERIAL DESCRIPTION:	12" x 12" Sand VFT Mastic		
MATERIAL LOCATION:	Lunchroom Hallway - 1978 bldg		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	B		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st - 3rd Flr. Boy's & Girl's Toilets, Boiler Rm, E. and W. Air Tunnels, Tank Rm, Engine Rm- 1921**

MATERIAL QUANTITY: **216**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	B				
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation				
MATERIAL LOCATION:	1st - 3rd Flr. Boy's & Girl's Toilets, Boiler Rm, E. and W. Air Tunnels, Tank Rm, Engine Rm- 1921				
MATERIAL QUANTITY:	216	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	C		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:	Physical Damage		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Boiler Rm, Tank Rm, Coal Rm, Elect. Rm, 103 Tlt, Princ. Tlt, 2nd Flr Jan. closet by Boys Tlt -1921		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:	Damage Location: Janitor's Closet; Inspector Response: REPAIR		

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	C		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
MATERIAL LOCATION:	Boiler Rm, Tank Rm, Coal Rm, Elect. Rm, 103 Tlt, Princ. Tlt, 2nd Flr Jan. closet by Boys Tlt -1921		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	5	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	D		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler Rm, Tank Rm, Coal Rm, Elect. Rm, 103 Tlt, Princ. Tlt, 2nd Flr Jan. closet by Boys Tlt -1921**

MATERIAL QUANTITY: **99**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	D				
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation				
MATERIAL LOCATION:	Boiler Rm, Tank Rm, Coal Rm, Elect. Rm, 103 Tlt, Princ. Tlt, 2nd Flr Jan. closet by Boys Tlt -1921				
MATERIAL QUANTITY:	99	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 105 Tlt, 1st Fl Jan Clst By Rm 105, Rm 102, 1st Fl Corr., Mn Offc, Basement- 1921**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	E				
MATERIAL DESCRIPTION:	Aircell Pipe Insulation				
MATERIAL LOCATION:	Rm 105 Tlt, 1st Fl Jan Clst By Rm 105, Rm 102, 1st Fl Corr., Mn Offc, Basement- 1921				
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	45	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 105 Tlt, 1st Fl Jan Clst By Rm 105, Rm 102, 1st Fl Corr., Mn Offc, Basement- 1921**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	F		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
MATERIAL LOCATION:	Rm 105 Tlt, 1st Fl Jan Clst By Rm 105, Rm 102, 1st Fl Corr., Mn Offc, Basement- 1921		
MATERIAL QUANTITY:	240	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	30	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Gale Academy	INSPECTION DATE:	3/18/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	G		
MATERIAL DESCRIPTION:	Boiler Gaskets #1 & #2		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room- 1921		
MATERIAL QUANTITY:	10	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	G				
MATERIAL DESCRIPTION:	Boiler Gaskets #1 & #2				
MATERIAL LOCATION:	Boiler Room- 1921				
MATERIAL QUANTITY:	10	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teacher's Lounge - 1978**

MATERIAL QUANTITY: **2**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	H				
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation				
MATERIAL LOCATION:	Teacher's Lounge - 1978				
MATERIAL QUANTITY:	2	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Mag Block Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Tank Room- 1921**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	31081	BUILDING ID:	3480
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Gale Academy	REVIEW DATE:	6/5/2016		
ADDRESS:	1631 W Jonquil Terrace	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	I				
MATERIAL DESCRIPTION:	Mag Block Tank Insulation				
MATERIAL LOCATION:	Tank Room- 1921				
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12" X 12" Blue w/ Beige Specks VFT**
MATERIAL LOCATION: **Teacher Toilet Rooms - 1978 Bldg**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Gale Academy** REVIEW DATE: **6/5/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12" X 12" Blue w/ Beige Specks VFT**
MATERIAL LOCATION: **Teacher Toilet Rooms - 1978 Bldg**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **06/05/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Gale Academy** INSPECTION DATE: **3/18/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12" X 12" Blue w/ Beige Specks VFT Mastic**
MATERIAL LOCATION: **Teacher Toilet Rooms - 1978 Bldg**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/18/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31081** BUILDING ID: **3480**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Gale Academy** REVIEW DATE: **6/5/2016**
ADDRESS: **1631 W Jonquil Terrace** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12" X 12" Blue w/ Beige Specks VFT Mastic**
MATERIAL LOCATION: **Teacher Toilet Rooms - 1978 Bldg**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **06/05/2016**

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

DAVID AVILA

This is to certify that _____
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 02/13/2016 _____ with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



02/13/2016

Course Dates:

02/13/2017

Expires:

1602BIR08

Certificate Number:

Phone: 312-491-0081

Director of Training

Nicholas J. Peneff

Doctor of Public Health

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.idph.org



4/18/2016

ARTURO SAENZ
855 W ADAMS ST SUITE 200
CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 04019

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License			Back of License	
			ASBESTOS PROFESSIONAL LICENSE	ENDORSEMENTS
ID NUMBER 100 - 04019	ISSUED 4/18/2016	EXPIRES 05/15/2017	INSPECTOR	TC EXPIRES 1/19/2017
ARTURO SAENZ 855 W ADAMS ST SUITE 200 CHICAGO, IL 60607 Environmental Health			MANAGEMENT PLANNER	1/27/2017
			AIR SAMPLING PROFESSIONAL	
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

2016



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Arturo Saenz


has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016


Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270319


Kathy DeSalvo, Director

2016

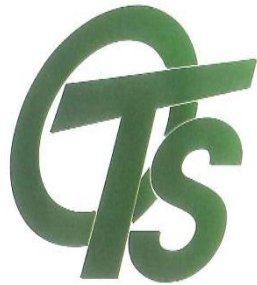

OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah


has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016

Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270320

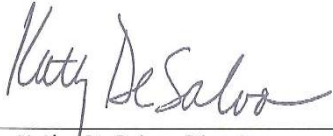
Kathy DeSalvo, Director

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed