

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-082Y
SCHOOL NAME: Youth Connection - Community Service West -
Community Christian Academy
ADDRESS OF SCHOOL: 1231 S. Pulaski Ave.
CITY: Chicago, IL, 60623-

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 5/5/2016

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 133
IDPH INSPECTOR LICENSE NUMBER: 100-06327
IDPH LICENSED INSPECTOR NAME(Please Print): Roberto Rivera
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____
School has been closed. Date closed: _____
School building has been demolished. Date: _____
School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Youth Connection - Community Service West - Community Christian Academy

1231 S. Pulaski Ave.
Chicago, IL, 60623-

Unit: 66612
Building ID: 1121U

IDPH ID Number: 14-016-2990-082Y

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

GSG-Probe Consulting, Inc.

2942 W. Van Buren

Chicago, IL, 60612

Phone 3123197575

Fax

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

July 25, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

GSG-Probe Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 66612 Region: IDPH ID:14-016-2990-082Y

School: Youth Connection - Community Service West - Community Building ID: 1121U
Christian Academy
Address: 1231 S. Pulaski Ave.

Chicago, IL, 60623-

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 10/10/2019

Inspector: Roberto Rivera
Management Planner: Jigar Shah

Inspector IDPH License: 100-06327
Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at 3123197575

Sincerely,
GSG-Probe Consulting, Inc.

Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: July 25, 2019

RE: Youth Connection - Community Service West - Community Christian Academy, Unit 66612
1231 S. Pulaski Ave.
Chicago, IL, 60623-

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Youth Connection - Community Service West - Community Christian Academy, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Youth Connection - Community Service West - Community Christian Academy, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Youth Connection - Community Service West - Community Christian Academy
Address: 1231 S. Pulaski Ave.
IDPH ID: 14-016-2990-082Y
Contact: Unit: 66612 Chicago, IL, 60623- Building ID: 1121U
Region: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 133

3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: GSG-Probe Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren
Chicago, IL, 60612
Phone: 3123197575 Fax:

5. Inspector

Inspector Name: Roberto Rivera

Inspector IDPH license # 100-06327

Signature:
Date: 7/25/2019

6. Management Planner

Management Planner Name: Jigar Shah

Management Planner IDPH license # 100-07342

Signature:
Date: 10/10/2019

7. Review Date: 10/10/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

GSG-Probe Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Youth Connection - Community Service West - Community Christian Academy. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1121U:

B. The following new homogenous areas have been identified for Building 1121U:

011A	12" x 12" Gray Mix Floor Tile Mastic
26	1' x 1' Ceiling Tile w/ Pinholes
27	Orange Fire Caulk on Conduit
28	2' x 4' Smooth Ceiling Tile

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

001	2' x 4' Lay In Ceiling Panels
002	12" x 12" Tan Floor Tile
003	12" x 12" Tan Floor Tile Mastic
004	Drywall
005	Black Cove Base
006	Red Cove Base
007	Red Vinyl Flooring
008	Black Cove Base Adhesive
009	Red Cove Base Adhesive
010	Carpet Mastic
011	12" x 12" Gray Mix Floor Tile
011A	12" x 12" Gray Mix Floor Tile Mastic
013	4" Brown Vinyl Baseboard
014	4" Brown Vinyl Baseboard Adhesive
015	2' x 4' Lay In Ceiling Panels
016	4" Gray Vinyl Baseboard
017	4" Gray Vinyl Baseboard Adhesive
019	12" x 12" Brown Speckled Floor Tile (Not Observed)
020	Mastic Associated with 12"x 12" Brown Floor Tile (Not observed)
121	Drywall
122	Drywall Joint Compound
123	Brown Carpet Mastic
124	12" x 12" Orange Floor Tile
124M	12" x 12" Orange Floor Tile Mastic
125	12" x 12" Tan & White Floor Tile
125M	12" x 12" Tan & White Floor Tile Mastic
21	6" x 6" White Grey Ceramic Tile Grout
22	6" x 6" White Grey Ceramic Tile Adhesive
23	12" x 12" Black, Yellow, Brown Ceramic Tile Grout
24	12" x 12" Black, Yellow, Brown Ceramic Tile Adhesive
25	12" x 12" Dark Brown Floor Tile
25M	12" x 12" Dark Brown Floor Tile Mastic
26	1' x 1' Ceiling Tile w/ Pinholes
27	Orange Fire Caulk on Conduit
28	2' x 4' Smooth Ceiling Tile

The following areas were deemed to be inaccessible:

124M

12" x 12' Orange Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Roberto Rivera, IDPH License # 100-06327. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Youth Connection - Community Service West - Community Christian Academy Building 1121U Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Youth Connection - Community Service West - Community Christian Academy Unit 66612 Building ID 1121U

Address 1231 S. Pulaski Ave. Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
001	2' x 4' Lay In Ceiling Panels	2,025	SF	Throughout Facility	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
002	12" x 12" Tan Floor Tile	1,458	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
003	12" x 12" Tan Floor Tile Mastic	1,458	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
004	Drywall	10,000	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
005	Black Cove Base	3,800	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
006	Red Cove Base	400	LF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
007	Red Vinyl Flooring		SF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
008	Black Cove Base Adhesive	3,800	LF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
009	Red Cove Base Adhesive	400	LF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
010	Carpet Mastic	550	SF	Offices and Entrance Hallway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
011	12" x 12" Gray Mix Floor Tile	1,350	SF	Science Lab/Science Lecture Classroom 7B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
011A	12" x 12" Gray Mix Floor Tile Mastic	1,500	SF	Science Lab/Science Lecture Classroom 7B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
013	4" Brown Vinyl Baseboard	200	LF	Science Lab/ Science Lecture Classroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
014	4" Brown Vinyl Baseboard Adhesive	200	LF	Science Lab/ Science Lecture Classroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
015	2' x 4' Lay In Ceiling Panels	2,025	SF	Science Lab/Science Lecture Classroom/Washrooms	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
016	4" Gray Vinyl Baseboard	300	LF	Washrooms and CFO Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
017	4" Gray Vinyl Baseboard Adhesive	300	LF	Washrooms and CFO Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
018	Blue Carpet Adhesive - ABATED			Multi-Purpose Room	ABATED	MISC						Any remaining friable ACBM or friable suspect ACBM		
019	12" x 12" Brown Speckled Floor Tile (Not	300	SF	Entrway Hallway	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Youth Connection - Community Service West - Community Christian Academy Unit 66612 Building ID 1121U

Address 1231 S. Pulaski Ave. Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Observed)											potential for damage		
020	Mastic Associated with 12"x 12" Brown Floor Tile(Not observed)	300	SF	Entrway Hallway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
121	Drywall	2,500	SF	Rooms 8, 9, 10 and Office 8 - Addition Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
122	Drywall Joint Compound	2,500	SF	Rooms 8, 9, 10 and Office 8 - Addition Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
123	Brown Carpet Mastic	300	SF	Entrance - Addition Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
124	12" x 12" Orange Floor Tile	1,000	SF	Rooms 8, 9, 10 and Office 8 - Addition Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
124M	12" x 12" Orange Floor Tile Mastic	1,000	SF	Rooms 8, 9, 10 and Office 8 - Addition Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
125	12" x 12" Tan & White Floor Tile	600	SF	Room 1 - Addition Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
125M	12" x 12" Tan & White Floor Tile Mastic	600	SF	Room 1 - Addition Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	6" x 6" White Grey Ceramic Tile Grout	300	SF	Men's/Women's Wash Rooms on Northwest Side	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	6" x 6" White Grey Ceramic Tile Adhesive	300	SF	Men's/Women's Wash Rooms on Northwest Side	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	12" x 12" Black, Yellow, Brown Ceramic Tile Grout	250	SF	Men's/Women's Wash Rooms Across from Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12" x 12" Black, Yellow, Brown Ceramic Tile Adhesive	250	SF	Men's/Women's Wash Rooms Across from Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12" x 12" Dark Brown Floor Tile	32	SF	Entrance to lunch room as patch	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25M	12" x 12" Dark Brown Floor Tile Mastic	32	SF	Entrance to lunch room as patch	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	1' x 1' Ceiling Tile w/ Pinholes	135	SF	Counseling Office	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
27	Orange Fire Caulk on Conduit	200	LF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	2' x 4' Smooth Ceiling Tile	4,000	SF	Food Services, Janitor's Closet	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Youth Connection - Community Service West - Community Christian Academy **Unit** 66612 **Building ID** 1121U
Address 1231 S. Pulaski Ave. **Region**

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612
Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

Reinspection Date <u>7/25/2019</u>
Inspector Name <u>Roberto Rivera</u>
<u>100-06327</u> <u>5/15/2020</u>
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
001	
002	
003	
004	
005	
006	
007	
008	
009	
010	
011	
011A	
013	
014	
015	
016	
017	
018	
019	
020	
121	
122	
123	

Chicago Public Schools

School Youth Connection - Community Service West - Community Christian Academy **Unit** 66612 **Building ID** 1121U
Address 1231 S. Pulaski Ave. **Region**

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612
Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
124	
124M	
125	
125M	
21	
22	
23	
24	
25	
25M	
26	
27	
28	

Table II

Management Planner's Review

Chicago Public Schools

Youth Connection -
Community Service West -
Community Christian

School Academy
Address 1231 S. Pulaski Ave.

Unit 66612
Chicago, IL, 60623-

Building ID 1121U
Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
001	2' x 4' Lay In Ceiling Panels	2,025	SF	Throughout Facility	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
002	12" x 12" Tan Floor Tile	1,458	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
003	12" x 12" Tan Floor Tile Mastic	1,458	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
004	Drywall	10,000	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
005	Black Cove Base	3,800	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
006	Red Cove Base	400	LF	Throughout Facility	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
007	Red Vinyl Flooring		SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
008	Black Cove Base Adhesive	3,800	LF	Throughout Facility	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
009	Red Cove Base Adhesive	400	LF	Throughout Facility	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
010	Carpet Mastic	550	SF	Offices and Entrance Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
011	12" x 12" Gray Mix Floor Tile	1,350	SF	Science Lab/Science Lecture Classroom 7B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
011A	12" x 12" Gray Mix Floor Tile Mastic	1,500	SF	Science Lab/Science Lecture Classroom 7B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
013	4" Brown Vinyl Baseboard	200	LF	Science Lab/ Science Lecture Classroom	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
014	4" Brown Vinyl Baseboard Adhesive	200	LF	Science Lab/ Science Lecture Classroom	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
015	2' x 4' Lay In Ceiling Panels	2,025	SF	Science Lab/Science Lecture Classroom/Washrooms	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
016	4" Gray Vinyl Baseboard	300	LF	Washrooms and CFO Office	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
017	4" Gray Vinyl Baseboard Adhesive	300	LF	Washrooms and CFO Office	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
018	Blue Carpet Adhesive - ABATED			Multi-Purpose Room	Abated	MISC				7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
019	12" x 12" Brown Speckled Floor Tile (Not Observed)	300	SF	Entrway Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
020	Mastic Associated with 12"x 12" Brown Floor Tile (Not observed)	300	SF	Entrway Hallway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
121	Drywall	2,500	SF	Rooms 8, 9, 10 and Office 8 - Addition Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
122	Drywall Joint Compound	2,500	SF	Rooms 8, 9, 10 and Office 8 - Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

Youth Connection -
 Community Service West -
 Community Christian
School Academy **Unit** 66612 **Building ID** 1121U
Address 1231 S. Pulaski Ave. Chicago, IL, 60623- **Region**

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
 2942 W. Van Buren Chicago, IL, 60612
 Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Building							
123	Brown Carpet Mastic	300	SF	Entrance - Addition Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
124	12" x 12" Orange Floor Tile	1,000	SF	Rooms 8, 9, 10 and Office 8 - Addition Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
124M	12" x 12" Orange Floor Tile Mastic	1,000	SF	Rooms 8, 9, 10 and Office 8 - Addition Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
125	12" x 12" Tan & White Floor Tile	600	SF	Room 1 - Addition Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
125M	12" x 12" Tan & White Floor Tile Mastic	600	SF	Room 1 - Addition Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	6" x 6" White Grey Ceramic Tile Grout	300	SF	Men's/Women's Wash Rooms on Northwest Side	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	6" x 6" White Grey Ceramic Tile Adhesive	300	SF	Men's/Women's Wash Rooms on Northwest Side	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12" x 12" Black, Yellow, Brown Ceramic Tile Grout	250	SF	Men's/Women's Wash Rooms Across from Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12" x 12" Black, Yellow, Brown Ceramic Tile Adhesive	250	SF	Men's/Women's Wash Rooms Across from Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12" x 12" Dark Brown Floor Tile	32	SF	Entrance to lunch room as patch	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25M	12" x 12" Dark Brown Floor Tile Mastic	32	SF	Entrance to lunch room as patch	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	1' x 1' Ceiling Tile w/ Pinholes	135	SF	Counseling Office	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	Orange Fire Caulk on Conduit	200	LF	Throughout	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
28	2' x 4' Smooth Ceiling Tile	4,000	SF	Food Services, Janitor's Closet	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

Youth Connection -
 Community Service West -
 Community Christian
School Academy
Address 1231 S. Pulaski Ave.

Unit 66612
 Chicago, IL, 60623-

Building ID 1121U
Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
 2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

Review Date	10/10/2019
Manager Planner Name	Jigar Shah
100-07342	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
001	
002	
003	
004	
005	
006	
007	
008	
009	
010	

Chicago Public Schools

School Youth Connection -
 Community Service West -
 Community Christian
 Academy
Address 1231 S. Pulaski Ave.

Unit 66612
 Chicago, IL, 60623-

Building ID 1121U
Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
 2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
011	
011A	
013	
014	
015	
016	
017	
018	
019	
020	
121	
122	
123	
124	
124M	
125	
125M	
21	
22	
23	
24	
25	
25M	
26	

Chicago Public Schools

Youth Connection -
Community Service West -
Community Christian
School Academy
Address 1231 S. Pulaski Ave.

Unit 66612
Chicago, IL, 60623-

Building ID 1121U
Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
27	
28	

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **001**
MATERIAL DESCRIPTION: **2' x 4' Lay In Ceiling Panels**
HISTORICAL AHERA DAMAGE CATEGORY: **6 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **2025**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **001**
MATERIAL DESCRIPTION: **2' x 4' Lay In Ceiling Panels**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **2025** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **002**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1458** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **002**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1458** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **003**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1458** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **003**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile Mastic**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1458** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community
Service West - Community Christian
Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **004**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **004**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community
Service West - Community Christian
Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005**
MATERIAL DESCRIPTION: **Black Cove Base**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **005**
MATERIAL DESCRIPTION: **Black Cove Base**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006**
MATERIAL DESCRIPTION: **Red Cove Base**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **006**
MATERIAL DESCRIPTION: **Red Cove Base**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community
Service West - Community Christian
Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **007**
MATERIAL DESCRIPTION: **Red Vinyl Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **007**
MATERIAL DESCRIPTION: **Red Vinyl Flooring**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **008**
MATERIAL DESCRIPTION: **Black Cove Base Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **008**
MATERIAL DESCRIPTION: **Black Cove Base Adhesive**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **3800** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **009**
MATERIAL DESCRIPTION: **Red Cove Base Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **009**
MATERIAL DESCRIPTION: **Red Cove Base Adhesive**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **010**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Offices and Entrance Hallway**
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **010**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Offices and Entrance Hallway**
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **011**
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Science Lab/Science Lecture Classroom 7B**
MATERIAL QUANTITY: **1350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **011**
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile**
MATERIAL LOCATION: **Science Lab/Science Lecture Classroom 7B**
MATERIAL QUANTITY: **1350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **013**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Science Lab/ Science Lecture Classroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **013**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard**
MATERIAL LOCATION: **Science Lab/ Science Lecture Classroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **014**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Science Lab/ Science Lecture Classroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **014**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard Adhesive**
MATERIAL LOCATION: **Science Lab/ Science Lecture Classroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **015**
MATERIAL DESCRIPTION: **2' x 4' Lay In Ceiling Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Science Lab/Science Lecture Classroom/Washrooms**
MATERIAL QUANTITY: **2025** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **015**
MATERIAL DESCRIPTION: **2' x 4' Lay In Ceiling Panels**
MATERIAL LOCATION: **Science Lab/Science Lecture Classroom/Washrooms**
MATERIAL QUANTITY: **2025** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community
Service West - Community Christian
Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **016**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Washrooms and CFO Office**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **016**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard**
MATERIAL LOCATION: **Washrooms and CFO Office**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community
Service West - Community Christian
Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **017**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Washrooms and CFO Office**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **017**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard Adhesive**
MATERIAL LOCATION: **Washrooms and CFO Office**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **018**
MATERIAL DESCRIPTION: **Blue Carpet Adhesive - ABATED**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Multi-Purpose Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **07/25/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **018**
MATERIAL DESCRIPTION: **Blue Carpet Adhesive - ABATED**
MATERIAL LOCATION: **Multi-Purpose Room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **019**
MATERIAL DESCRIPTION: **12" x 12" Brown Speckled Floor Tile (Not Observed)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Entrway Hallway**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **019**
MATERIAL DESCRIPTION: **12" x 12" Brown Speckled Floor Tile (Not Observed)**
MATERIAL LOCATION: **Entrway Hallway**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **020**
MATERIAL DESCRIPTION: **Mastic Associated with 12"x 12" Brown Floor Tile(Not observed)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Entrway Hallway**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **020**
MATERIAL DESCRIPTION: **Mastic Associated with 12"x 12" Brown Floor Tile(Not observed)**
MATERIAL LOCATION: **Entrway Hallway**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **121**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 8, 9, 10 and Office 8 - Addition Building**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **121**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Rooms 8, 9, 10 and Office 8 - Addition Building**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **122**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 8, 9, 10 and Office 8 - Addition Building**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **122**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
MATERIAL LOCATION: **Rooms 8, 9, 10 and Office 8 - Addition Building**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **123**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Entrance - Addition Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **123**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
MATERIAL LOCATION: **Entrance - Addition Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUILDING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **124**
MATERIAL DESCRIPTION: **12" x 12" Orange Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 8, 9, 10 and Office 8 - Addition Building**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **124**
MATERIAL DESCRIPTION: **12" x 12" Orange Floor Tile**
MATERIAL LOCATION: **Rooms 8, 9, 10 and Office 8 - Addition Building**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **124M**
MATERIAL DESCRIPTION: **12" x 12' Orange Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 8, 9, 10 and Office 8 - Addition Building**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **124M**
MATERIAL DESCRIPTION: **12" x 12' Orange Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 8, 9, 10 and Office 8 - Addition Building**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **125**
MATERIAL DESCRIPTION: **12" x 12" Tan & White Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 1 - Addition Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **125**
MATERIAL DESCRIPTION: **12" x 12" Tan & White Floor Tile**
MATERIAL LOCATION: **Room 1 - Addition Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **125M**
MATERIAL DESCRIPTION: **12" x 12" Tan & White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 1 - Addition Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **125M**
MATERIAL DESCRIPTION: **12" x 12" Tan & White Floor Tile Mastic**
MATERIAL LOCATION: **Room 1 - Addition Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUILDING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **6" x 6" White Grey Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Men's/Women's Wash Rooms on Northwest Side**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **6" x 6" White Grey Ceramic Tile Grout**
MATERIAL LOCATION: **Men's/Women's Wash Rooms on Northwest Side**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUILDING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community
Service West - Community Christian
Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **6" x 6" White Grey Ceramic Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Men's/Women's Wash Rooms on Northwest Side**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **6" x 6" White Grey Ceramic Tile Adhesive**
MATERIAL LOCATION: **Men's/Women's Wash Rooms on Northwest Side**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community
Service West - Community Christian
Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12" x 12" Black, Yellow, Brown Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Men's/Women's Wash Rooms Across from Addition**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12" x 12" Black, Yellow, Brown Ceramic Tile Grout**
MATERIAL LOCATION: **Men's/Women's Wash Rooms Across from Addition**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community
Service West - Community Christian
Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12" x 12" Black, Yellow, Brown Ceramic Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Men's/Women's Wash Rooms Across from Addition**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12" x 12" Black, Yellow, Brown Ceramic Tile Adhesive**
MATERIAL LOCATION: **Men's/Women's Wash Rooms Across from Addition**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Entrance to lunch room as patch**
MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown Floor Tile**
MATERIAL LOCATION: **Entrance to lunch room as patch**
MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection - Community Service West - Community Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25M**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Entrance to lunch room as patch**
MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUIDLING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **25M**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown Floor Tile Mastic**
MATERIAL LOCATION: **Entrance to lunch room as patch**
MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUILDING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile w/ Pinholes**
MATERIAL LOCATION: **Counseling Office**
MATERIAL QUANTITY: **135** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUILDING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service West
- Community Christian
Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile w/ Pinholes**
MATERIAL LOCATION: **Counseling Office**
MATERIAL QUANTITY: **135** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **10/10/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUILDING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **2 'x 4' Smooth Ceiling Tile**
MATERIAL LOCATION: **Food Services, Janitor's Closet**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUILDING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service West
- Community Christian
Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **2 'x 4' Smooth Ceiling Tile**
MATERIAL LOCATION: **Food Services, Janitor's Closet**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: 10/10/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUILDING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Orange Fire Caulk on Conduit**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: 07/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUILDING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service West
- Community Christian
Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Orange Fire Caulk on Conduit**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: 10/10/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUILDING ID: **1121U**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Youth Connection -
Community Service
West - Community
Christian Academy** INSPECTION DATE: **7/25/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **011A**
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile Mastic**
MATERIAL LOCATION: **Science Lab/Science Lecture Classroom 7B**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **07/25/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66612** BUILDING ID: **1121U**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Youth Connection -
Community Service West
- Community Christian
Academy** REVIEW DATE: **10/10/2019**
ADDRESS: **1231 S. Pulaski Ave.** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **011A**
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile Mastic**
MATERIAL LOCATION: **Science Lab/Science Lecture Classroom 7B**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: 10/10/2019

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois 62761-6000 • www.dph.illinois.gov

4/20/2016

ROBERTO RIVERA
855 WEST ADAMS STREET, STE 200
CHICAGO, IL 60607


ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 06327

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS SUPERVISOR/WORKER INSPECTOR	TC EXPIRES 1/20/2017 1/6/2017
ID NUMBER 100 - 06327	ISSUED 4/20/2016	EXPIRES 05/15/2017	PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/20/2017
ROBERTO RIVERA 855 WEST ADAMS STREET, ST CHICAGO, IL 60607 Environmental Health			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Roberto Rivera

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 2/15/2019

Exam Date: 2/15/2019

Expiration Date: 2/15/2020

Certificate Number: BIR1902150525

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

ROBERTO RIVERA
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/19/2019

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 06327

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

			ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 06327	ISSUED 4/19/2019	EXPIRES 05/15/2020	SUPERVISOR/WORKER INSPECTOR		2/22/2020 2/15/2020	
ROBERTO RIVERA 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			PROJECT MANAGER AIR SAMPLING PROFESSIONAL		2/22/2020	
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.						

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

2016



OCCUPATIONAL TRAINING & SUPPLY, INC.
7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Roberto Rivera

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/6/2016

Exam Date: 1/6/2016

Expiration Date: 1/6/2017

Certificate Number: BIR1601060030



Kathy DeSalvo, Director

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 2/28/2019

Exam Date: 2/28/2019

Expiration Date: 2/28/2020

Certificate Number: MPR1902280695

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/19/2019




ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
			INSPECTOR	2/28/2020
ID NUMBER	ISSUED	EXPIRES	PROJECT DESIGNER	3/15/2020
100 - 07342	4/19/2019	05/15/2020	MANAGEMENT PLANNER	2/28/2020
JIGAR M SHAH			PROJECT MANAGER	2/22/2020
2942 W VAN BUREN ST			AIR SAMPLING PROFESSIONAL	
CHICAGO, IL 60612			Alteration of this license shall result in legal action	
Environmental Health			This license issued under authority of the State of Illinois	
			Department of Public Health	
			This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed