

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2840
SCHOOL NAME: Latino Youth Alternative High School
ADDRESS OF SCHOOL: 2001 California
CITY: Chicago, IL, 60608

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 182
IDPH INSPECTOR LICENSE NUMBER: 100-18350
IDPH LICENSED INSPECTOR NAME(Please Print): Joseph Hennigan
IDPH MP LICENSE NUMBER: 100-04019
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Arturo Saenz

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Latino Youth Alternative High School

2001 California
Chicago, IL, 60608

Unit: 66619
Building ID: 1121E

IDPH ID Number: 14-016-2990-2840

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

GSG-Probe Consulting, Inc.

2942 W. Van Buren

Chicago, IL, 60612

Phone 3123197575

Fax

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

October 29, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

GSG-Probe Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 66619 Region: IDPH ID:14-016-2990-2840

School: Latino Youth Alternative High School Building ID: 1121E

Address: 2001 California
Chicago, IL, 60608

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 11/01/2019

Inspector: Joseph Hennigan Inspector IDPH License: 100-18350
Management Planner: Arturo Saenz Management Planner IDPH License: 100-04019

If you have any questions or comments, please contact us at 3123197575

Sincerely,
GSG-Probe Consulting, Inc.

Arturo Saenz
100-04019

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: October 29, 2019

RE: Latino Youth Alternative High School, Unit 66619
2001 California
Chicago, IL, 60608

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Latino Youth Alternative High School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Latino Youth Alternative High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Latino Youth Alternative High School Unit: 66619 Region:
Address: 2001 California Chicago, IL, 60608
IDPH ID: 14-016-2990-2840 Building ID: 1121E
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 182

3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: GSG-Probe Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren
Chicago, IL, 60612
Phone: 3123197575 Fax:

5. Inspector

Inspector Name: Joseph Hennigan

Inspector IDPH license # 100-18350 Signature:
Date: 10/29/2019

6. Management Planner

Management Planner Name: Arturo Saenz

Management Planner IDPH license # 100-04019 Signature:
Date: 11/01/2019

7. Review Date:11/01/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

GSG-Probe Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Latino Youth Alternative High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1121E:

B. The following new homogenous areas have been identified for Building 1121E:

M01	CMU System
M02	Brick & Mortar System
M03	Drywall System
M04	Multi-Colored Square Carpet Squares Mastic
M05	Red Carpet Mastic
M06	Wood Laminate Flooring & Mastic
M07	Beige Vinyl Basboard Mastic
M08	Maroon Vinyl Baseboard Mastic
M09	Interior Window Caulk
M10	Gray / Green Carpet Mastic
M11	Wood Slate Flooring
M12	12" x 12" Cream Ceramic Floor Tile Adhesive
M12A	12" x 12" Cream Ceramic Tile Grout
M13	2' x 2' White Pinhole Ceiling Tile
M14	12" x 12" Tan w/ Beige Specs VFT
M14A	12" x 12" Tan w/ Beige Specs VFT Mastic
M15	2' x 4' White Fissured Ceiling Tile
M16	Gray Vinyl Baseboard Mastic
M17	12" x 12" Gray & Tan Ceramic Tile Adhesive
M17A	12" x 12" Gray & Tan Ceramic Tile Grout
M18	Black Desk Top
M19	Fire Door
M20	Black Vinyl Baseboard Mastic

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

M01	CMU System
M02	Brick & Mortar System
M03	Drywall System
M04	Multi-Colored Square Carpet Squares Mastic
M05	Red Carpet Mastic
M06	Wood Laminate Flooring & Mastic
M07	Beige Vinyl Basboard Mastic
M08	Maroon Vinyl Baseboard Mastic
M09	Interior Window Caulk
M10	Gray / Green Carpet Mastic
M11	Wood Slate Flooring
M12	12" x 12" Cream Ceramic Floor Tile Adhesive
M12A	12" x 12" Cream Ceramic Tile Grout
M13	2' x 2' White Pinhole Ceiling Tile
M14	12" x 12" Tan w/ Beige Specs VFT
M14A	12" x 12" Tan w/ Beige Specs VFT Mastic
M15	2' x 4' White Fissured Ceiling Tile
M16	Gray Vinyl Baseboard Mastic
M17	12" x 12" Gray & Tan Ceramic Tile Adhesive
M17A	12" x 12" Gray & Tan Ceramic Tile Grout
M18	Black Desk Top
M19	Fire Door
M20	Black Vinyl Baseboard Mastic

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Joseph Hennigan, IDPH License # 100-18350. The Management Plan was updated by Arturo Saenz, IDPH License # 100-04019. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Latino Youth Alternative High School Building 1121E Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Latino Youth Alternative High School Unit 66619 Building ID 1121E

Address 2001 California Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
M01	CMU System	400	SF	Lobby, Room 200	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M02	Brick & Mortar System	12,000	SF	Throughout Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M03	Drywall System	5,000	SF	Throughout Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M04	Multi-Colored Square Carpet Squares Mastic	8,000	SF	Throughout Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M05	Red Carpet Mastic	600	SF	Reception Area, Rooms 201, 202, 203, 204, 205, 206, 207, 208, 210, 212, 214, Electrical Closet, 222, 221, 223, 225, 226, 227, 228, 230, 232, Mail Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M06	Wood Laminate Flooring & Mastic	600	SF	Room 200, 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M07	Beige Vinyl Basboard Mastic	2,000	LF	Reception Area, Rooms 200, 201, 202, 203, 204, 205, 206, 207, 208, 210, 212, 214, Electrical Closet, 222, 221, 223, 224, 225, 226, 227, 228, 230, 232, Media Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M08	Maroon Vinyl Baseboard Mastic	1,500	LF	Throughout Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M09	Interior Window Caulk	500	LF	Rooms 200, 202, 204, 206, 208, 210, 212, 214, Locker Room, 218, 220, 222, 224, 226, 228	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M10	Gray / Green Carpet Mastic	200	SF	Supply Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M11	Wood Slate Flooring	450	SF	Locker Area, Room 220	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M12	12" x 12" Cream Ceramic Floor Tile Adhesive	700	SF	Rooms 219, Washrooms, Mop Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M12A	12" x 12" Cream Ceramic Tile Grout	700	SF	Rooms 219, Washrooms, Mop Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Latino Youth Alternative High School Unit 66619 Building ID 1121E

Address 2001 California Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
M13	2' x 2' White Pinhole Ceiling Tile	400	SF	Restrooms, Rooms 220, 221	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
M14	12" x 12" Tan w/ Beige Specs VFT	150	SF	HUB Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M14A	12" x 12" Tan w/ Beige Specs VFT Mastic	150	SF	HUB Room	ASSUMED	MISC	N	NONE	5		No	ACBM with potential for significant damage	5	LOW
M15	2' x 4' White Fissured Ceiling Tile	250	SF	Room 218	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M16	Gray Vinyl Baseboard Mastic	150	SF	Room 218	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M17	12" x 12" Gray & Tan Ceramic Tile Adhesive	400	SF	Room 218	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M17A	12" x 12" Gray & Tan Ceramic Tile Grout	400	SF	Room 218	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M18	Black Desk Top	13	EA	Rooms 202, 218	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M19	Fire Door	4	EA	Exterior Doors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M20	Black Vinyl Baseboard Mastic	100	LF	Room 219	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Latino Youth Alternative High School Unit 66619 Building ID 1121E
Address 2001 California Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612
Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 10/29/2019
Inspector Name Joseph Hennigan
100-18350 5/15/2020
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
M01	
M02	
M03	
M04	
M05	
M06	
M07	
M08	
M09	
M10	
M11	
M12	
M12A	
M13	
M14	
M14A	
M15	
M16	
M17	
M17A	
M18	
M19	
M20	

Chicago Public Schools

School Latino Youth Alternative High School **Unit** 66619 **Building ID** 1121E
Address 2001 California **Region**

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School Latino Youth Alternative High School

Unit 66619

Building ID 1121E

Address 2001 California

Chicago, IL, 60608

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
M01	CMU System	400	SF	Lobby, Room 200	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M02	Brick & Mortar System	12,000	SF	Throughout Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M03	Drywall System	5,000	SF	Throughout Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M04	Multi-Colored Square Carpet Squares Mastic	8,000	SF	Throughout Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M05	Red Carpet Mastic	600	SF	Reception Area, Rooms 201, 202, 203, 204, 205, 206, 207, 208, 210, 212, 214, Electrical Closet, 222, 221, 223, 225, 226, 227, 228, 230, 232, Mail Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M06	Wood Laminate Flooring & Mastic	600	SF	Room 200, 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M07	Beige Vinyl Basboard Mastic	2,000	LF	Reception Area, Rooms 200, 201, 202, 203, 204, 205, 206, 207, 208, 210, 212, 214, Electrical Closet, 222, 221, 223, 224, 225, 226, 227, 228, 230, 232, Media Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
M08	Maroon Vinyl Baseboard Mastic	1,500	LF	Throughout Corridors	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
M09	Interior Window Caulk	500	LF	Rooms 200, 202, 204, 206, 208, 210, 212, 214, Locker Room, 218, 220, 222, 224, 226, 228	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
M10	Gray / Green Carpet Mastic	200	SF	Supply Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M11	Wood Slate Flooring	450	SF	Locker Area, Room 220	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M12	12" x 12" Cream Ceramic Floor Tile Adhesive	700	SF	Rooms 219, Washrooms, Mop Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M12A	12" x 12" Cream Ceramic Tile Grout	700	SF	Rooms 219, Washrooms, Mop Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M13	2' x 2' White Pinhole Ceiling Tile	400	SF	Restrooms, Rooms 220, 221	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M14	12" x 12" Tan w/ Beige Specs VFT	150	SF	HUB Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M14A	12" x 12" Tan w/ Beige Specs VFT Mastic	150	SF	HUB Room	Assumed	MISC	No	5	SF	5 ACBM with potential for significant damage	Follow O&M Plan
M15	2' x 4' White Fissured Ceiling Tile	250	SF	Room 218	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M16	Gray Vinyl Baseboard Mastic	150	SF	Room 218	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M17	12" x 12" Gray & Tan Ceramic Tile Adhesive	400	SF	Room 218	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M17A	12" x 12" Gray & Tan Ceramic Tile Grout	400	SF	Room 218	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M18	Black Desk Top	13	EA	Rooms 202, 218	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
M19	Fire Door	4	EA	Exterior Doors	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
M20	Black Vinyl Baseboard Mastic	100	LF	Room 219	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Latino Youth Alternative
High School

Unit 66619

Building ID 1121E

Address 2001 California

Chicago, IL, 60608

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

Review Date	11/01/2019
Manager Planner Name	Arturo Saenz
100-04019	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
M01	
M02	
M03	
M04	
M05	
M06	

Chicago Public Schools

School Latino Youth Alternative
High School

Unit 66619

Building ID 1121E

Address 2001 California

Chicago, IL, 60608

Region

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
M07	
M08	
M09	
M10	
M11	
M12	
M12A	
M13	
M14	
M14A	Replace Damaged VFT
M15	
M16	
M17	
M17A	
M18	
M19	
M20	

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M05**

MATERIAL DESCRIPTION: **Red Carpet Mastic**

MATERIAL LOCATION: **Reception Area, Rooms 201, 202, 203, 204, 205, 206, 207, 208, 210, 212, 214, Electrical Closet, 222, 221, 223, 225, 226, 227, 228, 230, 232, Mail Room**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE:

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	66619	BUILDING ID:	1121E
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Latino Youth Alternative High School	REVIEW DATE:	11/1/2019		
ADDRESS:	2001 California	IDPH LICENSE NO:	100-18350		
HOMOGENEOUS AREA:	M05				
MATERIAL DESCRIPTION:	Red Carpet Mastic				
MATERIAL LOCATION:	Reception Area, Rooms 201, 202, 203, 204, 205, 206, 207, 208, 210, 212, 214, Electrical Closet, 222, 221, 223, 225, 226, 227, 228, 230, 232, Mail Room				
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: 11/01/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M14A**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ Beige Specs VFT Mastic**
MATERIAL LOCATION: **HUB Room**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **5** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M14A**

MATERIAL DESCRIPTION: **12" x 12" Tan w/ Beige Specs VFT Mastic**

MATERIAL LOCATION: **HUB Room**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **5** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Replace Damaged VFT

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M07**

MATERIAL DESCRIPTION: **Beige Vinyl Basboard Mastic**

MATERIAL LOCATION: **Reception Area, Rooms 200, 201, 202, 203, 204, 205, 206, 207, 208, 210, 212, 214, Electrical Closet, 222, 221, 223, 224, 225, 226, 227, 228, 230, 232, Media Room**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**

MATERIAL CATEGORY: **MISC** FRIABLE:

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**

SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**

ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M07**

MATERIAL DESCRIPTION: **Beige Vinyl Basboard Mastic**

MATERIAL LOCATION: **Reception Area, Rooms 200, 201, 202, 203, 204, 205, 206, 207, 208, 210, 212, 214, Electrical Closet, 222, 221, 223, 224, 225, 226, 227, 228, 230, 232, Media Room**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M13**
MATERIAL DESCRIPTION: **2' x 2' White Pinhole Ceiling Tile**
MATERIAL LOCATION: **Restrooms, Rooms 220, 221**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M13**
MATERIAL DESCRIPTION: **2' x 2' White Pinhole Ceiling Tile**
MATERIAL LOCATION: **Restrooms, Rooms 220, 221**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M17A**
MATERIAL DESCRIPTION: **12" x 12" Gray & Tan Ceramic Tile Grout**
MATERIAL LOCATION: **Room 218**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M17A**

MATERIAL DESCRIPTION: **12" x 12" Gray & Tan Ceramic Tile Grout**

MATERIAL LOCATION: **Room 218**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M18**
MATERIAL DESCRIPTION: **Black Desk Top**
MATERIAL LOCATION: **Rooms 202, 218**
MATERIAL QUANTITY: **13** MATERIAL UNITS: **EA**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **EA**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M18**
MATERIAL DESCRIPTION: **Black Desk Top**
MATERIAL LOCATION: **Rooms 202, 218**
MATERIAL QUANTITY: **13** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: 11/01/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M03**
MATERIAL DESCRIPTION: **Drywall System**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M03**
MATERIAL DESCRIPTION: **Drywall System**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: 11/01/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M06**
MATERIAL DESCRIPTION: **Wood Laminate Flooring & Mastic**
MATERIAL LOCATION: **Room 200, 201**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**

SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**

ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M06**

MATERIAL DESCRIPTION: **Wood Laminate Flooring & Mastic**

MATERIAL LOCATION: **Room 200, 201**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M08**
MATERIAL DESCRIPTION: **Maroon Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Throughout Corridors**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M08**
MATERIAL DESCRIPTION: **Maroon Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Throughout Corridors**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M09**
MATERIAL DESCRIPTION: **Interior Window Caulk**
MATERIAL LOCATION: **Rooms 200, 202, 204, 206, 208, 210, 212, 214, Locker Room, 218, 220, 222, 224, 226, 228**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	66619	BUILDING ID:	1121E
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Latino Youth Alternative High School	REVIEW DATE:	11/1/2019		
ADDRESS:	2001 California	IDPH LICENSE NO:	100-18350		
HOMOGENEOUS AREA:	M09				
MATERIAL DESCRIPTION:	Interior Window Caulk				
MATERIAL LOCATION:	Rooms 200, 202, 204, 206, 208, 210, 212, 214, Locker Room, 218, 220, 222, 224, 226, 228				
MATERIAL QUANTITY:	500	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: 11/01/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M14**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ Beige Specs VFT**
MATERIAL LOCATION: **HUB Room**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M14**

MATERIAL DESCRIPTION: **12" x 12" Tan w/ Beige Specs VFT**

MATERIAL LOCATION: **HUB Room**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M01**
MATERIAL DESCRIPTION: **CMU System**
MATERIAL LOCATION: **Lobby, Room 200**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M01**
MATERIAL DESCRIPTION: **CMU System**
MATERIAL LOCATION: **Lobby, Room 200**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: 11/01/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M04**
MATERIAL DESCRIPTION: **Multi-Colored Square Carpet Squares Mastic**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M04**
MATERIAL DESCRIPTION: **Multi-Colored Square Carpet Squares Mastic**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M20**
MATERIAL DESCRIPTION: **Black Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Room 219**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M20**
MATERIAL DESCRIPTION: **Black Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Room 219**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: 11/01/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M02**
MATERIAL DESCRIPTION: **Brick & Mortar System**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M02**
MATERIAL DESCRIPTION: **Brick & Mortar System**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M10**
MATERIAL DESCRIPTION: **Gray / Green Carpet Mastic**
MATERIAL LOCATION: **Supply Closet**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M10**
MATERIAL DESCRIPTION: **Gray / Green Carpet Mastic**
MATERIAL LOCATION: **Supply Closet**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M11**
MATERIAL DESCRIPTION: **Wood Slate Flooring**
MATERIAL LOCATION: **Locker Area, Room 220**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M11**
MATERIAL DESCRIPTION: **Wood Slate Flooring**
MATERIAL LOCATION: **Locker Area, Room 220**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M12**
MATERIAL DESCRIPTION: **12" x 12" Cream Ceramic Floor Tile Adhesive**
MATERIAL LOCATION: **Rooms 219, Washrooms, Mop Closet**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M12**
MATERIAL DESCRIPTION: **12" x 12" Cream Ceramic Floor Tile Adhesive**
MATERIAL LOCATION: **Rooms 219, Washrooms, Mop Closet**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: 11/01/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M12A**
MATERIAL DESCRIPTION: **12" x 12" Cream Ceramic Tile Grout**
MATERIAL LOCATION: **Rooms 219, Washrooms, Mop Closet**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M12A**
MATERIAL DESCRIPTION: **12" x 12" Cream Ceramic Tile Grout**
MATERIAL LOCATION: **Rooms 219, Washrooms, Mop Closet**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M16**
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Room 218**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M16**
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Room 218**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: 11/01/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M19**
MATERIAL DESCRIPTION: **Fire Door**
MATERIAL LOCATION: **Exterior Doors**
MATERIAL QUANTITY: **4** MATERIAL UNITS: **EA**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **EA**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M19**
MATERIAL DESCRIPTION: **Fire Door**
MATERIAL LOCATION: **Exterior Doors**
MATERIAL QUANTITY: **4** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M15**
MATERIAL DESCRIPTION: **2' x 4' White Fissured Ceiling Tile**
MATERIAL LOCATION: **Room 218**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M15**
MATERIAL DESCRIPTION: **2' x 4' White Fissured Ceiling Tile**
MATERIAL LOCATION: **Room 218**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Latino Youth Alternative High School** INSPECTION DATE: **10/29/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **M17**
MATERIAL DESCRIPTION: **12" x 12" Gray & Tan Ceramic Tile Adhesive**
MATERIAL LOCATION: **Room 218**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 10/29/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66619** BUILDING ID: **1121E**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Latino Youth Alternative High School** REVIEW DATE: **11/1/2019**
ADDRESS: **2001 California** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **M17**

MATERIAL DESCRIPTION: **12" x 12" Gray & Tan Ceramic Tile Adhesive**

MATERIAL LOCATION: **Room 218**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **11/01/2019**

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.idph.illinois.gov

4/18/2016

JOSEPH L HENNIGAN
 855 W ADAMS, SUITE 200
 CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 18350

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
 ASBESTOS PROFESSIONAL LICENSE			INSPECTOR	2/13/2017
ID NUMBER	ISSUED	EXPIRES	PROJECT MANAGER	2/6/2017
100 - 10350	4/18/2016	05/15/2017	AIR SAMPLING PROFESSIONAL	
JOSEPH L HENNIGAN 855 W ADAMS, SUITE 200 CHICAGO, IL 60607 Environmental Health			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
 EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JOSEPH L HENNIGAN
2942 W VAN BUREN ST
CHICAGO, IL 60612

5/9/2018

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 18350

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

FRONT OF LICENSE			BACK OF LICENSE	
	ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 18350	ISSUED 5/9/2018	EXPIRES 05/15/2019	INSPECTOR	2/10/2019
JOSEPH L HENNIGAN 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			PROJECT MANAGER AIR SAMPLING PROFESSIONAL	2/3/2019
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that JOSEPH L. HENNIGAN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 02/09/2019 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



02/09/2019

Course Dates:

02/09/2020

Expires:

1902BIR15

Certificate Number:

Nicholas J. Peneff

Director of Training
Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that JOSEPH L. HENNIGAN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 02/13/2016 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

02/13/2016

Course Dates:

02/13/2017

Expires:

1602BIR15

Certificate Number:



N. Penoff

Director of Training

Nicholas J. Penoff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JOSEPH L HENNIGAN
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/19/2019

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 18350

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

			ASBESTOS PROFESSIONAL LICENSE	
ID NUMBER 100 - 18350	ISSUED 4/19/2019	EXPIRES 05/15/2020	ENDORSEMENTS	TC EXPIRES
JOSEPH L HENNIGAN 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			INSPECTOR	2/9/2020
			PROJECT MANAGER	2/2/2020
			AIR SAMPLING PROFESSIONAL	
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that JOSEPH L. HENNIGAN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 02/09/2019 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



02/09/2019

Course Dates:

02/09/2020

Expires:

1902BIR15

Certificate Number:

Nicholas J. Peneff

Director of Training
Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Arturo Saenz

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 2/28/2019

Exam Date: 2/28/2019

Expiration Date: 2/28/2020

Certificate Number: MPR1902280693

Kathy DeSalvo, Director



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER	ISSUED	EXPIRES
100 - 04019	4/30/2019	05/15/2020

ARTURO SAENZ
2942 W VAN BUREN ST
CHICAGO, IL 60612
Environmental Health



ENDORSEMENTS	TC EXPIRES
INSPECTOR	2/28/2020
MANAGEMENT PLANNER	2/28/2020
AIR SAMPLING PROFESSIONAL	
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed