

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2887  
SCHOOL NAME: Chavez Resource Ctr  
ADDRESS OF SCHOOL: 4946 S. Paulina  
CITY: Chicago, IL, 60609

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: \_\_\_\_\_ ENROLLMENT 99  
IDPH INSPECTOR LICENSE NUMBER: \_\_\_\_\_  
IDPH LICENSED INSPECTOR NAME(Please Print): \_\_\_\_\_  
IDPH MP LICENSE NUMBER: \_\_\_\_\_  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): \_\_\_\_\_

DESIGNATED PERSON (Please Print): \_\_\_\_\_ PHONE: \_\_\_\_\_

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_  
School has been closed. Date closed: \_\_\_\_\_  
School building has been demolished. Date: \_\_\_\_\_  
School building is asbestos free since last reinspection: Y

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Chavez Resource Ctr**

4946 S. Paulina  
Chicago, IL, 60609

Unit: 67021  
Building ID: 5641

IDPH ID Number: 14-016-2990-2887

**REPORT DATE:**

**Prepared for:**  
**Chicago Public Schools**  
**42 West Madison Street**  
**Chicago, IL 60602**

**Prepared by:**

, ,

Phone

Fax

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

Mr. Glen E. Garner  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 25152                      Region: 04                      IDPH ID:14-016-2990-2887

School: Chavez Resource Ctr                      Building ID: 5641

Address: 4946 S. Paulina

Chicago, IL, 60609

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date:

Inspector:

Inspector IDPH License:

Management Planner:

Management Planner IDPH License:

If you have any questions or comments, please contact us at

Sincerely,

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date:

RE: Chavez Resource Ctr, Unit 67021  
4946 S. Paulina  
Chicago, IL, 60609

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Chavez Resource Ctr, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Chavez Resource Ctr, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact , the designated Local Education Authority's Designated Person at .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School:	Chavez Resource Ctr	Unit: 25152	Region: 04
Address:	4946 S. Paulina	Chicago, IL, 60609	
IDPH ID:	14-016-2990-2887	Building ID: 5641	
Contact:		Phone:	

### 2. Description of Facility

Original Construction:	Additional Construction:
Total Square Footage:	No of Floors:
Current Occupancy: 99	

### 3. LEA Designated Person

Contact:	Phone:
Address: 42 West Madison Street	
Chicago, IL 60602	

### 4. Managing Environmental Consultant

MEC:	
Contact:	
Address	
Phone: ' '	Fax:

### 5. Inspector

Inspector Name:

Inspector IDPH license #	Signature:
	Date:

### 6. Management Planner

Management Planner Name:

Management Planner IDPH license #	Signature:
	Date:

### 7. Review Date:

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Name:

## II. EXECUTIVE SUMMARY

was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Chavez Resource Ctr. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 5641:

B. The following new homogenous areas have been identified for Building 5641:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by , IDPH License # . The Management Plan was updated by , IDPH License # . Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Chavez Resource Ctr Building 5641 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Chavez Resource Ctr Unit 25152 Building ID 5641  
Address 4946 S. Paulina Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

, ,  
Phone: Fax:

*Inspector's Comments are Summarized at the End of the Report*

---

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
-------	----------------------	-------------------	----------------	-------------------	---------------	-------------------	---------	-------------	-----------------	--------------	-------------------------------	-----------------	---------------	-----------------------

# Chicago Public Schools

**School** Chavez Resource Ctr **Unit** 25152 **Building ID** 5641  
**Address** 4946 S. Paulina **Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)**

’ ’  
Phone: Fax:

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date
Inspector Name
Inspector's IDPH License Number / Expiration Date

Inspector's Comments	
HA Number:	Inspector Comments:

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

School

Chavez Resource Ctr

Unit

25152

Building ID

5641

Address

4946 S. Paulina

Chicago, IL, 60609

Region

04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC)

, ,

Phone:

Fax:

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
-----------	----------------------	-------------------	----------------	-------------------	---------------	-------------------	---------	-----------------	--------------	-----------------	----------

Review Date

Manager Planner Name

HA Number	Management Comments
-----------	---------------------

# Chicago Public Schools

School

Chavez Resource Ctr

Unit

25152

Building ID

5641

Address

4946 S. Paulina

Chicago, IL, 60609

Region

04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC)

, ,

Phone:

Fax:

*Management Planner's Comments Summarized at the End of the Report*

Manager IDPH License No/Expiration

# Chicago Public Schools

*2019 AHERA REINSPECTION*

# APPENDIX B

## Inspector and Management Planner Licenses

---

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	CODE	KEY
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed