

Chicago Public Schools

6 Month Asbestos Surveillance

2025 Fall Six Month Survey

School: John Barry Elementary School
Address: 2828 N. Kilbourn Ave.

Oracle Unit: 22141
Region: 02

Building ID: 2160
Mail Room: 29

Asbestos Surveyor: Cooke, Kevin
Survey Date: 11/14/2025
Email Address: kcooke1@cps.edu

CHECK HERE IF NO CHANGE TO ASBESTOS

A copy of the 2025/2026 notice to parents and staff regarding the asbestos management plan notifications was distributed via:
 Each child's backpack
 Notice printed in school's newsletter
 Notice printed in school's calendar
 Other

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
2A	12"x12" Beige w/ Red & Brown Spots Floor Tile	8000	SF	1st and 2nd Floor Corridor - 1927 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
2B	12"x12" Beige w/ Red & Brown Spots Floor Tile Mastic	8000	SF	1st and 2nd Floor Corridor - 1927 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
2C	12"x12" Orange Floor Tile	350	SF	Room 103 - 1927 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
2D	12"x12" Orange Floor Tile Mastic	350	SF	Room 103 - 1927 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
2E	12"x12" White w/ Tan Spots VFT (Not Observed)	200	SF	Room 113 Gym Office - 1927 Building (Not Observed)		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
2F	12"x12" White w/ Tan Spots VFT Mastic (Not Observed)	200	SF	Room 113 Gym Office - 1927 Building (Not Observed)		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
2G	12"x12" White w/ Gray Streaks Floor Tile	2000	SF	Engineers Office & Toilet, Room 100, 101 (Not Observed), Lunchroom, 111 - 1927 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
2H	12"x12" White w/ Gray Streaks Floor Tile Mastic	2000	SF	Engineers Office & Toilet, Room 100, 101 (Not Observed), Lunchroom, 111 - 1927 Building Damage Location: Engineer's room		Miscellaneous	No	Dist	15		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
2I	12x12 Light Blue w/ streaks VFT	2500	SF	Rms 100, 101, 113 and Main Office		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
2J	12x12 Light Blue w/ Streaks VFT Mastic	2500	SF	Rms 100, 101, 113 and Main Office		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
39	Hardcoat Plaster			Throughout - 1927 Building		Miscellaneous			0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
40	Textured Plaster			Auditorium, Auditorium Vestibule, Auditorium Stage - 1927 Building		Miscellaneous			0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
41	12"x12" Peach VFT	2300	SF	Room 105 (Lunchroom)		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
41M	12"x12" Peach VFT Mastic	2300	SF	Room 105 (Lunchroom)		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
42	2'x4' White with Grooves Ceiling Tile	8500	SF	Throughout - 1927 Building		Miscellaneous	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
43	2'x4' White With Grooves Ceiling Tile (Replacement)	888	SF	2nd Fl. Corridor, 213, 211, 209, 207, 206, 205, 204, 203, 202, 201, 200, 1st Floor Corridor, 110, 106, Lunchroom (105), 102		Miscellaneous	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
44	24"x24" Carpet Tile Mastic	1250	SF	Room 213		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
45	Carpet Mastic	750	SF	Auditorium		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
95-1	12"x12" Gray w/ Black Specks Floor Tile	2500	SF	Room # 1 through # 10, Office, Corridor, Boys & Girls Toilets, Men & Womens Toilets - 1995 Annex		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
95-2	12"x12" Gray w/ Black Specks Floor Tile Mastic	2500	SF	Room # 1 through # 10, Office, Corridor, Boys & Girls Toilets, Men & Womens Toilets - 1995 Annex		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
95-3	2'x4' White w/ Grooves Ceiling Tile	2500	SF	Room # 1, 2, 3, 4, 5, 6, 7, 8, 9, 10, Office, Corridor-1995 Annex		Miscellaneous	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
95-4	Gray Vinyl Baseboard	2500	SF	Throughout 1995 Annex		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
95-5	Gray Vinyl Baseboard Mastic			Throughout 1995 Annex		Miscellaneous			0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
95-6	Drywall			Throughout 1995 Annex		Miscellaneous			0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
95-7	Drywall Compound			Throughout 1995 Annex		Miscellaneous			0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
BB	Mag Block Pipe Insulation	360	LF	1st Floor Girl's Washrooms (hidden by steel enclosure); Boiler Room; Engine Room - 1927 Building		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
C	Boiler Gaskets	4	LF	Boiler # 1 and # 2, Boiler Room - 1927 Building		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
CC	Aircell Pipe Insulation	4450	LF	Throughout (Hidden by drop-ceiling), Throughout Basement - 1927 Building		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
DD	Cardboard Pipe Insulation	1500	LF	Tunnel Connecting to Boiler Room, North and South Basement Storage Rooms, Air Tunnel - 1927 Building		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
E	Boiler Packing	450	SF	Boiler Room - 1927 Building		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
EE	MJP E/F/V on Mag Block Pipe Insulation (Jacket of both boilers)	450	SF	Boiler Room, Engine Room (Jacket of both boilers) - 1927 Building		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
F	Boiler Packing, Pipe Insulation	10	LF	Boiler Room - 1927 Building		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
FF	Air Cell Duct Insulation	1500	SF	Unfinished Crawl Spaces - 1927 Building		TSI	Yes	Dist	150		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
GG	Repaired Plaster	4	SF	North Side Air Tunnel - 1927 Building		Surface	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
HH	MJP E/F/V on Aircell Pipe Insulation (Hidden by drop-ceiling)	310	LF	Throughout (See Hatching Maps) - 1927 Building (Hidden by drop-ceiling)		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
II	MJP E/F/V on Cardboard Pipe Insulation	85	LF	Tunnel Connecting to Boiler Room, North and South Basement Storage Rooms - 1927 Building		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
IK	12"x12" Light Blue VFT	200	SF	Main Office - 1927 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
IL	12"x12" Light Blue VFT Mastic	200	SF	Main Office - 1927 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
JJ	Interior Window Caulk			Interior Windows- 1927 Building		Miscellaneous			0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
 Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
KK	Exterior Window Caulk			Exterior Windows- 1927 Building		Miscellaneous			0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
 Comments:

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
M	12" x 12" Blue VFT	200	SF	Office 102		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
 Comments:

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

ALL LEA Responsibilities, for this school, will be met.

Richard J. Schleyer

Richard J.Schleyer

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

NOTICE TO PARENTS AND STAFF REGARDING THE
ASBESTOS MANAGEMENT PLAN NOTIFICATION

School: John Barry Elementary School

Date: 9/8/2025

This is to notify you in accordance with Illinois and Federal Asbestos Regulations, that a copy of the Asbestos Management Plan is available at each school during school hours by appointment. Requests to review the Asbestos Management Plan must be made at least 24 hours in advance.

Also please be advised that CPS conducts asbestos inspections of all Schools every three years. The last inspection was completed in 2025. Asbestos surveillances are conducted every six months.

CHECK ONE

- A copy of this notice was sent home in each child's backpack.
- A copy of this notice was printed in the school's newsletter and sent home with each child
- A copy of this notice was printed in the school's calendar and sent home with each child
- Other.
-

A COPY OF THIS NOTICE MUST BE PLACED IN THE
SCHOOL'S ASBESTOS MANAGEMENT PLAN.

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.