

Chicago Public Schools

6 Month Asbestos Surveillance

2025 Fall Six Month Survey

School: James Russell Lowell Elementary School
Address: 3320 W. Hirsch Street

Oracle Unit: 24251
Region: 02

Building ID: 4540
Mail Room: 35

CHECK HERE IF NO CHANGE TO ASBESTOS

Asbestos Surveyor: MCGINTY, Timothy
Survey Date: 12/12/2025
Email Address: _____

A copy of the 2025/2026 notice to parents and staff regarding the asbestos management plan notifications was distributed via:
 Each child's backpack
 Notice printed in school's newsletter
 Notice printed in school's calendar
 Other | Posted to CPS Website

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
04	9"x9" Green Floor Tile	600	SF	Room 040 - 1894 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments: Partial abatement and repairs

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
05	12"x12" Off White w/ Beige Streaks Floor Tile	7450	SF	Rooms 101, 120, 123, 202, 220, 223, 203, 303, 301, 322, 323, 221, Engineer's Office, 1st & 2nd Floor Men's Toilet - 1894 Bldg.		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments: N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
09	9"x9" Red Floor Tile	2000	SF	Auditorium - 1927 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:Partial abatement and repairs

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
10	9"x9" Green Floor Tile Mastic	600	SF	Room 040 - 1894 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:Partial abatement and repairs

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
11	9"x9" Red Floor Tile Mastic	2000	SF	Auditorium - 1927 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:Partial abatement and repairs

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
12	12"x12" White w/ Tan Spots Floor Tile	47565	SF	Rooms 319, 308, 306, 318, 305, 106, 108, 119 - 1913 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:RM 319 repaired due to leak

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
13	12"x12" Off White w/ Beige Streaks Floor Tile Mastic	6550	SF	Rooms 101, 104 (Abated), 120, 123, 202, 220, 223, 203, 303, 322, 323, 1st & 2nd Floor Men's Toilet, Engineer's Office - 1894 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:Rm 104 abated and repaired

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
14	12"x12" White w/ Tan Spots Floor Tile Mastic	47565	SF	Rooms 319, 308, 306, 318, 305, 106, 108, 119 - 1913 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:Repaired due to bad leak

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
15	12"x12" Tan w/ Brown Spots Floor Tile	4500	SF	Rooms 318 & 206 - 1913 Bldg.		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
16	12"x12" Tan w/ Brown Spots Floor Tile Mastic	4500	SF	Rooms 318 & 206 - 1913 Bldg.		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
17	9"x9" Black Floor Tile	2000	SF	Auditorium - 1927 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
18	9"x9" Black Floor Tile Mastic	2000	SF	Auditorium - 1927 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
19	9"x9" Tan Floor Tile	800	SF	Room 102 - 1894 Bldg.		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
20	9"x9" Tan Floor Tile Mastic	800	SF	Room 102 - 1894 Bldg.		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
21	12"x12" Sand Floor Tile	3200	SF	Rooms 010, 101, 201, 320 - 1894 Bldg.		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
22	12"x12" Sand Floor Tile Mastic	3200	SF	Rooms 010, 101, 201, 320 - 1894 Bldg.		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
23	12"x12" Gray Floor Tile	4100	SF	Rooms 103, 304, 104, 121, 120/Cafeteria - 1894 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:Rm 104 abated and repaired

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
24	12"x12" Gray Floor Tile Mastic	4100	SF	Rooms 103, 304, 104, 121, 120/Cafeteria - 1894 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:Rm 104 abated and repaired

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
25	Interior Window Caulk			Interior Windows - 1894 Bldg.							<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
26	Interior Window Caulk			Interior Windows - 1913 Bldg.							<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
27	Interior Window Caulk			Interior Windows - 1927 Bldg.							<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
28	Exterior Window Caulk			Exterior Windows - 1894 Bldg.							<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
29	Exterior Window Caulk			Exterior Windows - 1913 Bldg.							<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
30	Exterior Window Caulk			Exterior Windows - 1927 Bldg.							<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
31	Vinyl Baseboard			Library (217 & 218) - 1913 Bldg.							<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
32	Vinyl Baseboard Mastic			Library (217 & 218) - 1913 Bldg.							<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
33	12" x 12" Grey with Grey and White Specs Floor Tile	1144	SF	Rooms 102, 104/Teacher's Lounge, closet and washroom of room 110, 304, 301, library, and lunchroom - 1894 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:Rm 104 abated and repaired

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
34	12" x 12" Grey with Grey and White Specs Floor Tile Mastic	1144	SF	Rooms 102, 104/Teacher's Lounge, closet and washroom of room 110, 304, 301, library, and lunchroom - 1894 Bldg.		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments:Rm 104 abated and repaired

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
35	12" x 12" Blue with Specks Floor Tile	59	SF	Room 123 (not observed) and Kitchen Washroom		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
36	12" x 12" Blue with Specks Floor Tile Mastic	59	SF	Room 123 (not observed) and Kitchen Washroom		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
37	12" x 12" Dark Blue with Black Streaks Floor Tile	15	SF	Engineer's Office		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
38	12" x 12" Dark Blue with Black Streaks Floor Tile Mastic	15	SF	Engineer's Office		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
39	12" x 12" Tan with white specs VFT	900	SF	Room 317 - 1913 Bldg		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
40	12" x 12" Tan with white specs VFT Mastic	900	SF	Room 317 - 1913 Bldg		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
41	2' x 4' with 2' x 2' white pinhole pattern	10000	SF	3rd Floor - 1894 Bldg		Miscellaneous	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
42	12" x 12" Yellow with red specks VFT	450	SF	Room 108 - 1913 Bldg		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
43	12" x 12" Yellow with red specks VFT Mastic	450	SF	Room 108 - 1913 Bldg		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
44	12" x 12" Brown with yellow specks VFT	450	SF	Room 108 - 1913 Bldg		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
45	12" x 12" Brown with yellow specks VFT Mastic	450	SF	Room 108 - 1913 Bldg.		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
46	2' x 4' White wormy ceiling tile	900	SF	Kitchen (120) - 1894 Bldg.		Miscellaneous	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
47	1' x 1' White wormy ceiling tile	1500	SF	Rooms 023, and 221 - 1894 Bldg.		Miscellaneous	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
48	1' x 1' White wormy ceiling tile mastic	1500	SF	Rooms 023, and 221 - 1894 Bldg.		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
49	Gray Linoleum	900	SF	Room 209 (not observed)		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
 Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
49A	Gray Linoleum Mastic	900	SF	Room 209 (not observed)		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
 Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
50	12"x12" Orange VFT	100	SF	Room 319 (Library)		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Repaired
 Comments:Repaired Due to Bad leak

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
50M	12"x12" Orange VFT Mastic	100	SF	Room 319 (Library)		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Repaired
 Comments:Repaired Due to Bad leak

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
51	12"x12" Gray w/ Specs VFT	400	SF	Room 319 (Library)		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Repaired
 Comments: Repaired Due to Bad leak

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
51M	12"x12" Gray w/ Specs VFT Mastic	400	SF	Room 319 (Library)		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Repaired
 Comments: Repaired Due to Bad leak

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
52	12"x12" Light Gray w/ Specs VFT	400	SF	Room 319 (Library)		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Repaired
 Comments: Repaired Due to Bad leak

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
52A	12"x12" Light Gray w/ Specs VFT Mastic	400	SF	Room 319 (Library)		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Repaired
 Comments: Repaired Due to Bad leak

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
53	12"x12" Light Gray w/ White & Gray Specs Replacement VFT	155	SF	Room 119		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments: Partial Abatement and repair

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
53M	12"x12" Light Gray w/ White & Gray Specs Replacement VFT Mastic	155	SF	Room 119		Miscellaneous	No	None	0		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

2025 Fall Six Month Survey: Abated
Comments: Partial Abatement and repair

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
54	12"x12" Gray w/ White Specs Replacement VFT	5	SF	Room 123 - 1894 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments: N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
54M	12"x12" Gray w/ White Specs Replacement VFT Mastic	5	SF	Room 123 - 1894 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments: N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
55	12"x12" Beige w/ Tan Specs Replacement VFT	320	SF	Room 220 - 1894 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
55M	12"x12" Beige w/ Tan Specs Replacement VFT Mastic	320	SF	Room 220 - 1894 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
56	White Linoleum	1900	SF	Room 204 and Closet, Room 223 and Closet - 1894 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
56M	White Linoleum Mastic	1900	SF	Room 204 and Closet, Room 223 and Closet - 1894 Building		Miscellaneous	No	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
57	2'x4' White w/ Pinholes Ceiling Tile	1600	SF	Rooms 314 and 315 - 1927 Building		Miscellaneous	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
58	2'x4' White w/ Pinholes Ceiling Tile	1800	SF	Rooms 204 and 223 - 1894 Building		Miscellaneous	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
59	Textured Plaster Ceiling	1000	SF	Room 022 - Main Building		Surface	No	Loc	40		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
C	Cardboard Pipe Insulation	150	LF	Tank Room, Basement Corridor - 1894 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
D	MJP E/F/V on Cardboard Pipe Insulation	35	FITTING	Tank Room, Basement Corridor - 1894 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
E	Aircell Pipe Insulation	600	LF	Tank Room, & Engine Rooms - 1894 Bldg.		TSI	Yes	Loc	5		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
F	MJP E/F/V on Aircell Pipe Insulation	50	FITTING	Tank Room, & Engine Rooms - 1894 Bldg		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
G	Preform Pipe Insulation	75	LF	Coal Room - 1894 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
H	MJP E/F/V on Preform Pipe Insulation	25	FITTING	Coal Room - 1894 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
I	Aircell Duct	750	SF	South Unexcavated - 1927 Bldg.		TSI	Yes	Dist	150		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
K	Storage Tank Insulation	125	SF	Boiler Room - 1913 Bldg.		TSI	Yes	Loc	5		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
M	MJP E/F/V on Fiberglass Pipe Insulation	150	FITTING	Engine Room, 1st Floor Corridor, Boiler Room - 1913 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
N	MJP E/F/V on Fiberglass Pipe Insulation	30	FITTING	1st Floor Corridor, Girls and Boys Toilet Pipe Chases - 1927 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
O	Cardboard Pipe Insulation	300	LF	Unexcavated Area, Boiler Room, 1st Floor Corridor, & Engine Room - 1913 Bldg.		TSI	Yes	Dist	100		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
P	MJP E/F/V on Cardboard Pipe Insulation	60	FITTING	Boiler Room, 1st Floor Corridor, & Engine Room - 1913 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
Q	Aircell Pipe Insulation	800	LF	Engine Room, 1st Floor Corridor - 1913 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
R	Aircell Pipe Insulation	1200	LF	South and North Unexcavated Areas, Fan Room, Engine Room, Tunnels - 1927		TSI	Yes	Dist	400		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
 Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
S	MJP E/F/V on Aircell Pipe Insulation	110	FITTING	Engine Room, 1st Floor Corridor - 1913 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
 Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
T	MJP E/F/V on Aircell Pipe Insulation	400	FITTING	South and North Unexcavated Areas, Fan Room, Engine Room, Tunnels - 1927 Bldg.		TSI	Yes	Dist	20		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
 Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
U	Preform Pipe Insulation	275	LF	1st Floor Corridor, Engine Room - 1913 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
 Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
V	Preform Pipe Insulation	219	LF	Rooms 110-115, 210-215 - 1927 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
W	MJP E/F/V on Preform Pipe Insulation	34	FITTING	1st Floor Corridor, Engineers Office, Engine Room - 1913 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
X	2'x4' Wormy Ceiling Tile			Room 205 & 305 - 1913 Bldg.							<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
Y	2'x4' Dot Ceiling Tile (NOT OBSERVED)			Room 219 - 1913 Bldg.							<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile
Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category
Z	Boiler Breeching	150	SF	Boiler Room - 1913 Bldg.		TSI	Yes	None	0		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

2025 Fall Six Month Survey: No Change
Comments:N/A

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

ALL LEA Responsibilities, for this school, will be met.

Richard J. Schleyer

Richard J.Schleyer

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.

NOTICE TO PARENTS AND STAFF REGARDING THE
ASBESTOS MANAGEMENT PLAN NOTIFICATION

School: James Russell Lowell Elementary School

Date: 8/1/2025

This is to notify you in accordance with Illinois and Federal Asbestos Regulations, that a copy of the Asbestos Management Plan is available at each school during school hours by appointment. Requests to review the Asbestos Management Plan must be made at least 24 hours in advance.

Also please be advised that CPS conducts asbestos inspections of all Schools every three years. The last inspection was completed in 2025. Asbestos surveillances are conducted every six months.

CHECK ONE

- A copy of this notice was sent home in each child's backpack.
- A copy of this notice was printed in the school's newsletter and sent home with each child
- A copy of this notice was printed in the school's calendar and sent home with each child
- Other. Posted to CPS Website
-

A COPY OF THIS NOTICE MUST BE PLACED IN THE
SCHOOL'S ASBESTOS MANAGEMENT PLAN.

VFT = Vinyl Floor Tile

Friable = Can be crumbled, pulverized, or reduced to powder by hand pressure.