

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2315  
SCHOOL NAME: Linne School  
ADDRESS OF SCHOOL: 3221 N Sacramento  
CITY: Chicago, IL, 60618

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/22/2013**

**If the address on this form is different than the address of the building, submit a written explanation.**

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 5/31/2016 ENROLLMENT 642  
IDPH INSPECTOR LICENSE NUMBER: 100-06327  
IDPH LICENSED INSPECTOR NAME (Please Print): Roberto Rivera  
IDPH MP LICENSE NUMBER: 100-04019  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Arturo Saenz

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



5/31/2016

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Linne School**

3221 N Sacramento  
Chicago, IL, 60618

Unit: 24201  
Building ID: 4490

IDPH ID Number: 14-016-2990-2315

**REPORT DATE:**

Tuesday, May 31, 2016

**Prepared for:**

**Chicago Public Schools**  
**125 S. Clark Street**  
**Chicago, IL 60603**

**Prepared by:**

**GSG Consultants, Inc.**

855 W. Adams St., Ste. 200

Phone (312) 733-6262

Fax (312) 733-5612

**DO NOT REMOVE FROM SCHOOL**  
**REQUIRED BY FEDERAL LAW**

March 10, 2016

Mr. R. Kent Cook  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

GSG Consultants, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1,2,6 Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 24201                      Region: 01                      IDPH ID: 14-016-2990-2315

School: Linne School                      Building ID: 4490

Address: 3221 N Sacramento  
Chicago, IL, 60618

Building Contact:                      Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 05/30/2016

Inspector: Roberto Rivera                      Inspector IDPH License: 100-06327  
Management Planner: Arturo Saenz                      Management Planner IDPH License: 100-04019

If you have any questions or comments, please contact us at (312) 733-6262

Sincerely,  
GSG Consultants, Inc.



Arturo Saenz  
100-04019

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: March 10, 2016

RE: Linne School, Unit 24201  
3221 N Sacramento  
Chicago, IL, 60618

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Linne School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Linne School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197.

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Linne School  
Address: 3221 N Sacramento  
IDPH ID: 14-016-2990-2315  
Contact:

Unit: 24201  
Chicago, IL, 60618  
Building ID: 4490  
Phone:

Region: 01

### 2. Description of Facility

Original Construction: 1895  
Total Square Footage: 62500  
Current Occupancy: 642

Additional Construction:  
No of Floors:

### 3. LEA Designated Person

Contact: Robert Christlieb  
Address: 125 South Clark Street, 17th Floor  
Chicago, IL 60603

Phone: (773) 553-3197

### 4. Managing Environmental Consultant

MEC: GSG Consultants, Inc.  
Contact: Arturo Saenz  
Address 855 W. Adams St., Ste. 200  
Phone: (312) 733-6262

Fax: (312) 733-5612

### 5. Inspector

Inspector Name: Roberto Rivera

Inspector IDPH license # 100-06327



Signature:  
Date: 3/10/2016

### 6. Management Planner

Management Planner Name: Arturo Saenz

Management Planner IDPH license # 100-04019



Signature:  
Date: 05/30/2016

### 7. Review Date: 05/30/2016

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 5/31/2016

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

GSG Consultants, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Linne School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4490:

B. The following new homogenous areas have been identified for Building 4490:

79	12" X 12" Gray Speckled VFT
----	-----------------------------

79A	12" X 12" Gray Speckled VFT Mastic
-----	------------------------------------



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

11	Green Linoleum Mastic
12	Rust Color Linoleum Mastic
14	12"x12" Brown w/ Speckles VFT
18	12"x12" Brown w/ Speckles VFT Mastic
22	1'x1' Ceiling Tile Mastic
25	Rust Color Linoleum
26	12"x12" Off White w/ Brown Speckles VFT
28	12"x12" Brown w/ Speckles VFT
29	12"x12" Brown w/ Speckles VFT Mastic
34	12"x12" White w/ Brown Speckles VFT
36	12"x12" White w/ Gray Speckles VFT
37	12"x12" White w/ Gray Speckles VFT Mastic
38	12"x12" White w/ Gray Speckles VFT
39	12"x12" White w/ Gray Speckles VFT Mastic
40	12"x12" White w/ Tan VFT
41	12"x12" White w/ Tan VFT Mastic
42	12"x12" White w/ Grey Streaks VFT
43	12"x12" White w/ Grey Streaks VFT Mastic
44	12"x12" Black w/ White Streaks VFT
45	12"x12" Black w/ White Streaks VFT Mastic
46	12"x12" Sand VFT
47	12"x12" Sand VFT Mastic
48	12"x12" Red VFT
49	12"x12" Red VFT Mastic
50	12"x12" Blue VFT
51	12"x12" Blue VFT Mastic
52	Textured Blue Linoleum
53	Textured Blue Linoleum Mastic
54	Red Linoleum
55	Red Linoleum Mastic
56	Beige Linoleum
57	Beige Linoleum Mastic
58	Blue Linoleum
59	Blue Linoleum Mastic
60	2' x 2' Dot Ceiling Tile
61	2' x 2' Smooth Ceiling Tile
62	Vinyl Baseboard
63	Vinyl Baseboard Mastic
64	Drywall
65	Drywall Compound
66	Spray-On Fireproofing Insulation
67	Carpet Mastic

68	12"x12" with grey streaks VFT
68 A	12"x12" white with grey streaks VFT (MASTIC)
69	12"x12" Red VFT - 1903 bldg.
69 A	12"x12" Red VFT & (MASTIC) - 1903 bldg.
70	12"x12" black with white streaks VFT
70 A	12"x12" black with white streaks VFT (MASTIC)
71	2'x2' Dot ceiling tile - bldg. 1903
72	Canvas Wall cover
74	Incinerator Gasket
75	Decorative plaster trim
76	Insulation Lining
77	Fire doors
78	2'x4' Ceiling Tile with grooves
79	12" X 12" Gray Speckled VFT
79A	12" X 12" Gray Speckled VFT Mastic
U	2'x4' Off White/Smooth Ceiling Tile

The following areas were deemed to be inaccessible:

22	1'x1' Ceiling Tile Mastic
66	Spray-On Fireproofing Insulation
78	2'x4' Ceiling Tile with grooves

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Roberto Rivera, IDPH License # 100-06327. The Management Plan was updated by Arturo Saenz, IDPH License # 100-04019. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Linne School Building 4490 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Linne School Unit 24201 Building ID 4490

Address 3221 N Sacramento Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
05	1'x1' Ceiling Tile			Stage and Assembly Hall - 1903	NO_ACBM	MISC	Y							
06	Green Linoleum			Room 212 - 1895	NO_ACBM									
11	Green Linoleum Mastic	1,000	SF	Room 212 - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	Rust Color Linoleum Mastic	2,000	SF	Auditorium - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	12"x12" Brown w/ White Speckles VFT	500	SF	1st Floor Kitchen 1895 (Basement)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
14	12"x12" Brown w/ Speckles VFT	600	SF	Stage - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	9"x9" Dark Brown w/ White & Red Streaks VFT	1,300	SF	2nd & 3rd Floor Corridors - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
16	9"x9" Gray w/ White Streaks VFT	600	SF	Room 103 - 1903 (Basement)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
17	12"x12" Brown w/ White Speckles VFT Mastic	500	SF	1st Floor Kitchen - 1895 (Basement)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	12"x12" Brown w/ Speckles VFT Mastic	600	SF	Stage - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	9"x9" Dark Brown w/ White & Red Streaks VFT Mastic	1,300	SF	2nd & 3rd Floor Corridors - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	9"x9" Gray w/ White Streaks VFT Mastic	600	SF	Room 103 - 1903 (Basement)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	Drywall Joint Compound			Throughout 1903	NO_ACBM									
21A	Drywall			Throughout 1903	NO_ACBM									
22	1'x1' Ceiling Tile Mastic	2,300	SF	Stage and Assembly Hall - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	Rust Color Linoleum	2,000	SF	Auditorium - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	12"x12" Off White w/ Brown Speckles VFT	500	SF	1st Floor Kitchen-1895 (Basement)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
27	12"x12" Off White w/ Brown Speckles VFT Mastic	500	SF	1st Floor Kitchen-1895 (Basement)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	12"x12" Brown w/ Speckles VFT	1,000	SF	Room 211 and Wardrobe - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
29	12"x12" Brown w/ Speckles VFT Mastic	1,000	SF	Room 211 and Wardrobe - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	9"x9" Tan w/ White & Brown Streaks VFT	2,900	SF	2nd & 3rd Floor Corridors & Room 311 - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	9"x9" Tan w/ White & Brown Streaks VFT Mastic	2,900	SF	2nd & 3rd Floor Corridors & Room 311 - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	9"x9" Brown w/ White & Dark Brown	400	SF	Room 311 - 1895	CHR	MISC	N	NONE	0		No	ACBM with the		MODERATE

# Chicago Public Schools

School Linne School Unit 24201 Building ID 4490

Address 3221 N Sacramento Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Speckles VFT											potential for damage		
33	9"x9" Brown w/ White & Dk Brn Speckles VFT Mastic	400	SF	Room 311 - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12"x12" White w/ Brown Speckles VFT	64	SF	Room 212 Toilet - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	12"x12" White w/ Brown Speckles VFT Mastic	64	SF	Room 212 Toilet - 1895	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	12"x12" White w/ Gray Speckles VFT	600	SF	Teachers Faculty Room - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
37	12"x12" White w/ Gray Speckles VFT Mastic	600	SF	Teachers Faculty Room - 1895	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12"x12" White w/ Gray Speckles VFT	800	SF	Engineers hall, Engineers Restroom - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	12"x12" White w/ Gray Speckles VFT Mastic	800	SF	Engineers hall, Engineers Restroom - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	12"x12" White w/ Tan VFT	1,600	SF	Room 205, 207 and Principals Restroom - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
41	12"x12" White w/ Tan VFT Mastic	1,600	SF	Room 205, 207 and Principals Restroom - 1903	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12"x12" White w/ Grey Streaks VFT	3,000	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
43	12"x12" White w/ Grey Streaks VFT Mastic	3,000	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	12"x12" Black w/ White Streaks VFT	100	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
45	12"x12" Black w/ White Streaks VFT Mastic	100	PERCENT	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	12"x12" Sand VFT	200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
47	12"x12" Sand VFT Mastic	200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	12"x12" Red VFT	200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
49	12"x12" Red VFT Mastic	200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
50	12"x12" Blue VFT	1,200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
51	12"x12" Blue VFT Mastic	1,200	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	Textured Blue Linoleum	400	SF	Stairwells, &	ASSUMED	MISC	N	NONE	0		No	ACBM with the		MODERATE

# Chicago Public Schools

School Linne School Unit 24201 Building ID 4490

Address 3221 N Sacramento Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Breezeway - 1997 Addition								potential for damage		
53	Textured Blue Linoleum Mastic	400	SF	Stairwells, & Breezeway - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54	Red Linoleum	100	SF	Gym - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
55	Red Linoleum Mastic	100	SF	Gym - 1997	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	Beige Linoleum	500	SF	Gym - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
57	Beige Linoleum Mastic	500	SF	Gym - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58	Blue Linoleum	200	SF	Gym - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
59	Blue Linoleum Mastic	200	SF	Gym - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
60	2' x 2' Dot Ceiling Tile	5,000	SF	Throughout - 1997 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
61	2' x 2' Smooth Ceiling Tile	1,000	SF	Kitchen & Lunch Area - 1997 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
62	Vinyl Baseboard	1,200	LF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	Vinyl Baseboard Mastic	1,200	LF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
64	Drywall	10,000	SF	Throughout - 1997 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65	Drywall Compound	2,000	SF	Throughout - 1997 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
66	Spray-On Fireproofing Insulation	10,000	SF	Throughout Above Ceilings on Beams - 1997 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
67	Carpet Mastic	1,000	SF	Main Office Area - 1997	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
68	12"x12" with grey streaks VFT	400	SF	1st floor and 2nd hall connecting old Bldg with annex 1997	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
68 A	12"x12" white with grey streaks VFT (MASTIC)	400	SF	1st floor and 2nd floor connecting old Bldg. with Annex 1997	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
69	12"x12" Red VFT - 1903 bldg.	24	SF	1st and 2nd floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the		MODERATE

# Chicago Public Schools

**School** Linne School **Unit** 24201 **Building ID** 4490

**Address** 3221 N Sacramento **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				hall connecting old bldg. with Annex 1997								potential for damage		
69 A	12"x12" Red VFT & (MASTIC) - 1903 bldg.	24	SF	1st and 2nd floor hall connecting old bldg. with Annex 1997	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
70	12"x12" black wih white streaks VFT	6	SF	1st and 2nd floor hall connecting old bldg. with Annex 1903 bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
70 A	12"x12" black with white streaks VFT (MASTIC)	6	SF	1st and 2nd floor hall connecting old bldg. with Annex 1903 bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
71	2'x2' Dot ceiling tile - bldg. 1903	400	SF	1st and 2nd floor hall connecting old bldg. with Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
72	Canvas Wall cover	280	SF	room 212 above weinscott-picture rail back stage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
73	Insulation (NOT USED)			boiler breaching and incinerator breaching		TSI								
74	Incinerator Gasket	8	LF	Incinerator- between burner and incinerator housing	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
75	Decorative plaster trim	1,500	SF	auditorium and stage	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
76	Insulation Lining	4	SF	side of incinerator	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
77	Fire doors	3	EA	auditorium east exit; 2nd fl faculty rest room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
78	2'x4' Ceiling Tile with grooves	4,800	SF	Rooms 208, 206, 204, 203, 201, and 202; Main Office and Principal's office - 1903	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
79	12" X 12" Gray Speckled VFT	300	SF	Engineer's Office - 1903 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
79A	12" X 12" Gray Speckled VFT Mastic	300	SF	Engineer's Office - 1903 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW



<b>School</b>	Linne School	<b>Unit</b>	24201	<b>Building ID</b>	4490
<b>Address</b>	3221 N Sacramento	<b>Region</b>	01		

### Inspector's Reinspection Findings Table 1

855 W. Adams St., Ste. 200

*Inspector's Comments are Summarized at the End of the Report*

[illegible]

# Chicago Public Schools

**School** Linne School **Unit** 24201 **Building ID** 4490

**Address** 3221 N Sacramento **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date **3/10/2016**

Inspector Name **Roberto Rivera**

**100-06327**

**1/6/2017**

Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
05	
06	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
21A	
22	
25	
26	
27	
28	
29	
30	
31	
32	
33	

# Chicago Public Schools

**School** Linne School **Unit** 24201 **Building ID** 4490

**Address** 3221 N Sacramento **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
60	
61	
62	

# Chicago Public Schools

**School** Linne School **Unit** 24201 **Building ID** 4490

**Address** 3221 N Sacramento **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
63	
64	
65	
66	
67	
68	
68 A	
69	
69 A	
70	
70 A	
71	
72	
73	Boiler & Incinerator breeching are not insulated. Material Description is marked "NOT USED"
74	
75	
76	
77	
78	
79	
79A	
G	
H	
M	
O	
Q	
R	
S	

# Chicago Public Schools

**School** Linne School **Unit** 24201 **Building ID** 4490

**Address** 3221 N Sacramento **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
T	
U	
V	
W	
X	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Linne School  
**Address** 3221 N Sacramento

**Unit** 24201  
Chicago, IL, 60618

**Building ID** 4490  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
05	1'x1' Ceiling Tile			Stage and Assembly Hall - 1903	No ACBM	MISC	Yes				
06	Green Linoleum			Room 212 - 1895	No ACBM						
11	Green Linoleum Mastic	1,000	SF	Room 212 - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	Rust Color Linoleum Mastic	2,000	SF	Auditorium - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	12"x12" Brown w/ White Speckles VFT	500	SF	1st Floor Kitchen 1895 (Basement)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	12"x12" Brown w/ Speckles VFT	600	SF	Stage - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	9"x9" Dark Brown w/ White & Red Streaks VFT	1,300	SF	2nd & 3rd Floor Corridors - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	9"x9" Gray w/ White Streaks VFT	600	SF	Room 103 - 1903 (Basement)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	12"x12" Brown w/ White Speckles VFT Mastic	500	SF	1st Floor Kitchen - 1895 (Basement)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12"x12" Brown w/ Speckles VFT Mastic	600	SF	Stage - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	9"x9" Dark Brown w/ White & Red Streaks VFT Mastic	1,300	SF	2nd & 3rd Floor Corridors - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	9"x9" Gray w/ White Streaks VFT Mastic	600	SF	Room 103 - 1903 (Basement)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Drywall Joint Compound			Throughout 1903	No ACBM						
21A	Drywall			Throughout 1903	No ACBM						
22	1'x1' Ceiling Tile Mastic	2,300	SF	Stage and Assembly Hall - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Rust Color Linoleum	2,000	SF	Auditorium - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12"x12" Off White w/ Brown Speckles VFT	500	SF	1st Floor Kitchen- 1895 (Basement)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12"x12" Off White w/ Brown Speckles VFT Mastic	500	SF	1st Floor Kitchen- 1895 (Basement)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	12"x12" Brown w/ Speckles VFT	1,000	SF	Room 211 and Wardrobe - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	12"x12" Brown w/ Speckles VFT Mastic	1,000	SF	Room 211 and Wardrobe - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	9"x9" Tan w/ White & Brown Streaks VFT	2,900	SF	2nd & 3rd Floor Corridors & Room 311 - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	9"x9" Tan w/ White & Brown Streaks VFT Mastic	2,900	SF	2nd & 3rd Floor Corridors & Room 311 - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	9"x9" Brown w/ White & Dark Brown Speckles VFT	400	SF	Room 311 - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	9"x9" Brown w/ White & Dk Brn Speckles VFT Mastic	400	SF	Room 311 - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12"x12" White w/ Brown Speckles VFT	64	SF	Room 212 Toilet - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12"x12" White w/ Brown Speckles VFT Mastic	64	SF	Room 212 Toilet - 1895	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12"x12" White w/ Gray Speckles VFT	600	SF	Teachers Faculty Room - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12"x12" White w/ Gray Speckles VFT Mastic	600	SF	Teachers Faculty Room - 1895	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12"x12" White w/ Gray Speckles VFT	800	SF	Engineers hall, Engineers Restroom - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12"x12" White w/ Gray Speckles VFT Mastic	800	SF	Engineers hall, Engineers Restroom -	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School**    Linne School  
**Address**    3221 N Sacramento

**Unit**    24201  
Chicago, IL, 60618

**Building ID**    4490  
**Region**    01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)**    GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone:    (312) 733-6262

Fax:    (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				1903							
40	12"x12" White w/ Tan VFT	1,600	SF	Room 205, 207 and Principals Restroom - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	12"x12" White w/ Tan VFT Mastic	1,600	SF	Room 205, 207 and Principals Restroom - 1903	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12"x12" White w/ Grey Streaks VFT	3,000	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	12"x12" White w/ Grey Streaks VFT Mastic	3,000	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	12"x12" Black w/ White Streaks VFT	100	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	12"x12" Black w/ White Streaks VFT Mastic	100	PERCENT	Throughout - 1997 Addition	Assumed	MISC	No	0	PERCENT	6 ACBM with the potential for damage	Follow O&M Plan
46	12"x12" Sand VFT	200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	12"x12" Sand VFT Mastic	200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	12"x12" Red VFT	200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	12"x12" Red VFT Mastic	200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	12"x12" Blue VFT	1,200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	12"x12" Blue VFT Mastic	1,200	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	Textured Blue Linoleum	400	SF	Stairwells, & Breezeway - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	Textured Blue Linoleum Mastic	400	SF	Stairwells, & Breezeway - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	Red Linoleum	100	SF	Gym - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	Red Linoleum Mastic	100	SF	Gym - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	Beige Linoleum	500	SF	Gym - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	Beige Linoleum Mastic	500	SF	Gym - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	Blue Linoleum	200	SF	Gym - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	Blue Linoleum Mastic	200	SF	Gym - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	2' x 2' Dot Ceiling Tile	5,000	SF	Throughout - 1997 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	2' x 2' Smooth Ceiling Tile	1,000	SF	Kitchen & Lunch Area - 1997 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	Vinyl Baseboard	1,200	LF	Throughout - 1997 Addition	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
63	Vinyl Baseboard Mastic	1,200	LF	Throughout - 1997 Addition	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
64	Drywall	10,000	SF	Throughout - 1997 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65	Drywall Compound	2,000	SF	Throughout - 1997 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
66	Spray-On Fireproofing Insulation	10,000	SF	Throughout Above Ceilings on Beams - 1997 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
67	Carpet Mastic	1,000	SF	Main Office Area - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68	12"x12" with grey streaks VFT	400	SF	1st floor and 2nd hall connecting old	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan



# Chicago Public Schools

**School**    Linne School  
**Address**    3221 N Sacramento

**Unit**    24201  
Chicago, IL, 60618

**Building ID**    4490  
**Region**    01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)**    GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone:    (312) 733-6262

Fax:    (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Bldg with annex 1997							
68 A	12"x12" white with grey streaks VFT (MASTIC)	400	SF	1st floor and 2nd floor connecting old Bldg. with Annex 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
69	12"x12" Red VFT - 1903 bldg.	24	SF	1st and 2nd floor hall connecting old bldg. with Annex 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
69 A	12"x12" Red VFT & (MASTIC) - 1903 bldg.	24	SF	1st and 2nd floor hall connecting old bldg. with Annex 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
70	12"x12" black wih white streaks VFT	6	SF	1st and 2nd floor hall connecting old bldg. with Annex 1903 bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
70 A	12"x12" black with white streaks VFT (MASTIC)	6	SF	1st and 2nd floor hall connecting old bldg. with Annex 1903 bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
71	2'x2' Dot ceiling tile - bldg. 1903	400	SF	1st and 2nd floor hall connecting old bldg. with Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
72	Canvas Wall cover	280	SF	room 212 above weinscott- picture rail back stage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
73	Insulation (NOT USED)			boiler breaching and incinerator breaching		TSI					
74	Incinerator Gasket	8	LF	Incinerator- between burner and incinerator housing	Assumed	MISC	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
75	Decorative plaster trim	1,500	SF	auditorium and stage	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
76	Insulation Lining	4	SF	side of incinerator	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
77	Fire doors	3	EA	auditorium east exit; 2nd fl faculty rest room	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
78	2'x4' Ceiling Tile with grooves	4,800	SF	Rooms 208, 206, 204, 203, 201, and 202; Main Office and Principal's office - 1903	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
79	12" X 12" Gray Speckled VFT	300	SF	Engineer's Office - 1903 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
79A	12" X 12" Gray Speckled VFT Mastic	300	SF	Engineer's Office - 1903 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	Mag Block Pipe Insulation	30	LF	South Cold Deck, South Hall Outside Cold Deck - 1903	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
H	MJP E/F/V on Mag Block Pipe Insulation	7	LF	South Cold Deck, South Hall Outside Cold Deck - 1903	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
M	MJP E/F/V on Fiberglass Pipe Insulation	36	LF	Elec. Room, Engineer Storage, Eng. Tol., Boys Basement Tol., Sprinkler Room & Hall, S. Stair - 1903	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School**    Linne School  
**Address**    3221 N Sacramento

**Unit**    24201  
Chicago, IL, 60618

**Building ID**    4490  
**Region**    01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)**    GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone:    (312) 733-6262

Fax:    (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
O	Cardboard Pipe Insulation	73	LF	North Basement (Encapsulated), Electrical Room, Engineer Office - 1903	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
Q	MJP E/F/V on Cardboard Pipe Insulation	6	LF	North Basement (Encapsulated), Engineer Office - 1903	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
R	2'x4' Off White/Smooth Ceiling Tile	0		S. Basement, S. Corridor, S. Caged (Kitchen) Area - 1895	No ACBM	MISC	Yes	0		6 ACBM with the potential for damage	
S	2'x4' White Textured Ceiling Tile			Teachers Faculty Rm, S. Basement - 1895	No ACBM	MISC	Yes				
T	Canvas Wall Cover			Room 311 - 1895	No ACBM						
U	2'x4' Off White/Smooth Ceiling Tile	1,100	SF	North Basement Dance Area - 1903	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
V	2'x4' White Textured Ceiling Tile			Engine/Tank Room, 3rd Floor Boys & Girls Toilets, 4th Floor Stairwells, 3rd Floor Classrooms, Storage Rm behind Stage - 1903	No ACBM						
W	Tank Insulation			Tank/Engine Room - 1903	No ACBM						
X	Canvas Wall Cover			2nd Floor Corridor - 1903	No ACBM						

# Chicago Public Schools

**School** Linne School  
**Address** 3221 N Sacramento

**Unit** 24201  
Chicago, IL, 60618

**Building ID** 4490  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

*Management Planner's Comments Summarized at the End of the Report*

Review Date	5/30/2016
Manager Planner Name	Arturo Saenz
100-04019	1/19/2017
Manager IDPH License No/Expiration	

HA Number	Management Comments
05	
06	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
21A	
22	
25	
26	
27	
28	
29	
30	
31	

# Chicago Public Schools

**School** Linne School  
**Address** 3221 N Sacramento

**Unit** 24201  
Chicago, IL, 60618

**Building ID** 4490  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.  
855 W. Adams St., Ste. 200  
Phone: (312) 733-6262 Fax: (312) 733-5612

### Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	

# Chicago Public Schools

**School**    Linne School  
**Address**    3221 N Sacramento

**Unit**    24201  
Chicago, IL, 60618

**Building ID**    4490  
**Region**    01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)**    GSG Consultants, Inc.  
855 W. Adams St., Ste. 200  
Phone:    (312) 733-6262                      Fax:    (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
59	
60	
61	
62	
63	
64	
65	
66	
67	
68	
68 A	
69	
69 A	
70	
70 A	
71	
72	
73	
74	
75	
76	
77	
78	
79	
79A	
G	
H	

# Chicago Public Schools

**School**    Linne School  
**Address**    3221 N Sacramento

**Unit**    24201  
Chicago, IL, 60618

**Building ID**    4490  
**Region**    01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)**    GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone:    (312) 733-6262                      Fax:    (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
M	
O	
Q	
R	
S	
T	
U	
V	
W	
X	

# Chicago Public Schools

GSG Consultants, Inc.

## 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	1'x1' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	No ACBM	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Stage and Assembly Hall - 1903

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA: 05

MATERIAL DESCRIPTION: 1'x1' Ceiling Tile

MATERIAL LOCATION: Stage and Assembly Hall - 1903

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	06	
MATERIAL DESCRIPTION:	Green Linoleum	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 212 - 1895

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA: 06

MATERIAL DESCRIPTION: Green Linoleum

MATERIAL LOCATION: Room 212 - 1895

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	Green Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 212 - 1895		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	Green Linoleum Mastic		
MATERIAL LOCATION:	Room 212 - 1895		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	Rust Color Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium - 1903		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	Rust Color Linoleum Mastic		
MATERIAL LOCATION:	Auditorium - 1903		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	13		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st Floor Kitchen 1895 (Basement)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	13		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Speckles VFT		
MATERIAL LOCATION:	1st Floor Kitchen 1895 (Basement)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stage - 1903		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT		
MATERIAL LOCATION:	Stage - 1903		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	9"x9" Dark Brown w/ White & Red Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	2nd & 3rd Floor Corridors - 1895		
MATERIAL QUANTITY:	1300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	9"x9" Dark Brown w/ White & Red Streaks VFT		
MATERIAL LOCATION:	2nd & 3rd Floor Corridors - 1895		
MATERIAL QUANTITY:	1300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	9"x9" Gray w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 103 - 1903 (Basement)		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	9"x9" Gray w/ White Streaks VFT		
MATERIAL LOCATION:	Room 103 - 1903 (Basement)		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Kitchen - 1895 (Basement)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Speckles VFT Mastic		
MATERIAL LOCATION:	1st Floor Kitchen - 1895 (Basement)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stage - 1903		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT Mastic		
MATERIAL LOCATION:	Stage - 1903		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	9"x9" Dark Brown w/ White & Red Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd & 3rd Floor Corridors - 1895		
MATERIAL QUANTITY:	1300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	19				
MATERIAL DESCRIPTION:	9"x9" Dark Brown w/ White & Red Streaks VFT Mastic				
MATERIAL LOCATION:	2nd & 3rd Floor Corridors - 1895				
MATERIAL QUANTITY:	1300	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	9"x9" Gray w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 103 - 1903 (Basement)		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	9"x9" Gray w/ White Streaks VFT Mastic		
MATERIAL LOCATION:	Room 103 - 1903 (Basement)		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21	
MATERIAL DESCRIPTION:	Drywall Joint Compound	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout 1903

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA: 21

MATERIAL DESCRIPTION: Drywall Joint Compound

MATERIAL LOCATION: Throughout 1903

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21A	
MATERIAL DESCRIPTION:	Drywall	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout 1903

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA: 21A

MATERIAL DESCRIPTION: Drywall

MATERIAL LOCATION: Throughout 1903

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUILDING ID: **4490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**  
SCHOOL NAME: **Linne School** INSPECTION DATE: **3/10/2016**  
ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-06327**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **1'x1' Ceiling Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Stage and Assembly Hall - 1903**  
MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/10/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	1'x1' Ceiling Tile Mastic		
MATERIAL LOCATION:	Stage and Assembly Hall - 1903		
MATERIAL QUANTITY:	2300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	Rust Color Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium - 1903		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	Rust Color Linoleum		
MATERIAL LOCATION:	Auditorium - 1903		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	12"x12" Off White w/ Brown Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st Floor Kitchen- 1895 (Basement)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	12"x12" Off White w/ Brown Speckles VFT		
MATERIAL LOCATION:	1st Floor Kitchen- 1895 (Basement)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	12"x12" Off White w/ Brown Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Kitchen- 1895 (Basement)		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	27				
MATERIAL DESCRIPTION:	12"x12" Off White w/ Brown Speckles VFT Mastic				
MATERIAL LOCATION:	1st Floor Kitchen- 1895 (Basement)				
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 211 and Wardrobe - 1895		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT		
MATERIAL LOCATION:	Room 211 and Wardrobe - 1895		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 211 and Wardrobe - 1895		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	29				
MATERIAL DESCRIPTION:	12"x12" Brown w/ Speckles VFT Mastic				
MATERIAL LOCATION:	Room 211 and Wardrobe - 1895				
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	9"x9" Tan w/ White & Brown Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd & 3rd Floor Corridors & Room 311 - 1895		
MATERIAL QUANTITY:	2900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	9"x9" Tan w/ White & Brown Streaks VFT		
MATERIAL LOCATION:	2nd & 3rd Floor Corridors & Room 311 - 1895		
MATERIAL QUANTITY:	2900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	9"x9" Tan w/ White & Brown Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd & 3rd Floor Corridors & Room 311 - 1895		
MATERIAL QUANTITY:	2900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	9"x9" Tan w/ White & Brown Streaks VFT Mastic		
MATERIAL LOCATION:	2nd & 3rd Floor Corridors & Room 311 - 1895		
MATERIAL QUANTITY:	2900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White & Dark Brown Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 311 - 1895		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	32				
MATERIAL DESCRIPTION:	9"x9" Brown w/ White & Dark Brown Speckles VFT				
MATERIAL LOCATION:	Room 311 - 1895				
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	9"x9" Brown w/ White & Dk Brn Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 311 - 1895		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	33				
MATERIAL DESCRIPTION:	9"x9" Brown w/ White & Dk Brn Speckles VFT Mastic				
MATERIAL LOCATION:	Room 311 - 1895				
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	12"x12" White w/ Brown Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 212 Toilet - 1895		
MATERIAL QUANTITY:	64	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	12"x12" White w/ Brown Speckles VFT		
MATERIAL LOCATION:	Room 212 Toilet - 1895		
MATERIAL QUANTITY:	64	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	12"x12" White w/ Brown Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 212 Toilet - 1895		
MATERIAL QUANTITY:	64	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	12"x12" White w/ Brown Speckles VFT Mastic		
MATERIAL LOCATION:	Room 212 Toilet - 1895		
MATERIAL QUANTITY:	64	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Teachers Faculty Room - 1895		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT		
MATERIAL LOCATION:	Teachers Faculty Room - 1895		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Teachers Faculty Room - 1895		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	37				
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT Mastic				
MATERIAL LOCATION:	Teachers Faculty Room - 1895				
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineers hall, Engineers Restroom - 1903		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT		
MATERIAL LOCATION:	Engineers hall, Engineers Restroom - 1903		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineers hall, Engineers Restroom - 1903		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	39				
MATERIAL DESCRIPTION:	12"x12" White w/ Gray Speckles VFT Mastic				
MATERIAL LOCATION:	Engineers hall, Engineers Restroom - 1903				
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	12"x12" White w/ Tan VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 205, 207 and Principals Restroom - 1903		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	12"x12" White w/ Tan VFT		
MATERIAL LOCATION:	Room 205, 207 and Principals Restroom - 1903		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	41		
MATERIAL DESCRIPTION:	12"x12" White w/ Tan VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 205, 207 and Principals Restroom - 1903		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	41		
MATERIAL DESCRIPTION:	12"x12" White w/ Tan VFT Mastic		
MATERIAL LOCATION:	Room 205, 207 and Principals Restroom - 1903		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	12"x12" White w/ Grey Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	12"x12" White w/ Grey Streaks VFT		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	12"x12" White w/ Grey Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	12"x12" White w/ Grey Streaks VFT Mastic		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	12"x12" Black w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	12"x12" Black w/ White Streaks VFT		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	12"x12" Black w/ White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	PERCENT
DAMAGE QUANTITY:		DAMAGE UNITS:	PERCENT
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	12"x12" Black w/ White Streaks VFT Mastic		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	PERCENT
DAMAGE QUANTITY:	0	DAMAGE UNITS:	PERCENT

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	12"x12" Sand VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	12"x12" Sand VFT		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUILDING ID: **4490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**  
SCHOOL NAME: **Linne School** INSPECTION DATE: **3/10/2016**  
ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-06327**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **12"x12" Sand VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout - 1997 Addition**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/10/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	47		
MATERIAL DESCRIPTION:	12"x12" Sand VFT Mastic		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	12"x12" Red VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	12"x12" Red VFT		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	12"x12" Red VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	12"x12" Red VFT Mastic		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	12"x12" Blue VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	12"x12" Blue VFT		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	51		
MATERIAL DESCRIPTION:	12"x12" Blue VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	51		
MATERIAL DESCRIPTION:	12"x12" Blue VFT Mastic		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	52		
MATERIAL DESCRIPTION:	Textured Blue Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Stairwells, & Breezeway - 1997 Addition		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	52		
MATERIAL DESCRIPTION:	Textured Blue Linoleum		
MATERIAL LOCATION:	Stairwells, & Breezeway - 1997 Addition		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	53		
MATERIAL DESCRIPTION:	Textured Blue Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stairwells, & Breezeway - 1997 Addition		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	53		
MATERIAL DESCRIPTION:	Textured Blue Linoleum Mastic		
MATERIAL LOCATION:	Stairwells, & Breezeway - 1997 Addition		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	54		
MATERIAL DESCRIPTION:	Red Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	54		
MATERIAL DESCRIPTION:	Red Linoleum		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	55		
MATERIAL DESCRIPTION:	Red Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gym - 1997		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	55		
MATERIAL DESCRIPTION:	Red Linoleum Mastic		
MATERIAL LOCATION:	Gym - 1997		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	56		
MATERIAL DESCRIPTION:	Beige Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	56		
MATERIAL DESCRIPTION:	Beige Linoleum		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	57		
MATERIAL DESCRIPTION:	Beige Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	57		
MATERIAL DESCRIPTION:	Beige Linoleum Mastic		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	58		
MATERIAL DESCRIPTION:	Blue Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	58		
MATERIAL DESCRIPTION:	Blue Linoleum		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	59		
MATERIAL DESCRIPTION:	Blue Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	59		
MATERIAL DESCRIPTION:	Blue Linoleum Mastic		
MATERIAL LOCATION:	Gym - 1997 Addition		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	60		
MATERIAL DESCRIPTION:	2' x 2' Dot Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	60		
MATERIAL DESCRIPTION:	2' x 2' Dot Ceiling Tile		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	61		
MATERIAL DESCRIPTION:	2' x 2' Smooth Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen & Lunch Area - 1997 Addition		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	61		
MATERIAL DESCRIPTION:	2' x 2' Smooth Ceiling Tile		
MATERIAL LOCATION:	Kitchen & Lunch Area - 1997 Addition		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	62		
MATERIAL DESCRIPTION:	Vinyl Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	62		
MATERIAL DESCRIPTION:	Vinyl Baseboard		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	63		
MATERIAL DESCRIPTION:	Vinyl Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	63		
MATERIAL DESCRIPTION:	Vinyl Baseboard Mastic		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	64		
MATERIAL DESCRIPTION:	Drywall		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	10000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	64		
MATERIAL DESCRIPTION:	Drywall		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	10000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	65		
MATERIAL DESCRIPTION:	Drywall Compound		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	65		
MATERIAL DESCRIPTION:	Drywall Compound		
MATERIAL LOCATION:	Throughout - 1997 Addition		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	66		
MATERIAL DESCRIPTION:	Spray-On Fireproofing Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Above Ceilings on Beams - 1997 Addition		
MATERIAL QUANTITY:	10000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	66		
MATERIAL DESCRIPTION:	Spray-On Fireproofing Insulation		
MATERIAL LOCATION:	Throughout Above Ceilings on Beams - 1997 Addition		
MATERIAL QUANTITY:	10000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	67		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office Area - 1997		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	67		
MATERIAL DESCRIPTION:	Carpet Mastic		
MATERIAL LOCATION:	Main Office Area - 1997		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	68		
MATERIAL DESCRIPTION:	12"x12" with grey streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st floor and 2nd hall connecting old Bldg with annex 1997		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	68		
MATERIAL DESCRIPTION:	12"x12" with grey streaks VFT		
MATERIAL LOCATION:	1st floor and 2nd hall connecting old Bldg with annex 1997		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	68 A		
MATERIAL DESCRIPTION:	12"x12" white with grey streaks VFT (MASTIC)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st floor and 2nd floor connecting old Bldg. with Annex 1997		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	68 A				
MATERIAL DESCRIPTION:	12"x12" white with grey streaks VFT (MASTIC)				
MATERIAL LOCATION:	1st floor and 2nd floor connecting old Bldg. with Annex 1997				
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	69		
MATERIAL DESCRIPTION:	12"x12" Red VFT - 1903 bldg.		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st and 2nd floor hall connecting old bldg. with Annex 1997		
MATERIAL QUANTITY:	24	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA: 69

MATERIAL DESCRIPTION: 12"x12" Red VFT - 1903 bldg.

MATERIAL LOCATION: 1st and 2nd floor hall connecting old bldg. with Annex 1997

MATERIAL QUANTITY: 24

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	69 A		
MATERIAL DESCRIPTION:	12"x12" Red VFT & (MASTIC) - 1903 bldg.		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st and 2nd floor hall connecting old bldg. with Annex 1997		
MATERIAL QUANTITY:	24	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	69 A				
MATERIAL DESCRIPTION:	12"x12" Red VFT & (MASTIC) - 1903 bldg.				
MATERIAL LOCATION:	1st and 2nd floor hall connecting old bldg. with Annex 1997				
MATERIAL QUANTITY:	24	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	70		
MATERIAL DESCRIPTION:	12"x12" black wih white streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st and 2nd floor hall connecting old bldg. with Annex 1903 bldg.		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	70				
MATERIAL DESCRIPTION:	12"x12" black wih white streaks VFT				
MATERIAL LOCATION:	1st and 2nd floor hall connecting old bldg. with Annex 1903 bldg.				
MATERIAL QUANTITY:	6	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	70 A		
MATERIAL DESCRIPTION:	12"x12" black with white streaks VFT (MASTIC)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st and 2nd floor hall connecting old bldg. with Annex 1903 bldg.		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	70 A		
MATERIAL DESCRIPTION:	12"x12" black with white streaks VFT (MASTIC)		
MATERIAL LOCATION:	1st and 2nd floor hall connecting old bldg. with Annex 1903 bldg.		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	71		
MATERIAL DESCRIPTION:	2'x2' Dot ceiling tile - bldg. 1903		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st and 2nd floor hall connecting old bldg. with Annex		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	71		
MATERIAL DESCRIPTION:	2'x2' Dot ceiling tile - bldg. 1903		
MATERIAL LOCATION:	1st and 2nd floor hall connecting old bldg. with Annex		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	72		
MATERIAL DESCRIPTION:	Canvas Wall cover		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **room 212  
above weinscott- picture rail  
back stage**

MATERIAL QUANTITY: **280**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/10/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA: 72

MATERIAL DESCRIPTION: Canvas Wall cover

MATERIAL LOCATION: room 212  
above weinscott- picture rail  
back stage

MATERIAL QUANTITY: 280

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	73
MATERIAL DESCRIPTION:	Insulation (NOT USED)
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage
HISTORICAL DAMAGE REASON:	
HISTORICAL RESPONSE ACTION:	Follow O&M Plan
ASBESTOS TYPE:	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: boiler breaching and incinerator breaching

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Boiler & Incinerator breeching are not insulated. Material Description is marked "NOT USED"

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA: 73

MATERIAL DESCRIPTION: Insulation (NOT USED)

MATERIAL LOCATION: boiler breaching and incinerator breaching

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	74		
MATERIAL DESCRIPTION:	Incinerator Gasket		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Incinerator- between burner and incinerator housing		
MATERIAL QUANTITY:	8	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	74		
MATERIAL DESCRIPTION:	Incinerator Gasket		
MATERIAL LOCATION:	Incinerator- between burner and incinerator housing		
MATERIAL QUANTITY:	8	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	75		
MATERIAL DESCRIPTION:	Decorative plaster trim		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	auditorium and stage		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	75		
MATERIAL DESCRIPTION:	Decorative plaster trim		
MATERIAL LOCATION:	auditorium and stage		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	76		
MATERIAL DESCRIPTION:	Insulation Lining		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	side of incinerator		
MATERIAL QUANTITY:	4	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	76		
MATERIAL DESCRIPTION:	Insulation Lining		
MATERIAL LOCATION:	side of incinerator		
MATERIAL QUANTITY:	4	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	77		
MATERIAL DESCRIPTION:	Fire doors		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **auditorium east exit;  
2nd fl faculty rest room**

MATERIAL QUANTITY: **3**

MATERIAL UNITS: **EA**

DAMAGE QUANTITY:

DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature:



Date: **03/10/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	77		
MATERIAL DESCRIPTION:	Fire doors		
MATERIAL LOCATION:	auditorium east exit; 2nd fl faculty rest room		
MATERIAL QUANTITY:	3	MATERIAL UNITS:	EA
DAMAGE QUANTITY:	0	DAMAGE UNITS:	EA

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	78		
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile with grooves		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 208, 206, 204, 203, 201, and 202; Main Office and Principal's office - 1903		
MATERIAL QUANTITY:	4800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	78				
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile with grooves				
MATERIAL LOCATION:	Rooms 208, 206, 204, 203, 201, and 202; Main Office and Principal's office - 1903				
MATERIAL QUANTITY:	4800	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	G		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	South Cold Deck, South Hall Outside Cold Deck - 1903		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	G				
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation				
MATERIAL LOCATION:	South Cold Deck, South Hall Outside Cold Deck - 1903				
MATERIAL QUANTITY:	30	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	H		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	South Cold Deck, South Hall Outside Cold Deck - 1903		
MATERIAL QUANTITY:	7	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	H				
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation				
MATERIAL LOCATION:	South Cold Deck, South Hall Outside Cold Deck - 1903				
MATERIAL QUANTITY:	7	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUILDING ID: **4490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**  
SCHOOL NAME: **Linne School** INSPECTION DATE: **3/10/2016**  
ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-06327**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Elec. Room, Engineer Storage, Eng. Tol., Boys Basement Tol., Sprinkler Room & Hall, S. Stair - 1903**

MATERIAL QUANTITY: **36**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/10/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	M				
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation				
MATERIAL LOCATION:	Elec. Room, Engineer Storage, Eng. Tol., Boys Basement Tol., Sprinkler Room & Hall, S. Stair - 1903				
MATERIAL QUANTITY:	36	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	O		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	North Basement (Encapsulated), Electrical Room, Engineer Office - 1903		
MATERIAL QUANTITY:	73	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	0				
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation				
MATERIAL LOCATION:	North Basement (Encapsulated), Electrical Room, Engineer Office - 1903				
MATERIAL QUANTITY:	73	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Q		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	North Basement (Encapsulated), Engineer Office - 1903		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	Q				
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation				
MATERIAL LOCATION:	North Basement (Encapsulated), Engineer Office - 1903				
MATERIAL QUANTITY:	6	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	R		
MATERIAL DESCRIPTION:	2'x4' Off White/Smooth Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	No ACBM	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **S. Basement, S. Corridor, S. Caged (Kitchen) Area - 1895**

MATERIAL QUANTITY: **0** MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/10/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	R				
MATERIAL DESCRIPTION:	2'x4' Off White/Smooth Ceiling Tile				
MATERIAL LOCATION:	S. Basement, S. Corridor, S. Caged (Kitchen) Area - 1895				
MATERIAL QUANTITY:	0	MATERIAL UNITS:			
DAMAGE QUANTITY:	0	DAMAGE UNITS:			

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUILDING ID: **4490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**  
SCHOOL NAME: **Linne School** INSPECTION DATE: **3/10/2016**  
ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-06327**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **S**  
MATERIAL DESCRIPTION: **2'x4' White Textured Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Teachers Faculty Rm, S. Basement - 1895**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/10/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA: S

MATERIAL DESCRIPTION: 2'x4' White Textured Ceiling Tile

MATERIAL LOCATION: Teachers Faculty Rm, S. Basement - 1895

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	T	
MATERIAL DESCRIPTION:	Canvas Wall Cover	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 311 - 1895

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA: T

MATERIAL DESCRIPTION: Canvas Wall Cover

MATERIAL LOCATION: Room 311 - 1895

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 05/30/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	U		
MATERIAL DESCRIPTION:	2'x4' Off White/Smooth Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	North Basement Dance Area - 1903		
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA:	U				
MATERIAL DESCRIPTION:	2'x4' Off White/Smooth Ceiling Tile				
MATERIAL LOCATION:	North Basement Dance Area - 1903				
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/30/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	V	
MATERIAL DESCRIPTION:	2'x4' White Textured Ceiling Tile	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Engine/Tank Room, 3rd Floor Boys & Girls Toilets, 4th Floor Stairwells, 3rd Floor Classrooms, Storage Rm behind Stage - 1903

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUILDING ID: **4490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**  
SCHOOL NAME: **Linne School** REVIEW DATE: **5/30/2016**  
ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-06327**

---

HOMOGENEOUS AREA: **V**  
MATERIAL DESCRIPTION: **2'x4' White Textured Ceiling Tile**  
MATERIAL LOCATION: **Engine/Tank Room, 3rd Floor Boys & Girls Toilets, 4th Floor Stairwells, 3rd Floor Classrooms, Storage Rm behind Stage - 1903**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/30/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	W	
MATERIAL DESCRIPTION:	Tank Insulation	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Tank/Engine Room - 1903

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA: **W**

MATERIAL DESCRIPTION: **Tank Insulation**

MATERIAL LOCATION: **Tank/Engine Room - 1903**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/30/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	X	
MATERIAL DESCRIPTION:	Canvas Wall Cover	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 2nd Floor Corridor - 1903

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Linne School	REVIEW DATE:	5/30/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

HOMOGENEOUS AREA: **X**

MATERIAL DESCRIPTION: **Canvas Wall Cover**

MATERIAL LOCATION: **2nd Floor Corridor - 1903**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/30/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	79		
MATERIAL DESCRIPTION:	12" X 12" Gray Speckled VFT		
MATERIAL LOCATION:	Engineer's Office - 1903 Bldg		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUILDING ID: **4490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**  
SCHOOL NAME: **Linne School** REVIEW DATE: **5/30/2016**  
ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **79**  
MATERIAL DESCRIPTION: **12" X 12" Gray Speckled VFT**  
MATERIAL LOCATION: **Engineer's Office - 1903 Bldg**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **05/30/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24201	BUILDING ID:	4490
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Roberto Rivera		
SCHOOL NAME:	Linne School	INSPECTION DATE:	3/10/2016		
ADDRESS:	3221 N Sacramento	IDPH LICENSE NO:	100-06327		

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	79A				
MATERIAL DESCRIPTION:	12" X 12" Gray Speckled VFT Mastic				
MATERIAL LOCATION:	Engineer's Office - 1903 Bldg				
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:	No		
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
		DAMAGE REASON:			
		DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		
COMMENTS:					

Inspector's Signature:



Date: 03/10/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24201** BUILDING ID: **4490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**  
SCHOOL NAME: **Linne School** REVIEW DATE: **5/30/2016**  
ADDRESS: **3221 N Sacramento** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **79A**  
MATERIAL DESCRIPTION: **12" X 12" Gray Speckled VFT Mastic**  
MATERIAL LOCATION: **Engineer's Office - 1903 Bldg**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **05/30/2016**

# APPENDIX B

## Inspector and Management Planner Licenses

---

2016



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Roberto Rivera**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/6/2016

Exam Date: 1/6/2016

Expiration Date: 1/6/2017

Certificate Number: BIR1601060030

  
Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0800 • [www.dph.illinois.gov](http://www.dph.illinois.gov)

4/20/2016

**ROBERTO RIVERA**  
855 WEST ADAMS STREET, STE 200  
CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 06327

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

**COPY OF THE ASBESTOS PROFESSIONAL LICENSE**

Front of License

Back of License

		<b>ASBESTOS PROFESSIONAL LICENSE</b>	
ID NUMBER 100 - 06327	ISSUED 4/20/2016	EXPIRES 05/15/2017	
<b>ROBERTO RIVERA</b> 855 WEST ADAMS STREET, ST CHICAGO, IL 60607 Environmental Health			
		<b>ENDORSEMENTS</b> SUPERVISOR/WORKER INSPECTOR  PROJECT MANAGER AIR SAMPLING PROFESSIONAL	<b>TC EXPIRES</b> 1/20/2017 1/6/2017  1/20/2017
<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.			

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**

*Nationally Accredited by PHAB*



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • [www.idph.state.il.us](http://www.idph.state.il.us)



4/18/2016

**ARTURO SAENZ**  
855 W ADAMS ST SUITE 200  
CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 04019

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

**COPY OF THE ASBESTOS PROFESSIONAL LICENSE**

Front of License			Back of License	
			<b>ASBESTOS PROFESSIONAL LICENSE</b>	<b>ENDORSEMENTS</b>
<b>ID NUMBER</b> 100 - 04019	<b>ISSUED</b> 4/18/2016	<b>EXPIRES</b> 05/15/2017	INSPECTOR	<b>TC EXPIRES</b> 1/19/2017
<b>ARTURO SAENZ</b> 855 W ADAMS ST SUITE 200 CHICAGO, IL 60607 Environmental Health			MANAGEMENT PLANNER	1/27/2017
			AIR SAMPLING PROFESSIONAL	
			<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**  
*Nationally Accredited by PHAB*

2016



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Arturo Saenz**


has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016

Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270319

  
Kathy DeSalvo, Director

2016



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

# **Asbestos Management Planner Refresher**

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

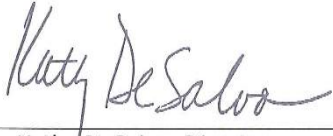
has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016

Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270320

  
Kathy DeSalvo, Director



# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	CODE	KEY
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed