

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2296
SCHOOL NAME: Kilmer School
ADDRESS OF SCHOOL: 6700 N Greenview Avenue
CITY: Chicago, IL, 60626

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/21/2016**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 807
IDPH INSPECTOR LICENSE NUMBER: 100-11093
IDPH LICENSED INSPECTOR NAME(Please Print): David Avila
IDPH MP LICENSE NUMBER: 100-04019
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Arturo Saenz

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Kilmer School

6700 N Greenview Avenue
Chicago, IL, 60626

Unit: 24021
Building ID: 4300

IDPH ID Number: 14-016-2990-2296

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

GSG-Probe Consulting, Inc.

2942 W. Van Buren

Chicago, IL, 60612

Phone 3123197575

Fax

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

May 25, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

GSG-Probe Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 24021 Region: 01 IDPH ID:14-016-2990-2296

School: Kilmer School Building ID: 4300

Address: 6700 N Greenvview Avenue

Chicago, IL, 60626

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 09/20/2019

Inspector: David Avila

Inspector IDPH License: 100-11093

Management Planner: Arturo Saenz

Management Planner IDPH License: 100-04019

If you have any questions or comments, please contact us at 3123197575

Sincerely,
GSG-Probe Consulting, Inc.

Arturo Saenz
100-04019

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: May 25, 2019

RE: Kilmer School, Unit 24021
6700 N Greenview Avenue
Chicago, IL, 60626

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Kilmer School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Kilmer School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School:	Kilmer School	Unit:	24021	Region:	01
Address:	6700 N Greenview Avenue	Chicago, IL,	60626		
IDPH ID:	14-016-2990-2296	Building ID:	4300		
Contact:		Phone:			

2. Description of Facility

Original Construction:	Additional Construction:
Total Square Footage:	No of Floors:
Current Occupancy: 807	

3. LEA Designated Person

Contact:	Robert Christlieb	Phone:	(773) 553-3197
Address:	42 West Madison Street		
	Chicago, IL 60602		

4. Managing Environmental Consultant

MEC:	GSG-Probe Consulting, Inc.	
Contact:	Jigar Shah	
Address	2942 W. Van Buren	
	Chicago, IL, 60612	
Phone:	3123197575	Fax:

5. Inspector

Inspector Name: David Avila

Inspector IDPH license # 100-11093	Signature:
	Date: 5/25/2019

6. Management Planner

Management Planner Name: Arturo Saenz

Management Planner IDPH license # 100-04019	Signature:
	Date: 09/20/2019

7. Review Date:09/20/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

GSG-Probe Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Kilmer School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4300:

31	12"x 12" Green w/ White Streaks VFT
33	12"x12" Green w/ White Streaks VFT
37	12"x12" Light Brown w/ White/Black/Brown Spots VFT
39	12"x12" Gray w/ White & Brown Streaks VFT
41	12"x12" Blue VFT
42	12"x12" Blue VFT Mastic
45	12"x12" Black w/ Green & White Streaks VFT
46	12"x12" Black w/ Green & White Streaks VFT Mastic

B. The following new homogenous areas have been identified for Building 4300:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

31	12"x 12" Green w/ White Streaks VFT
33	12"x12" Green w/ White Streaks VFT
37	12"x12" Light Brown w/ White/Black/Brown Spots VFT
39	12"x12" Gray w/ White & Brown Streaks VFT
41	12"x12" Blue VFT
42	12"x12" Blue VFT Mastic
45	12"x12" Black w/ Green & White Streaks VFT
46	12"x12" Black w/ Green & White Streaks VFT Mastic
53	12"x12" Light Gray w/ White Spots VFT
55	12"x36" Black VFT
56	12"x36" Black VFT Mastic
57	12"x12" Beige w/ Tan Spots VFT
58	12"x12" Beige w/ Tan Spots VFT Mastic
67	Brown Linoleum
69	12" X 12" Blue VFT
70	12"x 12" Blue VFT Mastic
71	12"x 12" Yellow VFT
72	12"x 12" Yellow VFT Mastic
73	12"x 12" Black VFT
74	12"x 12" Black VFT Mastic
75	2' x 2' Ceiling Tile
76	Vinyl Baseboard
77	Vinyl Baseboard Mastic
78	Spray-on Fireproofing
79	Drywall
80	Drywall Joint Compound
81	Rubber Flooring
82	Rubber Flooring Mastic
83	Carpet Mastic
84	Carpet Mastic
85	Carpet Mastic
86	Firedoors
87	Carpet MASTIC
88	Decorative plaster
89	12"x12" ceiling tile
90	12"x12" white w/ brown and green specks VFT
90A	12"x12" white w/ brown and green specks VFT MASTIC
91	12"x12" green VFT
91A	12"x12" green VFT MASTIC

92	12"x12" yellow VFT
92A	12"x12" yellow VFT MASTIC
93	Terrazzo
94	Terrazzo (Lower Auditorium Wall)
96	Stage Curtain
97	Transite Panel Behind Window Seat
HH	MJP E/F/V on Fiberglass Pipe Insulation
KK	MJP E/F/V on Fiberglass Pipe Insulation
MM	MJP E/F/V on Fiberglass Pipe Insulation

The following areas were deemed to be inaccessible:

83	Carpet Mastic
----	---------------

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by David Avila, IDPH License # 100-11093. The Management Plan was updated by Arturo Saenz, IDPH License # 100-04019. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Kilmer School Building 4300 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Kilmer School Unit 24021 Building ID 4300

Address 6700 N Greenview Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
31	12"x 12" Green w/ White Streaks VFT	800	SF	Rm 101, (305 not observed) - 1930	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
32	9"x9" Black VFT	2,475	SF	(First floor not observed) through Third Floor Hallway - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
33	12"x12" Green w/ White Streaks VFT	800	SF	Rm 101, (305 not observed) - 1930	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
34	9"x9" Black VFT Mastic	2,475	SF	(First floor not observed) through Third Floor Hallway - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	9"x9" Black VFT	1,125	SF	(First floor not observed) through Third Floor Hallway - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
36	9"x9" Black VFT Mastic	1,125	SF	First through Third Floor Hallway - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	12"x12" Light Brown w/ White/Black/Brown Spots VFT	1,500	SF	Room 112, 212 - 1936	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
38	12"x12" Lt Brn w/ White/Black/Brn Spots VFT Mastic	1,500	SF	Room 112, 212 - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	12"x12" Gray w/ White & Brown Streaks VFT	1,592	SF	Rm 114, 115, Foyer Outside Rm 214 & 215 - 1958	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
40	12"x12" Gray w/ White & Brown Streaks VFT Mastic	1,592	SF	Rm 114, 115, Foyer Outside Room 214 & 215 - 1958	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	12"x12" Blue VFT	2,000	SF	1st & 2nd Fl Passages To Addition, Foyer Outside Rm 114 & 115 and 214 & 215, Rm 318 -1959	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
42	12"x12" Blue VFT Mastic	2,000	SF	1st & 2nd Fl Passages To Addition, Foyer Outside Rm 114 & 115 and 214 & 215, Rm 318 -1959	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
43	9"x9" Beige w/ Brown Streaks VFT	3,430	SF	Room 214, 215, 314, 315, 318, Foyer Outside 214, 215, 314, 315 - 1958	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Kilmer School Unit 24021 Building ID 4300

Address 6700 N Greenview Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
44	9"x9" Beige w/ Brown Streaks VFT Mastic	3,430	SF	Room 214, 215, 314, 315, 318, Foyer Outside 214, 215, 314, 315 - 1958	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	12"x12" Black w/ Green & White Streaks VFT	800	SF	Room 101, (305 not observed) - 1930	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
46	12"x12" Black w/ Green & White Streaks VFT Mastic	800	SF	Room 101, (305 not observed) - 1930	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
47	9"x9" Red VFT	1,125	SF	(First floor not observed) through Third Floor Hallway - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
48	9"x9" Red VFT Mastic	1,125	SF	(First floor not observed) through Third Floor Hallway - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	9"x18" Black VFT	510	SF	(First floor not observed) through Third Floor Hallway - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
50	9"x18" Black VFT Mastic	510	SF	(First floor not observed) through Third Floor Hallway - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51	12"x12" Orange w/ Brown Streaks VFT	2,052	SF	Auditorium - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
52	12"x12" Orange w/ Brown Streaks VFT Mastic	2,052	SF	Auditorium - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	12"x12" Light Gray w/ White Spots VFT	60	SF	Main Office Lobby - 1930	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
54	12"x12" Light Gray w/ White Spots VFT Mastic	60	SF	Main Office Lobby - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	12"x36" Black VFT	250	SF	Room 101,(305 not observed) - 1930	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
56	12"x36" Black VFT Mastic	250	SF	Room 101,(305 not observed) - 1930	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
57	12"x12" Beige w/ Tan Spots VFT	800	SF	Room 102 - 1930	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
58	12"x12" Beige w/ Tan Spots VFT Mastic	800	SF	Room 102 - 1930	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
59	9"x9" Red VFT	2,475	SF	(First floor not observed) through Third Floor Hallway - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Kilmer School Unit 24021 Building ID 4300

Address 6700 N Greenview Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
60	9"x9" Red VFT Mastic - NOT OBSERVED	2,475	SF	(First floor not observed) through Third Floor Hallway - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
61	9"x18" Black VFT - NOT OBSERVED	1,050	SF	(First floor not observed) through Third Floor Hallway - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
62	9"x18" Black VFT Mastic - NOT OBSERVED	1,050	SF	(First floor not observed) through Third Floor Hallway - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	9"x9" Green VFT NOT OBSERVED	4,950	SF	First through Third Floor Hallway (Under HA # 59 & 60, 32 & 34) - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
64	9"x9" Green VFT Mastic NOT OBSERVED	4,950	SF	First through Third Floor Hallway (Under HA # 59 & 60, 32 & 34) - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65	9"x9" Green VFT NOT OBSERVED	2,250	SF	First through Third Floor Hallway (Under HA # 35 & 36, 47 & 48) - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
66	9"x9" Green VFT Mastic NOT OBSERVED	2,250	SF	First through Third Floor Hallway (Under HA # 35 & 36, 47 & 48) - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
67	Brown Linoleum	350	SF	Room 205 - 1930	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
68	Brown Linoleum Mastic	350	SF	Room 205 - 1930	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
69	12" X 12" Blue VFT	50,000	SF	Throughout - 1997	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
70	12"x 12" Blue VFT Mastic	50,000	SF	Throughout - 1997	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
71	12"x 12" Yellow VFT	1,000	SF	1st, 2nd, & 3rd Floor Corridors - 1997	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
72	12"x 12" Yellow VFT Mastic	1,000	SF	1st, 2nd, & 3rd Floor Corridors - 1997	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
73	12"x 12" Black VFT	165	SF	1st, 2nd, & 3rd Floor Corridors - 1997	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
74	12"x 12" Black VFT Mastic	165	SF	1st, 2nd, & 3rd Floor Corridors - 1997	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW

Chicago Public Schools

School Kilmer School Unit 24021 Building ID 4300

Address 6700 N Greenview Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
75	2' x 2' Ceiling Tile	60,000	SF	Throughout - 1997	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		MODERATE
76	Vinyl Baseboard	2,500	LF	Throughout - 1997	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
77	Vinyl Baseboard Mastic	2,500	LF	Throughout - 1997	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
78	Spray-on Fireproofing	20,000	SF	Throughout - 1997	ASSUMED	SURFACE	Y	NONE	0			ACBM with the potential for damage		MODERATE
79	Drywall	3,000	SF	3rd Fl Mens, Womens, Boys, & Girls Toilets,Rm 219 through 223, 117, 119, Kitchen, 122, 120- 1997	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
80	Drywall Joint Compound	250	LF	3rd Fl Mens, Womens, Boys, & Girls Toilets,Rm 219 through 223, 117, 119, Kitchen, 122, 120- 1997	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
81	Rubber Flooring	950	SF	1st Fl Corridor, NE Stairwell - 1997	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
82	Rubber Flooring Mastic	950	SF	1st Fl Corridor, NE Stairwell - 1997	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
83	Carpet Mastic	2,000	SF	Library, Library Office, NE & SE Main Office Storage Rooms - 1997	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
84	Carpet Mastic	150	SF	Rm 305 (1930 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
85	Carpet Mastic	100	SF	Rm 318 (1959 Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
86	Firedoors	6	EA	Balcony entrance, projector room auditorium	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
87	Carpet MASTIC	1,600	SF	Room 207 & 209,305 and along auditorium aisles	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
88	Decorative plaster	1,000	SF	1000	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
89	12"x12" ceiling tile	1,200	SF	auditorium	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
90	12"x12" white w/ brown and green specks VFT	4,000	SF	1st fl. corridor - 1930 bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Kilmer School Unit 24021 Building ID 4300

Address 6700 N Greenview Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
90A	12"x12" white w/ brown and green specks VFT MASTIC	4,000	SF	1st fl corridor - 1930 bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
91	12"x12" green VFT	65	SF	1st fl. hallway 1930	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
91A	12"x12" green VFT MASTIC	65	SF	1st fl. hallway 1930	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
92	12"x12" yellow VFT	52	SF	1st fl. hallway 1930	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
92A	12"x12" yellow VFT MASTIC	52	SF	1st fl. hallway 1930	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
93	Terrazzo	1,500	SF	all stairwells and 1 foot along corridors - 1930	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
94	Terrazzo (Lower Auditorium Wall)	1,500	SF	1936 bldg - all stairwells and 1 foot along corridors	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
95	MJP			Steam heating unit in rooms 114, 115, 214, 215, 314, 315	ABATED	MISC						Any remaining friable ACBM or friable suspect ACBM		
96	Stage Curtain	500	SF	Auditoriums	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
97	Transite Panel Behind Window Seat	85	SF	Rooms 107 and 109	ASSUMED	TSI	Y	NONE	0			ACBM with the potential for damage		MODERATE
CC	Aircell Pipe Insulation	200	LF	Crawl Space - 1958	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
DD	Cardboard Pipe Insulation	100	LF	Crawl Space - 1958	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
EE	MJP E/F/V on Aircell Pipe Insulation	30	LF	Crawl Space - 1958	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
FF	MJP E/F/V on Aircell Pipe Insulation	65	LF	Throughout - 1930	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
GG	MJP E/F/V on Cardboard Pipe Insulation	80	LF	Throughout - 1930	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
HH	MJP E/F/V on Fiberglass Pipe Insulation	20	LF	SE Storage Room - 1930	ASSUMED	TSI	Y	NONE	0			ACBM with the potential for damage		LOW
I	Tank Insulation	90	SF	Pump Room - 1930	CHR	TSI	Y		0		No	Damaged or significantly damaged friable thermal system insulating ACBM		LOW
II	MJP E/F/V on Aircell Pipe Insulation	90	LF	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
JJ	MJP E/F/V on Cardboard Pipe Insulation	35	LF	Fan Room, East,	CHR	TSI	Y	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Kilmer School Unit 24021 Building ID 4300

Address 6700 N Greenview Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				West & Center Unfinished Pipe Spaces - 1936								potential for damage		
KK	MJP E/F/V on Fiberglass Pipe Insulation	80	LF	East & Center Unfinished Pipe Spaces - 1936	ASSUMED	TSI	Y	NONE	0			ACBM with the potential for damage		LOW
LL	MJP E/F/V on Cardboard Pipe Insulation	15	LF	Crawl Space - 1958	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
M	Mag Block Pipe Insulation	375	LF	S. Book Storage, Area by S. Engine Room, N. Storage Area - 1930	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
MM	MJP E/F/V on Fiberglass Pipe Insulation	120	LF	Throughout Basement - 1958	ASSUMED	TSI	Y	NONE	0			ACBM with the potential for damage		LOW
N	MJP E/F/V on Mag Block Pipe Insulation	40	LF	S. Book Storage, Area by S. Engine Room, N. Storage Area - 1930	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
O	Cardboard Pipe Insulation	500	LF	Throughout - 1930	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
P	Aircell Pipe Insulation	700	LF	Throughout) - 1930	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
Q	Aircell Duct Insulation	200	LF	Southeast Storage Room - 1930	CHR	TSI	Y		0		No	Damaged or significantly damaged friable thermal system insulating ACBM		LOW
T	MJP E/F/V on Mag Block Pipe Insulation	35	LF	Fan Room, East & Center Unfinished Pipe Spaces - 1936	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
U	Mag Block Pipe Insulation	180	LF	Fan Room, East & Center Unfinished Pipe Spaces - 1936	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
V	Aircell Pipe Insulation	600	LF	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936	CHR	TSI	Y	NONE	0		No	Damaged or significantly damaged friable thermal system insulating ACBM		LOW
W	Cardboard Pipe Insulation	250	LF	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Kilmer School Unit 24021 Building ID 4300

Address 6700 N Greenview Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

Reinspection Date	<u>5/25/2019</u>
Inspector Name	<u>David Avila</u>
<u>100-11093</u>	<u>5/15/2020</u>
Inspector's IDPH License Number / Expiration Date	

Inspector's Comments

HA Number:	Inspector Comments:
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	

Chicago Public Schools

School Kilmer School **Unit** 24021 **Building ID** 4300

Address 6700 N Greenview Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
54	
55	
56	
57	
58	
59	
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	
80	
81	
82	

Chicago Public Schools

School Kilmer School **Unit** 24021 **Building ID** 4300

Address 6700 N Greenview Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
83	
84	
85	
86	
87	
88	
89	
90	
90A	
91	
91A	
92	
92A	
93	
94	
95	Abated Aug. 2018
96	
97	
CC	
DD	
EE	
FF	
GG	
HH	
I	Repaired, 2018
II	
JJ	
KK	
LL	

Chicago Public Schools

School Kilmer School **Unit** 24021 **Building ID** 4300

Address 6700 N Greenview Avenue **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
M	
MM	
N	
O	
P	
Q	Damage repaired, 2018
T	
U	
V	Damagee repaired 2018
W	

Table II

Management Planner's Review

Chicago Public Schools

School Kilmer School

Unit 24021

Building ID 4300

Address 6700 N Greenview Avenue

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
31	12"x 12" Green w/ White Streaks VFT	800	SF	Rm 101, (305 not observed) - 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	9"x9" Black VFT	2,475	SF	(First floor not observed) through Third Floor Hallway - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12"x12" Green w/ White Streaks VFT	800	SF	Rm 101, (305 not observed) - 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	9"x9" Black VFT Mastic	2,475	SF	(First floor not observed) through Third Floor Hallway - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	9"x9" Black VFT	1,125	SF	(First floor not observed) through Third Floor Hallway - 1936	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	9"x9" Black VFT Mastic	1,125	SF	First through Third Floor Hallway - 1936	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12"x12" Light Brown w/ White/Black/Brown Spots VFT	1,500	SF	Room 112, 212 - 1936	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12"x12" Lt Brn w/ White/Black/Brn Spots VFT Mastic	1,500	SF	Room 112, 212 - 1936	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12"x12" Gray w/ White & Brown Streaks VFT	1,592	SF	Rm 114, 115, Foyer Outside Rm 214 & 215 - 1958	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	12"x12" Gray w/ White & Brown Streaks VFT Mastic	1,592	SF	Rm 114, 115, Foyer Outside Room 214 & 215 - 1958	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	12"x12" Blue VFT	2,000	SF	1st & 2nd FI Passages To Addition, Foyer Outside Rm 114 & 115 and 214 & 215, Rm 318 -1959	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12"x12" Blue VFT Mastic	2,000	SF	1st & 2nd FI Passages To Addition, Foyer Outside Rm 114 & 115 and 214 & 215, Rm 318 -1959	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	9"x9" Beige w/ Brown Streaks VFT	3,430	SF	Room 214, 215, 314, 315, 318, Foyer Outside 214, 215, 314, 315 - 1958	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	9"x9" Beige w/ Brown Streaks VFT Mastic	3,430	SF	Room 214, 215, 314, 315, 318, Foyer Outside 214, 215, 314, 315 - 1958	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	12"x12" Black w/ Green & White Streaks VFT	800	SF	Room 101, (305 not observed) - 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	12"x12" Black w/ Green & White Streaks VFT Mastic	800	SF	Room 101, (305 not observed) - 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	9"x9" Red VFT	1,125	SF	(First floor not observed) through Third Floor Hallway - 1936	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	9"x9" Red VFT Mastic	1,125	SF	(First floor not observed) through Third Floor Hallway - 1936	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	9"x18" Black VFT	510	SF	(First floor not observed) through Third	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Kilmer School

Unit 24021

Building ID 4300

Address 6700 N Greenview Avenue

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Floor Hallway - 1936							
50	9"x18" Black VFT Mastic	510	SF	(First floor not observed) through Third Floor Hallway - 1936	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	12"x12" Orange w/ Brown Streaks VFT	2,052	SF	Auditorium - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	12"x12" Orange w/ Brown Streaks VFT Mastic	2,052	SF	Auditorium - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	12"x12" Light Gray w/ White Spots VFT	60	SF	Main Office Lobby - 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	12"x12" Light Gray w/ White Spots VFT Mastic	60	SF	Main Office Lobby - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	12"x36" Black VFT	250	SF	Room 101,(305 not observed) - 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	12"x36" Black VFT Mastic	250	SF	Room 101,(305 not observed) - 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	12"x12" Beige w/ Tan Spots VFT	800	SF	Room 102 - 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	12"x12" Beige w/ Tan Spots VFT Mastic	800	SF	Room 102 - 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	9"x9" Red VFT	2,475	SF	(First floor not observed) through Third Floor Hallway - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	9"x9" Red VFT Mastic - NOT OBSERVED	2,475	SF	(First floor not observed) through Third Floor Hallway - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	9"x18" Black VFT - NOT OBSERVED	1,050	SF	(First floor not observed) through Third Floor Hallway - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	9"x18" Black VFT Mastic - NOT OBSERVED	1,050	SF	(First floor not observed) through Third Floor Hallway - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63	9"x9" Green VFT NOT OBSERVED	4,950	SF	First through Third Floor Hallway (Under HA # 59 & 60, 32 & 34) - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64	9"x9" Green VFT Mastic NOT OBSERVED	4,950	SF	First through Third Floor Hallway (Under HA # 59 & 60, 32 & 34) - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65	9"x9" Green VFT NOT OBSERVED	2,250	SF	First through Third Floor Hallway (Under HA # 35 & 36, 47 & 48) - 1936	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
66	9"x9" Green VFT Mastic NOT OBSERVED	2,250	SF	First through Third Floor Hallway (Under HA # 35 & 36, 47 & 48) - 1936	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
67	Brown Linoleum	350	SF	Room 205 - 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68	Brown Linoleum Mastic	350	SF	Room 205 - 1930	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
69	12" X 12" Blue VFT	50,000	SF	Throughout - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
70	12"x 12" Blue VFT Mastic	50,000	SF	Throughout - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
71	12"x 12" Yellow VFT	1,000	SF	1st, 2nd, & 3rd Floor Corridors - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
72	12"x 12" Yellow VFT Mastic	1,000	SF	1st, 2nd, & 3rd Floor Corridors - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
73	12"x 12" Black VFT	165	SF	1st, 2nd, & 3rd Floor Corridors - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Kilmer School

Unit 24021

Building ID 4300

Address 6700 N Greenview Avenue

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
74	12"x 12" Black VFT Mastic	165	SF	1st, 2nd, & 3rd Floor Corridors - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
75	2' x 2' Ceiling Tile	60,000	SF	Throughout - 1997	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
76	Vinyl Baseboard	2,500	LF	Throughout - 1997	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
77	Vinyl Baseboard Mastic	2,500	LF	Throughout - 1997	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
78	Spray-on Fireproofing	20,000	SF	Throughout - 1997	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
79	Drywall	3,000	SF	3rd FI Mens, Womens, Boys, & Girls Toilets,Rm 219 through 223, 117, 119, Kitchen, 122, 120- 1997	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
80	Drywall Joint Compound	250	LF	3rd FI Mens, Womens, Boys, & Girls Toilets,Rm 219 through 223, 117, 119, Kitchen, 122, 120- 1997	Assumed	MISC	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
81	Rubber Flooring	950	SF	1st FI Corridor, NE Stairwell - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
82	Rubber Flooring Mastic	950	SF	1st FI Corridor, NE Stairwell - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
83	Carpet Mastic	2,000	SF	Library, Library Office, NE & SE Main Office Storage Rooms - 1997	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
84	Carpet Mastic	150	SF	Rm 305 (1930 Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
85	Carpet Mastic	100	SF	Rm 318 (1959 Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
86	Firedoors	6	EA	Balcony entrance, projector room auditorium	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
87	Carpet MASTIC	1,600	SF	Room 207 & 209,305 and along auditorium aisles	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
88	Decorative plaster	1,000	SF	1000	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
89	12"x12" ceiling tile	1,200	SF	auditorium	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
90	12"x12" white w/ brown and green specks VFT	4,000	SF	1st fl. corridor - 1930 bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
90A	12"x12" white w/ brown and green specks VFT MASTIC	4,000	SF	1st fl corridor - 1930 bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
91	12"x12" green VFT	65	SF	1st fl. hallway 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
91A	12"x12" green VFT MASTIC	65	SF	1st fl. hallway 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
92	12"x12" yellow VFT	52	SF	1st fl. hallway 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
92A	12"x12" yellow VFT MASTIC	52	SF	1st fl. hallway 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
93	Terrazzo	1,500	SF	all stairwells and 1 foot along corridors - 1930	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
94	Terrazzo (Lower Auditorium Wall)	1,500	SF	1936 bldg - all stairwells and 1 foot along corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Kilmer School

Unit 24021

Building ID 4300

Address 6700 N Greenview Avenue

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
95	MJP			Steam heating unit in rooms 114, 115, 214, 215, 314, 315	Abated	MISC				7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
96	Stage Curtain	500	SF	Auditoriums	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
97	Transite Panel Behind Window Seat	85	SF	Rooms 107 and 109	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CC	Aircell Pipe Insulation	200	LF	Crawl Space - 1958	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
DD	Cardboard Pipe Insulation	100	LF	Crawl Space - 1958	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
EE	MJP E/F/V on Aircell Pipe Insulation	30	LF	Crawl Space - 1958	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
FF	MJP E/F/V on Aircell Pipe Insulation	65	LF	Throughout - 1930	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
GG	MJP E/F/V on Cardboard Pipe Insulation	80	LF	Throughout - 1930	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
HH	MJP E/F/V on Fiberglass Pipe Insulation	20	LF	SE Storage Room - 1930	Assumed	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
I	Tank Insulation	90	SF	Pump Room - 1930	Chrysotile	TSI	Yes	0	SF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Follow O&M Plan
II	MJP E/F/V on Aircell Pipe Insulation	90	LF	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
JJ	MJP E/F/V on Cardboard Pipe Insulation	35	LF	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
KK	MJP E/F/V on Fiberglass Pipe Insulation	80	LF	East & Center Unfinished Pipe Spaces - 1936	Assumed	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
LL	MJP E/F/V on Cardboard Pipe Insulation	15	LF	Crawl Space - 1958	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
M	Mag Block Pipe Insulation	375	LF	S. Book Storage, Area by S. Engine Room, N. Storage Area - 1930	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
MM	MJP E/F/V on Fiberglass Pipe Insulation	120	LF	Throughout Basement - 1958	Assumed	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
N	MJP E/F/V on Mag Block Pipe Insulation	40	LF	S. Book Storage, Area by S. Engine Room, N. Storage Area - 1930	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
O	Cardboard Pipe Insulation	500	LF	Throughout - 1930	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
P	Aircell Pipe Insulation	700	LF	Throughout) - 1930	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
Q	Aircell Duct Insulation	200	LF	Southeast Storage Room - 1930	Chrysotile	TSI	Yes	0	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Follow O&M Plan
T	MJP E/F/V on Mag Block Pipe Insulation	35	LF	Fan Room, East & Center Unfinished Pipe Spaces - 1936	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
U	Mag Block Pipe Insulation	180	LF	Fan Room, East & Center Unfinished Pipe Spaces - 1936	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
V	Aircell Pipe Insulation	600	LF	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936	Chrysotile	TSI	Yes	0	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Follow O&M Plan

Chicago Public Schools

School

Kilmer School

Unit

24021

Building ID

4300

Address

6700 N Greenview Avenue

Chicago, IL, 60626

Region

01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone:

3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
W	Cardboard Pipe Insulation	250	LF	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan

Review Date	09/20/2019
Manager Planner Name	Arturo Saenz

HA Number	Management Comments
31	

Chicago Public Schools

School Kilmer School

Unit 24021

Building ID 4300

Address 6700 N Greenview Avenue

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

100-04019	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	

Chicago Public Schools

School Kilmer School

Unit 24021

Building ID 4300

Address 6700 N Greenview Avenue

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
58	
59	
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	
80	
81	
82	
83	

Chicago Public Schools

School Kilmer School

Unit 24021

Building ID 4300

Address 6700 N Greenview Avenue

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
84	
85	
86	
87	
88	
89	
90	
90A	
91	
91A	
92	
92A	
93	
94	
95	
96	
97	
CC	
DD	
EE	
FF	
GG	
HH	
I	
II	
JJ	

Chicago Public Schools

School Kilmer School

Unit 24021

Building ID 4300

Address 6700 N Greenview Avenue

Chicago, IL, 60626

Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
KK	
LL	
M	
MM	
N	
O	
P	
Q	
T	
U	
V	
W	

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	12"x 12" Green w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rm 101, (305 not observed) - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	12"x 12" Green w/ White Streaks VFT		
MATERIAL LOCATION:	Rm 101, (305 not observed) - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	9"x9" Black VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	2475	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	9"x9" Black VFT		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	2475	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	12"x12" Green w/ White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rm 101, (305 not observed) - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	12"x12" Green w/ White Streaks VFT		
MATERIAL LOCATION:	Rm 101, (305 not observed) - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	9"x9" Black VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	2475	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	9"x9" Black VFT Mastic		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	2475	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	9"x9" Black VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	1125	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	9"x9" Black VFT		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	1125	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	9"x9" Black VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	First through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	1125	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	9"x9" Black VFT Mastic		
MATERIAL LOCATION:	First through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	1125	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12"x12" Light Brown w/ White/Black/Brown Spots VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 112, 212 - 1936		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12"x12" Light Brown w/ White/Black/Brown Spots VFT		
MATERIAL LOCATION:	Room 112, 212 - 1936		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12"x12" Lt Brn w/ White/Black/Brn Spots VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 112, 212 - 1936		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12"x12" Lt Brn w/ White/Black/Brn Spots VFT Mastic		
MATERIAL LOCATION:	Room 112, 212 - 1936		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White & Brown Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rm 114, 115, Foyer Outside Rm 214 & 215 - 1958		
MATERIAL QUANTITY:	1592	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White & Brown Streaks VFT		
MATERIAL LOCATION:	Rm 114, 115, Foyer Outside Rm 214 & 215 - 1958		
MATERIAL QUANTITY:	1592	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White & Brown Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rm 114, 115, Foyer Outside Room 214 & 215 - 1958		
MATERIAL QUANTITY:	1592	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	12"x12" Gray w/ White & Brown Streaks VFT Mastic		
MATERIAL LOCATION:	Rm 114, 115, Foyer Outside Room 214 & 215 - 1958		
MATERIAL QUANTITY:	1592	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	41		
MATERIAL DESCRIPTION:	12"x12" Blue VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **1st & 2nd FI Passages To Addition, Foyer Outside Rm 114 & 115 and 214 & 215, Rm 318 -1959**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	41				
MATERIAL DESCRIPTION:	12"x12" Blue VFT				
MATERIAL LOCATION:	1st & 2nd FI Passages To Addition, Foyer Outside Rm 114 & 115 and 214 & 215, Rm 318 -1959				
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	12"x12" Blue VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st & 2nd FI Passages To Addition, Foyer Outside Rm 114 & 115 and 214 & 215, Rm 318 -1959**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	42				
MATERIAL DESCRIPTION:	12"x12" Blue VFT Mastic				
MATERIAL LOCATION:	1st & 2nd Fl Passages To Addition, Foyer Outside Rm 114 & 115 and 214 & 215, Rm 318 -1959				
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	9"x9" Beige w/ Brown Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 214, 215, 314, 315, 318, Foyer Outside 214, 215, 314, 315 - 1958		
MATERIAL QUANTITY:	3430	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	9"x9" Beige w/ Brown Streaks VFT		
MATERIAL LOCATION:	Room 214, 215, 314, 315, 318, Foyer Outside 214, 215, 314, 315 - 1958		
MATERIAL QUANTITY:	3430	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	9"x9" Beige w/ Brown Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 214, 215, 314, 315, 318, Foyer Outside 214, 215, 314, 315 - 1958		
MATERIAL QUANTITY:	3430	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	9"x9" Beige w/ Brown Streaks VFT Mastic		
MATERIAL LOCATION:	Room 214, 215, 314, 315, 318, Foyer Outside 214, 215, 314, 315 - 1958		
MATERIAL QUANTITY:	3430	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	12"x12" Black w/ Green & White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 101, (305 not observed) - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	12"x12" Black w/ Green & White Streaks VFT		
MATERIAL LOCATION:	Room 101, (305 not observed) - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	12"x12" Black w/ Green & White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 101, (305 not observed) - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	12"x12" Black w/ Green & White Streaks VFT Mastic		
MATERIAL LOCATION:	Room 101, (305 not observed) - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	47		
MATERIAL DESCRIPTION:	9"x9" Red VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	1125	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	47		
MATERIAL DESCRIPTION:	9"x9" Red VFT		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	1125	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	9"x9" Red VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	1125	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	9"x9" Red VFT Mastic		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	1125	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	9"x18" Black VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	510	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	9"x18" Black VFT		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	510	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	9"x18" Black VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	510	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	9"x18" Black VFT Mastic		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1936		
MATERIAL QUANTITY:	510	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	51		
MATERIAL DESCRIPTION:	12"x12" Orange w/ Brown Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Auditorium - 1930		
MATERIAL QUANTITY:	2052	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	51		
MATERIAL DESCRIPTION:	12"x12" Orange w/ Brown Streaks VFT		
MATERIAL LOCATION:	Auditorium - 1930		
MATERIAL QUANTITY:	2052	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	52		
MATERIAL DESCRIPTION:	12"x12" Orange w/ Brown Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium - 1930		
MATERIAL QUANTITY:	2052	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	52		
MATERIAL DESCRIPTION:	12"x12" Orange w/ Brown Streaks VFT Mastic		
MATERIAL LOCATION:	Auditorium - 1930		
MATERIAL QUANTITY:	2052	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	53		
MATERIAL DESCRIPTION:	12"x12" Light Gray w/ White Spots VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Main Office Lobby - 1930		
MATERIAL QUANTITY:	60	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	53		
MATERIAL DESCRIPTION:	12"x12" Light Gray w/ White Spots VFT		
MATERIAL LOCATION:	Main Office Lobby - 1930		
MATERIAL QUANTITY:	60	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	54		
MATERIAL DESCRIPTION:	12"x12" Light Gray w/ White Spots VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office Lobby - 1930		
MATERIAL QUANTITY:	60	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	54		
MATERIAL DESCRIPTION:	12"x12" Light Gray w/ White Spots VFT Mastic		
MATERIAL LOCATION:	Main Office Lobby - 1930		
MATERIAL QUANTITY:	60	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	55		
MATERIAL DESCRIPTION:	12"x36" Black VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 101,(305 not observed) - 1930		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	55		
MATERIAL DESCRIPTION:	12"x36" Black VFT		
MATERIAL LOCATION:	Room 101,(305 not observed) - 1930		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	56		
MATERIAL DESCRIPTION:	12"x36" Black VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 101,(305 not observed) - 1930		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	56		
MATERIAL DESCRIPTION:	12"x36" Black VFT Mastic		
MATERIAL LOCATION:	Room 101,(305 not observed) - 1930		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	57		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Tan Spots VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 102 - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	57		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Tan Spots VFT		
MATERIAL LOCATION:	Room 102 - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	58		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Tan Spots VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 102 - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	58		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Tan Spots VFT Mastic		
MATERIAL LOCATION:	Room 102 - 1930		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	59		
MATERIAL DESCRIPTION:	9"x9" Red VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	2475	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	59		
MATERIAL DESCRIPTION:	9"x9" Red VFT		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	2475	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	60		
MATERIAL DESCRIPTION:	9"x9" Red VFT Mastic - NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	2475	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	60		
MATERIAL DESCRIPTION:	9"x9" Red VFT Mastic - NOT OBSERVED		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	2475	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	61		
MATERIAL DESCRIPTION:	9"x18" Black VFT - NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	1050	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	61		
MATERIAL DESCRIPTION:	9"x18" Black VFT - NOT OBSERVED		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	1050	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	62		
MATERIAL DESCRIPTION:	9"x18" Black VFT Mastic - NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	1050	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	62		
MATERIAL DESCRIPTION:	9"x18" Black VFT Mastic - NOT OBSERVED		
MATERIAL LOCATION:	(First floor not observed) through Third Floor Hallway - 1930		
MATERIAL QUANTITY:	1050	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	63		
MATERIAL DESCRIPTION:	9"x9" Green VFT NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	First through Third Floor Hallway (Under HA # 59 & 60, 32 & 34) - 1930		
MATERIAL QUANTITY:	4950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	63		
MATERIAL DESCRIPTION:	9"x9" Green VFT NOT OBSERVED		
MATERIAL LOCATION:	First through Third Floor Hallway (Under HA # 59 & 60, 32 & 34) - 1930		
MATERIAL QUANTITY:	4950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	64		
MATERIAL DESCRIPTION:	9"x9" Green VFT Mastic NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	First through Third Floor Hallway (Under HA # 59 & 60, 32 & 34) - 1930		
MATERIAL QUANTITY:	4950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	64		
MATERIAL DESCRIPTION:	9"x9" Green VFT Mastic NOT OBSERVED		
MATERIAL LOCATION:	First through Third Floor Hallway (Under HA # 59 & 60, 32 & 34) - 1930		
MATERIAL QUANTITY:	4950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	65		
MATERIAL DESCRIPTION:	9"x9" Green VFT NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	First through Third Floor Hallway (Under HA # 35 & 36, 47 & 48) - 1936		
MATERIAL QUANTITY:	2250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	65		
MATERIAL DESCRIPTION:	9"x9" Green VFT NOT OBSERVED		
MATERIAL LOCATION:	First through Third Floor Hallway (Under HA # 35 & 36, 47 & 48) - 1936		
MATERIAL QUANTITY:	2250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	66		
MATERIAL DESCRIPTION:	9"x9" Green VFT Mastic NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	First through Third Floor Hallway (Under HA # 35 & 36, 47 & 48) - 1936		
MATERIAL QUANTITY:	2250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	66		
MATERIAL DESCRIPTION:	9"x9" Green VFT Mastic NOT OBSERVED		
MATERIAL LOCATION:	First through Third Floor Hallway (Under HA # 35 & 36, 47 & 48) - 1936		
MATERIAL QUANTITY:	2250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	67		
MATERIAL DESCRIPTION:	Brown Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 205 - 1930		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	67		
MATERIAL DESCRIPTION:	Brown Linoleum		
MATERIAL LOCATION:	Room 205 - 1930		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	68		
MATERIAL DESCRIPTION:	Brown Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 205 - 1930		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	68		
MATERIAL DESCRIPTION:	Brown Linoleum Mastic		
MATERIAL LOCATION:	Room 205 - 1930		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	69		
MATERIAL DESCRIPTION:	12" X 12" Blue VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	50000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	69		
MATERIAL DESCRIPTION:	12" X 12" Blue VFT		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	50000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	70		
MATERIAL DESCRIPTION:	12"x 12" Blue VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	50000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	70		
MATERIAL DESCRIPTION:	12"x 12" Blue VFT Mastic		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	50000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	71		
MATERIAL DESCRIPTION:	12"x 12" Yellow VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors - 1997		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	71		
MATERIAL DESCRIPTION:	12"x 12" Yellow VFT		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors - 1997		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	72		
MATERIAL DESCRIPTION:	12"x 12" Yellow VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors - 1997		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	72		
MATERIAL DESCRIPTION:	12"x 12" Yellow VFT Mastic		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors - 1997		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	73		
MATERIAL DESCRIPTION:	12"x 12" Black VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors - 1997		
MATERIAL QUANTITY:	165	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	73		
MATERIAL DESCRIPTION:	12"x 12" Black VFT		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors - 1997		
MATERIAL QUANTITY:	165	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	74		
MATERIAL DESCRIPTION:	12"x 12" Black VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors - 1997		
MATERIAL QUANTITY:	165	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	74		
MATERIAL DESCRIPTION:	12"x 12" Black VFT Mastic		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors - 1997		
MATERIAL QUANTITY:	165	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	75		
MATERIAL DESCRIPTION:	2' x 2' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	60000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	75		
MATERIAL DESCRIPTION:	2' x 2' Ceiling Tile		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	60000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	76		
MATERIAL DESCRIPTION:	Vinyl Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	76		
MATERIAL DESCRIPTION:	Vinyl Baseboard		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	77		
MATERIAL DESCRIPTION:	Vinyl Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	77		
MATERIAL DESCRIPTION:	Vinyl Baseboard Mastic		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	78		
MATERIAL DESCRIPTION:	Spray-on Fireproofing		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	78		
MATERIAL DESCRIPTION:	Spray-on Fireproofing		
MATERIAL LOCATION:	Throughout - 1997		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	79		
MATERIAL DESCRIPTION:	Drywall		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **3rd Fl Mens, Womens, Boys, & Girls Toilets, Rm 219 through 223, 117, 119, Kitchen, 122, 120- 1997**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	79		
MATERIAL DESCRIPTION:	Drywall		
MATERIAL LOCATION:	3rd Fl Mens, Womens, Boys, & Girls Toilets, Rm 219 through 223, 117, 119, Kitchen, 122, 120- 1997		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	80		
MATERIAL DESCRIPTION:	Drywall Joint Compound		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **3rd Fl Mens, Womens, Boys, & Girls Toilets, Rm 219 through 223, 117, 119, Kitchen, 122, 120- 1997**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	80				
MATERIAL DESCRIPTION:	Drywall Joint Compound				
MATERIAL LOCATION:	3rd Fl Mens, Womens, Boys, & Girls Toilets, Rm 219 through 223, 117, 119, Kitchen, 122, 120- 1997				
MATERIAL QUANTITY:	250	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	81		
MATERIAL DESCRIPTION:	Rubber Flooring		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st FI Corridor, NE Stairwell - 1997		
MATERIAL QUANTITY:	950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	81		
MATERIAL DESCRIPTION:	Rubber Flooring		
MATERIAL LOCATION:	1st FI Corridor, NE Stairwell - 1997		
MATERIAL QUANTITY:	950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	82		
MATERIAL DESCRIPTION:	Rubber Flooring Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st FI Corridor, NE Stairwell - 1997		
MATERIAL QUANTITY:	950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	82		
MATERIAL DESCRIPTION:	Rubber Flooring Mastic		
MATERIAL LOCATION:	1st FI Corridor, NE Stairwell - 1997		
MATERIAL QUANTITY:	950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	83		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library, Library Office, NE & SE Main Office Storage Rooms - 1997		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	83		
MATERIAL DESCRIPTION:	Carpet Mastic		
MATERIAL LOCATION:	Library, Library Office, NE & SE Main Office Storage Rooms - 1997		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	84		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rm 305 (1930 Bldg)		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	84		
MATERIAL DESCRIPTION:	Carpet Mastic		
MATERIAL LOCATION:	Rm 305 (1930 Bldg)		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	85		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rm 318 (1959 Bldg)		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	85		
MATERIAL DESCRIPTION:	Carpet Mastic		
MATERIAL LOCATION:	Rm 318 (1959 Bldg)		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	86		
MATERIAL DESCRIPTION:	Firedoors		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Balcony entrance, projector room auditorium		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	EA
DAMAGE QUANTITY:	0	DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	86		
MATERIAL DESCRIPTION:	Firedoors		
MATERIAL LOCATION:	Balcony entrance, projector room auditorium		
MATERIAL QUANTITY:	6	MATERIAL UNITS:	EA
DAMAGE QUANTITY:	0	DAMAGE UNITS:	EA

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	87		
MATERIAL DESCRIPTION:	Carpet MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 207 & 209,305 and along auditorium aisles		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	87		
MATERIAL DESCRIPTION:	Carpet MASTIC		
MATERIAL LOCATION:	Room 207 & 209,305 and along auditorium aisles		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	88		
MATERIAL DESCRIPTION:	Decorative plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1000		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	88		
MATERIAL DESCRIPTION:	Decorative plaster		
MATERIAL LOCATION:	1000		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	89		
MATERIAL DESCRIPTION:	12"x12" ceiling tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	auditorium		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	89		
MATERIAL DESCRIPTION:	12"x12" ceiling tile		
MATERIAL LOCATION:	auditorium		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	90		
MATERIAL DESCRIPTION:	12"x12" white w/ brown and green specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st fl. corridor - 1930 bldg		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	90		
MATERIAL DESCRIPTION:	12"x12" white w/ brown and green specks VFT		
MATERIAL LOCATION:	1st fl. corridor - 1930 bldg		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	90A		
MATERIAL DESCRIPTION:	12"x12" white w/ brown and green specks VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st fl corridor - 1930 bldg		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	90A		
MATERIAL DESCRIPTION:	12"x12" white w/ brown and green specks VFT MASTIC		
MATERIAL LOCATION:	1st fl corridor - 1930 bldg		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	91		
MATERIAL DESCRIPTION:	12"x12" green VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st fl. hallway 1930		
MATERIAL QUANTITY:	65	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	91		
MATERIAL DESCRIPTION:	12"x12" green VFT		
MATERIAL LOCATION:	1st fl. hallway 1930		
MATERIAL QUANTITY:	65	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	91A		
MATERIAL DESCRIPTION:	12"x12" green VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st fl. hallway 1930		
MATERIAL QUANTITY:	65	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	91A		
MATERIAL DESCRIPTION:	12"x12" green VFT MASTIC		
MATERIAL LOCATION:	1st fl. hallway 1930		
MATERIAL QUANTITY:	65	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	92		
MATERIAL DESCRIPTION:	12"x12" yellow VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st fl. hallway 1930		
MATERIAL QUANTITY:	52	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	92		
MATERIAL DESCRIPTION:	12"x12" yellow VFT		
MATERIAL LOCATION:	1st fl. hallway 1930		
MATERIAL QUANTITY:	52	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	92A		
MATERIAL DESCRIPTION:	12"x12" yellow VFT MASTIC		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st fl. hallway 1930		
MATERIAL QUANTITY:	52	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	92A		
MATERIAL DESCRIPTION:	12"x12" yellow VFT MASTIC		
MATERIAL LOCATION:	1st fl. hallway 1930		
MATERIAL QUANTITY:	52	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	93		
MATERIAL DESCRIPTION:	Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	all stairwells and 1 foot along corridors - 1930		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	93		
MATERIAL DESCRIPTION:	Terrazzo		
MATERIAL LOCATION:	all stairwells and 1 foot along corridors - 1930		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	94		
MATERIAL DESCRIPTION:	Terrazzo (Lower Auditorium Wall)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1936 bldg - all stairwells and 1 foot along corridors		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	94		
MATERIAL DESCRIPTION:	Terrazzo (Lower Auditorium Wall)		
MATERIAL LOCATION:	1936 bldg - all stairwells and 1 foot along corridors		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	95	
MATERIAL DESCRIPTION:	MJP	
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan	
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Steam heating unit in rooms 114, 115, 214, 215, 314, 315

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Abated Aug. 2018

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA: **95**

MATERIAL DESCRIPTION: **MJP**

MATERIAL LOCATION: **Steam heating unit in rooms 114, 115, 214, 215, 314, 315**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	96		
MATERIAL DESCRIPTION:	Stage Curtain		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Auditoriums		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	96		
MATERIAL DESCRIPTION:	Stage Curtain		
MATERIAL LOCATION:	Auditoriums		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	97		
MATERIAL DESCRIPTION:	Transite Panel Behind Window Seat		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 107 and 109		
MATERIAL QUANTITY:	85	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	97		
MATERIAL DESCRIPTION:	Transite Panel Behind Window Seat		
MATERIAL LOCATION:	Rooms 107 and 109		
MATERIAL QUANTITY:	85	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	CC		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Crawl Space - 1958		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	CC		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
MATERIAL LOCATION:	Crawl Space - 1958		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	DD		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Crawl Space - 1958		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	DD				
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation				
MATERIAL LOCATION:	Crawl Space - 1958				
MATERIAL QUANTITY:	100	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	EE		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Crawl Space - 1958		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	EE				
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation				
MATERIAL LOCATION:	Crawl Space - 1958				
MATERIAL QUANTITY:	30	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FF		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1930		
MATERIAL QUANTITY:	65	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	FF		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
MATERIAL LOCATION:	Throughout - 1930		
MATERIAL QUANTITY:	65	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	GG		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1930		
MATERIAL QUANTITY:	80	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA: **GG**

MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**

MATERIAL LOCATION: **Throughout - 1930**

MATERIAL QUANTITY: **80**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	HH		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	SE Storage Room - 1930		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	HH				
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation				
MATERIAL LOCATION:	SE Storage Room - 1930				
MATERIAL QUANTITY:	20	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	I		
MATERIAL DESCRIPTION:	Tank Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 Damaged or significantly damaged friable thermal system insulating ACM		
HISTORICAL DAMAGE REASON:	Physical Damage		
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Pump Room - 1930**

MATERIAL QUANTITY: **90**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS: **Repaired, 2018**

Inspector's Signature: _____

Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **Tank Insulation**

MATERIAL LOCATION: **Pump Room - 1930**

MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	II		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936		
MATERIAL QUANTITY:	90	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	II		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
MATERIAL LOCATION:	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936		
MATERIAL QUANTITY:	90	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	JJ		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936		
MATERIAL QUANTITY:	35	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA: JJ

MATERIAL DESCRIPTION: MJP E/F/V on Cardboard Pipe Insulation

MATERIAL LOCATION: Fan Room, East, West & Center Unfinished Pipe Spaces - 1936

MATERIAL QUANTITY: 35 MATERIAL UNITS: LF

DAMAGE QUANTITY: 0 DAMAGE UNITS: LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/20/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	KK		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	East & Center Unfinished Pipe Spaces - 1936		
MATERIAL QUANTITY:	80	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	KK				
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation				
MATERIAL LOCATION:	East & Center Unfinished Pipe Spaces - 1936				
MATERIAL QUANTITY:	80	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	LL		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Crawl Space - 1958		
MATERIAL QUANTITY:	15	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA: LL

MATERIAL DESCRIPTION: MJP E/F/V on Cardboard Pipe Insulation

MATERIAL LOCATION: Crawl Space - 1958

MATERIAL QUANTITY: 15

MATERIAL UNITS: LF

DAMAGE QUANTITY: 0

DAMAGE UNITS: LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/20/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	M		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	S. Book Storage, Area by S. Engine Room, N. Storage Area - 1930		
MATERIAL QUANTITY:	375	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	M		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
MATERIAL LOCATION:	S. Book Storage, Area by S. Engine Room, N. Storage Area - 1930		
MATERIAL QUANTITY:	375	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	MM		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Basement - 1958		
MATERIAL QUANTITY:	120	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	MM				
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation				
MATERIAL LOCATION:	Throughout Basement - 1958				
MATERIAL QUANTITY:	120	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	N		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	S. Book Storage, Area by S. Engine Room, N. Storage Area - 1930		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	N		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
MATERIAL LOCATION:	S. Book Storage, Area by S. Engine Room, N. Storage Area - 1930		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	O		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1930		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	O		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
MATERIAL LOCATION:	Throughout - 1930		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	P		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout) - 1930		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	P		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
MATERIAL LOCATION:	Throughout) - 1930		
MATERIAL QUANTITY:	700	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Q		
MATERIAL DESCRIPTION:	Aircell Duct Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 Damaged or significantly damaged friable thermal system insulating ACM		
HISTORICAL DAMAGE REASON:	Physical Damage		
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Southeast Storage Room - 1930**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS: **Damage repaired, 2018**

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	Q		
MATERIAL DESCRIPTION:	Aircell Duct Insulation		
MATERIAL LOCATION:	Southeast Storage Room - 1930		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	T		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Fan Room, East & Center Unfinished Pipe Spaces - 1936		
MATERIAL QUANTITY:	35	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	T		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
MATERIAL LOCATION:	Fan Room, East & Center Unfinished Pipe Spaces - 1936		
MATERIAL QUANTITY:	35	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	U		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Fan Room, East & Center Unfinished Pipe Spaces - 1936		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	U		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
MATERIAL LOCATION:	Fan Room, East & Center Unfinished Pipe Spaces - 1936		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	V		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 Damaged or significantly damaged friable thermal system insulating ACM		
HISTORICAL DAMAGE REASON:	Physical Damage		
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Fan Room, East, West & Center Unfinished Pipe Spaces - 1936**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS: **Damagee repaired 2018**

Inspector's Signature: _____ Date: **05/25/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	V		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
MATERIAL LOCATION:	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Kilmer School	INSPECTION DATE:	5/25/2019		
ADDRESS:	6700 N Greenview Avenue	IDPH LICENSE NO:	100-11093		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	W		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 05/25/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24021	BUILDING ID:	4300
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Kilmer School	REVIEW DATE:	9/20/2019		
ADDRESS:	6700 N Greenvew Avenue	IDPH LICENSE NO:	100-11093		

HOMOGENEOUS AREA:	W		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
MATERIAL LOCATION:	Fan Room, East, West & Center Unfinished Pipe Spaces - 1936		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/20/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

DAVID AVILA

This is to certify that _____
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 02/13/2016 _____ with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



02/13/2016

Course Dates:

02/13/2017

Expires:

1602BIR08

Certificate Number:

N. J. Penoff

Director of Training

Nicholas J. Penoff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

5/9/2018

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11093

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

		ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 11093	ISSUED 5/9/2018	EXPIRES 05/15/2019		INSPECTOR	2/10/2019
DAVID AVILA 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health		PROJECT MANAGER 9/16/2018 AIR SAMPLING PROFESSIONAL Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.			

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that DAVID AVILA
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 02/09/2019 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



PUBLIC HEALTH & SAFETY
Environmental and Occupational Services
378 Ashland Ave., Chicago, IL 60617
www.public-health-safety.com
Office: 312-491-0081
Fax: 312-421-2901

02/09/2019

Course Dates:

02/09/2020

Expires:

1902BIR05

Certificate Number:

Nicholas J. Peneff

Director of Training
Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/19/2019



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11093

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 11093	ISSUED 4/19/2019	INSPECTOR	2/9/2020
DAVID AVILA 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health	EXPIRES 05/15/2020 	PROJECT MANAGER AIR SAMPLING PROFESSIONAL	9/15/2019
		Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Arturo Saenz

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 2/28/2019

Exam Date: 2/28/2019

Expiration Date: 2/28/2020

Certificate Number: MPR1902280693

Kathy DeSalvo, Director



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER	ISSUED	EXPIRES
100 - 04019	4/30/2019	05/15/2020

ARTURO SAENZ
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

2/28/2020

MANAGEMENT PLANNER

2/28/2020

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois

Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed