

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2370
SCHOOL NAME: Nettelhorst School
ADDRESS OF SCHOOL: 3252 N Broadway Street
CITY: Chicago, IL, 60657

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/24/2016**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 772
IDPH INSPECTOR LICENSE NUMBER: 100-18350
IDPH LICENSED INSPECTOR NAME(Please Print): Joseph Hennigan
IDPH MP LICENSE NUMBER: 100-04019
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Arturo Saenz

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Nettelhorst School

3252 N Broadway Street
Chicago, IL, 60657

Unit: 24661
Building ID: 5070

IDPH ID Number: 14-016-2990-2370

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

Chicago Public Schools
42 West Madison Street
Chicago, IL 60602

Prepared by:

GSG-Probe Consulting, Inc.

2942 W. Van Buren

Chicago, IL, 60612

Phone 3123197575

Fax

DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW

September 11, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

GSG-Probe Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 24661 Region: 01 IDPH ID:14-016-2990-2370

School: Nettelhorst School Building ID: 5070

Address: 3252 N Broadway Street

Chicago, IL, 60657

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 10/23/2019

Inspector: Joseph Hennigan

Inspector IDPH License: 100-18350

Management Planner: Arturo Saenz

Management Planner IDPH License: 100-04019

If you have any questions or comments, please contact us at 3123197575

Sincerely,
GSG-Probe Consulting, Inc.

Arturo Saenz
100-04019

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: September 11, 2019

RE: Nettelhorst School, Unit 24661
3252 N Broadway Street
Chicago, IL, 60657

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Nettelhorst School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Nettelhorst School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School:	Nettelhorst School	Unit:	24661	Region:	01
Address:	3252 N Broadway Street		Chicago, IL, 60657		
IDPH ID:	14-016-2990-2370		Building ID:	5070	
Contact:			Phone:		

2. Description of Facility

Original Construction:	1937	Additional Construction:	1893,1913,1954
Total Square Footage:	19638	No of Floors:	2
Current Occupancy:	772		

3. LEA Designated Person

Contact:	Robert Christlieb	Phone:	(773) 553-3197
Address:	42 West Madison Street		
	Chicago, IL 60602		

4. Managing Environmental Consultant

MEC:	GSG-Probe Consulting, Inc.		
Contact:	Jigar Shah		
Address	2942 W. Van Buren		
	Chicago, IL, 60612		
Phone:	3123197575	Fax:	

5. Inspector

Inspector Name: Joseph Hennigan

Inspector IDPH license #	100-18350	Signature:	
		Date:	9/11/2019

6. Management Planner

Management Planner Name: Arturo Saenz

Management Planner IDPH license #	100-04019	Signature:	
		Date:	10/23/2019

7. Review Date:10/23/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

GSG-Probe Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Nettelhorst School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 5070:

B. The following new homogenous areas have been identified for Building 5070:

41	Multicolor Linoleum
41A	Multicolor Linoleum Mastic
42	12" x 12" Tan w/ White Specks VFT
42A	12" x 12" Tan w/ White Specks VFT Mastic
43	12" x 12" Blue w/ White Specks VFT
43A	12" x 12" Blue w/ White Specks VFT Mastic
44	2' x 4' White Textured Ceiling Tile
45	2' x 4' White Textured Ceiling Tile

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

08	Hard Coat Plaster
09	Hard Coat Plaster
10	Hard Coat Plaster
11	Hard Coat Plaster
12	12" x 12" Green VFT (Under Hardwood Floor)
15	12" x 12" Brown w/White Streaks VFT Mastic
17	12" x 12" Green VFT Mastic (Under Hardwood Floor)
19	12" x 12" Off White w/Tan Streaks VFT THESE TILES HAVE BEEN PAINTED OVER
19A	12" x 12" Off White w/Tan Streaks VFT Mastic THESE TILES HAVE BEEN PAINTED OVER
20	12" x 12" Purplish Grey VFT THESE TILES HAVE BEEN PAINTED OVER
20A	12" x 12" Purplish Grey VFT Mastic THESE TILES HAVE BEEN PAINTED OVER
21	12" x 12" Light Brown w/Gray Streaks VFT
21A	12" x 12" Light Brown w/Gray Streaks VFT Mastic
22	9" x 9" White VFT
23	9" x 9" Cream VFT
24	12" x 12" Gray w/Dark Gray Streaks VFT
24A	12" x 12" Gray w/Dark Gray Streaks VFT Mastic
25A	12" x 12" Brown w/Dark Brown Streaks VFT Mastic
30	Carpet Mastic
31	Gray Linoleum
31A	Gray Linoleum Mastic
32	Terrazzo
33	Terrazzo
34	12" x 12" Off-White w/Tan Specks VFT
34A	12" x 12" Off-White w/Tan Specks VFT Mastic
35	12" x 12" White w/Beige Streaks VFT
35A	12" x 12" White w/Beige Streaks VFT Mastic
36	12" x 12" White w/Beige Specks VFT
36A	12" x 12" White w/Beige Specks VFT Mastic
37	12" x 12" White w/ gray & light gray specs VFT
37A	12" x 12" White w/ gray & light gray specs VFT - Mastic
38	12" x 12" Dark Green VFT
38A	12" x 12" Dark Green VFT Mastic
39	12" x 12" Off White w/ Tan Streaks VFT
39A	12" x 12" Off White w/ Tan Streaks VFT Mastic

40	12" x 12" Tan w/ light tan streaks VFT
40A	12" x 12" Tan w/ light tan streaks VFT Mastic
41	Multicolor Linoleum
41A	Multicolor Linoleum Mastic
42	12" x 12" Tan w/ White Specks VFT
42A	12" x 12" Tan w/ White Specks VFT Mastic
43	12" x 12" Blue w/ White Specks VFT
43A	12" x 12" Blue w/ White Specks VFT Mastic
44	2' x 4' White Textured Ceiling Tile
45	2' x 4' White Textured Ceiling Tile
J	Lab Tops (Table/Countertops)

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Joseph Hennigan, IDPH License # 100-18350. The Management Plan was updated by Arturo Saenz, IDPH License # 100-04019. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Nettelhorst School Building 5070 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
04	12" x 12" Brown w/White Streaks VFT	1,350	SF	Room 305A, 303 - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05	9" x 9" Tan w/Brown Spots VFT	650	SF	Clerk's Office & Public Office (Both Under Carpet) - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08	Hard Coat Plaster	15,000	SF	Throughout - 1893 Bldg.	ASSUMED	SURFACE	N	DIST	50		No	ACBM with potential for significant damage	10	LOW
09	Hard Coat Plaster	2,500	SF	Throughout - 1911 Bldg.	ASSUMED	SURFACE	N	LOC	10		No	ACBM with potential for significant damage	10	LOW
10	Hard Coat Plaster	15,000	SF	Throughout - 1937 Bldg.	ASSUMED	SURFACE	N	LOC	20		No	ACBM with potential for significant damage	10	LOW
11	Hard Coat Plaster	8,000	SF	Throughout - 1953 Bldg.	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
12	12" x 12" Green VFT (Under Hardwood Floor)	2,000	SF	Auditorium - 1911 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	12" x 12" Brown w/White Streaks VFT Mastic	1,350	SF	Room 305A, 303 - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	9" x 9" Tan w/Brown Spots VFT Mastic	650	SF	Clerk's Office & Public Office (Under Carpet) - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	12" x 12" Green VFT Mastic (Under Hardwood Floor)	2,000	SF	Auditorium - 1911 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12" x 12" Off White w/Tan Streaks VFT THESE TILES HAVE BEEN PAINTED OVER	400	SF	Teacher's Cafeteria - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19A	12" x 12" Off White w/Tan Streaks VFT Mastic THESE TILES HAVE BEEN PAINTED OVER	400	SF	Teacher's Cafeteria - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	12" x 12" Purplish Grey VFT THESE TILES HAVE BEEN PAINTED OVER	600	SF	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20A	12" x 12" Purplish Grey VFT Mastic THESE TILES HAVE BEEN PAINTED OVER	600	SF	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12" x 12" Light Brown w/Gray Streaks VFT	2,300	SF	Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21A	12" x 12" Light Brown w/Gray Streaks	2,300	SF	Rooms 101 & 107,	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	VFT Mastic			3rd Floor Corridor - 1893 Bldg. (Under HA#35A)								potential for damage		
22	9" x 9" White VFT	400	SF	Principal's Office (Under Carpet) - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22A	9" x 9" White VFT Mastic	400	SF	Principal's Office (Under Carpet) - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	9" x 9" Cream VFT	2,500	SF	2nd Floor Corridors - 1893 Bldg. (Under HA#35A)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23A	9" x 9" Cream VFT Mastic	2,500	SF	2nd Floor Corridors - 1893 Bldg. (Under HA#35A)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12" x 12" Gray w/Dark Gray Streaks VFT	1,500	SF	Rooms 201 & 204 & Coat Room - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24A	12" x 12" Gray w/Dark Gray Streaks VFT Mastic	1,500	SF	Rooms 201 & 204 & Coat Room - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12" x 12" Brown w/Dark Brown Streaks VFT	650	SF	Room 302 & Coat Room - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25A	12" x 12" Brown w/Dark Brown Streaks VFT Mastic	650	SF	Room 302 & Coat Room - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	12" x 12" White VFT (Abated)			1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.	ABATED	MISC						Any remaining friable ACBM or friable suspect ACBM		
26A	12" x 12" White VFT Mastic (Abated)			1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.	ABATED	MISC						Any remaining friable ACBM or friable suspect ACBM		
28	12" x 12" White w/ Specks VFT (Abated)			Room 312 & Toilet - 1953 Bldg.	ABATED	MISC						Any remaining friable ACBM or friable suspect ACBM		
28A	12" x 12" White w/ Specks VFT Mastic (Abated)			Room 312 & Toilet - 1953 Bldg.	ABATED	MISC						Any remaining friable ACBM or friable suspect ACBM		
29	12" x 12" Tan w/ Brown Spots VFT	2,000	SF	Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toilet room next to Room 212, 314, 316 - 1953	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
29A	12" x 12" Tan w/ Brown Spots VFT Mastic	2,000	SF	Bldg. Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toilet room next to Room 212, 314, 316 - 1953 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	Carpet Mastic	3,000	SF	Rooms 209, 211 and 213 (Library All Three Rooms) - 1911 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	Gray Linoleum	500	SF	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31A	Gray Linoleum Mastic	500	SF	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	Terrazzo	1,500	SF	Stairwell - 1953 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	Terrazzo	1,600	SF	Stairwell - 1937 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12" x 12" Off-White w/Tan Specks VFT	2,000	SF	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34A	12" x 12" Off-White w/Tan Specks VFT Mastic	2,000	SF	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	12" x 12" White w/Beige Streaks VFT	5,000	SF	2nd and 3rd Floor Corridors - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35A	12" x 12" White w/Beige Streaks VFT Mastic	5,000	SF	2nd and 3rd Floor Corridors - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	12" x 12" White w/Beige Specks VFT	900	SF	Room 205 and Wardrobe - 1893 Bldg.	ASSUMED	MISC	N	NONE	50		No	ACBM with potential for significant damage	5	MODERATE
36A	12" x 12" White w/Beige Specks VFT	900	SF	Room 205 and	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Mastic			Wardrobe - 1893 Bldg.								potential for damage		
37	12" x 12" White w/ gray & light gray specs VFT	820	SF	Room 305, Gym Entry - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37A	12" x 12" White w/ gray & light gray specs VFT - Mastic	820	SF	Room 305, Gym Entry - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12" x 12" Dark Green VFT	1,800	SF	1st, 2nd, and 3rd Floor Corridors - 1953 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38A	12" x 12" Dark Green VFT Mastic	1,800	SF	1st, 2nd, and 3rd Floor Corridors - 1953 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	12" x 12" Off White w/ Tan Streaks VFT	2,000	SF	1st, 2nd, 3rd Floor Corridors - 1937 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39A	12" x 12" Off White w/ Tan Streaks VFT Mastic	2,000	SF	1st, 2nd, 3rd Floor Corridors - 1937 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	12" x 12" Tan w/ light tan streaks VFT	150	SF	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40A	12" x 12" Tan w/ light tan streaks VFT Mastic	150	SF	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	Multicolor Linoleum	2,000	SF	4th Floor Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41A	Multicolor Linoleum Mastic	2,000	SF	4th Floor Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12" x 12" Tan w/ White Specks VFT	15	SF	Room 302 (Replacement Patches) - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42A	12" x 12" Tan w/ White Specks VFT Mastic	15	SF	Room 302 (Replacement Patches) - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	12" x 12" Blue w/ White Specks VFT	15	SF	Room 302 (Replacement Patches)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43A	12" x 12" Blue w/ White Specks VFT Mastic	15	SF	Room 302 (Replacement Patches)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
44	2' x 4' White Textured Ceiling Tile	600	SF	1st and 2nd Floor Boy's Bathrooms - 1911 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	2' x 4' White Textured Ceiling Tile	50	SF	Room 101 Bathroom - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
J	Lab Tops (Table/Countertops)	12	EA	Room 305 - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
K	Aicell Pipe Insulation	800	LF	Above 1st Floor Corridor Ceiling - 1937 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
L	MJP E/F/V on Aircell Pipe Insulation	30	FITTING	Above 1st Floor Corridor Ceiling - 1937 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
M	Cardboard Pipe Insulation	750	LF	Above 1st Floor Corridor Ceiling - 1937 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
N	MJP E/F/V on Cardboard Pipe Insulation	25	FITTING	Above 1st Floor Corridor Ceiling - 1937 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

Reinspection Date	<u>9/11/2019</u>
Inspector Name	<u>Joseph Hennigan</u>
<u>100-18350</u>	<u>5/15/2020</u>
Inspector's IDPH License Number / Expiration Date	

Inspector's Comments

HA Number:	Inspector Comments:
04	
05	
08	
09	
10	
11	
12	
15	
16	
17	
19	
19A	
20	
20A	
21	
21A	
22	
22A	
23	
23A	
24	
24A	
25	

Chicago Public Schools

School Nettelhorst School **Unit** 24661 **Building ID** 5070

Address 3252 N Broadway Street **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
25A	
26	
26A	
28	
28A	
29	
29A	
30	
31	
31A	
32	
33	
34	
34A	
35	
35A	
36	
36A	
37	
37A	
38	
38A	
39	
39A	
40	
40A	
41	
41A	
42	

Chicago Public Schools

School Nettelhorst School **Unit** 24661 **Building ID** 5070

Address 3252 N Broadway Street **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.

2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
42A	
43	
43A	
44	
45	
J	
K	
L	
M	
N	

Table II

Management Planner's Review

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
04	12" x 12" Brown w/White Streaks VFT	1,350	SF	Room 305A, 303 - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	9" x 9" Tan w/Brown Spots VFT	650	SF	Clerk's Office & Public Office (Both Under Carpet) - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	Hard Coat Plaster	15,000	SF	Throughout - 1893 Bldg.	Assumed	SURFACE	No	50	SF	5 ACBM with potential for significant damage	Repair
09	Hard Coat Plaster	2,500	SF	Throughout - 1911 Bldg.	Assumed	SURFACE	No	10	SF	5 ACBM with potential for significant damage	Repair
10	Hard Coat Plaster	15,000	SF	Throughout - 1937 Bldg.	Assumed	SURFACE	No	20	SF	5 ACBM with potential for significant damage	Repair
11	Hard Coat Plaster	8,000	SF	Throughout - 1953 Bldg.	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	12" x 12" Green VFT (Under Hardwood Floor)	2,000	SF	Auditorium - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12" x 12" Brown w/White Streaks VFT Mastic	1,350	SF	Room 305A, 303 - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	9" x 9" Tan w/Brown Spots VFT Mastic	650	SF	Clerk's Office & Public Office (Under Carpet) - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	12" x 12" Green VFT Mastic (Under Hardwood Floor)	2,000	SF	Auditorium - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12" x 12" Off White w/Tan Streaks VFT THESE TILES HAVE BEEN PAINTED OVER	400	SF	Teacher's Cafeteria - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19A	12" x 12" Off White w/Tan Streaks VFT Mastic THESE TILES HAVE BEEN PAINTED OVER	400	SF	Teacher's Cafeteria - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12" x 12" Purplish Grey VFT THESE TILES HAVE BEEN PAINTED OVER	600	SF	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20A	12" x 12" Purplish Grey VFT Mastic THESE TILES HAVE BEEN PAINTED OVER	600	SF	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12" x 12" Light Brown w/Gray Streaks VFT	2,300	SF	Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21A	12" x 12" Light Brown w/Gray Streaks VFT Mastic	2,300	SF	Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35A)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	9" x 9" White VFT	400	SF	Principal's Office (Under Carpet) - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22A	9" x 9" White VFT Mastic	400	SF	Principal's Office (Under Carpet) - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	9" x 9" Cream VFT	2,500	SF	2nd Floor Corridors - 1893 Bldg. (Under	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				HA#35A)							
23A	9" x 9" Cream VFT Mastic	2,500	SF	2nd Floor Corridors - 1893 Bldg. (Under HA#35A)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12" x 12" Gray w/Dark Gray Streaks VFT	1,500	SF	Rooms 201 & 204 & Coat Room - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24A	12" x 12" Gray w/Dark Gray Streaks VFT Mastic	1,500	SF	Rooms 201 & 204 & Coat Room - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12" x 12" Brown w/Dark Brown Streaks VFT	650	SF	Room 302 & Coat Room - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25A	12" x 12" Brown w/Dark Brown Streaks VFT Mastic	650	SF	Room 302 & Coat Room - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12" x 12" White VFT (Abated)			1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.	Abated	MISC				7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
26A	12" x 12" White VFT Mastic (Abated)			1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.	Abated	MISC				7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
28	12" x 12" White w/ Specks VFT (Abated)			Room 312 & Toilet - 1953 Bldg.	Abated	MISC				7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
28A	12" x 12" White w/ Specks VFT Mastic (Abated)			Room 312 & Toilet - 1953 Bldg.	Abated	MISC				7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
29	12" x 12" Tan w/ Brown Spots VFT	2,000	SF	Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toliet room next to Room 212, 314, 316 - 1953 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29A	12" x 12" Tan w/ Brown Spots VFT Mastic	2,000	SF	Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toliet room next to Room 212, 314, 316 - 1953 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	Carpet Mastic	3,000	SF	Rooms 209, 211 and 213 (Library All Three Rooms) - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	Gray Linoleum	500	SF	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31A	Gray Linoleum Mastic	500	SF	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	Terrazzo	1,500	SF	Stairwell - 1953 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
33	Terrazzo	1,600	SF	Stairwell - 1937 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12" x 12" Off-White w/Tan Specks VFT	2,000	SF	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34A	12" x 12" Off-White w/Tan Specks VFT Mastic	2,000	SF	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12" x 12" White w/Beige Streaks VFT	5,000	SF	2nd and 3rd Floor Corridors - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35A	12" x 12" White w/Beige Streaks VFT Mastic	5,000	SF	2nd and 3rd Floor Corridors - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12" x 12" White w/Beige Specks VFT	900	SF	Room 205 and Wardrobe - 1893 Bldg.	Assumed	MISC	No	50	SF	5 ACBM with potential for significant damage	Follow O&M Plan
36A	12" x 12" White w/Beige Specks VFT Mastic	900	SF	Room 205 and Wardrobe - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12" x 12" White w/ gray & light gray specs VFT	820	SF	Room 305, Gym Entry - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37A	12" x 12" White w/ gray & light gray specs VFT - Mastic	820	SF	Room 305, Gym Entry - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12" x 12" Dark Green VFT	1,800	SF	1st, 2nd, and 3rd Floor Corridors - 1953 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38A	12" x 12" Dark Green VFT Mastic	1,800	SF	1st, 2nd, and 3rd Floor Corridors - 1953 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12" x 12" Off White w/ Tan Streaks VFT	2,000	SF	1st, 2nd, 3rd Floor Corridors - 1937 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39A	12" x 12" Off White w/ Tan Streaks VFT Mastic	2,000	SF	1st, 2nd, 3rd Floor Corridors - 1937 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	12" x 12" Tan w/ light tan streaks VFT	150	SF	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40A	12" x 12" Tan w/ light tan streaks VFT Mastic	150	SF	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	Multicolor Linoleum	2,000	SF	4th Floor Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41A	Multicolor Linoleum Mastic	2,000	SF	4th Floor Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12" x 12" Tan w/ White Specks VFT	15	SF	Room 302 (Replacement Patches) - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42A	12" x 12" Tan w/ White Specks VFT Mastic	15	SF	Room 302 (Replacement Patches) - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	12" x 12" Blue w/ White Specks VFT	15	SF	Room 302 (Replacement Patches)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43A	12" x 12" Blue w/ White Specks VFT Mastic	15	SF	Room 302 (Replacement Patches)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
44	2' x 4' White Textured Ceiling Tile	600	SF	1st and 2nd Floor Boy's Bathrooms - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	2' x 4' White Textured Ceiling Tile	50	SF	Room 101 Bathroom - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
J	Lab Tops (Table/Countertops)	12	EA	Room 305 - 1893 Bldg.	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
K	Aicell Pipe Insulation	800	LF	Above 1st Floor Corridor Ceiling - 1937 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
L	MJP E/F/V on Aircell Pipe Insulation	30	FITTING	Above 1st Floor Corridor Ceiling - 1937 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
M	Cardboard Pipe Insulation	750	LF	Above 1st Floor Corridor Ceiling - 1937 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
N	MJP E/F/V on Cardboard Pipe Insulation	25	FITTING	Above 1st Floor Corridor Ceiling - 1937 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

Review Date	10/23/2019
Manager Planner Name	Arturo Saenz
100-04019	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
04	
05	
08	Repair Damaged Plaster
09	Repair
10	Repair
11	
12	
15	
16	
17	
19	
19A	
20	
20A	
21	
21A	
22	
22A	
23	
23A	
24	
24A	
25	

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
25A	
26	
26A	
28	
28A	
29	
29A	
30	
31	
31A	
32	
33	
34	
34A	
35	
35A	
36	replace damaged VFT
36A	
37	
37A	
38	
38A	
39	
39A	
40	
40A	

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG-Probe Consulting, Inc.
2942 W. Van Buren Chicago, IL, 60612

Phone: 3123197575 Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
41	
41A	
42	
42A	
43	
43A	
44	
45	
J	
K	
L	
M	
N	

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04		
MATERIAL DESCRIPTION:	12" x 12" Brown w/White Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 305A, 303 - 1893 Bldg.		
MATERIAL QUANTITY:	1350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	04		
MATERIAL DESCRIPTION:	12" x 12" Brown w/White Streaks VFT		
MATERIAL LOCATION:	Room 305A, 303 - 1893 Bldg.		
MATERIAL QUANTITY:	1350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/23/2019

Chicago Public Schools

GSG-Probe Consulting, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	9" x 9" Tan w/Brown Spots VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Clerk's Office & Public Office (Both Under Carpet) - 1893 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	9" x 9" Tan w/Brown Spots VFT		
MATERIAL LOCATION:	Clerk's Office & Public Office (Both Under Carpet) - 1893 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	5 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:	Water		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1893 Bldg.		
MATERIAL QUANTITY:	15000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	50	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
MATERIAL LOCATION:	Throughout - 1893 Bldg.		
MATERIAL QUANTITY:	15000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	50	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair Damaged Plaster

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	5 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:	Water		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1911 Bldg.		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	10	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
MATERIAL LOCATION:	Throughout - 1911 Bldg.		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	10	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	5 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:	Water		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1937 Bldg.		
MATERIAL QUANTITY:	15000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	20	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
MATERIAL LOCATION:	Throughout - 1937 Bldg.		
MATERIAL QUANTITY:	15000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	20	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1953 Bldg.		
MATERIAL QUANTITY:	8000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
MATERIAL LOCATION:	Throughout - 1953 Bldg.		
MATERIAL QUANTITY:	8000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	12" x 12" Green VFT (Under Hardwood Floor)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium - 1911 Bldg.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	12" x 12" Green VFT (Under Hardwood Floor)		
MATERIAL LOCATION:	Auditorium - 1911 Bldg.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	12" x 12" Brown w/White Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 305A, 303 - 1893 Bldg.		
MATERIAL QUANTITY:	1350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	12" x 12" Brown w/White Streaks VFT Mastic		
MATERIAL LOCATION:	Room 305A, 303 - 1893 Bldg.		
MATERIAL QUANTITY:	1350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	9" x 9" Tan w/Brown Spots VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Clerk's Office & Public Office (Under Carpet) - 1893 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	9" x 9" Tan w/Brown Spots VFT Mastic		
MATERIAL LOCATION:	Clerk's Office & Public Office (Under Carpet) - 1893 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	12" x 12" Green VFT Mastic (Under Hardwood Floor)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium - 1911 Bldg.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	12" x 12" Green VFT Mastic (Under Hardwood Floor)		
MATERIAL LOCATION:	Auditorium - 1911 Bldg.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	12" x 12" Off White w/Tan Streaks VFT THESE TILES HAVE BEEN PAINTED OVER		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teacher's Cafeteria - 1893 Bldg.**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	19				
MATERIAL DESCRIPTION:	12" x 12" Off White w/Tan Streaks VFT THESE TILES HAVE BEEN PAINTED OVER				
MATERIAL LOCATION:	Teacher's Cafeteria - 1893 Bldg.				
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19A		
MATERIAL DESCRIPTION:	12" x 12" Off White w/Tan Streaks VFT Mastic THESE TILES HAVE BEEN PAINTED OVER		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teacher's Cafeteria - 1893 Bldg.**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	19A				
MATERIAL DESCRIPTION:	12" x 12" Off White w/Tan Streaks VFT Mastic THESE TILES HAVE BEEN PAINTED OVER				
MATERIAL LOCATION:	Teacher's Cafeteria - 1893 Bldg.				
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	12" x 12" Purplish Grey VFT THESE TILES HAVE BEEN PAINTED OVER		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	12" x 12" Purplish Grey VFT THESE TILES HAVE BEEN PAINTED OVER		
MATERIAL LOCATION:	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/23/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20A		
MATERIAL DESCRIPTION:	12" x 12" Purplish Grey VFT Mastic THESE TILES HAVE BEEN PAINTED OVER		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	20A				
MATERIAL DESCRIPTION:	12" x 12" Purplish Grey VFT Mastic THESE TILES HAVE BEEN PAINTED OVER				
MATERIAL LOCATION:	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.				
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	12" x 12" Light Brown w/Gray Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35)		
MATERIAL QUANTITY:	2300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	12" x 12" Light Brown w/Gray Streaks VFT		
MATERIAL LOCATION:	Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35)		
MATERIAL QUANTITY:	2300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21A		
MATERIAL DESCRIPTION:	12" x 12" Light Brown w/Gray Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35A)		
MATERIAL QUANTITY:	2300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	21A		
MATERIAL DESCRIPTION:	12" x 12" Light Brown w/Gray Streaks VFT Mastic		
MATERIAL LOCATION:	Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35A)		
MATERIAL QUANTITY:	2300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	9" x 9" White VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principal's Office (Under Carpet) - 1893 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	9" x 9" White VFT		
MATERIAL LOCATION:	Principal's Office (Under Carpet) - 1893 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22A		
MATERIAL DESCRIPTION:	9" x 9" White VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principal's Office (Under Carpet) - 1893 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	22A		
MATERIAL DESCRIPTION:	9" x 9" White VFT Mastic		
MATERIAL LOCATION:	Principal's Office (Under Carpet) - 1893 Bldg.		
MATERIAL QUANTITY:	400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23		
MATERIAL DESCRIPTION:	9" x 9" Cream VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd Floor Corridors - 1893 Bldg. (Under HA#35A)		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	23		
MATERIAL DESCRIPTION:	9" x 9" Cream VFT		
MATERIAL LOCATION:	2nd Floor Corridors - 1893 Bldg. (Under HA#35A)		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23A		
MATERIAL DESCRIPTION:	9" x 9" Cream VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd Floor Corridors - 1893 Bldg. (Under HA#35A)		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	23A		
MATERIAL DESCRIPTION:	9" x 9" Cream VFT Mastic		
MATERIAL LOCATION:	2nd Floor Corridors - 1893 Bldg. (Under HA#35A)		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	12" x 12" Gray w/Dark Gray Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 201 & 204 & Coat Room - 1893 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	12" x 12" Gray w/Dark Gray Streaks VFT		
MATERIAL LOCATION:	Rooms 201 & 204 & Coat Room - 1893 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24A		
MATERIAL DESCRIPTION:	12" x 12" Gray w/Dark Gray Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 201 & 204 & Coat Room - 1893 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	24A		
MATERIAL DESCRIPTION:	12" x 12" Gray w/Dark Gray Streaks VFT Mastic		
MATERIAL LOCATION:	Rooms 201 & 204 & Coat Room - 1893 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	12" x 12" Brown w/Dark Brown Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 302 & Coat Room - 1893 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	12" x 12" Brown w/Dark Brown Streaks VFT		
MATERIAL LOCATION:	Room 302 & Coat Room - 1893 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25A		
MATERIAL DESCRIPTION:	12" x 12" Brown w/Dark Brown Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 302 & Coat Room - 1893 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	25A		
MATERIAL DESCRIPTION:	12" x 12" Brown w/Dark Brown Streaks VFT Mastic		
MATERIAL LOCATION:	Room 302 & Coat Room - 1893 Bldg.		
MATERIAL QUANTITY:	650	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26	
MATERIAL DESCRIPTION:	12" x 12" White VFT (Abated)	
HISTORICAL AHERA DAMAGE CATEGORY	7	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **12" x 12" White VFT (Abated)**

MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26A	
MATERIAL DESCRIPTION:	12" x 12" White VFT Mastic (Abated)	
HISTORICAL AHERA DAMAGE CATEGORY	7	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	26A	
MATERIAL DESCRIPTION:	12" x 12" White VFT Mastic (Abated)	
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.	
MATERIAL QUANTITY:		MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	28	
MATERIAL DESCRIPTION:	12" x 12" White w/ Specks VFT (Abated)	
HISTORICAL AHERA DAMAGE CATEGORY	7	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 312 & Toilet - 1953 Bldg.

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **12" x 12" White w/ Specks VFT (Abated)**

MATERIAL LOCATION: **Room 312 & Toilet - 1953 Bldg.**

MATERIAL QUANTITY:	MATERIAL UNITS:
DAMAGE QUANTITY:	DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	28A	
MATERIAL DESCRIPTION:	12" x 12" White w/ Specks VFT Mastic (Abated)	
HISTORICAL AHERA DAMAGE CATEGORY	7	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 312 & Toilet - 1953 Bldg.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	28A	
MATERIAL DESCRIPTION:	12" x 12" White w/ Specks VFT Mastic (Abated)	
MATERIAL LOCATION:	Room 312 & Toilet - 1953 Bldg.	
MATERIAL QUANTITY:		MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ Brown Spots VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toilet room next to Room 212, 314, 316 - 1953 Bldg.**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	29				
MATERIAL DESCRIPTION:	12" x 12" Tan w/ Brown Spots VFT				
MATERIAL LOCATION:	Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toilet room next to Room 212, 314, 316 - 1953 Bldg.				
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29A		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ Brown Spots VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toilet room next to Room 212, 314, 316 - 1953 Bldg.**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	29A				
MATERIAL DESCRIPTION:	12" x 12" Tan w/ Brown Spots VFT Mastic				
MATERIAL LOCATION:	Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toilet room next to Room 212, 314, 316 - 1953 Bldg.				
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 209, 211 and 213 (Library All Three Rooms) - 1911 Bldg.		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	Carpet Mastic		
MATERIAL LOCATION:	Rooms 209, 211 and 213 (Library All Three Rooms) - 1911 Bldg.		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	Gray Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	Gray Linoleum		
MATERIAL LOCATION:	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31A		
MATERIAL DESCRIPTION:	Gray Linoleum Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	31A				
MATERIAL DESCRIPTION:	Gray Linoleum Mastic				
MATERIAL LOCATION:	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.				
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stairwell - 1953 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	Terrazzo		
MATERIAL LOCATION:	Stairwell - 1953 Bldg.		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stairwell - 1937 Bldg.		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	Terrazzo		
MATERIAL LOCATION:	Stairwell - 1937 Bldg.		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/23/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	12" x 12" Off-White w/Tan Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	12" x 12" Off-White w/Tan Specks VFT		
MATERIAL LOCATION:	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/23/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	34A		
MATERIAL DESCRIPTION:	12" x 12" Off-White w/Tan Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	34A		
MATERIAL DESCRIPTION:	12" x 12" Off-White w/Tan Specks VFT Mastic		
MATERIAL LOCATION:	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	12" x 12" White w/Beige Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd and 3rd Floor Corridors - 1893 Bldg.		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	12" x 12" White w/Beige Streaks VFT		
MATERIAL LOCATION:	2nd and 3rd Floor Corridors - 1893 Bldg.		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35A		
MATERIAL DESCRIPTION:	12" x 12" White w/Beige Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	2nd and 3rd Floor Corridors - 1893 Bldg.		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	35A		
MATERIAL DESCRIPTION:	12" x 12" White w/Beige Streaks VFT Mastic		
MATERIAL LOCATION:	2nd and 3rd Floor Corridors - 1893 Bldg.		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	12" x 12" White w/Beige Specks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	5 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:	Physical Damage		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 205 and Wardrobe - 1893 Bldg.		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	50	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	12" x 12" White w/Beige Specks VFT		
MATERIAL LOCATION:	Room 205 and Wardrobe - 1893 Bldg.		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	50	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

replace damaged VFT

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36A		
MATERIAL DESCRIPTION:	12" x 12" White w/Beige Specks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 205 and Wardrobe - 1893 Bldg.		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	36A		
MATERIAL DESCRIPTION:	12" x 12" White w/Beige Specks VFT Mastic		
MATERIAL LOCATION:	Room 205 and Wardrobe - 1893 Bldg.		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12" x 12" White w/ gray & light gray specs VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 305, Gym Entry - 1893 Bldg.		
MATERIAL QUANTITY:	820	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12" x 12" White w/ gray & light gray specs VFT		
MATERIAL LOCATION:	Room 305, Gym Entry - 1893 Bldg.		
MATERIAL QUANTITY:	820	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37A		
MATERIAL DESCRIPTION:	12" x 12" White w/ gray & light gray specs VFT - Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 305, Gym Entry - 1893 Bldg.		
MATERIAL QUANTITY:	820	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	37A		
MATERIAL DESCRIPTION:	12" x 12" White w/ gray & light gray specs VFT - Mastic		
MATERIAL LOCATION:	Room 305, Gym Entry - 1893 Bldg.		
MATERIAL QUANTITY:	820	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/23/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12" x 12" Dark Green VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd, and 3rd Floor Corridors - 1953 Addition		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12" x 12" Dark Green VFT		
MATERIAL LOCATION:	1st, 2nd, and 3rd Floor Corridors - 1953 Addition		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/23/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	38A		
MATERIAL DESCRIPTION:	12" x 12" Dark Green VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd, and 3rd Floor Corridors - 1953 Addition		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	38A		
MATERIAL DESCRIPTION:	12" x 12" Dark Green VFT Mastic		
MATERIAL LOCATION:	1st, 2nd, and 3rd Floor Corridors - 1953 Addition		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	12" x 12" Off White w/ Tan Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd, 3rd Floor Corridors - 1937 Addition		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	12" x 12" Off White w/ Tan Streaks VFT		
MATERIAL LOCATION:	1st, 2nd, 3rd Floor Corridors - 1937 Addition		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	39A		
MATERIAL DESCRIPTION:	12" x 12" Off White w/ Tan Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd, 3rd Floor Corridors - 1937 Addition		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	39A				
MATERIAL DESCRIPTION:	12" x 12" Off White w/ Tan Streaks VFT Mastic				
MATERIAL LOCATION:	1st, 2nd, 3rd Floor Corridors - 1937 Addition				
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ light tan streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ light tan streaks VFT		
MATERIAL LOCATION:	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	40A		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ light tan streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	40A		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ light tan streaks VFT Mastic		
MATERIAL LOCATION:	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	J		
MATERIAL DESCRIPTION:	Lab Tops (Table/Countertops)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 305 - 1893 Bldg.		
MATERIAL QUANTITY:	12	MATERIAL UNITS:	EA
DAMAGE QUANTITY:	0	DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	J				
MATERIAL DESCRIPTION:	Lab Tops (Table/Countertops)				
MATERIAL LOCATION:	Room 305 - 1893 Bldg.				
MATERIAL QUANTITY:	12	MATERIAL UNITS:	EA		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	EA		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	K		
MATERIAL DESCRIPTION:	Aicell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Above 1st Floor Corridor Ceiling - 1937 Bldg.		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	K		
MATERIAL DESCRIPTION:	Aicell Pipe Insulation		
MATERIAL LOCATION:	Above 1st Floor Corridor Ceiling - 1937 Bldg.		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	L		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Above 1st Floor Corridor Ceiling - 1937 Bldg.		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:	0	DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	L		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
MATERIAL LOCATION:	Above 1st Floor Corridor Ceiling - 1937 Bldg.		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:	0	DAMAGE UNITS:	FITTING

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	M		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Above 1st Floor Corridor Ceiling - 1937 Bldg.		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	M		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
MATERIAL LOCATION:	Above 1st Floor Corridor Ceiling - 1937 Bldg.		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/23/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	N		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Above 1st Floor Corridor Ceiling - 1937 Bldg.		
MATERIAL QUANTITY:	25	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:	0	DAMAGE UNITS:	FITTING
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Arturo Saenz		
SCHOOL NAME:	Nettelhorst School	REVIEW DATE:	10/23/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

HOMOGENEOUS AREA:	N		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
MATERIAL LOCATION:	Above 1st Floor Corridor Ceiling - 1937 Bldg.		
MATERIAL QUANTITY:	25	MATERIAL UNITS:	FITTING
DAMAGE QUANTITY:	0	DAMAGE UNITS:	FITTING

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	42A		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ White Specks VFT Mastic		
MATERIAL LOCATION:	Room 302 (Replacement Patches) - 1893 Bldg.		
MATERIAL QUANTITY:	15	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/23/2019**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **42A**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ White Specks VFT Mastic**
MATERIAL LOCATION: **Room 302 (Replacement Patches) - 1893 Bldg.**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	2' x 4' White Textured Ceiling Tile		
MATERIAL LOCATION:	Room 101 Bathroom - 1893 Bldg.		
MATERIAL QUANTITY:	50	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/23/2019**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **2' x 4' White Textured Ceiling Tile**
MATERIAL LOCATION: **Room 101 Bathroom - 1893 Bldg.**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	41		
MATERIAL DESCRIPTION:	Multicolor Linoleum		
MATERIAL LOCATION:	4th Floor Gym		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/23/2019**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Multicolor Linoleum**
MATERIAL LOCATION: **4th Floor Gym**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	41A				
MATERIAL DESCRIPTION:	Multicolor Linoleum Mastic				
MATERIAL LOCATION:	4th Floor Gym				
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:			
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
		DAMAGE REASON:			
		DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		
COMMENTS:					

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/23/2019**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **41A**

MATERIAL DESCRIPTION: **Multicolor Linoleum Mastic**

MATERIAL LOCATION: **4th Floor Gym**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	12" x 12" Tan w/ White Specks VFT		
MATERIAL LOCATION:	Room 302 (Replacement Patches) - 1893 Bldg.		
MATERIAL QUANTITY:	15	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/23/2019**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ White Specks VFT**
MATERIAL LOCATION: **Room 302 (Replacement Patches) - 1893 Bldg.**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	12" x 12" Blue w/ White Specks VFT		
MATERIAL LOCATION:	Room 302 (Replacement Patches)		
MATERIAL QUANTITY:	15	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: **09/11/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/23/2019**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12" x 12" Blue w/ White Specks VFT**
MATERIAL LOCATION: **Room 302 (Replacement Patches)**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	43A				
MATERIAL DESCRIPTION:	12" x 12" Blue w/ White Specks VFT Mastic				
MATERIAL LOCATION:	Room 302 (Replacement Patches)				
MATERIAL QUANTITY:	15	MATERIAL UNITS:	SF		
MATERIAL CATEGORY:	MISC	FRIABLE:			
ASBESTOS TYPE:	Assumed				
DISTURBANCE POTENTIAL:	LOW	CONDITION:			
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage				
ACCESSIBILITY:	Within Reach	DAMAGE REASON:			
		DAMAGE REASON:			
		DAMAGE REASON:			
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		
COMMENTS:					

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/23/2019**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **43A**
MATERIAL DESCRIPTION: **12" x 12" Blue w/ White Specks VFT Mastic**
MATERIAL LOCATION: **Room 302 (Replacement Patches)**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **10/23/2019**

Chicago Public Schools

GSG-Probe Consulting, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24661	BUILDING ID:	5070
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Joseph Hennigan		
SCHOOL NAME:	Nettelhorst School	INSPECTION DATE:	9/11/2019		
ADDRESS:	3252 N Broadway Street	IDPH LICENSE NO:	100-18350		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	2' x 4' White Textured Ceiling Tile		
MATERIAL LOCATION:	1st and 2nd Floor Boy's Bathrooms - 1911 Bldg.		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/11/2019

Chicago Public Schools

GSG-Probe Consulting, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/23/2019**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **2' x 4' White Textured Ceiling Tile**
MATERIAL LOCATION: **1st and 2nd Floor Boy's Bathrooms - 1911 Bldg.**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **10/23/2019**

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

4/18/2016

JOSEPH L HENNIGAN
855 W ADAMS, SUITE 200
CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 18350

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License			Back of License	
 ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 160 - 10350	ISSUED 4/18/2016	EXPIRES 05/15/2017	INSPECTOR	2/13/2017
JOSEPH L HENNIGAN 855 W ADAMS, SUITE 200 CHICAGO, IL 60607 Environmental Health			PROJECT MANAGER AIR SAMPLING PROFESSIONAL	2/6/2017
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JOSEPH L HENNIGAN
2942 W VAN BUREN ST
CHICAGO, IL 60612

5/9/2018



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 18350

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
	ID NUMBER 100 - 18350	ISSUED 5/9/2018	INSPECTOR	2/10/2019
JOSEPH L HENNIGAN 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health		EXPIRES 05/15/2019 	PROJECT MANAGER AIR SAMPLING PROFESSIONAL	2/3/2019
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that JOSEPH L. HENNIGAN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 02/09/2019 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



PUBLIC HEALTH & SAFETY inc.
Environmental and Occupational Services
315 Ashland Ave., Chicago, IL 60607
www.public-health-safety.com
Office: 312-491-0081
Fax: 312-421-2501

02/09/2019

Course Dates:

02/09/2020

Expires:

1902BIR15

Certificate Number:

Phone: 312-491-0081

Nicholas J. Peneff
Director of Training

Nicholas J. Peneff

Doctor of Public Health

FORM # A-010B

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that JOSEPH L. HENNIGAN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 02/13/2016 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



02/13/2016

Course Dates:

02/13/2017

Expires:

1602BIR15

Certificate Number:

N. J. Penneff

Director of Training

Nicholas J. Penneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JOSEPH L HENNIGAN
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/19/2019



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 18350

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 18350	ISSUED 4/19/2019	EXPIRES 05/15/2020	INSPECTOR	2/9/2020
JOSEPH L HENNIGAN 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			PROJECT MANAGER AIR SAMPLING PROFESSIONAL	2/2/2020
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that JOSEPH L. HENNIGAN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 02/09/2019 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



PUBLIC HEALTH & SAFETY inc.
Environmental and Occupational Services
315 Ashland Ave., Chicago, IL 60607
www.public-health-safety.com

Office: 312-491-0081
Fax: 312-421-2901

02/09/2019

Course Dates:

02/09/2020

Expires:

1902BIR15

Certificate Number:

Phone: 312-491-0081

Nicholas J. Peneff
Director of Training

Nicholas J. Peneff
Doctor of Public Health

FORM # A-010B

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Arturo Saenz

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 2/28/2019

Exam Date: 2/28/2019

Expiration Date: 2/28/2020

Certificate Number: MPR1902280693

Kathy DeSalvo, Director



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 04019

ISSUED
4/30/2019

EXPIRES
05/15/2020

ARTURO SAENZ
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

2/28/2020

MANAGEMENT PLANNER

2/28/2020

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois

Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed