

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0050
SCHOOL NAME: Brooks College Prep (Southside College Prep)
ADDRESS OF SCHOOL: 250 E. 111th St.
CITY: Chicago, IL, 60628

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/31/2016**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 987
IDPH INSPECTOR LICENSE NUMBER: 100-04437
IDPH LICENSED INSPECTOR NAME(Please Print): Mary Hicks
IDPH MP LICENSE NUMBER: 100-09786
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): John Fenn

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Brooks College Prep (Southside College Prep)

250 E. 111th St.
Chicago, IL, 60628

Unit: 47051
Building ID: 1500

IDPH ID Number: 14-016-2990-0050

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

TEM Environmental, Inc.

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

August 8, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 47051 Region: 06 IDPH ID:14-016-2990-0050

School: Brooks College Prep (Southside College Prep) Building ID: 1500

Address: 250 E. 111th St.

Chicago, IL, 60628

Building Contact: Ariola, Pete

Contact Phone:708 769 6968

Current Building Owners: Chicago Public Schools

Review Date: 09/06/2019

Inspector: Mary Hicks

Inspector IDPH License: 100-04437

Management Planner: John Fenn

Management Planner IDPH License: 100-09786

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,
TEM Environmental, Inc.

John Fenn
100-09786

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: August 08, 2019

RE: Brooks College Prep (Southside College Prep), Unit 47051
250 E. 111th St.
Chicago, IL, 60628

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Brooks College Prep (Southside College Prep), following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Brooks College Prep (Southside College Prep), there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Brooks College Prep (Southside College Prep) Unit: 47051 Region: 06
Address: 250 E. 111th St. Chicago, IL, 60628
IDPH ID: 14-016-2990-0050 Building ID: 1500
Contact: Ariola, Pete Phone: 708 769 6968

2. Description of Facility

Original Construction: 2011 Additional Construction: 1914,2000,2000,2011
Total Square Footage: 58615 No of Floors: 2
Current Occupancy: 987

3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Glendale Heights, IL, 60139
Phone: 630-790-0880 Fax: 630-790-0882

5. Inspector

Inspector Name: Mary Hicks

Inspector IDPH license # 100-04437
Signature:
Date: 8/8/2019

6. Management Planner

Management Planner Name: John Fenn

Management Planner IDPH license # 100-09786
Signature:
Date: 09/06/2019

7. Review Date:09/06/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Brooks College Prep (Southside College Prep). This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1500:

B. The following new homogenous areas have been identified for Building 1500:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

019	Beige Terrazzo
020	12 x 12 Yellow Floor Tile
025	12 x 12 Gray Floor Tile
080 (F25)	12x12 black floor tile
080 (F27)	12x12 Orange/Brown Floor Tile
081 (F25)	12x12 Black Floor Tile Mastic
081 (F27)	12x12 orange/brown floor tile mastic
082 (F31)	brown vinyl baseboard
082(F32)	black vinyl baseboard
082(F33)	wood grain baseboard mastic
083 (F31)	mastic under baseboard
083 (F33)	wood grain baseboard
083(F32)	black vinyl baseboard mastic
084 (CM 45)	orange carpet mastic
084 (CM53)	brown tweed carpet mastic
084(42)	orange/brown carpet mastic
084(43)	rust carpet mastic
084(CM41)	brown/tweed carpet mastic
087	12x12 Ceiling Tile-
088	12x12 Ceiling Tile Mastic
089	Plaster Not Observed
090M(F23)	12x12 white floor tile
091	12x12 off white floor tile
092	12x12 Off White Floor tile Mastic
100	1'x1' Ceiling Tile Mastic Not Observed
151	NOT OBSERVED FLOOR TILE REPLACEMENT12X12 Grey/Dark Brown
152	Baseboard Mastic
153	2'x4' Speckled Pattern Ceiling Tile (w/ 2'x2' Sections)
154	4" Vinyl Baseboard - Grey
155	Mastic associated with 4" Vinyl Baseboard - Grey
156	12"x12" White with Grey Specs Floor Tile
157	12"x12" White with Grey Specs Floor Tile Mastic
158	2'x2' Smooth Pattern Ceiling Tile
159	Interior Window Caulk
160	Terrazzo Floor
161	12"x12" Grey Speckled Floor Tile
162	12"x12" Grey Speckled Floor Tile Mastic
163	Black Sink Undercoat
164	Black Counter Top
165	Drywall

166	Drywall Joint Compound
167	Sheet Flooring - Brown Multi-Color Pattern
168	Sheet Flooring - Brown Multi-Color Pattern Mastic
169	White Sink Undercoat
170	Carpet Mastic - Brown
171	Carpet Mastic Blue w/ white streaks
172	Carpet Mastic Brown w/ blue and orange streaks
21	12 x 12 Yellow Floor Tile Mastic
22	Brown Carpet Mastic
26	12 x 12 Gray Floor Tile Mastic
27	2 x 4 Lay-in Panels NOT OBSERVED
28	Spray-on Insulation
29	2 x 2 Lay-in Ceiling Panels
30	Black Counter Tops

The following areas were deemed to be inaccessible:

010	Aircell Pipe Insulation
011	Mag Block Pipe Insulation
012	Cardboard Pipe Insulation
092	12x12 Off White Floor tile Mastic
152	Baseboard Mastic
155	Mastic associated with 4" Vinyl Baseboard - Grey
157	12"x12" White with Grey Specs Floor Tile Mastic
162	12"x12" Grey Speckled Floor Tile Mastic
168	Sheet Flooring - Brown Multi-Color Pattern Mastic
170	Carpet Mastic - Brown
171	Carpet Mastic Blue w/ white streaks
172	Carpet Mastic Brown w/ blue and orange streaks
21	12 x 12 Yellow Floor Tile Mastic
22	Brown Carpet Mastic
26	12 x 12 Gray Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Mary Hicks, IDPH License # 100-04437. The Management Plan was updated by John Fenn, IDPH License # 100-09786. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Brooks College Prep (Southside College Prep) Building 1500 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500

Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
002	Aircell jacket (ABATED)			Main Building: Hot water tank in boiler room	ABATED	TSI								
004	Cardboard Pipe Insulation (ABATED)			Main Building: Boiler Room East	ABATED	TSI								
005	Mag. Jacket Boilers 1&2 (ABATED)			Main Building: Boiler Room	ABATED	TSI								
007	Cardboard Pipe Insulation (ABATED)			Main Building: Boiler Room, East Perimeter	ABATED	TSI								
008	Joint compound on Cardboard Pipe Insul. (ABATED)			Main Building: Boiler Room Hot Water Pipe	ABATED	TSI								
009	Joint compound on aircell pipe insulation (ABATED)			Main Building: boiler room on east wall	ABATED	TSI								
010	Aircell Pipe Insulation	300	LF	Main Building: Attic (abated) and Tunnels (still present)	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
011	Mag Block Pipe Insulation	800	LF	Main Building: Tunnel	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
012	Cardboard Pipe Insulation	500	LF	Main Building: Tunnels	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
013(F18)	9x9 Brown Speckled Floor Tile (ABATED)			Main Building: West Wing Coaches Offices	ABATED	MISC								
014(C12)	2'x4' Ceiling Tile (ABATED)			Main Building: West Wing Coaches Office	ABATED	MISC								
014A	Red, Black, Brown, Tan linoleum pattern (ABATED)			Main Building: Auditorium 1st floor, 2nd Floor Foyer	ABATED	MISC								
015(C9)	1'x1' Glued on Ceiling (ABATED)			Main Building: Men's Bathroom	ABATED	MISC								
016	Plaster (ABATED)			Main Building: Throughout West Wing Building.	ABATED	SURFACE								
017(F1)	9x9 White Floor Tile (ABATED)			Main Building: East Wing Rooms 15, 19, and 306	ABATED	MISC								
018	9x9 Pink Floor Tile (ABATED)			Main Building: West	ABATED	MISC								

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500

Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Wing Foyer										
018(F15)	9x9 pink floor tile mastic (ABATED)			Main Building: W. wing 1st floor foyer & 2nd floor foyer and lounge	ABATED	MISC								
019	Beige Terrazzo	20,000	SF	Main Office, Rooms 304, 310, 306, 303C, 317, 318, 116, Hallways and Bathrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
020	12 x 12 Yellow Floor Tile	12,500	SF	Rooms 106, 200-205, 208, 209, 216, Library, Office, and Coach's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
023	Light Beige Linoleum (ABATED)			Main Building: Gym (Room 251), Room 253	ABATED	MISC								LOW
023(F2)	9x9 black floor tile (ABATED)			Main Building: east wing 2nd & 3rd floor rooms 15,19,306	ABATED	MISC								
024(F4)	9"x9" Maroon Floor Tile (ABATED)			Main Building: East Wing 2nd Floor, Library, and Guidance Office	ABATED	MISC								
025	12 x 12 Gray Floor Tile	5,000	SF	Band Room, 4th Floor, 403, 407, Office, Bathroom, West Side, 100, 101, Attendance Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
036 (C13)	2x4 lay in ceiling tile (ABATED)			Main Building: music room	ABATED	MISC								
040(F9)	9"x9" Gray Floor Tile (ABATED)			Main Building: Guidance and Xerox Offices	ABATED	MISC								
041(F3)	9"x9" Red Floor Tile (ABATED)			Main Building: Rm. 306 and Xerox Rm.	ABATED	MISC								
043(F11)	9x9 White Floor Tile (ABATED)			Main Building: Office	ABATED	MISC								
045 (F16)	9x9 grey floor tile (ABATED)			Main Building: west wing 2nd floor lounge	ABATED	MISC								
046(F20)	9"x9" Green Floor Tile (ABATED)			Main Building: Gym, Cafeteria	ABATED	MISC								

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500

Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
047(F19)	9"x9" Tan Floor Tile (ABATED)			Main Building: Gym, Cafeteria Building	ABATED	MISC								
049 (F5)	9x9 tan floor tile (ABATED)			Main Building: guidance office, east wing room 29 & library	ABATED	MISC								
051 (F12)	9x9 green & white floor tile (ABATED)			Main Building: east wing 2nd & 3rd floor hallway & room 31	ABATED	MISC								
052 (F17)	9x9 green & tan floor tile (ABATED)			Annex: office & storage 156A & 156B	ABATED	MISC								
052 (F21)	9x9 blue floor tile (ABATED)			Annex: room 151	ABATED	MISC								
052(F8)	Blue and White Linoleum (ABATED)			Main Building: 2nd Floor Teachers' Lounge Kitchen	ABATED	MISC								
053 (F13)	12x12 tan floor tile (ABATED)			Annex: boys & girls toilets & corridors	ABATED	MISC								
054	2x4 ceiling tile (ABATED)			Annex: Chemistry Lab Room 252	ABATED	MISC								
055	Aircell (ABATED)			Annex: Chemistry Lab	ABATED	MISC								
059	Trim mastic on on Tan Baseboard (ABATED)			Annex: foyer/corridor	ABATED	MISC								
060	Trim tan baseboard (ABATED)			Annex: Foyer/Corridor	ABATED	MISC								
070 (F13)	12x12 tan floor tile mastic (ABATED)			Annex: boys & girls toilets & corridors	ABATED	MISC								
070 (F17)	9x9 green floor tile mastic (ABATED)			Annex: room 151	ABATED	MISC								
070 (F21)	9x9 blue floor tile mastic (ABATED)			Annex: room 151	ABATED	MISC								
072	paneling mastic (ABATED)			Annex: Annex Corridor	ABATED	MISC								
073 (C14)	12x12 ceiling tile mastic (ABATED)			Annex: rooms 155 A-D	ABATED	MISC								
078	Aircell pipe insulation	3,000	LF	Crawl space tunnels, connecting tunnel from main bldg (to Monastery - Monastery no longer	CHR	TSI	Y	NONE	0		No	Any remaining friable ACM or friable suspect ACM		LOW

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500

Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				exists)										
079	Hard fittings on aircell pipe insulation	200	LF	Crawl space tunnels, connecting tunnel from main bldg to Monastery (Monastery no longer exists)	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
080 (F25)	12x12 black floor tile			Monastery: 2nd Floor Fireplace-BLDG DEMOLISHED	ASSUMED	MISC								
080 (F26)	12x12 Red Floor Tile			Monastery: 1st, 2nd & 3rd Floor Stairways-BLDG DEMOLISHED	CHR	MISC								Low
080 (F27)	12x12 Orange/Brown Floor Tile			Monastery: 2nd & 3rd Floor-BLDG DEMOLISHED	ASSUMED	MISC								
081 (F25)	12x12 Black Floor Tile Mastic			Monastery: 2nd Floor Fireplace-BLDG DEMOLISHED	ASSUMED	MISC								
081 (F26)	12x12 red floor tile mastic			Monastery- 1st, 2nd & 3rd Floor Stairways-BLDG DEMOLISHED	CHR	MISC								
081 (F27)	12x12 orange/brown floor tile mastic			Monastery: 2nd & 3rd floor-BLDG DEMOLISHED	ASSUMED	MISC								
082 (F31)	brown vinyl baseboard			Monastery: 2nd Floor Community Room-BLDG DEMOLISHED	ASSUMED	MISC								
082(F32)	black vinyl baseboard			Monastery: 1st, 2nd & 3rd Floor Stairwells, 315-BLDG DEMOLISHED	ASSUMED	MISC								
082(F33)	wood grain baseboard mastic			Monastery: Room 210-BLDG DEMOLISHED	ASSUMED	MISC								
083 (F31)	mastic under baseboard			Monastery: 2nd Floor Community Room-BLDG DEMOLISHED	ASSUMED	MISC								

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500

Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
083 (F33)	wood grain baseboard			Monastery: Room 210-BLDG DEMOLISHED	ASSUMED	MISC								
083(F32)	black vinyl baseboard mastic			Monastery: 1st, 2nd & 3rd Floor Stairwells, 315	ASSUMED	MISC								
084 (CM 45)	orange carpet mastic			Monastery: 2nd Floor Corridor, Room 204 & 210-BLDG DEMOLISHED	ASSUMED	MISC								
084 (CM53)	brown tweed carpet mastic			Monastery: Room 306-BLDG DEMOLISHED	ASSUMED	MISC								
084(42)	orange/brown carpet mastic			Monastery: 1st Floor NW Corner-BLDG DEMOLISHED	ASSUMED	MISC								
084(43)	rust carpet mastic			Monastery: 1st Floor NW Corridor-BLDG DEMOLISHED	ASSUMED	MISC								
084 (CM41)	brown/tweed carpet mastic			Monastery: 1st Floor NW Corridor	ASSUMED	MISC								
085(F28)	9x9 red/black border floor tile			Monastery: 1st, 2nd & 3rd Floor Stairwells-BLDG DEMOLISHED	CHR	MISC								
085(F29)	9x9 grey/red trim floor tile			Monastery: 1st Floor-BLDG DEMOLISHED	CHR	MISC								
086(F28)	9x9 red/black border floor tile mastic			Monastery: Stairwells 1st, 2nd, 3rd Floor-BLDG DEMOLISHED	CHR	MISC								
086(F29)	9x9 grey/red trim floor tile mastic			Monastery: 1st Floor-BLDG DEMOLISHED	CHR	MISC								Low
087	12x12 Ceiling Tile-			Monastery: 2nd,3rd floor--BLDG DEMOLISHED	ASSUMED	MISC								
088	12x12 Ceiling Tile Mastic			Monastery: 2nd 3rd floor-BLDG DEMOLISHED	ASSUMED	MISC								
089	Plaster Not Observed			Monastery: throughout 1st,2nd ,	ASSUMED	SURFACE								

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500
Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				3rd floors-BLDG DEMOLISHED										
090 (F23)	12x12 white floor tile mastic			Annex: Physics Lab-BLDG DEMOLISHED	CHR	MISC								
090M (F23)	12x12 white floor tile			Annex: Physics Lab-BLDG DEMOLISHED	ASSUMED	MISC								
091	12x12 off white floor tile			Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
092	12x12 Off White Floor tile Mastic			Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
093	Aircell pipe insulation (NOT OBSERVED)			Gym: Throughout bldg, locker rooms, showers	CHR	TSI								
094	Hard fittings on air cell pipe insulation (NOT OBSERVED)			Gym: Throughout bldg, locker rooms, showers	CHR	TSI								
100	1'x1' Ceiling Tile Mastic Not Observed			Monastery: confessionals-BLDG DEMOLISHED	ASSUMED	MISC								
101 (F61)	12x12 Light Gray Floor Tile (ABATED)			Main Building: West Wing Far West Corridor	ABATED	MISC								
101 (F62)	12x12 dark brown white/black speck floor tile (ABATED)			Main Building: west wing, north west corner	ABATED	MISC								
101(F60)	12x12 off white floor tile (ABATED)			Main Building: West Wing 3rd Floor, NW Corner, West & East Wing, North Portion	ABATED	MISC								
102 (F61)	12x12 light grey floor tile mastic (ABATED)			Main Building: west wing far west corridor	ABATED	MISC								
102(F60)	12x12 off white floor tile mastic (ABATED)			Main Building: West Wing 3rd floor, NW Corner, West & East Wing, North portion	ABATED	MISC								
102(F62)	12x12 dark brown white/black speckled floor tile (ABATED)			Main Building: West Wing, Northwest Corner	ABATED	MISC								
103(F63)	9x9 light green floor tile (ABATED)			Main Building: West Wing Corridor, 2nd & 3rd Floor East &	ABATED	MISC								

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500

Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				West Wing Patches										
103(F64)	9x9 light brown floor tile (ABATED)			Main Building: West Wing 1st, 2nd & 3rd Corridor Patches & east end	ABATED	MISC								
103(F65)	9x9 medium brown floor tile (ABATED)			Main Building: West Wing 1st & 3rd Floor Corridor Patches & East Wing	ABATED	MISC								
103(F66)	9x9 yellow floor tile (ABATED)			Main Building: 1st Floor Corridor Patches	ABATED	MISC								
103(F7)	9x9 clay floor tile (ABATED)			Main Building: 1st floor corridor west wing	ABATED	MISC								
104 (F63)	9x9 light green floor tile mastic (ABATED)			Main Building: West Wind Corridor, 2nd & 3rd Floor East & West Wing Patches	ABATED	MISC								
104 (F7)	9x9 clay floor tile mastic (ABATED)			Main Building: 1st floor corridor west wing	ABATED	MISC								
104(F1)	9x9 white floor tile mastic (ABATED)			Main Building: east wing room 15 & 19 & west wing music	ABATED	MISC								
104(F2)	9x9 black floor tile mastic (ABATED)			Main Building: east wing room 15 & 19	ABATED	MISC								
104(F3)	9x9 pink floor tile mastic (ABATED)			Main Building: west wing 1st,2nd floor foyer	ABATED	MISC								
104(F4)	9x9 maroon floor tile mastic (ABATED)			Main Building: 1st & 2nd floor west wing, 1st floor throughout, 2nd flr west rooms	ABATED	MISC								
104(F5)	9x9 tan mastic (ABATED)			Main Building: Library, East Wing Throughout	ABATED	MISC								
104(F64)	9x9 light brown floor tile mastic (ABATED)			Main Building: west wing 1st,2nd,3rd corridor patches & east end	ABATED	MISC								
104(F65)	9x9 medium brown floor tile mastic			Main Building: west	ABATED	MISC								

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500

Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	(ABATED)			wing 1st & 3rd floor corridor patches & east wing										
104(F66)	9x9 yellow floor tile mastic (ABATED)			Main Building: 1st floor corridor patches	ABATED	MISC								
104(F67)	9x9 green floor tile mastic (ABATED)			Main Building: 1st floor stairwell, east wing & 2nd & 3rd flr. Hallway	ABATED	MISC								
105 (F68)	Various size brown speckled floor tile (ABATED)			Main Building: 1st, 2nd & 3rd floor patches in east & west wing	ABATED	MISC								
106(F68)	Various size brown speckled floor tile mastic (ABATED)			Main Building: 1st, 2nd & 3rd floor patches in east & west wing	ABATED	MISC								
107 (CM70)	carpet mastic under multicolored (ABATED)			Main Building: 2nd floor west wing, far west wing	ABATED	MISC								
107 (CM71)	grey carpet mastic (ABATED)			Main Building: 2nd floor office, 1st floor west corner	ABATED	MISC								
108	grey vinyl stair treads (ABATED)			Main Building: 1st, 2nd, 3rd floor east & west wings	ABATED	MISC								
109	vinyl stair track mastic (ABATED)			Main Building: 1st, 2nd, 3rd floor east & west wings	ABATED	MISC	N							
110 (F75)	4" brown vinyl base board (ABATED)			Main Building: 1st floor corridor leading to west wing, 3rd floor NW corner	ABATED	MISC								
110 (F76)	4" black baseboard (ABATED)			Main Building: 1st, 2nd & 3rd Floor Throughout East Wing & Corridor-East Wing 1st Floor NE Corner West Wing	ABATED	MISC								
110 (F77)	4" tan baseboard (ABATED)			Main Building: 1st, 2nd floor, NE. & NW. portion	ABATED	MISC								

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500

Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
111(F75)	4" brown vinyl base board mastic (ABATED)			Main Building: 1st floor corridor leading to west wing, 3rd floor NW corner	ABATED	MISC								
111(F76)	4" black baseboard (ABATED)			Main Building: 1st, 2nd & 3rd floor throughout	ABATED	MISC								
111(F77)	4" tan baseboard mastic (ABATED)			Main Building: 1st & 2nd Floor, NE. & NW. portion	ABATED	MISC								
112 (F80)	6" black vinyl baseboard (ABATED)			Main Building: 2nd floor, SE corner	ABATED	MISC								
113 (F80)	6" black vinyl baseboard mastic (ABATED)			Main Building: 2nd floor main bldg. SE corner	ABATED	MISC								
114 (CT1)	12x12 ceiling tile (ABATED)			Main Building: 1st floor west wing near NW corner	ABATED	MISC								
114 (CTM1)	12x12 ceiling tile mastic (ABATED)			Main Building: 1st floor west wing near NW corner	ABATED	MISC								
116	12x12 cork tile (ABATED)			Main Building: 2nd floor west wing room NE. corner of bldg.	ABATED	MISC								
151	NOT OBSERVED FLOOR TILE REPLACEMENT12X12 Grey/Dark Brown	50,000	SF	1st, 2nd, & 3rd floor hallways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
152	Baseboard Mastic	50,000	SF	1st, 2nd, & 3rd floor throughout building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
153	2'x4' Speckled Pattern Ceiling Tile (w/ 2'x2' Sections)	1,350	SF	1st Floor: West Wing - Dining Room: 4th Floor: Center Building - Room 402 and 405	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
154	4" Vinyl Baseboard - Grey	1,100	LF	1st Floor: West Wing - Dining Room; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
155	Mastic associated with 4" Vinyl Baseboard	1,100	LF	1st Floor: West	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500

Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	- Grey			Wing - Dining Room; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405								potential for damage		
156	12"x12" White with Grey Specs Floor Tile	5,350	SF	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
157	12"x12" White with Grey Specs Floor Tile Mastic	5,350	SF	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
158	2'x2' Smooth Pattern Ceiling Tile	7,375	SF	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139, and North/South Corridor	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
159	Interior Window Caulk	400	LF	1st Floor: East Wing - Room 131, 133, 135, 137, and 139; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
160	Terrazzo Floor	2,025	SF	1st Floor: East Wing - North/South Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
161	12"x12" Grey Speckled Floor Tile	2,600	SF	4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
162	12"x12" Grey Speckled Floor Tile Mastic	2,600	SF	4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
163	Black Sink Undercoat	1	EA	4th Floor: Center Building - Room 400	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500

Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
164	Black Counter Top	200	SF	4th Floor: Center Building - Room 400 and 400A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
165	Drywall	4,600	SF	4th Floor: Center Building - Room 400, 400A, and 404	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
166	Drywall Joint Compound	4,600	SF	4th Floor: Center Building - Room 400, 400A, and 404	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
167	Sheet Flooring - Brown Multi-Color Pattern	1,350	SF	1st Floor: West Wing - Dining Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
168	Sheet Flooring - Brown Multi-Color Pattern Mastic	1,350	SF	1st Floor: West Wing - Dining Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
169	White Sink Undercoat	1	EA	4th Floor: Center Building - Room 404	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
170	Carpet Mastic - Brown	2,200	SF	Rooms 100 A, 100 C, 100 E, 100 F, 105, 111, 116A and 116B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
171	Carpet Mastic Blue w/ white streaks	1,500	SF	Rooms 201, 201A, 201C and 201D	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
172	Carpet Mastic Brown w/ blue and orange streaks	10,300	SF	Rooms 147, 153A, 153C, 153D, 153E, 153F, 153F2, 235, 237A, 237D and Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12 x 12 Yellow Floor Tile Mastic	12,500	SF	Rooms 106, 200-206, 208, 209, 210, 216, Library, Office, and Coach's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	Brown Carpet Mastic	6,000	SF	Library, Assistant Principal's, Nurse Office, Side Office, 102, 103, 111, 117, and Office Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	12 x 12 Gray Floor Tile Mastic	12,500	SF	Band Room, 4th Floor, 403, 407, Office, Bathroom, West Side, 100, 101, Attendance Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	2 x 4 Lay-in Panels NOT OBSERVED	1,000	SF	Kitchen	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable		LOW

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500

Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												suspect ACBM		
28	Spray-on Insulation	3,000	SF	Gymnasium	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
29	2 x 2 Lay-in Ceiling Panels	20,000	SF	Hallways	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
30	Black Counter Tops	26	SF	Rooms 307 and 307A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500
Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 8/8/2019
Inspector Name Mary Hicks
100-04437 5/15/2020
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
002	
004	
005	
007	
008	
009	
010	
011	
012	
013(F18)	
014(C12)	
014A	
015(C9)	
016	
017(F1)	
018	
018(F15)	
019	
020	
023	
023(F2)	
024(F4)	
025	

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500
Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
036 (C13)	
040(F9)	
041(F3)	
043(F11)	
045 (F16)	
046(F20)	
047(F19)	
049 (F5)	
051 (F12)	
052 (F17)	
052 (F21)	
052(F8)	
053 (F13)	
054	
055	
059	
060	
070 (F13)	
070 (F17)	
070 (F21)	
072	
073 (C14)	
078	Monastery No Longer Exists
079	Monastery No Longer Exists
080 (F25)	Monastery No Longer Exists
080 (F26)	Monastery No Longer Exists
080 (F27)	Monastery No Longer Exists
081 (F25)	Monastery No Longer Exists
081 (F26)	Monastery No Longer Exists

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500
Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
081 (F27)	Monastery No Longer Exists
082 (F31)	Monastery No Longer Exists
082(F32)	Monastery No Longer Exists
082(F33)	Monastery No Longer Exists
083 (F31)	Monastery No Longer Exists
083 (F33)	Monastery No Longer Exists
083(F32)	Monastery No Longer Exists
084 (CM 45)	Monastery No Longer Exists
084 (CM53)	Monastery No Longer Exists
084(42)	Monastery No Longer Exists
084(43)	Monastery No Longer Exists
084(CM41)	Monastery No Longer Exists
085(F28)	Monastery No Longer Exists
085(F29)	Monastery No Longer Exists
086(F28)	Monastery No Longer Exists
086(F29)	Monastery No Longer Exists
087	Monastery No Longer Exists
088	Monastery No Longer Exists
089	Monastery No Longer Exists
090 (F23)	
090M(F23)	
091	Not Observed 2019
092	VFT Not Observed 2019
093	Not Observed Multiple Years
094	Not Observed Multiple Years
100	Monastery No Longer Exists
101 (F61)	
101 (F62)	
101(F60)	

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500
Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
102 (F61)	
102(F60)	
102(F62)	
103(F63)	
103(F64)	
103(F65)	
103(F66)	
103(F7)	
104 (F63)	
104 (F7)	
104(F1)	
104(F2)	
104(F3)	
104(F4)	
104(F5)	
104(F64)	
104(F65)	
104(F66)	
104(F67)	
105 (F68)	
106(F68)	
107(CM70)	
107(CM71)	
108	
109	
110 (F75)	
110 (F76)	
110 (F77)	
111(F75)	

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500
Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
111(F76)	
111(F77)	
112 (F80)	
113 (F80)	
114 (CT1)	
114 (CTM1)	
116	
151	Not Observed 2019
152	Not Observed 2019
153	Not Observed 2019
154	
155	
156	
157	
158	
159	
160	
161	
162	
163	
164	
165	
166	
167	
168	
169	
170	
171	
172	

Chicago Public Schools

School Brooks College Prep (Southside College Prep) **Unit** 47051 **Building ID** 1500
Address 250 E. 111th St. **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
21	
22	
26	
27	Not Observed Multiple Years
28	
29	
30	

Table II

Management Planner's Review

Chicago Public Schools

School

Brooks College Prep
(Southside College Prep)

Unit

47051

Building ID

1500

Address

250 E. 111th St.

Chicago, IL, 60628

Region

06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone:

630-790-0880

Fax:

630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
002	Aircell jacket (ABATED)			Main Building: Hot water tank in boiler room	Abated	TSI					
004	Cardboard Pipe Insulation (ABATED)			Main Building: Boiler Room East	Abated	TSI					
005	Mag. Jacket Boilers 1&2 (ABATED)			Main Building: Boiler Room	Abated	TSI					
007	Cardboard Pipe Insulation (ABATED)			Main Building: Boiler Room, East Perimeter	Abated	TSI					
008	Joint compound on Cardboard Pipe Insul. (ABATED)			Main Building: Boiler Room Hot Water Pipe	Abated	TSI					
009	Joint compound on aircell pipe insulation (ABATED)			Main Building: boiler room on east wall	Abated	TSI					
010	Aircell Pipe Insulation	300	LF	Main Building: Attic (abated) and Tunnels (still present)	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
011	Mag Block Pipe Insulation	800	LF	Main Building: Tunnel	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
012	Cardboard Pipe Insulation	500	LF	Main Building: Tunnels	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
013(F18)	9x9 Brown Speckled Floor Tile (ABATED)			Main Building: West Wind Coaches Offices	Abated	MISC					
014(C12)	2'x4' Ceiling Tile (ABATED)			Main Building: West Wing Coaches Office	Abated	MISC					
014A	Red, Black, Brown, Tan linoleum pattern (ABATED)			Main Building: Auditorium 1st floor, 2nd Floor Foyer	Abated	MISC					
015(C9)	1'x1' Glued on Ceiling (ABATED)			Main Building: Men's Bathroom	Abated	MISC					
016	Plaster (ABATED)			Main Building: Throughout West Wing Building.	Abated	SURFACE					
017(F1)	9x9 White Floor Tile (ABATED)			Main Building: East Wing Rooms 15, 19, and 306	Abated	MISC					
018	9x9 Pink Floor Tile (ABATED)			Main Building: West Wing Foyer	Abated	MISC					
018(F15)	9x9 pink floor tile mastic (ABATED)			Main Building: W. wing 1st floor foyer & 2nd floor foyer and lounge	Abated	MISC					
019	Beige Terrazzo	20,000	SF	Main Office, Rooms 304, 310, 306, 303C, 317, 318, 116, Hallways and Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
020	12 x 12 Yellow Floor Tile	12,500	SF	Rooms 106, 200-205, 208, 209, 216,	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School

Brooks College Prep
(Southside College Prep)

Unit

47051

Building ID

1500

Address

250 E. 111th St.

Chicago, IL, 60628

Region

06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone:

630-790-0880

Fax:

630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Library, Office, and Coach's Office							
023	Light Beige Linoleum (ABATED)			Main Building: Gym (Room 251), Room 253	Abated	MISC					
023(F2)	9x9 black floor tile (ABATED)			Main Building: east wing 2nd & 3rd floor rooms 15,19,306	Abated	MISC					
024(F4)	9"x9" Maroon Floor Tile (ABATED)			Main Building: East Wing 2nd Floor, Library, and Guidance Office	Abated	MISC					
025	12 x 12 Gray Floor Tile	5,000	SF	Band Room, 4th Floor, 403, 407, Office, Bathroom, West Side, 100, 101, Attendance Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
036 (C13)	2x4 lay in ceiling tile (ABATED)			Main Building: music room	Abated	MISC					
040(F9)	9"x9" Gray Floor Tile (ABATED)			Main Building: Guidance and Xerox Offices	Abated	MISC					
041(F3)	9"x9" Red Floor Tile (ABATED)			Main Building: Rm. 306 and Xerox Rm.	Abated	MISC					
043(F11)	9x9 White Floor Tile (ABATED)			Main Building: Office	Abated	MISC					
045 (F16)	9x9 grey floor tile (ABATED)			Main Building: west wing 2nd floor lounge	Abated	MISC					
046(F20)	9"x9" Green Floor Tile (ABATED)			Main Building: Gym, Cafeteria	Abated	MISC					
047(F19)	9"x9" Tan Floor Tile (ABATED)			Main Building: Gym, Cafeteria Building	Abated	MISC					
049 (F5)	9x9 tan floor tile (ABATED)			Main Building: guidance office,east wing room 29 & library	Abated	MISC					
051 (F12)	9x9 green & white floor tile (ABATED)			Main Building: east wing 2nd & 3rd floor hallway & room 31	Abated	MISC					
052 (F17)	9x9 green & tan floor tile (ABATED)			Annex: office & storage 156A & 156B	Abated	MISC					
052 (F21)	9x9 blue floor tile (ABATED)			Annex: room 151	Abated	MISC					
052(F8)	Blue and White Linoleum (ABATED)			Main Building: 2nd Floor Teachers' Lounge Kitchen	Abated	MISC					
053 (F13)	12x12 tan floor tile (ABATED)			Annex: boys & girls toilets & corridors	Abated	MISC					
054	2x4 ceiling tile (ABATED)			Annex: Chemistry Lab Room 252	Abated	MISC					
055	Aircell (ABATED)			Annex: Chemistry Lab	Abated	MISC					
059	Trim mastic on on Tan Baseboard (ABATED)			Annex: foyer/corridor	Abated	MISC					
060	Trim tan baseboard (ABATED)			Annex: Foyer/Corridor	Abated	MISC					
070 (F13)	12x12 tan floor tile mastic (ABATED)			Annex: boys & girls toilets & corridors	Abated	MISC					

Chicago Public Schools

School

Brooks College Prep
(Southside College Prep)

Unit

47051

Building ID

1500

Address

250 E. 111th St.

Chicago, IL, 60628

Region

06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone:

630-790-0880

Fax:

630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
070 (F17)	9x9 green floor tile mastic (ABATED)			Annex: room 151	Abated	MISC					
070 (F21)	9x9 blue floor tile mastic (ABATED)			Annex: room 151	Abated	MISC					
072	paneling mastic (ABATED)			Annex: Annex Corridor	Abated	MISC					
073 (C14)	12x12 ceiling tile mastic (ABATED)			Annex: rooms 155 A-D	Abated	MISC					
078	Aircell pipe insulation	3,000	LF	Crawl space tunnels, connecting tunnel from main bldg (to Monastery - Monastery no longer exists)	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
079	Hard fittings on aircell pipe insulation	200	LF	Crawl space tunnels, connecting tunnel from main bldg to Monastery (Monastery no longer exists)	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
080 (F25)	12x12 black floor tile			Monastery: 2nd Floor Fireplace-BLDG DEMOLISHED	Assumed	MISC					
080 (F26)	12x12 Red Floor Tile			Monastery: 1st, 2nd & 3rd Floor Stairways-BLDG DEMOLISHED	Chrysotile	MISC					
080 (F27)	12x12 Orange/Brown Floor Tile			Monastery: 2nd & 3rd Floor-BLDG DEMOLISHED	Assumed	MISC					
081 (F25)	12x12 Black Floor Tile Mastic			Monastery: 2nd Floor Fireplace-BLDG DEMOLISHED	Assumed	MISC					
081 (F26)	12x12 red floor tile mastic			Monastery- 1st, 2nd & 3rd Floor Stairways-BLDG DEMOLISHED	Chrysotile	MISC					
081 (F27)	12x12 orange/brown floor tile mastic			Monastery: 2nd & 3rd floor-BLDG DEMOLISHED	Assumed	MISC					
082 (F31)	brown vinyl baseboard			Monastery: 2nd Floor Community Room-BLDG DEMOLISHED	Assumed	MISC					
082(F32)	black vinyl baseboard			Monastery: 1st, 2nd & 3rd Floor Stairwells, 315-BLDG DEMOLISHED	Assumed	MISC					
082(F33)	wood grain baseboard mastic			Monastery: Room 210-BLDG DEMOLISHED	Assumed	MISC					
083 (F31)	mastic under baseboard			Monastery: 2nd Floor Community Room-BLDG DEMOLISHED	Assumed	MISC					
083 (F33)	wood grain baseboard			Monastery: Room 210-BLDG DEMOLISHED	Assumed	MISC					
083(F32)	black vinyl baseboard mastic			Monastery: 1st, 2nd & 3rd Floor Stairwells, 315	Assumed	MISC					

Chicago Public Schools

School

Brooks College Prep
(Southside College Prep)

Unit

47051

Building ID

1500

Address

250 E. 111th St.

Chicago, IL, 60628

Region

06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone:

630-790-0880

Fax:

630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
084 (CM 45)	orange carpet mastic			Monastery: 2nd Floor Corridor, Room 204 & 210-BLDG DEMOLISHED	Assumed	MISC					
084 (CM53)	brown tweed carpet mastic			Monastery: Room 306-BLDG DEMOLISHED	Assumed	MISC					
084(42)	orange/brown carpet mastic			Monastery: 1st Floor NW Corner-BLDG DEMOLISHED	Assumed	MISC					
084(43)	rust carpet mastic			Monastery: 1st Floor NW Corridor-BLDG DEMOLISHED	Assumed	MISC					
084 (CM41)	brown/tweed carpet mastic			Monastery: 1st Floor NW Corridor	Assumed	MISC					
085(F28)	9x9 red/black border floor tile			Monastery: 1st, 2nd & 3rd Floor Stairwells-BLDG DEMOLISHED	Chrysotile	MISC					
085(F29)	9x9 grey/red trim floor tile			Monastery: 1st Floor-BLDG DEMOLISHED	Chrysotile	MISC					
086(F28)	9x9 red/black border floor tile mastic			Monastery: Stairwells 1st, 2nd, 3rd Floor-BLDG DEMOLISHED	Chrysotile	MISC					
086(F29)	9x9 grey/red trim floor tile mastic			Monastery: 1st Floor-BLDG DEMOLISHED	Chrysotile	MISC					
087	12x12 Ceiling Tile-			Monastery: 2nd,3rd floor--BLDG DEMOLISHED	Assumed	MISC					
088	12x12 Ceiling Tile Mastic			Monastery: 2nd 3rd floor-BLDG DEMOLISHED	Assumed	MISC					
089	Plaster Not Observed			Monastery: throughout 1st,2nd ,3rd floors-BLDG DEMOLISHED	Assumed	SURFACE					
090 (F23)	12x12 white floor tile mastic			Annex: Physics Lab-BLDG DEMOLISHED	Chrysotile	MISC					
090M (F23)	12x12 white floor tile			Annex: Physics Lab-BLDG DEMOLISHED	Assumed	MISC					
091	12x12 off white floor tile			Gym	Assumed	MISC	No	0		6 ACBM with the potential for damage	Follow O&M Plan
092	12x12 Off White Floor tile Mastic			Gym	Assumed	MISC	No	0		6 ACBM with the potential for damage	Follow O&M Plan
093	Aircell pipe insulation (NOT OBSERVED)			Gym: Throughout bldg, locker rooms, showers	Chrysotile	TSI					
094	Hard fittings on air cell pipe insulation (NOT OBSERVED)			Gym: Throughout bldg, locker rooms, showers	Chrysotile	TSI					

Chicago Public Schools

School

Brooks College Prep
(Southside College Prep)

Address

250 E. 111th St.

Unit

47051

Building ID

1500

Region

06

Chicago, IL, 60628

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
100	1'x1' Ceiling Tile Mastic Not Observed			Monastery: confessionals-BLDG DEMOLISHED	Assumed	MISC					
101 (F61)	12x12 Light Gray Floor Tile (ABATED)			Main Building: West Wing Far West Corridor	Abated	MISC					
101 (F62)	12x12 dark brown white/black speck floor tile (ABATED)			Main Building: west wing, north west corner	Abated	MISC					
101(F60)	12x12 off white floor tile (ABATED)			Main Building: West Wing 3rd Floor, NW Corner, West & East Wing, North Portion	Abated	MISC					
102 (F61)	12x12 light grey floor tile mastic (ABATED)			Main Building: west wing far west corridor	Abated	MISC					
102(F60)	12x12 off white floor tile mastic (ABATED)			Main Building: West Wing 3rd floor, NW Corner, West & East Wing, North portion	Abated	MISC					
102(F62)	12x12 dark brown white/black speckled floor tile (ABATED)			Main Building: West Wing, Northwest Corner	Abated	MISC					
103(F63)	9x9 light green floor tile (ABATED)			Main Building: West Wing Corridor, 2nd & 3rd Floor East & West Wing Patches	Abated	MISC					
103(F64)	9x9 light brown floor tile (ABATED)			Main Building: West Wing 1st, 2nd & 3rd Corridor Patches & east end	Abated	MISC					
103(F65)	9x9 medium brown floor tile (ABATED)			Main Building: West Wing 1st & 3rd Floor Corridor Patches & East Wing	Abated	MISC					
103(F66)	9x9 yellow floor tile (ABATED)			Main Building: 1st Floor Corridor Patches	Abated	MISC					
103(F7)	9x9 clay floor tile (ABATED)			Main Building: 1st floor corridor west wing	Abated	MISC					
104 (F63)	9x9 light green floor tile mastic (ABATED)			Main Building: West Wind Corridor, 2nd & 3rd Floor East & West Wing Patches	Abated	MISC					
104 (F7)	9x9 clay floor tile mastic (ABATED)			Main Building: 1st floor corridor west wing	Abated	MISC					
104(F1)	9x9 white floor tile mastic (ABATED)			Main Building: east wing room 15 & 19 & west wing music	Abated	MISC					
104(F2)	9x9 black floor tile mastic (ABATED)			Main Building: east wing room 15 & 19	Abated	MISC					
104(F3)	9x9 pink floor tile mastic (ABATED)			Main Building: west wing 1st,2nd floor	Abated	MISC					

Chicago Public Schools

School

Brooks College Prep
(Southside College Prep)

Address

250 E. 111th St.

Unit

47051

Building ID

1500

Region

06

Chicago, IL, 60628

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				foyer							
104(F4)	9x9 maroon floor tile mastic (ABATED)			Main Building: 1st & 2nd floor west wing, 1st floor throughout, 2nd flr west rooms	Abated	MISC					
104(F5)	9x9 tan mastic (ABATED)			Main Building: Library, East Wing Throughout	Abated	MISC					
104(F64)	9x9 light brown floor tile mastic (ABATED)			Main Building: west wing 1st,2nd,3rd corridor patches & east end	Abated	MISC					
104(F65)	9x9 medium brown floor tile mastic (ABATED)			Main Building: west wing 1st & 3rd floor corridor patches & east wing	Abated	MISC					
104(F66)	9x9 yellow floor tile mastic (ABATED)			Main Building: 1st floor corridor patches	Abated	MISC					
104(F67)	9x9 green floor tile mastic (ABATED)			Main Building: 1st floor stairwell, east wing & 2nd & 3rd flr. Hallway	Abated	MISC					
105 (F68)	Various size brown speckled floor tile (ABATED)			Main Building: 1st, 2nd & 3rd floor patches in east & west wing	Abated	MISC					
106(F68)	Various size brown speckled floor tile mastic (ABATED)			Main Building: 1st, 2nd & 3rd floor patches in east & west wing	Abated	MISC					
107 (CM70)	carpet mastic under multicolored (ABATED)			Main Building: 2nd floor west wing, far west wing	Abated	MISC					
107 (CM71)	grey carpet mastic (ABATED)			Main Building: 2nd floor office, 1st floor west corner	Abated	MISC					
108	grey vinyl stair treads (ABATED)			Main Building: 1st, 2nd, 3rd floor east & west wings	Abated	MISC					
109	vinyl stair track mastic (ABATED)			Main Building: 1st, 2nd, 3rd floor east & west wings	Abated	MISC	No				
110 (F75)	4" brown vinyl base board (ABATED)			Main Building: 1st floor corridor leading to west wing, 3rd floor NW corner	Abated	MISC					
110 (F76)	4" black baseboard (ABATED)			Main Building: 1st, 2nd & 3rd Floor Throughout East Wing & Corridor- East Wing 1st Floor NE Corner West Wing	Abated	MISC					
110 (F77)	4" tan baseboard (ABATED)			Main Building: 1st, 2nd floor, NE. & NW. portion	Abated	MISC					
111(F75)	4" brown vinyl base board mastic (ABATED)			Main Building: 1st floor corridor leading to west wing, 3rd floor NW corner	Abated	MISC					

Chicago Public Schools

School

Brooks College Prep
(Southside College Prep)

Unit

47051

Building ID

1500

Address

250 E. 111th St.

Chicago, IL, 60628

Region

06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone:

630-790-0880

Fax:

630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
111(F76)	4" black baseboard (ABATED)			Main Building: 1st, 2nd & 3rd floor throughout	Abated	MISC					
111(F77)	4" tan baseboard mastic (ABATED)			Main Building: 1st & 2nd Floor, NE. & NW. portion	Abated	MISC					
112 (F80)	6" black vinyl baseboard (ABATED)			Main Building: 2nd floor, SE corner	Abated	MISC					
113 (F80)	6" black vinyl baseboard mastic (ABATED)			Main Building: 2nd floor main bldg. SE corner	Abated	MISC					
114 (CT1)	12x12 ceiling tile (ABATED)			Main Building: 1st floor west wing near NW corner	Abated	MISC					
114 (CTM1)	12x12 ceiling tile mastic (ABATED)			Main Building: 1st floor west wing near NW corner	Abated	MISC					
116	12x12 cork tile (ABATED)			Main Building: 2nd floor west wing room NE. corner of bldg.	Abated	MISC					
151	NOT OBSERVED FLOOR TILE REPLACEMENT12X12 Grey/Dark Brown	50,000	SF	1st, 2nd, & 3rd floor hallways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
152	Baseboard Mastic	50,000	SF	1st, 2nd, & 3rd floor throughout building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
153	2'x4' Speckled Pattern Ceiling Tile (w/ 2'x2' Sections)	1,350	SF	1st Floor: West Wing - Dining Room: 4th Floor: Center Building - Room 402 and 405	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
154	4" Vinyl Baseboard - Grey	1,100	LF	1st Floor: West Wing - Dining Room; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
155	Mastic associated with 4" Vinyl Baseboard - Grey	1,100	LF	1st Floor: West Wing - Dining Room; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
156	12"x12" White with Grey Specs Floor Tile	5,350	SF	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
157	12"x12" White with Grey Specs Floor Tile Mastic	5,350	SF	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
158	2'x2' Smooth Pattern Ceiling Tile	7,375	SF	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139, and North/South Corridor	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

Chicago Public Schools

School

Brooks College Prep
(Southside College Prep)

Unit

47051

Building ID

1500

Address

250 E. 111th St.

Chicago, IL, 60628

Region

06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone:

630-790-0880

Fax:

630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
159	Interior Window Caulk	400	LF	1st Floor: East Wing - Room 131, 133, 135, 137, and 139; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
160	Terrazzo Floor	2,025	SF	1st Floor: East Wing - North/South Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
161	12"x12" Grey Speckled Floor Tile	2,600	SF	4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
162	12"x12" Grey Speckled Floor Tile Mastic	2,600	SF	4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
163	Black Sink Undercoat	1	EA	4th Floor: Center Building - Room 400	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
164	Black Counter Top	200	SF	4th Floor: Center Building - Room 400 and 400A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
165	Drywall	4,600	SF	4th Floor: Center Building - Room 400, 400A, and 404	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
166	Drywall Joint Compound	4,600	SF	4th Floor: Center Building - Room 400, 400A, and 404	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
167	Sheet Flooring - Brown Multi-Color Pattern	1,350	SF	1st Floor: West Wing - Dining Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
168	Sheet Flooring - Brown Multi-Color Pattern Mastic	1,350	SF	1st Floor: West Wing - Dining Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
169	White Sink Undercoat	1	EA	4th Floor: Center Building - Room 404	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
170	Carpet Mastic - Brown	2,200	SF	Rooms 100 A, 100 C, 100 E, 100 F, 105, 111, 116A and 116B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
171	Carpet Mastic Blue w/ white streaks	1,500	SF	Rooms 201, 201A, 201C and 201D	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
172	Carpet Mastic Brown w/ blue and orange streaks	10,300	SF	Rooms 147, 153A, 153C, 153D, 153E, 153F, 153F2, 235, 237A, 237D and Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12 x 12 Yellow Floor Tile Mastic	12,500	SF	Rooms 106, 200-206, 208, 209, 210, 216, Library, Office, and Coach's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	Brown Carpet Mastic	6,000	SF	Library, Assistant Principal's, Nurse Office, Side Office, 102, 103, 111, 117, and Office Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12 x 12 Gray Floor Tile Mastic	12,500	SF	Band Room, 4th Floor, 403, 407,	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School

Brooks College Prep
(Southside College Prep)

Unit

47051

Building ID

1500

Address

250 E. 111th St.

Chicago, IL, 60628

Region

06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Office, Bathroom, West Side, 100, 101, Attendance Office							
27	2 x 4 Lay-in Panels NOT OBSERVED	1,000	SF	Kitchen	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
28	Spray-on Insulation	3,000	SF	Gymnasium	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
29	2 x 2 Lay-in Ceiling Panels	20,000	SF	Hallways	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
30	Black Counter Tops	26	SF	Rooms 307 and 307A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Brooks College Prep
(Southside College Prep)

Unit 47051

Building ID 1500

Address 250 E. 111th St.

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Review Date	09/06/2019
Manager Planner Name	John Fenn
100-09786	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
002	
004	
005	
007	
008	
009	
010	
011	
012	
013(F18)	
014(C12)	
014A	
015(C9)	
016	
017(F1)	
018	
018(F15)	
019	
020	
023	
023(F2)	
024(F4)	

Chicago Public Schools

School Brooks College Prep
(Southside College Prep)

Unit 47051

Building ID 1500

Address 250 E. 111th St.

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
025	
036 (C13)	
040(F9)	
041(F3)	
043(F11)	
045 (F16)	
046(F20)	
047(F19)	
049 (F5)	
051 (F12)	
052 (F17)	
052 (F21)	
052(F8)	
053 (F13)	
054	
055	
059	
060	
070 (F13)	
070 (F17)	
070 (F21)	
072	
073 (C14)	
078	
079	

Chicago Public Schools

School Brooks College Prep
(Southside College Prep)

Unit 47051

Building ID 1500

Address 250 E. 111th St.

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
080 (F25)	
080 (F26)	
080 (F27)	
081 (F25)	
081 (F26)	
081 (F27)	
082 (F31)	
082(F32)	
082(F33)	
083 (F31)	
083 (F33)	
083(F32)	
084 (CM 45)	
084 (CM53)	
084(42)	
084(43)	
084(CM41)	
085(F28)	
085(F29)	
086(F28)	
086(F29)	
087	
088	
089	
090 (F23)	

Chicago Public Schools

School Brooks College Prep
(Southside College Prep)

Unit 47051

Building ID 1500

Address 250 E. 111th St.

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
090M(F23)	
091	
092	
093	
094	
100	
101 (F61)	
101 (F62)	
101(F60)	
102 (F61)	
102(F60)	
102(F62)	
103(F63)	
103(F64)	
103(F65)	
103(F66)	
103(F7)	
104 (F63)	
104 (F7)	
104(F1)	
104(F2)	
104(F3)	
104(F4)	
104(F5)	
104(F64)	

Chicago Public Schools

School Brooks College Prep
(Southside College Prep)

Unit 47051

Building ID 1500

Address 250 E. 111th St.

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
104(F65)	
104(F66)	
104(F67)	
105 (F68)	
106(F68)	
107(CM70)	
107(CM71)	
108	
109	
110 (F75)	
110 (F76)	
110 (F77)	
111(F75)	
111(F76)	
111(F77)	
112 (F80)	
113 (F80)	
114 (CT1)	
114 (CTM1)	
116	
151	
152	
153	
154	
155	

Chicago Public Schools

School Brooks College Prep
(Southside College Prep)

Unit 47051

Building ID 1500

Address 250 E. 111th St.

Chicago, IL, 60628

Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
156	
157	
158	
159	
160	
161	
162	
163	
164	
165	
166	
167	
168	
169	
170	
171	
172	
21	
22	
26	
27	
28	
29	
30	

Chicago Public Schools

School	Brooks College Prep (Southside College Prep)	Unit	47051	Building ID	1500
Address	250 E. 111th St.		Chicago, IL, 60628	Region	06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)	TEM Environmental, Inc.
	174 N. Brandon Drive Glendale Heights, IL, 60139
	Phone: 630-790-0880 Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Chicago Public Schools

TEM Environmental, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	002	
MATERIAL DESCRIPTION:	Aircell jacket (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Hot water tank in boiler room

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	002				
MATERIAL DESCRIPTION:	Aircell jacket (ABATED)				
MATERIAL LOCATION:	Main Building: Hot water tank in boiler room				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	004	
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Boiler Room East

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	004				
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation (ABATED)				
MATERIAL LOCATION:	Main Building: Boiler Room East				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	005	
MATERIAL DESCRIPTION:	Mag. Jacket Boilers 1&2 (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Boiler Room

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	005	
MATERIAL DESCRIPTION:	Mag. Jacket Boilers 1&2 (ABATED)	
MATERIAL LOCATION:	Main Building: Boiler Room	
MATERIAL QUANTITY:		MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	007	
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Boiler Room, East Perimeter

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	007				
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation (ABATED)				
MATERIAL LOCATION:	Main Building: Boiler Room, East Perimeter				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	008		
MATERIAL DESCRIPTION:	Joint compound on Cardboard Pipe Insul. (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Boiler Room Hot Water Pipe

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	008				
MATERIAL DESCRIPTION:	Joint compound on Cardboard Pipe Insul. (ABATED)				
MATERIAL LOCATION:	Main Building: Boiler Room Hot Water Pipe				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	009	
MATERIAL DESCRIPTION:	Joint compound on aircell pipe insulation (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: boiler room on east wall

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	009				
MATERIAL DESCRIPTION:	Joint compound on aircell pipe insulation (ABATED)				
MATERIAL LOCATION:	Main Building: boiler room on east wall				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	010		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Building: Attic (abated) and Tunnels (still present)		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	010				
MATERIAL DESCRIPTION:	Aircell Pipe Insulation				
MATERIAL LOCATION:	Main Building: Attic (abated) and Tunnels (still present)				
MATERIAL QUANTITY:	300	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	011		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Building: Tunnel		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	011				
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation				
MATERIAL LOCATION:	Main Building: Tunnel				
MATERIAL QUANTITY:	800	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	012		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Building: Tunnels		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	012				
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation				
MATERIAL LOCATION:	Main Building: Tunnels				
MATERIAL QUANTITY:	500	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	013(F18)		
MATERIAL DESCRIPTION:	9x9 Brown Speckled Floor Tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: West Wind Coaches Offices

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	013(F18)				
MATERIAL DESCRIPTION:	9x9 Brown Speckled Floor Tile (ABATED)				
MATERIAL LOCATION:	Main Building: West Wind Coaches Offices				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	014(C12)	
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: West Wing Coaches Office

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	014(C12)				
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile (ABATED)				
MATERIAL LOCATION:	Main Building: West Wing Coaches Office				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	014A	
MATERIAL DESCRIPTION:	Red, Black, Brown, Tan linoleum pattern (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Auditorium 1st floor, 2nd Floor Foyer

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	014A				
MATERIAL DESCRIPTION:	Red, Black, Brown, Tan linoleum pattern (ABATED)				
MATERIAL LOCATION:	Main Building: Auditorium 1st floor, 2nd Floor Foyer				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	015(C9)	
MATERIAL DESCRIPTION:	1'x1' Glued on Ceiling (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Men's Bathroom

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	015(C9)				
MATERIAL DESCRIPTION:	1'x1' Glued on Ceiling (ABATED)				
MATERIAL LOCATION:	Main Building: Men's Bathroom				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	016	
MATERIAL DESCRIPTION:	Plaster (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Throughout West Wing Building.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	016				
MATERIAL DESCRIPTION:	Plaster (ABATED)				
MATERIAL LOCATION:	Main Building: Throughout West Wing Building.				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	017(F1)		
MATERIAL DESCRIPTION:	9x9 White Floor Tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: East Wing Rooms 15, 19, and 306

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	017(F1)				
MATERIAL DESCRIPTION:	9x9 White Floor Tile (ABATED)				
MATERIAL LOCATION:	Main Building: East Wing Rooms 15, 19, and 306				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	018	
MATERIAL DESCRIPTION:	9x9 Pink Floor Tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: West Wing Foyer

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	018				
MATERIAL DESCRIPTION:	9x9 Pink Floor Tile (ABATED)				
MATERIAL LOCATION:	Main Building: West Wing Foyer				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	018(F15)		
MATERIAL DESCRIPTION:	9x9 pink floor tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: W. wing 1st floor foyer & 2nd floor foyer and lounge

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	018(F15)				
MATERIAL DESCRIPTION:	9x9 pink floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: W. wing 1st floor foyer & 2nd floor foyer and lounge				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	019		
MATERIAL DESCRIPTION:	Beige Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office, Rooms 304, 310, 306, 303C, 317, 318, 116, Hallways and Bathrooms		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	019				
MATERIAL DESCRIPTION:	Beige Terrazzo				
MATERIAL LOCATION:	Main Office, Rooms 304, 310, 306, 303C, 317, 318, 116, Hallways and Bathrooms				
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	020		
MATERIAL DESCRIPTION:	12 x 12 Yellow Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 106, 200-205, 208, 209, 216, Library, Office, and Coach's Office		
MATERIAL QUANTITY:	12500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	020				
MATERIAL DESCRIPTION:	12 x 12 Yellow Floor Tile				
MATERIAL LOCATION:	Rooms 106, 200-205, 208, 209, 216, Library, Office, and Coach's Office				
MATERIAL QUANTITY:	12500	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	023	
MATERIAL DESCRIPTION:	Light Beige Linoleum (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building: Gym (Room 251), Room 253**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	023				
MATERIAL DESCRIPTION:	Light Beige Linoleum (ABATED)				
MATERIAL LOCATION:	Main Building: Gym (Room 251), Room 253				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	023(F2)		
MATERIAL DESCRIPTION:	9x9 black floor tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: east wing 2nd & 3rd floor rooms 15,19,306

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	023(F2)				
MATERIAL DESCRIPTION:	9x9 black floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: east wing 2nd & 3rd floor rooms 15,19,306				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	024(F4)	
MATERIAL DESCRIPTION:	9"x9" Maroon Floor Tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: East Wing 2nd Floor, Library, and Guidance Office

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	024(F4)				
MATERIAL DESCRIPTION:	9"x9" Maroon Floor Tile (ABATED)				
MATERIAL LOCATION:	Main Building: East Wing 2nd Floor, Library, and Guidance Office				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	025		
MATERIAL DESCRIPTION:	12 x 12 Gray Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Band Room, 4th Floor, 403, 407, Office, Bathroom, West Side, 100, 101, Attendance Office**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/08/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	025				
MATERIAL DESCRIPTION:	12 x 12 Gray Floor Tile				
MATERIAL LOCATION:	Band Room, 4th Floor, 403, 407, Office, Bathroom, West Side, 100, 101, Attendance Office				
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	036 (C13)		
MATERIAL DESCRIPTION:	2x4 lay in ceiling tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: music room

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	036 (C13)				
MATERIAL DESCRIPTION:	2x4 lay in ceiling tile (ABATED)				
MATERIAL LOCATION:	Main Building: music room				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	040(F9)	
MATERIAL DESCRIPTION:	9"x9" Gray Floor Tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Guidance and Xerox Offices

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	040(F9)				
MATERIAL DESCRIPTION:	9"x9" Gray Floor Tile (ABATED)				
MATERIAL LOCATION:	Main Building: Guidance and Xerox Offices				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	041(F3)	
MATERIAL DESCRIPTION:	9"x9" Red Floor Tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Rm. 306 and Xerox Rm.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	041(F3)				
MATERIAL DESCRIPTION:	9"x9" Red Floor Tile (ABATED)				
MATERIAL LOCATION:	Main Building: Rm. 306 and Xerox Rm.				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	043(F11)		
MATERIAL DESCRIPTION:	9x9 White Floor Tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Office

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	043(F11)				
MATERIAL DESCRIPTION:	9x9 White Floor Tile (ABATED)				
MATERIAL LOCATION:	Main Building: Office				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	045 (F16)	
MATERIAL DESCRIPTION:	9x9 grey floor tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: west wing 2nd floor lounge

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	045 (F16)				
MATERIAL DESCRIPTION:	9x9 grey floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: west wing 2nd floor lounge				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	046(F20)	
MATERIAL DESCRIPTION:	9"x9" Green Floor Tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Gym, Cafeteria

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	046(F20)				
MATERIAL DESCRIPTION:	9"x9" Green Floor Tile (ABATED)				
MATERIAL LOCATION:	Main Building: Gym, Cafeteria				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	047(F19)	
MATERIAL DESCRIPTION:	9"x9" Tan Floor Tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Gym, Cafeteria Building

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	047(F19)				
MATERIAL DESCRIPTION:	9"x9" Tan Floor Tile (ABATED)				
MATERIAL LOCATION:	Main Building: Gym, Cafeteria Building				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	049 (F5)	
MATERIAL DESCRIPTION:	9x9 tan floor tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: guidance office,east wing room 29 & library

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	049 (F5)				
MATERIAL DESCRIPTION:	9x9 tan floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: guidance office, east wing room 29 & library				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	051 (F12)	
MATERIAL DESCRIPTION:	9x9 green & white floor tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: east wing 2nd & 3rd floor hallway & room 31

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	051 (F12)				
MATERIAL DESCRIPTION:	9x9 green & white floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: east wing 2nd & 3rd floor hallway & room 31				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	052 (F17)		
MATERIAL DESCRIPTION:	9x9 green & tan floor tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: office & storage 156A & 156B

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	052 (F17)				
MATERIAL DESCRIPTION:	9x9 green & tan floor tile (ABATED)				
MATERIAL LOCATION:	Annex: office & storage 156A & 156B				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	052 (F21)	
MATERIAL DESCRIPTION:	9x9 blue floor tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: room 151

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47051** BUILDING ID: **1500**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **John Fenn**
SCHOOL NAME: **Brooks College Prep
(Southside College
Prep)** REVIEW DATE: **9/6/2019**
ADDRESS: **250 E. 111th St.** IDPH LICENSE NO: **100-04437**

HOMOGENEOUS AREA: **052 (F21)**
MATERIAL DESCRIPTION: **9x9 blue floor tile (ABATED)**
MATERIAL LOCATION: **Annex: room 151**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	052(F8)	
MATERIAL DESCRIPTION:	Blue and White Linoleum (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 2nd Floor Teachers' Lounge Kitchen

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	052(F8)				
MATERIAL DESCRIPTION:	Blue and White Linoleum (ABATED)				
MATERIAL LOCATION:	Main Building: 2nd Floor Teachers' Lounge Kitchen				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	053 (F13)		
MATERIAL DESCRIPTION:	12x12 tan floor tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: boys & girls toilets & corridors

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	053 (F13)				
MATERIAL DESCRIPTION:	12x12 tan floor tile (ABATED)				
MATERIAL LOCATION:	Annex: boys & girls toilets & corridors				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	054	
MATERIAL DESCRIPTION:	2x4 ceiling tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: Chemistry Lab Room 252

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	054	
MATERIAL DESCRIPTION:	2x4 ceiling tile (ABATED)	
MATERIAL LOCATION:	Annex: Chemistry Lab Room 252	
MATERIAL QUANTITY:		MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	055	
MATERIAL DESCRIPTION:	Aircell (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: Chemistry Lab

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	055	
MATERIAL DESCRIPTION:	Aircell (ABATED)	
MATERIAL LOCATION:	Annex: Chemistry Lab	
MATERIAL QUANTITY:		MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	059	
MATERIAL DESCRIPTION:	Trim mastic on on Tan Baseboard (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: foyer/corridor

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	059				
MATERIAL DESCRIPTION:	Trim mastic on on Tan Baseboard (ABATED)				
MATERIAL LOCATION:	Annex: foyer/corridor				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	060	
MATERIAL DESCRIPTION:	Trim tan baseboard (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: Foyer/Corridor

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	060				
MATERIAL DESCRIPTION:	Trim tan baseboard (ABATED)				
MATERIAL LOCATION:	Annex: Foyer/Corridor				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	070 (F13)		
MATERIAL DESCRIPTION:	12x12 tan floor tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: boys & girls toilets & corridors

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	070 (F13)				
MATERIAL DESCRIPTION:	12x12 tan floor tile mastic (ABATED)				
MATERIAL LOCATION:	Annex: boys & girls toilets & corridors				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	070 (F17)		
MATERIAL DESCRIPTION:	9x9 green floor tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: room 151

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	070 (F17)				
MATERIAL DESCRIPTION:	9x9 green floor tile mastic (ABATED)				
MATERIAL LOCATION:	Annex: room 151				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	070 (F21)	
MATERIAL DESCRIPTION:	9x9 blue floor tile mastic (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: room 151

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA: **070 (F21)**

MATERIAL DESCRIPTION: **9x9 blue floor tile mastic (ABATED)**

MATERIAL LOCATION: **Annex: room 151**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	072	
MATERIAL DESCRIPTION:	paneling mastic (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: Annex Corridor

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	072	
MATERIAL DESCRIPTION:	paneling mastic (ABATED)	
MATERIAL LOCATION:	Annex: Annex Corridor	
MATERIAL QUANTITY:		MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	073 (C14)	
MATERIAL DESCRIPTION:	12x12 ceiling tile mastic (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: rooms 155 A-D

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	073 (C14)				
MATERIAL DESCRIPTION:	12x12 ceiling tile mastic (ABATED)				
MATERIAL LOCATION:	Annex: rooms 155 A-D				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	078		
MATERIAL DESCRIPTION:	Aircell pipe insulation		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Crawl space tunnels, connecting tunnel from main bldg (to Monastery - Monastery no longer exists)		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:	Monastery No Longer Exists		

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	078				
MATERIAL DESCRIPTION:	Aircell pipe insulation				
MATERIAL LOCATION:	Crawl space tunnels, connecting tunnel from main bldg (to Monastery - Monastery no longer exists)				
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	079		
MATERIAL DESCRIPTION:	Hard fittings on aircell pipe insulation		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Crawl space tunnels, connecting tunnel from main bldg to Monastery (Monastery no longer exists)		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:	Monastery No Longer Exists		

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	079				
MATERIAL DESCRIPTION:	Hard fittings on aircell pipe insulation				
MATERIAL LOCATION:	Crawl space tunnels, connecting tunnel from main bldg to Monastery (Monastery no longer exists)				
MATERIAL QUANTITY:	200	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	080 (F25)	
MATERIAL DESCRIPTION:	12x12 black floor tile	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Monastery: 2nd Floor Fireplace-BLDG DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Monastery No Longer Exists**

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	080 (F25)				
MATERIAL DESCRIPTION:	12x12 black floor tile				
MATERIAL LOCATION:	Monastery: 2nd Floor Fireplace-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	080 (F26)	
MATERIAL DESCRIPTION:	12x12 Red Floor Tile	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Chrysotile	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: Low

MATERIAL LOCATION: Monastery: 1st, 2nd & 3rd Floor Stairways-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	080 (F26)				
MATERIAL DESCRIPTION:	12x12 Red Floor Tile				
MATERIAL LOCATION:	Monastery: 1st, 2nd & 3rd Floor Stairways-BLDG DEMOLISHED				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	080 (F27)	
MATERIAL DESCRIPTION:	12x12 Orange/Brown Floor Tile	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery: 2nd & 3rd Floor-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	080 (F27)				
MATERIAL DESCRIPTION:	12x12 Orange/Brown Floor Tile				
MATERIAL LOCATION:	Monastery: 2nd & 3rd Floor-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	081 (F25)	
MATERIAL DESCRIPTION:	12x12 Black Floor Tile Mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Monastery: 2nd Floor Fireplace-BLDG DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Monastery No Longer Exists**

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	081 (F25)				
MATERIAL DESCRIPTION:	12x12 Black Floor Tile Mastic				
MATERIAL LOCATION:	Monastery: 2nd Floor Fireplace-BLDG DEMOLISHED				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	081 (F26)	
MATERIAL DESCRIPTION:	12x12 red floor tile mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Chrysotile	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery- 1st, 2nd & 3rd Floor Stairways-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	081 (F26)				
MATERIAL DESCRIPTION:	12x12 red floor tile mastic				
MATERIAL LOCATION:	Monastery- 1st, 2nd & 3rd Floor Stairways-BLDG DEMOLISHED				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	081 (F27)	
MATERIAL DESCRIPTION:	12x12 orange/brown floor tile mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Monastery: 2nd & 3rd floor-BLDG DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Monastery No Longer Exists**

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA: 081 (F27)

MATERIAL DESCRIPTION: 12x12 orange/brown floor tile mastic

MATERIAL LOCATION: Monastery: 2nd & 3rd floor-BLDG DEMOLISHED

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	082 (F31)	
MATERIAL DESCRIPTION:	brown vinyl baseboard	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Monastery: 2nd Floor Community Room-BLDG DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Monastery No Longer Exists**

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	082 (F31)				
MATERIAL DESCRIPTION:	brown vinyl baseboard				
MATERIAL LOCATION:	Monastery: 2nd Floor Community Room-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	082(F32)	
MATERIAL DESCRIPTION:	black vinyl baseboard	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan	
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery: 1st, 2nd & 3rd Floor Stairwells, 315-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	082(F32)				
MATERIAL DESCRIPTION:	black vinyl baseboard				
MATERIAL LOCATION:	Monastery: 1st, 2nd & 3rd Floor Stairwells, 315-BLDG DEMOLISHED				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	082(F33)	
MATERIAL DESCRIPTION:	wood grain baseboard mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Monastery: Room 210-BLDG DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Monastery No Longer Exists**

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	082(F33)				
MATERIAL DESCRIPTION:	wood grain baseboard mastic				
MATERIAL LOCATION:	Monastery: Room 210-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	083 (F31)	
MATERIAL DESCRIPTION:	mastic under baseboard	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Monastery: 2nd Floor Community Room-BLDG DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Monastery No Longer Exists**

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	083 (F31)				
MATERIAL DESCRIPTION:	mastic under baseboard				
MATERIAL LOCATION:	Monastery: 2nd Floor Community Room-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	083 (F33)	
MATERIAL DESCRIPTION:	wood grain baseboard	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Monastery: Room 210-BLDG DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Monastery No Longer Exists**

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	083 (F33)				
MATERIAL DESCRIPTION:	wood grain baseboard				
MATERIAL LOCATION:	Monastery: Room 210-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	083(F32)	
MATERIAL DESCRIPTION:	black vinyl baseboard mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery: 1st, 2nd & 3rd Floor Stairwells, 315

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	083(F32)				
MATERIAL DESCRIPTION:	black vinyl baseboard mastic				
MATERIAL LOCATION:	Monastery: 1st, 2nd & 3rd Floor Stairwells, 315				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	084 (CM 45)	
MATERIAL DESCRIPTION:	orange carpet mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery: 2nd Floor Corridor, Room 204 & 210-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	084 (CM 45)				
MATERIAL DESCRIPTION:	orange carpet mastic				
MATERIAL LOCATION:	Monastery: 2nd Floor Corridor, Room 204 & 210-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	084 (CM53)	
MATERIAL DESCRIPTION:	brown tweed carpet mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Monastery: Room 306-BLDG DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Monastery No Longer Exists**

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	084 (CM53)				
MATERIAL DESCRIPTION:	brown tweed carpet mastic				
MATERIAL LOCATION:	Monastery: Room 306-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	084(42)	
MATERIAL DESCRIPTION:	orange/brown carpet mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery: 1st Floor NW Corner-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	084(42)				
MATERIAL DESCRIPTION:	orange/brown carpet mastic				
MATERIAL LOCATION:	Monastery: 1st Floor NW Corner-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	084(43)	
MATERIAL DESCRIPTION:	rust carpet mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Monastery: 1st Floor NW Corridor-BLDG DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Monastery No Longer Exists**

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	084(43)				
MATERIAL DESCRIPTION:	rust carpet mastic				
MATERIAL LOCATION:	Monastery: 1st Floor NW Corridor-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	084(CM41)	
MATERIAL DESCRIPTION:	brown/tweed carpet mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery: 1st Floor NW Corridor

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	084(CM41)				
MATERIAL DESCRIPTION:	brown/tweed carpet mastic				
MATERIAL LOCATION:	Monastery: 1st Floor NW Corridor				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	085(F28)	
MATERIAL DESCRIPTION:	9x9 red/black border floor tile	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan	
ASBESTOS TYPE:	Chrysotile	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery: 1st, 2nd & 3rd Floor Stairwells-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	085(F28)				
MATERIAL DESCRIPTION:	9x9 red/black border floor tile				
MATERIAL LOCATION:	Monastery: 1st, 2nd & 3rd Floor Stairwells-BLDG DEMOLISHED				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	085(F29)	
MATERIAL DESCRIPTION:	9x9 grey/red trim floor tile	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Chrysotile	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Monastery: 1st Floor-BLDG DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Monastery No Longer Exists**

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	085(F29)				
MATERIAL DESCRIPTION:	9x9 grey/red trim floor tile				
MATERIAL LOCATION:	Monastery: 1st Floor-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	086(F28)	
MATERIAL DESCRIPTION:	9x9 red/black border floor tile mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Chrysotile	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery: Stairwells 1st, 2nd, 3rd Floor-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	086(F28)				
MATERIAL DESCRIPTION:	9x9 red/black border floor tile mastic				
MATERIAL LOCATION:	Monastery: Stairwells 1st, 2nd, 3rd Floor-BLDG DEMOLISHED				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	086(F29)	
MATERIAL DESCRIPTION:	9x9 grey/red trim floor tile mastic	
HISTORICAL AHERA DAMAGE CATEGORY	ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Chrysotile	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: Low

MATERIAL LOCATION: Monastery: 1st Floor-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	086(F29)				
MATERIAL DESCRIPTION:	9x9 grey/red trim floor tile mastic				
MATERIAL LOCATION:	Monastery: 1st Floor-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	087	
MATERIAL DESCRIPTION:	12x12 Ceiling Tile-	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery: 2nd,3rd floor--BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	087	
MATERIAL DESCRIPTION:	12x12 Ceiling Tile-	
MATERIAL LOCATION:	Monastery: 2nd,3rd floor--BLDG DEMOLISHED	
MATERIAL QUANTITY:		MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	088	
MATERIAL DESCRIPTION:	12x12 Ceiling Tile Mastic	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery: 2nd 3rd floor-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	088				
MATERIAL DESCRIPTION:	12x12 Ceiling Tile Mastic				
MATERIAL LOCATION:	Monastery: 2nd 3rd floor-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	089	
MATERIAL DESCRIPTION:	Plaster Not Observed	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Monastery: throughout 1st,2nd ,3rd floors-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Monastery No Longer Exists

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	089	
MATERIAL DESCRIPTION:	Plaster Not Observed	
MATERIAL LOCATION:	Monastery: throughout 1st,2nd ,3rd floors-BLDG DEMOLISHED	
MATERIAL QUANTITY:		MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	090 (F23)		
MATERIAL DESCRIPTION:	12x12 white floor tile mastic		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Chrysotile	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: Physics Lab-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	090 (F23)				
MATERIAL DESCRIPTION:	12x12 white floor tile mastic				
MATERIAL LOCATION:	Annex: Physics Lab-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	090M(F23)	
MATERIAL DESCRIPTION:	12x12 white floor tile	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Annex: Physics Lab-BLDG DEMOLISHED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	090M(F23)				
MATERIAL DESCRIPTION:	12x12 white floor tile				
MATERIAL LOCATION:	Annex: Physics Lab-BLDG DEMOLISHED				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	091		
MATERIAL DESCRIPTION:	12x12 off white floor tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY:

DAMAGE QUANTITY: **0**

COMMENTS: **Not Observed 2019**

MATERIAL UNITS:

DAMAGE UNITS:

Inspector's Signature: _____ Date: **08/08/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	091		
MATERIAL DESCRIPTION:	12x12 off white floor tile		
MATERIAL LOCATION:	Gym		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:	0	DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	092		
MATERIAL DESCRIPTION:	12x12 Off White Floor tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY:

DAMAGE QUANTITY: **0**

COMMENTS: **VFT Not Observed 2019**

MATERIAL UNITS:

DAMAGE UNITS:

Inspector's Signature: _____ Date: **08/08/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	092				
MATERIAL DESCRIPTION:	12x12 Off White Floor tile Mastic				
MATERIAL LOCATION:	Gym				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:	0			DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	093	
MATERIAL DESCRIPTION:	Aircell pipe insulation (NOT OBSERVED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Chrysotile	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Gym: Throughout bldg, locker rooms, showers

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Not Observed Multiple Years

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	093				
MATERIAL DESCRIPTION:	Aircell pipe insulation (NOT OBSERVED)				
MATERIAL LOCATION:	Gym: Throughout bldg, locker rooms, showers				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	094		
MATERIAL DESCRIPTION:	Hard fittings on air cell pipe insulation (NOT OBSERVED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Chrysotile	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Gym: Throughout bldg, locker rooms, showers

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Not Observed Multiple Years

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	094				
MATERIAL DESCRIPTION:	Hard fittings on air cell pipe insulation (NOT OBSERVED)				
MATERIAL LOCATION:	Gym: Throughout bldg, locker rooms, showers				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	100	
MATERIAL DESCRIPTION:	1'x1' Ceiling Tile Mastic Not Observed	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Monastery: confessionals-BLDG DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Monastery No Longer Exists**

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	100	
MATERIAL DESCRIPTION:	1'x1' Ceiling Tile Mastic Not Observed	
MATERIAL LOCATION:	Monastery: confessionals-BLDG DEMOLISHED	
MATERIAL QUANTITY:		MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	101 (F61)	
MATERIAL DESCRIPTION:	12x12 Light Gray Floor Tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: West Wing Far West Corridor

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	101 (F61)				
MATERIAL DESCRIPTION:	12x12 Light Gray Floor Tile (ABATED)				
MATERIAL LOCATION:	Main Building: West Wing Far West Corridor				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	101 (F62)		
MATERIAL DESCRIPTION:	12x12 dark brown white/black speck floor tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: west wing, north west corner

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	101 (F62)				
MATERIAL DESCRIPTION:	12x12 dark brown white/black speck floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: west wing, north west corner				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	101(F60)	
MATERIAL DESCRIPTION:	12x12 off white floor tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: West Wing 3rd Floor, NW Corner, West & East Wing, North Portion

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	101(F60)				
MATERIAL DESCRIPTION:	12x12 off white floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: West Wing 3rd Floor, NW Corner, West & East Wing, North Portion				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	102 (F61)		
MATERIAL DESCRIPTION:	12x12 light grey floor tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: west wing far west corridor

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	102 (F61)				
MATERIAL DESCRIPTION:	12x12 light grey floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: west wing far west corridor				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	102(F60)	
MATERIAL DESCRIPTION:	12x12 off white floor tile mastic (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: West Wing 3rd floor, NW Corner, West & East Wing, North portion

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	102(F60)				
MATERIAL DESCRIPTION:	12x12 off white floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: West Wing 3rd floor, NW Corner, West & East Wing, North portion				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	102(F62)		
MATERIAL DESCRIPTION:	12x12 dark brown white/black speckled floor tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: West Wing, Northwest Corner

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	102(F62)				
MATERIAL DESCRIPTION:	12x12 dark brown white/black speckled floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: West Wing, Northwest Corner				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	103(F63)	
MATERIAL DESCRIPTION:	9x9 light green floor tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: West Wing Corridor, 2nd & 3rd Floor East & West Wing Patches

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	103(F63)				
MATERIAL DESCRIPTION:	9x9 light green floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: West Wing Corridor, 2nd & 3rd Floor East & West Wing Patches				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	103(F64)		
MATERIAL DESCRIPTION:	9x9 light brown floor tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: West Wing 1st, 2nd & 3rd Corridor Patches & east end

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	103(F64)				
MATERIAL DESCRIPTION:	9x9 light brown floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: West Wing 1st, 2nd & 3rd Corridor Patches & east end				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	103(F65)		
MATERIAL DESCRIPTION:	9x9 medium brown floor tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: West Wing 1st & 3rd Floor Corridor Patches & East Wing

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	103(F65)				
MATERIAL DESCRIPTION:	9x9 medium brown floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: West Wing 1st & 3rd Floor Corridor Patches & East Wing				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	103(F66)	
MATERIAL DESCRIPTION:	9x9 yellow floor tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st Floor Corridor Patches

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	103(F66)				
MATERIAL DESCRIPTION:	9x9 yellow floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: 1st Floor Corridor Patches				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	103(F7)	
MATERIAL DESCRIPTION:	9x9 clay floor tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st floor corridor west wing

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	103(F7)				
MATERIAL DESCRIPTION:	9x9 clay floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: 1st floor corridor west wing				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104 (F63)		
MATERIAL DESCRIPTION:	9x9 light green floor tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: West Wind Corridor, 2nd & 3rd Floor East & West Wing Patches

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	104 (F63)				
MATERIAL DESCRIPTION:	9x9 light green floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: West Wind Corridor, 2nd & 3rd Floor East & West Wing Patches				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104 (F7)	
MATERIAL DESCRIPTION:	9x9 clay floor tile mastic (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st floor corridor west wing

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	104 (F7)				
MATERIAL DESCRIPTION:	9x9 clay floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: 1st floor corridor west wing				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104(F1)	
MATERIAL DESCRIPTION:	9x9 white floor tile mastic (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: east wing room 15 & 19 & west wing music

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	104(F1)				
MATERIAL DESCRIPTION:	9x9 white floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: east wing room 15 & 19 & west wing music				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104(F2)		
MATERIAL DESCRIPTION:	9x9 black floor tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: east wing room 15 & 19

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	104(F2)				
MATERIAL DESCRIPTION:	9x9 black floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: east wing room 15 & 19				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104(F3)	
MATERIAL DESCRIPTION:	9x9 pink floor tile mastic (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: west wing 1st,2nd floor foyer

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	104(F3)				
MATERIAL DESCRIPTION:	9x9 pink floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: west wing 1st,2nd floor foyer				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104(F4)	
MATERIAL DESCRIPTION:	9x9 maroon floor tile mastic (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st & 2nd floor west wing, 1st floor throughout, 2nd flr west rooms

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	104(F4)				
MATERIAL DESCRIPTION:	9x9 maroon floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: 1st & 2nd floor west wing, 1st floor throughout, 2nd flr west rooms				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104(F5)	
MATERIAL DESCRIPTION:	9x9 tan mastic (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: Library, East Wing Throughout

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	104(F5)				
MATERIAL DESCRIPTION:	9x9 tan mastic (ABATED)				
MATERIAL LOCATION:	Main Building: Library, East Wing Throughout				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104(F64)		
MATERIAL DESCRIPTION:	9x9 light brown floor tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: west wing 1st,2nd,3rd corridor patches & east end

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	104(F64)				
MATERIAL DESCRIPTION:	9x9 light brown floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: west wing 1st,2nd,3rd corridor patches & east end				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104(F65)		
MATERIAL DESCRIPTION:	9x9 medium brown floor tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: west wing 1st & 3rd floor corridor patches & east wing

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	104(F65)				
MATERIAL DESCRIPTION:	9x9 medium brown floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: west wing 1st & 3rd floor corridor patches & east wing				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104(F66)		
MATERIAL DESCRIPTION:	9x9 yellow floor tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st floor corridor patches

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	104(F66)				
MATERIAL DESCRIPTION:	9x9 yellow floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: 1st floor corridor patches				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	104(F67)		
MATERIAL DESCRIPTION:	9x9 green floor tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st floor stairwell, east wing & 2nd & 3rd flr. Hallway

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	104(F67)				
MATERIAL DESCRIPTION:	9x9 green floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: 1st floor stairwell, east wing & 2nd & 3rd flr. Hallway				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	105 (F68)		
MATERIAL DESCRIPTION:	Various size brown speckled floor tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st, 2nd & 3rd floor patches in east & west wing

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	105 (F68)				
MATERIAL DESCRIPTION:	Various size brown speckled floor tile (ABATED)				
MATERIAL LOCATION:	Main Building: 1st, 2nd & 3rd floor patches in east & west wing				
MATERIAL QUANTITY:			MATERIAL UNITS:		
DAMAGE QUANTITY:			DAMAGE UNITS:		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	106(F68)		
MATERIAL DESCRIPTION:	Various size brown speckled floor tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st, 2nd & 3rd floor patches in east & west wing

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	106(F68)				
MATERIAL DESCRIPTION:	Various size brown speckled floor tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: 1st, 2nd & 3rd floor patches in east & west wing				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	107(CM70)		
MATERIAL DESCRIPTION:	carpet mastic under multicolored (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 2nd floor west wing, far west wing

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	107(CM70)				
MATERIAL DESCRIPTION:	carpet mastic under multicolored (ABATED)				
MATERIAL LOCATION:	Main Building: 2nd floor west wing, far west wing				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47051** BUILDING ID: **1500**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Mary Hicks**
SCHOOL NAME: **Brooks College Prep (Southside College Prep)** INSPECTION DATE: **8/8/2019**
ADDRESS: **250 E. 111th St.** IDPH LICENSE NO: **100-04437**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **107(CM71)**
MATERIAL DESCRIPTION: **grey carpet mastic (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Building: 2nd floor office, 1st floor west corner**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **08/08/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	107(CM71)				
MATERIAL DESCRIPTION:	grey carpet mastic (ABATED)				
MATERIAL LOCATION:	Main Building: 2nd floor office, 1st floor west corner				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	108	
MATERIAL DESCRIPTION:	grey vinyl stair treads (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st, 2nd, 3rd floor east & west wings

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	108	
MATERIAL DESCRIPTION:	grey vinyl stair treads (ABATED)	
MATERIAL LOCATION:	Main Building: 1st, 2nd, 3rd floor east & west wings	
MATERIAL QUANTITY:		MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	109		
MATERIAL DESCRIPTION:	vinyl stair track mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st, 2nd, 3rd floor east & west wings

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	109				
MATERIAL DESCRIPTION:	vinyl stair track mastic (ABATED)				
MATERIAL LOCATION:	Main Building: 1st, 2nd, 3rd floor east & west wings				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	110 (F75)	
MATERIAL DESCRIPTION:	4" brown vinyl base board (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st floor corridor leading to west wing, 3rd floor NW corner

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	110 (F75)				
MATERIAL DESCRIPTION:	4" brown vinyl base board (ABATED)				
MATERIAL LOCATION:	Main Building: 1st floor corridor leading to west wing, 3rd floor NW corner				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	110 (F76)	
MATERIAL DESCRIPTION:	4" black baseboard (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st, 2nd & 3rd Floor Throughout East Wing & Corridor- East Wing 1st Floor NE Corner West Wing

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47051** BUIDLING ID: **1500**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **John Fenn**
SCHOOL NAME: **Brooks College Prep
(Southside College
Prep)** REVIEW DATE: **9/6/2019**
ADDRESS: **250 E. 111th St.** IDPH LICENSE NO: **100-04437**

HOMOGENEOUS AREA: **110 (F76)**
MATERIAL DESCRIPTION: **4" black baseboard (ABATED)**
MATERIAL LOCATION: **Main Building: 1st, 2nd & 3rd Floor Throughout East Wing & Corridor- East Wing 1st Floor NE
Corner West Wing**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	110 (F77)		
MATERIAL DESCRIPTION:	4" tan baseboard (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st, 2nd floor, NE. & NW. portion

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	110 (F77)				
MATERIAL DESCRIPTION:	4" tan baseboard (ABATED)				
MATERIAL LOCATION:	Main Building: 1st, 2nd floor, NE. & NW. portion				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	111(F75)		
MATERIAL DESCRIPTION:	4" brown vinyl base board mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st floor corridor leading to west wing, 3rd floor NW corner

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	111(F75)				
MATERIAL DESCRIPTION:	4" brown vinyl base board mastic (ABATED)				
MATERIAL LOCATION:	Main Building: 1st floor corridor leading to west wing, 3rd floor NW corner				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	111(F76)	
MATERIAL DESCRIPTION:	4" black baseboard (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st, 2nd & 3rd floor throughout

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	111(F76)				
MATERIAL DESCRIPTION:	4" black baseboard (ABATED)				
MATERIAL LOCATION:	Main Building: 1st, 2nd & 3rd floor throughout				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	111(F77)	
MATERIAL DESCRIPTION:	4" tan baseboard mastic (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st & 2nd Floor, NE. & NW. portion

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	111(F77)				
MATERIAL DESCRIPTION:	4" tan baseboard mastic (ABATED)				
MATERIAL LOCATION:	Main Building: 1st & 2nd Floor, NE. & NW. portion				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	112 (F80)		
MATERIAL DESCRIPTION:	6" black vinyl baseboard (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 2nd floor, SE corner

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	112 (F80)				
MATERIAL DESCRIPTION:	6" black vinyl baseboard (ABATED)				
MATERIAL LOCATION:	Main Building: 2nd floor, SE corner				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	113 (F80)		
MATERIAL DESCRIPTION:	6" black vinyl baseboard mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 2nd floor main bldg. SE corner

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	113 (F80)				
MATERIAL DESCRIPTION:	6" black vinyl baseboard mastic (ABATED)				
MATERIAL LOCATION:	Main Building: 2nd floor main bldg. SE corner				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	114 (CT1)	
MATERIAL DESCRIPTION:	12x12 ceiling tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st floor west wing near NW corner

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	114 (CT1)				
MATERIAL DESCRIPTION:	12x12 ceiling tile (ABATED)				
MATERIAL LOCATION:	Main Building: 1st floor west wing near NW corner				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	114 (CTM1)		
MATERIAL DESCRIPTION:	12x12 ceiling tile mastic (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 1st floor west wing near NW corner

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	114 (CTM1)				
MATERIAL DESCRIPTION:	12x12 ceiling tile mastic (ABATED)				
MATERIAL LOCATION:	Main Building: 1st floor west wing near NW corner				
MATERIAL QUANTITY:				MATERIAL UNITS:	
DAMAGE QUANTITY:				DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	116	
MATERIAL DESCRIPTION:	12x12 cork tile (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Main Building: 2nd floor west wing room NE. corner of bldg.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	116	
MATERIAL DESCRIPTION:	12x12 cork tile (ABATED)	
MATERIAL LOCATION:	Main Building: 2nd floor west wing room NE. corner of bldg.	
MATERIAL QUANTITY:		MATERIAL UNITS:
DAMAGE QUANTITY:		DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	151		
MATERIAL DESCRIPTION:	NOT OBSERVED FLOOR TILE REPLACEMENT 12X12 Grey/Dark Brown		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd, & 3rd floor hallways		
MATERIAL QUANTITY:	50000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:	Not Observed 2019		

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	151				
MATERIAL DESCRIPTION:	NOT OBSERVED FLOOR TILE REPLACEMENT 12X12 Grey/Dark Brown				
MATERIAL LOCATION:	1st, 2nd, & 3rd floor hallways				
MATERIAL QUANTITY:	50000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	152		
MATERIAL DESCRIPTION:	Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd, & 3rd floor throughout building		
MATERIAL QUANTITY:	50000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:	Not Observed 2019		

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	152				
MATERIAL DESCRIPTION:	Baseboard Mastic				
MATERIAL LOCATION:	1st, 2nd, & 3rd floor throughout building				
MATERIAL QUANTITY:	50000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	153		
MATERIAL DESCRIPTION:	2'x4' Speckled Pattern Ceiling Tile (w/ 2'x2' Sections)		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floo: West Wing - Dining Room: 4th Floor: Center Building - Room 402 and 405		
MATERIAL QUANTITY:	1350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:	Not Observed 2019		

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	153				
MATERIAL DESCRIPTION:	2'x4' Speckled Pattern Ceiling Tile (w/ 2'x2' Sections)				
MATERIAL LOCATION:	1st Floor: West Wing - Dining Room: 4th Floor: Center Building - Room 402 and 405				
MATERIAL QUANTITY:	1350	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	154		
MATERIAL DESCRIPTION:	4" Vinyl Baseboard - Grey		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor: West Wing - Dining Room; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: **08/08/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	154				
MATERIAL DESCRIPTION:	4" Vinyl Baseboard - Grey				
MATERIAL LOCATION:	1st Floor: West Wing - Dining Room; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405				
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	155		
MATERIAL DESCRIPTION:	Mastic associated with 4" Vinyl Baseboard - Grey		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor: West Wing - Dining Room; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: **08/08/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	155				
MATERIAL DESCRIPTION:	Mastic associated with 4" Vinyl Baseboard - Grey				
MATERIAL LOCATION:	1st Floor: West Wing - Dining Room; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405				
MATERIAL QUANTITY:	1100	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	156		
MATERIAL DESCRIPTION:	12"x12" White with Grey Specs Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139		
MATERIAL QUANTITY:	5350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	156				
MATERIAL DESCRIPTION:	12"x12" White with Grey Specs Floor Tile				
MATERIAL LOCATION:	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139				
MATERIAL QUANTITY:	5350	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	157		
MATERIAL DESCRIPTION:	12"x12" White with Grey Specs Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139		
MATERIAL QUANTITY:	5350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	157				
MATERIAL DESCRIPTION:	12"x12" White with Grey Specs Floor Tile Mastic				
MATERIAL LOCATION:	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139				
MATERIAL QUANTITY:	5350	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	158		
MATERIAL DESCRIPTION:	2'x2' Smooth Pattern Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139, and North/South Corridor		
MATERIAL QUANTITY:	7375	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	158				
MATERIAL DESCRIPTION:	2'x2' Smooth Pattern Ceiling Tile				
MATERIAL LOCATION:	1st Floor: East Wing - Rooms 131, 133, 135, 137, and 139, and North/South Corridor				
MATERIAL QUANTITY:	7375	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	159		
MATERIAL DESCRIPTION:	Interior Window Caulk		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor: East Wing - Room 131, 133, 135, 137, and 139; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: **08/08/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47051** BUIDLING ID: **1500**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **John Fenn**
SCHOOL NAME: **Brooks College Prep
(Southside College
Prep)** REVIEW DATE: **9/6/2019**
ADDRESS: **250 E. 111th St.** IDPH LICENSE NO: **100-04437**

HOMOGENEOUS AREA: **159**
MATERIAL DESCRIPTION: **Interior Window Caulk**
MATERIAL LOCATION: **1st Floor: East Wing - Room 131, 133, 135, 137, and 139; 4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	160		
MATERIAL DESCRIPTION:	Terrazzo Floor		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor: East Wing - North/South Corridor		
MATERIAL QUANTITY:	2025	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	160				
MATERIAL DESCRIPTION:	Terrazzo Floor				
MATERIAL LOCATION:	1st Floor: East Wing - North/South Corridor				
MATERIAL QUANTITY:	2025	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	161		
MATERIAL DESCRIPTION:	12"x12" Grey Speckled Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405		
MATERIAL QUANTITY:	2600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	161				
MATERIAL DESCRIPTION:	12"x12" Grey Speckled Floor Tile				
MATERIAL LOCATION:	4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405				
MATERIAL QUANTITY:	2600	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	162		
MATERIAL DESCRIPTION:	12"x12" Grey Speckled Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405**

MATERIAL QUANTITY: **2600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	162				
MATERIAL DESCRIPTION:	12"x12" Grey Speckled Floor Tile Mastic				
MATERIAL LOCATION:	4th Floor: Center Building - Room 400, 400A, 400A-1, 402, 404, 404A, 404C, 404D, and 405				
MATERIAL QUANTITY:	2600	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	163		
MATERIAL DESCRIPTION:	Black Sink Undercoat		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	4th Floor: Center Building - Room 400		
MATERIAL QUANTITY:	1	MATERIAL UNITS:	EA
DAMAGE QUANTITY:	0	DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	163				
MATERIAL DESCRIPTION:	Black Sink Undercoat				
MATERIAL LOCATION:	4th Floor: Center Building - Room 400				
MATERIAL QUANTITY:	1	MATERIAL UNITS:	EA		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	EA		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	164		
MATERIAL DESCRIPTION:	Black Counter Top		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	4th Floor: Center Building - Room 400 and 400A		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	164				
MATERIAL DESCRIPTION:	Black Counter Top				
MATERIAL LOCATION:	4th Floor: Center Building - Room 400 and 400A				
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/06/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	165		
MATERIAL DESCRIPTION:	Drywall		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	4th Floor: Center Building - Room 400, 400A, and 404		
MATERIAL QUANTITY:	4600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	165				
MATERIAL DESCRIPTION:	Drywall				
MATERIAL LOCATION:	4th Floor: Center Building - Room 400, 400A, and 404				
MATERIAL QUANTITY:	4600	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	166		
MATERIAL DESCRIPTION:	Drywall Joint Compound		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	4th Floor: Center Building - Room 400, 400A, and 404		
MATERIAL QUANTITY:	4600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	166				
MATERIAL DESCRIPTION:	Drywall Joint Compound				
MATERIAL LOCATION:	4th Floor: Center Building - Room 400, 400A, and 404				
MATERIAL QUANTITY:	4600	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	167		
MATERIAL DESCRIPTION:	Sheet Flooring - Brown Multi-Color Pattern		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor: West Wing - Dining Room		
MATERIAL QUANTITY:	1350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	167				
MATERIAL DESCRIPTION:	Sheet Flooring - Brown Multi-Color Pattern				
MATERIAL LOCATION:	1st Floor: West Wing - Dining Room				
MATERIAL QUANTITY:	1350	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	168		
MATERIAL DESCRIPTION:	Sheet Flooring - Brown Multi-Color Pattern Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor: West Wing - Dining Room		
MATERIAL QUANTITY:	1350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	168				
MATERIAL DESCRIPTION:	Sheet Flooring - Brown Multi-Color Pattern Mastic				
MATERIAL LOCATION:	1st Floor: West Wing - Dining Room				
MATERIAL QUANTITY:	1350	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	169		
MATERIAL DESCRIPTION:	White Sink Undercoat		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	4th Floor: Center Building - Room 404		
MATERIAL QUANTITY:	1	MATERIAL UNITS:	EA
DAMAGE QUANTITY:	0	DAMAGE UNITS:	EA
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	169				
MATERIAL DESCRIPTION:	White Sink Undercoat				
MATERIAL LOCATION:	4th Floor: Center Building - Room 404				
MATERIAL QUANTITY:	1	MATERIAL UNITS:	EA		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	EA		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	170		
MATERIAL DESCRIPTION:	Carpet Mastic - Brown		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 100 A, 100 C, 100 E, 100 F, 105, 111, 116A and 116B		
MATERIAL QUANTITY:	2200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	170				
MATERIAL DESCRIPTION:	Carpet Mastic - Brown				
MATERIAL LOCATION:	Rooms 100 A, 100 C, 100 E, 100 F, 105, 111, 116A and 116B				
MATERIAL QUANTITY:	2200	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	171		
MATERIAL DESCRIPTION:	Carpet Mastic Blue w/ white streaks		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 201, 201A, 201C and 201D		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	171				
MATERIAL DESCRIPTION:	Carpet Mastic Blue w/ white streaks				
MATERIAL LOCATION:	Rooms 201, 201A, 201C and 201D				
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	172		
MATERIAL DESCRIPTION:	Carpet Mastic Brown w/ blue and orange streaks		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 147, 153A, 153C, 153D, 153E, 153F, 153F2, 235, 237A, 237D and Library		
MATERIAL QUANTITY:	10300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	172				
MATERIAL DESCRIPTION:	Carpet Mastic Brown w/ blue and orange streaks				
MATERIAL LOCATION:	Rooms 147, 153A, 153C, 153D, 153E, 153F, 153F2, 235, 237A, 237D and Library				
MATERIAL QUANTITY:	10300	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	12 x 12 Yellow Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 106, 200-206, 208, 209, 210, 216, Library, Office, and Coach's Office		
MATERIAL QUANTITY:	12500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	21				
MATERIAL DESCRIPTION:	12 x 12 Yellow Floor Tile Mastic				
MATERIAL LOCATION:	Rooms 106, 200-206, 208, 209, 210, 216, Library, Office, and Coach's Office				
MATERIAL QUANTITY:	12500	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	Brown Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Library, Assistant Principal's, Nurse Office, Side Office, 102, 103, 111, 117, and Office Hall**

MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/08/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	22				
MATERIAL DESCRIPTION:	Brown Carpet Mastic				
MATERIAL LOCATION:	Library, Assistant Principal's, Nurse Office, Side Office, 102, 103, 111, 117, and Office Hall				
MATERIAL QUANTITY:	6000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	12 x 12 Gray Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Band Room, 4th Floor, 403, 407, Office, Bathroom, West Side, 100, 101, Attendance Office**

MATERIAL QUANTITY: **12500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/08/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	26				
MATERIAL DESCRIPTION:	12 x 12 Gray Floor Tile Mastic				
MATERIAL LOCATION:	Band Room, 4th Floor, 403, 407, Office, Bathroom, West Side, 100, 101, Attendance Office				
MATERIAL QUANTITY:	12500	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	2 x 4 Lay-in Panels NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:	Not Observed Multiple Years		

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	27				
MATERIAL DESCRIPTION:	2 x 4 Lay-in Panels NOT OBSERVED				
MATERIAL LOCATION:	Kitchen				
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	Spray-on Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gymnasium		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	Spray-on Insulation		
MATERIAL LOCATION:	Gymnasium		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	2 x 2 Lay-in Ceiling Panels		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Hallways		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	29				
MATERIAL DESCRIPTION:	2 x 2 Lay-in Ceiling Panels				
MATERIAL LOCATION:	Hallways				
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Mary Hicks		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	INSPECTION DATE:	8/8/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	Black Counter Tops		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 307 and 307A		
MATERIAL QUANTITY:	26	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 08/08/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	47051	BUILDING ID:	1500
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	John Fenn		
SCHOOL NAME:	Brooks College Prep (Southside College Prep)	REVIEW DATE:	9/6/2019		
ADDRESS:	250 E. 111th St.	IDPH LICENSE NO:	100-04437		

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	Black Counter Tops		
MATERIAL LOCATION:	Rooms 307 and 307A		
MATERIAL QUANTITY:	26	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 09/06/2019

Chicago Public Schools

TEM Environmental, Inc.

2019 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that MARY HICKS
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 03/18/2019 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903BIR08

Certificate Number:



PUBLIC HEALTH & SAFETY inc.

Environmental and Occupational Services
37 S. Ashland Ave., Chicago, IL 60607

www.public-health-safety.com

Office: 312-491-0081
Fax: 312-421-2901

N. J. Penef

Director of Training

Nicholas J. Penef

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that MARY HICKS
has completed the Asbestos Management Planner Refresher course and passed the examination
on 03/18/2019 with a minimum score of 70% or better. Training was in accordance with U.S.
E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model
Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903MPR05

Certificate Number:



PUBLIC HEALTH & SAFETY inc.

Environmental and Occupational Services
37 S. Ashland Ave., Chicago, IL 60607

www.public-health-safety.com

Office: 312-491-0081
Fax: 312-421-2901

N. Penneff

Director of Training

Nicholas J. Penneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-011

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER

100 - 04437

ISSUED

4/15/2019

EXPIRES

05/15/2020

MARY H HICKS

12823 S GREEN

CHICAGO, IL 60643

Environmental Health



ENDORSEMENTS

INSPECTOR

MANAGEMENT PLANNER

PROJECT MANAGER

AIR SAMPLING PROFESSIONAL

TC EXPIRES

3/18/2020

3/18/2020

4/27/2019

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

John Fenn

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/19/2019

Exam Date: 3/19/2019

Expiration Date: 3/19/2020

Certificate Number: BIR1903191011

Kathy DeSalvo, Director

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

John Fenn


has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/19/2019

Exam Date: 3/19/2019

Expiration Date: 3/19/2020

Certificate Number: MPR1903191035




Kathy DeSalvo, Director

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

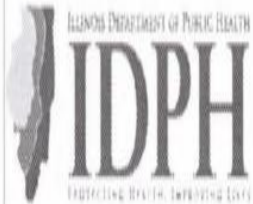

ASBESTOS PROFESSIONAL LICENSE

ENDORSEMENTS

TC EXPIRES

INSPECTOR

3/19/2020

ID NUMBER

ISSUED

EXPIRES

100 - 09786

4/11/2019

05/15/2020

MANAGEMENT PLANNER

3/19/2020

PROJECT MANAGER

3/18/2020

AIR SAMPLING PROFESSIONAL

JOHN H FENN

2829 N TROY ST

CHICAGO, IL 60618

Environmental Health



Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed