

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-070Y
SCHOOL NAME: Marvin Camras Elementary School
ADDRESS OF SCHOOL: 3000 N. Mango
CITY: Chicago, IL, 60634

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **6/14/2019**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/3/2022 ENROLLMENT 782
IDPH INSPECTOR LICENSE NUMBER: 100-20525
IDPH LICENSED INSPECTOR NAME (Please Print): Kevin Hanna
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074



10/4/2022

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____
School has been closed. Date closed: _____
School building has been demolished. Date: _____
School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Marvin Camras Elementary School

3000 N. Mango
Chicago, IL, 60634

Unit: 22691
Building ID:

IDPH ID Number: 14-016-2990-070Y

REPORT DATE:

Tuesday, October 04, 2022

Prepared for:

**Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602**

Prepared by:

Specialty Consulting, Inc.

2942 W. Van Buren Street

Chicago, IL, 60612

Phone (312) 319-7575

Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

10/24/2022

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 22691 Region: 02 IDPH ID: 14-016-2990-070Y

School: Marvin Camras Elementary School Building ID:

Address: 3000 N. Mango

Chicago, IL, 60634

Building Contact: Cassaccio, Nicholas

Contact Phone: 7737094873

Current Building Owners: Chicago Public Schools

Reinspection Date: 10/3/2022

Review Date: 10/24/2022

Inspector: Kevin Hanna

Inspector IDPH License: 100-20525

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: October 04, 2022

RE: Marvin Camras Elementary School, Unit 22691
3000 N. Mango
Chicago, IL, 60634

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Marvin Camras Elementary School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Marvin Camras Elementary School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Marvin Camras Elementary School Unit: 22691 Region: 02
Address: 3000 N. Mango Chicago, IL, 60634
IDPH ID: 14-016-2990-070Y Building ID:
Contact: Cassaccio, Nicholas Phone: 7737094873

2. Description of Facility

Original Construction: 1956 Additional Construction: 1946
Total Square Footage: 26826 No of Floors: 3
Current Occupancy: 782

3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602


4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah Fax: (312) 319-7580
Address 2942 W. Van Buren Street
Phone: (312) 319-7575

5. Inspector

Inspector Name: Kevin Hanna


Inspector IDPH license # 100-20525
Reinspection Date: 10/3/2022


Signature:
Date: 10/3/2022

6. Management Planner

Management Planner Name: Jigar Shah

Management Planner IDPH license # 100-07342


Signature:
Date: 10/24/2022

7. Review Date: 10/24/2022

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 10/4/2022

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Marvin Camras Elementary School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building :

61

Paper wrap Pipe Insulation

B. The following new homogenous areas have been identified for Building :

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

02	2'x4' White Fissured Ceiling Tile
03A	1'x1' White w/ Holes Ceiling Tile Mastic
04	Dry Wall System
06	12"x12' White w/ Gray Streaks VFT
06A	12"x12' White w/ Gray Streaks VFT Mastic
07	12"x12" Yellow Streaked VFT
07A	12"x12" Yellow Streaked VFT Mastic
08	Beige Vinyl Baseboard
08A	Beige Vinyl Baseboard Mastic
10	9"x9" Orange VFT
10A	9"x9" Orange VFT Mastic
11A	12"x12" Brown VFT Mastic
12A	Dark Brown Border VFT Mastic
13	Beige Linoleum w/ Dark Waves
13A	Beige Linoleum w/ Dark Waves Mastic
14	Terrazzo Floor
15	2'x2' White w/ Pinholes Ceiling Tile
16	12"x12" White w/ Blue Specs VFT
16A	12"x12" White w/ Blue Specs VFT Mastic
18	12"x12" Red w/ White Streaks VFT
18A	12"x12" Red w/ White Streaks VFT Mastic
19	Black w/ White Border VFT
19A	Black w/ White Border VFT Mastic
21A	12"x12" Brown w/ Light & Dark Streaks VFT Mastic
22	2'x2' Gray Ceiling Tile
23	Black w/ Red Border VFT
23A	Black w/ Red Border VFT Mastic
24	Carpet Mastic
25	1'x1' White Grooved Ceiling Tile
25A	1'x1' White Grooved Ceiling Tile Mastic
27	MJP on Aircell Pipe Insulation
29	9"x9" Gray VFT
29A	9"x9" Gray VFT Mastic
30	Vibration Damper Cloth
32	Red Fire Stop Caulking
33	12"x12" White w/Gray Streaks VFT
33A	12"x12" White w/ Gray Streaks VFT Mastic
34	12"x12" Yellow Streaked VFT
34A	12"x12" Yellow Streaked VFT Mastic
35	1'x1' White w/ Holes Ceiling Tile
35A	1'x1' White w/ holes Ceiling Tile Mastic

36	Terazzo Floor
37	Dry Wall System
38	12"x12" Red w/ White Streaked VFT
39	Black w/ White Border VFT
40	1'x1' White w/ Grooves Ceiling Tile
40A	1'x1' White w/ Grooves Ceiling Tile Mastic
41	12"x12" Light Green Streaked VFT
41A	12"x12" Light Green Streaked VFT Mastic
42	12"x12" Green Streaked VFT
42A	12"x12" Green Streaked VFT Mastic
43A	MJP on Air cell Pipe Insulation
44	Paper Wrap Pipe Insulation
44A	MJP on Paperwork Pipe Insulation
47	Dry Wall System
48	1'x1' White w/ Holes Ceiling Tile
48A	1'x1' White w/ holes Ceiling Tile Mastic
49	9"x9" Orange VFT
49A	9"x9" Orange VFT Mastic
50	Terrazzo
51	Beige Vinyl Baseboard
51A	Beige Vinyl Baseboard Mastic
52	12"x12" White w/ Gray Streaks VFT
52A	12"x12" White w/ Gray Streaks VFT Mastic
53	12"x12" Yellow Streaked VFT
53A	12"x12" Yellow Streaked VFT Mastic
54	12"x12" Gray w/ Green Specks VFT
54A	12"x12" Gray w/Green Specks VFT Mastic
55	Green Vinyl Baseboard
55A	Green Vinyl Baseboard Mastic
56	2'x2' White w/ Pinhole Ceiling Tile
57	12"x12" White w/ Multicolor Streaks VFT
57A	12"x12" White w/ Multicolor Streak
60	Transite Table Tops / Counter Tops
61	Paper wrap Pipe Insulation
61A	MJP on Paperwrap Pipe Insulation
62	Vibration Damper Cloth
64	12"x12" Brown Streaked VFT
64A	12"x12' Brown Streaked VFT Mastic
65	Transite Panels
66	Transite Panels
67	Transite Panels
68	9" x 9" Tan w/ White & Brown Specs VFT
68A	9" x 9" Tan w/ White & Brown Specs VFT Mastic

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Kevin Hanna, IDPH License # 100-20525. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Marvin Camras Elementary School Building Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Marvin Camras Elementary School Unit 22691 Building ID
 Address 3000 N. Mango Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Plaster			Throughout 1938 Main Building	NO_ACBM									
02	2'x4' White Fissured Ceiling Tile	5,000	SF	Hallways 1938 Main Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
03	1'x1' White w/ Holes Ceiling Tile			Throughout 1938 Main Building	NO_ACBM	MISC								
03A	1'x1' White w/ Holes Ceiling Tile Mastic	10,000	SF	Throughout 1938 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
04	Dry Wall System	2,500	SF	Throughout 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05	12"x12" Beige & Brown VFT	5,000	SF	3rd Floor Cafeteria - 1938 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
05A	12"x12" Beige & Brown VFT Mastic	5,000	SF	3rd Floor Cafeteria - 1938 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
06	12"x12" White w/ Gray Streaks VFT	18,000	SF	Throughout 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
06A	12"x12" White w/ Gray Streaks VFT Mastic	18,000	SF	Throughout 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07	12"x12" Yellow Streaked VFT	5,000	SF	Throughout 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
07A	12"x12" Yellow Streaked VFT Mastic	5,000	SF	Throughout 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08	Beige Vinyl Baseboard	10,000	SF	Throughout 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08A	Beige Vinyl Baseboard Mastic	10,000	SF	Throughout 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09	Air Cell Panel Insulation (Univents)	600	SF	3rd Floor Cafeteria - 1938 Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
10	9"x9" Orange VFT	1,500	SF	Throughout 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
10A	9"x9" Orange VFT Mastic	1,500	SF	Throughout 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	12"x12" Brown VFT	300	SF	SW and SE Stairwells - 1938 Main Building	CHR	MISC	N	LOC	5		No	ACBM with the potential for damage	3	LOW
11A	12"x12" Brown VFT Mastic	300	SF	SW and SE Stairwells - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	Dark Brown Border VFT	600	SF	SW and SE Stairwells - 1938 Main Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12A	Dark Brown Border VFT Mastic	600	SF	SW and SE Stairwells - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Marvin Camras Elementary School Unit 22691 Building ID

Address 3000 N. Mango Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
13	Beige Linoleum w/ Dark Waves	20	SF	Room 300G - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13A	Beige Linoleum w/ Dark Waves Mastic	20	SF	Room 300G - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	Terrazzo Floor	15,000	SF	Throughout 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	2'x2' White w/ Pinholes Ceiling Tile	10,000	SF	Room 309 - 1938 Main Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
16	12"x12" White w/ Blue Specs VFT	2,000	SF	Rooms 312, 314 - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16A	12"x12" White w/ Blue Specs VFT Mastic	2,000	SF	Rooms 312, 314 - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	18"x18" White Textured Ceiling			Rooms 312, 314 & 009- 1938 Main Building	NO_ACBM									
18	12"x12" Red w/ White Streaks VFT	5,000	SF	Throughout - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18A	12"x12" Red w/ White Streaks VFT Mastic	5,000	SF	Throughout - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	Black w/ White Border VFT	300	SF	Rooms 317, 319, 217 - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19A	Black w/ White Border VFT Mastic	300	SF	Rooms 317, 319, 217 - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	12"x12" Gray w/ Dark Gray Streaks VFT	600	SF	Gym Balcony - 1938 Main Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20A	12"x12" Gray w/ Dark Gray Streaks VFT Mastic	600	SF	Gym Balcony - 1938 Main Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12"x12" Brown w/ Light & Dark Streaks VFT	100	SF	1st Floor SE and SW Stairwells - 1938 Main Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21A	12"x12" Brown w/ Light & Dark Streaks VFT Mastic	100	SF	1st Floor SE and SW Stairwells - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	2'x2' Gray Ceiling Tile	4,000	SF	Gym - 1938 Main Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
23	Black w/ Red Border VFT	500	SF	Rooms 211A, 213A, 113A, 11A - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23A	Black w/ Red Border VFT Mastic	500	SF	Rooms 211A, 213A, 113A, 11A - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	Carpet Mastic	200	SF	Rooms 114, 112,	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Marvin Camras Elementary School Unit 22691 Building ID
 Address 3000 N. Mango Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				112A, Basement Locker Room - Not Observed								potential for damage		
25	1'x1' White Grooved Ceiling Tile	800	SF	Throughout 1938 Main Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
25A	1'x1' White Grooved Ceiling Tile Mastic	800	SF	Throughout 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	Aircell Pipe Insulation	2,000	LF	Throughout 1938 Main Building	CHR	TSI	Y	NONE	0		No	ACBM with potential for significant damage		LOW
27	MJP on Aircell Pipe Insulation	138	FITTING	Throughout 1938 Main Building	ASSUMED	TSI	Y	NONE	0		No	ACBM with potential for significant damage		HIGH
28	12"x12" Green Streaked VFT	300	SF	Room 107 - 1938 Main Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28A	12"x12" Green Streaked VFT Mastic	300	SF	Room 007 - 1938 Main Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	9"x9" Gray VFT	200	SF	Mechanical Room 017, Room 200B Men's Bathroom at SW Landing - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29A	9"x9" Gray VFT Mastic	200	SF	Mechanical Room 017, Room 200B Men's Bathroom at SW Landing - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	Vibration Damper Cloth	10	SF	Mechanical Room 017 - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	Tank Insulation	120	SF	Mechanical Room 017- 1938 Main Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
32	Red Fire Stop Caulking	10	SF	Mechanical Room 017- 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	12"x12" White w/Gray Streaks VFT	2,700	SF	Throughout 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33A	12"x12" White w/ Gray Streaks VFT Mastic	2,700	SF	Throughout 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12"x12" Yellow Streaked VFT	3,500	SF	Throughout 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34A	12"x12" Yellow Streaked VFT Mastic	3,500	SF	Throughout 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	1'x1' White w/ Holes Ceiling Tile	4,000	SF	Throughout 1956 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Marvin Camras Elementary School Unit 22691 Building ID

Address 3000 N. Mango Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
35A	1'x1' White w/ holes Ceiling Tile Mastic	4,000	SF	Throughout 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	Terazzo Floor	4,000	SF	Throughout 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	Dry Wall System	2,000	SF	Throughout 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12"x12" Red w/ White Streaked VFT	2,800	SF	Rooms 318D, 218C, 218E, 218F - 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38A	12"x12" Red w/ White Streaks VFT Mastic	2,800	SF	Rooms 318D, 218C, 218E, 218F - 1956 Addition	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	Black w/ White Border VFT	100	SF	Room 318D - 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39A	Black w/ White Border VFT Mastic	100	SF	Rooms 318D - 1956 Addition	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	1'x1' White w/ Grooves Ceiling Tile	2,500	SF	Library 120 - 1956 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
40A	1'x1' White w/ Grooves Ceiling Tile Mastic	2,500	SF	Library 120 - 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	12"x12" Light Green Streaked VFT	900	SF	Room 20 - 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41A	12"x12" Light Green Streaked VFT Mastic	900	SF	Room 20 - 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12"x12" Green Streaked VFT	900	SF	Room 20 - 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42A	12"x12" Green Streaked VFT Mastic	900	SF	Room 20 - 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	Air Cell Pipe Insulation	200	LF	Room 20 - 1956 Addition	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
43A	MJP on Air cell Pipe Insulation	30	FITTING	Room 20 - 1956 Addition	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
44	Paper Wrap Pipe Insulation	400	LF	Room 20 - 1956 Addition	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
44A	MJP on Paperwork Pipe Insulation	70	FITTING	Room 20 - 1956 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
46	Plaster			Throughout 1956 Addition	NO_ACBM									
47	Dry Wall System	2,500	SF	Throughout 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	1'x1' White w/ Holes Ceiling Tile	15,000	SF	Throughout 1962 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
48A	1'x1' White w/ holes Ceiling Tile Mastic	15,000	SF	Throughout 1962 Addition	ASSUMED	MISC	N	LOC	16		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Marvin Camras Elementary School Unit 22691 Building ID
Address 3000 N. Mango Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
49	9"x9" Orange VFT	5,600	SF	Rooms 323, 324, 325, 327, 225, 223, 224, 226 and 326 - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49A	9"x9" Orange VFT Mastic	5,600	SF	Rooms 323, 324, 325, 327, 225, 223, 224, 226 and 326 - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
50	Terrazzo	5,000	SF	Throughout 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51	Beige Vinyl Baseboard	240	LF	Throughout 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51A	Beige Vinyl Baseboard Mastic	240	LF	Throughout 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	12"x12" White w/ Gray Streaks VFT	5,500	SF	Throughout 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52A	12"x12" White w/ Gray Streaks VFT Mastic	5,500	SF	Throughout 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	12"x12" Yellow Streaked VFT	1,400	SF	Throughout 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53A	12"x12" Yellow Streaked VFT Mastic	1,400	SF	Throughout 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54	12"x12" Gray w/ Green Specks VFT	800	SF	Room 227 - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54A	12"x12" Gray w/Green Specks VFT Mastic	800	SF	Room 227 - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	Green Vinyl Baseboard	60	LF	Room 125 - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55A	Green Vinyl Baseboard Mastic	60	SF	Room 125 - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	2'x2' White w/ Pinhole Ceiling Tile	400	SF	Room 129, 023 - 1962 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
57	12"x12" White w/ Multicolor Streaks VFT	800	SF	Room 023 - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
57A	12"x12" White w/ Multicolor Streak	800	SF	Room 023 - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58	Tank Insulation			Mechanical Room 022 - 1962 Addition	ABATED	TSI								
59	MJP on Fiberglass Pip Runs	244	FITTING	Mechanical Rooms 321, 221, 121, 021 and 022 - 1962 Addition	CHR	TSI	Y	NONE	0		No	ACBM with potential for significant damage		LOW
60	Transite Table Tops / Counter Tops	30	SF	Room 211, 213 - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Marvin Camras Elementary School Unit 22691 Building ID
 Address 3000 N. Mango Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
61	Paper wrap Pipe Insulation	2,000	LF	Throughout 1938 Main Building	ASSUMED	TSI	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
61A	MJP on Paperwrap Pipe Insulation	124	FITTING	Throughout 1938 Main Building	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
62	Vibration Damper Cloth	40	SF	Mechanical Room 321 - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	Duct Insulation	200	SF	Mechanical Room 321 - 1962 Addition	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
64	12"x12" Brown Streaked VFT	500	SF	Room 000B - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
64A	12"x12" Brown Streaked VFT Mastic	500	SF	Room 000B - 1938 Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65	Transite Panels	500	SF	Inside Uni-vents Along Windows Throughout 1938 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
66	Transite Panels	100	SF	Inside Uni-vents Along Windows in Library 120 - 1956 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
67	Transite Panels	250	SF	Inside Uni-vents Along Windows - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
68	9" x 9" Tan w/ White & Brown Specs VFT	100	SF	Room 222 Janitor's Closet - 1962 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
68A	9" x 9" Tan w/ White & Brown Specs VFT Mastic	100	SF	Room 222 Janitor's Closet - 1962 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Marvin Camras Elementary School Unit 22691 Building ID
Address 3000 N. Mango Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 10/3/2022
Inspector Name Kevin Hanna
100-20525 5/15/2023
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
03	
03A	
04	
05	
05A	
06	
06A	
07	
07A	
08	
08A	
09	
10	
10A	
11	
11A	
12	
12A	
13	
13A	
14	
15	

Chicago Public Schools

School Marvin Camras Elementary School Unit 22691 Building ID

Address 3000 N. Mango Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
16	
16A	
17	
18	
18A	
19	
19A	
20	
20A	
21	
21A	
22	
23	
23A	
24	
25	
25A	
26	
27	
28	
28A	
29	
29A	
30	
31	
32	
33	
33A	
34	

Chicago Public Schools

School Marvin Camras Elementary School Unit 22691 Building ID

Address 3000 N. Mango Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
34A	
35	
35A	
36	
37	
38	
38A	
39	
39A	
40	
40A	
41	
41A	
42	
42A	
43	
43A	
44	
44A	
46	
47	
48	
48A	
49	
49A	
50	
51	
51A	
52	

Chicago Public Schools

School Marvin Camras Elementary School **Unit** 22691 **Building ID**

Address 3000 N. Mango **Region** 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
52A	
53	
53A	
54	
54A	
55	
55A	
56	
57	
57A	
58	
59	
60	
61	
61A	
62	
63	
64	
64A	
65	
66	
67	
68	
68A	

Chicago Public Schools

School Marvin Camras Elementary School **Unit** 22691 **Building ID**

Address 3000 N. Mango **Region** 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School Marvin Camras Elementary School

Unit 22691

Building ID

Address 3000 N. Mango

Chicago, IL, 60634

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Plaster			Throughout 1938 Main Building	No ACBM						
02	2'x4' White Fissured Ceiling Tile	5,000	SF	Hallways 1938 Main Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	1'x1' White w/ Holes Ceiling Tile			Throughout 1938 Main Building	No ACBM	MISC					
03A	1'x1' White w/ Holes Ceiling Tile Mastic	10,000	SF	Throughout 1938 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	Dry Wall System	2,500	SF	Throughout 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	12"x12" Beige & Brown VFT	5,000	SF	3rd Floor Cafeteria - 1938 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05A	12"x12" Beige & Brown VFT Mastic	5,000	SF	3rd Floor Cafeteria - 1938 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	12"x12" White w/ Gray Streaks VFT	18,000	SF	Throughout 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06A	12"x12" White w/ Gray Streaks VFT Mastic	18,000	SF	Throughout 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	12"x12" Yellow Streaked VFT	5,000	SF	Throughout 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07A	12"x12" Yellow Streaked VFT Mastic	5,000	SF	Throughout 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	Beige Vinyl Baseboard	10,000	SF	Throughout 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08A	Beige Vinyl Baseboard Mastic	10,000	SF	Throughout 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	Air Cell Panel Insulation (Univents)	600	SF	3rd Floor Cafeteria - 1938 Building	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	9"x9" Orange VFT	1,500	SF	Throughout 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10A	9"x9" Orange VFT Mastic	1,500	SF	Throughout 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	12"x12" Brown VFT	300	SF	SW and SE Stairwells - 1938 Main Building	Chrysotile	MISC	No	5	SF	6 ACBM with the potential for damage	Follow O&M Plan
11A	12"x12" Brown VFT Mastic	300	SF	SW and SE Stairwells - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	Dark Brown Border VFT	600	SF	SW and SE Stairwells - 1938 Main Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12A	Dark Brown Border VFT Mastic	600	SF	SW and SE Stairwells - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	Beige Linoleum w/ Dark Waves	20	SF	Room 300G - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13A	Beige Linoleum w/ Dark Waves Mastic	20	SF	Room 300G - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	Terrazzo Floor	15,000	SF	Throughout 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	2'x2' White w/ Pinholes Ceiling Tile	10,000	SF	Room 309 - 1938 Main Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	12"x12" White w/ Blue Specs VFT	2,000	SF	Rooms 312, 314 - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16A	12"x12" White w/ Blue Specs VFT Mastic	2,000	SF	Rooms 312, 314 - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	18"x18' White Textured Ceiling			Rooms 312, 314 & 009- 1938 Main Building	No ACBM						
18	12"x12" Red w/ White Streaks VFT	5,000	SF	Throughout - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18A	12"x12" Red w/ White Streaks VFT Mastic	5,000	SF	Throughout - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Marvin Camras Elementary School

Unit 22691

Building ID

Address 3000 N. Mango

Chicago, IL, 60634

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
19	Black w/ White Border VFT	300	SF	Rooms 317, 319, 217 - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19A	Black w/ White Border VFT Mastic	300	SF	Rooms 317, 319, 217 - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12"x12" Gray w/ Dark Gray Streaks VFT	600	SF	Gym Balcony - 1938 Main Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20A	12"x12" Gray w/ Dark Gray Streaks VFT Mastic	600	SF	Gym Balcony - 1938 Main Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12"x12" Brown w/ Light & Dark Streaks VFT	100	SF	1st Floor SE and SW Stairwells - 1938 Main Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21A	12"x12" Brown w/ Light & Dark Streaks VFT Mastic	100	SF	1st Floor SE and SW Stairwells - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	2'x2' Gray Ceiling Tile	4,000	SF	Gym - 1938 Main Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	Black w/ Red Border VFT	500	SF	Rooms 211A, 213A, 113A, 11A - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23A	Black w/ Red Border VFT Mastic	500	SF	Rooms 211A, 213A, 113A, 11A - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	Carpet Mastic	200	SF	Rooms 114, 112, 112A, Basement Locker Room - Not Observed	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	1'x1' White Grooved Ceiling Tile	800	SF	Throughout 1938 Main Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25A	1'x1' White Grooved Ceiling Tile Mastic	800	SF	Throughout 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	Aircell Pipe Insulation	2,000	LF	Throughout 1938 Main Building	Chrysotile	TSI	Yes	0	LF	5 ACBM with potential for significant damage	Follow O&M Plan
27	MJP on Aircell Pipe Insulation	138	FITTING	Throughout 1938 Main Building	Assumed	TSI	Yes	0	FITTING	5 ACBM with potential for significant damage	Follow O&M Plan
28	12"x12" Green Streaked VFT	300	SF	Room 107 - 1938 Main Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28A	12"x12" Green Streaked VFT Mastic	300	SF	Room 007 - 1938 Main Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	9"x9" Gray VFT	200	SF	Mechanical Room 017, Room 200B Men's Bathroom at SW Landing - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29A	9"x9" Gray VFT Mastic	200	SF	Mechanical Room 017, Room 200B Men's Bathroom at SW Landing - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	Vibration Damper Cloth	10	SF	Mechanical Room 017 - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	Tank Insulation	120	SF	Mechanical Room 017- 1938 Main Building	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Marvin Camras Elementary School

Unit 22691

Building ID

Address 3000 N. Mango

Chicago, IL, 60634

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
32	Red Fire Stop Caulking	10	SF	Mechanical Room 017- 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12"x12" White w/Gray Streaks VFT	2,700	SF	Throughout 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33A	12"x12" White w/ Gray Streaks VFT Mastic	2,700	SF	Throughout 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12"x12" Yellow Streaked VFT	3,500	SF	Throughout 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34A	12"x12" Yellow Streaked VFT Mastic	3,500	SF	Throughout 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	1'x1' White w/ Holes Ceiling Tile	4,000	SF	Throughout 1956 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35A	1'x1' White w/ holes Ceiling Tile Mastic	4,000	SF	Throughout 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	Terazzo Floor	4,000	SF	Throughout 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Dry Wall System	2,000	SF	Throughout 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12"x12" Red w/ White Streaked VFT	2,800	SF	Rooms 318D, 218C, 218E, 218F - 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38A	12"x12" Red w/ White Streaks VFT Mastic	2,800	SF	Rooms 318D, 218C, 218E, 218F - 1956 Addition	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	Black w/ White Border VFT	100	SF	Room 318D - 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39A	Black w/ White Border VFT Mastic	100	SF	Rooms 318D - 1956 Addition	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	1'x1' White w/ Grooves Ceiling Tile	2,500	SF	Library 120 - 1956 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40A	1'x1' White w/ Grooves Ceiling Tile Mastic	2,500	SF	Library 120 - 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	12"x12" Light Green Streaked VFT	900	SF	Room 20 - 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41A	12"x12" Light Green Streaked VFT Mastic	900	SF	Room 20 - 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12"x12" Green Streaked VFT	900	SF	Room 20 - 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42A	12"x12" Green Streaked VFT Mastic	900	SF	Room 20 - 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	Air Cell Pipe Insulation	200	LF	Room 20 - 1956 Addition	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
43A	MJP on Air cell Pipe Insulation	30	FITTING	Room 20 - 1956 Addition	Assumed	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
44	Paper Wrap Pipe Insulation	400	LF	Room 20 - 1956 Addition	Assumed	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
44A	MJP on Paperwork Pipe Insulation	70	FITTING	Room 20 - 1956 Addition	Assumed	MISC	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
46	Plaster			Throughout 1956 Addition	No ACBM						
47	Dry Wall System	2,500	SF	Throughout 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	1'x1' White w/ Holes Ceiling Tile	15,000	SF	Throughout 1962 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48A	1'x1' White w/ holes Ceiling Tile Mastic	15,000	SF	Throughout 1962 Addition	Assumed	MISC	No	16	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	9"x9" Orange VFT	5,600	SF	Rooms 323, 324, 325, 327, 225, 223, 224, 226 and 326 - 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49A	9"x9" Orange VFT Mastic	5,600	SF	Rooms 323, 324, 325, 327, 225, 223, 224, 226 and 326 - 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Marvin Camras Elementary School

Unit 22691

Building ID

Address 3000 N. Mango

Chicago, IL, 60634

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
50	Terrazzo	5,000	SF	Throughout 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	Beige Vinyl Baseboard	240	LF	Throughout 1962 Addition	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
51A	Beige Vinyl Baseboard Mastic	240	LF	Throughout 1962 Addition	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
52	12"x12" White w/ Gray Streaks VFT	5,500	SF	Throughout 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52A	12"x12" White w/ Gray Streaks VFT Mastic	5,500	SF	Throughout 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	12"x12" Yellow Streaked VFT	1,400	SF	Throughout 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53A	12"x12" Yellow Streaked VFT Mastic	1,400	SF	Throughout 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	12"x12" Gray w/ Green Specks VFT	800	SF	Room 227 - 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54A	12"x12" Gray w/Green Specks VFT Mastic	800	SF	Room 227 - 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	Green Vinyl Baseboard	60	LF	Room 125 - 1962 Addition	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
55A	Green Vinyl Baseboard Mastic	60	SF	Room 125 - 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	2'x2' White w/ Pinhole Ceiling Tile	400	SF	Room 129, 023 - 1962 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	12"x12" White w/ Multicolor Streaks VFT	800	SF	Room 023 - 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57A	12"x12" White w/ Multicolor Streak	800	SF	Room 023 - 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	Tank Insulation			Mechanical Room 022 - 1962 Addition	Abated	TSI					
59	MJP on Fiberglass Pip Runs	244	FITTING	Mechanical Rooms 321, 221, 121, 021 and 022 - 1962 Addition	Chrysotile	TSI	Yes	0	FITTING	5 ACBM with potential for significant damage	Follow O&M Plan
60	Transite Table Tops / Counter Tops	30	SF	Room 211, 213 - 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	Paper wrap Pipe Insulation	2,000	LF	Throughout 1938 Main Building	Assumed	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
61A	MJP on Paperwrap Pipe Insulation	124	FITTING	Throughout 1938 Main Building	Assumed	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
62	Vibration Damper Cloth	40	SF	Mechanical Room 321 - 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63	Duct Insulation	200	SF	Mechanical Room 321 - 1962 Addition	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64	12"x12" Brown Streaked VFT	500	SF	Room 000B - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64A	12"x12" Brown Streaked VFT Mastic	500	SF	Room 000B - 1938 Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
65	Transite Panels	500	SF	Inside Uni-vents Along Windows Throughout 1938 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
66	Transite Panels	100	SF	Inside Uni-vents Along Windows in Library 120 - 1956 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
67	Transite Panels	250	SF	Inside Uni-vents Along Windows - 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68	9" x 9" Tan w/ White & Brown Specs VFT	100	SF	Room 222 Janitor's Closet - 1962 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
68A	9" x 9" Tan w/ White & Brown Specs VFT Mastic	100	SF	Room 222 Janitor's Closet - 1962 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Marvin Camras Elementary School

Unit 22691

Building ID

Address 3000 N. Mango

Chicago, IL, 60634

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Review Date	10/24/2022
Manager Planner Name	Jigar Shah
100-07342	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	
03A	
04	
05	

Chicago Public Schools

School Marvin Camras Elementary School

Unit 22691

Building ID

Address 3000 N. Mango

Chicago, IL, 60634

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
05A	
06	
06A	
07	
07A	
08	
08A	
09	
10	
10A	
11	
11A	
12	
12A	
13	
13A	
14	
15	
16	
16A	
17	
18	
18A	
19	
19A	
20	

Chicago Public Schools

School Marvin Camras Elementary School

Unit 22691

Building ID

Address 3000 N. Mango

Chicago, IL, 60634

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
20A	
21	
21A	
22	
23	
23A	
24	
25	
25A	
26	
27	
28	
28A	
29	
29A	
30	
31	
32	
33	
33A	
34	
34A	
35	
35A	
36	
37	

Chicago Public Schools

School Marvin Camras Elementary School

Unit 22691

Building ID

Address 3000 N. Mango

Chicago, IL, 60634

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
38	
38A	
39	
39A	
40	
40A	
41	
41A	
42	
42A	
43	
43A	
44	
44A	
46	
47	
48	
48A	
49	
49A	
50	
51	
51A	
52	
52A	
53	

Chicago Public Schools

School Marvin Camras Elementary School

Unit 22691

Building ID

Address 3000 N. Mango

Chicago, IL, 60634

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
53A	
54	
54A	
55	
55A	
56	
57	
57A	
58	
59	
60	
61	
61A	
62	
63	
64	
64A	
65	
66	
67	
68	
68A	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout 1938 Main Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **Plaster**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: 10/24/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **2'x4' White Fissured Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Hallways 1938 Main Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **2'x4' White Fissured Ceiling Tile**
MATERIAL LOCATION: **Hallways 1938 Main Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **1'x1' White w/ Holes Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout 1938 Main Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **1'x1' White w/ Holes Ceiling Tile**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: 10/24/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03A**
MATERIAL DESCRIPTION: **1'x1' White w/ Holes Ceiling Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1938 Building**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **03A**
MATERIAL DESCRIPTION: **1'x1' White w/ Holes Ceiling Tile Mastic**
MATERIAL LOCATION: **Throughout 1938 Building**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **Dry Wall System**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **Dry Wall System**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **12"x12" Beige & Brown VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **3rd Floor Cafeteria - 1938 Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **12"x12" Beige & Brown VFT**
MATERIAL LOCATION: **3rd Floor Cafeteria - 1938 Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05A**
MATERIAL DESCRIPTION: **12"x12" Beige & Brown VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **3rd Floor Cafeteria - 1938 Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **05A**
MATERIAL DESCRIPTION: **12"x12" Beige & Brown VFT Mastic**
MATERIAL LOCATION: **3rd Floor Cafeteria - 1938 Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **12"x12' White w/ Gray Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **18000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **12"x12' White w/ Gray Streaks VFT**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **18000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06A**
MATERIAL DESCRIPTION: **12"x12' White w/ Gray Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **18000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **06A**
MATERIAL DESCRIPTION: **12"x12' White w/ Gray Streaks VFT Mastic**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **18000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07A**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **07A**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT Mastic**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **Beige Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **Beige Vinyl Baseboard**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08A**
MATERIAL DESCRIPTION: **Beige Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **08A**
MATERIAL DESCRIPTION: **Beige Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **Air Cell Panel Insulation (Univents)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Cafeteria - 1938 Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **Air Cell Panel Insulation (Univents)**
MATERIAL LOCATION: **3rd Floor Cafeteria - 1938 Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

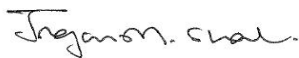

Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **9"x9" Orange VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable misc. ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout 1938 Main Building**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **9"x9" Orange VFT**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10A**
MATERIAL DESCRIPTION: **9"x9" Orange VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable misc. ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout 1938 Main Building**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **10A**
MATERIAL DESCRIPTION: **9"x9" Orange VFT Mastic**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12"x12" Brown VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **SW and SE Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12"x12" Brown VFT**
MATERIAL LOCATION: **SW and SE Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **5** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11A**
MATERIAL DESCRIPTION: **12"x12" Brown VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **SW and SE Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **11A**
MATERIAL DESCRIPTION: **12"x12" Brown VFT Mastic**
MATERIAL LOCATION: **SW and SE Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Dark Brown Border VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **SW and SE Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Dark Brown Border VFT**
MATERIAL LOCATION: **SW and SE Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12A**
MATERIAL DESCRIPTION: **Dark Brown Border VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **SW and SE Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **12A**
MATERIAL DESCRIPTION: **Dark Brown Border VFT Mastic**
MATERIAL LOCATION: **SW and SE Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Beige Linoleum w/ Dark Waves**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 300G - 1938 Main Building**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Beige Linoleum w/ Dark Waves**
MATERIAL LOCATION: **Room 300G - 1938 Main Building**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13A**
MATERIAL DESCRIPTION: **Beige Linoleum w/ Dark Waves Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 300G - 1938 Main Building**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **13A**
MATERIAL DESCRIPTION: **Beige Linoleum w/ Dark Waves Mastic**
MATERIAL LOCATION: **Room 300G - 1938 Main Building**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 10/24/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Terrazzo Floor**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Terrazzo Floor**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **2'x2' White w/ Pinholes Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 309 - 1938 Main Building**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **2'x2' White w/ Pinholes Ceiling Tile**
MATERIAL LOCATION: **Room 309 - 1938 Main Building**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" White w/ Blue Specs VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 312, 314 - 1938 Main Building**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" White w/ Blue Specs VFT**
MATERIAL LOCATION: **Rooms 312, 314 - 1938 Main Building**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **12"x12" White w/ Blue Specs VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 312, 314 - 1938 Main Building**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **12"x12" White w/ Blue Specs VFT Mastic**
MATERIAL LOCATION: **Rooms 312, 314 - 1938 Main Building**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **18"x18' White Textured Ceiling**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 312, 314 & 009- 1938 Main Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **18"x18' White Textured Ceiling**
MATERIAL LOCATION: **Rooms 312, 314 & 009- 1938 Main Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 10/24/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"x12" Red w/ White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1938 Main Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"x12" Red w/ White Streaks VFT**
MATERIAL LOCATION: **Throughout - 1938 Main Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18A**
MATERIAL DESCRIPTION: **12"x12" Red w/ White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1938 Main Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **18A**
MATERIAL DESCRIPTION: **12"x12" Red w/ White Streaks VFT Mastic**
MATERIAL LOCATION: **Throughout - 1938 Main Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Black w/ White Border VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 317, 319, 217 - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Black w/ White Border VFT**
MATERIAL LOCATION: **Rooms 317, 319, 217 - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19A**
MATERIAL DESCRIPTION: **Black w/ White Border VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 317, 319, 217 - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **19A**
MATERIAL DESCRIPTION: **Black w/ White Border VFT Mastic**
MATERIAL LOCATION: **Rooms 317, 319, 217 - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Dark Gray Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Gym Balcony - 1938 Main Building**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Dark Gray Streaks VFT**
MATERIAL LOCATION: **Gym Balcony - 1938 Main Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20A**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Dark Gray Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym Balcony - 1938 Main Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **20A**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Dark Gray Streaks VFT Mastic**
MATERIAL LOCATION: **Gym Balcony - 1938 Main Building**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Light & Dark Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor SE and SW Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Light & Dark Streaks VFT**
MATERIAL LOCATION: **1st Floor SE and SW Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21A**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Light & Dark Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor SE and SW Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **21A**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Light & Dark Streaks VFT Mastic**
MATERIAL LOCATION: **1st Floor SE and SW Stairwells - 1938 Main Building**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **2'x2' Gray Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym - 1938 Main Building**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **2'x2' Gray Ceiling Tile**
MATERIAL LOCATION: **Gym - 1938 Main Building**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Black w/ Red Border VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 211A, 213A, 113A, 11A - 1938 Main Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Black w/ Red Border VFT**
MATERIAL LOCATION: **Rooms 211A, 213A, 113A, 11A - 1938 Main Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23A**
MATERIAL DESCRIPTION: **Black w/ Red Border VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 211A, 213A, 113A, 11A - 1938 Main Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **23A**
MATERIAL DESCRIPTION: **Black w/ Red Border VFT Mastic**
MATERIAL LOCATION: **Rooms 211A, 213A, 113A, 11A - 1938 Main Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 114, 112, 112A, Basement Locker Room - Not Observed**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Rooms 114, 112, 112A, Basement Locker Room - Not Observed**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **1'x1' White Grooved Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **1'x1' White Grooved Ceiling Tile**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25A**
MATERIAL DESCRIPTION: **1'x1' White Grooved Ceiling Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **25A**
MATERIAL DESCRIPTION: **1'x1' White Grooved Ceiling Tile Mastic**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **5 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Deterioration
Delamination**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout 1938 Main Building**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **MJP on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **5 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination
Deterioration**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **138** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **MJP on Aircell Pipe Insulation**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **138** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12"x12" Green Streaked VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 107 - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12"x12" Green Streaked VFT**
MATERIAL LOCATION: **Room 107 - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28A**
MATERIAL DESCRIPTION: **12"x12" Green Streaked VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 007 - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **28A**
MATERIAL DESCRIPTION: **12"x12" Green Streaked VFT Mastic**
MATERIAL LOCATION: **Room 007 - 1938 Main Building**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **9"x9" Gray VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Mechanical Room 017, Room 200B Men's Bathroom at SW Landing - 1938 Main Building**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **9"x9" Gray VFT**
MATERIAL LOCATION: **Mechanical Room 017, Room 200B Men's Bathroom at SW Landing - 1938 Main Building**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 10/24/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29A**
MATERIAL DESCRIPTION: **9"x9" Gray VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Mechanical Room 017, Room 200B Men's Bathroom at SW Landing - 1938 Main Building**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **29A**
MATERIAL DESCRIPTION: **9"x9" Gray VFT Mastic**
MATERIAL LOCATION: **Mechanical Room 017, Room 200B Men's Bathroom at SW Landing - 1938 Main Building**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 10/24/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Vibration Damper Cloth**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Mechanical Room 017 - 1938 Main Building**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Vibration Damper Cloth**
MATERIAL LOCATION: **Mechanical Room 017 - 1938 Main Building**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Mechanical Room 017- 1938 Main Building**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Tank Insulation**
MATERIAL LOCATION: **Mechanical Room 017- 1938 Main Building**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Red Fire Stop Caulking**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Mechanical Room 017- 1938 Main Building**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Red Fire Stop Caulking**
MATERIAL LOCATION: **Mechanical Room 017- 1938 Main Building**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

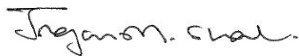

Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12"x12" White w/Gray Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12"x12" White w/Gray Streaks VFT**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33A**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **33A**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT Mastic**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34A**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **34A**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT Mastic**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **1'x1' White w/ Holes Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **1'x1' White w/ Holes Ceiling Tile**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35A**
MATERIAL DESCRIPTION: **1'x1' White w/ holes Ceiling Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **35A**
MATERIAL DESCRIPTION: **1'x1' White w/ holes Ceiling Tile Mastic**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Terazzo Floor**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Terazzo Floor**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Dry Wall System**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Dry Wall System**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **12"x12" Red w/ White Streaked VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 318D, 218C, 218E, 218F - 1956 Addition**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **12"x12" Red w/ White Streaked VFT**
MATERIAL LOCATION: **Rooms 318D, 218C, 218E, 218F - 1956 Addition**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38A**
MATERIAL DESCRIPTION: **12"x12" Red w/ White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 318D, 218C, 218E, 218F - 1956 Addition**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **38A**
MATERIAL DESCRIPTION: **12"x12" Red w/ White Streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 318D, 218C, 218E, 218F - 1956 Addition**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Black w/ White Border VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 318D - 1956 Addition**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Black w/ White Border VFT**
MATERIAL LOCATION: **Room 318D - 1956 Addition**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39A**
MATERIAL DESCRIPTION: **Black w/ White Border VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 318D - 1956 Addition**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **39A**
MATERIAL DESCRIPTION: **Black w/ White Border VFT Mastic**
MATERIAL LOCATION: **Rooms 318D - 1956 Addition**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **1'x1' White w/ Grooves Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library 120 - 1956 Addition**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **1'x1' White w/ Grooves Ceiling Tile**
MATERIAL LOCATION: **Library 120 - 1956 Addition**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40A**
MATERIAL DESCRIPTION: **1'x1' White w/ Grooves Ceiling Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library 120 - 1956 Addition**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **40A**
MATERIAL DESCRIPTION: **1'x1' White w/ Grooves Ceiling Tile Mastic**
MATERIAL LOCATION: **Library 120 - 1956 Addition**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12"x12" Light Green Streaked VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12"x12" Light Green Streaked VFT**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41A**
MATERIAL DESCRIPTION: **12"x12" Light Green Streaked VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **41A**
MATERIAL DESCRIPTION: **12"x12" Light Green Streaked VFT Mastic**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12"x12" Green Streaked VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12"x12" Green Streaked VFT**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42A**
MATERIAL DESCRIPTION: **12"x12" Green Streaked VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **42A**
MATERIAL DESCRIPTION: **12"x12" Green Streaked VFT Mastic**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Air Cell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination
Deterioration
Physical Damage**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 20 - 1956 Addition**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Air Cell Pipe Insulation**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43A**
MATERIAL DESCRIPTION: **MJP on Air cell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **43A**
MATERIAL DESCRIPTION: **MJP on Air cell Pipe Insulation**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Paper Wrap Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Paper Wrap Pipe Insulation**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44A**
MATERIAL DESCRIPTION: **MJP on Paperwork Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **44A**
MATERIAL DESCRIPTION: **MJP on Paperwork Pipe Insulation**
MATERIAL LOCATION: **Room 20 - 1956 Addition**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout 1956 Addition**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **Plaster**
MATERIAL LOCATION: **Throughout 1956 Addition**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: 10/24/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **Dry Wall System**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **Dry Wall System**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **1'x1' White w/ Holes Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable misc. ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Remove**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **1'x1' White w/ Holes Ceiling Tile**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48A**
MATERIAL DESCRIPTION: **1'x1' White w/ holes Ceiling Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **48A**
MATERIAL DESCRIPTION: **1'x1' White w/ holes Ceiling Tile Mastic**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **16** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **9"x9" Orange VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 323, 324, 325, 327, 225, 223, 224, 226 and 326 - 1962 Addition**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **9"x9" Orange VFT**
MATERIAL LOCATION: **Rooms 323, 324, 325, 327, 225, 223, 224, 226 and 326 - 1962 Addition**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49A**
MATERIAL DESCRIPTION: **9"x9" Orange VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 323, 324, 325, 327, 225, 223, 224, 226 and 326 - 1962 Addition**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **49A**
MATERIAL DESCRIPTION: **9"x9" Orange VFT Mastic**
MATERIAL LOCATION: **Rooms 323, 324, 325, 327, 225, 223, 224, 226 and 326 - 1962 Addition**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **Terrazzo**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

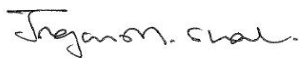

Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Beige Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Beige Vinyl Baseboard**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51A**
MATERIAL DESCRIPTION: **Beige Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **51A**
MATERIAL DESCRIPTION: **Beige Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52A**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **52A**
MATERIAL DESCRIPTION: **12"x12" White w/ Gray Streaks VFT Mastic**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53A**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **53A**
MATERIAL DESCRIPTION: **12"x12" Yellow Streaked VFT Mastic**
MATERIAL LOCATION: **Throughout 1962 Addition**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Green Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 227 - 1962 Addition**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Green Specks VFT**
MATERIAL LOCATION: **Room 227 - 1962 Addition**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54A**
MATERIAL DESCRIPTION: **12"x12" Gray w/Green Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 227 - 1962 Addition**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **54A**
MATERIAL DESCRIPTION: **12"x12" Gray w/Green Specks VFT Mastic**
MATERIAL LOCATION: **Room 227 - 1962 Addition**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **Green Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 125 - 1962 Addition**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **Green Vinyl Baseboard**
MATERIAL LOCATION: **Room 125 - 1962 Addition**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55A**
MATERIAL DESCRIPTION: **Green Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 125 - 1962 Addition**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **55A**
MATERIAL DESCRIPTION: **Green Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Room 125 - 1962 Addition**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **2'x2' White w/ Pinhole Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 129, 023 - 1962 Addition**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **2'x2' White w/ Pinhole Ceiling Tile**
MATERIAL LOCATION: **Room 129, 023 - 1962 Addition**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **12"x12" White w/ Multicolor Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 023 - 1962 Addition**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **12"x12" White w/ Multicolor Streaks VFT**
MATERIAL LOCATION: **Room 023 - 1962 Addition**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57A**
MATERIAL DESCRIPTION: **12"x12" White w/ Multicolor Streak**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 023 - 1962 Addition**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **57A**
MATERIAL DESCRIPTION: **12"x12" White w/ Multicolor Streak**
MATERIAL LOCATION: **Room 023 - 1962 Addition**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Mechanical Room 022 - 1962 Addition**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **Tank Insulation**
MATERIAL LOCATION: **Mechanical Room 022 - 1962 Addition**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: 10/24/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **MJP on Fiberglass Pip Runs**
HISTORICAL AHERA DAMAGE CATEGORY **5 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Mechanical Rooms 321, 221, 121, 021 and 022 - 1962 Addition**

MATERIAL QUANTITY: **244** MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **MJP on Fiberglass Pip Runs**
MATERIAL LOCATION: **Mechanical Rooms 321, 221, 121, 021 and 022 - 1962 Addition**
MATERIAL QUANTITY: **244** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **Transite Table Tops / Counter Tops**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 211, 213 - 1962 Addition**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **Transite Table Tops / Counter Tops**
MATERIAL LOCATION: **Room 211, 213 - 1962 Addition**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **Paper wrap Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination
Deterioration
Physical Damage**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout 1938 Main Building**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **Paper wrap Pipe Insulation**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61A**
MATERIAL DESCRIPTION: **MJP on Paperwrap Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **124** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **61A**
MATERIAL DESCRIPTION: **MJP on Paperwrap Pipe Insulation**
MATERIAL LOCATION: **Throughout 1938 Main Building**
MATERIAL QUANTITY: **124** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Vibration Damper Cloth**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Mechanical Room 321 - 1962 Addition**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Vibration Damper Cloth**
MATERIAL LOCATION: **Mechanical Room 321 - 1962 Addition**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **Duct Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Mechanical Room 321 - 1962 Addition**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **Duct Insulation**
MATERIAL LOCATION: **Mechanical Room 321 - 1962 Addition**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **12"x12" Brown Streaked VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 000B - 1938 Main Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **12"x12" Brown Streaked VFT**
MATERIAL LOCATION: **Room 000B - 1938 Main Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64A**
MATERIAL DESCRIPTION: **12"x12' Brown Streaked VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 000B - 1938 Main Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **64A**
MATERIAL DESCRIPTION: **12"x12' Brown Streaked VFT Mastic**
MATERIAL LOCATION: **Room 000B - 1938 Main Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **Transite Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Inside Uni-vents Along Windows Throughout 1938 Bldg.**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **Transite Panels**
MATERIAL LOCATION: **Inside Uni-vents Along Windows Throughout 1938 Bldg.**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **Transite Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Inside Uni-vents Along Windows in Library 120 - 1956 Addition**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **Transite Panels**
MATERIAL LOCATION: **Inside Uni-vents Along Windows in Library 120 - 1956 Addition**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **Transite Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Inside Uni-vents Along Windows - 1962 Addition**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **Transite Panels**
MATERIAL LOCATION: **Inside Uni-vents Along Windows - 1962 Addition**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **9" x 9" Tan w/ White & Brown Specs VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 222 Janitor's Closet - 1962 Addition**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: **10/03/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUILDING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **9" x 9" Tan w/ White & Brown Specs VFT**
MATERIAL LOCATION: **Room 222 Janitor's Closet - 1962 Addition**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Kevin Hanna**
SCHOOL NAME: **Marvin Camras Elementary School** INSPECTION DATE: **10/3/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68A**
MATERIAL DESCRIPTION: **9" x 9" Tan w/ White & Brown Specs VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 222 Janitor's Closet - 1962 Bldg.**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Date: 10/03/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22691** BUIDLING ID:
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Marvin Camras
Elementary School** REVIEW DATE: **10/24/2022**
ADDRESS: **3000 N. Mango** IDPH LICENSE NO: **100-20525**

HOMOGENEOUS AREA: **68A**
MATERIAL DESCRIPTION: **9" x 9" Tan w/ White & Brown Specs VFT Mastic**
MATERIAL LOCATION: **Room 222 Janitor's Closet - 1962 Bldg.**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/24/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that KEVIN HANNA
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 01/15/2022 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA-II, Authorized by both AHERA & ASHARA.

01/15/2022
Course Dates:

01/15/2023
Expires:

2201BIR10
Certificate Number:



37 S Ashland Ave, Chicago, IL 60607 • www.public-health-safety.com

A handwritten signature in blue ink, appearing to read "N. Peneff", is written over a light-colored rectangular background.

Director of Training
Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 20525

ISSUED
4/14/2022

EXPIRES
05/15/2023


KEVIN HANNA
7809 KOLMAR AVE
SKOKIE, IL 60076

Environmental Health



7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2023

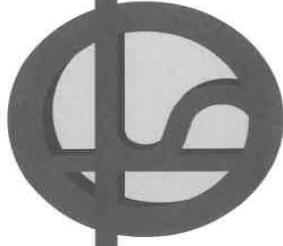

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023

Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 07342

ISSUED
4/1/2022

EXPIRES
05/15/2023

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612



Environmental Health

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 <p>ASBESTOS PROFESSIONAL LICENSE</p>			<p>ENDORSEMENTS</p>		<p>TC EXPIRES</p>
<p>ID NUMBER 100 - 07342</p>	<p>ISSUED 4/1/2022</p>	<p>EXPIRES 05/15/2023</p>	<p>INSPECTOR</p>	<p>3/9/2023</p>	
<p>JIGAR M SHAH 2942 W VAN BUREN ST CHICAGO, IL 60612</p> <p>Environmental Health</p> 			<p>PROJECT DESIGNER</p>	<p>3/24/2023</p>	
			<p>MANAGEMENT PLANNER</p>	<p>3/9/2023</p>	
			<p>PROJECT MANAGER</p>	<p>3/2/2023</p>	
			<p>AIR SAMPLING PROFESSIONAL</p>		
			<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>		

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed