

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2220
SCHOOL NAME: Goethe School
ADDRESS OF SCHOOL: 2236 N. Rockwell Avenue
CITY: Chicago, IL, 60647

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **10/15/2019**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 8/18/2022 ENROLLMENT 707
IDPH INSPECTOR LICENSE NUMBER: 100-11093
IDPH LICENSED INSPECTOR NAME (Please Print): David Avila
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074



9/5/2022

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____
School has been closed. Date closed: _____
School building has been demolished. Date: _____
School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Goethe School

2236 N. Rockwell Avenue
Chicago, IL, 60647

Unit: 23341
Building ID: 3560

IDPH ID Number: 14-016-2990-2220

REPORT DATE:

Monday, September 05, 2022

Prepared for:

Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:

Specialty Consulting, Inc.

2942 W. Van Buren Street

Chicago, IL, 60612

Phone (312) 319-7575

Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

09/05/2022

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 23341 Region: 02 IDPH ID: 14-016-2990-2220

School: Goethe School Building ID: 3560

Address: 2236 N. Rockwell Avenue

Chicago, IL, 60647

Building Contact: Zecevich, Dejan

Contact Phone: 7734567579

Current Building Owners: Chicago Public Schools

Reinspection Date: 8/18/2022

Review Date: 09/05/2022

Inspector: David Avila

Inspector IDPH License: 100-11093

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: September 05, 2022

RE: Goethe School, Unit 23341
2236 N. Rockwell Avenue
Chicago, IL, 60647

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Goethe School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Goethe School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Goethe School Unit: 23341 Region: 02
Address: 2236 N. Rockwell Avenue Chicago, IL, 60647
IDPH ID: 14-016-2990-2220 Building ID: 3560
Contact: Zecevich, Dejan Phone: 7734567579

2. Description of Facility

Original Construction: 1895 Additional Construction: 1988
Total Square Footage: 57508 No of Floors: 3
Current Occupancy: 707

3. LEA Designated Person

Contact: Richard J. Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602


4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575 Fax: (312) 319-7580

5. Inspector

Inspector Name: David Avila


Inspector IDPH license # 100-11093
Reinspection Date: 8/18/2022

Signature: 
Date: 8/18/2022

6. Management Planner

Management Planner Name: Jigar Shah

Management Planner IDPH license # 100-07342

Signature: 
Date: 09/05/2022

7. Review Date: 09/05/2022

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 9/5/2022

Name: Richard J. Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Goethe School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3560:

08	MJP E/F/V on Aircell Pipe Insulation
09	Cardboard Pipe Insulation
10	MJP E/F/V on Cardboard Pipe Insulation
12	Aircell Duct Insulation
19	12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)
20	12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)
21	12" x 12" Brown w/ Wht. & Black Specks VFT (NOT OBSERVED)
33	Drywall

37

12x12 White w/ tan specks floor tile

B. The following new homogenous areas have been identified for Building 3560:

47 & 48	12 x 12 Off White VFT & Mastic
49 & 50	12 x 12 Dark Gray VFT & Mastic
HA 45 & 46	12 x 12 Light Peach VFT & Mastic

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01	Hard Coat Plaster
02	2'x4' Ceiling Tile
04	12"x12" Beige w/ Brown Spots VFT
05	12"x12" White VFT
06	12"x12" Brown w/ White Spots VFT
19	12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)
20	12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)
21	12" x 12" Brown w/ Wht. & Black Specks VFT (NOT OBSERVED)
27	1' x 1' White w/ Grooves Ceiling Tile
28	1' x 1' White w/ Grooves Ceiling Tile Mastic
29	1' x 1' White w/ Dots and Grooves Ceiling Tile
30	1' x 1' White w/ Dots & Grooves CIng. Tile Mastic
31	Vinyl Baseboard
32	Vinyl Baseboard Mastic
33	Drywall
34	Drywall Joint Compound
37	12x12 White w/ tan specks floor tile
37M	12x12 White w/ tan specs VFT Mastic
38	12x12 Green with Gray + Dark Green specs VFT
38M	12x12 Green w/ gray + Dark green specs VFT Mastic
39	White Spray-On Under sink coating
40	1x1 White Ceiling Tile
41	1x1 White Ceiling Tile Matic
42	Tank Insulation
43	Under sink coating
44	Under sink coating
47 & 48	12 x 12 Off White VFT & Mastic
49 & 50	12 x 12 Dark Gray VFT & Mastic
HA 45 & 46	12 x 12 Light Peach VFT & Mastic

The following areas were deemed to be inaccessible:

40	1x1 White Ceiling Tile
41	1x1 White Ceiling Tile Matic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by David Avila, IDPH License # 100-11093. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates: 3/16/2020
 7/9/2020

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Goethe School Building 3560 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Goethe School Unit 23341 Building ID 3560

Address 2236 N. Rockwell Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Hard Coat Plaster	60,000	SF	Throughout - 1885 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
02	2'x4' Ceiling Tile	500	SF	Room 106 - 1885 Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
03	12" x 12" beige specks floor tile	16,700	SF	Rooms 205, 206, 207, 208, 203, 202, 201, 210, 2nd floor teachers lunchroom, 308, 307, 306, 305, 301, 108, 106, 105, 102, and 101 Throughout - 1885 Building	CHR	MISC	N	NONE	30		No	Damaged or significantly damaged friable misc. ACBM	3	MODERATE
04	12"x12" Beige w/ Brown Spots VFT	2,500	SF	Rooms 106 & 206 - 1st , 2nd floor corridors. 1885 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
05	12"x12" White VFT	1,500	SF	First and Second Floor Hallways, Lunchroom Managers office, Kitchen, Room 001-1885 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
06	12"x12" Brown w/ White Spots VFT	1,500	SF	First and Second Floor Hallways, Lunchroom Managers office, Kitchen - 1885 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
07	Air Cell Pipe Insulation	180	LF	Rooms 001, 002, 003, 004, Boiler Room, Coal Room-1885 Building	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		MODERATE
08	MJP E/F/V on Aircell Pipe Insulation	35	LF	Rooms 001, 002, 003, 004, Boiler Room, Coal Room, Basement corridor's-1885 Building	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
09	Cardboard Pipe Insulation	320	LF	Storage room 004, 2nd floor boys washroom, room 003, basement boy washroom, pump room storage room next to room 001	CHR	TSI	Y	NONE			Yes	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Goethe School Unit 23341 Building ID 3560

Address 2236 N. Rockwell Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
10	MJP E/F/V on Cardboard Pipe Insulation	2	LF	Basement Boys washroom, pump room	CHR	TSI	Y	NONE			Yes	ACBM with the potential for damage		LOW
11	MJP E/F/V on Fiberglass Pipe Insulation	124	LF	Fan Room #1, Hallway in front of room 003	CHR	TSI	Y	NONE			No	ACBM with the potential for damage		MODERATE
12	Aircell Duct Insulation	480	SF	Basement Corridor-1885 Building	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM	2	LOW
13	12"x12" Brown VFT Mastic	18,450	SF	Throughout - 1885 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	12"x12" Beige w/ Brown Spots VFT Mastic	1,350	SF	Rooms 106 & 206-1885 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	12"x12" White VFT Mastic	2,500	SF	First and Second Floor Hallways, Lunchroom, Managers office, Kitchen, RM 001 - 1885 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	12" x12" Brown w/ White Spots VFT Mastic	2,500	SF	First and Second Floor Corridors, Lunchroom Managers office, Kitchen, - 1885 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	9" x 9" Brown w/ Streaks VFT	180	SF	Room 308 Wardrobe- 1885 Building (Possibly under flooring)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
18	9" x 9" Brown w/ Streaks VFT Mastic	180	SF	Room 308 Wardrobe- 1885 Building (Possibly under flooring)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)	0		Room # 500 through # 503 - 1987 Annex	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
20	12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)	0		Room # 500 through # 503 - 1987 Annex	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
21	12" x 12" Brown w/ Wht. & Black Specks VFT(NOT OBSERVED)	0		Throughout - 1987 Annex	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
22	12" x 12" Brown w/ Wht. & Black Specks VFT Mastic (ABATED)			Throughout (See Hatching Maps) - 1987 Annex	ABATED	MISC					No			
23	12" x 12" Beige w/ Brown Specks VFT (ABATED)			Room 400, AP Room - 1987 Annex	ABATED	MISC					No			

Chicago Public Schools

School Goethe School Unit 23341 Building ID 3560

Address 2236 N. Rockwell Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
24	12" x 12" Beige w/ Brown Specks VFT Mastic (ABATED)			Room 400, AP Room - 1987 Annex	ABATED	MISC					No			
25	12" x 12" White w/ Blue Specks VFT (NOT OBSERVED)			Room # 401 - 1987 Annex							No			
26	12" x 12" White w/ Blue Specks VFT Mastic (NOT OBSERVED)			Room # 401 - 1987 Annex							No			
27	1' x 1' White w/ Grooves Ceiling Tile	20,000	SF	Throughout - 1987 Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
28	1' x 1' White w/ Grooves Ceiling Tile Mastic	20,000	SF	Throughout - 1987 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	1' x 1' White w/ Dots and Grooves Ceiling Tile	1,200	SF	Room 400 - 1987 Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
30	1' x 1' White w/ Dots & Grooves Cing. Tile Mastic	1,200	SF	Room 400 - 1987 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	Vinyl Baseboard	3,500	LF	Throughout - 1987 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	Vinyl Baseboard Mastic	3,500	LF	Throughout - 1987 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	Drywall	50,000	SF	Room 400	ASSUMED	MISC	N	NONE			Yes	ACBM with potential for significant damage		MODERATE
34	Drywall Joint Compound	5,000	LF	Throughout - 1987 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)			Lunchroom--REMOVED	ABATED	MISC								Low
36	12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)			Lunchroom--REMOVED	ABATED	MISC		None						Low
37	12x12 White w/ tan specks floor tile	14,000	SF	Rooms 403, 404, 501, 500, 502, 504, 504C, 506, and 507	ASSUMED	MISC	N	NONE			Yes	ACBM with the potential for damage		MODERATE
37M	12x12 White w/ tan specs VFT Mastic	14,000	SF	1st fl classrooms (400 thru 405) + staff rooms #06-#09; 2nd fl classrooms (500 thru 507)--1987 annex bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12x12 Green with Gray + Dark Green specs VFT	7,800	SF	1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)--1987 annex bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38M	12x12 Green w/ gray + Dark green specs VFT Mastic	7,800	SF	1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	White Spray-On Under sink coating	3	SF	under sink in cabinet room #402--1987	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Goethe School Unit 23341 Building ID 3560

Address 2236 N. Rockwell Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				annex										
40	1x1 White Ceiling Tile	2,800	SF	3rd Floor Gym	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
41	1x1 White Ceiling Tile Matic	2,800	SF	3rd Floor Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	Tank Insulation	40	SF	Boiler Room	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
43	Under sink coating	36	SF	Room 306 and 2nd floor teachers lunch room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	Under sink coating	6	SF	Room 402	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47 & 48	12 x 12 Off White VFT & Mastic			Room 304	ASSUMED	MISC	N	NONE				ACBM with the potential for damage		
49 & 50	12 x 12 Dark Gray VFT & Mastic			Room 304	ASSUMED	MISC	N	NONE				ACBM with the potential for damage		
HA 45 & 46	12 x 12 Light Peach VFT & Mastic	400		Room 304	ASSUMED	MISC	N	NONE				ACBM with the potential for damage		

Chicago Public Schools

School Goethe School Unit 23341 Building ID 3560

Address 2236 N. Rockwell Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 8/18/2022
Inspector Name David Avila
100-11093 5/15/2023
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
03	Abated in 107,304. Damage noted in 101, 207, 204, 307, 301
04	
05	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	Not observed. Possibly Under HA 03
18	Possibly Under Flooring
19	
20	
21	
22	
23	
24	

Chicago Public Schools

School Goethe School Unit 23341 Building ID 3560

Address 2236 N. Rockwell Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
37M	
38	
38M	
39	
40	
41	
42	
43	
44	
47 & 48	
49 & 50	
HA 45 & 46	

Chicago Public Schools

School Goethe School **Unit** 23341 **Building ID** 3560

Address 2236 N. Rockwell Avenue **Region** 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School Goethe School
Address 2236 N. Rockwell Avenue

Unit 23341
Chicago, IL, 60647

Building ID 3560
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Hard Coat Plaster	60,000	SF	Throughout - 1885 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02	2'x4' Ceiling Tile	500	SF	Room 106 - 1885 Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	12" x 12" beige specks floor tile	16,700	SF	Rooms 205, 206, 207, 208, 203, 202, 201, 210, 2nd floor teachers lunchroom, 308, 307, 306, 305, 301, 108, 106, 105, 102, and 101 Throughout - 1885 Building	Chrysotile	MISC	No	30	SF	4 Damaged or significantly damaged friable misc. ACBM	Remove
04	12"x12" Beige w/ Brown Spots VFT	2,500	SF	Rooms 106 & 206 - 1st , 2nd floor corridors. 1885 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	12"x12" White VFT	1,500	SF	First and Second Floor Hallways, Lunchroom Managers office, Kitchen, Room 001- 1885 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	12"x12" Brown w/ White Spots VFT	1,500	SF	First and Second Floor Hallways, Lunchroom Managers office, Kitchen - 1885 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	Air Cell Pipe Insulation	180	LF	Rooms 001, 002, 003, 004, Boiler Room, Coal Room- 1885 Building	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
08	MJP E/F/V on Aircell Pipe Insulation	35	LF	Rooms 001, 002, 003, 004, Boiler Room, Coal Room, Basement corridor's- 1885 Building	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
09	Cardboard Pipe Insulation	320	LF	Storage room 004, 2nd floor boys washroom, room 003, basement boy washroom, pump room storage room next to room 001	Chrysotile	TSI	Yes		LF	6 ACBM with the potential for damage	Follow O&M Plan
10	MJP E/F/V on Cardboard Pipe Insulation	2	LF	Basement Boys washroom, pump room	Chrysotile	TSI	Yes		LF	6 ACBM with the potential for damage	Follow O&M Plan
11	MJP E/F/V on Fiberglass Pipe Insulation	124	LF	Fan Room #1, Hallway in front of room 003	Chrysotile	TSI	Yes		LF	6 ACBM with the potential for damage	Follow O&M Plan
12	Aircell Duct Insulation	480	SF	Basement Corridor- 1885 Building	Chrysotile	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
13	12"x12" Brown VFT Mastic	18,450	SF	Throughout - 1885 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	12"x12" Beige w/ Brown Spots VFT Mastic	1,350	SF	Rooms 106 & 206- 1885 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12"x12" White VFT Mastic	2,500	SF	First and Second Floor Hallways, Lunchroom, Managers office, Kitchen, RM 001 - 1885 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	12" x12" Brown w/ White Spots VFT Mastic	2,500	SF	First and Second Floor Corridors, Lunchroom Managers office, Kitchen, -	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Goethe School
Address 2236 N. Rockwell Avenue

Unit 23341
Chicago, IL, 60647

Building ID 3560
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				1885 Building							
17	9" x 9" Brown w/ Streaks VFT	180	SF	Room 308 Wardrobe- 1885 Building (Possibly under flooring)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	9" x 9" Brown w/ Streaks VFT Mastic	180	SF	Room 308 Wardrobe- 1885 Building (Possibly under flooring)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)	0		Room # 500 through # 503 - 1987 Annex	Assumed	MISC	No	0		6 ACBM with the potential for damage	Follow O&M Plan
20	12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)	0		Room # 500 through # 503 - 1987 Annex	Assumed	MISC	No	0		6 ACBM with the potential for damage	Follow O&M Plan
21	12" x 12" Brown w/ Wht. & Black Specks VFT (NOT OBSERVED)	0		Throughout - 1987 Annex	Assumed	MISC	No	0		6 ACBM with the potential for damage	Follow O&M Plan
22	12" x 12" Brown w/ Wht. & Black Specks VFT Mastic (ABATED)			Throughout (See Hatching Maps) - 1987 Annex	Abated	MISC					
23	12" x 12" Beige w/ Brown Specks VFT (ABATED)			Room 400, AP Room - 1987 Annex	Abated	MISC					
24	12" x 12" Beige w/ Brown Specks VFT Mastic (ABATED)			Room 400, AP Room - 1987 Annex	Abated	MISC					
25	12" x 12" White w/ Blue Specks VFT (NOT OBSERVED)			Room # 401 - 1987 Annex							
26	12" x 12" White w/ Blue Specks VFT Mastic (NOT OBSERVED)			Room # 401 - 1987 Annex							
27	1' x 1' White w/ Grooves Ceiling Tile	20,000	SF	Throughout - 1987 Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	1' x 1' White w/ Grooves Ceiling Tile Mastic	20,000	SF	Throughout - 1987 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	1' x 1' White w/ Dots and Grooves Ceiling Tile	1,200	SF	Room 400 - 1987 Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	1' x 1' White w/ Dots & Grooves Cing. Tile Mastic	1,200	SF	Room 400 - 1987 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	Vinyl Baseboard	3,500	LF	Throughout - 1987 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
32	Vinyl Baseboard Mastic	3,500	LF	Throughout - 1987 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
33	Drywall	50,000	SF	Room 400	Assumed	MISC	No		SF	5 ACBM with potential for significant damage	Follow O&M Plan
34	Drywall Joint Compound	5,000	LF	Throughout - 1987 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
35	12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)			Lunchroom--REMOVED	Abated	MISC					
36	12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)			Lunchroom--REMOVED	Abated	MISC					
37	12x12 White w/ tan specks floor tile	14,000	SF	Rooms 403, 404, 501, 500, 502, 504, 504C, 506, and 507	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
37M	12x12 White w/ tan specs VFT Mastic	14,000	SF	1st fl classrooms (400 thru 405) + staff	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Goethe School
Address 2236 N. Rockwell Avenue

Unit 23341
 Chicago, IL, 60647

Building ID 3560
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				rooms #06-#09; 2nd fl classrooms(500 thru 507)--1987 annex bldg							
38	12x12 Green with Gray + Dark Green specs VFT	7,800	SF	1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)--1987 annex bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38M	12x12 Green w/ gray + Dark green specs VFT Mastic	7,800	SF	1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	White Spray-On Under sink coating	3	SF	under sink in cabinet room #402--1987 annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	1x1 White Ceiling Tile	2,800	SF	3rd Floor Gym	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	1x1 White Ceiling Tile Matic	2,800	SF	3rd Floor Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	Tank Insulation	40	SF	Boiler Room	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	Under sink coating	36	SF	Room 306 and 2nd floor teachers lunch room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	Under sink coating	6	SF	Room 402	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47 & 48	12 x 12 Off White VFT & Mastic			Room 304	Assumed	MISC	No			6 ACBM with the potential for damage	Follow O&M Plan
49 & 50	12 x 12 Dark Gray VFT & Mastic			Room 304	Assumed	MISC	No			6 ACBM with the potential for damage	Follow O&M Plan
HA 45 & 46	12 x 12 Light Peach VFT & Mastic	400		Room 304	Assumed	MISC	No			6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Goethe School
Address 2236 N. Rockwell Avenue

Unit 23341
 Chicago, IL, 60647

Building ID 3560
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Review Date	9/5/2022
Manager Planner Name	Jigar Shah
100-07342	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	Remove damaged ACM ASAP
04	
05	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	

Chicago Public Schools

School Goethe School
Address 2236 N. Rockwell Avenue

Unit 23341
Chicago, IL, 60647

Building ID 3560
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
37M	
38	
38M	
39	
40	
41	
42	
43	
44	
47 & 48	

Chicago Public Schools

School Goethe School
Address 2236 N. Rockwell Avenue

Unit 23341
Chicago, IL, 60647

Building ID 3560
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
49 & 50	
HA 45 & 46	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout - 1885 Building**

MATERIAL QUANTITY: **60000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout - 1885 Building**
MATERIAL QUANTITY: **60000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **2'x4' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 106 - 1885 Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **2'x4' Ceiling Tile**
MATERIAL LOCATION: **Room 106 - 1885 Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **12" x 12" beige specks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **4 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 205, 206, 207, 208, 203, 202, 201, 210, 2nd floor teachers lunchroom, 308, 307, 306, 305, 301, 108, 106, 105, 102, and 101 Throughout - 1885 Building**
MATERIAL QUANTITY: **16700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Abated in 107,304. Damage noted in 101, 207, 204, 307, 301**

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **12" x 12" beige specks floor tile**
MATERIAL LOCATION: **Rooms 205, 206, 207, 208, 203, 202, 201, 210, 2nd floor teachers lunchroom, 308, 307, 306, 305, 301, 108, 106, 105, 102, and 101 Throughout - 1885 Building**
MATERIAL QUANTITY: **16700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Remove damaged ACM ASAP

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Spots VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 106 & 206 - 1st , 2nd floor corridors. 1885 Building**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Spots VFT**
MATERIAL LOCATION: **Rooms 106 & 206 - 1st , 2nd floor corridors. 1885 Building**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **12"x12" White VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **First and Second Floor Hallways, Lunchroom Managers office, Kitchen, Room 001-1885 Building**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **12"x12" White VFT**
MATERIAL LOCATION: **First and Second Floor Hallways, Lunchroom Managers office, Kitchen, Room 001- 1885 Building**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **12"x12" Brown w/ White Spots VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **First and Second Floor Hallways, Lunchroom Managers office, Kitchen - 1885 Building**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **12"x12" Brown w/ White Spots VFT**
MATERIAL LOCATION: **First and Second Floor Hallways, Lunchroom Managers office, Kitchen - 1885 Building**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **Air Cell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 001, 002, 003, 004, Boiler Room, Coal Room- 1885 Building**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **Air Cell Pipe Insulation**
MATERIAL LOCATION: **Rooms 001, 002, 003, 004, Boiler Room, Coal Room- 1885 Building**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 001, 002, 003, 004, Boiler Room, Coal Room, Basement corridor's- 1885 Building**
MATERIAL QUANTITY: **35** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
MATERIAL LOCATION: **Rooms 001, 002, 003, 004, Boiler Room, Coal Room, Basement corridor's- 1885 Building**
MATERIAL QUANTITY: **35** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage
Air Erosion/Flow**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Storage room 004, 2nd floor boys washroom, room 003, basement boy washroom, pump room storage room next to room 001**

MATERIAL QUANTITY: **320** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
MATERIAL LOCATION: **Storage room 004, 2nd floor boys washroom, room 003, basement boy washroom, pump room storage room next to room 001**
MATERIAL QUANTITY: **320** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Air Erosion/Flow**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Boys washroom, pump room**

MATERIAL QUANTITY: **2**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
MATERIAL LOCATION: **Basement Boys washroom, pump room**
MATERIAL QUANTITY: **2** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **See Comments**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Fan Room #1, Hallway in front of room 003**

MATERIAL QUANTITY: **124**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
MATERIAL LOCATION: **Fan Room #1, Hallway in front of room 003**
MATERIAL QUANTITY: **124** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Aircell Duct Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Basement Corridor- 1885 Building**
MATERIAL QUANTITY: **480** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **480** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Aircell Duct Insulation**
MATERIAL LOCATION: **Basement Corridor- 1885 Building**
MATERIAL QUANTITY: **480** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 09/05/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **12"x12" Brown VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1885 Building**
MATERIAL QUANTITY: **18450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **12"x12" Brown VFT Mastic**
MATERIAL LOCATION: **Throughout - 1885 Building**
MATERIAL QUANTITY: **18450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Spots VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 106 & 206- 1885 Building**
MATERIAL QUANTITY: **1350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Spots VFT Mastic**
MATERIAL LOCATION: **Rooms 106 & 206- 1885 Building**
MATERIAL QUANTITY: **1350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" White VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First and Second Floor Hallways, Lunchroom, Managers office, Kitchen, RM 001 - 1885 Building**

MATERIAL QUANTITY: **2500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" White VFT Mastic**
MATERIAL LOCATION: **First and Second Floor Hallways, Lunchroom, Managers office, Kitchen, RM 001 - 1885 Building**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12" x12" Brown w/ White Spots VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First and Second Floor Corridors, Lunchroom Managers office, Kitchen, - 1885 Building**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12" x12" Brown w/ White Spots VFT Mastic**
MATERIAL LOCATION: **First and Second Floor Corridors, Lunchroom Managers office, Kitchen, - 1885 Building**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **9" x 9" Brown w/ Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 308 Wardrobe- 1885 Building (Possibly under flooring)**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Not observed. Possibly Under HA 03**

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **9" x 9" Brown w/ Streaks VFT**
MATERIAL LOCATION: **Room 308 Wardrobe- 1885 Building (Possibly under flooring)**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **9" x 9" Brown w/ Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 308 Wardrobe- 1885 Building (Possibly under flooring)**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Possibly Under Flooring**

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **9" x 9" Brown w/ Streaks VFT Mastic**
MATERIAL LOCATION: **Room 308 Wardrobe- 1885 Building (Possibly under flooring)**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room # 500 through # 503 - 1987 Annex**

MATERIAL QUANTITY: **0** MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)**
MATERIAL LOCATION: **Room # 500 through # 503 - 1987 Annex**
MATERIAL QUANTITY: **0** MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room # 500 through # 503 - 1987 Annex**

MATERIAL QUANTITY: **0** MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)**
MATERIAL LOCATION: **Room # 500 through # 503 - 1987 Annex**
MATERIAL QUANTITY: **0** MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12" x 12" Brown w/ Wht. & Black Specks VFT(NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout - 1987 Annex**

MATERIAL QUANTITY: **0** MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12" x 12" Brown w/ Wht. & Black Specks VFT(NOT OBSERVED)**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **0** MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12" x 12" Brown w/ Wht. & Black Specks VFT Mastic (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout (See Hatching Maps) - 1987 Annex**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12" x 12" Brown w/ Wht. & Black Specks VFT Mastic (ABATED)**
MATERIAL LOCATION: **Throughout (See Hatching Maps) - 1987 Annex**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Brown Specks VFT (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 400, AP Room - 1987 Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Brown Specks VFT (ABATED)**
MATERIAL LOCATION: **Room 400, AP Room - 1987 Annex**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Brown Specks VFT Mastic (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 400, AP Room - 1987 Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Brown Specks VFT Mastic (ABATED)**
MATERIAL LOCATION: **Room 400, AP Room - 1987 Annex**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12" x 12" White w/ Blue Specks VFT (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room # 401 - 1987 Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12" x 12" White w/ Blue Specks VFT (NOT OBSERVED)**
MATERIAL LOCATION: **Room # 401 - 1987 Annex**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12" x 12" White w/ Blue Specks VFT Mastic (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room # 401 - 1987 Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12" x 12" White w/ Blue Specks VFT Mastic (NOT OBSERVED)**
MATERIAL LOCATION: **Room # 401 - 1987 Annex**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **1' x 1' White w/ Grooves Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **1' x 1' White w/ Grooves Ceiling Tile**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **1' x 1' White w/ Grooves Ceiling Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **1' x 1' White w/ Grooves Ceiling Tile Mastic**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **1' x 1' White w/ Dots and Grooves Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 400 - 1987 Annex**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **1' x 1' White w/ Dots and Grooves Ceiling Tile**
MATERIAL LOCATION: **Room 400 - 1987 Annex**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **1' x 1' White w/ Dots & Grooves CIng. Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 400 - 1987 Annex**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **1' x 1' White w/ Dots & Grooves CIng. Tile Mastic**
MATERIAL LOCATION: **Room 400 - 1987 Annex**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Vinyl Baseboard**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Water**
HISTORICAL RESPONSE ACTION: **Remove**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Room 400**

MATERIAL QUANTITY: **50000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Room 400**
MATERIAL QUANTITY: **50000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Lunchroom--REMOVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)**
MATERIAL LOCATION: **Lunchroom--REMOVED**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Lunchroom--REMOVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)**
MATERIAL LOCATION: **Lunchroom--REMOVED**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **12x12 White w/ tan specks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 403, 404, 501, 500, 502, 504, 504C, 506, and 507**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **12x12 White w/ tan specks floor tile**
MATERIAL LOCATION: **Rooms 403, 404, 501, 500, 502, 504, 504C, 506, and 507**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37M**
MATERIAL DESCRIPTION: **12x12 White w/ tan specs VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st fl classrooms (400 thru 405) + staff rooms #06-#09; 2nd fl classrooms(500 thru 507)--1987 annex bldg**

MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **37M**
MATERIAL DESCRIPTION: **12x12 White w/ tan specs VFT Mastic**
MATERIAL LOCATION: **1st fl classrooms (400 thru 405) + staff rooms #06-#09; 2nd fl classrooms(500 thru 507)--1987 annex bldg**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **12x12 Green with Gray + Dark Green specs VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)--1987 annex bldg**
MATERIAL QUANTITY: **7800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **12x12 Green with Gray + Dark Green specs VFT**
MATERIAL LOCATION: **1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)--1987 annex bldg**
MATERIAL QUANTITY: **7800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38M**
MATERIAL DESCRIPTION: **12x12 Green w/ gray + Dark green specs VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)**
MATERIAL QUANTITY: **7800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **38M**
MATERIAL DESCRIPTION: **12x12 Green w/ gray + Dark green specs VFT Mastic**
MATERIAL LOCATION: **1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)**
MATERIAL QUANTITY: **7800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **White Spray-On Under sink coating**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **under sink in cabinet room #402--1987 annex**

MATERIAL QUANTITY: **3** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **White Spray-On Under sink coating**
MATERIAL LOCATION: **under sink in cabinet room #402--1987 annex**
MATERIAL QUANTITY: **3** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **1x1 White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Gym**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **1x1 White Ceiling Tile**
MATERIAL LOCATION: **3rd Floor Gym**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **1x1 White Ceiling Tile Matic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Gym**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **1x1 White Ceiling Tile Matic**
MATERIAL LOCATION: **3rd Floor Gym**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Tank Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Under sink coating**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 306 and 2nd floor teachers lunch room**
MATERIAL QUANTITY: **36** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/18/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Under sink coating**
MATERIAL LOCATION: **Room 306 and 2nd floor teachers lunch room**
MATERIAL QUANTITY: **36** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUIDLING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Under sink coating**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 402**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Under sink coating**
MATERIAL LOCATION: **Room 402**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **09/05/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **HA 45 & 46**
MATERIAL DESCRIPTION: **12 x 12 Light Peach VFT & Mastic**
MATERIAL LOCATION: **Room 304**
MATERIAL QUANTITY: **400** MATERIAL UNITS:
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS:
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **HA 45 & 46**
MATERIAL DESCRIPTION: **12 x 12 Light Peach VFT & Mastic**
MATERIAL LOCATION: **Room 304**
MATERIAL QUANTITY: **400** MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

Jigar Shah

Date: 09/05/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **47 & 48**
MATERIAL DESCRIPTION: **12 x 12 Off White VFT & Mastic**
MATERIAL LOCATION: **Room 304**
MATERIAL QUANTITY: MATERIAL UNITS:
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS:
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **47 & 48**
MATERIAL DESCRIPTION: **12 x 12 Off White VFT & Mastic**
MATERIAL LOCATION: **Room 304**

MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

Jigar Shah

Date: 09/05/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **8/18/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **49 & 50**
MATERIAL DESCRIPTION: **12 x 12 Dark Gray VFT & Mastic**
MATERIAL LOCATION: **Room 304**
MATERIAL QUANTITY: MATERIAL UNITS:
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS:
COMMENTS:

Inspector's Signature: _____



Date: 08/18/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **9/5/2022**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **49 & 50**

MATERIAL DESCRIPTION: **12 x 12 Dark Gray VFT & Mastic**

MATERIAL LOCATION: **Room 304**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

Jigar Shah

Date: 09/05/2022

APPENDIX B

Inspector and Management Planner Licenses



Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

David Avila

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/9/2022

Exam Date: 9/9/2022

Expiration Date: 9/9/2023

Certificate Number: BIR2209092141


Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

David Avila

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/10/2021

Exam Date: 9/10/2021

Expiration Date: 9/10/2022

Certificate Number: BIR2109101942

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

2/28/2022



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 11093

ISSUED
2/28/2022

EXPIRES
05/15/2023

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health





ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11093

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 <p>ASBESTOS PROFESSIONAL LICENSE</p>			<p>ENDORSEMENTS</p>		<p>TC EXPIRES</p>
<p>ID NUMBER 100 - 11093</p>	<p>ISSUED 2/28/2022</p>	<p>EXPIRES 05/15/2023</p>	<p>INSPECTOR</p>		<p>9/10/2022</p>
<p>DAVID AVILA 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health</p> 			<p>PROJECT MANAGER AIR SAMPLING PROFESSIONAL</p>		<p>9/11/2022</p>
			<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>		

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

7233 S. Adams Street | Willowbrook, IL 60527
(630) 655-3900 | www.otssafety.com

2023



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 2/23/2023

Exam Date: 2/23/2023

Expiration Date: 2/23/2024

Certificate Number: MPR2302230560

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: MPR2203090714

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090705

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 07342

ISSUED
4/1/2022

EXPIRES
05/15/2023

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612



Environmental Health

JIGAR M SHAH
2942 W VAN BUREN ST
CHICAGO, IL 60612

4/1/2022

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 <p>ASBESTOS PROFESSIONAL LICENSE</p>			<p>ENDORSEMENTS</p>		<p>TC EXPIRES</p>
<p>ID NUMBER 100 - 07342</p>	<p>ISSUED 4/1/2022</p>	<p>EXPIRES 05/15/2023</p>	<p>INSPECTOR</p> <p>PROJECT DESIGNER</p> <p>MANAGEMENT PLANNER</p> <p>PROJECT MANAGER</p> <p>AIR SAMPLING PROFESSIONAL</p>	<p>3/9/2023</p> <p>3/24/2023</p> <p>3/9/2023</p> <p>3/2/2023</p>	
<p>JIGAR M SHAH 2942 W VAN BUREN ST CHICAGO, IL 60612</p> <p>Environmental Health</p>					<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed