

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2263  
SCHOOL NAME: Herzl School  
ADDRESS OF SCHOOL: 3711 W. Douglas Blvd  
CITY: Chicago, IL, 60623

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **4/12/2019**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 8/30/2022 ENROLLMENT 445  
IDPH INSPECTOR LICENSE NUMBER: 100-20411  
IDPH LICENSED INSPECTOR NAME (Please Print): Benyamen Maradkel  
IDPH MP LICENSE NUMBER: 100-19466  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074



9/12/2022

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

---

---

---

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Herzl School**

3711 W. Douglas Blvd  
Chicago, IL, 60623

Unit: 23771  
Building ID: 3970

IDPH ID Number: 14-016-2990-2263

**REPORT DATE:**

Monday, September 12, 2022

**Prepared for:**

**Chicago Public Schools**  
**42 W. Madison Street**  
**Chicago, IL 60602**

**Prepared by:**

**Carnow, Conibear and Associates**

600 West Van Buren St., Ste 500

Chicago, IL, 60607

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

09/12/2022

Mr. Eric Culbertson  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3, 4 Elementary Schools. Please update your records with the following information.

School District: 299            Unit: 23771            Region: 03            IDPH ID: 14-016-2990-2263

School: Herzl School            Building ID: 3970

Address: 3711 W. Douglas Blvd

Chicago, IL, 60623

Building Contact:            Contact Phone:

Current Building Owners: Chicago Public Schools

Reinspection Date: 8/30/2022

Review Date: 09/12/2022

Inspector: Benyamen Maradkel

Inspector IDPH License: 100-20411

Management Planner: Evan Christian

Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,  
Carnow, Conibear and Associates



Evan Christian  
100-19466

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: September 12, 2022

RE: Herzl School, Unit 23771  
3711 W. Douglas Blvd  
Chicago, IL, 60623

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Herzl School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Herzl School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Herzl School Unit: 23771 Region: 03  
Address: 3711 W. Douglas Blvd Chicago, IL, 60623  
IDPH ID: 14-016-2990-2263 Building ID: 3970  
Contact: Phone:

### 2. Description of Facility

Original Construction: Additional Construction:  
Total Square Footage: No of Floors:  
Current Occupancy: 445

### 3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074  
Address: 42 West Madison Street  
Chicago, IL 60602


### 4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates  
Contact: Doug McCormick  
Address 600 West Van Buren St., Ste 500  
Phone: (312) 762-2900 Fax: (312) 782-5145

### 5. Inspector

Inspector Name: Benyamen Maradkel


Inspector IDPH license # 100-20411  
Reinspection Date: 8/30/2022

Signature:   
Date: 8/30/2022

### 6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466


Signature:   
Date: 09/12/2022

### 7. Review Date: 09/12/2022

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:

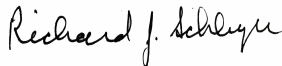

Date: 9/12/2022

Name: Richard J.Schleyer

## II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Herzl School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3970:

006.2	12" x 12" Off-White Floor Tile w/Brown & Gray Specks
015.1	12" x 12" Off-White Floor Tile w/Brown & Gray Streaks Mastic
017.2	12" x 12" Off White Floor Tile w/Brown & Gray Spks Mastic
60	12" x 12" Light Beige w/Light Spots Floor Tile
65	12" x 12" Gray and White Mottled Floor Tile
66	12" x 12" Gray and White Mottled Floor Tile Mastic
67	2' x 2' White Fissured Ceiling Tile
68	12" x 12" Brown Floor Tile

69	12" x 12" Brown Floor Tile Mastic
70	12" x 12" Gray & White Mix Floor Tile
71	12" x 12" Gray & White Mix Floor Tile Mastic
D	Hard Joint Compound on Fiberglass Pipe Insulation
F	Cardboard pipe insulation
H	Preformed pipe insulation
J	Aircell pipe insulation
K	Aircell pipe fitting
L	Fittings on Fiberglass Pipe Insulation
M	Cardboard pipe insulation
N	Hard Joint Compound on Cardboard Pipe Insulation
O	Preformed pipe insulation
P	Preformed pipe joint insulation
Q	Aircell pipe insulation
R	Hard Joint Compound on Aircell Pipe Insulation



B. The following new homogenous areas have been identified for Building 3970:

12.2	12" x 12" White Floor Tile w/Gray Specks w/ Mastic
17.3	12" x 12" Off-White Floor Tile w/Blue Specks Mastic
70	12" x 12" Gray & White Mix Floor Tile
71	12" x 12" Gray & White Mix Floor Tile Mastic

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

013	1' x 1' Acoustical Ceiling Tile
018	Vibration isolation cloth
019	Boiler gaskets
020	Linoleum mastic
026	12" x 12" White Floor Tile w/ Gray Flecks
027	12" x 12" White Floor Tile w/ Gray Flecks Mastic
039	12" x 12" Light Blue Floor Tile w/ White Specks
040	12" x 12" Light Blue Floor Tile w/ White Spks Mastic
041	Vault door liner
042	Gray carpet mastic
047	Lab table tops
048	12" x 12" White w/Multi-Color Streaks Floor Tile
049	12" x 12" White w/Multi-Color Streaks Floor Tile Mastic
12.2	12" x 12" White Floor Tile w/Gray Specks w/ Mastic
14	Chalk boards
17.3	12" x 12" Off-White Floor Tile w/Blue Specks Mastic
52	12" x 12" Light Blue w/Marbling Streaks Floor Tile
54	Blue white ceramic floor tile grout
55	Blue, white ceramic floor tile adhesive
56	12" x 12" Beige w/Gray Spots Floor Tile
57	12" x 12" Light Gray w/Dark Gray Spots Floor Tile
58	12" x 12" Light Gray w/Dark Gray Spots Floor Tile Mastic
59	Carpet square glue
60	12" x 12" Light Beige w/Light Spots Floor Tile
61	12" x 12" Light Beige w/Light Spots Floor Tile Mastic
65	12" x 12" Gray and White Mottled Floor Tile
66	12" x 12" Gray and White Mottled Floor Tile Mastic
67	2' x 2' White Fissured Ceiling Tile
68	12" x 12" Brown Floor Tile
69	12" x 12" Brown Floor Tile Mastic
70	12" x 12" Gray & White Mix Floor Tile
71	12" x 12" Gray & White Mix Floor Tile Mastic

The following areas were deemed to be inaccessible:

015.1	12" x 12" Off-White Floor Tile w/Brown & Gray Streaks Mastic
017.2	12" x 12" Off White Floor Tile w/Brown & Gray Spks Mastic
040	12" x 12" Light Blue Floor Tile w/ White Spks Mastic
042	Gray carpet mastic
55	Blue, white ceramic floor tile adhesive
58	12" x 12" Light Gray w/Dark Gray Spots Floor Tile Mastic
59	Carpet square glue
61	12" x 12" Light Beige w/Light Spots Floor Tile Mastic
66	12" x 12" Gray and White Mottled Floor Tile Mastic
69	12" x 12" Brown Floor Tile Mastic
F	Cardboard pipe insulation
H	Preformed pipe insulation
I	Preformed pipe joint insulation
L	Fittings on Fiberglass Pipe Insulation
Q	Aircell pipe insulation
R	Hard Joint Compound on Aircell Pipe Insulation

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Benyamen Maradkel, IDPH License # 100-20411. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Herzl School Building 3970 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---



# Chicago Public Schools

School Herzl School Unit 23771 Building ID 3970

Address 3711 W. Douglas Blvd Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
012.2	12" x 12" White Floor Tile w/Gray Specks			Rooms 310 and Kitchen	ABATED	MISC								
012.3	12" x 12" Gray Floor Tile w/ White Speckles			Room 209	ABATED	MISC								
013	1' x 1' Acoustical Ceiling Tile		SF	Auditorium not observed 1x1" but present	ASSUMED	MISC				SF				
014.1	9" x 9" Brown/Tan Floor Tile w/Red/Brown Specks Mastic			Rooms 307	ABATED	MISC								
014.2	9" x 9" Off-White Floor Tile w/Bl & Brown Spks Mastic			Room 309	ABATED	MISC								
014.3	9" x 9" Dark Brown & Red Floor (Checkerboard) Mastic			1st Floor Corridor, 208	ABATED	MISC								
014.4	18" x 18" Black Floor Tile Mastic			1st Floor Corridor	ABATED	MISC								
014.5	9" x 9" Green Floor Tile w/White Streaks Mastic			Room 107	ABATED	MISC								
014.6	9" x 9" Gray/Tan Floor Tile Mastic			Room 212	ABATED	MISC								
015.1	12" x 12" Off-White Floor Tile w/Brown & Gray Streaks Mastic	2,500	SF	Rooms 110, 111, 308, 315, and 316	ABATED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
015.2	12" x 12" White Floor Tile w/Gray Specks Mastic			Rooms 310, 311, kitchen	ABATED	MISC								
015.3	12" x 12" Gray Floor Tile w/White Specks Mastic			Room 209	ABATED	MISC								
016.1	9" x 9" Brown/Tan Floor Tile w/Red & Brown Specks Mastic			Room 300	ABATED	MISC								
016.2	Bottom Layer of Floor Tile Mastic			Room 300	ABATED	MISC								
016.3	9" x 9" Brown/Tan Floor Tile w/Brown & White Specks Mastic			Room 202	ABATED	MISC								
016.4	9" x 9" Off-White Floor Tile w/Brown,Blk & Red Mastic			Room 203	ABATED	MISC								
017.1	12" x 12" Off-White Floor Tile w/Brown Specks Mastic			Room 301-308, 317-323	ABATED	MISC								
017.2	12" x 12" Off White Floor Tile w/Brown & Gray Spks Mastic	500	SF	Room 302	ABATED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
017.3	12"x12" Off White Floor Tile w/Blue Specks Mastic			2nd Floor North Central Office	ABATED	MISC		None						Low
017.4	12" x 12" Off-White Floor Tile w/White Spkles Mastic			2nd Floor Meeting Room	ABATED	MISC								
017.5	12" x 12" Red -Brown Floor (Checkerboard) Mastic			1st Floor Corridor	ABATED	MISC								
017.6	18" x 18" Black Floor Tile Mastic			1st Floor Corridor	ABATED	MISC								
017.7	12" x 12" Off-White FloorTile w/White & Brown Spks Mastic			Room 101	ABATED	MISC								
018	Vibration isolation cloth		SF	1st Floor Kitchen	ASSUMED	MISC				SF				

# Chicago Public Schools

School Herzl School Unit 23771 Building ID 3970

Address 3711 W. Douglas Blvd Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
019	Boiler gaskets	10	SF	Boiler Room	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
020	Linoleum mastic		SF	3rd Floor Janitor's Closet and 3rd Floor Storage Closet (no access)	ASSUMED	MISC				SF				
021	Incinerator fire brick			Boiler Room	NO_ACBM	MISC								
022	Building brick - Non-AHERA			Exterior of 1914 Building	NO_ACBM	MISC								
023	Brick mortar - Non-AHERA			Exterior of 1914 Building	NO_ACBM	MISC								
024	Building brick - Non-AHERA			Exterior of 1921 Building	NO_ACBM	MISC								
025	Brick mortar - Non-AHERA			Exterior of 1921 Building	NO_ACBM	MISC								
026	12" x 12" White Floor Tile w/ Gray Flecks			Room 324	ASSUMED	MISC								
027	12" x 12" White Floor Tile w/ Gray Flecks Mastic			Room 324 (not observed)	ASSUMED	MISC								
028	4" Gray vinyl baseboard			Room 324	NO_ACBM	MISC								
029	4" Gray vinyl baseboard mastic			Room 324	NO_ACBM	MISC								
030	12" x 12" Beige Floor Tile w/ White Flecks			Room 224 and Speech Assistant Room	ABATED	MISC								
031	12" x 12" Beige Floor Tile w/ White Flecks Mastic			Room 224 and Speech Assistant Room	ABATED	MISC								
032	4" Brown vinyl baseboard			Room 224 and Speech Assistant Room	NO_ACBM	MISC								
033	4" Brown vinyl baseboard mastic			Room 224 and Speech Assistant Room	NO_ACBM	MISC								
034	Ceramic wall tile adhesive			Room 224 Bathrooms and 324 Bathrooms	NO_ACBM	MISC								
035	4" Black vinyl baseboard			Auditorium	NO_ACBM	MISC								
036	4" Black vinyl baseboard mastic			Auditorium	NO_ACBM	MISC								
037	9" x 9" Light Brown Floor Tile w/Dark Brown Streaks			Room 120	ABATED	MISC								
038	9" x 9" Light Brown Floor Tile w/Dark Brown Streaks Mastic			Room 120	ABATED	MISC								
039	12" x 12" Light Blue Floor Tile w/ White Specks	1,500	SF	Auditorium	ASSUMED	MISC	N	LOC	6	SF	No	ACBM with potential for significant damage	4	LOW
040	12" x 12" Light Blue Floor Tile w/ White	1,500	SF	Auditorium	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the		LOW



# Chicago Public Schools

School Herzl School Unit 23771 Building ID 3970

Address 3711 W. Douglas Blvd Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Spks Mastic											potential for damage		
041	Vault door liner		SF	Third Floor Across From 310	ASSUMED	MISC				SF				
042	Gray carpet mastic	672	SF	Auditorium	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
043	12" x 12" Blue Mix Floor Tile			Room 128 and Office by 118	ABATED	MISC								
044	12" x 12" Blue Mix Floor Tile Mastic			Room 128 and Office by 118	ABATED	MISC								
045	12" x 12" Blue/White Checkerboard Floor Tile			Main Office	ABATED	MISC								
046	12" x 12" Blue/White Checkerboard Floor Tile Mastic			Main Office	ABATED	MISC								
047	Lab table tops	80	SF	Room 322, 303, 320	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
048	12" x 12" White w/Multi-Color Streaks Floor Tile		SF	Rooms 303 and 317	ASSUMED	MISC				SF				
049	12" x 12" White w/Multi-Color Streaks Floor Tile Mastic		SF	Rooms 303 and 317	ASSUMED	MISC				SF				
050	12" x 12" White w/Colored Streaks Floor Tile			1st Floor North Vestibules	ABATED	MISC								
051	12" x 12" White w/Colored Streaks Floor Tile Mastic			1st Floor North Vestibules	ABATED	MISC								
12.2	12" x 12" White Floor Tile w/Gray Specks w/ Mastic	700	SF	Rooms 310, 311, kitchen	ASSUMED	MISC	N	LOC	4	SF	No	ACBM with potential for significant damage	4	LOW
14	Chalk boards		SF	Rooms 301-310,102,104-110,201-210	ASSUMED	MISC				SF				
17.3	12" x 12" Off-White Floor Tile w/Blue Specks Mastic	200	SF	2nd Floor North Central Office (217C)	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with potential for significant damage		LOW
52	12" x 12" Light Blue w/Marbling Streaks Floor Tile			Room 317 (not observed)	ASSUMED	MISC								
53	12" x 12" Light Blue w/Marbling Streaks Floor Tile Mastic			Room 317	ABATED	MISC								
54	Blue white ceramic floor tile grout	5,400	SF	1st, 2nd, 3rd, Floor-Boys/Girls Wash Room	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
55	Blue, white ceramic floor tile adhesive	5,400	SF	1st, 2nd, 3rd, Floors-Boys/Girls Wash Room	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
56	12" x 12" Beige w/Gray Spots Floor Tile		SF	Room 119	ASSUMED	MISC				SF				
57	12" x 12" Light Gray w/Dark Gray Spots Floor Tile	10,000	SF	1st Floor Hallways, 149	ASSUMED	MISC	N	LOC	6	SF	No	ACBM with potential for significant damage	4	LOW



# Chicago Public Schools

School Herzl School Unit 23771 Building ID 3970

Address 3711 W. Douglas Blvd Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
D	Hard Joint Compound on Fiberglass Pipe Insulation	15	LF	Throughout 1914 Facility including Kitchen & Pipe Chases	CHR	TSI	Y	NONE	0	LF	Yes	Any remaining friable ACBM or friable suspect ACBM		HIGH
E	Water meter packing - abated			Basement	ABATED	TSI								
F	Cardboard pipe insulation	1,500	LF	Above 1st Floor ceiling	CHR	TSI	Y	NONE	0	LF	Yes	Damaged or significantly damaged friable thermal system insulating ACBM		LOW
G	Hard Joint Compound on Cardboard Pipe Insulation	150	EA	Above 1st Floor Ceiling	CHR	TSI	Y	NONE	0	EA	No	ACBM with the potential for damage		LOW
H	Preformed pipe insulation	100	LF	Tunnel	AMO	TSI	Y	LOC	6	LF	Yes	Damaged or significantly damaged friable thermal system insulating ACBM	4	LOW
I	Preformed pipe joint insulation	25	SF	Tunnel	AMO	TSI	Y	NONE	0	SF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
J	Aircell pipe insulation	500	LF	Throughout 1914 Facility	CHR	TSI	Y	LOC	4	LF	Yes	Damaged or significantly damaged friable thermal system insulating ACBM	4	LOW
K	Aircell pipe fitting	50	EA	Throughout 1914 Facility	AMO	TSI	Y	NONE	0	EA	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
L	Fittings on Fiberglass Pipe Insulation	100	SF	Throughout 1921 Facility	CHR	TSI	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
M	Cardboard pipe insulation	300	LF	1st Floor	CHR	TSI	Y	NONE	0	LF	Yes	Damaged or significantly damaged friable thermal system insulating ACBM		LOW
N	Hard Joint Compound on Cardboard Pipe Insulation	30	SF	1st Floor	CHR	TSI	Y	NONE	0	SF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
O	Preformed pipe insulation	5	LF	1st Floor	AMO	TSI	Y	NONE	0	LF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
P	Preformed pipe joint insulation	10	LF	1st Floor	AMO	TSI	Y	NONE	0	LF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
Q	Aircell pipe insulation	100	LF	Throughout 1921 Facility	CHR	TSI	Y	NONE	0	LF	Yes	Any remaining friable ACBM or friable suspect ACBM		LOW

# Chicago Public Schools

School Herzl School Unit 23771 Building ID 3970

Address 3711 W. Douglas Blvd Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
R	Hard Joint Compound on Aircell Pipe Insulation	25	SF	Throughout 1921 Facility & Tunnel	CHR	TS1	Y	NONE	0	SF	Yes	Damaged or significantly damaged friable thermal system insulating ACBM		LOW

# Chicago Public Schools

School Herzl School Unit 23771 Building ID 3970

Address 3711 W. Douglas Blvd Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>8/30/2022</b>
Inspector Name <b>Benyamen Maradkel</b>
<b>100-20411</b> <b>5/15/2023</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
001	Damage in Rooms 336, 316, 217C, 149, 116
002	Not observed 2022
003	Not observed 2022
004	
005.1	Not observed 2022
005.2	
005.3	Not observed 2022
005.4	Not observed 2022
006.1	
006.2	
006.3	Not observed 2022
006.4	Not observed 2022
006.5	Not observed 2022
006.6	Not observed 2022
006.7	
008	Not observed 2022
009	Not observed 2022
010	
011.1	Not observed 2022
011.2	Not observed 2022
011.3	Not observed 2022
011.4	Not observed 2022
011.5	Not observed 2022
011.6	Not observed 2022

# Chicago Public Schools

School Herzl School Unit 23771 Building ID 3970

Address 3711 W. Douglas Blvd Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
012.1	
012.2	
012.3	
013	Not observed 2022
014.1	Not observed 2022
014.2	Not observed 2022
014.3	Not observed 2022
014.4	Not observed 2022
014.5	Not observed 2022
014.6	Not observed 2022
015.1	
015.2	Present in room 311 -700 SF Not present - 310, kitchen 2022
015.3	
016.1	Not observed 2022
016.2	Not observed 2022
016.3	Not observed 2022
016.4	Not observed 2022
017.1	Not observed 2022
017.2	
017.3	
017.4	
017.5	Not observed 2022
017.6	Not observed 2022
017.7	
018	Not observed 2022
019	
020	Not observed 2022
021	
022	

# Chicago Public Schools

School Herzl School Unit 23771 Building ID 3970

Address 3711 W. Douglas Blvd Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
023	
024	
025	
026	Not observed 2022
027	Not observed 2022
028	
029	
030	
031	
032	
033	
034	
035	
036	
037	Not observed 2022
038	Not observed 2022
039	damaged in auditorium
040	
041	Not observed 2022
042	
043	
044	
045	Not observed 2022
046	Not observed 2022
047	Not observed in rooms 320, 322 - 2022
048	Not observed 2022
049	Not observed 2022
050	Not observed 2022
051	Not observed 2022

# Chicago Public Schools

School Herzl School Unit 23771 Building ID 3970

Address 3711 W. Douglas Blvd Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
12.2	Damage in Room 311, not observed in Room 310, kitchen - 2022
14	Not observed 2022 - could be behind marker boards
17.3	
52	Not observed 2022
53	Not observed 2022
54	
55	
56	Not observed 2022
57	damaged in 1st floor vestibule door 20
58	
59	
60	damaged in lunchroom
61	
62	
63	Not observed 2022
64	Not observed 2022
65	
66	
67	
68	
69	
70	
71	
A	
B	Damaged in pump room
C	
D	
E	
F	



# Chicago Public Schools

School Herzl School Unit 23771 Building ID 3970

Address 3711 W. Douglas Blvd Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
G	
H	Damage by entrance of tunnel
I	
J	Damaged in lunchroom (110)
K	
L	
M	
N	
O	
P	
Q	
R	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Herzl School  
**Address** 3711 W. Douglas Blvd

**Unit** 23771  
Chicago, IL, 60623

**Building ID** 3970  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
001	Hardcoat plaster			Throughout 1914 Building	No ACBM	SURFACE					
002	2' x 4' Lay In Ceiling Panels			Rooms 322 & 323	No ACBM	MISC					
003	1' x 1' Ceiling Tile			Rooms 302 and 303	No ACBM	MISC					
004	Blown in insulation			Attic	No ACBM	TSI					
005.1	9" x 9" Brown/Tan Floor Tile w/Red & Brown Specks			Room 300, Office	Abated	MISC					
005.2	Bottom Layer of Floor Tile			Room 300	Abated	MISC					
005.3	9"x 9" Brown/Tan Floor Tile w/Brown & White Specks			Room 202	Abated	MISC					
005.4	9" x 9" Off-White Floor Tile w/Blk,Brown & Red Streaks			Room 203	Abated	MISC					
006.1	12" x 12" Off-White Floor Tile w/ Brown Specks Mastic			Rooms 301-310, 315-323	Abated	MISC					
006.2	12" x 12" Off-White Floor Tile w/Brown & Gray Specks	500	SF	Rooms 302	Abated	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
006.3	12" x 12" Off-White Floor Tile w/Blue Specks			2nd Floor North Central Office	Abated	MISC					
006.4	12" x 12" Off-White Floor Tile w/White Speckles			2nd Floor Meeting Room	Abated	MISC					
006.5	12" x 12" Red/Brown Floor Tile w/White Specks			1st Floor Corridor	Abated	MISC					
006.6	18" x 18" Black Floor Tile			1st Floor Corridor	Abated	MISC					
006.7	12" x 12" Off-White FloorTile w/White & Brown Specks			Room 101	Abated	MISC					
008	Linoleum			3rd Floor Janitor's Closet, Storage Closet 3rd Floor.	No ACBM	MISC					
009	2' x 4' Ceiling Tile (Tectum)			1st Floor Auditorium (323)	No ACBM	MISC					
010	Hardcoat plaster			Throughout 1921 Building	No ACBM	SURFACE					
011.1	9" x 9" Brown/Tan Floor Tile w/Red/Brown Speckles			Room 307	Abated	MISC					
011.2	9" x 9" Off-White Floor Tile w/ Blue & Brown Specks			Room 309	Abated	MISC					
011.3	9" x 9" Dark Brown and Red Floor Tile (Checkerboard)			1st Floor Corridor & 208	Abated	MISC					
011.4	18" x 18" Black Floor Tile			1st Floor Corridor	Abated	MISC					
011.5	9" x 9" Green Floor Tile w/White Streaks			Room 107	Abated	MISC					
011.6	9" x 9" Gray/Tan Floor Tile			212	Abated	MISC					
012.1	12" x 12" Off-White Floor Tile w/ Brown Specks			Rooms 110,111	Abated	MISC					

# Chicago Public Schools

**School** Herzl School  
**Address** 3711 W. Douglas Blvd

**Unit** 23771  
Chicago, IL, 60623

**Building ID** 3970  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
012.2	12" x 12" White Floor Tile w/Gray Specks			Rooms 310 and Kitchen	Abated	MISC					
012.3	12" x 12" Gray Floor Tile w/ White Speckles			Room 209	Abated	MISC					
013	1' x 1' Acoustical Ceiling Tile		SF	Auditorium not observed 1x1" but present	Assumed	MISC			SF		Follow O&M Plan
014.1	9" x 9" Brown/Tan Floor Tile w/Red/Brown Specks Mastic			Rooms 307	Abated	MISC					
014.2	9" x 9" Off-White Floor Tile w/Bl & Brown Spks Mastic			Room 309	Abated	MISC					
014.3	9" x 9" Dark Brown & Red Floor (Checkerboard) Mastic			1st Floor Corridor, 208	Abated	MISC					
014.4	18" x 18" Black Floor Tile Mastic			1st Floor Corridor	Abated	MISC					
014.5	9" x 9" Green Floor Tile w/White Streaks Mastic			Room 107	Abated	MISC					
014.6	9" x 9" Gray/Tan Floor Tile Mastic			Room 212	Abated	MISC					
015.1	12" x 12" Off-White Floor Tile w/Brown & Gray Streaks Mastic	2,500	SF	Rooms 110, 111, 308, 315, and 316	Abated	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
015.2	12" x 12" White Floor Tile w/Gray Specks Mastic			Rooms 310, 311, kitchen	Abated	MISC					
015.3	12" x 12" Gray Floor Tile w/White Specks Mastic			Room 209	Abated	MISC					
016.1	9" x 9" Brown/Tan Floor Tile w/Red & Brown Specks Mastic			Room 300	Abated	MISC					
016.2	Bottom Layer of Floor Tile Mastic			Room 300	Abated	MISC					
016.3	9" x 9" Brown/Tan Floor Tile w/Brown & White Specks Mastic			Room 202	Abated	MISC					
016.4	9" x 9" Off-White Floor Tile w/Brown,Blk & Red Mastic			Room 203	Abated	MISC					
017.1	12" x 12" Off-White Floor Tile w/Brown Specks Mastic			Room 301-308, 317-323	Abated	MISC					
017.2	12" x 12" Off White Floor Tile w/Brown & Gray Spks Mastic	500	SF	Room 302	Abated	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
017.3	12"x12" Off White Floor Tile w/Blue Specks Mastic			2nd Floor North Central Office	Abated	MISC					
017.4	12" x 12" Off-White Floor Tile w/White Spkles Mastic			2nd Floor Meeting Room	Abated	MISC					
017.5	12" x 12" Red -Brown Floor (Checkerboard) Mastic			1st Floor Corridor	Abated	MISC					
017.6	18" x 18" Black Floor Tile Mastic			1st Floor Corridor	Abated	MISC					
017.7	12" x 12" Off-White FloorTile w/White & Brown Spks Mastic			Room 101	Abated	MISC					
018	Vibration isolation cloth		SF	1st Floor Kitchen	Assumed	MISC			SF		Follow O&M Plan

# Chicago Public Schools

**School** Herzl School  
**Address** 3711 W. Douglas Blvd

**Unit** 23771  
Chicago, IL, 60623

**Building ID** 3970  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
019	Boiler gaskets	10	SF	Boiler Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
020	Linoleum mastic		SF	3rd Floor Janitor's Closet and 3rd Floor Storage Closet (no access)	Assumed	MISC			SF		Follow O&M Plan
021	Incinerator fire brick			Boiler Room	No ACBM	MISC					
022	Building brick - Non-AHERA			Exterior of 1914 Building	No ACBM	MISC					
023	Brick mortar -Non-AHERA			Exterior of 1914 Building	No ACBM	MISC					
024	Building brick - Non-AHERA			Exterior of 1921 Building	No ACBM	MISC					
025	Brick mortar - Non-AHERA			Exterior of 1921 Building	No ACBM	MISC					
026	12" x 12" White Floor Tile w/ Gray Flecks			Room 324	Assumed	MISC					Follow O&M Plan
027	12" x 12" White Floor Tile w/ Gray Flecks Mastic			Room 324 (not observed)	Assumed	MISC					Follow O&M Plan
028	4" Gray vinyl baseboard			Room 324	No ACBM	MISC					
029	4" Gray vinyl baseboard mastic			Room 324	No ACBM	MISC					
030	12" x 12" Beige Floor Tile w/ White Flecks			Room 224 and Speech Assistant Room	Abated	MISC					
031	12" x 12" Beige Floor Tile w/ White Flecks Mastic			Room 224 and Speech Assistant Room	Abated	MISC					
032	4" Brown vinyl baseboard			Room 224 and Speech Assistant Room	No ACBM	MISC					
033	4" Brown vinyl baseboard mastic			Room 224 and Speech Assistant Room	No ACBM	MISC					
034	Ceramic wall tile adhesive			Room 224 Bathrooms and 324 Bathrooms	No ACBM	MISC					
035	4" Black vinyl baseboard			Auditorium	No ACBM	MISC					
036	4" Black vinyl baseboard mastic			Auditorium	No ACBM	MISC					
037	9" x 9" Light Brown Floor Tile w/Dark Brown Streaks			Room 120	Abated	MISC					
038	9" x 9" Light Brown Floor Tile w/Dark Brown Streaks Mastic			Room 120	Abated	MISC					
039	12" x 12" Light Blue Floor Tile w/ White Specks	1,500	SF	Auditorium	Assumed	MISC	No	6	SF	5 ACBM with potential for significant damage	Repair
040	12" x 12" Light Blue Floor Tile w/ White Spks Mastic	1,500	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
041	Vault door liner		SF	Third Floor Across From 310	Assumed	MISC			SF		Follow O&M Plan
042	Gray carpet mastic	672	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
043	12" x 12" Blue Mix Floor Tile			Room 128 and Office by 118	Abated	MISC					
044	12" x 12" Blue Mix Floor Tile Mastic			Room 128 and Office by 118	Abated	MISC					
045	12" x 12" Blue/White Checkerboard Floor Tile			Main Office	Abated	MISC					
046	12" x 12" Blue/White Checkerboard Floor Tile Mastic			Main Office	Abated	MISC					

# Chicago Public Schools

School Herzl School  
Address 3711 W. Douglas Blvd

Unit 23771  
Chicago, IL, 60623

Building ID 3970  
Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
047	Lab table tops	80	SF	Room 322, 303, 320	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
048	12" x 12" White w/Multi-Color Streaks Floor Tile		SF	Rooms 303 and 317	Assumed	MISC			SF		Follow O&M Plan
049	12" x 12" White w/Multi-Color Streaks Floor Tile Mastic		SF	Rooms 303 and 317	Assumed	MISC			SF		Follow O&M Plan
050	12" x 12" White w/Colored Streaks Floor Tile			1st Floor North Vestibules	Abated	MISC					
051	12" x 12" White w/Colored Streaks Floor Tile Mastic			1st Floor North Vestibules	Abated	MISC					
12.2	12" x 12" White Floor Tile w/Gray Specks w/ Mastic	700	SF	Rooms 310, 311, kitchen	Assumed	MISC	No	4	SF	5 ACBM with potential for significant damage	Remove
14	Chalk boards		SF	Rooms 301-310,102,104-110,201-210	Assumed	MISC			SF		Follow O&M Plan
17.3	12" x 12" Off-White Floor Tile w/Blue Specks Mastic	200	SF	2nd Floor North Central Office (217C)	Assumed	MISC	No	0	SF	5 ACBM with potential for significant damage	Follow O&M Plan
52	12" x 12" Light Blue w/Marbling Streaks Floor Tile			Room 317 (not observed)	Assumed	MISC					Follow O&M Plan
53	12" x 12" Light Blue w/Marbling Streaks Floor Tile Mastic			Room 317	Abated	MISC					
54	Blue white ceramic floor tile grout	5,400	SF	1st, 2nd, 3rd, Floor-Boys/Girls Wash Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	Blue, white ceramic floor tile adhesive	5,400	SF	1st, 2nd, 3rd, Floors-Boys/Girls Wash Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	12" x 12" Beige w/Gray Spots Floor Tile		SF	Room 119	Assumed	MISC			SF		Follow O&M Plan
57	12" x 12" Light Gray w/Dark Gray Spots Floor Tile	10,000	SF	1st Floor Hallways, 149	Assumed	MISC	No	6	SF	5 ACBM with potential for significant damage	Repair
58	12" x 12" Light Gray w/Dark Gray Spots Floor Tile Mastic	10,000	SF	1st Floor Hallways, 149	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	Carpet square glue	1,500	SF	Main Offices/principal office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	12" x 12" Light Beige w/Light Spots Floor Tile	32,000	SF	1st and 2nd Floor Classrooms , lunchroom (110)	Assumed	MISC	No	4	SF	5 ACBM with potential for significant damage	Repair
61	12" x 12" Light Beige w/Light Spots Floor Tile Mastic	32,000	SF	1st and 2nd Floor Classrooms, lunchroom (110)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	Brown flooring under wood floor			3rd Floor Gym	No ACBM	MISC					
63	Paper under wood underlayment			Rooms 108, 109, 110, 114, 118, 123, 207, 210, 211, 212, and 2nd Floor Offices (not observed)	No ACBM	MISC					
64	Paper under wood underlayment			Rooms 107, 116, 204, 205, 208, 209, and 244 (not observed)	Chrysotile	MISC					Follow O&M Plan
65	12" x 12" Gray and White Mottled Floor Tile	20,000	SF	Classrooms Throughout 3rd Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
66	12" x 12" Gray and White Mottled Floor Tile Mastic	20,000	SF	Classrooms Throughout 3rd Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

School Herzl School  
Address 3711 W. Douglas Blvd

Unit 23771  
Chicago, IL, 60623

Building ID 3970  
Region 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
67	2' x 2' White Fissured Ceiling Tile	1,750	SF	Room 124, Auditorium	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
68	12" x 12" Brown Floor Tile	120	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
69	12" x 12" Brown Floor Tile Mastic	120	SF	Engineer's office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
70	12" x 12" Gray & White Mix Floor Tile	5,000	SF	Rooms 301-310, 315-323, 315A, 330A, Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
71	12" x 12" Gray & White Mix Floor Tile Mastic	5,000	SF	Rooms 301-310, 315-323, 315A, 330A, Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Fiberglass Insulation on Boiler			Boiler Room	No ACBM	MISC					
B	Fiberglass tank insulation			Pump Room	No ACBM	MISC					
C	Fiberglass pipe insulation			Throughout Facility	No ACBM	MISC					
D	Hard Joint Compound on Fiberglass Pipe Insulation	15	LF	Throughout 1914 Facility including Kitchen & Pipe Chases	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
E	Water meter packing - abated			Basement	Abated	TSI					
F	Cardboard pipe insulation	1,500	LF	Above 1st Floor ceiling	Chrysotile	TSI	Yes	0	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Follow O&M Plan
G	Hard Joint Compound on Cardboard Pipe Insulation	150	EA	Above 1st Floor Ceiling	Chrysotile	TSI	Yes	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
H	Preformed pipe insulation	100	LF	Tunnel	Amosite	TSI	Yes	6	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Encapsulate
I	Preformed pipe joint insulation	25	SF	Tunnel	Amosite	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
J	Aircell pipe insulation	500	LF	Throughout 1914 Facility	Chrysotile	TSI	Yes	4	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Encapsulate
K	Aircell pipe fitting	50	EA	Throughout 1914 Facility	Amosite	TSI	Yes	0	EA	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
L	Fittings on Fiberglass Pipe Insulation	100	SF	Throughout 1921 Facility	Chrysotile	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
M	Cardboard pipe insulation	300	LF	1st Floor	Chrysotile	TSI	Yes	0	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Follow O&M Plan
N	Hard Joint Compound on Cardboard Pipe Insulation	30	SF	1st Floor	Chrysotile	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
O	Preformed pipe insulation	5	LF	1st Floor	Amosite	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
P	Preformed pipe joint insulation	10	LF	1st Floor	Amosite	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

# Chicago Public Schools

**School** Herzl School  
**Address** 3711 W. Douglas Blvd

**Unit** 23771  
 Chicago, IL, 60623

**Building ID** 3970  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
Q	Aircell pipe insulation	100	LF	Throughout 1921 Facility	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
R	Hard Joint Compound on Aircell Pipe Insulation	25	SF	Throughout 1921 Facility & Tunnel	Chrysotile	TSI	Yes	0	SF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Follow O&M Plan

Review Date 9/12/2022

HA Number	Management Comments
-----------	---------------------



# Chicago Public Schools

**School** Herzl School  
**Address** 3711 W. Douglas Blvd

**Unit** 23771  
 Chicago, IL, 60623

**Building ID** 3970  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

Manager Planner Name	Evan Christian
100-19466	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
001	
002	
003	
004	
005.1	
005.2	
005.3	
005.4	
006.1	
006.2	
006.3	
006.4	
006.5	
006.6	
006.7	
008	
009	
010	
011.1	
011.2	
011.3	
011.4	
011.5	
011.6	
012.1	
012.2	
012.3	

# Chicago Public Schools

**School** Herzl School  
**Address** 3711 W. Douglas Blvd

**Unit** 23771  
 Chicago, IL, 60623

**Building ID** 3970  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
013	
014.1	
014.2	
014.3	
014.4	
014.5	
014.6	
015.1	
015.2	
015.3	
016.1	
016.2	
016.3	
016.4	
017.1	
017.2	
017.3	
017.4	
017.5	
017.6	
017.7	
018	
019	
020	
021	
022	
023	

# Chicago Public Schools

**School** Herzl School  
**Address** 3711 W. Douglas Blvd

**Unit** 23771  
Chicago, IL, 60623

**Building ID** 3970  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
024	
025	
026	
027	
028	
029	
030	
031	
032	
033	
034	
035	
036	
037	
038	
039	
040	
041	
042	
043	
044	
045	
046	
047	
048	
049	
050	

# Chicago Public Schools

**School** Herzl School  
**Address** 3711 W. Douglas Blvd

**Unit** 23771  
 Chicago, IL, 60623

**Building ID** 3970  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
051	
12.2	Sample to determine ACM content.
14	
17.3	Sample to determine ACM content.
52	
53	
54	
55	
56	
57	
58	
59	
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
70	
71	
A	
B	
C	

# Chicago Public Schools

**School** Herzl School  
**Address** 3711 W. Douglas Blvd

**Unit** 23771  
Chicago, IL, 60623

**Building ID** 3970  
**Region** 03

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
D	
E	
F	
G	
H	
I	
J	
K	
L	
M	
N	
O	
P	
Q	
R	

# APPENDIX A

## Assessment Sheets, Drawings and Photos

---

# Chicago Public Schools

Carnow, Conibear and Associates

*2022 AHERA REINSPECTION*

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **001**  
MATERIAL DESCRIPTION: **Hardcoat plaster**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout 1914 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Damage in Rooms 336, 316, 217C, 149, 116**

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **001**

MATERIAL DESCRIPTION: **Hardcoat plaster**

MATERIAL LOCATION: **Throughout 1914 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **002**  
MATERIAL DESCRIPTION: **2' x 4' Lay In Ceiling Panels**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 322 & 323**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **002**

MATERIAL DESCRIPTION: **2' x 4' Lay In Ceiling Panels**

MATERIAL LOCATION: **Rooms 322 & 323**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **003**  
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 302 and 303**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **003**

MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**

MATERIAL LOCATION: **Rooms 302 and 303**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **004**  
MATERIAL DESCRIPTION: **Blown in insulation**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Attic**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

---

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **004**

MATERIAL DESCRIPTION: **Blown in insulation**

MATERIAL LOCATION: **Attic**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005.1**  
MATERIAL DESCRIPTION: **9" x 9" Brown/Tan Floor Tile w/Red & Brown Specks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 300, Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **005.1**

MATERIAL DESCRIPTION: **9" x 9" Brown/Tan Floor Tile w/Red & Brown Specks**

MATERIAL LOCATION: **Room 300, Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005.2**  
MATERIAL DESCRIPTION: **Bottom Layer of Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 300**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

---

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **005.2**

MATERIAL DESCRIPTION: **Bottom Layer of Floor Tile**

MATERIAL LOCATION: **Room 300**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005.3**  
MATERIAL DESCRIPTION: **9"x 9" Brown/Tan Floor Tile w/Brown & White Specks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 202**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **005.3**

MATERIAL DESCRIPTION: **9"x 9" Brown/Tan Floor Tile w/Brown & White Specks**

MATERIAL LOCATION: **Room 202**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005.4**  
MATERIAL DESCRIPTION: **9" x 9" Off-White Floor Tile w/Blk,Brown & Red Streaks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 203**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **005.4**

MATERIAL DESCRIPTION: **9" x 9" Off-White Floor Tile w/Blk,Brown & Red Streaks**

MATERIAL LOCATION: **Room 203**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006.1**  
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/ Brown Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 301-310, 315-323**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **006.1**

MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/ Brown Specks Mastic**

MATERIAL LOCATION: **Rooms 301-310, 315-323**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23771 BUIDLING ID: 3970  
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Benyamen Maradkel  
SCHOOL NAME: Herzl School INSPECTION DATE: 8/30/2022  
ADDRESS: 3711 W. Douglas Blvd IDPH LICENSE NO: 100-20411

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 006.2  
MATERIAL DESCRIPTION: 12" x 12" Off-White Floor Tile w/Brown & Gray Specks  
HISTORICAL AHERA DAMAGE CATEGORY 6  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: Abated FRIABLE: No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 302**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **006.2**  
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/Brown & Gray Specks**  
MATERIAL LOCATION: **Rooms 302**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006.3**  
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/Blue Specks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd Floor North Central Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **006.3**

MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/Blue Specks**

MATERIAL LOCATION: **2nd Floor North Central Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006.4**  
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/White Speckles**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd Floor Meeting Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **006.4**

MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/White Speckles**

MATERIAL LOCATION: **2nd Floor Meeting Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006.5**  
MATERIAL DESCRIPTION: **12" x 12" Red/Brown Floor Tile w/White Specks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **006.5**

MATERIAL DESCRIPTION: **12" x 12" Red/Brown Floor Tile w/White Specks**

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006.6**  
MATERIAL DESCRIPTION: **18" x 18" Black Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **006.6**

MATERIAL DESCRIPTION: **18" x 18" Black Floor Tile**

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006.7**  
MATERIAL DESCRIPTION: **12" x 12" Off-White FloorTile w/White & Brown Specks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 101**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **006.7**

MATERIAL DESCRIPTION: **12" x 12" Off-White FloorTile w/White & Brown Specks**

MATERIAL LOCATION: **Room 101**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **008**  
MATERIAL DESCRIPTION: **Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd Floor Janitor's Closet, Storage Closet 3rd Floor.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **008**  
MATERIAL DESCRIPTION: **Linoleum**  
MATERIAL LOCATION: **3rd Floor Janitor's Closet, Storage Closet 3rd Floor.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **009**  
MATERIAL DESCRIPTION: **2' x 4' Ceiling Tile (Tectum)**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Auditorium (323)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **009**

MATERIAL DESCRIPTION: **2' x 4' Ceiling Tile (Tectum)**

MATERIAL LOCATION: **1st Floor Auditorium (323)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **010**  
MATERIAL DESCRIPTION: **Hardcoat plaster**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout 1921 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **010**

MATERIAL DESCRIPTION: **Hardcoat plaster**

MATERIAL LOCATION: **Throughout 1921 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **011.1**  
MATERIAL DESCRIPTION: **9" x 9" Brown/Tan Floor Tile w/Red/Brown Speckles**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 307**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **011.1**

MATERIAL DESCRIPTION: **9" x 9" Brown/Tan Floor Tile w/Red/Brown Speckles**

MATERIAL LOCATION: **Room 307**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **011.2**  
MATERIAL DESCRIPTION: **9" x 9" Off-White Floor Tile w/ Blue & Brown Specks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 309**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **011.2**

MATERIAL DESCRIPTION: **9" x 9" Off-White Floor Tile w/ Blue & Brown Specks**

MATERIAL LOCATION: **Room 309**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools    UNIT NUMBER: 23771    BUIDLING ID: 3970  
CITY/STATE: Chicago, Illinois    AHERA INSPECTOR: Benyamen Maradkel  
SCHOOL NAME: Herzl School    INSPECTION DATE: 8/30/2022  
ADDRESS: 3711 W. Douglas Blvd    IDPH LICENSE NO: 100-20411

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 011.3  
MATERIAL DESCRIPTION: 9" x 9" Dark Brown and Red Floor Tile (Checkerboard)  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: Abated    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st Floor Corridor & 208

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Not observed 2022

Inspector's Signature:



Date: 08/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **011.3**

MATERIAL DESCRIPTION: **9" x 9" Dark Brown and Red Floor Tile (Checkerboard)**

MATERIAL LOCATION: **1st Floor Corridor & 208**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **011.4**  
MATERIAL DESCRIPTION: **18" x 18" Black Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **011.4**

MATERIAL DESCRIPTION: **18" x 18" Black Floor Tile**

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools    UNIT NUMBER: 23771    BUILDING ID: 3970  
CITY/STATE: Chicago, Illinois    AHERA INSPECTOR: Benyamen Maradkel  
SCHOOL NAME: Herzl School    INSPECTION DATE: 8/30/2022  
ADDRESS: 3711 W. Douglas Blvd    IDPH LICENSE NO: 100-20411

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 011.5  
MATERIAL DESCRIPTION: 9" x 9" Green Floor Tile w/White Streaks  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: Abated    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 107

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Not observed 2022

Inspector's Signature:



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **011.5**

MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks**

MATERIAL LOCATION: **Room 107**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **011.6**  
MATERIAL DESCRIPTION: **9" x 9" Gray/Tan Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **212**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **011.6**

MATERIAL DESCRIPTION: **9" x 9" Gray/Tan Floor Tile**

MATERIAL LOCATION: **212**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **012.1**  
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/ Brown Specks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 110,111**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **012.1**

MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/ Brown Specks**

MATERIAL LOCATION: **Rooms 110,111**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **012.2**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Specks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 310 and Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **012.2**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Specks**

MATERIAL LOCATION: **Rooms 310 and Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **012.3**  
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile w/ White Speckles**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 209**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **012.3**

MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile w/ White Speckles**

MATERIAL LOCATION: **Room 209**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **013**  
MATERIAL DESCRIPTION: **1' x 1' Acoustical Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Auditorium not observed 1x1"" but present**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **013**  
MATERIAL DESCRIPTION: **1' x 1' Acoustical Ceiling Tile**  
MATERIAL LOCATION: **Auditorium not observed 1x1"" but present**  
MATERIAL QUANTITY: MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **014.1**  
MATERIAL DESCRIPTION: **9" x 9" Brown/Tan Floor Tile w/Red/Brown Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 307**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **014.1**

MATERIAL DESCRIPTION: **9" x 9" Brown/Tan Floor Tile w/Red/Brown Specks Mastic**

MATERIAL LOCATION: **Rooms 307**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **014.2**  
MATERIAL DESCRIPTION: **9" x 9" Off-White Floor Tile w/BI & Brown Spks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 309**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **014.2**

MATERIAL DESCRIPTION: **9" x 9" Off-White Floor Tile w/BI & Brown Spks Mastic**

MATERIAL LOCATION: **Room 309**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23771 BUIDLING ID: 3970  
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Benyamen Maradkel  
SCHOOL NAME: Herzl School INSPECTION DATE: 8/30/2022  
ADDRESS: 3711 W. Douglas Blvd IDPH LICENSE NO: 100-20411

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 014.3  
MATERIAL DESCRIPTION: 9" x 9" Dark Brown & Red Floor (Checkerboard) Mastic  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: Abated FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st Floor Corridor, 208

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Not observed 2022

Inspector's Signature:



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **014.3**

MATERIAL DESCRIPTION: **9" x 9" Dark Brown & Red Floor (Checkerboard) Mastic**

MATERIAL LOCATION: **1st Floor Corridor, 208**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **014.4**  
MATERIAL DESCRIPTION: **18" x 18" Black Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **014.4**

MATERIAL DESCRIPTION: **18" x 18" Black Floor Tile Mastic**

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **014.5**  
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 107**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **014.5**

MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks Mastic**

MATERIAL LOCATION: **Room 107**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **014.6**  
MATERIAL DESCRIPTION: **9" x 9" Gray/Tan Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 212**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **014.6**

MATERIAL DESCRIPTION: **9" x 9" Gray/Tan Floor Tile Mastic**

MATERIAL LOCATION: **Room 212**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools    UNIT NUMBER: 23771    BUILDING ID: 3970  
CITY/STATE: Chicago, Illinois    AHERA INSPECTOR: Benyamen Maradkel  
SCHOOL NAME: Herzl School    INSPECTION DATE: 8/30/2022  
ADDRESS: 3711 W. Douglas Blvd    IDPH LICENSE NO: 100-20411

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 015.1  
MATERIAL DESCRIPTION: 12" x 12" Off-White Floor Tile w/Brown & Gray Streaks Mastic  
HISTORICAL AHERA DAMAGE CATEGORY 6  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: Abated    FRIABLE: No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 110, 111, 308, 315, and 316**

MATERIAL QUANTITY: **2500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **015.1**  
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/Brown & Gray Streaks Mastic**  
MATERIAL LOCATION: **Rooms 110, 111, 308, 315, and 316**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **015.2**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 310, 311, kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Present in room 311 -700 SF Not present - 310, kitchen 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **015.2**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Specks Mastic**

MATERIAL LOCATION: **Rooms 310, 311, kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **015.3**  
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile w/White Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 209**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **015.3**

MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile w/White Specks Mastic**

MATERIAL LOCATION: **Room 209**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **016.1**  
MATERIAL DESCRIPTION: **9" x 9" Brown/Tan Floor Tile w/Red & Brown Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 300**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **016.1**

MATERIAL DESCRIPTION: **9" x 9" Brown/Tan Floor Tile w/Red & Brown Specks Mastic**

MATERIAL LOCATION: **Room 300**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **016.2**  
MATERIAL DESCRIPTION: **Bottom Layer of Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 300**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **016.2**

MATERIAL DESCRIPTION: **Bottom Layer of Floor Tile Mastic**

MATERIAL LOCATION: **Room 300**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **016.3**  
MATERIAL DESCRIPTION: **9" x 9" Brown/Tan Floor Tile w/Brown & White Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 202**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **016.3**

MATERIAL DESCRIPTION: **9" x 9" Brown/Tan Floor Tile w/Brown & White Specks Mastic**

MATERIAL LOCATION: **Room 202**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23771 BUIDLING ID: 3970  
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Benyamen Maradkel  
SCHOOL NAME: Herzl School INSPECTION DATE: 8/30/2022  
ADDRESS: 3711 W. Douglas Blvd IDPH LICENSE NO: 100-20411

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 016.4  
MATERIAL DESCRIPTION: 9" x 9" Off-White Floor Tile w/Brown,Blk & Red Mastic  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: Abated FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 203

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Not observed 2022

Inspector's Signature:



Date: 08/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **016.4**

MATERIAL DESCRIPTION: **9" x 9" Off-White Floor Tile w/Brown,Blk & Red Mastic**

MATERIAL LOCATION: **Room 203**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **017.1**  
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/Brown Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 301-308, 317-323**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **017.1**

MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/Brown Specks Mastic**

MATERIAL LOCATION: **Room 301-308, 317-323**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools    UNIT NUMBER: 23771    BUILDING ID: 3970  
CITY/STATE: Chicago, Illinois    AHERA INSPECTOR: Benyamen Maradkel  
SCHOOL NAME: Herzl School    INSPECTION DATE: 8/30/2022  
ADDRESS: 3711 W. Douglas Blvd    IDPH LICENSE NO: 100-20411

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 017.2  
MATERIAL DESCRIPTION: 12" x 12" Off White Floor Tile w/Brown & Gray Spks Mastic  
HISTORICAL AHERA DAMAGE CATEGORY 6  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: Abated    FRIABLE: No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 302**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **017.2**  
MATERIAL DESCRIPTION: **12" x 12" Off White Floor Tile w/Brown & Gray Spks Mastic**  
MATERIAL LOCATION: **Room 302**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **017.3**  
MATERIAL DESCRIPTION: **12"x12" Off White Floor Tile w/Blue Specks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **2nd Floor North Central Office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **017.3**

MATERIAL DESCRIPTION: **12"x12" Off White Floor Tile w/Blue Specks Mastic**

MATERIAL LOCATION: **2nd Floor North Central Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **017.4**  
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/White Spkles Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd Floor Meeting Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **017.4**

MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/White Spkles Mastic**

MATERIAL LOCATION: **2nd Floor Meeting Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23771 BUIDLING ID: 3970  
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Benyamen Maradkel  
SCHOOL NAME: Herzl School INSPECTION DATE: 8/30/2022  
ADDRESS: 3711 W. Douglas Blvd IDPH LICENSE NO: 100-20411

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 017.5  
MATERIAL DESCRIPTION: 12" x 12" Red -Brown Floor (Checkerboard) Mastic  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: Abated FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st Floor Corridor

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Not observed 2022

Inspector's Signature:



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **017.5**

MATERIAL DESCRIPTION: **12" x 12" Red -Brown Floor (Checkerboard) Mastic**

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **017.6**  
MATERIAL DESCRIPTION: **18" x 18" Black Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **017.6**

MATERIAL DESCRIPTION: **18" x 18" Black Floor Tile Mastic**

MATERIAL LOCATION: **1st Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **017.7**  
MATERIAL DESCRIPTION: **12" x 12" Off-White FloorTile w/White & Brown Spks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 101**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **017.7**

MATERIAL DESCRIPTION: **12" x 12" Off-White FloorTile w/White & Brown Spks Mastic**

MATERIAL LOCATION: **Room 101**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **018**  
MATERIAL DESCRIPTION: **Vibration isolation cloth**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Kitchen**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **018**  
MATERIAL DESCRIPTION: **Vibration isolation cloth**  
MATERIAL LOCATION: **1st Floor Kitchen**  
MATERIAL QUANTITY: MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **019**  
MATERIAL DESCRIPTION: **Boiler gaskets**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **019**  
MATERIAL DESCRIPTION: **Boiler gaskets**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **020**  
MATERIAL DESCRIPTION: **Linoleum mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd Floor Janitor's Closet and 3rd Floor Storage Closet (no access)**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **020**  
MATERIAL DESCRIPTION: **Linoleum mastic**  
MATERIAL LOCATION: **3rd Floor Janitor's Closet and 3rd Floor Storage Closet (no access)**  
MATERIAL QUANTITY: MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **021**  
MATERIAL DESCRIPTION: **Incinerator fire brick**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **021**

MATERIAL DESCRIPTION: **Incinerator fire brick**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **022**  
MATERIAL DESCRIPTION: **Building brick - Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of 1914 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **022**

MATERIAL DESCRIPTION: **Building brick - Non-AHERA**

MATERIAL LOCATION: **Exterior of 1914 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **023**  
MATERIAL DESCRIPTION: **Brick mortar -Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of 1914 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

---

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **023**

MATERIAL DESCRIPTION: **Brick mortar -Non-AHERA**

MATERIAL LOCATION: **Exterior of 1914 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **024**  
MATERIAL DESCRIPTION: **Building brick - Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of 1921 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **024**

MATERIAL DESCRIPTION: **Building brick - Non-AHERA**

MATERIAL LOCATION: **Exterior of 1921 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **025**  
MATERIAL DESCRIPTION: **Brick mortar - Non-AHERA**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of 1921 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **025**

MATERIAL DESCRIPTION: **Brick mortar - Non-AHERA**

MATERIAL LOCATION: **Exterior of 1921 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **026**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Gray Flecks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 324**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **026**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Gray Flecks**

MATERIAL LOCATION: **Room 324**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **027**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Gray Flecks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 324 (not observed)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **027**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Gray Flecks Mastic**

MATERIAL LOCATION: **Room 324 (not observed)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **028**  
MATERIAL DESCRIPTION: **4" Gray vinyl baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 324**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **028**  
MATERIAL DESCRIPTION: **4" Gray vinyl baseboard**  
MATERIAL LOCATION: **Room 324**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **029**  
MATERIAL DESCRIPTION: **4" Gray vinyl baseboard mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 324**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **029**

MATERIAL DESCRIPTION: **4" Gray vinyl baseboard mastic**

MATERIAL LOCATION: **Room 324**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **030**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ White Flecks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 224 and Speech Assistant Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **030**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ White Flecks**  
MATERIAL LOCATION: **Room 224 and Speech Assistant Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **031**  
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ White Flecks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 224 and Speech Assistant Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **031**

MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ White Flecks Mastic**

MATERIAL LOCATION: **Room 224 and Speech Assistant Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **032**  
MATERIAL DESCRIPTION: **4" Brown vinyl baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 224 and Speech Assistant Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

---

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **032**  
MATERIAL DESCRIPTION: **4" Brown vinyl baseboard**  
MATERIAL LOCATION: **Room 224 and Speech Assistant Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **033**  
MATERIAL DESCRIPTION: **4" Brown vinyl baseboard mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 224 and Speech Assistant Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

---

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **033**  
MATERIAL DESCRIPTION: **4" Brown vinyl baseboard mastic**  
MATERIAL LOCATION: **Room 224 and Speech Assistant Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **034**  
MATERIAL DESCRIPTION: **Ceramic wall tile adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 224 Bathrooms and 324 Bathrooms**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **034**  
MATERIAL DESCRIPTION: **Ceramic wall tile adhesive**  
MATERIAL LOCATION: **Room 224 Bathrooms and 324 Bathrooms**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **035**  
MATERIAL DESCRIPTION: **4" Black vinyl baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

---

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **035**  
MATERIAL DESCRIPTION: **4" Black vinyl baseboard**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **036**  
MATERIAL DESCRIPTION: **4" Black vinyl baseboard mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **036**

MATERIAL DESCRIPTION: **4" Black vinyl baseboard mastic**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **037**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/Dark Brown Streaks**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 120**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **037**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/Dark Brown Streaks**  
MATERIAL LOCATION: **Room 120**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **038**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/Dark Brown Streaks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 120**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **038**  
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/Dark Brown Streaks Mastic**  
MATERIAL LOCATION: **Room 120**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **039**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue Floor Tile w/ White Specks**  
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON: **Other**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS: **damaged in auditorium**

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **039**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue Floor Tile w/ White Specks**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **6** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **040**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue Floor Tile w/ White Spks Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **040**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue Floor Tile w/ White Spks Mastic**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **041**  
MATERIAL DESCRIPTION: **Vault door liner**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Third Floor Across From 310**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **041**

MATERIAL DESCRIPTION: **Vault door liner**

MATERIAL LOCATION: **Third Floor Across From 310**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **042**  
MATERIAL DESCRIPTION: **Gray carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **672** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **042**  
MATERIAL DESCRIPTION: **Gray carpet mastic**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **672** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **043**  
MATERIAL DESCRIPTION: **12" x 12" Blue Mix Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 128 and Office by 118**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **043**  
MATERIAL DESCRIPTION: **12" x 12" Blue Mix Floor Tile**  
MATERIAL LOCATION: **Room 128 and Office by 118**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **044**  
MATERIAL DESCRIPTION: **12" x 12" Blue Mix Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 128 and Office by 118**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **044**

MATERIAL DESCRIPTION: **12" x 12" Blue Mix Floor Tile Mastic**

MATERIAL LOCATION: **Room 128 and Office by 118**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **045**  
MATERIAL DESCRIPTION: **12" x 12" Blue/White Checkerboard Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **045**

MATERIAL DESCRIPTION: **12" x 12" Blue/White Checkerboard Floor Tile**

MATERIAL LOCATION: **Main Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **046**  
MATERIAL DESCRIPTION: **12" x 12" Blue/White Checkerboard Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **046**  
MATERIAL DESCRIPTION: **12" x 12" Blue/White Checkerboard Floor Tile Mastic**  
MATERIAL LOCATION: **Main Office**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **047**  
MATERIAL DESCRIPTION: **Lab table tops**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 322, 303, 320**  
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS: **Not observed in rooms 320, 322 - 2022**

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **047**  
MATERIAL DESCRIPTION: **Lab table tops**  
MATERIAL LOCATION: **Room 322, 303, 320**  
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **048**  
MATERIAL DESCRIPTION: **12" x 12" White w/Multi-Color Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 303 and 317**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **048**

MATERIAL DESCRIPTION: **12" x 12" White w/Multi-Color Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 303 and 317**

MATERIAL QUANTITY:

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **049**  
MATERIAL DESCRIPTION: **12" x 12" White w/Multi-Color Streaks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 303 and 317**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **049**  
MATERIAL DESCRIPTION: **12" x 12" White w/Multi-Color Streaks Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 303 and 317**  
MATERIAL QUANTITY: MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **050**  
MATERIAL DESCRIPTION: **12" x 12" White w/Colored Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor North Vestibules**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **050**  
MATERIAL DESCRIPTION: **12" x 12" White w/Colored Streaks Floor Tile**  
MATERIAL LOCATION: **1st Floor North Vestibules**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **051**  
MATERIAL DESCRIPTION: **12" x 12" White w/Colored Streaks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor North Vestibules**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **051**

MATERIAL DESCRIPTION: **12" x 12" White w/Colored Streaks Floor Tile Mastic**

MATERIAL LOCATION: **1st Floor North Vestibules**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **Chalk boards**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 301-310,102,104-110,201-210**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not observed 2022 - could be behind marker boards**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Chalk boards**

MATERIAL LOCATION: **Rooms 301-310,102,104-110,201-210**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue w/Marbling Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 317 (not observed)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **12" x 12" Light Blue w/Marbling Streaks Floor Tile**

MATERIAL LOCATION: **Room 317 (not observed)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools    UNIT NUMBER: 23771    BUILDING ID: 3970  
CITY/STATE: Chicago, Illinois    AHERA INSPECTOR: Benyamen Maradkel  
SCHOOL NAME: Herzl School    INSPECTION DATE: 8/30/2022  
ADDRESS: 3711 W. Douglas Blvd    IDPH LICENSE NO: 100-20411

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 53  
MATERIAL DESCRIPTION: 12" x 12" Light Blue w/Marbling Streaks Floor Tile Mastic  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: Abated    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 317

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Not observed 2022

Inspector's Signature:



Date: 08/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **12" x 12" Light Blue w/Marbling Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Room 317**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **Blue white ceramic floor tile grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st, 2nd, 3rd, Floor-Boys/Girls Wash Room**  
MATERIAL QUANTITY: **5400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **Blue white ceramic floor tile grout**  
MATERIAL LOCATION: **1st, 2nd, 3rd, Floor-Boys/Girls Wash Room**  
MATERIAL QUANTITY: **5400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **Blue, white ceramic floor tile adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st, 2nd, 3rd, Floors-Boys/Girls Wash Room**  
MATERIAL QUANTITY: **5400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **Blue, white ceramic floor tile adhesive**  
MATERIAL LOCATION: **1st, 2nd, 3rd, Floors-Boys/Girls Wash Room**  
MATERIAL QUANTITY: **5400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **12" x 12" Beige w/Gray Spots Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 119**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **56**

MATERIAL DESCRIPTION: **12" x 12" Beige w/Gray Spots Floor Tile**

MATERIAL LOCATION: **Room 119**

MATERIAL QUANTITY:

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **12" x 12" Light Gray w/Dark Gray Spots Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON: **Other**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st Floor Hallways, 149**  
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS: **damaged in 1st floor vestibule door 20**

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **12" x 12" Light Gray w/Dark Gray Spots Floor Tile**  
MATERIAL LOCATION: **1st Floor Hallways, 149**  
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **6** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**  
MATERIAL DESCRIPTION: **12" x 12" Light Gray w/Dark Gray Spots Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Hallways, 149**

MATERIAL QUANTITY: **10000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **58**  
MATERIAL DESCRIPTION: **12" x 12" Light Gray w/Dark Gray Spots Floor Tile Mastic**  
MATERIAL LOCATION: **1st Floor Hallways, 149**  
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**  
MATERIAL DESCRIPTION: **Carpet square glue**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Offices/principal office**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **59**  
MATERIAL DESCRIPTION: **Carpet square glue**  
MATERIAL LOCATION: **Main Offices/principal office**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**  
MATERIAL DESCRIPTION: **12" x 12" Light Beige w/Light Spots Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON: **Other**  
DISTURBANCE POTENTIAL: **HIGH**  
MATERIAL LOCATION: **1st and 2nd Floor Classrooms , lunchroom (110)**  
MATERIAL QUANTITY: **32000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **SF**  
COMMENTS: **damaged in lunchroom**

Inspector's Signature: \_\_\_\_\_



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **60**  
MATERIAL DESCRIPTION: **12" x 12" Light Beige w/Light Spots Floor Tile**  
MATERIAL LOCATION: **1st and 2nd Floor Classrooms , lunchroom (110)**  
MATERIAL QUANTITY: **32000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **4** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **12" x 12" Light Beige w/Light Spots Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st and 2nd Floor Classrooms, lunchroom (110)**  
MATERIAL QUANTITY: **32000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **12" x 12" Light Beige w/Light Spots Floor Tile Mastic**  
MATERIAL LOCATION: **1st and 2nd Floor Classrooms, lunchroom (110)**  
MATERIAL QUANTITY: **32000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**  
MATERIAL DESCRIPTION: **Brown flooring under wood floor**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd Floor Gym**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUILDING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **62**

MATERIAL DESCRIPTION: **Brown flooring under wood floor**

MATERIAL LOCATION: **3rd Floor Gym**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**  
MATERIAL DESCRIPTION: **Paper under wood underlayment**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 108, 109, 110, 114, 118, 123, 207, 210, 211, 212, and 2nd Floor Offices (not observed)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **63**

MATERIAL DESCRIPTION: **Paper under wood underlayment**

MATERIAL LOCATION: **Rooms 108, 109, 110, 114, 118, 123, 207, 210, 211, 212, and 2nd Floor Offices (not observed)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**  
MATERIAL DESCRIPTION: **Paper under wood underlayment**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 107, 116, 204, 205, 208, 209, and 244 (not observed)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **64**

MATERIAL DESCRIPTION: **Paper under wood underlayment**

MATERIAL LOCATION: **Rooms 107, 116, 204, 205, 208, 209, and 244 (not observed)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**  
MATERIAL DESCRIPTION: **12" x 12" Gray and White Mottled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms Throughout 3rd Floor**

MATERIAL QUANTITY: **20000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **65**  
MATERIAL DESCRIPTION: **12" x 12" Gray and White Mottled Floor Tile**  
MATERIAL LOCATION: **Classrooms Throughout 3rd Floor**  
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **66**  
MATERIAL DESCRIPTION: **12" x 12" Gray and White Mottled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms Throughout 3rd Floor**

MATERIAL QUANTITY: **20000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **66**  
MATERIAL DESCRIPTION: **12" x 12" Gray and White Mottled Floor Tile Mastic**  
MATERIAL LOCATION: **Classrooms Throughout 3rd Floor**  
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **67**  
MATERIAL DESCRIPTION: **2' x 2' White Fissured Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 124, Auditorium**  
MATERIAL QUANTITY: **1750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **67**  
MATERIAL DESCRIPTION: **2' x 2' White Fissured Ceiling Tile**  
MATERIAL LOCATION: **Room 124, Auditorium**  
MATERIAL QUANTITY: **1750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68**  
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Remove**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY: **120**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **68**  
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile**  
MATERIAL LOCATION: **Engineer's Office**  
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Remove**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **69**  
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Remove**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Engineer's office**  
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **69**  
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile Mastic**  
MATERIAL LOCATION: **Engineer's office**  
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Remove**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**  
MATERIAL DESCRIPTION: **Fiberglass Insulation on Boiler**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **A**

MATERIAL DESCRIPTION: **Fiberglass Insulation on Boiler**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**  
MATERIAL DESCRIPTION: **Fiberglass tank insulation**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Pump Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Damaged in pump room**

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **B**

MATERIAL DESCRIPTION: **Fiberglass tank insulation**

MATERIAL LOCATION: **Pump Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Fiberglass pipe insulation**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

---

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **C**

MATERIAL DESCRIPTION: **Fiberglass pipe insulation**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Hard Joint Compound on Fiberglass Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**  
MATERIAL LOCATION: **Throughout 1914 Facility including Kitchen & Pipe Chases**  
MATERIAL QUANTITY: **15** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **15** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **Hard Joint Compound on Fiberglass Pipe Insulation**

MATERIAL LOCATION: **Throughout 1914 Facility including Kitchen & Pipe Chases**

MATERIAL QUANTITY: **15** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Water meter packing - abated**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Water meter packing - abated**

MATERIAL LOCATION: **Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Cardboard pipe insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON: **Deterioration**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Above 1st Floor ceiling**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Cardboard pipe insulation**  
MATERIAL LOCATION: **Above 1st Floor ceiling**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Hard Joint Compound on Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Above 1st Floor Ceiling**

MATERIAL QUANTITY: **150**

MATERIAL UNITS: **EA**

DAMAGE QUANTITY:

DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Hard Joint Compound on Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Above 1st Floor Ceiling**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **EA**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Preformed pipe insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Any remaining friable ACM or friable suspect ACM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON: **Other**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Tunnel**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS: **Damage by entrance of tunnel**

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Preformed pipe insulation**  
MATERIAL LOCATION: **Tunnel**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **6** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **Preformed pipe joint insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Tunnel**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **Preformed pipe joint insulation**  
MATERIAL LOCATION: **Tunnel**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23771 BUIDLING ID: 3970  
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Benyamen Maradkel  
SCHOOL NAME: Herzl School INSPECTION DATE: 8/30/2022  
ADDRESS: 3711 W. Douglas Blvd IDPH LICENSE NO: 100-20411

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: J  
MATERIAL DESCRIPTION: Aircell pipe insulation  
HISTORICAL AHERA DAMAGE CATEGORY 1 Any remaining friable ACBM or friable suspect ACBM  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: Follow O&M Plan  
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: Other  
DISTURBANCE POTENTIAL: LOW  
MATERIAL LOCATION: Throughout 1914 Facility  
MATERIAL QUANTITY: 500 MATERIAL UNITS: LF  
DAMAGE QUANTITY: DAMAGE UNITS: LF  
COMMENTS: Damaged in lunchroom (110)

Inspector's Signature:



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **Aircell pipe insulation**  
MATERIAL LOCATION: **Throughout 1914 Facility**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **4** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Aircell pipe fitting**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1914 Facility**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **EA**  
DAMAGE QUANTITY: DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Aircell pipe fitting**  
MATERIAL LOCATION: **Throughout 1914 Facility**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **EA**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**  
MATERIAL DESCRIPTION: **Fittings on Fiberglass Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1921 Facility**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **L**  
MATERIAL DESCRIPTION: **Fittings on Fiberglass Pipe Insulation**  
MATERIAL LOCATION: **Throughout 1921 Facility**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **Cardboard pipe insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **Cardboard pipe insulation**  
MATERIAL LOCATION: **1st Floor**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**  
MATERIAL DESCRIPTION: **Hard Joint Compound on Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st Floor**  
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **N**

MATERIAL DESCRIPTION: **Hard Joint Compound on Cardboard Pipe Insulation**

MATERIAL LOCATION: **1st Floor**

MATERIAL QUANTITY: **30**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**  
MATERIAL DESCRIPTION: **Preformed pipe insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st Floor**  
MATERIAL QUANTITY: **5** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **0**

MATERIAL DESCRIPTION: **Preformed pipe insulation**

MATERIAL LOCATION: **1st Floor**

MATERIAL QUANTITY: **5**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P**  
MATERIAL DESCRIPTION: **Preformed pipe joint insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st Floor**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**



# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **P**  
MATERIAL DESCRIPTION: **Preformed pipe joint insulation**  
MATERIAL LOCATION: **1st Floor**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q**  
MATERIAL DESCRIPTION: **Aircell pipe insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1921 Facility**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **100** DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **Q**  
MATERIAL DESCRIPTION: **Aircell pipe insulation**  
MATERIAL LOCATION: **Throughout 1921 Facility**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School** INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **R**  
MATERIAL DESCRIPTION: **Hard Joint Compound on Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout 1921 Facility & Tunnel**

MATERIAL QUANTITY: **25**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/30/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUIDLING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

---

HOMOGENEOUS AREA: **R**

MATERIAL DESCRIPTION: **Hard Joint Compound on Aircell Pipe Insulation**

MATERIAL LOCATION: **Throughout 1921 Facility & Tunnel**

MATERIAL QUANTITY: **25**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23771**    BUILDING ID: **3970**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School**    INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd**    IDPH LICENSE NO: **100-20411**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **71**  
MATERIAL DESCRIPTION: **12" x 12" Gray & White Mix Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 301-310, 315-323, 315A, 330A, Kitchen**  
MATERIAL QUANTITY: **5000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUILDING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

HOMOGENEOUS AREA: **71**  
MATERIAL DESCRIPTION: **12" x 12" Gray & White Mix Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 301-310, 315-323, 315A, 330A, Kitchen**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23771**      BUILDING ID: **3970**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School**      INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd**      IDPH LICENSE NO: **100-20411**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **12.2**  
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Specks w/ Mastic**  
MATERIAL LOCATION: **Rooms 310, 311, kitchen**  
MATERIAL QUANTITY: **700**      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION: **Damaged**  
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**  
ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE QUANTITY: **4**      DAMAGE REASON:  
DAMAGE UNITS: **SF**

COMMENTS:  
Damage in Room 311, not observed in Room 310, kitchen - 2022

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022



# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23771**      BUILDING ID: **3970**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School**      REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd**      IDPH LICENSE NO: **100-20411**

HOMOGENEOUS AREA: **12.2**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Gray Specks w/ Mastic**

MATERIAL LOCATION: **Rooms 310, 311, kitchen**

MATERIAL QUANTITY: **700**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **4**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### COMMENTS:

Sample to determine ACM content.

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23771**    BUILDING ID: **3970**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School**    INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd**    IDPH LICENSE NO: **100-20411**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **70**  
MATERIAL DESCRIPTION: **12" x 12" Gray & White Mix Floor Tile**  
MATERIAL LOCATION: **Rooms 301-310, 315-323, 315A, 330A, Kitchen**  
MATERIAL QUANTITY: **5000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23771** BUILDING ID: **3970**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School** REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd** IDPH LICENSE NO: **100-20411**

HOMOGENEOUS AREA: **70**  
MATERIAL DESCRIPTION: **12" x 12" Gray & White Mix Floor Tile**  
MATERIAL LOCATION: **Rooms 301-310, 315-323, 315A, 330A, Kitchen**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23771**    BUILDING ID: **3970**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Benyamen Maradkel**  
SCHOOL NAME: **Herzl School**    INSPECTION DATE: **8/30/2022**  
ADDRESS: **3711 W. Douglas Blvd**    IDPH LICENSE NO: **100-20411**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **17.3**  
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/Blue Specks Mastic**  
MATERIAL LOCATION: **2nd Floor North Central Office (217C)**  
MATERIAL QUANTITY: **200**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION: **No Damage**  
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 08/30/2022

# Chicago Public Schools

Carnow, Conibear and Associates

**2022 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23771**      BUILDING ID: **3970**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Herzl School**      REVIEW DATE: **9/12/2022**  
ADDRESS: **3711 W. Douglas Blvd**      IDPH LICENSE NO: **100-20411**

HOMOGENEOUS AREA: **17.3**  
MATERIAL DESCRIPTION: **12" x 12" Off-White Floor Tile w/Blue Specks Mastic**  
MATERIAL LOCATION: **2nd Floor North Central Office (217C)**  
MATERIAL QUANTITY: **200**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### COMMENTS:

Sample to determine ACM content.

Management Planner's Signature: \_\_\_\_\_



Date: **09/12/2022**

# APPENDIX B

## **Inspector and Management Planner Licenses**

---

# Benyamen Maradkel

Illinois Licensed Building Inspector



**ASBESTOS  
PROFESSIONAL  
LICENSE**

**ID NUMBER**  
**100 - 20411**

**ISSUED**  
**3/17/2022**

**EXPIRES**  
**05/15/2023**

**BENYAMEN C MARADKEL**  
**706 W HACKBERRY DR**  
**ARLINGTON HEIGHTS, IL 6000**  
*Environmental Health*



**ENDORSEMENTS**

INSPECTOR

**EXPIRES**

3/9/2023

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Benyamen Maradkel**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/9/2022

Exam Date: 3/9/2022

Expiration Date: 3/9/2023

Certificate Number: BIR2203090703

Kathy DeSalvo, Director





OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: MPR2111012581

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/3/2022

Exam Date: 11/3/2022

Expiration Date: 11/3/2023

Certificate Number: MPR2211033519

  
Kathy DeSalvo, Director



# ASBESTOS PROFESSIONAL LICENSE

ID NUMBER

**100 - 19466**

ISSUED

**4/22/2022**

EXPIRES

**05/15/2023**

**EVAN I CHRISTIAN**  
**1119 N HOYNE AVE, APT 1**  
**CHICAGO, IL 60622**

Environmental Health



## ENDORSEMENTS

## TC EXPIRES

INSPECTOR

10/8/2022

MANAGEMENT PLANNER

11/1/2022

PROJECT MANAGER

3/28/2023

AIR SAMPLING PROFESSIONAL


**Alteration of this license shall result in legal action**

This license issued under authority of the State of Illinois

Department of Public Health

This license is valid only when accompanied by a valid

training course certificate.

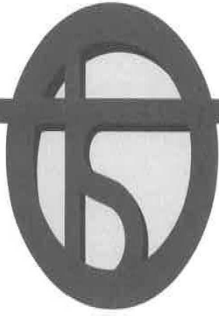

OCCUPATIONAL TRAINING & SUPPLY, INC.

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 10/8/2021

Exam Date: 10/8/2021

Expiration Date: 10/8/2022

Certificate Number: BIR2110082264

Kathy DeSalvo, Director



# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/11/2022

Exam Date: 11/11/2022

Expiration Date: 11/11/2023

Certificate Number: BIR2211113639

Kathy DeSalvo, Director -

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---



## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed