

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2370
SCHOOL NAME: Nettelhorst School
ADDRESS OF SCHOOL: 3252 N Broadway Street
CITY: Chicago, IL, 60657

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **9/11/2019**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 9/19/2022 ENROLLMENT 628
IDPH INSPECTOR LICENSE NUMBER: 100-11093
IDPH LICENSED INSPECTOR NAME (Please Print): David Avila
IDPH MP LICENSE NUMBER: 100-04019
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Arturo Saenz

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074



10/13/2022

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Nettelhorst School

3252 N Broadway Street
Chicago, IL, 60657

Unit: 24661
Building ID: 5070

IDPH ID Number: 14-016-2990-2370

REPORT DATE:

Thursday, October 13, 2022

Prepared for:

Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:

Specialty Consulting, Inc.

2942 W. Van Buren Street

Chicago, IL, 60612

Phone (312) 319-7575

Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

10/13/2022

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 24661 Region: 01 IDPH ID: 14-016-2990-2370

School: Nettelhorst School Building ID: 5070

Address: 3252 N Broadway Street

Chicago, IL, 60657

Building Contact: Bergendahl, David

Contact Phone: 7737096245

Current Building Owners: Chicago Public Schools

Reinspection Date: 9/19/2022

Review Date: 10/13/2022

Inspector: David Avila

Inspector IDPH License: 100-11093

Management Planner: Arturo Saenz

Management Planner IDPH License: 100-04019

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.



Arturo Saenz
100-04019

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: October 13, 2022

RE: Nettelhorst School, Unit 24661
3252 N Broadway Street
Chicago, IL, 60657

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Nettelhorst School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Nettelhorst School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Nettelhorst School Unit: 24661 Region: 01
Address: 3252 N Broadway Street Chicago, IL, 60657
IDPH ID: 14-016-2990-2370 Building ID: 5070
Contact: Bergendahl, David Phone: 7737096245

2. Description of Facility

Original Construction: 1937 Additional Construction: 1893,1913,1954
Total Square Footage: 19638 No of Floors: 2
Current Occupancy: 628

3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602


4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575 Fax: (312) 319-7580

5. Inspector

Inspector Name: David Avila


Inspector IDPH license # 100-11093
Reinspection Date: 9/19/2022

Signature: 
Date: 9/19/2022

6. Management Planner

Management Planner Name: Arturo Saenz

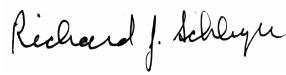
Management Planner IDPH license # 100-04019

Signature: 
Date: 10/13/2022

7. Review Date: 10/13/2022

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 10/13/2022

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Nettelhorst School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 5070:

B. The following new homogenous areas have been identified for Building 5070:

46	12" x 12" Light blue w/ specks VFT
46A	Mastic

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

08	Hard Coat Plaster
09	Hard Coat Plaster
10	Hard Coat Plaster
11	Hard Coat Plaster
12	12" x 12" Green VFT (Under Hardwood Floor)
15	12" x 12" Brown w/White Streaks VFT Mastic
17	12" x 12" Green VFT Mastic (Under Hardwood Floor)
19	12" x 12" Off White w/Tan Streaks VFT THESE TILES HAVE BEEN PAINTED OVER
19A	12" x 12" Off White w/Tan Streaks VFT Mastic THESE TILES HAVE BEEN PAINTED OVER
20	12" x 12" Purplish Grey VFT THESE TILES HAVE BEEN PAINTED OVER
20A	12" x 12" Purplish Grey VFT Mastic THESE TILES HAVE BEEN PAINTED OVER
21	12" x 12" Light Brown w/Gray Streaks VFT
21A	12" x 12" Light Brown w/Gray Streaks VFT Mastic
22	9" x 9" White VFT
23	9" x 9" Cream VFT
24	12" x 12" Gray w/Dark Gray Streaks VFT
24A	12" x 12" Gray w/Dark Gray Streaks VFT Mastic
25A	12" x 12" Brown w/Dark Brown Streaks VFT Mastic
30	Carpet Mastic
31	Gray Linoleum
31A	Gray Linoleum Mastic
32	Terrazzo
33	Terrazzo
34	12" x 12" Off-White w/Tan Specks VFT
34A	12" x 12" Off-White w/Tan Specks VFT Mastic
35	12" x 12" White w/Beige Streaks VFT
35A	12" x 12" White w/Beige Streaks VFT Mastic
36	12" x 12" White w/Beige Specks VFT
36A	12" x 12" White w/Beige Specks VFT Mastic
37	12" x 12" White w/ gray & light gray specs VFT
37A	12" x 12" White w/ gray & light gray specs VFT - Mastic
38	12" x 12" Dark Green VFT
38A	12" x 12" Dark Green VFT Mastic
39	12" x 12" Off White w/ Tan Streaks VFT
39A	12" x 12" Off White w/ Tan Streaks VFT Mastic

40	12" x 12" Tan w/ light tan streaks VFT
40A	12" x 12" Tan w/ light tan streaks VFT Mastic
41	Multicolor Linoleum
41A	Multicolor Linoleum Mastic
42	12" x 12" Tan w/ White Specks VFT
42A	12" x 12" Tan w/ White Specks VFT Mastic
43	12" x 12" Blue w/ White Specks VFT
43A	12" x 12" Blue w/ White Specks VFT Mastic
44	2' x 4' White Textured Ceiling Tile
45	2' x 4' White Textured Ceiling Tile
46	12" x 12" Light blue w/ specks VFT
46A	Mastic
J	Lab Tops (Table/Countertops)

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by David Avila, IDPH License # 100-11093. The Management Plan was updated by Arturo Saenz, IDPH License # 100-04019. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Nettelhorst School Building 5070 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
04	12" x 12" Brown w/White Streaks VFT	1,350	SF	Room 305A, 303 - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05	9" x 9" Tan w/Brown Spots VFT	650	SF	Clerk's Office & Public Office (Both Under Carpet) - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08	Hard Coat Plaster	15,000	SF	Throughout - 1893 Bldg.	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
09	Hard Coat Plaster	2,500	SF	Throughout - 1911 Bldg.	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
10	Hard Coat Plaster	15,000	SF	Throughout - 1937 Bldg.	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
11	Hard Coat Plaster	8,000	SF	Throughout - 1953 Bldg.	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
12	12" x 12" Green VFT (Under Hardwood Floor)	2,000	SF	Auditorium - 1911 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	12" x 12" Brown w/White Streaks VFT Mastic	1,350	SF	Room 305A, 303 - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	9" x 9" Tan w/Brown Spots VFT Mastic	650	SF	Clerk's Office & Public Office (Under Carpet) - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	12" x 12" Green VFT Mastic (Under Hardwood Floor)	2,000	SF	Auditorium - 1911 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12" x 12" Off White w/Tan Streaks VFT THESE TILES HAVE BEEN PAINTED OVER	400	SF	Teacher's Cafeteria - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19A	12" x 12" Off White w/Tan Streaks VFT Mastic THESE TILES HAVE BEEN PAINTED OVER	400	SF	Teacher's Cafeteria - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	12" x 12" Purplish Grey VFT THESE TILES HAVE BEEN PAINTED OVER	600	SF	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20A	12" x 12" Purplish Grey VFT Mastic THESE TILES HAVE BEEN PAINTED OVER	600	SF	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12" x 12" Light Brown w/Gray Streaks VFT	2,300	SF	Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21A	12" x 12" Light Brown w/Gray Streaks	2,300	SF	Rooms 101 & 107.	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	VFT Mastic			3rd Floor Corridor - 1893 Bldg. (Under HA#35A)								potential for damage		
22	9" x 9" White VFT	400	SF	Principal's Office (Under Carpet) - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22A	9" x 9" White VFT Mastic	400	SF	Principal's Office (Under Carpet) - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	9" x 9" Cream VFT	2,500	SF	2nd Floor Corridors - 1893 Bldg. (Under HA#35A)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23A	9" x 9" Cream VFT Mastic	2,500	SF	2nd Floor Corridors - 1893 Bldg. (Under HA#35A)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12" x 12" Gray w/Dark Gray Streaks VFT	1,500	SF	Rooms 201 & 204 & Coat Room - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24A	12" x 12" Gray w/Dark Gray Streaks VFT Mastic	1,500	SF	Rooms 201 & 204 & Coat Room - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12" x 12" Brown w/Dark Brown Streaks VFT	650	SF	Room 302 & Coat Room - 1893 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25A	12" x 12" Brown w/Dark Brown Streaks VFT Mastic	650	SF	Room 302 & Coat Room - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	12" x 12" White VFT (Abated)			1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.	ABATED	MISC								
26A	12" x 12" White VFT Mastic (Abated)			1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.	ABATED	MISC								
28	12" x 12" White w/ Specks VFT (Abated)			Room 312 & Toilet - 1953 Bldg.	ABATED	MISC								
28A	12" x 12" White w/ Specks VFT Mastic (Abated)			Room 312 & Toilet - 1953 Bldg.	ABATED	MISC								
29	12" x 12" Tan w/ Brown Spots VFT	2,000	SF	Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toilet room next to Room 212, 314, 316 - 1953 Bldg.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29A	12" x 12" Tan w/ Brown Spots VFT Mastic	2,000	SF	Rooms 112, 114,	CHR	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				116, 212, 214; Room 216 (under laminated wood floor); Toilet room next to Room 212, 314, 316 - 1953 Bldg.								potential for damage		
30	Carpet Mastic	3,000	SF	Rooms 209, 211 and 213 (Library All Three Rooms) - 1911 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	Gray Linoleum	500	SF	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31A	Gray Linoleum Mastic	500	SF	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	Terrazzo	1,500	SF	Stairwell - 1953 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	Terrazzo	1,600	SF	Stairwell - 1937 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12" x 12" Off-White w/Tan Specks VFT	2,000	SF	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34A	12" x 12" Off-White w/Tan Specks VFT Mastic	2,000	SF	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	12" x 12" White w/Beige Streaks VFT	5,000	SF	2nd and 3rd Floor Corridors - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35A	12" x 12" White w/Beige Streaks VFT Mastic	5,000	SF	2nd and 3rd Floor Corridors - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	12" x 12" White w/Beige Specks VFT	900	SF	Room 205 and Wardrobe - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36A	12" x 12" White w/Beige Specks VFT Mastic	900	SF	Room 205 and Wardrobe - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
37	12" x 12" White w/ gray & light gray specs VFT	820	SF	Room 305, Gym Entry - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37A	12" x 12" White w/ gray & light gray specs VFT - Mastic	820	SF	Room 305, Gym Entry - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12" x 12" Dark Green VFT	1,800	SF	1st, 2nd, and 3rd Floor Corridors - 1953 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38A	12" x 12" Dark Green VFT Mastic	1,800	SF	1st, 2nd, and 3rd Floor Corridors - 1953 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	12" x 12" Off White w/ Tan Streaks VFT	2,000	SF	1st, 2nd, 3rd Floor Corridors - 1937 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39A	12" x 12" Off White w/ Tan Streaks VFT Mastic	2,000	SF	1st, 2nd, 3rd Floor Corridors - 1937 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	12" x 12" Tan w/ light tan streaks VFT	150	SF	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40A	12" x 12" Tan w/ light tan streaks VFT Mastic	150	SF	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	Multicolor Linoleum	2,000	SF	4th Floor Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41A	Multicolor Linoleum Mastic	2,000	SF	4th Floor Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12" x 12" Tan w/ White Specks VFT	15	SF	Room 302 (Replacement Patches) - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42A	12" x 12" Tan w/ White Specks VFT Mastic	15	SF	Room 302 (Replacement Patches) - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	12" x 12" Blue w/ White Specks VFT	15	SF	Room 302 (Replacement Patches)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43A	12" x 12" Blue w/ White Specks VFT Mastic	15	SF	Room 302 (Replacement Patches)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	2' x 4' White Textured Ceiling Tile	600	SF	1st and 2nd Floor Boy's Bathrooms -	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				1911 Bldg.										
45	2' x 4' White Textured Ceiling Tile	50	SF	Room 101 Bathroom - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	12" x 12" Light blue w/ specks VFT	800	SF	Room 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
46A	Mastic	800	SF	Room 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
J	Lab Tops (Table/Countertops)	12	EA	Room 305 - 1893 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
K	Aicell Pipe Insulation	800	LF	Above 1st Floor Corridor Ceiling - 1937 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
L	MJP E/F/V on Aircell Pipe Insulation	30	FITTING	Above 1st Floor Corridor Ceiling - 1937 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
M	Cardboard Pipe Insulation	750	LF	Above 1st Floor Corridor Ceiling - 1937 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
N	MJP E/F/V on Cardboard Pipe Insulation	25	FITTING	Above 1st Floor Corridor Ceiling - 1937 Bldg.	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 9/19/2022
Inspector Name David Avila
100-11093 5/15/2023
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
04	
05	
08	
09	
10	
11	
12	
15	
16	
17	
19	
19A	
20	
20A	
21	
21A	
22	
22A	
23	
23A	
24	
24A	
25	
25A	

Chicago Public Schools

School Nettelhorst School Unit 24661 Building ID 5070

Address 3252 N Broadway Street Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
26	
26A	
28	
28A	
29	
29A	
30	
31	
31A	
32	
33	
34	
34A	
35	
35A	
36	
36A	
37	
37A	
38	
38A	
39	
39A	
40	
40A	
41	
41A	
42	
42A	

Chicago Public Schools

School Nettelhorst School **Unit** 24661 **Building ID** 5070

Address 3252 N Broadway Street **Region** 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
43	
43A	
44	
45	
46	
46A	
J	
K	
L	
M	
N	

Table II

Management Planner's Review

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
04	12" x 12" Brown w/White Streaks VFT	1,350	SF	Room 305A, 303 - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	9" x 9" Tan w/Brown Spots VFT	650	SF	Clerk's Office & Public Office (Both Under Carpet) - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	Hard Coat Plaster	15,000	SF	Throughout - 1893 Bldg.	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	Hard Coat Plaster	2,500	SF	Throughout - 1911 Bldg.	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	Hard Coat Plaster	15,000	SF	Throughout - 1937 Bldg.	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	Hard Coat Plaster	8,000	SF	Throughout - 1953 Bldg.	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	12" x 12" Green VFT (Under Hardwood Floor)	2,000	SF	Auditorium - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12" x 12" Brown w/White Streaks VFT Mastic	1,350	SF	Room 305A, 303 - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	9" x 9" Tan w/Brown Spots VFT Mastic	650	SF	Clerk's Office & Public Office (Under Carpet) - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	12" x 12" Green VFT Mastic (Under Hardwood Floor)	2,000	SF	Auditorium - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12" x 12" Off White w/Tan Streaks VFT THESE TILES HAVE BEEN PAINTED OVER	400	SF	Teacher's Cafeteria - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19A	12" x 12" Off White w/Tan Streaks VFT Mastic THESE TILES HAVE BEEN PAINTED OVER	400	SF	Teacher's Cafeteria - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12" x 12" Purplish Grey VFT THESE TILES HAVE BEEN PAINTED OVER	600	SF	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20A	12" x 12" Purplish Grey VFT Mastic THESE TILES HAVE BEEN PAINTED OVER	600	SF	Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12" x 12" Light Brown w/Gray Streaks VFT	2,300	SF	Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21A	12" x 12" Light Brown w/Gray Streaks VFT Mastic	2,300	SF	Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35A)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	9" x 9" White VFT	400	SF	Principal's Office (Under Carpet) - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22A	9" x 9" White VFT Mastic	400	SF	Principal's Office (Under Carpet) - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	9" x 9" Cream VFT	2,500	SF	2nd Floor Corridors - 1893 Bldg. (Under HA#35A)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23A	9" x 9" Cream VFT Mastic	2,500	SF	2nd Floor Corridors - 1893 Bldg. (Under HA#35A)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12" x 12" Gray w/Dark Gray Streaks VFT	1,500	SF	Rooms 201 & 204 & Coat Room - 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
 Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Bldg.							
24A	12" x 12" Gray w/Dark Gray Streaks VFT Mastic	1,500	SF	Rooms 201 & 204 & Coat Room - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12" x 12" Brown w/Dark Brown Streaks VFT	650	SF	Room 302 & Coat Room - 1893 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25A	12" x 12" Brown w/Dark Brown Streaks VFT Mastic	650	SF	Room 302 & Coat Room - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12" x 12" White VFT (Abated)			1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.	Abated	MISC					
26A	12" x 12" White VFT Mastic (Abated)			1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.	Abated	MISC					
28	12" x 12" White w/ Specks VFT (Abated)			Room 312 & Toilet - 1953 Bldg.	Abated	MISC					
28A	12" x 12" White w/ Specks VFT Mastic (Abated)			Room 312 & Toilet - 1953 Bldg.	Abated	MISC					
29	12" x 12" Tan w/ Brown Spots VFT	2,000	SF	Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toilet room next to Room 212, 314, 316 - 1953 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29A	12" x 12" Tan w/ Brown Spots VFT Mastic	2,000	SF	Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toilet room next to Room 212, 314, 316 - 1953 Bldg.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	Carpet Mastic	3,000	SF	Rooms 209, 211 and 213 (Library All Three Rooms) - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	Gray Linoleum	500	SF	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31A	Gray Linoleum Mastic	500	SF	North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	Terrazzo	1,500	SF	Stairwell - 1953 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	Terrazzo	1,600	SF	Stairwell - 1937 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12" x 12" Off-White w/Tan Specks VFT	2,000	SF	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34A	12" x 12" Off-White w/Tan Specks VFT Mastic	2,000	SF	Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12" x 12" White w/Beige Streaks VFT	5,000	SF	2nd and 3rd Floor Corridors - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35A	12" x 12" White w/Beige Streaks VFT Mastic	5,000	SF	2nd and 3rd Floor Corridors - 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
 Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Bldg.							
36	12" x 12" White w/Beige Specks VFT	900	SF	Room 205 and Wardrobe - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36A	12" x 12" White w/Beige Specks VFT Mastic	900	SF	Room 205 and Wardrobe - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12" x 12" White w/ gray & light gray specs VFT	820	SF	Room 305, Gym Entry - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37A	12" x 12" White w/ gray & light gray specs VFT - Mastic	820	SF	Room 305, Gym Entry - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12" x 12" Dark Green VFT	1,800	SF	1st, 2nd, and 3rd Floor Corridors - 1953 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38A	12" x 12" Dark Green VFT Mastic	1,800	SF	1st, 2nd, and 3rd Floor Corridors - 1953 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12" x 12" Off White w/ Tan Streaks VFT	2,000	SF	1st, 2nd, 3rd Floor Corridors - 1937 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39A	12" x 12" Off White w/ Tan Streaks VFT Mastic	2,000	SF	1st, 2nd, 3rd Floor Corridors - 1937 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	12" x 12" Tan w/ light tan streaks VFT	150	SF	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40A	12" x 12" Tan w/ light tan streaks VFT Mastic	150	SF	3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	Multicolor Linoleum	2,000	SF	4th Floor Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41A	Multicolor Linoleum Mastic	2,000	SF	4th Floor Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12" x 12" Tan w/ White Specks VFT	15	SF	Room 302 (Replacement Patches) - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42A	12" x 12" Tan w/ White Specks VFT Mastic	15	SF	Room 302 (Replacement Patches) - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	12" x 12" Blue w/ White Specks VFT	15	SF	Room 302 (Replacement Patches)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43A	12" x 12" Blue w/ White Specks VFT Mastic	15	SF	Room 302 (Replacement Patches)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	2' x 4' White Textured Ceiling Tile	600	SF	1st and 2nd Floor Boy's Bathrooms - 1911 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	2' x 4' White Textured Ceiling Tile	50	SF	Room 101 Bathroom - 1893 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	12" x 12" Light blue w/ specks VFT	800	SF	Room 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46A	Mastic	800	SF	Room 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
J	Lab Tops (Table/Countertops)	12	EA	Room 305 - 1893 Bldg.	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
K	Aicell Pipe Insulation	800	LF	Above 1st Floor Corridor Ceiling - 1937 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
L	MJP E/F/V on Aircell Pipe Insulation	30	FITTING	Above 1st Floor Corridor Ceiling - 1937 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
 Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
M	Cardboard Pipe Insulation	750	LF	Above 1st Floor Corridor Ceiling - 1937 Bldg.	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
N	MJP E/F/V on Cardboard Pipe Insulation	25	FITTING	Above 1st Floor Corridor Ceiling - 1937 Bldg.	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan

Review Date 10/13/2022

HA Number	Management Comments
-----------	---------------------

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
 Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

Manager Planner Name	Arturo Saenz
100-04019	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
04	
05	
08	
09	
10	
11	
12	
15	
16	
17	
19	
19A	
20	
20A	
21	
21A	
22	
22A	
23	
23A	
24	
24A	
25	
25A	
26	
26A	
28	

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
28A	
29	
29A	
30	
31	
31A	
32	
33	
34	
34A	
35	
35A	
36	
36A	
37	
37A	
38	
38A	
39	
39A	
40	
40A	
41	
41A	
42	
42A	
43	

Chicago Public Schools

School Nettelhorst School
Address 3252 N Broadway Street

Unit 24661
Chicago, IL, 60657

Building ID 5070
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
43A	
44	
45	
46	
46A	
J	
K	
L	
M	
N	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 305A, 303 - 1893 Bldg.**

MATERIAL QUANTITY: **1350**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Streaks VFT**
MATERIAL LOCATION: **Room 305A, 303 - 1893 Bldg.**
MATERIAL QUANTITY: **1350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **9" x 9" Tan w/Brown Spots VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Clerk's Office & Public Office (Both Under Carpet) - 1893 Bldg.**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **9" x 9" Tan w/Brown Spots VFT**
MATERIAL LOCATION: **Clerk's Office & Public Office (Both Under Carpet) - 1893 Bldg.**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Water**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout - 1893 Bldg.**

MATERIAL QUANTITY: **15000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout - 1893 Bldg.**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Water**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout - 1911 Bldg.**

MATERIAL QUANTITY: **2500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout - 1911 Bldg.**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Water**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout - 1937 Bldg.**

MATERIAL QUANTITY: **15000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout - 1937 Bldg.**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1953 Bldg.**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout - 1953 Bldg.**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12" x 12" Green VFT (Under Hardwood Floor)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Auditorium - 1911 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12" x 12" Green VFT (Under Hardwood Floor)**
MATERIAL LOCATION: **Auditorium - 1911 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 305A, 303 - 1893 Bldg.**
MATERIAL QUANTITY: **1350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Streaks VFT Mastic**
MATERIAL LOCATION: **Room 305A, 303 - 1893 Bldg.**
MATERIAL QUANTITY: **1350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **9" x 9" Tan w/Brown Spots VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Clerk's Office & Public Office (Under Carpet) - 1893 Bldg.**

MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **9" x 9" Tan w/Brown Spots VFT Mastic**
MATERIAL LOCATION: **Clerk's Office & Public Office (Under Carpet) - 1893 Bldg.**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12" x 12" Green VFT Mastic (Under Hardwood Floor)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Auditorium - 1911 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12" x 12" Green VFT Mastic (Under Hardwood Floor)**
MATERIAL LOCATION: **Auditorium - 1911 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12" x 12" Off White w/Tan Streaks VFT THESE TILES HAVE BEEN PAINTED OVER**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teacher's Cafeteria - 1893 Bldg.**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12" x 12" Off White w/Tan Streaks VFT THESE TILES HAVE BEEN PAINTED OVER**
MATERIAL LOCATION: **Teacher's Cafeteria - 1893 Bldg.**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19A**
MATERIAL DESCRIPTION: **12" x 12" Off White w/Tan Streaks VFT Mastic THESE TILES HAVE BEEN PAINTED OVER**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teacher's Cafeteria - 1893 Bldg.**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **19A**
MATERIAL DESCRIPTION: **12" x 12" Off White w/Tan Streaks VFT Mastic THESE TILES HAVE BEEN PAINTED OVER**
MATERIAL LOCATION: **Teacher's Cafeteria - 1893 Bldg.**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12" x 12" Purplish Grey VFT THESE TILES HAVE BEEN PAINTED OVER**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12" x 12" Purplish Grey VFT THESE TILES HAVE BEEN PAINTED OVER**
MATERIAL LOCATION: **Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20A**
MATERIAL DESCRIPTION: **12" x 12" Purplish Grey VFT Mastic THESE TILES HAVE BEEN PAINTED OVER**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **20A**
MATERIAL DESCRIPTION: **12" x 12" Purplish Grey VFT Mastic THESE TILES HAVE BEEN PAINTED OVER**
MATERIAL LOCATION: **Teacher's Cafeteria and Corridor Outside Teachers' Cafeteria - 1893 Bldg.**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12" x 12" Light Brown w/Gray Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35)**
MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12" x 12" Light Brown w/Gray Streaks VFT**
MATERIAL LOCATION: **Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35)**
MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21A**
MATERIAL DESCRIPTION: **12" x 12" Light Brown w/Gray Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35A)**
MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **21A**
MATERIAL DESCRIPTION: **12" x 12" Light Brown w/Gray Streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 101 & 107, 3rd Floor Corridor - 1893 Bldg. (Under HA#35A)**
MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **9" x 9" White VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Principal's Office (Under Carpet) - 1893 Bldg.**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **9" x 9" White VFT**
MATERIAL LOCATION: **Principal's Office (Under Carpet) - 1893 Bldg.**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22A**
MATERIAL DESCRIPTION: **9" x 9" White VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Principal's Office (Under Carpet) - 1893 Bldg.**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **22A**
MATERIAL DESCRIPTION: **9" x 9" White VFT Mastic**
MATERIAL LOCATION: **Principal's Office (Under Carpet) - 1893 Bldg.**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **9" x 9" Cream VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Corridors - 1893 Bldg. (Under HA#35A)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **9" x 9" Cream VFT**
MATERIAL LOCATION: **2nd Floor Corridors - 1893 Bldg. (Under HA#35A)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23A**
MATERIAL DESCRIPTION: **9" x 9" Cream VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Corridors - 1893 Bldg. (Under HA#35A)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **23A**
MATERIAL DESCRIPTION: **9" x 9" Cream VFT Mastic**
MATERIAL LOCATION: **2nd Floor Corridors - 1893 Bldg. (Under HA#35A)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12" x 12" Gray w/Dark Gray Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 201 & 204 & Coat Room - 1893 Bldg.**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12" x 12" Gray w/Dark Gray Streaks VFT**
MATERIAL LOCATION: **Rooms 201 & 204 & Coat Room - 1893 Bldg.**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24A**
MATERIAL DESCRIPTION: **12" x 12" Gray w/Dark Gray Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 201 & 204 & Coat Room - 1893 Bldg.**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **24A**
MATERIAL DESCRIPTION: **12" x 12" Gray w/Dark Gray Streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 201 & 204 & Coat Room - 1893 Bldg.**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12" x 12" Brown w/Dark Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 302 & Coat Room - 1893 Bldg.**

MATERIAL QUANTITY: **650**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12" x 12" Brown w/Dark Brown Streaks VFT**
MATERIAL LOCATION: **Room 302 & Coat Room - 1893 Bldg.**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25A**
MATERIAL DESCRIPTION: **12" x 12" Brown w/Dark Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 302 & Coat Room - 1893 Bldg.**

MATERIAL QUANTITY: **650**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **25A**
MATERIAL DESCRIPTION: **12" x 12" Brown w/Dark Brown Streaks VFT Mastic**
MATERIAL LOCATION: **Room 302 & Coat Room - 1893 Bldg.**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12" x 12" White VFT (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12" x 12" White VFT (Abated)**
MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26A**
MATERIAL DESCRIPTION: **12" x 12" White VFT Mastic (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **26A**
MATERIAL DESCRIPTION: **12" x 12" White VFT Mastic (Abated)**
MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Corridor - 1937 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12" x 12" White w/ Specks VFT (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 312 & Toilet - 1953 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12" x 12" White w/ Specks VFT (Abated)**
MATERIAL LOCATION: **Room 312 & Toilet - 1953 Bldg.**

MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 10/13/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28A**
MATERIAL DESCRIPTION: **12" x 12" White w/ Specks VFT Mastic (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 312 & Toilet - 1953 Bldg.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **28A**
MATERIAL DESCRIPTION: **12" x 12" White w/ Specks VFT Mastic (Abated)**
MATERIAL LOCATION: **Room 312 & Toilet - 1953 Bldg.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ Brown Spots VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toliet room next to Room 212, 314, 316 - 1953 Bldg.**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ Brown Spots VFT**
MATERIAL LOCATION: **Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toliet room next to Room 212, 314, 316 - 1953 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29A**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ Brown Spots VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toliet room next to Room 212, 314, 316 - 1953 Bldg.**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **29A**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ Brown Spots VFT Mastic**
MATERIAL LOCATION: **Rooms 112, 114, 116, 212, 214; Room 216 (under laminated wood floor); Toliet room next to Room 212, 314, 316 - 1953 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 209, 211 and 213 (Library All Three Rooms) - 1911 Bldg.**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Rooms 209, 211 and 213 (Library All Three Rooms) - 1911 Bldg.**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Gray Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Gray Linoleum**
MATERIAL LOCATION: **North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31A**
MATERIAL DESCRIPTION: **Gray Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **31A**
MATERIAL DESCRIPTION: **Gray Linoleum Mastic**
MATERIAL LOCATION: **North and South Corridors outside Gymnasium, Room 402 Wardrobe - 1893 Bldg.**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Stairwell - 1953 Bldg.**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Terrazzo**
MATERIAL LOCATION: **Stairwell - 1953 Bldg.**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Stairwell - 1937 Bldg.**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Terrazzo**
MATERIAL LOCATION: **Stairwell - 1937 Bldg.**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12" x 12" Off-White w/Tan Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12" x 12" Off-White w/Tan Specks VFT**
MATERIAL LOCATION: **Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34A**
MATERIAL DESCRIPTION: **12" x 12" Off-White w/Tan Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **34A**
MATERIAL DESCRIPTION: **12" x 12" Off-White w/Tan Specks VFT Mastic**
MATERIAL LOCATION: **Library (formerly Rooms 209, 211, 218) (Under Carpet) - 1911 Bldg.**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12" x 12" White w/Beige Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd and 3rd Floor Corridors - 1893 Bldg.**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12" x 12" White w/Beige Streaks VFT**
MATERIAL LOCATION: **2nd and 3rd Floor Corridors - 1893 Bldg.**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35A**
MATERIAL DESCRIPTION: **12" x 12" White w/Beige Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd and 3rd Floor Corridors - 1893 Bldg.**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **35A**
MATERIAL DESCRIPTION: **12" x 12" White w/Beige Streaks VFT Mastic**
MATERIAL LOCATION: **2nd and 3rd Floor Corridors - 1893 Bldg.**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12" x 12" White w/Beige Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 205 and Wardrobe - 1893 Bldg.**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12" x 12" White w/Beige Specks VFT**
MATERIAL LOCATION: **Room 205 and Wardrobe - 1893 Bldg.**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36A**
MATERIAL DESCRIPTION: **12" x 12" White w/Beige Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 205 and Wardrobe - 1893 Bldg.**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **36A**
MATERIAL DESCRIPTION: **12" x 12" White w/Beige Specks VFT Mastic**
MATERIAL LOCATION: **Room 205 and Wardrobe - 1893 Bldg.**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **12" x 12" White w/ gray & light gray specs VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 305, Gym Entry - 1893 Bldg.**
MATERIAL QUANTITY: **820** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **12" x 12" White w/ gray & light gray specs VFT**
MATERIAL LOCATION: **Room 305, Gym Entry - 1893 Bldg.**
MATERIAL QUANTITY: **820** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37A**
MATERIAL DESCRIPTION: **12" x 12" White w/ gray & light gray specs VFT - Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 305, Gym Entry - 1893 Bldg.**
MATERIAL QUANTITY: **820** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **37A**
MATERIAL DESCRIPTION: **12" x 12" White w/ gray & light gray specs VFT - Mastic**
MATERIAL LOCATION: **Room 305, Gym Entry - 1893 Bldg.**
MATERIAL QUANTITY: **820** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **12" x 12" Dark Green VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, and 3rd Floor Corridors - 1953 Addition**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **12" x 12" Dark Green VFT**
MATERIAL LOCATION: **1st, 2nd, and 3rd Floor Corridors - 1953 Addition**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38A**
MATERIAL DESCRIPTION: **12" x 12" Dark Green VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, and 3rd Floor Corridors - 1953 Addition**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **38A**
MATERIAL DESCRIPTION: **12" x 12" Dark Green VFT Mastic**
MATERIAL LOCATION: **1st, 2nd, and 3rd Floor Corridors - 1953 Addition**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **12" x 12" Off White w/ Tan Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors - 1937 Addition**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **12" x 12" Off White w/ Tan Streaks VFT**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors - 1937 Addition**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39A**
MATERIAL DESCRIPTION: **12" x 12" Off White w/ Tan Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors - 1937 Addition**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **39A**
MATERIAL DESCRIPTION: **12" x 12" Off White w/ Tan Streaks VFT Mastic**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors - 1937 Addition**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ light tan streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ light tan streaks VFT**
MATERIAL LOCATION: **3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40A**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ light tan streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **40A**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ light tan streaks VFT Mastic**
MATERIAL LOCATION: **3rd Floor Faculty Toilet (next to MDF Room); MDF Room - 1953 Bldg**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Multicolor Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **4th Floor Gym**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Multicolor Linoleum**
MATERIAL LOCATION: **4th Floor Gym**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41A**
MATERIAL DESCRIPTION: **Multicolor Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **4th Floor Gym**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **41A**
MATERIAL DESCRIPTION: **Multicolor Linoleum Mastic**
MATERIAL LOCATION: **4th Floor Gym**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ White Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 302 (Replacement Patches) - 1893 Bldg.**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ White Specks VFT**
MATERIAL LOCATION: **Room 302 (Replacement Patches) - 1893 Bldg.**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42A**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ White Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 302 (Replacement Patches) - 1893 Bldg.**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **42A**
MATERIAL DESCRIPTION: **12" x 12" Tan w/ White Specks VFT Mastic**
MATERIAL LOCATION: **Room 302 (Replacement Patches) - 1893 Bldg.**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12" x 12" Blue w/ White Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 302 (Replacement Patches)**

MATERIAL QUANTITY: **15**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12" x 12" Blue w/ White Specks VFT**
MATERIAL LOCATION: **Room 302 (Replacement Patches)**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43A**
MATERIAL DESCRIPTION: **12" x 12" Blue w/ White Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 302 (Replacement Patches)**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **43A**
MATERIAL DESCRIPTION: **12" x 12" Blue w/ White Specks VFT Mastic**
MATERIAL LOCATION: **Room 302 (Replacement Patches)**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **2' x 4' White Textured Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st and 2nd Floor Boy's Bathrooms - 1911 Bldg.**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **2' x 4' White Textured Ceiling Tile**
MATERIAL LOCATION: **1st and 2nd Floor Boy's Bathrooms - 1911 Bldg.**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **2' x 4' White Textured Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 101 Bathroom - 1893 Bldg.**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **2' x 4' White Textured Ceiling Tile**
MATERIAL LOCATION: **Room 101 Bathroom - 1893 Bldg.**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Lab Tops (Table/Countertops)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 305 - 1893 Bldg.**
MATERIAL QUANTITY: **12** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Lab Tops (Table/Countertops)**
MATERIAL LOCATION: **Room 305 - 1893 Bldg.**
MATERIAL QUANTITY: **12** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Aicell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Above 1st Floor Corridor Ceiling - 1937 Bldg.**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Aicell Pipe Insulation**
MATERIAL LOCATION: **Above 1st Floor Corridor Ceiling - 1937 Bldg.**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Above 1st Floor Corridor Ceiling - 1937 Bldg.**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
MATERIAL LOCATION: **Above 1st Floor Corridor Ceiling - 1937 Bldg.**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Above 1st Floor Corridor Ceiling - 1937 Bldg.**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
MATERIAL LOCATION: **Above 1st Floor Corridor Ceiling - 1937 Bldg.**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Above 1st Floor Corridor Ceiling - 1937 Bldg.**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUIDLING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
MATERIAL LOCATION: **Above 1st Floor Corridor Ceiling - 1937 Bldg.**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12" x 12" Light blue w/ specks VFT**
MATERIAL LOCATION: **Room 201**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **09/19/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12" x 12" Light blue w/ specks VFT**
MATERIAL LOCATION: **Room 201**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **10/13/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Nettelhorst School** INSPECTION DATE: **9/19/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **46A**
MATERIAL DESCRIPTION: **Mastic**
MATERIAL LOCATION: **Room 201**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: David Avila Date: 09/19/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24661** BUILDING ID: **5070**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Nettelhorst School** REVIEW DATE: **10/13/2022**
ADDRESS: **3252 N Broadway Street** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **46A**

MATERIAL DESCRIPTION: **Mastic**

MATERIAL LOCATION: **Room 201**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **10/13/2022**

APPENDIX B

Inspector and Management Planner Licenses



Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

David Avila

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/9/2022

Exam Date: 9/9/2022

Expiration Date: 9/9/2023

Certificate Number: BIR2209092141


Kathy DeSalvo, Director



Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

David Avila

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/10/2021

Exam Date: 9/10/2021

Expiration Date: 9/10/2022

Certificate Number: BIR2109101942

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

2/28/2022



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 11093

ISSUED
2/28/2022

EXPIRES
05/15/2023

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health





ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11093

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 <p>ASBESTOS PROFESSIONAL LICENSE</p>			<p>ENDORSEMENTS</p>		<p>TC EXPIRES</p>
<p>ID NUMBER 100 - 11093</p>	<p>ISSUED 2/28/2022</p>	<p>EXPIRES 05/15/2023</p>	<p>INSPECTOR</p>		<p>9/10/2022</p>
<p>DAVID AVILA 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health</p> 			<p>PROJECT MANAGER</p>		<p>9/11/2022</p>
			<p>AIR SAMPLING PROFESSIONAL</p>		
			<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>		

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Arturo Saenz

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: BIR2111012562


Kathy DeSalvo, Director



Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that
Arturo Saenz

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: MPR2111012583


Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois

ARTURO SAENZ
2942 W VAN BUREN ST
CHICAGO, IL 60612

2/28/2022



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 04019

ISSUED
2/28/2022

EXPIRES
05/15/2023

ARTURO SAENZ
2942 W VAN BUREN ST
CHICAGO, IL 60612



Environmental Health



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 04019

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 04019	ISSUED 2/28/2022	EXPIRES 05/15/2023	INSPECTOR	11/1/2022
ARTURO SAENZ 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health			MANAGEMENT PLANNER	11/1/2022
			AIR SAMPLING PROFESSIONAL	
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.				

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH. IMPROVING LIVES

Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed