

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2520
SCHOOL NAME: Woodson North School
ADDRESS OF SCHOOL: 4414 S. Evans
CITY: Chicago, IL, 60653

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **4/15/2019**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/31/2022 ENROLLMENT 304
IDPH INSPECTOR LICENSE NUMBER: 100-07134
IDPH LICENSED INSPECTOR NAME (Please Print): Ron Brock
IDPH MP LICENSE NUMBER: 100-19466
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074



11/18/2022

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____
School has been closed. Date closed: _____
School building has been demolished. Date: _____
School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Woodson North School

4414 S. Evans
Chicago, IL, 60653

Unit: 26541
Building ID: 7750

IDPH ID Number: 14-016-2990-2520

REPORT DATE:

Friday, November 18, 2022

Prepared for:

Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Chicago, Il, 60607

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

11/18/2022

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr. Culbertson:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3, 4 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 26501 Region: 04 IDPH ID: 14-016-2990-2520

School: Woodson North School Building ID: 7750

Address: 4414 S. Evans

Chicago, IL, 60653

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Reinspection Date: 10/31/2022

Review Date: 11/18/2022

Inspector: Ron Brock

Inspector IDPH License: 100-07134

Management Planner: Evan Christian

Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Evan Christian
100-19466

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: November 18, 2022

RE: Woodson North School, Unit 26541
4414 S. Evans
Chicago, IL, 60653

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Woodson North School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Woodson North School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Woodson North School Unit: 26501 Region: 04
Address: 4414 S. Evans Chicago, IL, 60653
IDPH ID: 14-016-2990-2520 Building ID: 7750
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 304

3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602


4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Doug McCormick
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Ron Brock


Inspector IDPH license # 100-07134
Reinspection Date: 10/31/2022

Signature: 
Date: 10/31/2022

6. Management Planner

Management Planner Name: Evan Christian


Management Planner IDPH license # 100-19466

Signature: 
Date: 11/18/2022

7. Review Date: 11/18/2022

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

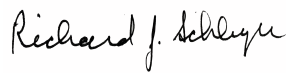Signature: 

Date: 11/18/2022

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Woodson North School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 7750:

41	Chalkboard/whiteboard adhesive
42	12" x 12" Gray w/White Streaks Floor Tile
43	Mastic for 12" x 12" Gray w/White Streaks Floor Tile
44	2' x 4' Fissured Ceiling Tile (2'x2' Look)
45	12" x 12" Blue w/Blue Streaks Floor Tile
46	Mastic for 12" x 12" Blue w/Blue Streaks Floor Tile
47	12" x 12" Green Grayish Speckled Floor Tile
48	Mastic for 12" x 12" Green Grayish Speckled Floor Tile

49	Black science lab tables
50	2' x 2' Smooth Ceiling Tiles
51	Mastic for Red Carpet
52	1' x 1' White Ceiling Tile w/Holes
53	Mastic for 1' x 1' White Tiles w/Holes
54	Wood flooring

B. The following new homogenous areas have been identified for Building 7750:

41	Chalkboard/whiteboard adhesive
42	12" x 12" Gray w/White Streaks Floor Tile
43	Mastic for 12" x 12" Gray w/White Streaks Floor Tile
44	2' x 4' Fissured Ceiling Tile (2'x2' Look)
45	12" x 12" Blue w/Blue Streaks Floor Tile
46	Mastic for 12" x 12" Blue w/Blue Streaks Floor Tile
47	12" x 12" Green Grayish Speckled Floor Tile
48	Mastic for 12" x 12" Green Grayish Speckled Floor Tile
49	Black science lab tables
50	2' x 2' Smooth Ceiling Tiles
51	Mastic for Red Carpet
52	1' x 1' White Ceiling Tile w/Holes
53	Mastic for 1' x 1' White Tiles w/Holes
54	Wood flooring

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

003	12" x 12" Ceiling Tile
004.1	9" x 9" Brown w/ White Speckles Vinyl Floor Tile
005	12" x 12" Brown w/White Speckles Vinyl Floor Tile
005.1	12" x 12" White w/ Brown Speckles Vinyl Floor Tile
007	12" x 12" Brown w/White Speckles Vinyl Floor Tile Mastic
008	Brown baseboard
008M	Brown baseboard mastic
009	Cinder block wall (interior)
010	Brick Wall - Non-AHERA
011	Cinder block wall mortar
012	Brick Wall Mortar - Non-AHERA
013	Exterior Window Caulk - Non-AHERA
014	Interior window caulk
015	Roofing Material - Non-AHERA
016	Blue carpet mastic
017	Gray carpet mastic
018	Incinerator components
019	Tank insulation
21	12" x 12" Grn w/ Light and Dark Grn Floor Tile Mastic
22	12" x 12" Tan w/White Floor Tile Mastic
23	4" Green vinyl baseboard
24	4" Green vinyl baseboard adhesive
25	2' x 4' White Ceiling Tile
26	12" x 12" Light Brown w/White/Dark Brown Floor tile
27	12" x 12" Light Brown w/White/Dark Brown Floor tile Mastic
28	12" x 12" Blue w/Light and Dark Blue Floor Tile
29	12" x 12" Blue w/Light and Dark Blue Floor Tile Mastic
30	12" x 12" Grn w/ Light and Dark Grn Floor Tile
31	12" x 12"Grn w/Light and Dark Grn Floor Tile Mastic
32	12" x 12"White w/Gray Floor Tile
33	12" x 12"White w/Gray Floor Tile Mastic
34	4" Black vinyl baseboard
35	4" Black vinyl baseboard adhesive
36	6" Black vinyl baseboard
37	6" Black vinyl baseboard adhesive

38	Purple carpet mastic
39	Vaulted door
40	Gray spray-on
41	Chalkboard/whiteboard adhesive
42	12" x 12" Gray w/White Streaks Floor Tile
43	Mastic for 12" x 12" Gray w/White Streaks Floor Tile
44	2' x 4' Fissured Ceiling Tile (2'x2' Look)
45	12" x 12" Blue w/Blue Streaks Floor Tile
46	Mastic for 12" x 12" Blue w/Blue Streaks Floor Tile
47	12" x 12" Green Grayish Speckled Floor Tile
48	Mastic for 12" x 12" Green Grayish Speckled Floor Tile
49	Black science lab tables
50	2' x 2' Smooth Ceiling Tiles
51	Mastic for Red Carpet
52	1' x 1' White Ceiling Tile w/Holes
53	Mastic for 1' x 1' White Tiles w/Holes
54	Wood flooring
A	Boiler insulation jacket
C	Cementitious Joint Insulation on Fiberglass Piping
J	Pipe insulation
K	Pipe insulation joints

The following areas were deemed to be inaccessible:

003	12" x 12" Ceiling Tile
007	12" x 12" Brown w/White Speckles Vinyl Floor Tile Mastic
007.1	12" x 12" White w/ Brown Speckles Vinyl Floor Tile Mastic
008M	Brown baseboard mastic
018	Incinerator components
019	Tank insulation
21	12" x 12" Grn w/ Light and Dark Grn Floor Tile Mastic
22	12" x 12" Tan w/White Floor Tile Mastic
27	12" x 12" Light Brown w/White/Dark Brown Floor tile Mastic
29	12" x 12" Blue w/Light and Dark Blue Floor Tile Mastic
31	12" x 12"Grn w/Light and Dark Grn Floor Tile Mastic
33	12" x 12"White w/Gray Floor Tile Mastic
38	Purple carpet mastic
41	Chalkboard/whiteboard adhesive

43	Mastic for 12" x 12" Gray w/White Streaks Floor Tile
46	Mastic for 12" x 12" Blue w/Blue Streaks Floor Tile
48	Mastic for 12" x 12" Green Grayish Speckled Floor Tile
50	2' x 2' Smooth Ceiling Tiles
51	Mastic for Red Carpet
52	1' x 1' White Ceiling Tile w/Holes
53	Mastic for 1' x 1' White Tiles w/Holes
E	Mag block tank insulation

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Ron Brock, IDPH License # 100-07134. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Woodson North School Building 7750 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Woodson North School Unit 26501 Building ID 7750

Address 4414 S. Evans Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
001	Acoustical ceiling plaster (abated)			1st, 2nd and 3rd Floor Classrooms	ABATED	SURFACE								
002	Hard coat plaster			Throughout Facility	NO_ACBM	SURFACE								
003	12" x 12" Ceiling Tile	2,500	SF	All Purpose Room	ASSUMED	MISC	Y	NONE	0	SF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
004	9" x 9" Tan w/ White Speckles Vinyl Floor Tile (Abated)			Throughout Classrooms and Corridors	ABATED	MISC								
004.1	9" x 9" Brown w/ White Speckles Vinyl Floor Tile	800	SF	Engineer's Office, 134, 136	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
005	12" x 12" Brown w/White Speckles Vinyl Floor Tile	150	SF	Throughout Facility as Patches, Gym (131)	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
005.1	12" x 12" White w/ Brown Speckles Vinyl Floor Tile	750	SF	Room 307, Gym (131)	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
005.2	12" x 12" Green w/ Brown Speckles Vinyl Floor Tile (Abated)			Principal's Office & Closet and the Front Office	ABATED	MISC								
005.3	12" x 12" White Floor Tile w/Blue Streaks (Abated)			Room 208	ABATED	MISC								
006	9" x 9" Tan w/ White Speckles Vinyl Floor Tile Mastic (Abated)			Throughout Various Classrooms and Corridors	ABATED	MISC								
006.1	9" x 9" Brown w/ Whitet Speckles Vinyl Floor Tile Mastic (Abated)			Throughout Classrooms and Corridors as Patches	ABATED	MISC								
007	12" x 12" Brown w/White Speckles Vinyl Floor Tile Mastic	150	SF	Throughout Facility as Patches	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
007.1	12" x 12" White w/ Brown Speckles Vinyl Floor Tile Mastic	600	SF	Gym (131)	CHR	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
007.2	12" x 12" Green w/Brown Speckles Vinyl Floor Tile Mastic (Abated)			Principal's Office & Closet and the Front Office	ABATED	MISC								
007.3	12" x 12" White Floor Tile w/Blue Streaks Mastic (Abated)			Room 208	ABATED	MISC								
008	Brown baseboard	500	LF	All Purpose Room	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
008M	Brown baseboard mastic	500	LF	All Purpose Room	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
009	Cinder block wall (interior)	1,100	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
010	Brick Wall - Non-AHERA			Building Exterior	ASSUMED	MISC								
011	Cinder block wall mortar	1,100	SF	Throughout Facility	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the		LOW

Chicago Public Schools

School Woodson North School Unit 26501 Building ID 7750

Address 4414 S. Evans Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
012	Brick Wall Mortar - Non-AHERA			Building Exterior	ASSUMED	MISC								
013	Exterior Window Caulk - Non-AHERA			Building Exterior	ASSUMED	MISC								
014	Interior window caulk	4,000	LF	Building Interior	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
015	Roofing Material - Non-AHERA			Roof	ASSUMED	MISC								
016	Blue carpet mastic			Rooms 309 & 310	ASSUMED	MISC								
017	Gray carpet mastic			Counselor's Room	ASSUMED	MISC								
018	Incinerator components	200	SF	Boiler Room	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
019	Tank insulation	400	SF	Boiler Room	ASSUMED	TSI	Y	NONE	0	SF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
020	12" x 12" Ceiling Tile Mastic (Abated)			First Floor Classrooms	ABATED	MISC								
21	12" x 12" Grn w/ Light and Dark Grn Floor Tile Mastic	55,600	SF	All Classrooms, Hallways, Lunch room, Multi Purpose Room, Teacher's Bathroom	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
22	12" x 12" Tan w/White Floor Tile Mastic	55,500	SF	All Classrooms, Hallways, Lunch room, Multi Purpose Room	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
23	4" Green vinyl baseboard	4,300	LF	All Classrooms, Hallways, Lunch room, Multi Purpose Room	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
24	4" Green vinyl baseboard adhesive	4,300	LF	All Classrooms, Hallways, Lunch room, Multi Purpose Room	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
25	2' x 4' White Ceiling Tile	55,000	SF	All Classrooms, Hallways, Lunch room, Multi Purpose Room	ASSUMED	MISC	Y	NONE	0	SF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
26	12" x 12" Light Brown w/White/Dark Brown Floor tile	2,000	SF	Kitchen and Multi Purpose Room, 135	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
27	12" x 12" Light Brown w/White/Dark Brown Floor tile Mastic	2,000	SF	Kitchen and Multi Purpose Room, 135	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
28	12" x 12" Blue w/Light and Dark Blue Floor Tile	800	SF	Hallways and lunchroom	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
29	12" x 12" Blue w/Light and Dark Blue Floor Tile Mastic	800	SF	Hallways and lunchroom	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Woodson North School Unit 26501 Building ID 7750

Address 4414 S. Evans Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
30	12" x 12" Grn w/ Light and Dark Grn Floor Tile	275	SF	Hallways and Lunchroom	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
31	12" x 12" Grn w/Light and Dark Grn Floor Tile Mastic	275	SF	Hallways and lunchroom	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
32	12" x 12" White w/Gray Floor Tile	2,500	SF	Gym (130)	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
33	12" x 12" White w/Gray Floor Tile Mastic	2,500	SF	Gym (130)	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
34	4" Black vinyl baseboard	200	LF	Gym	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
35	4" Black vinyl baseboard adhesive	200	LF	Gym	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
36	6" Black vinyl baseboard	75	LF	Kitchen	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
37	6" Black vinyl baseboard adhesive	75	LF	Kitchen	ASSUMED	MISC	N	NONE	0	LF	No	ACBM with the potential for damage		LOW
38	Purple carpet mastic	875	SF	Principal's Office	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
39	Vaulted door	35	SF	Main Office	ASSUMED	MISC	N	NONE	0	SF	No	ACBM with the potential for damage		LOW
40	Gray spray-on	50,000	SF	Throughout	ASSUMED	SURFACE	Y	NONE	0	SF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
41	Chalkboard/whiteboard adhesive	1,200	SF	Rooms 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 102, 101, 104, 109, 110, 111, 112	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
42	12" x 12" Gray w/White Streaks Floor Tile	25,000	SF	3rd Fl Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd Fl Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st Fl Hallway	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW

Chicago Public Schools

School Woodson North School Unit 26501 Building ID 7750

Address 4414 S. Evans Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				(North Building), 102, 101, 103, 104, Lunchroom, Main Office (113), 109, 110, 111, 112, Nurse Room										
43	Mastic for 12" x 12" Gray w/White Streaks Floor Tile	25,000	SF	3rd Fl Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd Fl Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st Fl Hallway (North Building), 102, 101, 103, 104, Lunchroom, Main Office (113), 109, 110, 111, 112, Nurse Room	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
44	2' x 4' Fissured Ceiling Tile (2'x2' Look)	25,000	SF	3rd Fl Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd Fl Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st Fl Hallway (North Building), 102, 102 Bathroom, 101, 103, 104, Lunchroom, Principal's Office, Main Office (113), 109, 110, 111, 112, Nurse Room	ASSUMED	MISC	Y	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
45	12" x 12" Blue w/Blue Streaks Floor Tile	250	SF	3rd Fl Hallway	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the		LOW

Chicago Public Schools

School Woodson North School Unit 26501 Building ID 7750

Address 4414 S. Evans Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				(North Building), 2nd Fl Hallway (North Building), 1st Fl Hallway (North Building), Lunchroom								potential for damage		
46	Mastic for 12" x 12" Blue w/Blue Streaks Floor Tile	350	SF	3rd Fl Hallway (North Building), 2nd Fl Hallway (North Building), 1st Fl Hallway (North Building), Lunchroom	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
47	12" x 12" Green Grayish Speckled Floor Tile	350	SF	3rd Fl Hallway (North Building), 2nd Fl Hallway (North Building), 1st Fl Hallway (North Building), Lunchroom	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
48	Mastic for 12" x 12" Green Grayish Speckled Floor Tile	350	SF	3rd Fl Hallway (North Building), 2nd Fl Hallway (North Building), 1st Fl Hallway (North Building), Lunchroom	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
49	Black science lab tables	10	EA	Room 305	ASSUMED	MISC	N	NONE	0	EA	Yes	ACBM with the potential for damage		LOW
50	2' x 2' Smooth Ceiling Tiles	1,000	SF	Lunchroom	ASSUMED	MISC	Y	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
51	Mastic for Red Carpet	250	SF	Principal's Office	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
52	1' x 1' White Ceiling Tile w/Holes	2,000	SF	Gym (131)	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
53	Mastic for 1' x 1' White Tiles w/Holes	2,000	SF	Gym (131)	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
54	Wood flooring	400	SF	Stage (Gym 131)	ASSUMED	MISC	N	NONE	0	SF	Yes	ACBM with the potential for damage		LOW
A	Boiler insulation jacket	400	SF	Boiler Room	ASSUMED	TSI	Y	NONE	0	SF	No	Any remaining friable ACBM or friable suspect ACBM		LOW
B	Mag block duct insulation	100	LF	Boiler Room	AMO	TSI	Y	NONE	0	LF	No	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Woodson North School Unit 26501 Building ID 7750

Address 4414 S. Evans Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
C	Cementitious Joint Insulation on Fiberglass Piping	100	LF	Boiler Room, and crawl Spaces	ASSUMED	TSI	Y	NONE	0	LF	No	Any remaining friable ACM or friable suspect ACM		LOW
E	Mag block tank insulation	10	LF	Crawlspace	AMO	TSI	Y	NONE	0	LF	No	Any remaining friable ACM or friable suspect ACM		LOW
J	Pipe insulation	60	LF	Engineer's Office	ASSUMED	TSI	Y	NONE	0	LF	No	Any remaining friable ACM or friable suspect ACM		LOW
K	Pipe insulation joints	6	JOINTS	Engineer's Office	ASSUMED	TSI	Y	NONE	0	JOINTS	No	Any remaining friable ACM or friable suspect ACM		LOW

Chicago Public Schools

School Woodson North School Unit 26501 Building ID 7750

Address 4414 S. Evans Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 10/31/2022
Inspector Name Ron Brock
100-07134 5/15/2023
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
001	
002	
003	
004	
004.1	
005	
005.1	
005.2	
005.3	
006	
006.1	
007	
007.1	
007.2	
007.3	
008	
008M	
009	
010	
011	
012	
013	
014	
015	

Chicago Public Schools

School Woodson North School Unit 26501 Building ID 7750

Address 4414 S. Evans Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
016	Not observed 2022
017	Not observed 2022
018	
019	
020	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	

Chicago Public Schools

School Woodson North School Unit 26501 Building ID 7750

Address 4414 S. Evans Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
A	
B	
C	
E	
J	
K	

Table II

Management Planner's Review

Chicago Public Schools

School Woodson North School

Unit 26501

Building ID 7750

Address 4414 S. Evans

Chicago, IL, 60653

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
001	Acoustical ceiling plaster (abated)			1st, 2nd and 3rd Floor Classrooms	Abated	SURFACE					
002	Hard coat plaster			Throughout Facility	No ACBM	SURFACE					
003	12" x 12" Ceiling Tile	2,500	SF	All Purpose Room	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
004	9" x 9" Tan w/ White Speckles Vinyl Floor Tile (Abated)			Throughout Classrooms and Corridors	Abated	MISC					
004.1	9" x 9" Brown w/ White Speckles Vinyl Floor Tile	800	SF	Engineer's Office, 134, 136	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
005	12" x 12" Brown w/White Speckles Vinyl Floor Tile	150	SF	Throughout Facility as Patches, Gym (131)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
005.1	12" x 12" White w/ Brown Speckles Vinyl Floor Tile	750	SF	Room 307, Gym (131)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
005.2	12" x 12" Green w/ Brown Speckles Vinyl Floor Tile (Abated)			Principal's Office & Closet and the Front Office	Abated	MISC					
005.3	12" x 12" White Floor Tile w/Blue Streaks (Abated)			Room 208	Abated	MISC					
006	9" x 9" Tan w/ White Speckles Vinyl Floor Tile Mastic (Abated)			Throughout Various Classrooms and Corridors	Abated	MISC					
006.1	9" x 9" Brown w/ Whitet Speckles Vinyl Floor Tile Mastic (Abated)			Throughout Classrooms and Corridors as Patches	Abated	MISC					
007	12" x 12" Brown w/White Speckles Vinyl Floor Tile Mastic	150	SF	Throughout Facility as Patches	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007.1	12" x 12" White w/ Brown Speckles Vinyl Floor Tile Mastic	600	SF	Gym (131)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007.2	12" x 12" Green w/Brown Speckles Vinyl Floor Tile Mastic (Abated)			Principal's Office & Closet and the Front Office	Abated	MISC					
007.3	12" x 12" White Floor Tile w/Blue Streaks Mastic (Abated)			Room 208	Abated	MISC					
008	Brown baseboard	500	LF	All Purpose Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
008M	Brown baseboard mastic	500	LF	All Purpose Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
009	Cinder block wall (interior)	1,100	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
010	Brick Wall - Non-AHERA			Building Exterior	Assumed	MISC					Follow O&M Plan
011	Cinder block wall mortar	1,100	SF	Throughout Facility	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
012	Brick Wall Mortar - Non-AHERA			Building Exterior	Assumed	MISC					Follow O&M Plan
013	Exterior Window Caulk - Non-AHERA			Building Exterior	Assumed	MISC					Follow O&M Plan
014	Interior window caulk	4,000	LF	Building Interior	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
015	Roofing Material - Non-AHERA			Roof	Assumed	MISC					Follow O&M Plan
016	Blue carpet mastic			Rooms 309 & 310	Assumed	MISC					Follow O&M Plan

Chicago Public Schools

School Woodson North School

Unit 26501

Building ID 7750

Address 4414 S. Evans

Chicago, IL, 60653

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
017	Gray carpet mastic			Counselor's Room	Assumed	MISC					Follow O&M Plan
018	Incinerator components	200	SF	Boiler Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
019	Tank insulation	400	SF	Boiler Room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
020	12" x 12" Ceiling Tile Mastic (Abated)			First Floor Classrooms	Abated	MISC					
21	12" x 12" Grn w/ Light and Dark Grn Floor Tile Mastic	55,600	SF	All Classrooms, Hallways, Lunch room, Multi Purpose Room, Teacher's Bathroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12" x 12" Tan w/White Floor Tile Mastic	55,500	SF	All Classrooms, Hallways, Lunch room, Multi Purpose Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	4" Green vinyl baseboard	4,300	LF	All Classrooms, Hallways, Lunch room, Multi Purpose Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
24	4" Green vinyl baseboard adhesive	4,300	LF	All Classrooms, Hallways, Lunch room, Multi Purpose Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
25	2' x 4' White Ceiling Tile	55,000	SF	All Classrooms, Hallways, Lunch room, Multi Purpose Room	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
26	12" x 12" Light Brown w/White/Dark Brown Floor tile	2,000	SF	Kitchen and Multi Purpose Room, 135	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12" x 12" Light Brown w/White/Dark Brown Floor tile Mastic	2,000	SF	Kitchen and Multi Purpose Room, 135	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	12" x 12" Blue w/Light and Dark Blue Floor Tile	800	SF	Hallways and lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	12" x 12" Blue w/Light and Dark Blue Floor Tile Mastic	800	SF	Hallways and lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	12" x 12" Grn w/ Light and Dark Grn Floor Tile	275	SF	Hallways and Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12" x 12" Grn w/Light and Dark Grn Floor Tile Mastic	275	SF	Hallways and lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12" x 12" White w/Gray Floor Tile	2,500	SF	Gym (130)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12" x 12" White w/Gray Floor Tile Mastic	2,500	SF	Gym (130)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	4" Black vinyl baseboard	200	LF	Gym	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
35	4" Black vinyl baseboard adhesive	200	LF	Gym	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
36	6" Black vinyl baseboard	75	LF	Kitchen	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
37	6" Black vinyl baseboard adhesive	75	LF	Kitchen	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
38	Purple carpet mastic	875	SF	Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	Vaulted door	35	SF	Main Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	Gray spray-on	50,000	SF	Throughout	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

Chicago Public Schools

School Woodson North School

Unit 26501

Building ID 7750

Address 4414 S. Evans

Chicago, IL, 60653

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
41	Chalkboard/whiteboard adhesive	1,200	SF	Rooms 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 102, 101, 104, 109, 110, 111, 112	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12" x 12" Gray w/White Streaks Floor Tile	25,000	SF	3rd FI Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd FI Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st FI Hallway (North Building), 102, 101, 103, 104, Lunchroom, Main Office (113), 109, 110, 111, 112, Nurse Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	Mastic for 12" x 12" Gray w/White Streaks Floor Tile	25,000	SF	3rd FI Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd FI Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st FI Hallway (North Building), 102, 101, 103, 104, Lunchroom, Main Office (113), 109, 110, 111, 112, Nurse Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	2' x 4' Fissured Ceiling Tile (2'x2' Look)	25,000	SF	3rd FI Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd FI Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st FI Hallway (North Building), 102, 102 Bathroom, 101, 103, 104, Lunchroom, Principal's Office, Main Office (113), 109, 110, 111, 112, Nurse Room	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	12" x 12" Blue w/Blue Streaks Floor Tile	250	SF	3rd FI Hallway (North Building), 2nd FI Hallway (North Building), 1st FI Hallway (North Building), Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	Mastic for 12" x 12" Blue w/Blue Streaks Floor Tile	350	SF	3rd FI Hallway (North Building), 2nd FI	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Woodson North School

Unit 26501

Building ID 7750

Address 4414 S. Evans

Chicago, IL, 60653

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Hallway (North Building), 1st FI Hallway (North Building), Lunchroom							
47	12" x 12" Green Grayish Speckled Floor Tile	350	SF	3rd FI Hallway (North Building), 2nd FI Hallway (North Building), 1st FI Hallway (North Building), Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	Mastic for 12" x 12" Green Grayish Speckled Floor Tile	350	SF	3rd FI Hallway (North Building), 2nd FI Hallway (North Building), 1st FI Hallway (North Building), Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	Black science lab tables	10	EA	Room 305	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
50	2' x 2' Smooth Ceiling Tiles	1,000	SF	Lunchroom	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	Mastic for Red Carpet	250	SF	Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	1' x 1' White Ceiling Tile w/Holes	2,000	SF	Gym (131)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	Mastic for 1' x 1' White Tiles w/Holes	2,000	SF	Gym (131)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	Wood flooring	400	SF	Stage (Gym 131)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Boiler insulation jacket	400	SF	Boiler Room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
B	Mag block duct insulation	100	LF	Boiler Room	Amosite	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
C	Cementitious Joint Insulation on Fiberglass Piping	100	LF	Boiler Room, and crawl Spaces	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
E	Mag block tank insulation	10	LF	Crawlspace	Amosite	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
J	Pipe insulation	60	LF	Engineer's Office	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
K	Pipe insulation joints	6	JOINTS	Engineer's Office	Assumed	TSI	Yes	0	JOINTS	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

Chicago Public Schools

School Woodson North School
Address 4414 S. Evans

Unit 26501
 Chicago, IL, 60653

Building ID 7750
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	11/18/2022
Manager Planner Name	Evan Christian
100-19466	5/15/2023
Manager IDPH License No/Expiration	

HA Number	Management Comments
001	
002	
003	
004	
004.1	
005	
005.1	
005.2	
005.3	
006	
006.1	
007	
007.1	

Chicago Public Schools

School Woodson North School
Address 4414 S. Evans

Unit 26501
 Chicago, IL, 60653

Building ID 7750
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
007.2	
007.3	
008	
008M	
009	
010	
011	
012	
013	
014	
015	
016	
017	
018	
019	
020	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	

Chicago Public Schools

School Woodson North School

Unit 26501

Building ID 7750

Address 4414 S. Evans

Chicago, IL, 60653

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
A	
B	
C	
E	

Chicago Public Schools

School Woodson North School

Unit 26501

Building ID 7750

Address 4414 S. Evans

Chicago, IL, 60653

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
J	
K	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **001**
MATERIAL DESCRIPTION: **Acoustical ceiling plaster (abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd and 3rd Floor Classrooms**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **001**

MATERIAL DESCRIPTION: **Acoustical ceiling plaster (abated)**

MATERIAL LOCATION: **1st, 2nd and 3rd Floor Classrooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **002**
MATERIAL DESCRIPTION: **Hard coat plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **002**

MATERIAL DESCRIPTION: **Hard coat plaster**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **003**
MATERIAL DESCRIPTION: **12" x 12" Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Purpose Room**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **003**
MATERIAL DESCRIPTION: **12" x 12" Ceiling Tile**
MATERIAL LOCATION: **All Purpose Room**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **004**
MATERIAL DESCRIPTION: **9" x 9" Tan w/ White Speckles Vinyl Floor Tile (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Classrooms and Corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **004**

MATERIAL DESCRIPTION: **9" x 9" Tan w/ White Speckles Vinyl Floor Tile (Abated)**

MATERIAL LOCATION: **Throughout Classrooms and Corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **004.1**
MATERIAL DESCRIPTION: **9" x 9" Brown w/ White Speckles Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Engineer's Office, 134, 136**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **004.1**

MATERIAL DESCRIPTION: **9" x 9" Brown w/ White Speckles Vinyl Floor Tile**

MATERIAL LOCATION: **Engineer's Office, 134, 136**

MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Speckles Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility as Patches, Gym (131)**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **005**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Speckles Vinyl Floor Tile**
MATERIAL LOCATION: **Throughout Facility as Patches, Gym (131)**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005.1**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Speckles Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 307, Gym (131)**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **005.1**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Speckles Vinyl Floor Tile**
MATERIAL LOCATION: **Room 307, Gym (131)**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005.2**
MATERIAL DESCRIPTION: **12" x 12" Green w/ Brown Speckles Vinyl Floor Tile (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Principal's Office & Closet and the Front Office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **005.2**

MATERIAL DESCRIPTION: **12" x 12" Green w/ Brown Speckles Vinyl Floor Tile (Abated)**

MATERIAL LOCATION: **Principal's Office & Closet and the Front Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005.3**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Blue Streaks (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 208**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **005.3**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Blue Streaks (Abated)**

MATERIAL LOCATION: **Room 208**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006**
MATERIAL DESCRIPTION: **9" x 9" Tan w/ White Speckles Vinyl Floor Tile Mastic (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Various Classrooms and Corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **006**
MATERIAL DESCRIPTION: **9" x 9" Tan w/ White Speckles Vinyl Floor Tile Mastic (Abated)**
MATERIAL LOCATION: **Throughout Various Classrooms and Corridors**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006.1**
MATERIAL DESCRIPTION: **9" x 9" Brown w/ Whitet Speckles Vinyl Floor Tile Mastic (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Classrooms and Corridors as Patches**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **006.1**

MATERIAL DESCRIPTION: **9" x 9" Brown w/ Whitet Speckles Vinyl Floor Tile Mastic (Abated)**

MATERIAL LOCATION: **Throughout Classrooms and Corridors as Patches**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **007**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Speckles Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Facility as Patches**

MATERIAL QUANTITY: **150**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **007**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Speckles Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Throughout Facility as Patches**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **007.1**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Speckles Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Gym (131)**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **007.1**

MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Speckles Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Gym (131)**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **007.2**
MATERIAL DESCRIPTION: **12" x 12" Green w/Brown Speckles Vinyl Floor Tile Mastic (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Principal's Office & Closet and the Front Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **007.2**
MATERIAL DESCRIPTION: **12" x 12" Green w/Brown Speckles Vinyl Floor Tile Mastic (Abated)**
MATERIAL LOCATION: **Principal's Office & Closet and the Front Office**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **007.3**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Blue Streaks Mastic (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 208**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **007.3**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/Blue Streaks Mastic (Abated)**

MATERIAL LOCATION: **Room 208**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **008**
MATERIAL DESCRIPTION: **Brown baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Purpose Room**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **008**
MATERIAL DESCRIPTION: **Brown baseboard**
MATERIAL LOCATION: **All Purpose Room**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **008M**
MATERIAL DESCRIPTION: **Brown baseboard mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **All Purpose Room**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **008M**
MATERIAL DESCRIPTION: **Brown baseboard mastic**
MATERIAL LOCATION: **All Purpose Room**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **009**
MATERIAL DESCRIPTION: **Cinder block wall (interior)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **009**
MATERIAL DESCRIPTION: **Cinder block wall (interior)**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **010**
MATERIAL DESCRIPTION: **Brick Wall - Non-AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Building Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **010**

MATERIAL DESCRIPTION: **Brick Wall - Non-AHERA**

MATERIAL LOCATION: **Building Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **011**
MATERIAL DESCRIPTION: **Cinder block wall mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **011**
MATERIAL DESCRIPTION: **Cinder block wall mortar**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **012**
MATERIAL DESCRIPTION: **Brick Wall Mortar - Non-AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Building Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **012**

MATERIAL DESCRIPTION: **Brick Wall Mortar - Non-AHERA**

MATERIAL LOCATION: **Building Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **013**
MATERIAL DESCRIPTION: **Exterior Window Caulk - Non-AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Building Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **013**

MATERIAL DESCRIPTION: **Exterior Window Caulk - Non-AHERA**

MATERIAL LOCATION: **Building Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **014**
MATERIAL DESCRIPTION: **Interior window caulk**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Building Interior**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **014**
MATERIAL DESCRIPTION: **Interior window caulk**
MATERIAL LOCATION: **Building Interior**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **015**
MATERIAL DESCRIPTION: **Roofing Material - Non-AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **015**

MATERIAL DESCRIPTION: **Roofing Material - Non-AHERA**

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **016**
MATERIAL DESCRIPTION: **Blue carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 309 & 310**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **016**
MATERIAL DESCRIPTION: **Blue carpet mastic**
MATERIAL LOCATION: **Rooms 309 & 310**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **017**
MATERIAL DESCRIPTION: **Gray carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Counselor's Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2022**

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **017**

MATERIAL DESCRIPTION: **Gray carpet mastic**

MATERIAL LOCATION: **Counselor's Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **018**
MATERIAL DESCRIPTION: **Incinerator components**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 10/31/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **018**
MATERIAL DESCRIPTION: **Incinerator components**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **019**
MATERIAL DESCRIPTION: **Tank insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **019**
MATERIAL DESCRIPTION: **Tank insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **020**
MATERIAL DESCRIPTION: **12" x 12" Ceiling Tile Mastic (Abated)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **First Floor Classrooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **020**

MATERIAL DESCRIPTION: **12" x 12" Ceiling Tile Mastic (Abated)**

MATERIAL LOCATION: **First Floor Classrooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12" x 12" Grn w/ Light and Dark Grn Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **All Classrooms, Hallways, Lunch room, Multi Purpose Room, Teacher's Bathroom**

MATERIAL QUANTITY: **55600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12" x 12" Grn w/ Light and Dark Grn Floor Tile Mastic**
MATERIAL LOCATION: **All Classrooms, Hallways, Lunch room, Multi Purpose Room, Teacher's Bathroom**
MATERIAL QUANTITY: **55600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12" x 12" Tan w/White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **All Classrooms, Hallways, Lunch room, Multi Purpose Room**

MATERIAL QUANTITY: **55500**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12" x 12" Tan w/White Floor Tile Mastic**
MATERIAL LOCATION: **All Classrooms, Hallways, Lunch room, Multi Purpose Room**
MATERIAL QUANTITY: **55500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **4" Green vinyl baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Classrooms, Hallways, Lunch room, Multi Purpose Room**
MATERIAL QUANTITY: **4300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **4" Green vinyl baseboard**
MATERIAL LOCATION: **All Classrooms, Hallways, Lunch room, Multi Purpose Room**
MATERIAL QUANTITY: **4300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **4" Green vinyl baseboard adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Classrooms, Hallways, Lunch room, Multi Purpose Room**
MATERIAL QUANTITY: **4300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **4" Green vinyl baseboard adhesive**

MATERIAL LOCATION: **All Classrooms, Hallways, Lunch room, Multi Purpose Room**

MATERIAL QUANTITY: **4300**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **2' x 4' White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Classrooms, Hallways, Lunch room, Multi Purpose Room**
MATERIAL QUANTITY: **55000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **2' x 4' White Ceiling Tile**
MATERIAL LOCATION: **All Classrooms, Hallways, Lunch room, Multi Purpose Room**
MATERIAL QUANTITY: **55000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12" x 12" Light Brown w/White/Dark Brown Floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen and Multi Purpose Room, 135**

MATERIAL QUANTITY: **2000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12" x 12" Light Brown w/White/Dark Brown Floor tile**
MATERIAL LOCATION: **Kitchen and Multi Purpose Room, 135**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12" x 12" Light Brown w/White/Dark Brown Floor tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen and Multi Purpose Room, 135**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12" x 12" Light Brown w/White/Dark Brown Floor tile Mastic**
MATERIAL LOCATION: **Kitchen and Multi Purpose Room, 135**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12" x 12" Blue w/Light and Dark Blue Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Hallways and lunchroom**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12" x 12" Blue w/Light and Dark Blue Floor Tile**
MATERIAL LOCATION: **Hallways and lunchroom**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12" x 12" Blue w/Light and Dark Blue Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Hallways and lunchroom**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12" x 12" Blue w/Light and Dark Blue Floor Tile Mastic**
MATERIAL LOCATION: **Hallways and lunchroom**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12" x 12" Grn w/ Light and Dark Grn Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Hallways and Lunchroom**

MATERIAL QUANTITY: **275**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12" x 12" Grn w/ Light and Dark Grn Floor Tile**
MATERIAL LOCATION: **Hallways and Lunchroom**
MATERIAL QUANTITY: **275** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12" x 12" Grn w/Light and Dark Grn Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Hallways and lunchroom**

MATERIAL QUANTITY: **275**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **12" x 12" Grn w/Light and Dark Grn Floor Tile Mastic**

MATERIAL LOCATION: **Hallways and lunchroom**

MATERIAL QUANTITY: **275**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12" x 12" White w/Gray Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym (130)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12" x 12" White w/Gray Floor Tile**
MATERIAL LOCATION: **Gym (130)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12" x 12" White w/Gray Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym (130)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12" x 12" White w/Gray Floor Tile Mastic**
MATERIAL LOCATION: **Gym (130)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **4" Black vinyl baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **4" Black vinyl baseboard**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **4" Black vinyl baseboard adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **4" Black vinyl baseboard adhesive**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **6" Black vinyl baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **75** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **6" Black vinyl baseboard**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **75** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **6" Black vinyl baseboard adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **75** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **6" Black vinyl baseboard adhesive**

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY: **75**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Purple carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **875** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **Purple carpet mastic**

MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY: **875**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Vaulted door**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office**
MATERIAL QUANTITY: **35** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Vaulted door**
MATERIAL LOCATION: **Main Office**
MATERIAL QUANTITY: **35** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Gray spray-on**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **50000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Gray spray-on**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **50000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Boiler insulation jacket**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Boiler insulation jacket**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Mag block duct insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Mag block duct insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Cementitious Joint Insulation on Fiberglass Piping**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room, and crawl Spaces**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **C**

MATERIAL DESCRIPTION: **Cementitious Joint Insulation on Fiberglass Piping**

MATERIAL LOCATION: **Boiler Room, and crawl Spaces**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Mag block tank insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Crawlspace**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Mag block tank insulation**

MATERIAL LOCATION: **Crawlspace**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Pipe insulation**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Pipe insulation joints**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **JOINTS**
DAMAGE QUANTITY: DAMAGE UNITS: **JOINTS**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Pipe insulation joints**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **JOINTS**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **JOINTS**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **Mastic for 1' x 1' White Tiles w/Holes**
MATERIAL LOCATION: **Gym (131)**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **Mastic for 1' x 1' White Tiles w/Holes**

MATERIAL LOCATION: **Gym (131)**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **Mastic for 12" x 12" Gray w/White Streaks Floor Tile**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd FI Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st FI Hallway (North Building), 102, 101, 103, 104, Lunchroom, Main Office (113), 109, 110, 111, 112, Nurse Room**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**

SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**

ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **Mastic for 12" x 12" Gray w/White Streaks Floor Tile**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd FI Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st FI Hallway (North Building), 102, 101, 103, 104, Lunchroom, Main Office (113), 109, 110, 111, 112, Nurse Room**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Mastic for Red Carpet**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **10/31/2022** _____

Chicago Public Schools

Carnow, Conibear and Associates 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Mastic for Red Carpet**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: Chicago Public Schools UNIT NUMBER: 26501 BUILDING ID: 7750
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Ron Brock
SCHOOL NAME: Woodson North School INSPECTION DATE: 10/31/2022
ADDRESS: 4414 S. Evans IDPH LICENSE NO: 100-07134

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: 49
MATERIAL DESCRIPTION: Black science lab tables
MATERIAL LOCATION: Room 305
MATERIAL QUANTITY: 10 MATERIAL UNITS: EA
MATERIAL CATEGORY: MISC FRIABLE: No
ASBESTOS TYPE: Assumed
DISTURBANCE POTENTIAL: LOW CONDITION: No Damage
AHERA DAMAGE CATEGORY: 6 ACBM with the potential for damage
ACCESSIBILITY: Within Reach DAMAGE REASON:
DAMAGE QUANTITY: 0 DAMAGE REASON:
DAMAGE UNITS: EA
COMMENTS:

Inspector's Signature:



Date: 10/31/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **Black science lab tables**

MATERIAL LOCATION: **Room 305**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12" x 12" Blue w/Blue Streaks Floor Tile**
MATERIAL LOCATION: **3rd FI Hallway (North Building), 2nd FI Hallway (North Building), 1st FI Hallway (North Building), Lunchroom**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**

SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**

ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **12" x 12" Blue w/Blue Streaks Floor Tile**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 2nd FI Hallway (North Building), 1st FI Hallway (North Building), Lunchroom**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **1' x 1' White Ceiling Tile w/Holes**
MATERIAL LOCATION: **Gym (131)**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **1' x 1' White Ceiling Tile w/Holes**
MATERIAL LOCATION: **Gym (131)**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **Mastic for 12" x 12" Green Grayish Speckled Floor Tile**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 2nd FI Hallway (North Building), 1st FI Hallway (North Building), Lunchroom**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**

SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**

ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **Mastic for 12" x 12" Green Grayish Speckled Floor Tile**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 2nd FI Hallway (North Building), 1st FI Hallway (North Building), Lunchroom**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **Mastic for 12" x 12" Blue w/Blue Streaks Floor Tile**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 2nd FI Hallway (North Building), 1st FI Hallway (North Building), Lunchroom**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 10/31/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**

SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**

ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **Mastic for 12" x 12" Blue w/Blue Streaks Floor Tile**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 2nd FI Hallway (North Building), 1st FI Hallway (North Building), Lunchroom**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **2' x 2' Smooth Ceiling Tiles**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **2' x 2' Smooth Ceiling Tiles**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **12" x 12" Green Grayish Speckled Floor Tile**

MATERIAL LOCATION: **3rd Fl Hallway (North Building), 2nd Fl Hallway (North Building), 1st Fl Hallway (North Building), Lunchroom**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

DAMAGE QUANTITY: **0**

COMMENTS:

Inspector's Signature: _____



Date: 10/31/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **12" x 12" Green Grayish Speckled Floor Tile**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 2nd FI Hallway (North Building), 1st FI Hallway (North Building), Lunchroom**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/18/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **2' x 4' Fissured Ceiling Tile (2'x2' Look)**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd FI Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st FI Hallway (North Building), 102, 102 Bathroom, 101, 103, 104, Lunchroom, Principal's Office, Main Office (113), 109, 110, 111, 112, Nurse Room**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **2' x 4' Fissured Ceiling Tile (2'x2' Look)**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd FI Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st FI Hallway (North Building), 102, 102 Bathroom, 101, 103, 104, Lunchroom, Principal's Office, Main Office (113), 109, 110, 111, 112, Nurse Room**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUIDLING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **12" x 12" Gray w/White Streaks Floor Tile**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd FI Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st FI Hallway (North Building), 102, 101, 103, 104, Lunchroom, Main Office (113), 109, 110, 111, 112, Nurse Room**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **12" x 12" Gray w/White Streaks Floor Tile**

MATERIAL LOCATION: **3rd FI Hallway (North Building), 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 2nd FI Hallway (North Building), 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 1st FI Hallway (North Building), 102, 101, 103, 104, Lunchroom, Main Office (113), 109, 110, 111, 112, Nurse Room**

MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **Wood flooring**
MATERIAL LOCATION: **Stage (Gym 131)**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 11/18/2022

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ron Brock**
SCHOOL NAME: **Woodson North School** INSPECTION DATE: **10/31/2022**
ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **Chalkboard/whiteboard adhesive**

MATERIAL LOCATION: **Rooms 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 102, 101, 104, 109, 110, 111, 112**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION: **No Damage**

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **10/31/2022**

Chicago Public Schools

Carnow, Conibear and Associates

2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26501** BUILDING ID: **7750**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**

SCHOOL NAME: **Woodson North School** REVIEW DATE: **11/18/2022**

ADDRESS: **4414 S. Evans** IDPH LICENSE NO: **100-07134**

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **Chalkboard/whiteboard adhesive**

MATERIAL LOCATION: **Rooms 300, 301, 302, 303, 304, 306, 314, 308, 305, 309, 310, 311, 312, 313, 210, 211, 212, 213, 214, 205, 207, 200, 201, 202, 203, 204, 208, 209, 102, 101, 104, 109, 110, 111, 112**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **11/18/2022**

APPENDIX B

Inspector and Management Planner Licenses

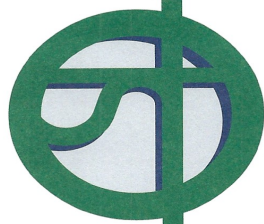

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Ron Brock

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/19/2022

Exam Date: 1/19/2022



Expiration Date: 1/19/2023

Certificate Number: BIR2201190225

Kathy DeSalvo, Director

Ronald Brock

Illinois Licensed Building Inspector, Air Sampling Professional, Asbestos Project Manager

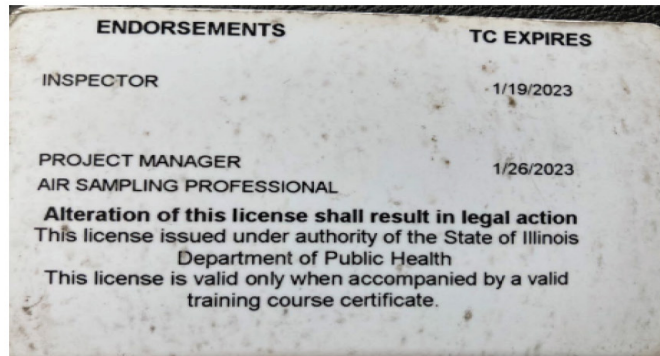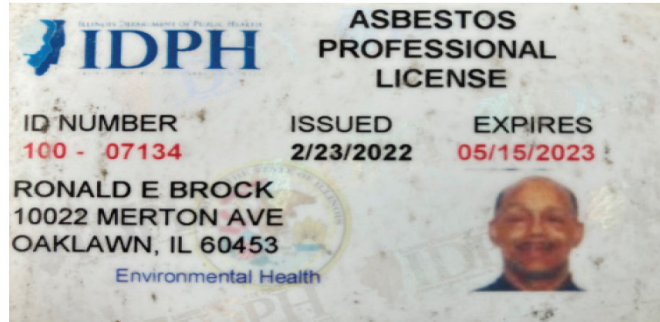



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: MPR2111012581

Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/3/2022

Exam Date: 11/3/2022

Expiration Date: 11/3/2023

Certificate Number: MPR2211033519


Kathy DeSalvo, Director



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER

100 - 19466

ISSUED

4/22/2022

EXPIRES

05/15/2023

EVAN I CHRISTIAN
1119 N HOYNE AVE, APT 1
CHICAGO, IL 60622

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

10/8/2022

MANAGEMENT PLANNER

11/1/2022

PROJECT MANAGER


3/28/2023

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

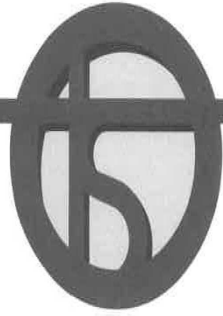

OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 10/8/2021

Exam Date: 10/8/2021

Expiration Date: 10/8/2022

Certificate Number: BIR2110082264

Kathy DeSalvo, Director



Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/11/2022

Exam Date: 11/11/2022

Expiration Date: 11/11/2023

Certificate Number: BIR2211113639

Kathy DeSalvo, Director -

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed