

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2357
SCHOOL NAME: Morrill School
ADDRESS OF SCHOOL: 6011 Rockwell
CITY: Chicago, IL, 60629

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 8/18/2022

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 5/15/2025 ENROLLMENT 546
IDPH INSPECTOR LICENSE NUMBER: 100-21040
IDPH LICENSED INSPECTOR NAME (Please Print): Josh Herman
IDPH MP LICENSE NUMBER: 100-00349
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): James Tuinenga

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074

Richard J. Schleyer 6/2/2025

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Morrill School

6011 Rockwell
Chicago, IL, 60629

Unit: 24571
Building ID: 4880

IDPH ID Number: 14-016-2990-2357

REPORT DATE:
Monday, June 02, 2025

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:
TEM Environmental, Inc.

174 N. Brandon Drive
Glendale Heights, IL, 60139
Phone 630-790-0880
Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

05/30/2025

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr.Culbertson:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 24571 Region: 05 IDPH ID: 14-016-2990-2357

School: Morrill School Building ID: 4880

Address: 6011 Rockwell

Chicago, IL, 60629

Building Contact: Quinn, Kevin **Contact Phone: 7733919500**

Current Building Owners: Chicago Public Schools

Reinspection Date: 5/15/2025

Review Date: 05/30/2025

Inspector: Josh Herman Inspector IDPH License: 100-21040
Management Planner: James Tuinenga Management Planner IDPH License: 100-00349

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,
TEM Environmental, Inc.

Jan Tenison

James Tuinenga
100-00349

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: June 02, 2025

RE: Morrill School, Unit 24571
6011 Rockwell
Chicago, IL, 60629

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Morrill School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Morrill School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Morrill School Unit: 24571 Region: 05
Address: 6011 Rockwell Chicago, IL, 60629
IDPH ID: 14-016-2990-2357 Building ID: 4880
Contact: Quinn, Kevin Phone: 7733919500

2. Description of Facility

Original Construction: 1924 Additional Construction:
Total Square Footage: 1900 No of Floors: 1
Current Occupancy: 546

3. LEA Designated Person

4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Phone: 630-790-0880 Fax: 630-790-0882

5. Inspector

Inspector Name: Josh Herman

Signature: 

6. Management Planner

Management Planner Name: James Tuinenqa

Signature: 

7 Review Date: 05/30/2035

8 IFA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: Richard J. Schleyer

Signature:

Date: 6/2/2025

Name: Richard J. Schleyer

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Morrill School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4880:

31	12"x12" Black Floor Tile
31A	12"x12" Black Floor Tile Mastic
32	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile
32A	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile Mastic
33	12"x12" Grey w/Specs Floor Tile
33A	12"x12" Grey w/Specs Floor Tile Mastic
34	12"x12" Purple w/Specs Floor Tile
34A	12"x12" Purple w/Specs Floor Tile Mastic

35	2'x4' Smooth Ceiling Tile
36	2"x2" Ceramic Tile Grout
37	12"x12" White & 9"x9" Ceramic Tile Grout
38	Blackboards
39	Blue Stage Curtains
NEW	Newly Installed Suspect ACM

B. The following new homogenous areas have been identified for Building 4880:

- 35 2'x4' Smooth Ceiling Tile
- 36 2"x2" Ceramic Tile Grout
- 37 12"x12" White & 9"x9" Ceramic Tile Grout
- 38 Blackboards
- 39 Blue Stage Curtains

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

06	Decorative Plaster
12	12"x12" Peach & Cream Floor Tile Mastic
14	2'x4' Acoustic Ceiling Tile
15	Wall Accents Acoustic Tile
16	12"x12" Tan/Cream Vinyl Floor Tile
17	12"x12" Tan/Cream Vinyl Floor Tile Mastic
18	White Boiler Gasket
19	Foilwrap Over Duct Insulation
20	Purple Carpet Mastic NOT OBSERVED
21	12"x12" Blue on Blue Floor Tile
21M	12x12 Blue on Blue Floor Tile Mastic
22	12x12 Off-White w/Specks Floor Tile
22M	12x12 Off-White w/Specks Floor Tile Mastic
23	12x12 Red w/Red Streaks Floor Tile
23M	12x12 Red w/Red Streaks Floor Tile Mastic
24	12"x12" Green w/Green Specks Floor Tile
24M	12"x12" Green w/Green Specks Floor Tile Mastic
25	12"x12" White w/Blue and Gray Floor Tile
25M	12"x12" White w/Blue and Gray Floor Tile Mastic
26	Carpet Mastic NOT OBSERVED
27	Baseboard Mastic
28	2'x4' Pinhole Ceiling Tile
29	Drywall
30	2'x4' Textured Ceiling Tile
31	12"x12" Black Floor Tlle
31A	12"x12" Black Floor Tile Mastic
32	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile
32A	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile Mastic
33	12"x12" Grey w/Specs Floor Tile
33A	12"x12" Grey w/Specs Floor Tile Mastic
34	12"x12" Purple w/Specs Floor Tile
34A	12"x12" Purple w/Specs Floor Tile Mastic
35	2'x4' Smooth Ceiling Tile
36	2"x2" Ceramic Tile Grout
37	12"x12" White & 9"x9" Ceramic Tile Grout
38	Blackboards
39	Blue Stage Curtains
AA	12"x12" White w/Tan Floor Tile
AA1	12"x12" White w/Tan Floor Tile Mastic
E	Cardboard Insulation

FT-1	12"x12" White w/Blue Pink & Yellow Flecks Floor Tile
FT-7	12"x12" Grey w/Specs Floor Tile
FT-8	12"x12" White w/Dark Streaks Floor Tile
FTM-1	12x12 White w/Blue, Pink & Yellow Flecks Floor Tile Mastic
FTM-7	12"x12" Grey w/Specs Floor Tile Mastic
FTM-8	12"x12" White w/Dark Streaks Floor Mastic
J	Cementious Mud on Valves
K	Aircell Pipe Insulation
NEW	Newly Installed Suspect ACM

The following areas were deemed to be inaccessible:

12	12"x12" Peach & Cream Floor Tile Mastic
14	2'x4' Acoustic Ceiling Tile
17	12"x12" Tan/Cream Vinyl Floor Tile Mastic
20	Purple Carpet Mastic NOT OBSERVED
21M	12x12 Blue on Blue Floor Tile Mastic
22M	12x12 Off-White w/Specs Floor Tile Mastic
23M	12x12 Red w/Red Streaks Floor Tile Mastic
24M	12"x12" Green w/Green Specks Floor Tile Mastic
25M	12"x12" White w/Blue and Gray Floor Tile Mastic
26	Carpet Mastic NOT OBSERVED
27	Baseboard Mastic
AA1	12"x12" White w/Tan Floor Tile Mastic
FT-4	9"x9" Green & Cream Floor Tile (Covered with Carpet) NOT OBSERVED
FTM-1	12x12 White w/Blue, Pink & Yellow Flecks Floor Tile Mastic
FTM-2	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile Mastic
FTM-4	9x9 Green & Cream Floor Tile Mastic (Covered with Carpet)
FTM-5	9"x20" Black Flooring Mastic
FTM-6	12"x12" Cream w/Tan Floor Tile Mastic
FTM-7	12"x12" Grey w/Specs Floor Tile Mastic
FTM-8	12"x12" White w/Dark Streaks Floor Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Josh Herman, IDPH License # 100-21040. The Management Plan was updated by James Tuinenga, IDPH License # 100-00349. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Morrill School Building 4880 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Morrill School **Unit** 24571 **Building ID** 4880
Address 6011 Rockwell **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
02	12"x12" Peach and Cream Floor Tile	2,400	SF	3rd Floor Corridor	CHR	MISC	N	DIST	30		No	ACBM with the potential for damage	3	MODERATE
03	Dark Green Linoleum ABATED			Room 106, Old Library	ABATED	MISC								
06	Decorative Plaster	5,000	SF	Auditorium	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
10	Aircell Debris	200	LF	Unexcavated Tunnel Area	CHR	TSI	Y	LOC	1		No	Damaged or significantly damaged friable thermal system insulating ACBM	10	LOW
11	9x9 Brown & Tan Floor Tile Mastic ABATED			1st & 2nd Floor Corridors	ABATED	MISC								
12	12"x12" Peach & Cream Floor Tile Mastic	2,400	SF	3rd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	Linoleum Mastic ABATED			Room 106- Old Library	ABATED	MISC								
14	2'x4' Acoustic Ceiling Tile	40,000	SF	1st, 2nd & 3rd Floor Classrooms and Corridors	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
15	Wall Accents Acoustic Tile	500	SF	Auditorium	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
16	12"x12" Tan/Cream Vinyl Floor Tile	1,500	SF	Rooms 106, 111, and 201	ASSUMED	MISC	N	DIST	20		No	ACBM with the potential for damage	3	LOW
17	12"x12" Tan/Cream Vinyl Floor Tile Mastic	1,500	SF	Rooms 101, 106, 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	White Boiler Gasket	50	SF	Boiler Room (On Boiler)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	Foilwrap Over Duct Insulation	500	LF	Boiler Room - Boiler Duct Work	ASSUMED	TSI	N	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
20	Purple Carpet Mastic NOT OBSERVED	1,500	SF	Main Office, Storage, Room 107	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12"x12" Blue on Blue Floor Tile	1,900	SF	Cafeteria Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21M	12x12 Blue on Blue Floor Tile Mastic	1,900	SF	Cafeteria, Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	12x12 Off-White w/Speccks Floor Tile	320	SF	Kitchen Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22M	12x12 Off-White w/Speccks Floor Tile Mastic	320	SF	Kitchen Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	12x12 Red w/Red Streaks Floor Tile	450	SF	Room 117	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Morrill School **Unit** 24571 **Building ID** 4880
Address 6011 Rockwell **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
23M	12x12 Red w/Red Streaks Floor Tile Mastic	450	SF	Room 117	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12"x12" Green w/Green Specks Floor Tile	450	SF	Room 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24M	12"x12" Green w/Green Specks Floor Tile Mastic	450	SF	Room 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12"x12" White w/Blue and Gray Floor Tile	5,050	SF	1st Floor Hall, Room 119, 2nd Floor Hall & Room 220	ASSUMED	MISC	N	NONE			No	ACBM with the potential for damage		LOW
25M	12"x12" White w/Blue and Gray Floor Tile Mastic	5,050	SF	1st Floor Hall, Room 119, 2nd Floor Hall & Room 220	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	Carpet Mastic NOT OBSERVED	1,500	SF	Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	Baseboard Mastic	980	SF	Rooms 116, 117, 119, 2nd Floor, Kitchen, Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	2'x4' Pinhole Ceiling Tile	2,100	SF	Floor Room and 1st & 2nd	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
29	Drywall	12,500	SF	Annex- 1st & 2nd Floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	2'x4' Textured Ceiling Tile	4,000	SF	Annex (S)- 1st & 2nd Floor	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
31	12"x12" Black Floor Tile	40	SF	Elevator	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
31A	12"x12" Black Floor Tile Mastic	40	SF	Elevator	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
32	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile	1,800	SF	Rooms 103, 216 & 219	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
32A	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile Mastic	1,800	SF	Rooms 103, 216 & 219	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
33	12"x12" Grey w/Specs Floor Tile	1,800	SF	Main Office, Principal's Office & Room 217	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
33A	12"x12" Grey w/Specs Floor Tile Mastic	1,800	SF	Main Office, Principal's Office & Room 217	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
34	12"x12" Purple w/Specs Floor Tile	1,200	SF	Rooms 214 & 214B	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
34A	12"x12" Purple w/Specs Floor Tile Mastic	1,200	SF	Rooms 214 & 214B	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the		LOW

Chicago Public Schools

School Morrill School **Unit** 24571 **Building ID** 4880
Address 6011 Rockwell **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
35	2"x4' Smooth Ceiling Tile	1,500	SF	Server Line 118A, Server 118B, Office 118C, Toilet 118D	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
36	2"x2" Ceramic Tile Grout	600	SF	3rd Floor Boys' & Girls' Washrooms	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
37	12"x12" White & 9"x9" Ceramic Tile Grout	3,800	SF	Open Area near Door 11	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
38	Blackboards	1,200	SF	Throughout Main Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
39	Blue Stage Curtains	2,000	SF	Assembly Hall Stage & Windows	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
7	Packing Material Around Pumps	25	SF	Tunnels	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
AA	12"x12" White w/Tan Floor Tile	6,000	SF	1st and 2nd Floor Corridors and Room 103	ASSUMED	TSI	N	NONE	0		No	ACBM with the potential for damage		LOW
AA1	12"x12" White w/Tan Floor Tile Mastic	6,000	SF	1st and 2nd Floor Corridors and Room 103	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
C	Air Cell ABATED			Tunnel	ABATED	TSI								
D	Aircell Pipe Joint Insulation ABATED			Tunnels	ABATED	TSI								
E	Cardboard Insulation	500	LF	Boiler Room	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
F	Cardboard Joint Compound	40	SF	Boiler Room, Unexcavated Tunnel	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
FT-1	12"x12" White w/Blue Pink & Yellow Flecks Floor Tile	1,900	SF	Rooms 101, 214, 214B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-2	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile	750	SF	Room 103	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-3	12"x12" Black w/White Flecks Floor Tile NOT OBSERVED			1st Floor Hall- Patch		MISC								
FT-4	9"x9" Green & Cream Floor Tile (Covered with Carpet) NOT OBSERVED	300	SF	Principal's Office and Storage	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-5	9"x20" Black Terrazzo	1,000	SF	1st & 2nd Floor Halls Border	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-6	12"x12" Cream w/Tan Floor Tile	750	SF	Room 106, 111 & 201	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-7	12"x12" Grey w/Specks Floor Tile	300	SF	Gym Office	ASSUMED	MISC	N		0		No	ACBM with the potential for damage	3	LOW

Chicago Public Schools

School Morrill School **Unit** 24571 **Building ID** 4880
Address 6011 Rockwell **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
FT-8	12"x12" White w/Dark Streaks Floor Tile	2,000	SF	Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-1	12x12 White w/Blue, Pink & Yellow Flecks Floor Tile Mastic	1,900	SF	Rooms 101, 214, 214B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-2	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile Mastic	750	SF	Room 103, Main Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-3	12"x12" Black w/White Flecks Floor Tile Mastic NOT OBSERVED			1st Floor Hall- Patch		MISC								
FTM-4	9x9 Green & Cream Floor Tile Mastic (Covered with Carpet)	300	SF	Principal's Office, Storage	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-5	9"x20" Black Flooring Mastic	1,000	SF	1st & 2nd Floor Halls	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-6	12"x12" Cream w/Tan Floor Tile Mastic	1,800	SF	Room 106, 111 & 201	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-7	12"x12" Grey w/Specs Floor Tile Mastic	300	SF	Gym Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-8	12"x12" White w/Dark Streaks Floor Mastic	2,000	SF	Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
G	Mag Block-Boiler ABATED			Boiler Room	ABATED	TSI								
I	9"x9" Brown & Tan Floor Tile ABATED			1st & 2nd floor corridors	ABATED	MISC								
J	Cementitious Mud on Valves	10	LF	(N) Base Fan Room	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACM or friable suspect ACM		LOW
K	Aircell Pipe Insulation	350	LF	(W) Tunnel Unexcavated	ASSUMED	TSI	Y	DIST	10		No	Damaged or significantly damaged friable thermal system insulating ACM	3	LOW
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	ASSUMED	MISC		UNKNO WN			Yes	ACBM with the potential for damage		

Chicago Public Schools

School Morrill School Unit 24571 Building ID 4880
Address 6011 Rockwell Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date <u>5/15/2025</u>
Inspector Name <u>Josh Herman</u>
100-21040 <u>5/15/2026</u>
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
02	
03	
06	
10	
11	
12	
13	
14	
15	
16	Damage is located in Rooms 106, 111 & 201
17	
18	
19	
20	Not Observed 2025. Main Office has 12"x12" Gray w/Speccks FT
21	
21M	
22	
22M	
23	
23M	
24	
24M	
25	
25M	

Chicago Public Schools

School Morrill School **Unit** 24571 **Building ID** 4880
Address 6011 Rockwell **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
26	Not Observed 2025
27	
28	
29	
30	
31	
31A	
32	
32A	
33	
33A	
34	
34A	
35	
36	
37	
38	
39	
7	
AA	
AA1	
C	
D	
E	
F	
FT-1	
FT-2	
FT-3	Not Observed 2022, 2025
FT-4	Not Observed 2025

Chicago Public Schools

School Morrill School **Unit** 24571 **Building ID** 4880
Address 6011 Rockwell **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
FT-5	
FT-6	
FT-7	
FT-8	
FTM-1	
FTM-2	
FTM-3	Not Observed 2022, 2025
FTM-4	
FTM-5	
FTM-6	
FTM-7	
FTM-8	
G	
I	
J	
K	
NEW	

Table II
Management Planner's Review

Chicago Public Schools

School Morrill School

Unit 24571

Building ID 4880

Address 6011 Rockwell

Chicago, IL, 60629

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
02	12"x12" Peach and Cream Floor Tile	2,400	SF	3rd Floor Corridor	Chrysotile	MISC	No	30	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	Dark Green Linoleum ABATED			Room 106, Old Library	Abated	MISC					
06	Decorative Plaster	5,000	SF	Auditorium	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
10	Aircell Debris	200	LF	Unexcavated Tunnel Area	Chrysotile	TSI	Yes	1	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Follow O&M Plan
11	9x9 Brown & Tan Floor Tile Mastic ABATED			1st & 2nd Floor Corridors	Abated	MISC					
12	12"x12" Peach & Cream Floor Tile Mastic	2,400	SF	3rd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	Linoleum Mastic ABATED			Room 106- Old Library	Abated	MISC					
14	2'x4' Acoustic Ceiling Tile	40,000	SF	1st, 2nd & 3rd Floor Classrooms and Corridors	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
15	Wall Accents Acoustic Tile	500	SF	Auditorium	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
16	12"x12" Tan/Cream Vinyl Floor Tile	1,500	SF	Rooms 106, 111, and 201	Assumed	MISC	No	20	SF	6 ACBM with the potential for damage	Remove
17	12"x12" Tan/Cream Vinyl Floor Tile Mastic	1,500	SF	Rooms 101, 106, 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	White Boiler Gasket	50	SF	Boiler Room (On Boiler)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	Foilwrap Over Duct Insulation	500	LF	Boiler Room - Boiler Duct Work	Assumed	TSI	No	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
20	Purple Carpet Mastic NOT OBSERVED	1,500	SF	Main Office, Storage, Room 107	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12"x12" Blue on Blue Floor Tile	1,900	SF	Cafeteria Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21M	12x12 Blue on Blue Floor Tile Mastic	1,900	SF	Cafeteria, Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12x12 Off-White w/Specks Floor Tile	320	SF	Kitchen Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22M	12x12 Off-White w/Specks Floor Tile Mastic	320	SF	Kitchen Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12x12 Red w/Red Streaks Floor Tile	450	SF	Room 117	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23M	12x12 Red w/Red Streaks Floor Tile Mastic	450	SF	Room 117	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12"x12" Green w/Green Specks Floor Tile	450	SF	Room 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24M	12"x12" Green w/Green Specks Floor Tile Mastic	450	SF	Room 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12"x12" White w/Blue and Gray Floor Tile	5,050	SF	1st Floor Hall, Room 119, 2nd Floor Hall & Room 220	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Follow O&M Plan
25M	12"x12" White w/Blue and Gray Floor Tile Mastic	5,050	SF	1st Floor Hall, Room 119, 2nd Floor Hall & Room 220	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	Carpet Mastic NOT OBSERVED	1,500	SF	Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	Baseboard Mastic	980	SF	Rooms 116, 117, 119, 2nd Floor, Kitchen, Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	2'x4' Pinhole Ceiling Tile	2,100	SF	Floor Room and 1st & 2nd	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable	Follow O&M Plan

Chicago Public Schools

School Morrill School

Unit 24571

Building ID 4880

Address 6011 Rockwell

Chicago, IL, 60629

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
29	Drywall	12,500	SF	Annex- 1st & 2nd Floor	Assumed	MISC	No	0	SF	suspect ACBM	
30	2'x4' Textured Ceiling Tile	4,000	SF	Annex (S)- 1st & 2nd Floor	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12"x12" Black Floor Tile	40	SF	Elevator	Assumed	MISC	No	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
31A	12"x12" Black Floor Tile Mastic	40	SF	Elevator	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile	1,800	SF	Rooms 103, 216 & 219	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32A	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile Mastic	1,800	SF	Rooms 103, 216 & 219	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12"x12" Grey w/Specs Floor Tile	1,800	SF	Main Office, Principal's Office & Room 217	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33A	12"x12" Grey w/Specs Floor Tile Mastic	1,800	SF	Main Office, Principal's Office & Room 217	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12"x12" Purple w/Specs Floor Tile	1,200	SF	Rooms 214 & 214B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34A	12"x12" Purple w/Specs Floor Tile Mastic	1,200	SF	Rooms 214 & 214B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	2'x4' Smooth Ceiling Tile	1,500	SF	Server Line 118A, Servery 118B, Office 118C, Toilet 118D	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	2"x2" Ceramic Tile Grout	600	SF	3rd Floor Boys' & Girls' Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12"x12" White & 9"x9" Ceramic Tile Grout	3,800	SF	Open Area near Door 11	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	Blackboards	1,200	SF	Throughout Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	Blue Stage Curtains	2,000	SF	Assembly Hall Stage & Windows	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
7	Packing Material Around Pumps	25	SF	Tunnels	Chrysotile	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
AA	12"x12" White w/Tan Floor Tile	6,000	SF	1st and 2nd Floor Corridors and Room 103	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
AA1	12"x12" White w/Tan Floor Tile Mastic	6,000	SF	1st and 2nd Floor Corridors and Room 103	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C	Air Cell ABATED			Tunnel	Abated	TSI					
D	Aircell Pipe Joint Insulation ABATED			Tunnels	Abated	TSI					
E	Cardboard Insulation	500	LF	Boiler Room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
F	Cardboard Joint Compound	40	SF	Boiler Room, Unexcavated Tunnel	Chrysotile	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
FT-1	12"x12" White w/Blue Pink & Yellow Flecks Floor Tile	1,900	SF	Rooms 101, 214, 214B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Morrill School

Unit 24571

Building ID 4880

Address 6011 Rockwell

Chicago, IL, 60629

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
FT-2	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile	750	SF	Room 103	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-3	12"x12" Black w/White Flecks Floor Tile NOT OBSERVED			1st Floor Hall- Patch		MISC					
FT-4	9"x9" Green & Cream Floor Tile (Covered with Carpet) NOT OBSERVED	300	SF	Principal's Office and Storage	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-5	9"x20" Black Terrazzo	1,000	SF	1st & 2nd Floor Halls Border	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-6	12"x12" Cream w/Tan Floor Tile	750	SF	Room 106, 111 & 201	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-7	12"x12" Grey w/Specs Floor Tile	300	SF	Gym Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-8	12"x12" White w/Dark Streaks Floor Tile	2,000	SF	Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-1	12x12 White w/Blue, Pink & Yellow Flecks Floor Tile Mastic	1,900	SF	Rooms 101, 214, 214B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-2	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile Mastic	750	SF	Room 103, Main Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-3	12"x12" Black w/White Flecks Floor Tile Mastic NOT OBSERVED			1st Floor Hall- Patch		MISC					
FTM-4	9x9 Green & Cream Floor Tile Mastic (Covered with Carpet)	300	SF	Principal's Office, Storage	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-5	9"x20" Black Flooring Mastic	1,000	SF	1st & 2nd Floor Halls	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-6	12"x12" Cream w/Tan Floor Tile Mastic	1,800	SF	Room 106, 111 & 201	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-7	12"x12" Grey w/Specs Floor Tile Mastic	300	SF	Gym Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-8	12"x12" White w/Dark Streaks Floor Mastic	2,000	SF	Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	Mag Block-Boiler ABATED			Boiler Room	Abated	TSI					
I	9"x9" Brown & Tan Floor Tile ABATED			1st & 2nd floor corridors	Abated	MISC					
J	Cementious Mud on Valves	10	LF	(N) Base Fan Room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
K	Aircell Pipe Insulation	350	LF	(W) Tunnel Unexcavated	Assumed	TSI	Yes	10	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
NEW	Newly Installed Suspect ACM			Installed After Implementation of Management Plan and After Renovations	Assumed	MISC				6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Morrill School

Unit 24571

Building ID 4880

Address 6011 Rockwell

Chicago, IL, 60629

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Review Date	5/30/2025
Manager Planner Name	James Tuinenga
100-00349	5/15/2026
Manager IDPH License No/Expiration	

HA Number	Management Comments
02	
03	
06	
10	
11	
12	
13	
14	
15	

Chicago Public Schools

School Morrill School

Unit 24571

Building ID 4880

Address 6011 Rockwell

Chicago, IL, 60629

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
16	Response action selective of areas of damage only
17	
18	
19	
20	
21	
21M	
22	
22M	
23	
23M	
24	
24M	
25	
25M	
26	
27	
28	
29	
30	
31	
31A	
32	
32A	
33	
33A	
34	

Chicago Public Schools

School Morrill School

Unit 24571

Building ID 4880

Address 6011 Rockwell

Chicago, IL, 60629

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
34A	
35	
36	
37	
38	
39	
7	
AA	
AA1	
C	
D	
E	
F	
FT-1	
FT-2	
FT-3	
FT-4	
FT-5	
FT-6	
FT-7	
FT-8	
FTM-1	
FTM-2	
FTM-3	
FTM-4	
FTM-5	
FTM-6	

Chicago Public Schools

School Morrill School

Unit 24571

Building ID 4880

Address 6011 Rockwell

Chicago, IL, 60629

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
FTM-7	
FTM-8	
G	
I	
J	
K	Repair response action selective to unexcavated area in basement tunnel
NEW	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02		
MATERIAL DESCRIPTION:	12"x12" Peach and Cream Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Deterioration Water		
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration Water		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	3rd Floor Corridor		
MATERIAL QUANTITY:	2400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **02**

MATERIAL DESCRIPTION: **12"x12" Peach and Cream Floor Tile**

MATERIAL LOCATION: **3rd Floor Corridor**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **Dark Green Linoleum ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 106, Old Library**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **03**

MATERIAL DESCRIPTION: **Dark Green Linoleum ABATED**

MATERIAL LOCATION: **Room 106, Old Library**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	06		
MATERIAL DESCRIPTION:	Decorative Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **Decorative Plaster**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	Aircell Debris		
HISTORICAL AHERA DAMAGE CATEGORY	1 Damaged or significantly damaged friable thermal system insulating ACBM		
HISTORICAL DAMAGE REASON:	Water Deterioration		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:	Water Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Unexcavated Tunnel Area		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **Aircell Debris**

MATERIAL LOCATION: **Unexcavated Tunnel Area**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **1** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **9x9 Brown & Tan Floor Tile Mastic ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st & 2nd Floor Corridors**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **9x9 Brown & Tan Floor Tile Mastic ABATED**

MATERIAL LOCATION: **1st & 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	12"x12" Peach & Cream Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	3rd Floor Corridor		
MATERIAL QUANTITY:	2400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **12"x12" Peach & Cream Floor Tile Mastic**

MATERIAL LOCATION: **3rd Floor Corridor**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Linoleum Mastic ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE: _____

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 106- Old Library**

MATERIAL QUANTITY: _____ MATERIAL UNITS: _____

DAMAGE QUANTITY: _____ DAMAGE UNITS: _____

COMMENTS:

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Linoleum Mastic ABATED**

MATERIAL LOCATION: **Room 106- Old Library**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	2'x4' Acoustic Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Classrooms and Corridors		
MATERIAL QUANTITY:	40000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **2'x4' Acoustic Ceiling Tile**

MATERIAL LOCATION: **1st, 2nd & 3rd Floor Classrooms and Corridors**

MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	Wall Accents Acoustic Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Auditorium		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Wall Accents Acoustic Tile**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	12"x12" Tan/Cream Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 106, 111, and 201		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Damage is located in Rooms 106, 111 & 201		

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **12"x12" Tan/Cream Vinyl Floor Tile**

MATERIAL LOCATION: **Rooms 106, 111, and 201**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **20** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Response action selective of areas of damage only

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	12"x12" Tan/Cream Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 101, 106, 201		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **12"x12" Tan/Cream Vinyl Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 101, 106, 201**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	White Boiler Gasket		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room (On Boiler)		
MATERIAL QUANTITY:	50	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **White Boiler Gasket**

MATERIAL LOCATION: **Boiler Room (On Boiler)**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	Foilwrap Over Duct Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room - Boiler Duct Work		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Foilwrap Over Duct Insulation**

MATERIAL LOCATION: **Boiler Room - Boiler Duct Work**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	Purple Carpet Mastic NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office, Storage, Room 107		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not Observed 2025. Main Office has 12"x12" Gray w/Speccks FT		

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Purple Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **Main Office, Storage, Room 107**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	12"x12" Blue on Blue Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Cafeteria Lunchroom		
MATERIAL QUANTITY:	1900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **12"x12" Blue on Blue Floor Tile**

MATERIAL LOCATION: **Cafeteria Lunchroom**

MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	21M		
MATERIAL DESCRIPTION:	12x12 Blue on Blue Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Cafeteria, Lunchroom		
MATERIAL QUANTITY:	1900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **21M**

MATERIAL DESCRIPTION: **12x12 Blue on Blue Floor Tile Mastic**

MATERIAL LOCATION: **Cafeteria, Lunchroom**

MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	12x12 Off-White w/Speccks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen Office		
MATERIAL QUANTITY:	320	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **12x12 Off-White w/Speccks Floor Tile**

MATERIAL LOCATION: **Kitchen Office**

MATERIAL QUANTITY: **320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22M		
MATERIAL DESCRIPTION:	12x12 Off-White w/Speccks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen Office		
MATERIAL QUANTITY:	320	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **22M**

MATERIAL DESCRIPTION: **12x12 Off-White w/Speccks Floor Tile Mastic**

MATERIAL LOCATION: **Kitchen Office**

MATERIAL QUANTITY: **320** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23		
MATERIAL DESCRIPTION:	12x12 Red w/Red Streaks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 117		
MATERIAL QUANTITY:	450	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **12x12 Red w/Red Streaks Floor Tile**

MATERIAL LOCATION: **Room 117**

MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	23M		
MATERIAL DESCRIPTION:	12x12 Red w/Red Streaks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 117		
MATERIAL QUANTITY:	450	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **23M**

MATERIAL DESCRIPTION: **12x12 Red w/Red Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Room 117**

MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	12"x12" Green w/Green Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 116		
MATERIAL QUANTITY:	450	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **12"x12" Green w/Green Specks Floor Tile**

MATERIAL LOCATION: **Room 116**

MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24M		
MATERIAL DESCRIPTION:	12"x12" Green w/Green Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 116		
MATERIAL QUANTITY:	450	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **24M**

MATERIAL DESCRIPTION: **12"x12" Green w/Green Specks Floor Tile Mastic**

MATERIAL LOCATION: **Room 116**

MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	12"x12" White w/Blue and Gray Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Hall, Room 119, 2nd Floor Hall & Room 220		
MATERIAL QUANTITY:	5050	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **12"x12" White w/Blue and Gray Floor Tile**

MATERIAL LOCATION: **1st Floor Hall, Room 119, 2nd Floor Hall & Room 220**

MATERIAL QUANTITY: **5050** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25M		
MATERIAL DESCRIPTION:	12"x12" White w/Blue and Gray Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Hall, Room 119, 2nd Floor Hall & Room 220		
MATERIAL QUANTITY:	5050	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **25M**

MATERIAL DESCRIPTION: **12"x12" White w/Blue and Gray Floor Tile Mastic**

MATERIAL LOCATION: **1st Floor Hall, Room 119, 2nd Floor Hall & Room 220**

MATERIAL QUANTITY: **5050** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	Carpet Mastic NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Not Observed 2025		

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **Carpet Mastic NOT OBSERVED**

MATERIAL LOCATION: **Library**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 116, 117, 119, 2nd Floor, Kitchen, Lunchroom		
MATERIAL QUANTITY:	980	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **Baseboard Mastic**

MATERIAL LOCATION: **Rooms 116, 117, 119, 2nd Floor, Kitchen, Lunchroom**

MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	2'x4' Pinhole Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Floor Room and 1st & 2nd		
MATERIAL QUANTITY:	2100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **2'x4' Pinhole Ceiling Tile**

MATERIAL LOCATION: **Floor Room and 1st & 2nd**

MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	Drywall		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Annex- 1st & 2nd Floor		
MATERIAL QUANTITY:	12500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Annex- 1st & 2nd Floor**

MATERIAL QUANTITY: **12500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	2'x4' Textured Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Annex (S)- 1st & 2nd Floor		
MATERIAL QUANTITY:	4000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **2'x4' Textured Ceiling Tile**

MATERIAL LOCATION: **Annex (S)- 1st & 2nd Floor**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	12"x12" Black Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Elevator		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **12"x12" Black Floor Tile**

MATERIAL LOCATION: **Elevator**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31A		
MATERIAL DESCRIPTION:	12"x12" Black Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Elevator		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **31A**

MATERIAL DESCRIPTION: **12"x12" Black Floor Tile Mastic**

MATERIAL LOCATION: **Elevator**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 103, 216 & 219		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **12"x12" White w/Blue, Pink & Yellow Specks Floor Tile**

MATERIAL LOCATION: **Rooms 103, 216 & 219**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32A		
MATERIAL DESCRIPTION:	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 103, 216 & 219		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **32A**

MATERIAL DESCRIPTION: **12"x12" White w/Blue, Pink & Yellow Specks Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 103, 216 & 219**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	12"x12" Grey w/Speccks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office, Principal's Office & Room 217		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **12"x12" Grey w/Speccks Floor Tile**

MATERIAL LOCATION: **Main Office, Principal's Office & Room 217**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33A		
MATERIAL DESCRIPTION:	12"x12" Grey w/Speccks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office, Principal's Office & Room 217		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **33A**

MATERIAL DESCRIPTION: **12"x12" Grey w/Speccks Floor Tile Mastic**

MATERIAL LOCATION: **Main Office, Principal's Office & Room 217**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	12"x12" Purple w/Speccks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 214 & 214B		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **12"x12" Purple w/Specs Floor Tile**

MATERIAL LOCATION: **Rooms 214 & 214B**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	34A		
MATERIAL DESCRIPTION:	12"x12" Purple w/Speccks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 214 & 214B		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **34A**

MATERIAL DESCRIPTION: **12"x12" Purple w/Specs Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 214 & 214B**

MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	7		
MATERIAL DESCRIPTION:	Packing Material Around Pumps		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Tunnels		
MATERIAL QUANTITY:	25	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **7**

MATERIAL DESCRIPTION: **Packing Material Around Pumps**

MATERIAL LOCATION: **Tunnels**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	AA		
MATERIAL DESCRIPTION:	12"x12" White w/Tan Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st and 2nd Floor Corridors and Room 103		
MATERIAL QUANTITY:	6000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **AA**

MATERIAL DESCRIPTION: **12"x12" White w/Tan Floor Tile**

MATERIAL LOCATION: **1st and 2nd Floor Corridors and Room 103**

MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	AA1		
MATERIAL DESCRIPTION:	12"x12" White w/Tan Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st and 2nd Floor Corridors and Room 103		
MATERIAL QUANTITY:	6000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **AA1**

MATERIAL DESCRIPTION: **12"x12" White w/Tan Floor Tile Mastic**

MATERIAL LOCATION: **1st and 2nd Floor Corridors and Room 103**

MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Air Cell ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Tunnel**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **C**

MATERIAL DESCRIPTION: **Air Cell ABATED**

MATERIAL LOCATION: **Tunnel**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **Aircell Pipe Joint Insulation ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Tunnels**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **Aircell Pipe Joint Insulation ABATED**

MATERIAL LOCATION: **Tunnels**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	E		
MATERIAL DESCRIPTION:	Cardboard Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **Cardboard Insulation**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	F		
MATERIAL DESCRIPTION:	Cardboard Joint Compound		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room, Unexcavated Tunnel		
MATERIAL QUANTITY:	40	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **F**

MATERIAL DESCRIPTION: **Cardboard Joint Compound**

MATERIAL LOCATION: **Boiler Room, Unexcavated Tunnel**

MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FT-1		
MATERIAL DESCRIPTION:	12"x12" White w/Blue Pink & Yellow Flecks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 101, 214, 214B		
MATERIAL QUANTITY:	1900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FT-1**

MATERIAL DESCRIPTION: **12"x12" White w/Blue Pink & Yellow Flecks Floor Tile**

MATERIAL LOCATION: **Rooms 101, 214, 214B**

MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FT-2		
MATERIAL DESCRIPTION:	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 103		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FT-2**

MATERIAL DESCRIPTION: **12"x12" White w/Blue, Pink & Yellow Specks Floor Tile**

MATERIAL LOCATION: **Room 103**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-3**

MATERIAL DESCRIPTION: **12"x12" Black w/White Flecks Floor Tile NOT OBSERVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **FRIABLE**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Hall- Patch**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2022, 2025**

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FT-3**

MATERIAL DESCRIPTION: **12"x12" Black w/White Flecks Floor Tile NOT OBSERVED**

MATERIAL LOCATION: **1st Floor Hall- Patch**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FT-4		
MATERIAL DESCRIPTION:	9"x9" Green & Cream Floor Tile (Covered with Carpet) NOT OBSERVED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principal's Office and Storage		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:			
COMMENTS:	Not Observed 2025		

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FT-4**

MATERIAL DESCRIPTION: **9"x9" Green & Cream Floor Tile (Covered with Carpet) NOT OBSERVED**

MATERIAL LOCATION: **Principal's Office and Storage**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FT-5		
MATERIAL DESCRIPTION:	9"x20" Black Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st & 2nd Floor Halls Border		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FT-5**

MATERIAL DESCRIPTION: **9"x20" Black Terrazzo**

MATERIAL LOCATION: **1st & 2nd Floor Halls Border**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FT-6		
MATERIAL DESCRIPTION:	12"x12" Cream w/Tan Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 106, 111 & 201		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FT-6**

MATERIAL DESCRIPTION: **12"x12" Cream w/Tan Floor Tile**

MATERIAL LOCATION: **Room 106, 111 & 201**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FT-7		
MATERIAL DESCRIPTION:	12"x12" Grey w/Speccks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gym Office		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FT-7**

MATERIAL DESCRIPTION: **12"x12" Grey w/Speccks Floor Tile**

MATERIAL LOCATION: **Gym Office**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FT-8		
MATERIAL DESCRIPTION:	12"x12" White w/Dark Streaks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FT-8**

MATERIAL DESCRIPTION: **12"x12" White w/Dark Streaks Floor Tile**

MATERIAL LOCATION: **Library**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FTM-1		
MATERIAL DESCRIPTION:	12x12 White w/Blue, Pink & Yellow Flecks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 101, 214, 214B		
MATERIAL QUANTITY:	1900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FTM-1**

MATERIAL DESCRIPTION: **12x12 White w/Blue, Pink & Yellow Flecks Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 101, 214, 214B**

MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FTM-2		
MATERIAL DESCRIPTION:	12"x12" White w/Blue, Pink & Yellow Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 103, Main Office		
MATERIAL QUANTITY:	750	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FTM-2**

MATERIAL DESCRIPTION: **12"x12" White w/Blue, Pink & Yellow Specks Floor Tile Mastic**

MATERIAL LOCATION: **Room 103, Main Office**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-3**

MATERIAL DESCRIPTION: **12"x12" Black w/White Flecks Floor Tile Mastic NOT OBSERVED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **FRIABLE**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Hall- Patch**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2022, 2025**

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FTM-3**

MATERIAL DESCRIPTION: **12"x12" Black w/White Flecks Floor Tile Mastic NOT OBSERVED**

MATERIAL LOCATION: **1st Floor Hall- Patch**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FTM-4		
MATERIAL DESCRIPTION:	9x9 Green & Cream Floor Tile Mastic (Covered with Carpet)		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Principal's Office, Storage		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FTM-4**

MATERIAL DESCRIPTION: **9x9 Green & Cream Floor Tile Mastic (Covered with Carpet)**

MATERIAL LOCATION: **Principal's Office, Storage**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FTM-5		
MATERIAL DESCRIPTION:	9"x20" Black Flooring Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st & 2nd Floor Halls		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FTM-5**

MATERIAL DESCRIPTION: **9"x20" Black Flooring Mastic**

MATERIAL LOCATION: **1st & 2nd Floor Halls**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FTM-6		
MATERIAL DESCRIPTION:	12"x12" Cream w/Tan Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 106, 111 & 201		
MATERIAL QUANTITY:	1800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FTM-6**

MATERIAL DESCRIPTION: **12"x12" Cream w/Tan Floor Tile Mastic**

MATERIAL LOCATION: **Room 106, 111 & 201**

MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FTM-7		
MATERIAL DESCRIPTION:	12"x12" Grey w/Speccks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gym Office		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FTM-7**

MATERIAL DESCRIPTION: **12"x12" Grey w/Speccks Floor Tile Mastic**

MATERIAL LOCATION: **Gym Office**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	FTM-8		
MATERIAL DESCRIPTION:	12"x12" White w/Dark Streaks Floor Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **FTM-8**

MATERIAL DESCRIPTION: **12"x12" White w/Dark Streaks Floor Mastic**

MATERIAL LOCATION: **Library**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **Mag Block-Boiler ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **Mag Block-Boiler ABATED**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **9"x9" Brown & Tan Floor Tile ABATED**

HISTORICAL AHERA DAMAGE CATEGORY

HISTORICAL DAMAGE REASON:

HISTORICAL RESPONSE ACTION:

ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st & 2nd floor corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **9"x9" Brown & Tan Floor Tile ABATED**

MATERIAL LOCATION: **1st & 2nd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	J		
MATERIAL DESCRIPTION:	Cementious Mud on Valves		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	(N) Base Fan Room		
MATERIAL QUANTITY:	10	MATERIAL UNITS:	LF
DAMAGE QUANTITY:			
COMMENTS:			

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **J**

MATERIAL DESCRIPTION: **Cementious Mud on Valves**

MATERIAL LOCATION: **(N) Base Fan Room**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUILDING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	K		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 Damaged or significantly damaged friable thermal system insulating ACBM		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	(W) Tunnel Unexcavated		
MATERIAL QUANTITY:	350	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	DAMAGE UNITS: LF		
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **K**

MATERIAL DESCRIPTION: **Aircell Pipe Insulation**

MATERIAL LOCATION: **(W) Tunnel Unexcavated**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **10** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair response action selective to unexcavated area in basement tunnell

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	NEW		
MATERIAL DESCRIPTION:	Newly Installed Suspect ACM		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **05/15/2025**

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	James Tuinenga		
SCHOOL NAME:	Morrill School	REVIEW DATE:	5/30/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

HOMOGENEOUS AREA: **NEW**

MATERIAL DESCRIPTION: **Newly Installed Suspect ACM**

MATERIAL LOCATION: **Installed After Implementation of Management Plan and After Renovations**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	2'x4' Smooth Ceiling Tile		
MATERIAL LOCATION:	Server Line 118A, Servery 118B, Office 118C, Toilet 118D		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	Yes
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Barely Reachable	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **James Tuinenga**

SCHOOL NAME: **Morrill School** REVIEW DATE: **5/30/2025**

ADDRESS: **6011 Rockwell** IDPH LICENSE NO: **100-21040**

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **2'x4' Smooth Ceiling Tile**

MATERIAL LOCATION: **Server Line 118A, Servery 118B, Office 118C, Toilet 118D**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	Blackboards		
MATERIAL LOCATION:	Throughout Main Building		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **James Tuinenga**

SCHOOL NAME: **Morrill School** REVIEW DATE: **5/30/2025**

ADDRESS: **6011 Rockwell** IDPH LICENSE NO: **100-21040**

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **Blackboards**

MATERIAL LOCATION: **Throughout Main Building**


MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

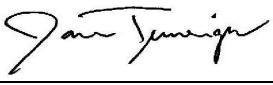Management Planner's Signature:  Date: 05/30/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	Blue Stage Curtains		
MATERIAL LOCATION:	Assembly Hall Stage & Windows		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **James Tuinenga**

SCHOOL NAME: **Morrill School** REVIEW DATE: **5/30/2025**

ADDRESS: **6011 Rockwell** IDPH LICENSE NO: **100-21040**

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **Blue Stage Curtains**

MATERIAL LOCATION: **Assembly Hall Stage & Windows**


MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

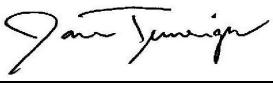Management Planner's Signature:  Date: 05/30/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12"x12" White & 9"x9" Ceramic Tile Grout		
MATERIAL LOCATION:	Open Area near Door 11		
MATERIAL QUANTITY:	3800	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF

COMMENTS:

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **James Tuinenga**

SCHOOL NAME: **Morrill School** REVIEW DATE: **5/30/2025**

ADDRESS: **6011 Rockwell** IDPH LICENSE NO: **100-21040**

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **12"x12" White & 9"x9" Ceramic Tile Grout**

MATERIAL LOCATION: **Open Area near Door 11**


MATERIAL QUANTITY: **3800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

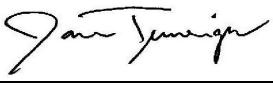Management Planner's Signature:  Date: 05/30/2025

Chicago Public Schools

TEM Environmental, Inc.
2025 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	24571	BUIDLING ID:	4880
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Josh Herman		
SCHOOL NAME:	Morrill School	INSPECTION DATE:	5/15/2025		
ADDRESS:	6011 Rockwell	IDPH LICENSE NO:	100-21040		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	2"x2" Ceramic Tile Grout		
MATERIAL LOCATION:	3rd Floor Boys' & Girls' Washrooms		
MATERIAL QUANTITY:	600	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	No
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Within Reach	DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 05/15/2025

Chicago Public Schools

TEM Environmental, Inc. 2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **James Tuinenga**

SCHOOL NAME: **Morrill School** REVIEW DATE: **5/30/2025**

ADDRESS: **6011 Rockwell** IDPH LICENSE NO: **100-21040**

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **2"x2" Ceramic Tile Grout**

MATERIAL LOCATION: **3rd Floor Boys' & Girls' Washrooms**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:



Date: **05/30/2025**

Chicago Public Schools

TEM Environmental, Inc.

2025 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

JOSH R HERMAN
5121 N MONITOR AVE
CHICAGO, IL 60630

5/23/2025

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 21040

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License



**ASBESTOS
PROFESSIONAL
LICENSE**

ENDORSEMENTS

TC EXPIRES

INSPECTOR

7/19/2025

ID NUMBER
100 - 21040

ISSUED
5/23/2025

EXPIRES
05/15/2026

JOSH R HERMAN
5121 N MONITOR AVE
CHICAGO, IL 60630
Environmental Health



Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

Reliable
Environmental
Solutions, Inc. **R | E | S**

This is to certify that

James Tuinenga

*has on 2/2/22, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Building Inspector Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher.*

Course Date: February 2, 2022

COURSE LENGTH: 4 HOURS

Examination Date: February 2, 2022

Expiration Date: February 2, 2023

Certificate Number: BIR/1013

William S. Williams


Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois 217.787.9800 217.787.9801 FAX www.ReliableEnv.com



TEM ENVIRONMENTAL, INC.

ENVIRONMENTAL SCIENTISTS | INDUSTRIAL HYGIENISTS

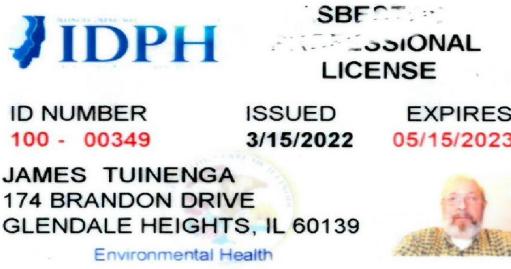

ENDORSEMENTS

INSPECTOR	2/2/2023
PROJECT DESIGNER	2/3/2023
MANAGEMENT PLANNER	2/2/2023
PROJECT MANAGER	2/1/2023
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

**Reliable
Environmental
Solutions, Inc. RES**

This is to certify that

James Tuinenga

*has on 2/02/22, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: February 2, 2022

COURSE LENGTH: 4 HOURS

Examination Date: February 2, 2022

Expiration Date: February 2, 2023

William S. Williams


Certificate Number: MPR/0458

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois 217.787.9800 217.787.9801 FAX www.ReliableEnv.com



TEM ENVIRONMENTAL, INC.
ENVIRONMENTAL SCIENTISTS | INDUSTRIAL HYGIENISTS

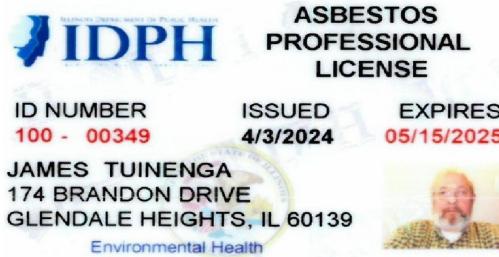

ENDORSEMENTS

INSPECTOR
PROJECT DESIGNER
MANAGEMENT PLANNER
PROJECT MANAGER
AIR SAMPLING PROFESSIONAL

TC EXPIRES

1/31/2025
2/1/2025
1/31/2025
1/30/2025

Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois

Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**Reliable
Environmental
Solutions, Inc. R E S**

This is to certify that

James Tuinenga

*has on 2/5/25, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Building Inspector Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher.*

Course Date: February 5, 2025

COURSE LENGTH: 4 HOURS

Examination Date: February 5, 2025

Expiration Date: February 5, 2026

Certificate Number: BIR/1227




Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois 217.787.9800 www.ReliableEnv.com



TEM ENVIRONMENTAL, INC.
ENVIRONMENTAL SCIENTISTS | INDUSTRIAL HYGIENISTS

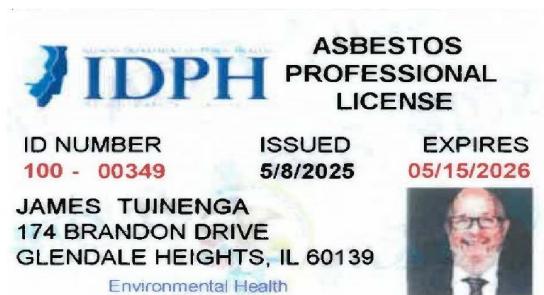

ENDORSEMENTS

INSPECTOR
PROJECT DESIGNER
MANAGEMENT PLANNER
PROJECT MANAGER
AIR SAMPLING PROFESSIONAL

TC EXPIRES

2/5/2026
2/6/2025
2/5/2026
2/4/2026

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

**Reliable
Environmental
Solutions, Inc.** **R E S**

This is to certify that

James Tuinenga

*has on 2/5/25, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: February 5, 2025

COURSE LENGTH: 4 HOURS

Examination Date: February 5, 2025

Expiration Date: February 5, 2026

Certificate Number: MPR/0546



Training Program Manager, William S. Williams

2760 W. Jefferson Street, Springfield, Illinois 217.787.9800 www.ReliableEnv.com

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE	Loc	Localized
	Dist	Distributed