

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-3546
SCHOOL NAME: Shields School Branch
ADDRESS OF SCHOOL: 4450 S. FAIRFIELD 32
CITY: Chicago, IL, 60632

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 12/9/2022

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: _____ ENROLLMENT 378 _____

IDPH INSPECTOR LICENSE NUMBER: _____

IDPH LICENSED INSPECTOR NAME (Please Print): _____

IDPH MP LICENSE NUMBER: _____

IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): _____

DESIGNATED PERSON (Please Print): _____ PHONE: _____

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Shields School Branch

4450 S. FAIRFIELD 32
Chicago, IL, 60632

Unit: 25361
Building ID: 5911

IDPH ID Number: 14-016-2990-3546

REPORT DATE:

Prepared for:
Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:

''

Phone

Fax

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

Mr. Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2025 Three-Year Reinspections

Dear Mr. Culbertson:

, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 25362 Region: 04 IDPH ID: 14-016-2990-3546

School: Shields School Branch Building ID: 5911

Address: 4450 S. FAIRFIELD 32

Chicago, IL, 60632

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Reinspection Date:

Review Date:

Inspector: Inspector IDPH License:

Management Planner: Management Planner IDPH License:

If you have any questions or comments, please contact us at

Sincerely,

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date:

RE: Shields School Branch, Unit 25361
4450 S. FAIRFIELD 32
Chicago, IL, 60632

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2025 asbestos three year re-inspection has been completed at Shields School Branch , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Shields School Branch, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact , the designated Local Education Authority's Designated Person at .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Shields School Branch Unit: 25362 Region: 04
Address: 4450 S. FAIRFIELD 32 Chicago, IL, 60632
IDPH ID: 14-016-2990-3546 Building ID: 5911
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 378

3. LEA Designated Person

Contact: Phone:
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC:
Contact:
Address:
Phone: Fax:

5. Inspector

Inspector Name: Signature:
Inspector IDPH license # Date:
Reinspection Date:

6. Management Planner

Management Planner Name: Signature:
Management Planner IDPH license # Date:

7. Review Date:

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Name:

Unit : 25362

Shields School Branch

Building: 5911

II. EXECUTIVE SUMMARY

was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Shields School Branch. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 5911:

5

Acoustical ceiling plaster

B. The following new homogenous areas have been identified for Building 5911:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

10 A	9" x 9" Green Floor Tile w/White Streaks
10 B	9" x 9" Light Gray Floor Tile w/ Green Streaks Mastic
11 A	9" x 9" Green Floor Tile w/White Streaks Mastic
11 B	9" x 9" Light Gray Floor Tile w/ Grn Streaks Mastic
12 A	9" x 9" Tan Floor Tile w/ Brown Streaks
12 B	9" x 9" Dark Brown w/White Floor Tile
12 C	9" x 9" Tan Floor Tile w/ Red Streaks
12 D	9" x 9" Red Floor Tile w/ Tan Streaks
12 E	9" x 9" Floor Tile
12 F	12" x 12" Beige Floor Tile w/ Black Specks
12 G	9" x 9" Red Floor Tile w/ White Streaks
12 H	9" x 9" Mustard Floor Tile w/Red Streaks
12 I	9" x 9" Light Brown Floor Tile w/White Streaks
12 J	9" x 9" Dark Brown Floor Tile w/ White Streaks
12 K	9" x 9" Green Floor Tile w/White Streaks
12 L	9" x 9" White Floor Tile w/Green Streaks
12 M	9" x 9" Green Speckled Floor Tile
12 N	9" x 9" White Speckled Floor Tile
12 O	9" x 9" Aqua Floor Tile
12 P	12" x 12" White Floor Tile w/ Gray Streaks
13 A	9" x 9" Tan Floor Tile w/ Brown Streaks Mastic
13 B	9" x 9" Dark Brown w/White Mastic
13 C	9" x 9" Tan Floor Tile w/ Red Streaks Mastic
13 D	9" x 9" Red Floor Tile w/ Tan Streaks Mastic
13 E	9" x 9" Floor Tile Mastic
13 F	12" x 12" Beige Floor Tile w/ Black Specks Mastic
13 G	9" x 9" Red Floor Tile w/White Streaks Mastic
13 H	9" x 9" Mustard Floor Tile w/Red Streaks Mastic
13 I	9" x 9" Light Brown Floor Tile w/White Streaks Mastic
13 J	9" x 9" Dark Brown Floor Tile w/ White Streaks Mastic
13 K	9" x 9" Green Floor Tile w/White Streaks Mastic
13 L	9" x 9" White Floor Tile w/Green Streaks Mastic
13 M	9" x 9" Green Speckled Floor Tile Mastic
13 N	9" x 9" White Speckled Floor Tile Mastic
13 O	9" x 9" Aqua Floor Tile Mastic
13 P	12" x 12" White Floor Tile w/ Gray Streaks Mastic
23	Fire door
24	Interior brick
25	Interior brick mortar

26	Glazed block
27	Glazed block mortar
28	Coating on Bottom of Sinks
29	Interior door grout
30	Insulation Wrap on A/C Vent
31	Cinderblock
32	Cinderblock mortar
33	Blackboards
34	Blackboard adhesive
35	Pump gaskets
36	2' x 4' Lay In Ceiling Panels
37	2' x 2' Lay In Ceiling Panels
38	12" x 12" Random Dot Ceiling Tile
39	12" x 12" Random Dot Ceiling Tile Adhesive
40	Window caulk
41	Green carpet mastic
42	Orange carpet mastic
43	Brown carpet mastic
44	6" Black vinyl baseboard
45	6" Black vinyl baseboard adhesive
46	2" Black vinyl baseboard
47	2" Black vinyl baseboard adhesive
48	4" Black vinyl baseboard
49	4" Black vinyl baseboard adhesive
50	Blown in insulation
51	Canvas
52	Patch and Repair Cloth/Glue Material
53	12" x 12" White w/ Blue Mix Floor Tile
54	12" x 12" White w/ Blue Mix Floor Tile Mastic
55	12" x 12" White w/ Brown Streaks Floor Tile
56	12" x 12" White w/ Brown Streaks Floor Tile Mastic
57	4" Brown baseboard
58	4" Brown baseboard adhesive
59	12" x 12" White w/Brown Floor Tile
60	12" x 12" White w/Brown Floor Tile Mastic
8 A	9" x 9" Tan Floor Tile w/ Green Streaks
8 B	9" x 9" Green Floor Tile
8 C	9" x 9" Red Floor Tile
8 D	9" x 9" Green Floor Tile
8 E	9" x 9" Tan Floor Tile w/Brown Streaks
8 F	9" x 9" Light Green Floor Tile
8 G	12" x 12" Blue/Orange/Yellow/Red/Black Floor Tile
9 A	9" x 9" Tan Floor Tile w/ Green Streaks Mastic
9 B	9" x 9" Green Floor Tile Mastic
9 C	9" x 9" Red Floor Tile Mastic
9 D	9" x 9" Green Floor Tile
9 E	9" x 9" Tan Floor Tile w/ Brown Streaks Mastic
9 F	9" x 9" Light Green Floor Tile Mastic

9 G 12" x 12" Blue/Or/Yellow/Red/Black Floor Tile
Mastic

The following areas were deemed to be inaccessible:

1 Low press. Steam corrugated pipe insulation
11 B 9" x 9" LightGrayFloor Tile w/ Grn Streaks Mastic
12 E 9" x 9" Floor Tile
13 A 9" x 9" Tan Floor Tile w/ Brown Streaks Mastic
13 B 9" x 9" Dark Brown w/White Mastic
13 C 9" x 9" Tan Floor Tile w/ Red Streaks Mastic
13 D 9" x 9" Red Floor Tile w/ Tan Streaks Mastic
13 E 9" x 9" Floor Tile Mastic
13 F 12" x 12" Beige Floor Tile w/ Black Specks Mastic
13 G 9" x 9" Red Floor Tile w/White Streaks Mastic
13 H 9" x 9" Mustard Floor Tile w/Red Streaks Mastic
13 I 9" x 9" Light Brown Floor Tile w/White Streaks
 Mastic
13 J 9" x 9" Dark Brown Floor Tile w/ White Streaks
 Mastic
13 K 9" x 9" Green Floor Tile w/White Streaks Mastic
13 L 9" x 9" White Floor Tile w/Green Streaks Mastic
13 M 9" x 9" Green Speckled Floor Tile Mastic
13 N 9" x 9" White Speckled Floor Tile Mastic
13 O 9" x 9" Aqua Floor Tile Mastic
13 P 12" x 12" White Floor Tile w/ Gray Streaks Mastic
2 MJP on Low Press. Steam corrugated pipe insulation
23 Fire door
34 Blackboard adhesive
39 12" x 12" Random Dot Ceiling Tile Adhesive
4 MJP on Paperwrap Pipe Insulation
42 Orange carpet mastic
45 6" Black vinyl baseboard adhesive
47 2" Black vinyl baseboard adhesive
49 4" Black vinyl baseboard adhesive
50 Blown in insulation
53 12" x 12" White w/ Blue Mix Floor Tile
54 12" x 12" White w/ Blue Mix Floor Tile Mastic
56 12" x 12" White w/ Brown Streaks Floor Tile Mastic
58 4" Brown baseboard adhesive
60 12" x 12" White w/Brown Floor Tile Mastic
8 B 9" x 9" Green Floor Tile
9 A 9" x 9" Tan Floor Tile w/ Green Streaks Mastic
9 C 9" x 9" Red Floor Tile Mastic
9 F 9" x 9" Light Green Floor Tile Mastic
9 G 12" x 12" Blue/Or/Yellow/Red/Black Floor Tile

Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by , IDPH License # . The Management Plan was updated by , IDPH License # . Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Shields School Branch Building 5911 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Shields School Branch **Unit** 25362 **Building ID** 5911
Address 4450 S. FAIRFIELD 32 **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

Phone: Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	Low press. Steam corrugated pipe insulation	873	LF	Throughout Main School Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
10 A	9" x 9" Green Floor Tile w/White Streaks	6,800	SF	Rooms 401, 402, 403, 404, 405, Principal's Office, Library,Office, Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
10 B	9" x 9" Light Gray Floor Tile w/ Green Streaks Mastic	5,600	SF	Rooms 401, 402, 403, 404, 405, Principal's Office, Library,Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
11 A	9" x 9" Green Floor Tile w/White Streaks Mastic	6,800	SF	Rooms 401, 402, 403, 404, 405, Principal's Office, Library, Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11 B	9" x 9" LightGrayFloor Tile w/ Grn Streaks Mastic	5,600	SF	Rooms 401, 402, 403, 404, 405, Principal's Office, Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12 A	9" x 9" Tan Floor Tile w/ Brown Streaks	2,500	SF	Second Floor Corridor and North Stairway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 B	9" x 9" Dark Brown w/White Floor Tile	600	SF	Second Floor Corridor and North Stairway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 C	9" x 9" Tan Floor Tile w/ Red Streaks	375	SF	Rooms 406 and 415	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 D	9" x 9" Red Floor Tile w/ Tan Streaks	375	SF	Rooms 406 and 415	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 E	9" x 9" Floor Tile	3,250	SF	Rooms 407 and 414 (Beneath 12" x 12"" Floor Tile)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 F	12" x 12" Beige Floor Tile w/ Black Specks	1,625	SF	Rooms 407 and 408	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 G	9" x 9" Red Floor Tile w/ White Streaks	815	SF	409,410	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 H	9" x 9" Mustard Floor Tile w/Red Streaks	815	SF	Room 409,410	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 I	9" x 9" Light Brown Floor Tile w/White Streaks	250	SF	North End of Second Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 J	9" x 9" Dark Brown Floor Tile w/ White Streaks	250	SF	North End of Second Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH

Chicago Public Schools

School Shields School Branch **Unit** 25362 **Building ID** 5911
Address 4450 S. FAIRFIELD 32 **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

Phone: Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
12 K	9" x 9" Green Floor Tile w/White Streaks	400	SF	Room 411	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 L	9" x 9" White Floor Tile w/Green Streaks	350	SF	2nd Floor Storage Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 M	9" x 9" Green Speckled Floor Tile	325	SF	Room 413	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 N	9" x 9" White Speckled Floor Tile	325	SF	Room 413	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 O	9" x 9" Aqua Floor Tile	100	SF	Room 413	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
12 P	12" x 12" White Floor Tile w/ Gray Streaks	2,000	SF	Room 414, Basement	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
13 A	9" x 9" Tan Floor Tile w/ Brown Streaks Mastic	2,500	SF	Second Floor Corridor and North Stairwell	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 B	9" x 9" Dark Brown w/White Mastic	600	SF	Second Floor Corridor and North Stairwell	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 C	9" x 9" Tan Floor Tile w/ Red Streaks Mastic	375	SF	Rooms 406 and 415	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 D	9" x 9" Red Floor Tile w/ Tan Streaks Mastic	375	SF	Rooms 406 and 415	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 E	9" x 9" Floor Tile Mastic	3,250	SF	Rooms 407, 408 & 414.412(Beneath 12" x 12" Floor Tile)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 F	12" x 12" Beige Floor Tile w/ Black Specks Mastic	1,625	SF	Rooms 407 and 408	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 G	9" x 9" Red Floor Tile w/White Streaks Mastic	815	SF	409,410	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 H	9" x 9" Mustard Floor Tile w/Red Streaks Mastic	815	SF	Room 409, 410	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 I	9" x 9" Light Brown Floor Tile w/White Streaks Mastic	250	SF	North End of Second Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 J	9" x 9" Dark Brown Floor Tile w/ White Streaks Mastic	250	SF	North End of Second Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 K	9" x 9" Green Floor Tile w/White Streaks Mastic	600	SF	Room 411, 2nd Floor Storage Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 L	9" x 9" White Floor Tile w/Green Streaks Mastic	750	SF	Room 411, 2nd Floor Storage Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 M	9" x 9" Green Speckled Floor Tile Mastic	325	SF	Room 413	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Shields School Branch **Unit** 25362 **Building ID** 5911
Address 4450 S. FAIRFIELD 32 **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

Phone: Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
13 N	9" x 9" White Speckled Floor Tile Mastic	325	SF	Room 413	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 O	9" x 9" Aqua Floor Tile Mastic	100	SF	Room 413	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13 P	12" x 12" White Floor Tile w/ Gray Streaks Mastic	875	SF	Room 414, Basement	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	Boiler insulation jacket	300	SF	North Boiler	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
15	Boiler insulation jacket	300	SF	South Boiler	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
16	Boiler breeching insulation	600	SF	Behind Boilers	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
17	Joint Compound on Aircell Pipe Insulation	80	LF	Low Pressure Steam Piping in Boiler Room & Tunnel	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
18	Joint Compound on Paperwrap Pipe Insulation	25	LF	Domestic Cold Water Piping in Boiler Room & Tunnel	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
19	Joint Compound on Paperwrap Pipe Insulation	20	LF	Domestic Hot Water Piping in Boiler Room & Tunnel	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
2	MJP on Low Press. Steam corrugated pipe insulation	144	LF	Throughout Main School Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
20	Aircell pipe insulation	500	LF	Low Pressure Steam Piping in Boiler Room & Tunnel, 415	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
21	Paperwrap pipe insulation	125	LF	Domestic Cold Water Piping in Boiler Room & Tunnel	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
22	Paperwrap pipe insulation		LF	Domestic Hot Water Piping in Boiler Room & Tunnel	CHR	TSI								
23	Fire door	32	SF	Doorway leading to Gym	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
24	Interior brick	5,000	SF	Throughout Facility including Kindergarten, Lunchroom, and Room 401	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	Interior brick mortar	5,000	SF	Throughout Facility including	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Shields School Branch **Unit** 25362 **Building ID** 5911
Address 4450 S. FAIRFIELD 32 **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

Phone: Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Kindergarten, Lunchroom, and Room 401										
26	Glazed block	13,000	SF	Throughout Facility Including Kindergarten, Lunchroom, Kitchen, Office, Girl's and Boy's Bathrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
27	Glazed block mortar	13,000	SF	Throughout Facility Including Kindergarten, Lunchroom, Kitchen, Office, Girl's and Boy's Bathrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	Coating on Bottom of Sinks	10	SF	Kindergarten and Kitchen	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
29	Interior door grout	240	LF	Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
3	Paperwrap Pipe Insulation on Dom. Cold water lines	160	LF	Throughout Main School Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
30	Insulation Wrap on A/C Vent	30	SF	Kitchen Store Room	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
31	Cinderblock	500	SF	Kitchen Store Room, Janitor's Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	Cinderblock mortar	500	SF	Kitchen Store Room, Janitor's Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	Blackboards	5,000	SF	Classrooms and Kitchen Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
34	Blackboard adhesive	5,000	SF	Classrooms and Kitchen Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	Pump gaskets	3	SF	Sprinkler Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	2' x 4' Lay In Ceiling Panels	625	SF	Room 416	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
37	2' x 2' Lay In Ceiling Panels	32,000	SF	3rd Fl Hallway (Annex), 320, 321, 322, 325, 324, 2nd Fl Hallway (Annex), 226, 225, 224, 227,	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Shields School Branch **Unit** 25362 **Building ID** 5911
Address 4450 S. FAIRFIELD 32 **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

Phone: Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				223, 222, 221, 220, 1st Fl Hallway (Annex), 121, 122, Lunchroom (125), 123, 124										
38	12" x 12" Random Dot Ceiling Tile	3,250	SF	Rooms 407, 413, 408 and 410	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
39	12" x 12" Random Dot Ceiling Tile Adhesive	3,250	SF	Rooms 407, 413,408 and 410	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
4	MJP on Paperwrap Pipe Insulation	34	LF	Throughout Main School Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
40	Window caulk	10,000	LF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	Green carpet mastic		SF	Room 416	ASSUMED	MISC								
42	Orange carpet mastic	200	SF	On Columns in Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	Brown carpet mastic		SF	Room 412	ASSUMED	MISC								
44	6" Black vinyl baseboard	1,500	LF	Assistant Principal's Office, 2nd Floor Corridor,Rooms 406,410, 407,408,409,411,412,415	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	6" Black vinyl baseboard adhesive	1,500	LF	Gym, Assistant Principal's Office, 2nd Floor Corridor, Rooms 406,410, 407,408,409,411,412,415	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	2" Black vinyl baseboard	1,000	LF	Beneath Radiators in Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
47	2" Black vinyl baseboard adhesive	1,000	LF	Beneath Radiators in Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	4" Black vinyl baseboard	200	LF	Rooms 413 and 414	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	4" Black vinyl baseboard adhesive	200	LF	Rooms 413 and 414	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5	Acoustical ceiling plaster	3,500	SF	Second Floor Addition	CHR	SURFACE	Y	NONE	0		Yes	ACBM with the potential for damage		MODERATE
50	Blown in insulation	23,040	SF	Attic	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
51	Canvas	3,500	SF	On Walls in Rooms 413,414,406,415,407,408,412,411	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Shields School Branch **Unit** 25362 **Building ID** 5911
Address 4450 S. FAIRFIELD 32 **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

Phone: Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
52	Patch and Repair Cloth/Glue Material	200	SF	Boiler Area	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
53	12" x 12" White w/ Blue Mix Floor Tile	750	SF	Room 414, 101 Modular	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54	12" x 12" White w/ Blue Mix Floor Tile Mastic	750	SF	Room 414, 101 Modular	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	12" x 12" White w/ Brown Streaks Floor Tile	1,400	SF	Rooms 412 and 416	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
56	12" x 12" White w/ Brown Streaks Floor Tile Mastic	1,400	SF	Rooms 412 and 416	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
57	4" Brown baseboard	50	SF	Room 416	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
58	4" Brown baseboard adhesive	50	SF	Room 416	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
59	12" x 12" White w/Brown Floor Tile	625	SF	Kitchen Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
6	Acoustical ceiling plaster		SF	Second Floor Original Building	CHR	SURFACE								
60	12" x 12" White w/Brown Floor Tile Mastic	625	SF	Kitchen Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
7	Acoustical plaster	7,000	SF	First Floor	CHR	SURFACE	N	NONE	0		No	ACBM with the potential for damage		MODERATE
8 A	9" x 9" Tan Floor Tile w/ Green Streaks	5,200	SF	Kindergarten, Kitchen Storage, Office, 2nd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
8 B	9" x 9" Green Floor Tile	50	SF	Kindergarten, Kitchen Storage, Office, 2nd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
8 C	9" x 9" Red Floor Tile	50	SF	Library, Room 400	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
8 D	9" x 9" Green Floor Tile		SF	Teacher's Lounge	ASSUMED	MISC								
8 E	9" x 9" Tan Floor Tile w/Brown Streaks		SF	Teacher's Lounge,	ASSUMED	MISC								
8 F	9" x 9" Light Green Floor Tile		SF	Gym	ASSUMED	MISC								
8 G	12" x 12" Blue/Orange/Yellow/Red/Black Floor Tile	400	SF	East and West Entrances at North End of Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		HIGH
9 A	9" x 9" Tan Floor Tile w/ Green Streaks Mastic	5,200	SF	Kindergarten, Kitchen Storage, Office, Gym, 2nd Floor Corridor, Assistant Principal Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Shields School Branch **Unit** 25362 **Building ID** 5911
Address 4450 S. FAIRFIELD 32 **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

Phone: Fax:

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
9 B	9" x 9" Green Floor Tile Mastic			Kindergarten, Kitchen Store Room, Office, 2nd Floor Corridor, Assistant Principal's Office	ASSUMED	MISC								
9 C	9" x 9" Red Floor Tile Mastic	50	SF	Library, Room 400	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
9 D	9" x 9" Green Floor Tile		SF	Teacher's Lounge	ASSUMED	MISC								
9 E	9" x 9" Tan Floor Tile w/ Brown Streaks Mastic		SF	Teacher's Lounge	ASSUMED	MISC								
9 F	9" x 9" Light Green Floor Tile Mastic	200	SF	Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
9 G	12" x 12" Blue/Or/Yellow/Red/Black Floor Tile Mastic	400	SF	East and West Entrances at North End of Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Shields School Branch Unit 25362 Building ID 5911
Address 4450 S. FAIRFIELD 32 Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

Phone: Fax:

Inspector's Comments are Summarized at the End of the Report

Reinspection Date	Inspector's Comments	
Inspector Name		
Inspector's IDPH License Number / Expiration Date		
<hr/>		
HA Number:	Inspector Comments:	
1		
10 A		
10 B		
11 A		
11 B		
12 A		
12 B		
12 C		
12 D		
12 E		
12 F		
12 G		
12 H		
12 I		
12 J		
12 K		
12 L		
12 M		
12 N		
12 O		
12 P		
13 A		
13 B		
13 C		

Chicago Public Schools

School Shields School Branch Unit 25362 Building ID 5911
Address 4450 S. FAIRFIELD 32 Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

Phone: Fax:

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
13 D	
13 E	
13 F	
13 G	
13 H	
13 I	
13 J	
13 K	
13 L	
13 M	
13 N	
13 O	
13 P	
14	
15	
16	
17	
18	
19	
2	
20	
21	
22	
23	
24	
25	
26	
27	
28	

Chicago Public Schools

School Shields School Branch Unit 25362 Building ID 5911
Address 4450 S. FAIRFIELD 32 Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

Phone: Fax:

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
29	
3	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
4	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
5	
50	
51	
52	
53	
54	

Chicago Public Schools

School Shields School Branch Unit 25362 Building ID 5911
Address 4450 S. FAIRFIELD 32 Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC)

Phone: Fax:

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
55	
56	
57	
58	
59	
6	
60	
7	
8 A	
8 B	
8 C	
8 D	
8 E	
8 F	
8 G	
9 A	
9 B	
9 C	
9 D	
9 E	
9 F	
9 G	

Table II
Management Planner's Review

Chicago Public Schools

School Shields School Branch

Unit 25362

Building ID 5911

Address 4450 S. FAIRFIELD 32

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

Phone:

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	Low press. Steam corrugated pipe insulation	873	LF	Throughout Main School Building	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	
10 A	9" x 9" Green Floor Tile w/White Streaks	6,800	SF	Rooms 401, 402, 403, 404, 405, Principal's Office, Library,Office,Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
10 B	9" x 9" Light Gray Floor Tile w/ Green Streaks Mastic	5,600	SF	Rooms 401, 402, 403, 404, 405, Principal's Office,Library,Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
11 A	9" x 9" Green Floor Tile w/White Streaks Mastic	6,800	SF	Rooms 401, 402, 403, 404, 405, Principal's Office, Library, Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
11 B	9" x 9" LightGrayFloor Tile w/ Grn Streaks Mastic	5,600	SF	Rooms 401, 402, 403, 404, 405, Principal's Office, Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 A	9" x 9" Tan Floor Tile w/ Brown Streaks	2,500	SF	Second Floor Corridor and North Stairway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 B	9" x 9" Dark Brown w/White Floor Tile	600	SF	Second Floor Corridor and North Stairway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 C	9" x 9" Tan Floor Tile w/ Red Streaks	375	SF	Rooms 406 and 415	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 D	9" x 9" Red Floor Tile w/ Tan Streaks	375	SF	Rooms 406 and 415	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 E	9" x 9" Floor Tile	3,250	SF	Rooms 407 and 414 (Beneath 12"" x12"" Floor Tile)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 F	12" x 12" Beige Floor Tile w/ Black Specks	1,625	SF	Rooms 407 and 408	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 G	9" x 9" Red Floor Tile w/ White Streaks	815	SF	409,410	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 H	9" x 9" Mustard Floor Tile w/Red Streaks	815	SF	Room 409,410	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 I	9" x 9" Light Brown Floor Tile w/White Streaks	250	SF	North End of Second Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 J	9" x 9" Dark Brown Floor Tile w/ White Streaks	250	SF	North End of Second Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 K	9" x 9" Green Floor Tile w/White Streaks	400	SF	Room 411	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 L	9" x 9" White Floor Tile w/Green Streaks	350	SF	2nd Floor Storage Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 M	9" x 9" Green Speckled Floor Tile	325	SF	Room 413	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 N	9" x 9" White Speckled Floor Tile	325	SF	Room 413	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 O	9" x 9" Aqua Floor Tile	100	SF	Room 413	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
12 P	12" x 12" White Floor Tile w/ Gray Streaks	2,000	SF	Room 414, Basement	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 A	9" x 9" Tan Floor Tile w/ Brown Streaks Mastic	2,500	SF	Second Floor Corridor and North Stairwell	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 B	9" x 9" Dark Brown w/White Mastic	600	SF	Second Floor Corridor and North Stairwell	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 C	9" x 9" Tan Floor Tile w/ Red Streaks Mastic	375	SF	Rooms 406 and 415	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 D	9" x 9" Red Floor Tile w/ Tan Streaks Mastic	375	SF	Rooms 406 and 415	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 E	9" x 9" Floor Tile Mastic	3,250	SF	Rooms 407, 408 & 414,412(Beneath 12""x12"" Floor Tile)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	

Chicago Public Schools

School Shields School Branch
Address 4450 S. FAIRFIELD 32

Unit 25362
Chicago, IL, 60632

Building ID 5911
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

Phone:

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
13 F	12" x 12" Beige Floor Tile w/ Black Specks Mastic	1,625	SF	Rooms 407 and 408	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 G	9" x 9" Red Floor Tile w/White Streaks Mastic	815	SF	409,410	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 H	9" x 9" Mustard Floor Tile w/Red Streaks Mastic	815	SF	Room 409, 410	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 I	9" x 9" Light Brown Floor Tile w/White Streaks Mastic	250	SF	North End of Second Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 J	9" x 9" Dark Brown Floor Tile w/ White Streaks Mastic	250	SF	North End of Second Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 K	9" x 9" Green Floor Tile w/White Streaks Mastic	600	SF	Room 411, 2nd Floor Storage Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 L	9" x 9" White Floor Tile w/Green Streaks Mastic	750	SF	Room 411, 2nd Floor Storage Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 M	9" x 9" Green Speckled Floor Tile Mastic	325	SF	Room 413	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 N	9" x 9" White Speckled Floor Tile Mastic	325	SF	Room 413	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 O	9" x 9" Aqua Floor Tile Mastic	100	SF	Room 413	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13 P	12" x 12" White Floor Tile w/ Gray Streaks Mastic	875	SF	Room 414, Basement	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
14	Boiler insulation jacket	300	SF	North Boiler	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	
15	Boiler insulation jacket	300	SF	South Boiler	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	
16	Boiler breeching insulation	600	SF	Behind Boilers	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	
17	Joint Compound on Aircell Pipe Insulation	80	LF	Low Pressure Steam Piping in Boiler Room & Tunnel	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	
18	Joint Compound on Paperwrap Pipe Insulation	25	LF	Domestic Cold Water Piping in Boiler Room & Tunnel	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	
19	Joint Compound on Paperwrap Pipe Insulation	20	LF	Domestic Hot Water Piping in Boiler Room & Tunnel	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	
2	MJP on Low Press. Steam corrugated pipe insulation	144	LF	Throughout Main School Building	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	
20	Aircell pipe insulation	500	LF	Low Pressure Steam Piping in Boiler Room & Tunnel, 415	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	
21	Paperwrap pipe insulation	125	LF	Domestic Cold Water Piping in Boiler Room & Tunnel	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	
22	Paperwrap pipe insulation		LF	Domestic Hot Water Piping in Boiler Room & Tunnel	Chrysotile	TSI			LF		
23	Fire door	32	SF	Doorway leading to Gym	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	
24	Interior brick	5,000	SF	Throughout Facility including Kindergarten, Lunchroom, and Room 401	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
25	Interior brick mortar	5,000	SF	Throughout Facility including Kindergarten, Lunchroom, and Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	

Chicago Public Schools

School Shields School Branch

Unit 25362

Building ID 5911

Address 4450 S. FAIRFIELD 32

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

Phone:

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				401							
26	Glazed block	13,000	SF	Throughout Facility Including Kindergarten, Lunchroom, Kitchen, Office, Girl's and Boy's Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
27	Glazed block mortar	13,000	SF	Throughout Facility Including Kindergarten, Lunchroom, Kitchen, Office, Girl's and Boy's Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
28	Coating on Bottom of Sinks	10	SF	Kindergarten and Kitchen	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	
29	Interior door grout	240	LF	Kitchen	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	
3	Paperwrap Pipe Insulation on Dom. Cold water lines	160	LF	Throughout Main School Building	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	
30	Insulation Wrap on A/C Vent	30	SF	Kitchen Store Room	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	
31	Cinderblock	500	SF	Kitchen Store Room, Janitor's Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
32	Cinderblock mortar	500	SF	Kitchen Store Room, Janitor's Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
33	Blackboards	5,000	SF	Classrooms and Kitchen Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
34	Blackboard adhesive	5,000	SF	Classrooms and Kitchen Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
35	Pump gaskets	3	SF	Sprinkler Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
36	2' x 4' Lay In Ceiling Panels	625	SF	Room 416	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
37	2' x 2' Lay In Ceiling Panels	32,000	SF	3rd Fl Hallway (Annex), 320, 321, 322, 325, 324, 2nd Fl Hallway (Annex), 226, 225, 224, 227, 223, 222, 221, 220, 1st Fl Hallway (Annex), 121, 122, Lunchroom (125), 123, 124	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	
38	12" x 12" Random Dot Ceiling Tile	3,250	SF	Rooms 407, 413, 408 and 410	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	
39	12" x 12" Random Dot Ceiling Tile Adhesive	3,250	SF	Rooms 407, 413, 408 and 410	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
4	MJP on Paperwrap Pipe Insulation	34	LF	Throughout Main School Building	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	
40	Window caulk	10,000	LF	Throughout Facility	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	
41	Green carpet mastic		SF	Room 416	Assumed	MISC			SF		
42	Orange carpet mastic	200	SF	On Columns in Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
43	Brown carpet mastic		SF	Room 412	Assumed	MISC			SF		
44	6" Black vinyl baseboard	1,500	LF	Assistant Principal's Office, 2nd Floor Corridor, Rooms 406, 410, 407, 408, 409, 411, 412, 415	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	
45	6" Black vinyl baseboard adhesive	1,500	LF	Gym, Assistant Principal's Office, 2nd Floor Corridor, Rooms 406, 410, 407, 408, 409, 411, 412, 415	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	

Chicago Public Schools

School Shields School Branch

Unit 25362

Building ID 5911

Address 4450 S. FAIRFIELD 32

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

Phone:

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
46	2" Black vinyl baseboard	1,000	LF	Beneath Radiators in Classrooms	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	
47	2" Black vinyl baseboard adhesive	1,000	LF	Beneath Radiators in Classrooms	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	
48	4" Black vinyl baseboard	200	LF	Rooms 413 and 414	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	
49	4" Black vinyl baseboard adhesive	200	LF	Rooms 413 and 414	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	
5	Acoustical ceiling plaster	3,500	SF	Second Floor Addition	Chrysotile	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	
50	Blown in insulation	23,040	SF	Attic	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	
51	Canvas	3,500	SF	On Walls in Rooms 413,414,406,415,407,408,412,411	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
52	Patch and Repair Cloth/Glue Material	200	SF	Boiler Area	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	
53	12" x 12" White w/ Blue Mix Floor Tile	750	SF	Room 414, 101 Modular	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
54	12" x 12" White w/ Blue Mix Floor Tile Mastic	750	SF	Room 414, 101 Modular	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
55	12" x 12" White w/ Brown Streaks Floor Tile	1,400	SF	Rooms 412 and 416	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
56	12" x 12" White w/ Brown Streaks Floor Tile Mastic	1,400	SF	Rooms 412 and 416	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
57	4" Brown baseboard	50	SF	Room 416	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
58	4" Brown baseboard adhesive	50	SF	Room 416	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
59	12" x 12" White w/Brown Floor Tile	625	SF	Kitchen Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
6	Acoustical ceiling plaster		SF	Second Floor Original Building	Chrysotile	SURFACE			SF		
60	12" x 12" White w/Brown Floor Tile Mastic	625	SF	Kitchen Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
7	Acoustical plaster	7,000	SF	First Floor	Chrysotile	SURFACE	No	0	SF	6 ACBM with the potential for damage	
8 A	9" x 9" Tan Floor Tile w/ Green Streaks	5,200	SF	Kindergarten, Kitchen Storage, Office, 2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
8 B	9" x 9" Green Floor Tile	50	SF	Kindergarten, Kitchen Store Room, Office, 2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
8 C	9" x 9" Red Floor Tile	50	SF	Library, Room 400	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
8 D	9" x 9" Green Floor Tile		SF	Teacher's Lounge	Assumed	MISC			SF		
8 E	9" x 9" Tan Floor Tile w/Brown Streaks		SF	Teacher's Lounge,	Assumed	MISC			SF		
8 F	9" x 9" Light Green Floor Tile		SF	Gym	Assumed	MISC			SF		
8 G	12" x 12" Blue/Orange/Yellow/Red/Black Floor Tile	400	SF	East and West Entrances at North End of Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
9 A	9" x 9" Tan Floor Tile w/ Green Streaks Mastic	5,200	SF	Kindergarten, Kitchen Storage, Office, Gym, 2nd Floor Corridor, Assistant Principal Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
9 B	9" x 9" Green Floor Tile Mastic			Kindergarten, Kitchen Store Room, Office, 2nd Floor Corridor, Assistant Principal's Office	Assumed	MISC					
9 C	9" x 9" Red Floor Tile Mastic	50	SF	Library, Room 400	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	

Chicago Public Schools

School Shields School Branch

Unit 25362

Building ID 5911

Address 4450 S. FAIRFIELD 32

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

Phone:

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
9 D	9" x 9" Green Floor Tile		SF	Teacher's Lounge	Assumed	MISC			SF		
9 E	9" x 9" Tan Floor Tile w/ Brown Streaks Mastic		SF	Teacher's Lounge	Assumed	MISC			SF		
9 F	9" x 9" Light Green Floor Tile Mastic	200	SF	Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
9 G	12" x 12" Blue/Or/Yellow/Red/Black Floor Tile Mastic	400	SF	East and West Entrances at North End of Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	

Review Date	HA Number	Management Comments
-------------	-----------	---------------------

Chicago Public Schools

School Shields School Branch

Unit 25362

Building ID 5911

Address 4450 S. FAIRFIELD 32

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

Phone:

Fax:

Management Planner's Comments Summarized at the End of the Report

Manager Planner Name	
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
10 A	
10 B	
11 A	
11 B	
12 A	
12 B	
12 C	
12 D	
12 E	
12 F	
12 G	
12 H	
12 I	
12 J	
12 K	
12 L	
12 M	
12 N	
12 O	
12 P	
13 A	
13 B	
13 C	
13 D	
13 E	
13 F	

Chicago Public Schools

School Shields School Branch

Unit 25362

Building ID 5911

Address 4450 S. FAIRFIELD 32

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

Phone:

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
13 G	
13 H	
13 I	
13 J	
13 K	
13 L	
13 M	
13 N	
13 O	
13 P	
14	
15	
16	
17	
18	
19	
2	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	

Chicago Public Schools

School Shields School Branch

Unit 25362

Building ID 5911

Address 4450 S. FAIRFIELD 32

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

Phone:

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
3	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
4	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
5	
50	
51	
52	
53	

Chicago Public Schools

School Shields School Branch

Unit 25362

Building ID 5911

Address 4450 S. FAIRFIELD 32

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC)

Phone:

Fax:

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
54	
55	
56	
57	
58	
59	
6	
60	
7	
8 A	
8 B	
8 C	
8 D	
8 E	
8 F	
8 G	
9 A	
9 B	
9 C	
9 D	
9 E	
9 F	
9 G	

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

2025 AHERA REINSPECTION

Chicago Public Schools

2025 AHERA REINSPECTION Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **Low press. Steam corrugated pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Main School Building**
MATERIAL QUANTITY: **873** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **873** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **1**

MATERIAL DESCRIPTION: **Low press. Steam corrugated pipe insulation**

MATERIAL LOCATION: **Throughout Main School Building**

MATERIAL QUANTITY: **873** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10 A**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rooms 401, 402, 403, 404, 405, Principal's Office, Library,Office,Kitchen**
MATERIAL QUANTITY: **6800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **10 A**

MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks**

MATERIAL LOCATION: **Rooms 401, 402, 403, 404, 405, Principal's Office, Library,Office,Kitchen**

MATERIAL QUANTITY: **6800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10 B**
MATERIAL DESCRIPTION: **9" x 9" Light Gray Floor Tile w/ Green Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rooms 401, 402, 403, 404, 405, Principal's Office, Library, Office**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **10 B**

MATERIAL DESCRIPTION: **9" x 9" Light Gray Floor Tile w/ Green Streaks Mastic**

MATERIAL LOCATION: **Rooms 401, 402, 403, 404, 405, Principal's Office, Library, Office**

MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11 A**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 401, 402, 403, 404, 405,Principal's Office, Library, Kitchen**
MATERIAL QUANTITY: **6800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **11 A**

MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks Mastic**

MATERIAL LOCATION: **Rooms 401, 402, 403, 404, 405,Principal's Office, Library, Kitchen**

MATERIAL QUANTITY: **6800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11 B**
MATERIAL DESCRIPTION: **9" x 9" LightGrayFloor Tile w/ Grn Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 401, 402, 403, 404, 405,Principal's Office, Library**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **11 B**

MATERIAL DESCRIPTION: **9" x 9" LightGrayFloor Tile w/ Grn Streaks Mastic**

MATERIAL LOCATION: **Rooms 401, 402, 403, 404, 405,Principal's Office, Library**

MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 A**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Brown Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Second Floor Corridor and North Stairway**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 A**

MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Brown Streaks**

MATERIAL LOCATION: **Second Floor Corridor and North Stairway**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 B**
MATERIAL DESCRIPTION: **9" x 9" Dark Brown w/White Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Second Floor Corridor and North Stairway**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 B**

MATERIAL DESCRIPTION: **9" x 9" Dark Brown w/White Floor Tile**

MATERIAL LOCATION: **Second Floor Corridor and North Stairway**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 C**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Red Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rooms 406 and 415**
MATERIAL QUANTITY: **375** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **375** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 C**

MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Red Streaks**

MATERIAL LOCATION: **Rooms 406 and 415**

MATERIAL QUANTITY: **375** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 D**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile w/ Tan Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rooms 406 and 415**
MATERIAL QUANTITY: **375** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **375** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 D**

MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile w/ Tan Streaks**

MATERIAL LOCATION: **Rooms 406 and 415**

MATERIAL QUANTITY: **375** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 E**
MATERIAL DESCRIPTION: **9" x 9" Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rooms 407 and 414 (Beneath 12""x12"" Floor Tile)**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 E**

MATERIAL DESCRIPTION: **9" x 9" Floor Tile**

MATERIAL LOCATION: **Rooms 407 and 414 (Beneath 12""x12"" Floor Tile)**

MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 F**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ Black Specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rooms 407 and 408**
MATERIAL QUANTITY: **1625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 F**

MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ Black Specks**

MATERIAL LOCATION: **Rooms 407 and 408**

MATERIAL QUANTITY: **1625** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 G**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile w/ White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **409,410**
MATERIAL QUANTITY: **815** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **815** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 G**

MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile w/ White Streaks**

MATERIAL LOCATION: **409,410**

MATERIAL QUANTITY: **815** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 H**
MATERIAL DESCRIPTION: **9" x 9" Mustard Floor Tile w/Red Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 409,410**
MATERIAL QUANTITY: **815** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **815** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 H**

MATERIAL DESCRIPTION: **9" x 9" Mustard Floor Tile w/Red Streaks**

MATERIAL LOCATION: **Room 409,410**

MATERIAL QUANTITY: **815** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 I**
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **North End of Second Floor Corridor**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 I**

MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/White Streaks**

MATERIAL LOCATION: **North End of Second Floor Corridor**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 J**
MATERIAL DESCRIPTION: **9" x 9" Dark Brown Floor Tile w/ White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **North End of Second Floor Corridor**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 J**

MATERIAL DESCRIPTION: **9" x 9" Dark Brown Floor Tile w/ White Streaks**

MATERIAL LOCATION: **North End of Second Floor Corridor**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 K**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 411**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 K**

MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks**

MATERIAL LOCATION: **Room 411**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 L**
MATERIAL DESCRIPTION: **9" x 9" White Floor Tile w/Green Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **2nd Floor Storage Room**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 L**

MATERIAL DESCRIPTION: **9" x 9" White Floor Tile w/Green Streaks**

MATERIAL LOCATION: **2nd Floor Storage Room**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 M**
MATERIAL DESCRIPTION: **9" x 9" Green Speckled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 413**
MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **325** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 M**

MATERIAL DESCRIPTION: **9" x 9" Green Speckled Floor Tile**

MATERIAL LOCATION: **Room 413**

MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 N**
MATERIAL DESCRIPTION: **9" x 9" White Speckled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 413**
MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 N**

MATERIAL DESCRIPTION: **9" x 9" White Speckled Floor Tile**

MATERIAL LOCATION: **Room 413**

MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 O**
MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 413**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **100** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 O**

MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile**

MATERIAL LOCATION: **Room 413**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12 P**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Gray Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Room 414, Basement**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **12 P**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Gray Streaks**

MATERIAL LOCATION: **Room 414, Basement**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 A**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Brown Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Second Floor Corridor and North Stairwell**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 A**

MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Brown Streaks Mastic**

MATERIAL LOCATION: **Second Floor Corridor and North Stairwell**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 B**
MATERIAL DESCRIPTION: **9" x 9" Dark Brown w/White Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Second Floor Corridor and North Stairwell**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **600** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 B**

MATERIAL DESCRIPTION: **9" x 9" Dark Brown w/White Mastic**

MATERIAL LOCATION: **Second Floor Corridor and North Stairwell**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 C**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Red Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 406 and 415**
MATERIAL QUANTITY: **375** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **375** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 C**

MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Red Streaks Mastic**

MATERIAL LOCATION: **Rooms 406 and 415**

MATERIAL QUANTITY: **375** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 D**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile w/ Tan Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 406 and 415**
MATERIAL QUANTITY: **375** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **375** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 D**

MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile w/ Tan Streaks Mastic**

MATERIAL LOCATION: **Rooms 406 and 415**

MATERIAL QUANTITY: **375** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 E**
MATERIAL DESCRIPTION: **9" x 9" Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 407, 408 & 414,412(Beneath 12""x12"" Floor Tile)**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 E**

MATERIAL DESCRIPTION: **9" x 9" Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 407, 408 & 414,412(Beneath 12""x12"" Floor Tile)**

MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 F**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ Black Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 407 and 408**
MATERIAL QUANTITY: **1625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 F**

MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile w/ Black Specks Mastic**

MATERIAL LOCATION: **Rooms 407 and 408**

MATERIAL QUANTITY: **1625** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 G**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile w/White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **409,410**
MATERIAL QUANTITY: **815** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **815** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 G**

MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile w/White Streaks Mastic**

MATERIAL LOCATION: **409,410**

MATERIAL QUANTITY: **815** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 H**
MATERIAL DESCRIPTION: **9" x 9" Mustard Floor Tile w/Red Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 409, 410**
MATERIAL QUANTITY: **815** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **815** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 H**

MATERIAL DESCRIPTION: **9" x 9" Mustard Floor Tile w/Red Streaks Mastic**

MATERIAL LOCATION: **Room 409, 410**

MATERIAL QUANTITY: **815** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 I**
MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **North End of Second Floor Corridor**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **250** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 I**

MATERIAL DESCRIPTION: **9" x 9" Light Brown Floor Tile w/White Streaks Mastic**

MATERIAL LOCATION: **North End of Second Floor Corridor**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 J**
MATERIAL DESCRIPTION: **9" x 9" Dark Brown Floor Tile w/ White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **North End of Second Floor Corridor**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 J**

MATERIAL DESCRIPTION: **9" x 9" Dark Brown Floor Tile w/ White Streaks Mastic**

MATERIAL LOCATION: **North End of Second Floor Corridor**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 K**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 411, 2nd Floor Storage Room**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **600** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 K**

MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile w/White Streaks Mastic**

MATERIAL LOCATION: **Room 411, 2nd Floor Storage Room**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 L**
MATERIAL DESCRIPTION: **9" x 9" White Floor Tile w/Green Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 411, 2nd Floor Storage Room**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 L**

MATERIAL DESCRIPTION: **9" x 9" White Floor Tile w/Green Streaks Mastic**

MATERIAL LOCATION: **Room 411, 2nd Floor Storage Room**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 M**
MATERIAL DESCRIPTION: **9" x 9" Green Speckled Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 413**
MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 M**

MATERIAL DESCRIPTION: **9" x 9" Green Speckled Floor Tile Mastic**

MATERIAL LOCATION: **Room 413**

MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 N**
MATERIAL DESCRIPTION: **9" x 9" White Speckled Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 413**
MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 N**

MATERIAL DESCRIPTION: **9" x 9" White Speckled Floor Tile Mastic**

MATERIAL LOCATION: **Room 413**

MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 O**
MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 413**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **100** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 O**

MATERIAL DESCRIPTION: **9" x 9" Aqua Floor Tile Mastic**

MATERIAL LOCATION: **Room 413**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13 P**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Gray Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 414, Basement**
MATERIAL QUANTITY: **875** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **875** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **13 P**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile w/ Gray Streaks Mastic**

MATERIAL LOCATION: **Room 414, Basement**

MATERIAL QUANTITY: **875** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Boiler insulation jacket**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **North Boiler**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Boiler insulation jacket**

MATERIAL LOCATION: **North Boiler**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Boiler insulation jacket**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **South Boiler**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Boiler insulation jacket**

MATERIAL LOCATION: **South Boiler**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Boiler breeching insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Behind Boilers**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **600** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Boiler breeching insulation**

MATERIAL LOCATION: **Behind Boilers**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Joint Compound on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Low Pressure Steam Piping in Boiler Room & Tunnel**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **80** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **Joint Compound on Aircell Pipe Insulation**

MATERIAL LOCATION: **Low Pressure Steam Piping in Boiler Room & Tunnel**

MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Joint Compound on Paperwrap Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Domestic Cold Water Piping in Boiler Room & Tunnel**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **25** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BULDING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **Joint Compound on Paperwrap Pipe Insulation**

MATERIAL LOCATION: **Domestic Cold Water Piping in Boiler Room & Tunnel**

MATERIAL QUANTITY: **25** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Joint Compound on Paperwrap Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Moderate**

Domestic Hot Water Piping in Boiler Room & Tunnel

MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **1** DAMAGE UNITS: **1E**

COMMENTS:

Inspector's Signature:

Date:

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Joint Compound on Paperwrap Pipe Insulation**

MATERIAL LOCATION: **Domestic Hot Water Piping in Boiler Room & Tunnel**

MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **MJP on Low Press. Steam corrugated pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Main School Building**
MATERIAL QUANTITY: **144** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **2**

MATERIAL DESCRIPTION: **MJP on Low Press. Steam corrugated pipe insulation**

MATERIAL LOCATION: **Throughout Main School Building**

MATERIAL QUANTITY: **144** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Aircell pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Low Pressure Steam Piping in Boiler Room & Tunnel, 415**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **500** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BULDING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Aircell pipe insulation**

MATERIAL LOCATION: **Low Pressure Steam Piping in Boiler Room & Tunnel, 415**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Paperwrap pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Domestic Cold Water Piping in Boiler Room & Tunnel**
MATERIAL QUANTITY: **125** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **125** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BULDING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **Paperwrap pipe insulation**

MATERIAL LOCATION: **Domestic Cold Water Piping in Boiler Room & Tunnel**

MATERIAL QUANTITY: **125** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Paperwrap pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Domestic Hot Water Piping in Boiler Room & Tunnel**

MATERIAL QUANTITY: MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BULDING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **Paperwrap pipe insulation**

MATERIAL LOCATION: **Domestic Hot Water Piping in Boiler Room & Tunnel**

MATERIAL QUANTITY: MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Fire door**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Doorway leading to Gym**
MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **Fire door**

MATERIAL LOCATION: **Doorway leading to Gym**

MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Interior brick**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility including Kindergarten, Lunchroom, and Room 401**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **5000** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BULDING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **Interior brick**

MATERIAL LOCATION: **Throughout Facility including Kindergarten, Lunchroom, and Room 401**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Interior brick mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility including Kindergarten, Lunchroom, and Room 401**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BULDING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **Interior brick mortar**

MATERIAL LOCATION: **Throughout Facility including Kindergarten, Lunchroom, and Room 401**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Glazed block**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout Facility Including Kindergarten, Lunchroom, Kitchen, Office, Girl's and Boy's Bathrooms**

MATERIAL QUANTITY: **13000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BULDING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **Glazed block**

MATERIAL LOCATION: **Throughout Facility Including Kindergarten, Lunchroom, Kitchen, Office, Girl's and Boy's Bathrooms**

MATERIAL QUANTITY: **13000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Glazed block mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility Including Kindergarten, Lunchroom, Kitchen, Office, Girl's and Boy's Bathrooms**
MATERIAL QUANTITY: **13000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BULDING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **Glazed block mortar**

MATERIAL LOCATION: **Throughout Facility Including Kindergarten, Lunchroom, Kitchen, Office, Girl's and Boy's Bathrooms**

MATERIAL QUANTITY: **13000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Coating on Bottom of Sinks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kindergarten and Kitchen**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **10** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Coating on Bottom of Sinks**

MATERIAL LOCATION: **Kindergarten and Kitchen**

MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Interior door grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **Interior door grout**

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY: **240** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **Paperwrap Pipe Insulation on Dom. Cold water lines**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout Main School Building**
MATERIAL QUANTITY: **160** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **160** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **3**

MATERIAL DESCRIPTION: **Paperwrap Pipe Insulation on Dom. Cold water lines**

MATERIAL LOCATION: **Throughout Main School Building**

MATERIAL QUANTITY: **160** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Insulation Wrap on A/C Vent**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Kitchen Store Room**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **Insulation Wrap on A/C Vent**

MATERIAL LOCATION: **Kitchen Store Room**

MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Cinderblock**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen Store Room, Janitor's Closet**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **Cinderblock**

MATERIAL LOCATION: **Kitchen Store Room, Janitor's Closet**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Cinderblock mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen Store Room, Janitor's Closet**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **Cinderblock mortar**

MATERIAL LOCATION: **Kitchen Store Room, Janitor's Closet**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Blackboards**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Classrooms and Kitchen Storage**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **Blackboards**

MATERIAL LOCATION: **Classrooms and Kitchen Storage**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Blackboard adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms and Kitchen Storage**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **Blackboard adhesive**

MATERIAL LOCATION: **Classrooms and Kitchen Storage**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Pump gaskets**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Sprinkler Room**
MATERIAL QUANTITY: **3** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **Pump gaskets**

MATERIAL LOCATION: **Sprinkler Room**

MATERIAL QUANTITY: **3** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **2' x 4' Lay In Ceiling Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 416**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **625** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **2' x 4' Lay In Ceiling Panels**

MATERIAL LOCATION: **Room 416**

MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **2' x 2' Lay In Ceiling Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **3rd Fl Hallway (Annex), 320, 321, 322, 325, 324, 2nd Fl Hallway (Annex), 226, 225, 224, 227, 223, 222, 221, 220, 1st Fl Hallway (Annex), 121, 122, Lunchroom (125), 123, 124**
MATERIAL QUANTITY: **32000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BULDING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **2' x 2' Lay In Ceiling Panels**

MATERIAL LOCATION: **3rd Fl Hallway (Annex), 320, 321, 322, 325, 324, 2nd Fl Hallway (Annex), 226, 225, 224, 227, 223, 222, 221, 220, 1st Fl Hallway (Annex), 121, 122, Lunchroom (125), 123, 124**

MATERIAL QUANTITY: **32000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **12" x 12" Random Dot Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 407, 413, 408 and 410**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **12" x 12" Random Dot Ceiling Tile**

MATERIAL LOCATION: **Rooms 407, 413, 408 and 410**

MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **12" x 12" Random Dot Ceiling Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 407, 413,408 and 410**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **12" x 12" Random Dot Ceiling Tile Adhesive**

MATERIAL LOCATION: **Rooms 407, 413,408 and 410**

MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **MJP on Paperwrap Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Main School Building**
MATERIAL QUANTITY: **34** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **34** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **4**

MATERIAL DESCRIPTION: **MJP on Paperwrap Pipe Insulation**

MATERIAL LOCATION: **Throughout Main School Building**

MATERIAL QUANTITY: **34** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Window caulk**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **Window caulk**

MATERIAL LOCATION: **Throughout Facility**

MATERIAL QUANTITY: **10000** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Green carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 416**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **41**

MATERIAL DESCRIPTION: **Green carpet mastic**

MATERIAL LOCATION: **Room 416**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Orange carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **On Columns in Gym**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **42**

MATERIAL DESCRIPTION: **Orange carpet mastic**

MATERIAL LOCATION: **On Columns in Gym**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Brown carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 412**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **43**

MATERIAL DESCRIPTION: **Brown carpet mastic**

MATERIAL LOCATION: **Room 412**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **6" Black vinyl baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assistant Principal's Office, 2nd Floor Corridor,Rooms 406,410, 407,408,409,411,412,415**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **6" Black vinyl baseboard**

MATERIAL LOCATION: **Assistant Principal's Office, 2nd Floor Corridor,Rooms 406,410, 407,408,409,411,412,415**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **6" Black vinyl baseboard adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym, Assistant Principal's Office, 2nd Floor Corridor,Rooms 406,410, 407,408,409,411,412,415**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **45**

MATERIAL DESCRIPTION: **6" Black vinyl baseboard adhesive**

MATERIAL LOCATION: **Gym, Assistant Principal's Office, 2nd Floor Corridor,Rooms 406,410, 407,408,409,411,412,415**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **2" Black vinyl baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Beneath Radiators in Classrooms**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **2" Black vinyl baseboard**

MATERIAL LOCATION: **Beneath Radiators in Classrooms**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **2" Black vinyl baseboard adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Beneath Radiators in Classrooms**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **2" Black vinyl baseboard adhesive**

MATERIAL LOCATION: **Beneath Radiators in Classrooms**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **4" Black vinyl baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 413 and 414**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **4" Black vinyl baseboard**

MATERIAL LOCATION: **Rooms 413 and 414**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **4" Black vinyl baseboard adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 413 and 414**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **4" Black vinyl baseboard adhesive**

MATERIAL LOCATION: **Rooms 413 and 414**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **Acoustical ceiling plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Second Floor Addition**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **5**

MATERIAL DESCRIPTION: **Acoustical ceiling plaster**

MATERIAL LOCATION: **Second Floor Addition**

MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **Blown in insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Attic**
MATERIAL QUANTITY: **23040** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **Blown in insulation**

MATERIAL LOCATION: **Attic**

MATERIAL QUANTITY: **23040** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Canvas**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **On Walls in Rooms 413,414,406,415,407,408,412,411**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **51**

MATERIAL DESCRIPTION: **Canvas**

MATERIAL LOCATION: **On Walls in Rooms 413,414,406,415,407,408,412,411**

MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **Patch and Repair Cloth/Glue Material**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Boiler Area**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **52**

MATERIAL DESCRIPTION: **Patch and Repair Cloth/Glue Material**

MATERIAL LOCATION: **Boiler Area**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12" x 12" White w/ Blue Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 414, 101 Modular**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **750** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **12" x 12" White w/ Blue Mix Floor Tile**

MATERIAL LOCATION: **Room 414, 101 Modular**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12" x 12" White w/ Blue Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 414, 101 Modular**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **750** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **54**

MATERIAL DESCRIPTION: **12" x 12" White w/ Blue Mix Floor Tile Mastic**

MATERIAL LOCATION: **Room 414, 101 Modular**

MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Streaks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Rooms 412 and 416**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **55**

MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Streaks Floor Tile**

MATERIAL LOCATION: **Rooms 412 and 416**

MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Streaks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 412 and 416**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **1400** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BULDING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **56**

MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Rooms 412 and 416**

MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **4" Brown baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 416**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **57**

MATERIAL DESCRIPTION: **4" Brown baseboard**

MATERIAL LOCATION: **Room 416**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **4" Brown baseboard adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 416**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **58**

MATERIAL DESCRIPTION: **4" Brown baseboard adhesive**

MATERIAL LOCATION: **Room 416**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **12" x 12" White w/Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Kitchen Office**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **59**

MATERIAL DESCRIPTION: **12" x 12" White w/Brown Floor Tile**

MATERIAL LOCATION: **Kitchen Office**

MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **Acoustical ceiling plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Second Floor Original Building**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **6**

MATERIAL DESCRIPTION: **Acoustical ceiling plaster**

MATERIAL LOCATION: **Second Floor Original Building**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **12" x 12" White w/Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen Office**
MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **60**

MATERIAL DESCRIPTION: **12" x 12" White w/Brown Floor Tile Mastic**

MATERIAL LOCATION: **Kitchen Office**

MATERIAL QUANTITY: **625** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **Acoustical plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **First Floor**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **7**

MATERIAL DESCRIPTION: **Acoustical plaster**

MATERIAL LOCATION: **First Floor**

MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8 A**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Green Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Kindergarten, Kitchen Storage, Office, 2nd Floor Corridor**
MATERIAL QUANTITY: **5200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **8 A**

MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Green Streaks**

MATERIAL LOCATION: **Kindergarten, Kitchen Storage, Office, 2nd Floor Corridor**

MATERIAL QUANTITY: **5200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8 B**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Kindergarten, Kitchen Store Room, Office, 2nd Floor Corridor**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **8 B**

MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile**

MATERIAL LOCATION: **Kindergarten, Kitchen Store Room, Office, 2nd Floor Corridor**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8 C**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Library, Room 400**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **8 C**

MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile**

MATERIAL LOCATION: **Library, Room 400**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8 D**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Teacher's Lounge**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **8 D**

MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile**

MATERIAL LOCATION: **Teacher's Lounge**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8 E**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/Brown Streaks**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Teacher's Lounge,**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **8 E**

MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/Brown Streaks**

MATERIAL LOCATION: **Teacher's Lounge,**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8 F**
MATERIAL DESCRIPTION: **9" x 9" Light Green Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **8 F**

MATERIAL DESCRIPTION: **9" x 9" Light Green Floor Tile**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8 G**
MATERIAL DESCRIPTION: **12" x 12" Blue/Orange/Yellow/Red/Black Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **East and West Entrances at North End of Gym**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **8 G**

MATERIAL DESCRIPTION: **12" x 12" Blue/Orange/Yellow/Red/Black Floor Tile**

MATERIAL LOCATION: **East and West Entrances at North End of Gym**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9 A**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Green Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kindergarten, Kitchen Storage, Office, Gym, 2nd Floor Corridor, Assistant Principal Office**
MATERIAL QUANTITY: **5200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **9 A**

MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Green Streaks Mastic**

MATERIAL LOCATION: **Kindergarten, Kitchen Storage, Office, Gym, 2nd Floor Corridor, Assistant Principal Office**

MATERIAL QUANTITY: **5200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9 B**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kindergarten, Kitchen Store Room, Office, 2nd Floor Corridor, Assistant Principal's Office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **9 B**

MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile Mastic**

MATERIAL LOCATION: **Kindergarten, Kitchen Store Room, Office, 2nd Floor Corridor, Assistant Principal's Office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9 C**
MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library, Room 400**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **9 C**

MATERIAL DESCRIPTION: **9" x 9" Red Floor Tile Mastic**

MATERIAL LOCATION: **Library, Room 400**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9 D**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Teacher's Lounge**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **9 D**

MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile**

MATERIAL LOCATION: **Teacher's Lounge**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9 E**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Brown Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Teacher's Lounge**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **9 E**

MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile w/ Brown Streaks Mastic**

MATERIAL LOCATION: **Teacher's Lounge**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9 F**
MATERIAL DESCRIPTION: **9" x 9" Light Green Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **9 F**

MATERIAL DESCRIPTION: **9" x 9" Light Green Floor Tile Mastic**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BUIDLING ID: **5911**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR:
SCHOOL NAME: **Shields School Branch** INSPECTION DATE:
ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9 G**
MATERIAL DESCRIPTION: **12" x 12" Blue/Or/Yellow/Red/Black Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **East and West Entrances at North End of Gym**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25362** BULDING ID: **5911**

CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER:

SCHOOL NAME: **Shields School Branch** REVIEW DATE:

ADDRESS: **4450 S. FAIRFIELD 32** IDPH LICENSE NO:

HOMOGENEOUS AREA: **9 G**

MATERIAL DESCRIPTION: **12" x 12" Blue/Or/Yellow/Red/Black Floor Tile Mastic**

MATERIAL LOCATION: **East and West Entrances at North End of Gym**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: _____

Chicago Public Schools

2025 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE	Loc	Localized
	Dist	Distributed