

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: UNKNOWN
SCHOOL NAME: UNO - Archer Heights HS
ADDRESS OF SCHOOL: 4248 W 47th St.
CITY: Chicago, IL, 60632

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED

 
If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 9/4/2013 ENROLLMENT 653
IDPH INSPECTOR LICENSE NUMBER: 100-03175
IDPH LICENSED INSPECTOR NAME (Please Print): Marcos Iwankiw
IDPH MP LICENSE NUMBER: 100-09870
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Todd Huffer

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



9/4/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

UNO - Archer Heights HS

4248 W 47th St.
Chicago, IL, 60632

Unit: 66394
Building ID: 3343

IDPH ID Number: UNKNOWN

REPORT DATE:

Wednesday, September 04, 2013

Prepared for:

**Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603**

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

August 29, 2013

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 66394 Region: 04 IDPH ID: UNKNOWN

School: UNO - Archer Heights HS Building ID: 3343

Address: 4248 W 47th St.

Chicago, IL, 60632

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 9/4/2013

Inspector: Marcos Iwankiw

Inspector IDPH License: 100-03175

Management Planner: Todd Huffer

Management Planner IDPH License: 100-09870

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Todd Huffer
100-09870

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: August 29, 2013

RE: UNO - Archer Heights HS, Unit 66394
4248 W 47th St.
Chicago, IL, 60632

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at UNO - Archer Heights HS , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at UNO - Archer Heights HS, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: UNO - Archer Heights HS Unit: 66394 Region: 04
Address: 4248 W 47th St. Chicago, IL, 60632
IDPH ID: UNKNOWN Building ID: 3343
Contact: Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 653

3. LEA Designated Person

Contact: Ms. Lynn Crivello Phone: (773) 553-3113
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603


4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Marcos Iwankiw


Inspector IDPH license # 100-03175

Signature: 
Date: 8/29/2013

6. Management Planner

Management Planner Name: Todd Huffer

Management Planner IDPH license # 100-09870

Signature: 
Date: 9/4/2013

7. Review Date: 9/4/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 9/4/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the UNO - Archer Heights HS. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3343:

B. The following new homogenous areas have been identified for Building 3343:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

1	Drywall
12	Mastic used for Floor Tiles
13	Carpet Adhesive for Blue and Black Striped Carpet Tiles
14	Carpet adhesive for Green/Yellow Striped Carpet Tile
15	4" Sky Blue Baseboard
16	4" Light Green Baseboards
17	Mastic used for baseboards
18	2' X 2' White Ceiling Tiles
19	2' X 4' Drop Face White with Pin Dots Ceiling Tile
2	Drywall Joint Compound
20	sinks
21	Roof Field
22	Roof Flashing
3	12" X 12" Light Blue Mix Floor Tile
4	12' X 12" Blue Mix Floor Tile
5	12" x 12" Dark Blue Mix Floor Tile
6	12" X 12" White with Gray Mix Floor Tile
7	12" x 12" White with Blue Specks Floor Tile
9	12" x 12" Green Mix Floor Tile

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Marcos Iwankiw, IDPH License # 100-03175. The Management Plan was updated by Todd Huffer, IDPH License # 100-09870. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The UNO - Archer Heights HS Building 3343 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School UNO - Archer Heights HS Unit 66394 Building ID 3343
 Address 4248 W 47th St. Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500
 Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	Drywall	14,000	SF	Throughout 1st & 2nd Floor	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		MODERATE
12	Mastic used for Floor Tiles	78,400	SF	1st & 2nd Floor Halls, Vestibule, Teachers Offices, Bathrooms, Classrooms, Engineers Office	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
13	Carpet Adhesive for Blue and Black Striped Carpet Tiles	275	SF	1st Floor small corner offices	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
14	Carpet adhesive for Green/Yellow Striped Carpet Tile	275	SF	2nd Floor Small Corner Offices	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
15	4" Sky Blue Baseboard	5,400	LF	Throughout 1st Floor	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
16	4" Light Green Baseboards	5,520	LF	Throughout 2nd Floor	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
17	Mastic used for baseboards	10,920	LF	Throughout 1st and 2nd Floor	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
18	2' X 2' White Ceiling Tiles	28,000	SF	1st & 2nd Floor Halls, Vestibule, Teachers Office	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
19	2' X 4' Drop Face White with Pin Dots Ceiling Tile	21,875	SF	1st and 2nd Floor Classrooms and Multi-Purpose Room	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
2	Drywall Joint Compound	9,000	SF	Throughout 1st & 2nd Floors	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		MODERATE
20	sinks	14		4 classrooms (2 Arts Rooms & 2 Science Rooms) in 1st & 2nd Floors, and Multi-Purpose Rooms	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
21	Roof Field	67,000	SF	Roof	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
22	Roof Flashing	2,500	LF	Roof	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
3	12" X 12" Light Blue Mix Floor Tile	23,325	SF	1st Floor Halls, Classrooms, Teachers Offices, Vestibules, Bathrooms, Engineers office	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
4	12" X 12" Blue Mix Floor Tile	1,250	SF	1st Floor halls, Engineers office	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW

Chicago Public Schools

School UNO - Archer Heights HS Unit 66394 Building ID 3343
 Address 4248 W 47th St. Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500
 Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
5	12" x 12" Dark Blue Mix Floor Tile	55	SF	1st Floor Halls and Engineers office	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
6	12" X 12" White with Gray Mix Floor Tile	13,675	SF	1st Floor Halls, teachers offices, bathrooms, and resource room	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
7	12" x 12" White with Blue Specks Floor Tile	270	SF	1st Floor Teachers Office 1-50	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW
9	12" x 12" Green Mix Floor Tile	1,250	SF	2nd Floor - Halls, Engineer's office	ASSUMED	MISC	Y	NONE			No	ACBM with the potential for damage		LOW

Chicago Public Schools

School UNO - Archer Heights HS Unit 66394 Building ID 3343
Address 4248 W 47th St. Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date **8/29/2013**
Inspector Name **Marcos Iwankiw**
100-03175 **5/15/2013**
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
1	
12	
13	
14	
15	
16	
17	
18	
19	
2	
20	
21	
22	
3	
4	
5	
6	
7	
9	

Chicago Public Schools

School UNO - Archer Heights HS Unit 66394 Building ID 3343
Address 4248 W 47th St. Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School UNO - Archer Heights HS
Address 4248 W 47th St.

Unit 66394
Chicago, IL, 60632

Building ID 3343
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 762-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	Drywall	14,000	SF	Throughout 1st & 2nd Floor	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
12	Mastic used for Floor Tiles	78,400	SF	1st & 2nd Floor Halls, Vestibule, Teachers Offices, Bathrooms, Classrooms, Engineers Office	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
13	Carpet Adhesive for Blue and Black Striped Carpet Tiles	275	SF	1st floor small corner offices	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
14	Carpet adhesive for Green/Yellow Striped Carpet Tile	275	SF	2nd Floor Small Corner Offices	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
15	4" Sky Blue Baseboard	5,400	LF	Throughout 1st Floor	Assumed	MISC	Yes		LF	6 ACBM with the potential for damage	Operations and Maintenance
16	4" Light Green Baseboards	5,520	LF	Throughout 2nd Floor	Assumed	MISC	Yes		LF	6 ACBM with the potential for damage	Operations and Maintenance
17	Mastic used for baseboards	10,920	LF	Throughout 1st and 2nd Floor	Assumed	MISC	Yes		LF	6 ACBM with the potential for damage	Operations and Maintenance
18	2' X 2' White Ceiling Tiles	28,000	SF	1st & 2nd Floor Halls, Vestibule, Teachers Office	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
19	2' X 4' Drop Face White with Pin Dots Ceiling Tile	21,875	SF	1st and 2nd Floor Classrooms and Multi-Purpose Room	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
2	Drywall Joint Compound	9,000	SF	Throughout 1st & 2nd Floors	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
20	sinks	14		4 classrooms (2 Arts Rooms & 2 Science Rooms) in 1st & 2nd Floors, and Multi-Purpose Rooms	Assumed	MISC	Yes			6 ACBM with the potential for damage	Operations and Maintenance
21	Roof Field	67,000	SF	Roof	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
22	Roof Flashing	2,500	LF	Roof	Assumed	MISC	Yes		LF	6 ACBM with the potential for damage	Operations and Maintenance
3	12" X 12" Light Blue Mix Floor Tile	23,325	SF	1st Floor Halls, Classrooms, Teachers Offices, Vestibules, Bathrooms	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
4	12" X 12" Blue Mix Floor Tile	1,250	SF	1st Floor Halls, Classrooms, Teachers Offices, Vestibules, Bathrooms	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
5	12" x 12" Dark Blue Mix Floor Tile	55	SF	1st Floor Halls, Engineers office	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
6	12" X 12" White with Gray Mix Floor Tile	13,675	SF	1st Floor Halls, teachers office, bathrooms, and resource room	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
7	12" x 12" White with Blue Specks Floor Tile	270	SF	1st Floor teachers Office 1-50	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance
9	12" x 12" Green Mix Floor Tile	1,250	SF	2nd Floor - Halls, Engineer's office	Assumed	MISC	Yes		SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School UNO - Archer Heights HS
 Address 4248 W 47th St.

Unit 66394
 Chicago, IL 60632

Building ID 3343
 Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
 600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 762-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	9/4/2013
Manager Planner Name	Todd Huffer
100-09870	5/15/2013
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
12	
13	
14	
15	
16	
17	
18	
19	
2	
20	

Chicago Public Schools

School UNO - Archer Heights HS
Address 4248 W 47th St.

Unit 66394
Chicago, IL 60632

Building ID 3343
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 762-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
21	
22	
3	
4	
5	
6	
7	
9	

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout 1st & 2nd Floor**

MATERIAL QUANTITY: **14000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout 1st & 2nd Floor**
MATERIAL QUANTITY: **14000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Mastic used for Floor Tiles**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st & 2nd Floor Halls, Vestibule, Teachers Offices, Bathrooms. Classrooms, Engineers Office**

MATERIAL QUANTITY: **78400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Mastic used for Floor Tiles**
MATERIAL LOCATION: **1st & 2nd Floor Halls, Vestibule, Teachers Offices, Bathrooms. Classrooms, Engineers Office**
MATERIAL QUANTITY: **78400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Carpet Adhesive for Blue and Black Striped Carpet Tiles**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st floor small corner offices**

MATERIAL QUANTITY: **275**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Carpet Adhesive for Blue and Black Striped Carpet Tiles**
MATERIAL LOCATION: **1st floor small corner offices**
MATERIAL QUANTITY: **275** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Carpet adhesive for Green/Yellow Striped Carpet Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Small Corner Offices**

MATERIAL QUANTITY: **275**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Carpet adhesive for Green/Yellow Striped Carpet Tile**
MATERIAL LOCATION: **2nd Floor Small Corner Offices**
MATERIAL QUANTITY: **275** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **4" Sky Blue Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1st Floor**
MATERIAL QUANTITY: **5400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **4" Sky Blue Baseboard**
MATERIAL LOCATION: **Throughout 1st Floor**
MATERIAL QUANTITY: **5400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **4" Light Green Baseboards**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 2nd Floor**
MATERIAL QUANTITY: **5520** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **4" Light Green Baseboards**
MATERIAL LOCATION: **Throughout 2nd Floor**
MATERIAL QUANTITY: **5520** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Mastic used for baseboards**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1st and 2nd Floor**
MATERIAL QUANTITY: **10920** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Mastic used for baseboards**
MATERIAL LOCATION: **Throughout 1st and 2nd Floor**
MATERIAL QUANTITY: **10920** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **2' X 2' White Ceiling Tiles**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st & 2nd Floor Halls, Vestibule , Teachers Office**
MATERIAL QUANTITY: **28000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **2' X 2' White Ceiling Tiles**
MATERIAL LOCATION: **1st & 2nd Floor Halls, Vestibule , Teachers Office**
MATERIAL QUANTITY: **28000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **2' X 4' Drop Face White with Pin Dots Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st and 2nd Floor Classrooms and Multi-Purpose Room**
MATERIAL QUANTITY: **21875** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **2' X 4' Drop Face White with Pin Dots Ceiling Tile**
MATERIAL LOCATION: **1st and 2nd Floor Classrooms and Multi-Purpose Room**
MATERIAL QUANTITY: **21875** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout 1st & 2nd Floors**

MATERIAL QUANTITY: **9000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
MATERIAL LOCATION: **Throughout 1st & 2nd Floors**
MATERIAL QUANTITY: **9000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **sinks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **4 classrooms (2 Arts Rooms & 2 Science Rooms) in 1st & 2nd Floors, and Multi-Purpose Rooms**

MATERIAL QUANTITY: **14**

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **sinks**
MATERIAL LOCATION: **4 classrooms (2 Arts Rooms & 2 Science Rooms) in 1st & 2nd Floors, and Multi-Purpose Rooms**
MATERIAL QUANTITY: **14** MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Roof Field**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Roof**
MATERIAL QUANTITY: **67000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Roof Field**
MATERIAL LOCATION: **Roof**
MATERIAL QUANTITY: **67000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Roof Flashing**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Roof**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Roof Flashing**
MATERIAL LOCATION: **Roof**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **12" X 12" Light Blue Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Halls, Classrooms, Teachers Offices, Vestibules , Bathrooms**
MATERIAL QUANTITY: **23325** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **12" X 12" Light Blue Mix Floor Tile**
MATERIAL LOCATION: **1st Floor Halls, Classrooms, Teachers Offices, Vestibules , Bathrooms**
MATERIAL QUANTITY: **23325** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12' X 12" Blue Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor halls, Engineers office**
MATERIAL QUANTITY: **1250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12' X 12" Blue Mix Floor Tile**
MATERIAL LOCATION: **1st Floor halls, Engineers office**
MATERIAL QUANTITY: **1250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **12" x 12" Dark Blue Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Halls and Engineers office**
MATERIAL QUANTITY: **55** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **12" x 12" Dark Blue Mix Floor Tile**
MATERIAL LOCATION: **1st Floor Halls and Engineers office**
MATERIAL QUANTITY: **55** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **12" X 12" White with Gray Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Halls, teachers offices, bathrooms, and resource room**
MATERIAL QUANTITY: **13675** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **12" X 12" White with Gray Mix Floor Tile**
MATERIAL LOCATION: **1st Floor Halls, teachers offices, bathrooms, and resource room**
MATERIAL QUANTITY: **13675** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" x 12" White with Blue Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Teachers Office 1-50**
MATERIAL QUANTITY: **270** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" x 12" White with Blue Specks Floor Tile**
MATERIAL LOCATION: **1st Floor Teachers Office 1-50**
MATERIAL QUANTITY: **270** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Marcos Iwankiw**
SCHOOL NAME: **UNO - Archer Heights HS** INSPECTION DATE: **8/29/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **12" x 12" Green Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor - Halls, Engineer's office**

MATERIAL QUANTITY: **1250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: **08/29/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **66394** BUIDLING ID: **3343**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**
SCHOOL NAME: **UNO - Archer Heights HS** REVIEW DATE: **9/4/2013**
ADDRESS: **4248 W 47th St.** IDPH LICENSE NO: **100-03175**

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **12" x 12" Green Mix Floor Tile**
MATERIAL LOCATION: **2nd Floor - Halls, Engineer's office**
MATERIAL QUANTITY: **1250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **09/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

Marcos Iwankiw


Licensed Illinois Asbestos Inspector, Project Manager, and
Air Sampling Professional

Illinois Department of
PUBLIC HEALTH

**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER 100 - 03175	ISSUED 6/5/2012	EXPIRES 05/15/2013
---------------------------------	---------------------------	------------------------------

MARCOS IWANKIW
600 W. VAN BUREN STREET,
CHICAGO, IL 60607



Environmental Health

ENDORSEMENTS	TC EXPIRES
INSPECTOR	12/8/2012
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/23/2013

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**



Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Marcos Iwankiw

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department
of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance
with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042318

Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012



Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Todd Huffer

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department
of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance
with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042317

Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013




Kathy DeSalvo, Director

2012


Todd Huffer

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional

 **ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER 100 - 09870	ISSUED 4/4/2012	EXPIRES 05/15/2013
---------------------------------	---------------------------	------------------------------

TODD T HUFFER
918 N WOLCOTT UNIT 6
CHICAGO, IL 60622

Environmental Health

ENDORSEMENTS	TC EXPIRES
INSPECTOR	12/8/2012
MANAGEMENT PLANNER	1/19/2013
PROJECT MANAGER	9/8/2012
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**



Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Todd Huffer

has successfully completed the 4 hour Asbestos Management Planner Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250735

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014


Kathy DeSalvo, Director

2013

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed