

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2095
SCHOOL NAME: Bridge School
ADDRESS OF SCHOOL: 7001 W Addison
CITY: Chicago, IL, 60634

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **9/13/2019**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 6/21/2022 ENROLLMENT 1107
IDPH INSPECTOR LICENSE NUMBER: 100-11093
IDPH LICENSED INSPECTOR NAME (Please Print): David Avila
IDPH MP LICENSE NUMBER: 100-04019
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Arturo Saenz

DESIGNATED PERSON (Please Print): Richard J.Schleyer PHONE: (773) 251-7074



7/14/2022

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Bridge School

7001 W Addison
Chicago, IL, 60634

Unit: 22321
Building ID: 2380

IDPH ID Number: 14-016-2990-2095

REPORT DATE:

Thursday, July 14, 2022

Prepared for:

Chicago Public Schools
42 W. Madison Street
Chicago, IL 60602

Prepared by:

Specialty Consulting, Inc.

2942 W. Van Buren Street

Chicago, IL, 60612

Phone (312) 319-7575

Fax (312) 319-7580

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

07/14/2022

Mr.Eric Culbertson
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2022 Three-Year Reinspections

Dear Mr.Culbertson:

Specialty Consulting, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1, 2 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 22321 Region: 01 IDPH ID: 14-016-2990-2095

School: Bridge School Building ID: 2380

Address: 7001 W Addison
Chicago, IL, 60634

Building Contact: Ferhatbegovic, Denis Contact Phone: 7737106230

Current Building Owners: Chicago Public Schools

Reinspection Date: 6/21/2022

Review Date: 07/14/2022

Inspector: David Avila Inspector IDPH License: 100-11093
Management Planner: Arturo Saenz Management Planner IDPH License: 100-04019

If you have any questions or comments, please contact us at (312) 319-7575

Sincerely,
Specialty Consulting, Inc.

A handwritten signature in blue ink, appearing to be "AS", written over a horizontal line.

Arturo Saenz
100-04019

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: July 14, 2022

RE: Bridge School, Unit 22321
7001 W Addison
Chicago, IL, 60634

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2022 asbestos three year re-inspection has been completed at Bridge School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing building materials have been identified at Bridge School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing building materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Richard J.Schleyer, the designated Local Education Authority's Designated Person at (773) 251-7074 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Bridge School Unit: 22321 Region: 01
Address: 7001 W Addison Chicago, IL, 60634
IDPH ID: 14-016-2990-2095 Building ID: 2380
Contact: Ferhatbegovic, Denis Phone: 7737106230

2. Description of Facility

Original Construction: 0 Additional Construction:
Total Square Footage: 37480 No of Floors: 2
Current Occupancy: 1107

3. LEA Designated Person

Contact: Richard J.Schleyer Phone: (773) 251-7074
Address: 42 West Madison Street
Chicago, IL 60602


4. Managing Environmental Consultant

MEC: Specialty Consulting, Inc.
Contact: Jigar Shah
Address 2942 W. Van Buren Street
Phone: (312) 319-7575 Fax: (312) 319-7580

5. Inspector

Inspector Name: David Avila


Inspector IDPH license # 100-11093
Reinspection Date: 6/21/2022

Signature: 
Date: 6/21/2022

6. Management Planner

Management Planner Name: Arturo Saenz

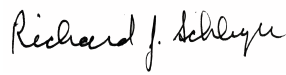
Management Planner IDPH license # 100-04019

Signature: 
Date: 07/14/2022

7. Review Date: 07/14/2022

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 7/14/2022

Name: Richard J.Schleyer

II. EXECUTIVE SUMMARY

Specialty Consulting, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Bridge School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 2380:

01

Hot Water Tank Lagging #1

B. The following new homogenous areas have been identified for Building 2380:

| | |
|------|--|
| 103 | 12"x12" Gray w/ Specks VFT |
| 103A | 12x12 Gray w/ Specks VFT Mastic |
| 104 | 12x12 Peach w/ Specks VFT |
| 104A | 12x12 Peach w/ Specks VFT Mastic |
| 105 | 12x12 Blue w/ Specks VFT |
| 105A | 12x12 Blue w/ Specks VFT Mastic |
| 106 | 12x12 Blue w/ Light Blue and White Streaks VFT |
| 107 | 12x12 Blue w/ Light Blue and White Streaks VFT Mastic |
| 108 | 12x12 Gray w/ Blue and White Streaks VFT |
| 109 | 12x12 Gray w/ Blue and White Streaks VFT Mastic |
| 110 | 12x12 Tan w/ Brown and Blue Streaks VFT |
| 111 | 12x12 Tan w/ Brown and Blue Streaks VFT Mastic |

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

| | |
|------|---|
| 100 | 2'x2' White w/holes Ceiling Tile |
| 101 | Drywall System |
| 102 | Vinyl Baseboard Mastic |
| 103 | 12"x12" Gray w/ Specks VFT |
| 103A | 12x12 Gray w/ Specks VFT Mastic |
| 104 | 12x12 Peach w/ Specks VFT |
| 104A | 12x12 Peach w/ Specks VFT Mastic |
| 105 | 12x12 Blue w/ Specks VFT |
| 105A | 12x12 Blue w/ Specks VFT Mastic |
| 106 | 12x12 Blue w/ Light Blue and White Streaks VFT |
| 107 | 12x12 Blue w/ Light Blue and White Streaks VFT Mastic |
| 108 | 12x12 Gray w/ Blue and White Streaks VFT |
| 109 | 12x12 Gray w/ Blue and White Streaks VFT Mastic |
| 110 | 12x12 Tan w/ Brown and Blue Streaks VFT |
| 111 | 12x12 Tan w/ Brown and Blue Streaks VFT Mastic |
| 16 | MJP E/F/V on Fiberglass Pipe Run |
| 41 | 12"x12" Brown w/ Dark Brown Streaks VFT |
| 43 | 12"x12" White w/ Tan Streaks VFT |
| 49 | 12"x12" Tan w/ Brown Streaks VFT |
| 51 | 12"x12" Sand VFT |
| 64 | 12" x 12" Cream with Brown Streaks VFT |
| 64 A | 12" x 12" Cream with Brown Streaks VFT Mastic |
| 65 | 12"x12" White w/ Tan Specks VFT |
| 66 | 12"x12" White w/ Tan Specks VFT Mastic |
| 67 | 12"x12" Tan w/ White Specks VFT |
| 69 | 12"x12" Off White w/ Tan Specks VFT |
| 85 | Cardboard Pipe Insulation |
| 87 | MJP on Fiberglass Pipe Insulation |
| 89 | 1 x 1 ft Grooved Ceiling Tiles |
| 89 A | 1 x 1 ft Grooved Ceiling Tile Mastic |
| 90 | Terrazo |
| 91 A | Carpet Mastic |
| 92 | 12"x12" Blue VFT |
| 93 | 12"x12" Blue Mastic |
| 94 | Blown-In Insulation on Duct Work |
| 95 | 12"x12" White w/gray streaks VFT |
| 96 | 12"x12" White w/gray streaks Mastic |
| 97 | Beige w/brown streaks Linoleum Flooring |
| 98 | Beige w/brown streaks Linoleum Flooring Mastic |
| 99 | Texture Drywall Ceiling |

The following areas were deemed to be inaccessible:

| | |
|------|---|
| 01 | Hot Water Tank Lagging #1 |
| 02 | Hot Water Tank Lagging #2 |
| 03 | Boiler Lagging #1 |
| 04 | Boiler Lagging #2 |
| 05 | Header Insulation and Pipe Insulation (Mag Block) |
| 06 | Cardboard Pipe Insulation |
| 08 | Aircell Pipe Insulation |
| 09 | MJP E/F/V on Aircell Pipe Insulation |
| 10 | MJP E/F/V on Cardboard Pipe Insulation |
| 11 | Aircell Duct Wrap |
| 12 | Debris on Dirt Floor |
| 15 | Mag Block Pipe Insulation |
| 16 | MJP E/F/V on Fiberglass Pipe Run |
| 83 | Aircell Pipe Insulation |
| 85 | Cardboard Pipe Insulation |
| 87 | MJP on Fiberglass Pipe Insulation |
| 88 | Aircell Duct Insulation |
| 89 | 1 x 1 ft Grooved Ceiling Tiles |
| 89 A | 1 x 1 ft Grooved Ceiling Tile Mastic |
| 90 | Terrazo |
| 94 | Blown-In Insulation on Duct Work |

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by David Avila, IDPH License # 100-11093. The Management Plan was updated by Arturo Saenz, IDPH License # 100-04019. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Bridge School Building 2380 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable ACBM. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inserted in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Bridge School Unit 22321 Building ID 2380

Address 7001 W Addison Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|---|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|---|---------------|-----------------------|
| 01 | Hot Water Tank Lagging #1 | 100 | SF | Boiler Room - 1926 | CHR | TSI | Y | LOC | 20 | | Yes | Damaged or significantly damaged friable thermal system insulating ACBM | 2 | LOW |
| 02 | Hot Water Tank Lagging #2 | 175 | SF | Boiler Room - 1926 | CHR | TSI | Y | LOC | 30 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | 2 | LOW |
| 03 | Boiler Lagging #1 | 500 | SF | Boiler Room - 1926 | CHR | TSI | Y | LOC | 50 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | 2 | LOW |
| 04 | Boiler Lagging #2 | 500 | SF | Boiler Room - 1926 | CHR | TSI | Y | LOC | 50 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | 2 | LOW |
| 05 | Header Insulation and Pipe Insulation (Mag Block) | 260 | LF | Boiler Room - 1926 | CHR | TSI | Y | LOC | 20 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | 3 | LOW |
| 06 | Cardboard Pipe Insulation | 1,200 | LF | Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926 | CHR | TSI | Y | LOC | 57 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | 2 | LOW |
| 07 | Gasket Material (Boiler #1 & #2) | 4 | LF | Boiler Room - 1926 | CHR | TSI | Y | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 08 | Aircell Pipe Insulation | 2,000 | LF | Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926 | CHR | TSI | Y | LOC | 269 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | 2 | LOW |
| 09 | MJP E/F/V on Aircell Pipe Insulation | 600 | LF | Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, & Unexcavated Areas, N & S Air tunnels - 1926 | CHR | TSI | Y | LOC | 60 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | 3 | LOW |

Chicago Public Schools

School Bridge School Unit 22321 Building ID 2380

Address 7001 W Addison Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|---|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|---|---------------|-----------------------|
| 10 | MJP E/F/V on Cardboard Pipe Insulation | 240 | LF | Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926 | CHR | TSI | Y | LOC | 6 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | 3 | LOW |
| 100 | 2'x2' White w/holes Ceiling Tile | 3,200 | SF | Rooms 001-004 including closets and the Hallway in the MODULAR | ASSUMED | MISC | Y | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 101 | Drywall System | 4,500 | SF | Throughout MODULAR | ASSUMED | MISC | Y | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 102 | Vinyl Baseboard Mastic | 600 | LF | Throughout MODULAR | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 103 | 12"x12" Gray w/ Specks VFT | 1,200 | SF | 105, 107, and 112 | ASSUMED | MISC | N | NONE | 0 | | | ACBM with the potential for damage | | LOW |
| 103A | 12x12 Gray w/ Specks VFT Mastic | 1,200 | SF | 105, 107, 112 | ASSUMED | MISC | N | NONE | | | | ACBM with the potential for damage | | LOW |
| 104 | 12x12 Peach w/ Specks VFT | 1,200 | SF | 105, 107, 112 | ASSUMED | MISC | N | NONE | 0 | | | ACBM with the potential for damage | | LOW |
| 104A | 12x12 Peach w/ Specks VFT Mastic | 1,200 | SF | 105, 107, 112 | ASSUMED | MISC | N | NONE | | | | ACBM with the potential for damage | | LOW |
| 105 | 12x12 Blue w/ Specks VFT | 1,200 | SF | 105, 107, 112 | ASSUMED | MISC | N | NONE | | | | ACBM with the potential for damage | | LOW |
| 105A | 12x12 Blue w/ Specks VFT Mastic | 1,200 | SF | 105, 107, 112 | ASSUMED | MISC | N | NONE | | | | ACBM with the potential for damage | | LOW |
| 106 | 12x12 Blue w/ Light Blue and White Streaks VFT | 400 | SF | Room 105, 112 | ASSUMED | MISC | N | NONE | 0 | | | ACBM with the potential for damage | | |
| 107 | 12x12 Blue w/ Light Blue and White Streaks VFT Mastic | 400 | SF | Room 105, 112 | ASSUMED | MISC | N | NONE | 0 | | | ACBM with the potential for damage | | |
| 108 | 12x12 Gray w/ Blue and White Streaks VFT | 400 | SF | Room 105, 112 | ASSUMED | MISC | N | NONE | 0 | | | ACBM with the potential for damage | | |
| 109 | 12x12 Gray w/ Blue and White Streaks VFT Mastic | 400 | SF | Room 105, 112 | ASSUMED | MISC | N | NONE | 0 | | | ACBM with the potential for damage | | |
| 11 | Aircell Duct Wrap | 2,500 | SF | Unexcavated Areas - 1926 | CHR | TSI | Y | LOC | 104 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | 2 | LOW |
| 110 | 12x12 Tan w/ Brown and Blue Streaks VFT | 400 | SF | Room 105, 112 | ASSUMED | MISC | N | NONE | 0 | | | ACBM with the potential for damage | | |
| 111 | 12x12 Tan w/ Brown and Blue Streaks VFT Mastic | 400 | SF | Room 105, 112 | ASSUMED | MISC | N | NONE | 0 | | | ACBM with the potential for damage | | |

Chicago Public Schools

School Bridge School Unit 22321 Building ID 2380

Address 7001 W Addison Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|---|---------------|-----------------------|
| 12 | Debris on Dirt Floor | 1,200 | SF | NW, NE, Center, SW Unexcavated Areas - 1926 | CHR | TSI | Y | DIST | 1,200 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | 2 | LOW |
| 15 | Mag Block Pipe Insulation | 60 | LF | Air Tunnel & Tunnel To Building, Mechanical Room, NW Unexcavated Area- 1926 | CHR | TSI | Y | LOC | 6 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | | LOW |
| 16 | MJP E/F/V on Fiberglass Pipe Run | 200 | LF | Mechanical Rm, Electrical Rm, Boiler Rm, Boys and Girls Toilet Pipe Chases- 1926 | ASSUMED | TSI | Y | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 28 | MJP E/F/V on Mag Block Pipe Insulation | 43 | LF | Boiler Room & Tunnel To Building- 1926 | CHR | TSI | Y | NONE | 0 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | | LOW |
| 31 | 12"x12" Brown w/ White Streaks VFT | 1,400 | SF | 1st Floor Cafeteria (Room 112) - 1926 | ABATED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 32 | 12"x12" Brown w/ White Streaks VFT Mastic | 1,400 | SF | 1st Floor Cafeteria (Room 112) - 1926 | ABATED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 33 | 12"x12" White w/ Brown Streaks VFT | 800 | SF | 1st Floor Cafeteria (Room 112) - 1926 | ABATED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 34 | 12"x12" White w/ Brown Streaks VFT Mastic | 800 | SF | 1st Floor Cafeteria (Room 112) - 1926 | ABATED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 35 | 9"x 9" White w/ Red Streaks VFT | 550 | SF | Room 110 (under the carpet), MDF Room - 1926 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 36 | 9"x 9" White w/ Red Streaks VFT Mastic | 550 | SF | Room 110 (under the carpet), MDF Room - 1926 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 37 | 9"x9" Beige VFT | 750 | SF | Room 111 - 1926 | CHR | MISC | N | DIST | 10 | | No | Damaged or significantly damaged friable misc. ACBM | 3 | MODERATE |
| 38 | 9"x9" Beige VFT Mastic | 750 | SF | Room 111 - 1926 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 41 | 12"x12" Brown w/ Dark Brown Streaks VFT | 360 | SF | Room 108 - 1926 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 42 | 12"x12" Brown w/ Dark Brown Streaks VFT Mastic | 360 | SF | Room 108 - 1926 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 43 | 12"x12" White w/ Tan Streaks VFT | 360 | SF | Room 108 - 1926 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 44 | 12"x12" White w/ Tan Streaks VFT Mastic | 360 | SF | Room 108 - 1926 | CHR | MISC | N | NONE | 0 | | No | ACBM with the | | LOW |

Chicago Public Schools

School Bridge School Unit 22321 Building ID 2380

Address 7001 W Addison Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|---|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| | | | | | | | | | | | | potential for damage | | |
| 45 | 12"x12" Off White VFT | 750 | SF | Room 107 & Storage - 1926 | ABATED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 46 | 12"x12" Off White VFT Mastic | 750 | SF | Room 107 & Storage - 1926 | ABATED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 47 | 12"x12" Light Purple VFT | 750 | SF | Room 107 & Storage - 1926 | ABATED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 48 | 12"x12" Light Purple VFT Mastic | 750 | SF | Room 107 & Storage - 1926 | ABATED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 49 | 12"x12" Tan w/ Brown Streaks VFT | 750 | SF | Room 106 - 1926 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 50 | 12"x12" Tan w/ Brown Streaks VFT Mastic | 750 | SF | Room 106 - 1926 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 51 | 12"x12" Sand VFT | 120 | SF | Room 104 - 1926 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 52 | 12"x12" Sand VFT Mastic | 120 | SF | Room 104 - 1926 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 53 | 9"x9" White w/ Blue Streaks VFT | 700 | SF | Room 105 - 1926 | ABATED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 54 | 9"x9" White w/ Blue Streaks VFT Mastic | 700 | SF | Room 105 - 1926 | ABATED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 62 | Lab Table Tops | 1,200 | SF | Room 106 - 1926 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 64 | 12" x 12" Cream with Brown Streaks VFT | 1,500 | SF | First and Second Floor Corridors - 1926 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 64 A | 12" x 12" Cream with Brown Streaks VFT Mastic | 1,500 | SF | First and Second Floor Corridors - 1926 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 65 | 12"x12" White w/ Tan Specks VFT | 1,500 | SF | 1st & 2nd Floor Corridors - 1929 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 66 | 12"x12" White w/ Tan Specks VFT Mastic | 1,500 | SF | 1st & 2nd Floor Corridors - 1929 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 67 | 12"x12" Tan w/ White Specks VFT | 700 | SF | Room 102 - 1929 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 68 | 12"x12" Tan w/ White Specks VFT Mastic | 700 | SF | Room 102 - 1929 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 69 | 12"x12" Off White w/ Tan Specks VFT | 700 | SF | Room 102 - 1929 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 70 | 12"x12" Off White w/ Tan Specks VFT Mastic | 700 | SF | Room 102 - 1929 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 71 | 12"x12" Black VFT | 1,100 | SF | Assembly Hall - 1929 | CHR | MISC | N | LOC | 15 | | No | ACBM with the potential for damage | 3 | LOW |
| 72 | 12"x12" Black VFT Mastic | 1,100 | SF | Assembly Hall - | CHR | MISC | N | LOC | 15 | | No | Damaged or | 3 | LOW |

Chicago Public Schools

School Bridge School Unit 22321 Building ID 2380

Address 7001 W Addison Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|---|---------------|-----------------------|
| | | | | 1929 | | | | | | | | significantly damaged friable misc. ACBM | | |
| 73 | 12"x12" Dark Red VFT | 1,100 | SF | Assembly Hall - 1929 | CHR | MISC | N | LOC | 15 | | No | ACBM with the potential for damage | 3 | LOW |
| 74 | 12"x12" Dark Red VFT Mastic | 1,100 | SF | Assembly Hall - 1929 | CHR | MISC | N | LOC | 15 | | No | ACBM with the potential for damage | 3 | LOW |
| 75 | 9"x18" Black VFT | 350 | SF | Assembly Hall - 1929 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 76 | 9"x18" Black VFT Mastic | 350 | SF | Assembly Hall - 1929 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 77 | 9"x9" Black w/ White Streaks VFT | 400 | SF | Assembly Hall - 1929 | CHR | MISC | N | LOC | 50 | | No | ACBM with the potential for damage | | LOW |
| 78 | 9"x9" Black w/ White Streaks VFT Mastic | 50 | SF | Assembly Hall - 1929 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 79 | 9"x9" Dark Red w/ White Streaks VFT | 50 | SF | Assembly Hall - 1929 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 80 | 9"x9" Dark Red w/ White Streaks VFT Mastic | 50 | SF | Assembly Hall - 1929 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 81 | Carpet Mastic - REMOVED | | | Room 201 - 1929 - REMOVED | | | | | | | | | | |
| 82 | Hard Coat Plaster | | | Throughout - 1929 | NO_ACBM | | | | | | | | | |
| 83 | Aircell Pipe Insulation | 1,250 | LF | South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, Assembly Hall Plenum, SE Unex. - 1929 | CHR | TSI | Y | DIST | 60 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | | LOW |
| 84 | MJP on Aircell Pipe Insulation | 145 | LF | South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, Assembly Hall Plenum, SE Unexcavated. - 1929 | CHR | TSI | Y | LOC | 21 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | | LOW |
| 85 | Cardboard Pipe Insulation | 535 | LF | South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, A.H. Plenum & W. Tol., SE Unex. - 1929 | ASSUMED | TSI | Y | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 86 | MJP on Cardboard Pipe Insulation | 60 | LF | South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, A.H. Plenum & W. Tol., SE Unex. - | CHR | TSI | Y | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Bridge School Unit 22321 Building ID 2380

Address 7001 W Addison Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|---|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|---|---------------|-----------------------|
| | | | | 1929 | | | | | | | | | | |
| 87 | MJP on Fiberglass Pipe Insulation | 500 | LF | Basement Electrical Room, 1st & 2nd Floor Boy's & Girl's Toilet Chases, Rm 300 Pipe Chase - 1929 | ASSUMED | TSI | Y | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 88 | Aircell Duct Insulation | 500 | SF | South & SouthEast Unexcavated - 1929 | CHR | TSI | Y | DIST | 180 | | No | Damaged or significantly damaged friable thermal system insulating ACBM | 2 | LOW |
| 89 | 1 x 1 ft Grooved Ceiling Tiles | 700 | SF | Rooms 111 and 112 | ASSUMED | MISC | Y | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 89 A | 1 x 1 ft Grooved Ceiling Tile Mastic | 700 | SF | Rooms 111 and 112 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 90 | Terrazo | 4,500 | SF | 1926 Building: Entryways, 1st and 2nd Floor Corridors, Gym Stairs, Stairwells, Room 300, 107 Wardrobe, Stage and Stairs | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 91 A | Carpet Mastic | 1,600 | SF | Rooms 110 and 213, Office and 2nd Floor Counselor's Office | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 92 | 12"x12" Blue VFT | 700 | SF | 1st and 2nd Floor Corridors (Building 1926) | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 93 | 12"x12" Blue Mastic | 700 | SF | 1st and 2nd Floor Corridors (Building 1926) | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 94 | Blown-In Insulation on Duct Work | 2,500 | SF | Attic | ASSUMED | MISC | Y | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 95 | 12"x12" White w/gray streaks VFT | 3,200 | SF | Rooms 001-004 including the closets and the hallway in the MODULAR | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 96 | 12"x12" White w/gray streaks Mastic | 3,200 | SF | Rooms 001-004 including the closets and the Hallway in the MODULAR | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 97 | Beige w/brown streaks Linoleum Flooring | 280 | SF | Boy's and Girl's Bathrooms in the MODULAR | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Bridge School Unit 22321 Building ID 2380

Address 7001 W Addison Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| 98 | Beige w/brown streaks Linoleum Flooring Mastic | 280 | SF | Boy's and Girl's Washrooms in the MODULAR | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 99 | Texture Drywall Ceiling | 280 | SF | Boy's and Girl's Washrooms in the MODULAR | ASSUMED | MISC | Y | NONE | 0 | | No | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Bridge School Unit 22321 Building ID 2380

Address 7001 W Addison Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

| |
|---|
| Reinspection Date 6/21/2022 |
| Inspector Name David Avila |
| 100-11093 5/15/2023 |
| Inspector's IDPH License Number / Expiration Date |

Inspector's Comments

| HA Number: | Inspector Comments: |
|------------|---------------------|
| 01 | |
| 02 | |
| 03 | |
| 04 | |
| 05 | |
| 06 | |
| 07 | |
| 08 | |
| 09 | |
| 10 | |
| 100 | |
| 101 | |
| 102 | |
| 103 | |
| 103A | |
| 104 | |
| 104A | |
| 105 | |
| 105A | |
| 106 | |
| 107 | |
| 108 | |
| 109 | |
| 11 | |

Chicago Public Schools

School Bridge School Unit 22321 Building ID 2380

Address 7001 W Addison Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|---------------------|
| 110 | |
| 111 | |
| 12 | |
| 15 | |
| 16 | |
| 28 | |
| 31 | |
| 32 | |
| 33 | |
| 34 | |
| 35 | |
| 36 | |
| 37 | |
| 38 | |
| 41 | |
| 42 | |
| 43 | |
| 44 | |
| 45 | |
| 46 | |
| 47 | |
| 48 | |
| 49 | |
| 50 | |
| 51 | |
| 52 | |
| 53 | |
| 54 | |
| 62 | |

Chicago Public Schools

School Bridge School Unit 22321 Building ID 2380

Address 7001 W Addison Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|----------------------|
| 64 | |
| 64 A | |
| 65 | |
| 66 | |
| 67 | |
| 68 | |
| 69 | |
| 70 | |
| 71 | Damage in auditorium |
| 72 | Damage in auditorium |
| 73 | Damage in auditorium |
| 74 | Damage in auditorium |
| 75 | |
| 76 | |
| 77 | |
| 78 | |
| 79 | |
| 80 | |
| 81 | |
| 82 | |
| 83 | |
| 84 | |
| 85 | |
| 86 | |
| 87 | |
| 88 | |
| 89 | |
| 89 A | |
| 90 | |

Chicago Public Schools

School Bridge School Unit 22321 Building ID 2380

Address 7001 W Addison Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575 Fax: (312) 319-7580

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|---------------------|
| 91 A | |
| 92 | |
| 93 | |
| 94 | |
| 95 | |
| 96 | |
| 97 | |
| 98 | |
| 99 | |

Table II

Management Planner's Review

Chicago Public Schools

School Bridge School
Address 7001 W Addison

Unit 22321
Chicago, IL, 60634

Building ID 2380
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|---|-------------------|----------------|---|---------------|-------------------|---------|-----------------|--------------|---|-----------------|
| 01 | Hot Water Tank Lagging #1 | 100 | SF | Boiler Room - 1926 | Chrysotile | TSI | Yes | 20 | SF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |
| 02 | Hot Water Tank Lagging #2 | 175 | SF | Boiler Room - 1926 | Chrysotile | TSI | Yes | 30 | SF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |
| 03 | Boiler Lagging #1 | 500 | SF | Boiler Room - 1926 | Chrysotile | TSI | Yes | 50 | SF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |
| 04 | Boiler Lagging #2 | 500 | SF | Boiler Room - 1926 | Chrysotile | TSI | Yes | 50 | SF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |
| 05 | Header Insulation and Pipe Insulation (Mag Block) | 260 | LF | Boiler Room - 1926 | Chrysotile | TSI | Yes | 20 | LF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |
| 06 | Cardboard Pipe Insulation | 1,200 | LF | Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926 | Chrysotile | TSI | Yes | 57 | LF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |
| 07 | Gasket Material (Boiler #1 & #2) | 4 | LF | Boiler Room - 1926 | Chrysotile | TSI | Yes | 0 | LF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 08 | Aircell Pipe Insulation | 2,000 | LF | Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926 | Chrysotile | TSI | Yes | 269 | LF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |
| 09 | MJP E/F/V on Aircell Pipe Insulation | 600 | LF | Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, & Unexcavated Areas, N & S Air tunnels - 1926 | Chrysotile | TSI | Yes | 60 | LF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |
| 10 | MJP E/F/V on Cardboard Pipe Insulation | 240 | LF | Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926 | Chrysotile | TSI | Yes | 6 | LF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |
| 100 | 2'x2' White w/holes Ceiling Tile | 3,200 | SF | Rooms 001-004 including closets and the Hallway in the MODULAR | Assumed | MISC | Yes | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 101 | Drywall System | 4,500 | SF | Throughout MODULAR | Assumed | MISC | Yes | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 102 | Vinyl Baseboard Mastic | 600 | LF | Throughout MODULAR | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 103 | 12"x12" Gray w/ Specks VFT | 1,200 | SF | 105, 107, and 112 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 103A | 12x12 Gray w/ Specks VFT Mastic | 1,200 | SF | 105, 107, 112 | Assumed | MISC | No | | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 104 | 12x12 Peach w/ Specks VFT | 1,200 | SF | 105, 107, 112 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 104A | 12x12 Peach w/ Specks VFT Mastic | 1,200 | SF | 105, 107, 112 | Assumed | MISC | No | | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 105 | 12x12 Blue w/ Specks VFT | 1,200 | SF | 105, 107, 112 | Assumed | MISC | No | | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 105A | 12x12 Blue w/ Specks VFT Mastic | 1,200 | SF | 105, 107, 112 | Assumed | MISC | No | | SF | 6 ACBM with the potential for damage | Follow O&M Plan |

Chicago Public Schools

School Bridge School
Address 7001 W Addison

Unit 22321
Chicago, IL, 60634

Building ID 2380
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|---|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|---|-----------------|
| 106 | 12x12 Blue w/ Light Blue and White Streaks VFT | 400 | SF | Room 105, 112 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 107 | 12x12 Blue w/ Light Blue and White Streaks VFT Mastic | 400 | SF | Room 105, 112 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 108 | 12x12 Gray w/ Blue and White Streaks VFT | 400 | SF | Room 105, 112 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 109 | 12x12 Gray w/ Blue and White Streaks VFT Mastic | 400 | SF | Room 105, 112 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 11 | Aircell Duct Wrap | 2,500 | SF | Unexcavated Areas - 1926 | Chrysotile | TSI | Yes | 104 | SF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Remove |
| 110 | 12x12 Tan w/ Brown and Blue Streaks VFT | 400 | SF | Room 105, 112 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 111 | 12x12 Tan w/ Brown and Blue Streaks VFT Mastic | 400 | SF | Room 105, 112 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 12 | Debris on Dirt Floor | 1,200 | SF | NW, NE, Center, SW Unexcavated Areas - 1926 | Chrysotile | TSI | Yes | 1,200 | SF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Remove |
| 15 | Mag Block Pipe Insulation | 60 | LF | Air Tunnel & Tunnel To Building, Mechanical Room, NW Unexcavated Area- 1926 | Chrysotile | TSI | Yes | 6 | LF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |
| 16 | MJP E/F/V on Fiberglass Pipe Run | 200 | LF | Mechanical Rm, Electrical Rm, Boiler Rm, Boys and Girls Toilet Pipe Chases- 1926 | Assumed | TSI | Yes | 0 | LF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 28 | MJP E/F/V on Mag Block Pipe Insulation | 43 | LF | Boiler Room & Tunnel To Building- 1926 | Chrysotile | TSI | Yes | 0 | LF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Follow O&M Plan |
| 31 | 12"x12" Brown w/ White Streaks VFT | 1,400 | SF | 1st Floor Cafeteria (Room 112) - 1926 | Abated | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 32 | 12"x12" Brown w/ White Streaks VFT Mastic | 1,400 | SF | 1st Floor Cafeteria (Room 112) - 1926 | Abated | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 33 | 12"x12" White w/ Brown Streaks VFT | 800 | SF | 1st Floor Cafeteria (Room 112) - 1926 | Abated | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 34 | 12"x12" White w/ Brown Streaks VFT Mastic | 800 | SF | 1st Floor Cafeteria (Room 112) - 1926 | Abated | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 35 | 9"x 9" White w/ Red Streaks VFT | 550 | SF | Room 110 (under the carpet), MDF Room - 1926 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 36 | 9"x 9" White w/ Red Streaks VFT Mastic | 550 | SF | Room 110 (under the carpet), MDF Room - 1926 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 37 | 9"x9" Beige VFT | 750 | SF | Room 111 - 1926 | Chrysotile | MISC | No | 10 | SF | 4 Damaged or significantly damaged friable misc. ACBM | Remove |
| 38 | 9"x9" Beige VFT Mastic | 750 | SF | Room 111 - 1926 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 41 | 12"x12" Brown w/ Dark Brown Streaks VFT | 360 | SF | Room 108 - 1926 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 42 | 12"x12" Brown w/ Dark Brown Streaks VFT Mastic | 360 | SF | Room 108 - 1926 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 43 | 12"x12" White w/ Tan Streaks VFT | 360 | SF | Room 108 - 1926 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 44 | 12"x12" White w/ Tan Streaks VFT Mastic | 360 | SF | Room 108 - 1926 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 45 | 12"x12" Off White VFT | 750 | SF | Room 107 & Storage - 1926 | Abated | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 46 | 12"x12" Off White VFT Mastic | 750 | SF | Room 107 & Storage - 1926 | Abated | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |

Chicago Public Schools

School Bridge School
Address 7001 W Addison

Unit 22321
Chicago, IL, 60634

Building ID 2380
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|---|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|---|-----------------|
| 47 | 12"x12" Light Purple VFT | 750 | SF | Room 107 & Storage - 1926 | Abated | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 48 | 12"x12" Light Purple VFT Mastic | 750 | SF | Room 107 & Storage - 1926 | Abated | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 49 | 12"x12" Tan w/ Brown Streaks VFT | 750 | SF | Room 106 - 1926 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 50 | 12"x12" Tan w/ Brown Streaks VFT Mastic | 750 | SF | Room 106 - 1926 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 51 | 12"x12" Sand VFT | 120 | SF | Room 104 - 1926 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 52 | 12"x12" Sand VFT Mastic | 120 | SF | Room 104 - 1926 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 53 | 9"x9" White w/ Blue Streaks VFT | 700 | SF | Room 105 - 1926 | Abated | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 54 | 9"x9" White w/ Blue Streaks VFT Mastic | 700 | SF | Room 105 - 1926 | Abated | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 62 | Lab Table Tops | 1,200 | SF | Room 106 - 1926 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 64 | 12" x 12" Cream with Brown Streaks VFT | 1,500 | SF | First and Second Floor Corridors - 1926 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 64 A | 12" x 12" Cream with Brown Streaks VFT Mastic | 1,500 | SF | First and Second Floor Corridors - 1926 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 65 | 12"x12" White w/ Tan Specks VFT | 1,500 | SF | 1st & 2nd Floor Corridors - 1929 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 66 | 12"x12" White w/ Tan Specks VFT Mastic | 1,500 | SF | 1st & 2nd Floor Corridors - 1929 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 67 | 12"x12" Tan w/ White Specks VFT | 700 | SF | Room 102 - 1929 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 68 | 12"x12" Tan w/ White Specks VFT Mastic | 700 | SF | Room 102 - 1929 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 69 | 12"x12" Off White w/ Tan Specks VFT | 700 | SF | Room 102 - 1929 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 70 | 12"x12" Off White w/ Tan Specks VFT Mastic | 700 | SF | Room 102 - 1929 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 71 | 12"x12" Black VFT | 1,100 | SF | Assembly Hall - 1929 | Chrysotile | MISC | No | 15 | SF | 6 ACBM with the potential for damage | Remove |
| 72 | 12"x12" Black VFT Mastic | 1,100 | SF | Assembly Hall - 1929 | Chrysotile | MISC | No | 15 | SF | 4 Damaged or significantly damaged friable misc. ACBM | Remove |
| 73 | 12"x12" Dark Red VFT | 1,100 | SF | Assembly Hall - 1929 | Chrysotile | MISC | No | 15 | SF | 6 ACBM with the potential for damage | Remove |
| 74 | 12"x12" Dark Red VFT Mastic | 1,100 | SF | Assembly Hall - 1929 | Chrysotile | MISC | No | 15 | SF | 6 ACBM with the potential for damage | Remove |
| 75 | 9"x18" Black VFT | 350 | SF | Assembly Hall - 1929 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 76 | 9"x18" Black VFT Mastic | 350 | SF | Assembly Hall - 1929 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 77 | 9"x9" Black w/ White Streaks VFT | 400 | SF | Assembly Hall - 1929 | Chrysotile | MISC | No | 50 | SF | 6 ACBM with the potential for damage | Remove |
| 78 | 9"x9" Black w/ White Streaks VFT Mastic | 50 | SF | Assembly Hall - 1929 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 79 | 9"x9" Dark Red w/ White Streaks VFT | 50 | SF | Assembly Hall - 1929 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 80 | 9"x9" Dark Red w/ White Streaks VFT Mastic | 50 | SF | Assembly Hall - 1929 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 81 | Carpet Mastic - REMOVED | | | Room 201 - 1929 - REMOVED | | | | | | | |
| 82 | Hard Coat Plaster | | | Throughout - 1929 | No ACBM | | | | | | |
| 83 | Aircell Pipe Insulation | 1,250 | LF | South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, Assembly Hall Plenum, SE Unex. - 1929 | Chrysotile | TSI | Yes | 60 | LF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |
| 84 | MJP on Aircell Pipe Insulation | 145 | LF | South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, Assembly Hall | Chrysotile | TSI | Yes | 21 | LF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Repair |

Chicago Public Schools

School Bridge School
Address 7001 W Addison

Unit 22321
Chicago, IL, 60634

Building ID 2380
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|--|-------------------|----------------|---|---------------|-------------------|---------|-----------------|--------------|---|-----------------|
| | | | | Plenum, SE Unexcavated. - 1929 | | | | | | | |
| 85 | Cardboard Pipe Insulation | 535 | LF | South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, A.H. Plenum & W. Tol., SE Unex. - 1929 | Assumed | TSI | Yes | 0 | LF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 86 | MJP on Cardboard Pipe Insulation | 60 | LF | South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, A.H. Plenum & W. Tol., SE Unex. - 1929 | Chrysotile | TSI | Yes | 0 | LF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 87 | MJP on Fiberglass Pipe Insulation | 500 | LF | Basement Electrical Room, 1st & 2nd Floor Boy's & Girl's Toilet Chases, Rm 300 Pipe Chase - 1929 | Assumed | TSI | Yes | 0 | LF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 88 | Aircell Duct Insulation | 500 | SF | South & SouthEast Unexcavated - 1929 | Chrysotile | TSI | Yes | 180 | SF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Remove |
| 89 | 1 x 1 ft Grooved Ceiling Tiles | 700 | SF | Rooms 111 and 112 | Assumed | MISC | Yes | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 89 A | 1 x 1 ft Grooved Ceiling Tile Mastic | 700 | SF | Rooms 111 and 112 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 90 | Terrazo | 4,500 | SF | 1926 Building: Entryways, 1st and 2nd Floor Corridors, Gym Stairs, Stairwells, Room 300, 107 Wardrobe, Stage and Stairs | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 91 A | Carpet Mastic | 1,600 | SF | Rooms 110 and 213, Office and 2nd Floor Counselor's Office | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 92 | 12"x12" Blue VFT | 700 | SF | 1st and 2nd Floor Corridors (Building 1926) | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 93 | 12"x12" Blue Mastic | 700 | SF | 1st and 2nd Floor Corridors (Building 1926) | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 94 | Blown-In Insulation on Duct Work | 2,500 | SF | Attic | Assumed | MISC | Yes | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 95 | 12"x12" White w/gray streaks VFT | 3,200 | SF | Rooms 001-004 including the closets and the hallway in the MODULAR | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 96 | 12"x12" White w/gray streaks Mastic | 3,200 | SF | Rooms 001-004 including the closets and the Hallway in the MODULAR | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 97 | Beige w/brown streaks Linoleum Flooring | 280 | SF | Boy's and Girl's Bathrooms in the MODULAR | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 98 | Beige w/brown streaks Linoleum Flooring Mastic | 280 | SF | Boy's and Girl's Washrooms in the MODULAR | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |
| 99 | Texture Drywall Ceiling | 280 | SF | Boy's and Girl's Washrooms in the MODULAR | Assumed | MISC | Yes | 0 | SF | 6 ACBM with the potential for damage | Follow O&M Plan |

Chicago Public Schools

School Bridge School
Address 7001 W Addison

Unit 22321
Chicago, IL, 60634

Building ID 2380
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.
2942 W. Van Buren Street
Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

| | |
|------------------------------------|--------------|
| Review Date | 7/14/2022 |
| Manager Planner Name | Arturo Saenz |
| 100-04019 | 5/15/2023 |
| Manager IDPH License No/Expiration | |

| HA Number | Management Comments |
|-----------|-------------------------|
| 01 | repair damaged ACM ASAP |
| 02 | Repair Damaged ACM ASAP |
| 03 | Repair Damaged ACM |
| 04 | Repair Damaged ACM ASAP |
| 05 | Repair Damaged ACM ASAP |
| 06 | Repair Damaged ACM ASAP |
| 07 | |

Chicago Public Schools

School Bridge School
Address 7001 W Addison

Unit 22321
 Chicago, IL, 60634

Building ID 2380
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|---------------------------------------|
| 08 | Repair Damaged ACM |
| 09 | Repair damaged ACM ASAP |
| 10 | Repair Damaged ACM |
| 100 | |
| 101 | |
| 102 | |
| 103 | |
| 103A | |
| 104 | |
| 104A | |
| 105 | |
| 105A | |
| 106 | |
| 107 | |
| 108 | |
| 109 | |
| 11 | Remove Damaged ACM ASAP |
| 110 | |
| 111 | |
| 12 | Isolate Area, Remove Damaged ACM ASAP |
| 15 | Repair Damaged ACM ASAP |
| 16 | |
| 28 | |
| 31 | |
| 32 | |
| 33 | |
| 34 | |

Chicago Public Schools

School Bridge School
Address 7001 W Addison

Unit 22321
 Chicago, IL, 60634

Building ID 2380
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|-------------------------|
| 35 | |
| 36 | |
| 37 | remove damaged ACM asap |
| 38 | |
| 41 | |
| 42 | |
| 43 | |
| 44 | |
| 45 | |
| 46 | |
| 47 | |
| 48 | |
| 49 | |
| 50 | |
| 51 | |
| 52 | |
| 53 | |
| 54 | |
| 62 | |
| 64 | |
| 64 A | |
| 65 | |
| 66 | |
| 67 | |
| 68 | |
| 69 | |
| 70 | |

Chicago Public Schools

School Bridge School
Address 7001 W Addison

Unit 22321
 Chicago, IL, 60634

Building ID 2380
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|-------------------------|
| 71 | remove damaged ACM ASAP |
| 72 | remove damaged ACM ASAP |
| 73 | remove damaged ACM ASAP |
| 74 | remove damaged ACM ASAP |
| 75 | |
| 76 | |
| 77 | remove damaged ACM ASAP |
| 78 | |
| 79 | |
| 80 | |
| 81 | |
| 82 | |
| 83 | Repair Damaged ACM ASAP |
| 84 | Repair Damaged ACM ASAP |
| 85 | |
| 86 | |
| 87 | |
| 88 | Remove Damaged ACM ASAP |
| 89 | |
| 89 A | |
| 90 | |
| 91 A | |
| 92 | |
| 93 | |
| 94 | |
| 95 | |
| 96 | |

Chicago Public Schools

School Bridge School
Address 7001 W Addison

Unit 22321
Chicago, IL, 60634

Building ID 2380
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Specialty Consulting, Inc.

2942 W. Van Buren Street

Phone: (312) 319-7575

Fax: (312) 319-7580

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|---------------------|
| 97 | |
| 98 | |
| 99 | |

APPENDIX A

Assessment Sheets, Drawings and Photos

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Chicago Public Schools

Specialty Consulting, Inc.

2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **Hot Water Tank Lagging #1**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **Hot Water Tank Lagging #1**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **20** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:
repair damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **Hot Water Tank Lagging #2**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **175** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **Hot Water Tank Lagging #2**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **175** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Repair Damaged ACM ASAP

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **Boiler Lagging #1**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **Boiler Lagging #1**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:
Repair Damaged ACM

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **Boiler Lagging #2**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **Boiler Lagging #2**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Repair Damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **Header Insulation and Pipe Insulation (Mag Block)**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **260** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **Header Insulation and Pipe Insulation (Mag Block)**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **260** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **20** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:
Repair Damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
MATERIAL LOCATION: **Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **57** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Repair Damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **Gasket Material (Boiler #1 & #2)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **4** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **Gasket Material (Boiler #1 & #2)**
MATERIAL LOCATION: **Boiler Room - 1926**
MATERIAL QUANTITY: **4** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **269** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Repair Damaged ACM

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, & Unexcavated Areas, N & S Air tunnels - 1926**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
MATERIAL LOCATION: **Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, & Unexcavated Areas, N & S Air tunnels - 1926**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **60** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Repair damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACM**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
MATERIAL LOCATION: **Boiler Room, Mechanical Area, Tunnel, Unfinished Pipe Space, Unexcavated Areas and Air Tunnels (North and South) - 1926**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **6** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Repair Damaged ACM

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **100**
MATERIAL DESCRIPTION: **2'x2' White w/holes Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 001-004 including closets and the Hallway in the MODULAR**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **100**
MATERIAL DESCRIPTION: **2'x2' White w/holes Ceiling Tile**
MATERIAL LOCATION: **Rooms 001-004 including closets and the Hallway in the MODULAR**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **101**
MATERIAL DESCRIPTION: **Drywall System**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout MODULAR**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **101**
MATERIAL DESCRIPTION: **Drywall System**
MATERIAL LOCATION: **Throughout MODULAR**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **102**
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout MODULAR**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **102**
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Throughout MODULAR**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Aircell Duct Wrap**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Unexcavated Areas - 1926**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Aircell Duct Wrap**
MATERIAL LOCATION: **Unexcavated Areas - 1926**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **104** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:
Remove Damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Debris on Dirt Floor**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **NW, NE, Center, SW Unexcavated Areas - 1926**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Debris on Dirt Floor**
MATERIAL LOCATION: **NW, NE, Center, SW Unexcavated Areas - 1926**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **1200** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Isolate Area, Remove Damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Air Tunnel & Tunnel To Building, Mechanical Room, NW Unexcavated Area- 1926**

MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**
MATERIAL LOCATION: **Air Tunnel & Tunnel To Building, Mechanical Room, NW Unexcavated Area- 1926**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **6** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Repair Damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Run**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Mechanical Rm, Electrical Rm, Boiler Rm, Boys and Girls Toilet Pipe Chases- 1926**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Run**
MATERIAL LOCATION: **Mechanical Rm, Electrical Rm, Boiler Rm, Boys and Girls Toilet Pipe Chases- 1926**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **MJP E/F/V on Mag Block Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler Room & Tunnel To Building- 1926**

MATERIAL QUANTITY: **43**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **MJP E/F/V on Mag Block Pipe Insulation**
MATERIAL LOCATION: **Boiler Room & Tunnel To Building- 1926**
MATERIAL QUANTITY: **43** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12"x12" Brown w/ White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Cafeteria (Room 112) - 1926**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12"x12" Brown w/ White Streaks VFT**
MATERIAL LOCATION: **1st Floor Cafeteria (Room 112) - 1926**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12"x12" Brown w/ White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Cafeteria (Room 112) - 1926**

MATERIAL QUANTITY: **1400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12"x12" Brown w/ White Streaks VFT Mastic**
MATERIAL LOCATION: **1st Floor Cafeteria (Room 112) - 1926**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12'x12" White w/ Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st Floor Cafeteria (Room 112) - 1926**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12'x12" White w/ Brown Streaks VFT**
MATERIAL LOCATION: **1st Floor Cafeteria (Room 112) - 1926**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12"x12" White w/ Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Cafeteria (Room 112) - 1926**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12"x12" White w/ Brown Streaks VFT Mastic**
MATERIAL LOCATION: **1st Floor Cafeteria (Room 112) - 1926**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **9"x 9" White w/ Red Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 110 (under the carpet), MDF Room - 1926**
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **9"x 9" White w/ Red Streaks VFT**
MATERIAL LOCATION: **Room 110 (under the carpet), MDF Room - 1926**
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **9"x 9" White w/ Red Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 110 (under the carpet), MDF Room - 1926**
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **9"x 9" White w/ Red Streaks VFT Mastic**
MATERIAL LOCATION: **Room 110 (under the carpet), MDF Room - 1926**
MATERIAL QUANTITY: **550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **9"x9" Beige VFT**
HISTORICAL AHERA DAMAGE CATEGORY **4 Damaged or significantly damaged friable misc. ACBM**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 111 - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **9"x9" Beige VFT**
MATERIAL LOCATION: **Room 111 - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **10** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:
remove damaged ACM asap

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **9"x9" Beige VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 111 - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **9"x9" Beige VFT Mastic**
MATERIAL LOCATION: **Room 111 - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Dark Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 108 - 1926**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Dark Brown Streaks VFT**
MATERIAL LOCATION: **Room 108 - 1926**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Dark Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 108 - 1926**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Dark Brown Streaks VFT Mastic**
MATERIAL LOCATION: **Room 108 - 1926**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 108 - 1926**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Streaks VFT**
MATERIAL LOCATION: **Room 108 - 1926**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 108 - 1926**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Streaks VFT Mastic**
MATERIAL LOCATION: **Room 108 - 1926**
MATERIAL QUANTITY: **360** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12"x12" Off White VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 107 & Storage - 1926**

MATERIAL QUANTITY: **750**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12"x12" Off White VFT**
MATERIAL LOCATION: **Room 107 & Storage - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12"x12" Off White VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 107 & Storage - 1926**

MATERIAL QUANTITY: **750**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12"x12" Off White VFT Mastic**
MATERIAL LOCATION: **Room 107 & Storage - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **12"x12" Light Purple VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Room 107 & Storage - 1926**

MATERIAL QUANTITY: **750**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **12"x12" Light Purple VFT**
MATERIAL LOCATION: **Room 107 & Storage - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **12"x12" Light Purple VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 107 & Storage - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **12"x12" Light Purple VFT Mastic**
MATERIAL LOCATION: **Room 107 & Storage - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 106 - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT**
MATERIAL LOCATION: **Room 106 - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 106 - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT Mastic**
MATERIAL LOCATION: **Room 106 - 1926**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12"x12" Sand VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 104 - 1926**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12"x12" Sand VFT**
MATERIAL LOCATION: **Room 104 - 1926**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12"x12' Sand VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 104 - 1926**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12"x12' Sand VFT Mastic**
MATERIAL LOCATION: **Room 104 - 1926**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **9"x9" White w/ Blue Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 105 - 1926**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **9"x9" White w/ Blue Streaks VFT**
MATERIAL LOCATION: **Room 105 - 1926**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **9"x9" White w/ Blue Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 105 - 1926**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **9"x9" White w/ Blue Streaks VFT Mastic**
MATERIAL LOCATION: **Room 105 - 1926**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Lab Table Tops**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 106 - 1926**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Lab Table Tops**
MATERIAL LOCATION: **Room 106 - 1926**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **12" x 12" Cream with Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **First and Second Floor Corridors - 1926**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **12" x 12" Cream with Brown Streaks VFT**
MATERIAL LOCATION: **First and Second Floor Corridors - 1926**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64 A**
MATERIAL DESCRIPTION: **12" x 12" Cream with Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **First and Second Floor Corridors - 1926**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **64 A**
MATERIAL DESCRIPTION: **12" x 12" Cream with Brown Streaks VFT Mastic**
MATERIAL LOCATION: **First and Second Floor Corridors - 1926**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st & 2nd Floor Corridors - 1929**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT**
MATERIAL LOCATION: **1st & 2nd Floor Corridors - 1929**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st & 2nd Floor Corridors - 1929**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT Mastic**
MATERIAL LOCATION: **1st & 2nd Floor Corridors - 1929**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **12"x12" Tan w/ White Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 102 - 1929**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **12"x12" Tan w/ White Specks VFT**
MATERIAL LOCATION: **Room 102 - 1929**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **12"x12" Tan w/ White Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 102 - 1929**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **12"x12" Tan w/ White Specks VFT Mastic**
MATERIAL LOCATION: **Room 102 - 1929**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **12"x12" Off White w/ Tan Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 102 - 1929**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **12"x12" Off White w/ Tan Specks VFT**
MATERIAL LOCATION: **Room 102 - 1929**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **70**
MATERIAL DESCRIPTION: **12"x12" Off White w/ Tan Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 102 - 1929**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **70**
MATERIAL DESCRIPTION: **12"x12" Off White w/ Tan Specks VFT Mastic**
MATERIAL LOCATION: **Room 102 - 1929**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **71**
MATERIAL DESCRIPTION: **12"x12" Black VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage in auditorium**

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **71**
MATERIAL DESCRIPTION: **12"x12" Black VFT**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **15** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

remove damaged ACM ASAP

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **12"x12" Black VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **4 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage in auditorium**

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **12"x12" Black VFT Mastic**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **15** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

remove damaged ACM ASAP

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **12"x12" Dark Red VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage in auditorium**

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **12"x12" Dark Red VFT**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **15** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

remove damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **74**
MATERIAL DESCRIPTION: **12"x12" Dark Red VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage in auditorium**

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **74**
MATERIAL DESCRIPTION: **12"x12" Dark Red VFT Mastic**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **15** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

remove damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **75**
MATERIAL DESCRIPTION: **9"x18" Black VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **75**
MATERIAL DESCRIPTION: **9"x18" Black VFT**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **9"x18" Black VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Assembly Hall - 1929**

MATERIAL QUANTITY: **350**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **9"x18" Black VFT Mastic**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **9"x9" Black w/ White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **9"x9" Black w/ White Streaks VFT**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **50** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

remove damaged ACM ASAP

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **9"x9" Black w/ White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Assembly Hall - 1929**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **9"x9" Black w/ White Streaks VFT Mastic**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **9"x9" Dark Red w/ White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Assembly Hall - 1929**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **9"x9" Dark Red w/ White Streaks VFT**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **9"x9" Dark Red w/ White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Assembly Hall - 1929**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **9"x9" Dark Red w/ White Streaks VFT Mastic**
MATERIAL LOCATION: **Assembly Hall - 1929**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **81**
MATERIAL DESCRIPTION: **Carpet Mastic - REMOVED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:
DISTURBANCE POTENTIAL:
MATERIAL LOCATION: **Room 201 - 1929 - REMOVED**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:
COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **81**

MATERIAL DESCRIPTION: **Carpet Mastic - REMOVED**

MATERIAL LOCATION: **Room 201 - 1929 - REMOVED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **82**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout - 1929**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **82**

MATERIAL DESCRIPTION: **Hard Coat Plaster**

MATERIAL LOCATION: **Throughout - 1929**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **07/14/2022** _____

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 22321 BUIDLING ID: 2380
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: David Avila
SCHOOL NAME: Bridge School INSPECTION DATE: 6/21/2022
ADDRESS: 7001 W Addison IDPH LICENSE NO: 100-11093

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 83
MATERIAL DESCRIPTION: Aircell Pipe Insulation
HISTORICAL AHERA DAMAGE CATEGORY 1 Damaged or significantly damaged friable thermal system insulating ACBM
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW

MATERIAL LOCATION: South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, Assembly Hall Plenum, SE Unex. - 1929

MATERIAL QUANTITY: 1250 MATERIAL UNITS: LF

DAMAGE QUANTITY: DAMAGE UNITS: LF

COMMENTS:

Inspector's Signature:



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **83**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, Assembly Hall Plenum, SE Unex. - 1929**
MATERIAL QUANTITY: **1250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **60** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Repair Damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **84**
MATERIAL DESCRIPTION: **MJP on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, Assembly Hall Plenum, SE Unexcavated. - 1929**

MATERIAL QUANTITY: **145** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **84**
MATERIAL DESCRIPTION: **MJP on Aircell Pipe Insulation**
MATERIAL LOCATION: **South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, Assembly Hall Plenum, SE Unexcavated. - 1929**
MATERIAL QUANTITY: **145** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **21** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Repair Damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **85**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, A.H. Plenum & W. Tol., SE Unex. - 1929**

MATERIAL QUANTITY: **535** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **85**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
MATERIAL LOCATION: **South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, A.H. Plenum & W. Tol., SE Unex. - 1929**
MATERIAL QUANTITY: **535** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **86**
MATERIAL DESCRIPTION: **MJP on Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, A.H. Plenum & W. Tol., SE Unex. - 1929**

MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **86**
MATERIAL DESCRIPTION: **MJP on Cardboard Pipe Insulation**
MATERIAL LOCATION: **South: Air Tunnel, & Unex., Basement Store Rm, Elec. Rm, A.H. Plenum & W. Tol., SE Unex. - 1929**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **87**
MATERIAL DESCRIPTION: **MJP on Fiberglass Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Electrical Room, 1st & 2nd Floor Boy's & Girl's Toliet Chases, Rm 300 Pipe Chase - 1929**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **87**
MATERIAL DESCRIPTION: **MJP on Fiberglass Pipe Insulation**
MATERIAL LOCATION: **Basement Electrical Room, 1st & 2nd Floor Boy's & Girl's Toliet Chases, Rm 300 Pipe Chase - 1929**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **88**
MATERIAL DESCRIPTION: **Aircell Duct Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **South & SouthEast Unexcavated - 1929**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **88**
MATERIAL DESCRIPTION: **Aircell Duct Insulation**
MATERIAL LOCATION: **South & SouthEast Unexcavated - 1929**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **180** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:
Remove Damaged ACM ASAP

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **89**
MATERIAL DESCRIPTION: **1 x 1 ft Grooved Ceiling Tiles**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 111 and 112**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **89**
MATERIAL DESCRIPTION: **1 x 1 ft Grooved Ceiling Tiles**
MATERIAL LOCATION: **Rooms 111 and 112**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **89 A**
MATERIAL DESCRIPTION: **1 x 1 ft Grooved Ceiling Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 111 and 112**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **89 A**
MATERIAL DESCRIPTION: **1 x 1 ft Grooved Ceiling Tile Mastic**
MATERIAL LOCATION: **Rooms 111 and 112**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **90**
MATERIAL DESCRIPTION: **Terrazo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1926 Building: Entryways, 1st and 2nd Floor Corridors, Gym Stairs, Stairwells, Room 300, 107 Wardrobe, Stage and Stairs**

MATERIAL QUANTITY: **4500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **90**
MATERIAL DESCRIPTION: **Terrazo**
MATERIAL LOCATION: **1926 Building: Entryways, 1st and 2nd Floor Corridors, Gym Stairs, Stairwells, Room 300, 107 Wardrobe, Stage and Stairs**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **91 A**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 110 and 213, Office and 2nd Floor Counselor's Office**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **91 A**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Rooms 110 and 213, Office and 2nd Floor Counselor's Office**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **92**
MATERIAL DESCRIPTION: **12"x12" Blue VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st and 2nd Floor Corridors (Building 1926)**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **92**
MATERIAL DESCRIPTION: **12"x12" Blue VFT**
MATERIAL LOCATION: **1st and 2nd Floor Corridors (Building 1926)**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **93**
MATERIAL DESCRIPTION: **12"x12" Blue Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st and 2nd Floor Corridors (Building 1926)**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **93**
MATERIAL DESCRIPTION: **12"x12" Blue Mastic**
MATERIAL LOCATION: **1st and 2nd Floor Corridors (Building 1926)**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **94**
MATERIAL DESCRIPTION: **Blown-In Insulation on Duct Work**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Attic**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **94**
MATERIAL DESCRIPTION: **Blown-In Insulation on Duct Work**
MATERIAL LOCATION: **Attic**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **95**
MATERIAL DESCRIPTION: **12"x12" White w/gray streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 001-004 including the closets and the hallway in the MODULAR**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **95**
MATERIAL DESCRIPTION: **12"x12" White w/gray streaks VFT**
MATERIAL LOCATION: **Rooms 001-004 including the closets and the hallway in the MODULAR**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **96**
MATERIAL DESCRIPTION: **12"x12" White w/gray streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 001-004 including the closets and the Hallway in the MODULAR**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **96**
MATERIAL DESCRIPTION: **12"x12" White w/gray streaks Mastic**
MATERIAL LOCATION: **Rooms 001-004 including the closets and the Hallway in the MODULAR**
MATERIAL QUANTITY: **3200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **97**
MATERIAL DESCRIPTION: **Beige w/brown streaks Linoleum Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boy's and Girl's Bathrooms in the MODULAR**
MATERIAL QUANTITY: **280** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **97**
MATERIAL DESCRIPTION: **Beige w/brown streaks Linoleum Flooring**
MATERIAL LOCATION: **Boy's and Girl's Bathrooms in the MODULAR**
MATERIAL QUANTITY: **280** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **98**
MATERIAL DESCRIPTION: **Beige w/brown streaks Linoleum Flooring Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boy's and Girl's Washrooms in the MODULAR**

MATERIAL QUANTITY: **280** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **98**
MATERIAL DESCRIPTION: **Beige w/brown streaks Linoleum Flooring Mastic**
MATERIAL LOCATION: **Boy's and Girl's Washrooms in the MODULAR**
MATERIAL QUANTITY: **280** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **99**
MATERIAL DESCRIPTION: **Texture Drywall Ceiling**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boy's and Girl's Washrooms in the MODULAR**

MATERIAL QUANTITY: **280** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUIDLING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **99**
MATERIAL DESCRIPTION: **Texture Drywall Ceiling**
MATERIAL LOCATION: **Boy's and Girl's Washrooms in the MODULAR**
MATERIAL QUANTITY: **280** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **103A**
MATERIAL DESCRIPTION: **12x12 Gray w/ Specks VFT Mastic**
MATERIAL LOCATION: **105, 107, 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **103A**
MATERIAL DESCRIPTION: **12x12 Gray w/ Specks VFT Mastic**
MATERIAL LOCATION: **105, 107, 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **107**
MATERIAL DESCRIPTION: **12x12 Blue w/ Light Blue and White Streaks VFT Mastic**
MATERIAL LOCATION: **Room 105, 112**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **107**

MATERIAL DESCRIPTION: **12x12 Blue w/ Light Blue and White Streaks VFT Mastic**

MATERIAL LOCATION: **Room 105, 112**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

| | | | | | |
|--------------|------------------------|------------------|-------------|--------------|------|
| LEA NAME: | Chicago Public Schools | UNIT NUMBER: | 22321 | BUILDING ID: | 2380 |
| CITY/STATE: | Chicago, Illinois | AHERA INSPECTOR: | David Avila | | |
| SCHOOL NAME: | Bridge School | INSPECTION DATE: | 6/21/2022 | | |
| ADDRESS: | 7001 W Addison | IDPH LICENSE NO: | 100-11093 | | |

INFORMATION FROM CURRENT INSPECTION

| | | | | |
|------------------------|---|-----------------|----|--|
| HOMOGENEOUS AREA: | 109 | | | |
| MATERIAL DESCRIPTION: | 12x12 Gray w/ Blue and White Streaks VFT Mastic | | | |
| MATERIAL LOCATION: | Room 105, 112 | | | |
| MATERIAL QUANTITY: | 400 | MATERIAL UNITS: | SF | |
| MATERIAL CATEGORY: | MISC | FRIABLE: | No | |
| ASBESTOS TYPE: | Assumed | | | |
| DISTURBANCE POTENTIAL: | | CONDITION: | | |
| AHERA DAMAGE CATEGORY: | 6 ACBM with the potential for damage | | | |
| ACCESSIBILITY: | | DAMAGE REASON: | | |
| | | DAMAGE REASON: | | |
| DAMAGE QUANTITY: | 0 | DAMAGE REASON: | | |
| | | DAMAGE UNITS: | SF | |
| COMMENTS: | | | | |

Inspector's Signature:



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **109**
MATERIAL DESCRIPTION: **12x12 Gray w/ Blue and White Streaks VFT Mastic**
MATERIAL LOCATION: **Room 105, 112**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **12x12 Blue w/ Specks VFT**
MATERIAL LOCATION: **105, 107, 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **12x12 Blue w/ Specks VFT**
MATERIAL LOCATION: **105, 107, 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **105A**
MATERIAL DESCRIPTION: **12x12 Blue w/ Specks VFT Mastic**
MATERIAL LOCATION: **105, 107, 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc.
2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **105A**
MATERIAL DESCRIPTION: **12x12 Blue w/ Specks VFT Mastic**
MATERIAL LOCATION: **105, 107, 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **104A**
MATERIAL DESCRIPTION: **12x12 Peach w/ Specks VFT Mastic**
MATERIAL LOCATION: **105, 107, 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **104A**
MATERIAL DESCRIPTION: **12x12 Peach w/ Specks VFT Mastic**
MATERIAL LOCATION: **105, 107, 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **07/14/2022** _____

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **12x12 Blue w/ Light Blue and White Streaks VFT**
MATERIAL LOCATION: **Room 105, 112**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **12x12 Blue w/ Light Blue and White Streaks VFT**
MATERIAL LOCATION: **Room 105, 112**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **111**
MATERIAL DESCRIPTION: **12x12 Tan w/ Brown and Blue Streaks VFT Mastic**
MATERIAL LOCATION: **Room 105, 112**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **111**
MATERIAL DESCRIPTION: **12x12 Tan w/ Brown and Blue Streaks VFT Mastic**
MATERIAL LOCATION: **Room 105, 112**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **108**
MATERIAL DESCRIPTION: **12x12 Gray w/ Blue and White Streaks VFT**
MATERIAL LOCATION: **Room 105, 112**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **06/21/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **108**
MATERIAL DESCRIPTION: **12x12 Gray w/ Blue and White Streaks VFT**
MATERIAL LOCATION: **Room 105, 112**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **110**
MATERIAL DESCRIPTION: **12x12 Tan w/ Brown and Blue Streaks VFT**
MATERIAL LOCATION: **Room 105, 112**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **110**
MATERIAL DESCRIPTION: **12x12 Tan w/ Brown and Blue Streaks VFT**
MATERIAL LOCATION: **Room 105, 112**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **07/14/2022**

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **103**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Specks VFT**
MATERIAL LOCATION: **105, 107, and 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **103**
MATERIAL DESCRIPTION: **12"x12" Gray w/ Specks VFT**
MATERIAL LOCATION: **105, 107, and 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: 07/14/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**
SCHOOL NAME: **Bridge School** INSPECTION DATE: **6/21/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **12x12 Peach w/ Specks VFT**
MATERIAL LOCATION: **105, 107, 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 06/21/2022

Chicago Public Schools

Specialty Consulting, Inc. 2022 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22321** BUILDING ID: **2380**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Arturo Saenz**
SCHOOL NAME: **Bridge School** REVIEW DATE: **7/14/2022**
ADDRESS: **7001 W Addison** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **12x12 Peach w/ Specks VFT**
MATERIAL LOCATION: **105, 107, 112**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  _____ Date: **07/14/2022** _____

APPENDIX B

Inspector and Management Planner Licenses



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

David Avila

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/9/2022

Exam Date: 9/9/2022

Expiration Date: 9/9/2023

Certificate Number: BIR2209092141


Kathy DeSalvo, Director



OCCUPATIONAL TRAINING & SUPPLY, INC.

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

David Avila

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/10/2021

Exam Date: 9/10/2021

Expiration Date: 9/10/2022

Certificate Number: BIR2109101942

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

2/28/2022



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 11093

ISSUED
2/28/2022

EXPIRES
05/15/2023

DAVID AVILA
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health





ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11093

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

| | | | | | |
|--|------------------------------------|--------------------------------------|--|--|--------------------------|
|  <p>ASBESTOS PROFESSIONAL LICENSE</p> | | | <p>ENDORSEMENTS</p> | | <p>TC EXPIRES</p> |
| <p>ID NUMBER 100 - 11093</p> | <p>ISSUED 2/28/2022</p> | <p>EXPIRES 05/15/2023</p> | <p>INSPECTOR</p> | | <p>9/10/2022</p> |
| <p>DAVID AVILA 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health</p>  | | | <p>PROJECT MANAGER AIR SAMPLING PROFESSIONAL</p> | | <p>9/11/2022</p> |
| | | | <p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p> | | |

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB



Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Arturo Saenz

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: BIR2111012562

A handwritten signature in cursive script that reads 'Kathy DeSalvo'.

Kathy DeSalvo, Director



Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that
Arturo Saenz

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/1/2021

Exam Date: 11/1/2021

Expiration Date: 11/1/2022

Certificate Number: MPR2111012583

A handwritten signature in cursive script that reads 'Kathy DeSalvo'.

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois

ARTURO SAENZ
2942 W VAN BUREN ST
CHICAGO, IL 60612

2/28/2022



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 04019

ISSUED
2/28/2022

EXPIRES
05/15/2023

ARTURO SAENZ
2942 W VAN BUREN ST
CHICAGO, IL 60612

Environmental Health





ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 04019

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

| | | | | |
|---|---------------------|---|--|---|
|  ASBESTOS PROFESSIONAL LICENSE | | | ENDORSEMENTS INSPECTOR MANAGEMENT PLANNER AIR SAMPLING PROFESSIONAL Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate. | TC EXPIRES 11/1/2022 11/1/2022 |
| ID NUMBER 100 - 04019 ARTURO SAENZ 2942 W VAN BUREN ST CHICAGO, IL 60612 Environmental Health | ISSUED 2/28/2022 | EXPIRES 05/15/2023  | | |

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH. IMPROVING LIVES

Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

| | CODE | KEY |
|--------------------------|-------------|--|
| MATERIAL | | |
| | ACBM | Asbestos Containing Building Materials |
| MATERIAL CATEGORY | | |
| | MISC | Miscellaneous |
| | SURF | Surfacing |
| | TSI | Thermal System Insulation |
| MATERIAL UNITS | | |
| | LF | Linear Feet |
| | SF | Square Feet |
| | CF | Cubic Feet |
| DAMAGE TYPE | | |
| | Loc | Localized |
| | Dist | Distributed |