

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2443
SCHOOL NAME: Alcott High School for the Humanities
ADDRESS OF SCHOOL: 2957 N. Hoyne Avenue
CITY: Chicago, IL, 60618

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **4/2/2010**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 5/12/2013 ENROLLMENT 0

IDPH INSPECTOR LICENSE NUMBER: 100-18350

IDPH LICENSED INSPECTOR NAME (Please Print): Joseph Hennigan

IDPH MP LICENSE NUMBER: 100-07342

IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



5/12/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Alcott High School for the Humanities

2957 N. Hoyne Avenue
Chicago, IL, 60618

Unit: 25281
Building ID: 5790

IDPH ID Number: 14-016-2990-2443

REPORT DATE:

Sunday, May 12, 2013

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone (312) 733-6262

Fax (312) 733-5612

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

April 14, 2013

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

GSG Consultants, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1,2,6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 25281 Region: 02 IDPH ID: 14-016-2990-2443

School: Alcott High School for the Humanities Building ID: 5790

Address: 2957 N. Hoyne Avenue
Chicago, IL, 60618

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 5/12/2013

Inspector: Joseph Hennigan Inspector IDPH License: 100-18350
Management Planner: Jigar Shah Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 733-6262

Sincerely,
GSG Consultants, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: April 14, 2013

RE: Alcott High School for the Humanities, Unit 25281
2957 N. Hoyne Avenue
Chicago, IL, 60618

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Alcott High School for the Humanities , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Alcott High School for the Humanities, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Alcott High School for the Humanities
Address: 2957 N. Hoyne Avenue
IDPH ID: 14-016-2990-2443
Contact: Unit: 25281 Chicago, IL, 60618
Building ID: 5790
Region: 02
Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: No of Floors:
Current Occupancy: 0

3. LEA Designated Person

Contact: Ms. Lynn Crivello
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603
Phone: (773) 553-3113


4. Managing Environmental Consultant

MEC: GSG Consultants, Inc.
Contact: Arturo Saenz
Address 855 W. Adams St., Ste. 200
Phone: (312) 733-6262
Fax: (312) 733-5612

5. Inspector

Inspector Name: Joseph Hennigan


Inspector IDPH license # 100-18350

Signature: 
Date: 4/14/2013

6. Management Planner

Management Planner Name: Jigar Shah


Management Planner IDPH license # 100-07342

Signature: 
Date: 5/12/2013

7. Review Date: 5/12/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 5/12/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

GSG Consultants, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Alcott High School for the Humanities. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 5790:

01	Hard Coat Plaster
02B	1'x1' New Wormy Design White Ceiling Tile
02C	1'x1' Small Hole Ceiling Tile
05	2'x4' Ceiling Tile
06	12"x12" Beige w/ Brown Streaks VFT (ABATED 7/23/09)
10	12"x12" Beige w/ Brown Streaks VFT Mastic (ABATED 7/23/09)
13	1'x1' White Ceiling Tile Mastic
24	12"x12" Pink Grain VFT
25	12"x12" Pink Grain VFT Mastic

26	2'x2' Dot Ceiling Tile
28	Interior Window Glaze
29	Light Brown Linoleum
30	Light Brown Linoleum Mastic

B. The following new homogenous areas have been identified for Building 5790:

42	12"x12" Tan w/Light Brown and White Streaks VFT
43	12"x12" Tan w/Light Brown and White Streaks VFT (Mastic)
44	Linoleum White w/Orange and Gray Specks
45	Linoleum White w/Orange and Gray Specks (Mastic)
46	Black Vinyl Lab Table and Countertops
47	Lab Black Vinyl Sinks
48	Lab Fume Hood
49	12"x12" Cream w/Tan Streaks VFT
50	12"x12" Cream w/Tan Streaks VFT (Mastic)
51	Linoleum Gray
52	Linoleum Gray (Mastic)
53	White Vinyl Wall Sheeting
54	White Vinyl Wall Sheeting Adhesive
55	Gray Vinyl Baseboard
56	Gray Vinyl Baseboard (Mastic)
57	Gray Sink Spray-On Undercoating
58	Drywall
59	Drywall Compound
60	Boiler Insulation in Boilers 1 and 2
61	Boiler Cloth Rope Insulation
62	Duct Insulation
63	Gray Rubber Skid Proof Flooring
64	Gray Rubber Skid Proof Floor (Mastic)

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01	Hard Coat Plaster
02	1'x1' Old Wormy Design White Ceiling Tile
02B	1'x1' New Wormy Design White Ceiling Tile
02C	1'x1' Small Hole Ceiling Tile
05	2'x4' Ceiling Tile
13	1'x1' White Ceiling Tile Mastic
24	12"x12" Pink Grain VFT
25	12"x12" Pink Grain VFT Mastic
26	2'x2' Dot Ceiling Tile
28	Interior Window Glaze
29	Light Brown Linoleum
30	Light Brown Linoleum Mastic
31	12 x 12 inch Black w/White Streaks VFT
31 A	12 x 12 inch Black w/White Streaks VFT Mastic
32	Brown/White Checked Linoleum (NOT OBSERVED)
32A	Brown/White Checked Linoleum Mastic (NOT OBSERVED)
33	12 x 12 White with Grey and White Streaks Floor Tile
34	12 x 12 White with Grey and White Streaks Floor Tile Mastic
35	12 x 12 Black with White Streaks Floor Tile
35A	12 x 12 Black with White Streaks Floor Tile Mastic
36	12 x 12 Brown with White Streaks Floor Tile
37	12 x 12 Brown with White Streaks Floor Tile Mastic
38	Black Linoleum
39	Black Linoleum Adhesive
40	Ceramic Floor Tile Grout
41	Ceramic Floor Tile Adhesive
42	12"x12" Tan w/Light Brown and White Streaks VFT
43	12"x12" Tan w/Light Brown and White Streaks VFT (Mastic)
44	Linoleum White w/Orange and Gray Specks
45	Linoleum White w/Orange and Gray Specks (Mastic)
46	Black Vinyl Lab Table and Countertops
47	Lab Black Vinyl Sinks
48	Lab Fume Hood
49	12"x12" Cream w/Tan Streaks VFT
50	12"x12" Cream w/Tan Streaks VFT (Mastic)
51	Linoleum Gray
52	Linoleum Gray (Mastic)
53	White Vinyl Wall Sheeting
54	White Vinyl Wall Sheeting Adhesive

55	Gray Vinyl Baseboard
56	Gray Vinyl Baseboard (Mastic)
57	Gray Sink Spray-On Undercoating
58	Drywall
59	Drywall Compound
60	Boiler Insulation in Boilers 1 and 2
61	Boiler Cloth Rope Insulation
62	Duct Insulation
63	Gray Rubber Skid Proof Flooring
64	Gray Rubber Skid Proof Floor (Mastic)

The following areas were deemed to be inaccessible:

13	1'x1' White Ceiling Tile Mastic
34	12 x 12 White with Grey and White Streaks Floor Tile Mastic
35A	12 x 12 Black with White Streaks Floor Tile Mastic
37	12 x 12 Brown with White Streaks Floor Tile Mastic
39	Black Linoleum Adhesive
41	Ceramic Floor Tile Adhesive

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Joseph Hennigan, IDPH License # 100-18350. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Alcott High School for the Humanities Building 5790 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Alcott High School for the Humanities Unit 25281 Building ID 5790

Address 2957 N. Hoyne Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Hard Coat Plaster	10,000	SF	Throughout building	ASSUMED	SURFACE	N	NONE	0		Yes	ACBM with the potential for damage		LOW
02	1'x1' Old Wormy Design White Ceiling Tile	3,000	SF	Throughout: 101, 102, 104, 108,111, 205, 208, 302, 307, 308, Bathrooms 1st - 3rd Floors	ASSUMED	MISC	Y	NONE	0		No	ACBM with potential for significant damage		MODERATE
02B	1'x1' New Wormy Design White Ceiling Tile	3,500	SF	Throughout	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		MODERATE
02C	1'x1' Small Hole Ceiling Tile	3,500	SF	Throughout	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		MODERATE
05	2'x4' Ceiling Tile	3,500	SF	Basement Kitchen, Principal's Office, Basement East & West Lunch Rooms, 108, 111, 208	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		MODERATE
06	12"x12" Beige w/ Brown Streaks VFT (ABATED 7/23/09)	2,500	SF	Throughout	CHR	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
10	12"x12" Beige w/ Brown Streaks VFT Mastic (ABATED 7/23/09)	2,500	SF	Throughout	CHR	MISC	N	NONE	0		Yes	ACBM with the potential for damage		MODERATE
13	1'x1' White Ceiling Tile Mastic	10,500	SF	Throughout	ASSUMED	MISC	Y	NONE	0		Yes	ACBM with the potential for damage		LOW
14	12"x12" Pink VFT (ABATED 2009/10 CIP)			1st Floor Girls Washroom by Room 107										
15	12"x12" Pink VFT Mastic (ABATED 2009/10 CIP)			1st Floor Girls Washroom by Room 107										
16	12"x12" Brown Grain VFT (ABATED 2009/10 CIP)			Principal's office & bathroom, Rooms #106, #104, and 2nd Floor Men's Teacher Toilet, Main Office										
17	12"x12" Brown Grain VFT Mastic (ABATED 2009/10 CIP)			Principal's office & bathroom, Rooms #106, #104, and 2nd Floor Men's Teacher Toilet, Main Office										
18	12"x12" White w/ Yellow Streaks VFT (ABATED 2009/10 CIP)			1st Floor Hallway										
19	12"x12" White w/ Yellow Streaks VFT Mastic (ABATED 2009/10 CIP)			1st Floor Hallway										
20	12"x12" Dark Brown VFT (ABATED 2009/10 CIP)			Kitchen Manager's Office, Basement		MISC			0					

Chicago Public Schools

School Alcott High School for the Humanities Unit 25281 Building ID 5790

Address 2957 N. Hoyne Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Lunch Room (East), Basement Room 003, Kitchen										
21	12"x12" Dark Brown VFT Mastic (ABATED 2009/10 CIP)			Kitchen Manager's Office, Basement Lunch Room (East), Basement Room 003, Kitchen		MISC		None	0					Low
22	12"x12" White with Red Streaks VFT (ABATED 1/30/10)			Lunch Room (West), & Basement Nurse's Room		MISC								
23	12"x12" White w/ Red Streaks VFT Mastic (ABATED 1/3/10)			Lunch Room (West), & Basement Nurse's Room										
24	12"x12" Pink Grain VFT	100	SF	Teacher's Lounge Bathroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
25	12"x12" Pink Grain VFT Mastic	100	SF	Teacher's Lounge Bathroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
26	2'x2' Dot Ceiling Tile	4,200	SF	Room #201, 202, 203, 204, 206, 207, and 208	ASSUMED	MISC	Y	DIST	5		Yes	ACBM with potential for significant damage	10	LOW
28	Interior Window Glaze	10,000	LF	Interior Windows	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
29	Light Brown Linoleum	350	SF	Main Office Storage Room, 111	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
30	Light Brown Linoleum Mastic	350	SF	Main Office Storage Room, 111	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
31	12 x 12 inch Black w/White Streaks VFT	1,500	SF	1st floor corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31 A	12 x 12 inch Black w/White Streaks VFT Mastic	1,500	SF	1st Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	Brown/White Checked Linoleum (NOT OBSERVED)	1,000	SF	Stage Assembly Hall	ASSUMED	MISC					No			
32A	Brown/White Checked Linoleum Mastic (NOT OBSERVED)	1,000	SF	Stage Assembly Hall	ASSUMED	MISC					No			
33	12 x 12 White with Grey and White Streaks Floor Tile	5,600	SF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12 x 12 White with Grey and White Streaks Floor Tile Mastic	5,600	SF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	12 x 12 Black with White Streaks Floor Tile	1,500	SF	1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35A	12 x 12 Black with White Streaks Floor Tile Mastic	1,500	SF	1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	12 x 12 Brown with White Streaks Floor	5,600	SF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Alcott High School for the Humanities Unit 25281 Building ID 5790

Address 2957 N. Hoyne Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Tile											potential for damage		
37	12 x 12 Brown with White Streaks Floor Tile Mastic	5,600	SF	Throughout	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	Black Linoleum	1,000	SF	2nd and 3rd Floor Stairwells	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	Black Linoleum Adhesive	1,000	SF	2nd and 3rd Floor Stairwells	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	Ceramic Floor Tile Grout	80	SF	2nd Floor Men's Washroom	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
41	Ceramic Floor Tile Adhesive	80	SF	2nd Floor Men's Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12"x12" Tan w/Light Brown and White Streaks VFT	5,000	SF	1st, 2nd, 3rd Floor Corridors	ASSUMED	MISC	N	NONE	0					LOW
43	12"x12" Tan w/Light Brown and White Streaks VFT (Mastic)	5,000	SF	1st, 2nd, 3rd Floor Corridors	ASSUMED	MISC	N	NONE	0					LOW
44	Linoleum White w/Orange and Gray Specks	950	SF	Rooms 206b, 208	ASSUMED	MISC	N	NONE	0					
45	Linoleum White w/Orange and Gray Specks (Mastic)	950	SF	Rooms 206b, 208	ASSUMED	MISC	N	NONE	0					LOW
46	Black Vinyl Lab Table and Countertops	250	SF	Lab 208	ASSUMED	MISC	N	NONE	0					LOW
47	Lab Black Vinyl Sinks	50	SF	Lab 208	ASSUMED	MISC	N	NONE	0					LOW
48	Lab Fume Hood	40	SF	Lab 208	ASSUMED	MISC	N	NONE	0					LOW
49	12"x12" Cream w/Tan Streaks VFT	180	SF	1st Floor Corridor	ASSUMED	MISC	N	NONE	0					LOW
50	12"x12" Cream w/Tan Streaks VFT (Mastic)	180	SF	1st Floor Corridor	ASSUMED	MISC	N	NONE	0					LOW
51	Linoleum Gray	750	SF	Basement Vestibules, Stairway Landings, Corridors, and Offices	ASSUMED	MISC	N	NONE	0					LOW
52	Linoleum Gray (Mastic)	750	SF	Basement Vestibules, Stairway Landings, Corridors, And Offices	ASSUMED	MISC	N	NONE	0					LOW
53	White Vinyl Wall Sheeting	1,500	SF	Throughout Basement Lower Walls in Lunchrooms, Vestibules, Corridors, and Storage Rooms	ASSUMED	MISC	N	NONE	0					LOW
54	White Vinyl Wall Sheeting Adhesive	1,500	SF	Throughout Basement Lower Walls in Lunchrooms,	ASSUMED	MISC	N	NONE	0					LOW

Chicago Public Schools

School Alcott High School for the Humanities Unit 25281 Building ID 5790

Address 2957 N. Hoyne Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Vestibules, Corridors, and Storage Rooms										
55	Gray Vinyl Baseboard	150	LF	Rooms 007, 012, 013, 017, Lunchroom	ASSUMED	MISC	N	NONE	0					LOW
56	Gray Vinyl Baseboard (Mastic)	150	LF	Rooms 007, 012, 013, 017, Lunchroom	ASSUMED	MISC	N	NONE	0					LOW
57	Gray Sink Spray-On Undercoating	15	SF	Room 007	ASSUMED	MISC	N	NONE	0					LOW
58	Drywall	7,500	SF	Throughout Basement, Corridors, and Offices	ASSUMED	MISC	N	NONE	0					MODERATE
59	Drywall Compound	1	SF	Throughout Basement, Corridors, and Offices	ASSUMED	MISC	N	NONE	0					MODERATE
60	Boiler Insulation in Boilers 1 and 2	90	SF	Boiler Room - Main Boilers	ASSUMED	MISC	Y	NONE	0					LOW
61	Boiler Cloth Rope Insulation	60	LF	Main Boiler Room - Boilers 1 and 2	ASSUMED	MISC	N	NONE	0					LOW
62	Duct Insulation	200	SF	Boiler Room	ASSUMED	MISC	N	NONE	0					LOW
63	Gray Rubber Skid Proof Flooring	240	SF	Top of Corridor Landings 1st, 2nd, 3rd Floor	ASSUMED	MISC	N	NONE	0					LOW
64	Gray Rubber Skid Proof Floor (Mastic)	240	SF	Top of Corridor Landings at Stairwells 1st, 2nd, 3rd Floor	ASSUMED	MISC	N	NONE	0					LOW
C	MJP E/F/V on Fiberglass Pipe Insulation (ABATED)	300	LF	Throughout Basement (See Hatching Maps)	CHR	TSI					No			
D	Cardboard Pipe Insulation (ABATED)	50	LF	Throughout Basement (See Hatching Maps)	CHR	TSI					No			
E	MJP on Cardboard Pipe Insulation (ABATED)	2	LF	Basement Girls Bathroom Foyer	CHR	TSI					No			
F	Aircell Pipe Insulation	68	LF	Boiler Room, Corridor Basement, and Air Tunnel	CHR	TSI	Y	NONE	0		No	ACBM with potential for significant damage		LOW
G	MJP E/F/V on Aircell Pipe Insulation	9	EA	Boiler Room and Air Tunnel Basement	CHR	TSI	Y	DIST	3		No	Damaged or significantly damaged friable thermal system	3	LOW

Chicago Public Schools

School Alcott High School for the Humanities Unit 25281 Building ID 5790

Address 2957 N. Hoyne Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												insulating ACBM		

Chicago Public Schools

School Alcott High School for the Humanities Unit 25281 Building ID 5790

Address 2957 N. Hoyne Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 4/14/2013
Inspector Name Joseph Hennigan
100-18350 5/15/2013
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
02B	
02C	
05	
06	Except-This VFT remains in Stairwell Landings 1st, 2nd, 3rd Floors.
10	Except-This VFT remains in Stairwell Landings 1st, 2nd, 3rd Floors.
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	Damage Distributed Throughout
28	
29	
30	

Chicago Public Schools

School Alcott High School for the Humanities Unit 25281 Building ID 5790
Address 2957 N. Hoyne Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
31	
31 A	
32	
32A	
33	
34	
35	
35A	
36	
37	
38	
39	
40	
41	
42	New Installation
43	New Installation
44	New Installation
45	New Installation
46	New Installation
47	New Installation
48	New Installation
49	New Installation
50	New Installation
51	New Installation
52	New Installation
53	
54	
55	
56	

Chicago Public Schools

School Alcott High School for the Humanities **Unit** 25281 **Building ID** 5790

Address 2957 N. Hoyne Avenue **Region** 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
57	
58	New Installation
59	New Installation
60	
61	
62	
63	New Installation 2009/10 CIP
64	New Installation 2009/10 CIP
C	
D	
E	
F	
G	

Table II

Management Planner's Review

Chicago Public Schools

School Alcott High School for the Humanities

Unit 25281

Building ID 5790

Address 2957 N. Hoyne Avenue

Chicago, IL, 60618

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Hard Coat Plaster	10,000	SF	Throughout building	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
02	1'x1' Old Wormy Design White Ceiling Tile	3,000	SF	Throughout: 101, 102, 104, 108,111, 205, 208, 302, 307, 308, Bathrooms 1st -3rd Floors	Assumed	MISC	Yes	0	SF	5 ACBM with potential for significant damage	Operations and Maintenance
02B	1'x1' New Wormy Design White Ceiling Tile	3,500	SF	Throughout	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
02C	1'x1' Small Hole Ceiling Tile	3,500	SF	Throughout	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
05	2'x4' Ceiling Tile	3,500	SF	Basement Kitchen, Principal's Office, Basement East & West Lunch Rooms, 108, 111, 208	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
06	12"x12" Beige w/ Brown Streaks VFT (ABATED 7/23/09)	2,500	SF	Throughout	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
10	12"x12" Beige w/ Brown Streaks VFT Mastic (ABATED 7/23/09)	2,500	SF	Throughout	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
13	1'x1' White Ceiling Tile Mastic	10,500	SF	Throughout	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
14	12"x12" Pink VFT (ABATED 2009/10 CIP)			1st Floor Girls Washroom by Room 107							
15	12"x12" Pink VFT Mastic (ABATED 2009/10 CIP)			1st Floor Girls Washroom by Room 107							
16	12"x12" Brown Grain VFT (ABATED 2009/10 CIP)			Principal's office & bathroom, Rooms #106, #104, and 2nd Floor Men's Teacher Toilet, Main Office							
17	12"x12" Brown Grain VFT Mastic (ABATED 2009/10 CIP)			Principal's office & bathroom, Rooms #106, #104, and 2nd Floor Men's Teacher Toilet, Main Office							
18	12"x12" White w/ Yellow Streaks VFT (ABATED 2009/10 CIP)			1st Floor Hallway							
19	12"x12" White w/ Yellow Streaks VFT Mastic (ABATED 2009/10 CIP)			1st Floor Hallway							
20	12"x12" Dark Brown VFT (ABATED 2009/10 CIP)			Kitchen Manager's Office, Basement Lunch Room (East), Basement Room 003, Kitchen		MISC		0			
21	12"x12" Dark Brown VFT Mastic (ABATED 2009/10 CIP)			Kitchen Manager's Office, Basement Lunch Room (East), Basement Room 003, Kitchen		MISC		0			
22	12"x12" White with Red Streaks VFT (ABATED 1/30/10)			Lunch Room (West), & Basement Nurse's Room		MISC					
23	12"x12" White w/ Red Streaks VFT Mastic			Lunch Room (West), & Basement							

Chicago Public Schools

School Alcott High School for the Humanities

Unit 25281

Building ID 5790

Address 2957 N. Hoyne Avenue

Chicago, IL, 60618

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
	(ABATED 1/3/10)			Nurse's Room							
24	12"x12" Pink Grain VFT	100	SF	Teacher's Lounge Bathroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
25	12"x12" Pink Grain VFT Mastic	100	SF	Teacher's Lounge Bathroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
26	2'x2' Dot Ceiling Tile	4,200	SF	Room #201, 202, 203, 204, 206, 207, and 208	Assumed	MISC	Yes	5	SF	5 ACBM with potential for significant damage	Remove
28	Interior Window Glaze	10,000	LF	Interior Windows	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
29	Light Brown Linoleum	350	SF	Main Office Storage Room, 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
30	Light Brown Linoleum Mastic	350	SF	Main Office Storage Room, 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
31	12 x 12 inch Black w/White Streaks VFT	1,500	SF	1st floor corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
31 A	12 x 12 inch Black w/White Streaks VFT Mastic	1,500	SF	1st Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
32	Brown/White Checked Linoleum (NOT OBSERVED)	1,000	SF	Stage Assembly Hall	Assumed	MISC			SF		Operations and Maintenance
32A	Brown/White Checked Linoleum Mastic (NOT OBSERVED)	1,000	SF	Stage Assembly Hall	Assumed	MISC			SF		Operations and Maintenance
33	12 x 12 White with Grey and White Streaks Floor Tile	5,600	SF	Throughout	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
34	12 x 12 White with Grey and White Streaks Floor Tile Mastic	5,600	SF	Throughout	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
35	12 x 12 Black with White Streaks Floor Tile	1,500	SF	1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
35A	12 x 12 Black with White Streaks Floor Tile Mastic	1,500	SF	1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
36	12 x 12 Brown with White Streaks Floor Tile	5,600	SF	Throughout	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
37	12 x 12 Brown with White Streaks Floor Tile Mastic	5,600	SF	Throughout	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
38	Black Linoleum	1,000	SF	2nd and 3rd Floor Stairwells	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
39	Black Linoleum Adhesive	1,000	SF	2nd and 3rd Floor Stairwells	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
40	Ceramic Floor Tile Grout	80	SF	2nd Floor Men's Washroom	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
41	Ceramic Floor Tile Adhesive	80	SF	2nd Floor Men's Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
42	12"x12" Tan w/Light Brown and White Streaks VFT	5,000	SF	1st, 2nd, 3rd Floor Corridors	Assumed	MISC	No	0	SF		Operations and Maintenance
43	12"x12" Tan w/Light Brown and White Streaks VFT (Mastic)	5,000	SF	1st, 2nd, 3rd Floor Corridors	Assumed	MISC	No	0	SF		Operations and Maintenance
44	Linoleum White w/Orange and Gray Specks	950	SF	Rooms 206b, 208	Assumed	MISC	No	0	SF		Operations and Maintenance
45	Linoleum White w/Orange and Gray Specks (Mastic)	950	SF	Rooms 206b, 208	Assumed	MISC	No	0	SF		Operations and Maintenance
46	Black Vinyl Lab Table and Countertops	250	SF	Lab 208	Assumed	MISC	No	0	SF		Operations and Maintenance
47	Lab Black Vinyl Sinks	50	SF	Lab 208	Assumed	MISC	No	0	SF		Operations and Maintenance

Chicago Public Schools

School Alcott High School for the Humanities

Unit 25281

Building ID 5790

Address 2957 N. Hoyne Avenue

Chicago, IL, 60618

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
48	Lab Fume Hood	40	SF	Lab 208	Assumed	MISC	No	0	SF		Operations and Maintenance
49	12"x12" Cream w/Tan Streaks VFT	180	SF	1st Floor Corridor	Assumed	MISC	No	0	SF		Operations and Maintenance
50	12"x12" Cream w/Tan Streaks VFT (Mastic)	180	SF	1st Floor Corridor	Assumed	MISC	No	0	SF		Operations and Maintenance
51	Linoleum Gray	750	SF	Basement Vestibules, Stairway Landings, Corridors, and Offices	Assumed	MISC	No	0	SF		Operations and Maintenance
52	Linoleum Gray (Mastic)	750	SF	Basement Vestibules, Stairway Landings, Corridors, And Offices	Assumed	MISC	No	0	SF		Operations and Maintenance
53	White Vinyl Wall Sheeting	1,500	SF	Throughout Basement Lower Walls in Lunchrooms, Vestibules, Corridors, and Storage Rooms	Assumed	MISC	No	0	SF		Operations and Maintenance
54	White Vinyl Wall Sheeting Adhesive	1,500	SF	Throughout Basement Lower Walls in Lunchrooms, Vestibules, Corridors, and Storage Rooms	Assumed	MISC	No	0	SF		Operations and Maintenance
55	Gray Vinyl Baseboard	150	LF	Rooms 007, 012, 013, 017, Lunchroom	Assumed	MISC	No	0	LF		Operations and Maintenance
56	Gray Vinyl Baseboard (Mastic)	150	LF	Rooms 007, 012, 013, 017, Lunchroom	Assumed	MISC	No	0	LF		Operations and Maintenance
57	Gray Sink Spray-On Undercoating	15	SF	Room 007	Assumed	MISC	No	0	SF		Operations and Maintenance
58	Drywall	7,500	SF	Throughout Basement, Corridors, and Offices	Assumed	MISC	No	0	SF		Operations and Maintenance
59	Drywall Compound	1	SF	Throughout Basement, Corridors, and Offices	Assumed	MISC	No	0	SF		Operations and Maintenance
60	Boiler Insulation in Boilers 1 and 2	90	SF	Boiler Room - Main Boilers	Assumed	MISC	Yes	0	SF		Operations and Maintenance
61	Boiler Cloth Rope Insulation	60	LF	Main Boiler Room - Boilers 1 and 2	Assumed	MISC	No	0	LF		Operations and Maintenance
62	Duct Insulation	200	SF	Boiler Room	Assumed	MISC	No	0	SF		Operations and Maintenance
63	Gray Rubber Skid Proof Flooring	240	SF	Top of Corridor Landings 1st, 2nd, 3rd Floor	Assumed	MISC	No	0	SF		Operations and Maintenance
64	Gray Rubber Skid Proof Floor (Mastic)	240	SF	Top of Corridor Landings at Stairwells 1st, 2nd, 3rd Floor	Assumed	MISC	No	0	SF		Operations and Maintenance
C	MJP E/F/V on Fiberglass Pipe Insulation (ABATED)	300	LF	Throughout Basement (See Hatching Maps)	Chrysotile	TSI			LF		
D	Cardboard Pipe Insulation (ABATED)	50	LF	Throughout Basement (See Hatching Maps)	Chrysotile	TSI			LF		
E	MJP on Cardboard Pipe Insulation (ABATED)	2	LF	Basement Girls Bathroom Foyer	Chrysotile	TSI			LF		
F	Aircell Pipe Insulation	68	LF	Boiler Room, Corridor Basement, and Air Tunnel	Chrysotile	TSI	Yes	0	LF	5 ACBM with potential for significant damage	Operations and Maintenance
G	MJP E/F/V on Aircell Pipe Insulation	9	EA	Boiler Room and Air Tunnel Basement	Chrysotile	TSI	Yes	3	EA	1 Damaged or significantly damaged	Repair

Chicago Public Schools

School Alcott High School for the Humanities

Unit 25281

Building ID 5790

Address 2957 N. Hoyne Avenue

Chicago, IL, 60618

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
										friable thermal system insulating ACBM	

Review Date	5/12/2013
Manager Planner Name	Jigar Shah

HA Number	Management Comments
01	
02	

Chicago Public Schools

School Alcott High School for the Humanities

Unit 25281

Building ID 5790

Address 2957 N. Hoyne Avenue

Chicago, IL, 60618

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

100-07342	5/15/2013
Manager IDPH License No/Expiration	

HA Number	Management Comments
02B	
02C	
05	
06	
10	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	Remove Damaged tiles as soon as possible if ACBM
28	
29	
30	
31	
31 A	
32	
32A	

Chicago Public Schools

School Alcott High School for the Humanities

Unit 25281

Building ID 5790

Address 2957 N. Hoyne Avenue

Chicago, IL, 60618

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
33	
34	
35	
35A	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	

Chicago Public Schools

School Alcott High School for the Humanities

Unit 25281

Building ID 5790

Address 2957 N. Hoyne Avenue

Chicago, IL, 60618

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
58	
59	
60	
61	
62	
63	
64	
C	
D	
E	
F	
G	Repair Damage as soon as possible

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY: **10000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **Hard Coat Plaster**
MATERIAL LOCATION: **Throughout building**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 05/12/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **1'x1' Old Wormy Design White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout: 101, 102, 104, 108,111, 205, 208, 302, 307, 308, Bathrooms 1st -3rd Floors**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **1'x1' Old Wormy Design White Ceiling Tile**
MATERIAL LOCATION: **Throughout: 101, 102, 104, 108,111, 205, 208, 302, 307, 308, Bathrooms 1st -3rd Floors**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 05/12/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUIDLING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 02B
MATERIAL DESCRIPTION: 1'x1' New Wormy Design White Ceiling Tile
HISTORICAL AHERA DAMAGE CATEGORY 6
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Assumed FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: MODERATE
MATERIAL LOCATION: Throughout
MATERIAL QUANTITY: 3500 MATERIAL UNITS: SF
DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS:

Inspector's Signature:



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**


HOMOGENEOUS AREA: **02B**
MATERIAL DESCRIPTION: **1'x1' New Wormy Design White Ceiling Tile**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

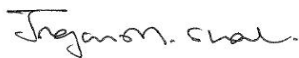

Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUIDLING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 02C
MATERIAL DESCRIPTION: 1'x1' Small Hole Ceiling Tile
HISTORICAL AHERA DAMAGE CATEGORY 6
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Assumed FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: MODERATE
MATERIAL LOCATION: Throughout
MATERIAL QUANTITY: 3500 MATERIAL UNITS: SF
DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **02C**
MATERIAL DESCRIPTION: **1'x1' Small Hole Ceiling Tile**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUIDLING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 05
MATERIAL DESCRIPTION: 2'x4' Ceiling Tile
HISTORICAL AHERA DAMAGE CATEGORY 6
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Assumed FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: MODERATE

MATERIAL LOCATION: Basement Kitchen, Principal's Office, Basement East & West Lunch Rooms, 108, 111, 208

MATERIAL QUANTITY: 3500 MATERIAL UNITS: SF

DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS:

Inspector's Signature:



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **2'x4' Ceiling Tile**
MATERIAL LOCATION: **Basement Kitchen, Principal's Office, Basement East & West Lunch Rooms, 108, 111, 208**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUIDLING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 06
MATERIAL DESCRIPTION: 12"x12" Beige w/ Brown Streaks VFT (ABATED 7/23/09)
HISTORICAL AHERA DAMAGE CATEGORY 6
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Chrysotile FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Throughout
MATERIAL QUANTITY: 2500 MATERIAL UNITS: SF
DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS: Except-This VFT remains in Stairwell Landings 1st, 2nd, 3rd Floors.

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Streaks VFT (ABATED 7/23/09)**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUILDING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 10
MATERIAL DESCRIPTION: 12'x12" Beige w/ Brown Streaks VFT Mastic (ABATED 7/23/09)
HISTORICAL AHERA DAMAGE CATEGORY 6
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Chrysotile FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **2500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Except-This VFT remains in Stairwell Landings 1st, 2nd, 3rd Floors.**

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**


HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **12'x12" Beige w/ Brown Streaks VFT Mastic (ABATED 7/23/09)**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

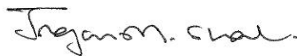

Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUILDING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 13
MATERIAL DESCRIPTION: 1'x1' White Ceiling Tile Mastic
HISTORICAL AHERA DAMAGE CATEGORY 6
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Assumed FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Throughout
MATERIAL QUANTITY: 10500 MATERIAL UNITS: SF
DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS:

Inspector's Signature: 

Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **1'x1' White Ceiling Tile Mastic**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **10500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" Pink VFT (ABATED 2009/10 CIP)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Girls Washroom by Room 107**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" Pink VFT (ABATED 2009/10 CIP)**
MATERIAL LOCATION: **1st Floor Girls Washroom by Room 107**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 05/12/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUILDING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 15
MATERIAL DESCRIPTION: 12"x12" Pink VFT Mastic (ABATED 2009/10 CIP)
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st Floor Girls Washroom by Room 107

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" Pink VFT Mastic (ABATED 2009/10 CIP)**
MATERIAL LOCATION: **1st Floor Girls Washroom by Room 107**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Brown Grain VFT (ABATED 2009/10 CIP)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Principal's office & bathroom, Rooms #106, #104, and 2nd Floor Men's Teacher Toliet, Main Office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**


HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Brown Grain VFT (ABATED 2009/10 CIP)**
MATERIAL LOCATION: **Principal's office & bathroom, Rooms #106, #104, and 2nd Floor Men's Teacher Toliet, Main Office**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

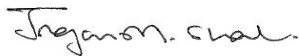

Date: 05/12/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12"x12" Brown Grain VFT Mastic (ABATED 2009/10 CIP)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Principal's office & bathroom, Rooms #106, #104, and 2nd Floor Men's Teacher Toliet, Main Office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: 

Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**


HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12"x12" Brown Grain VFT Mastic (ABATED 2009/10 CIP)**
MATERIAL LOCATION: **Principal's office & bathroom, Rooms #106, #104, and 2nd Floor Men's Teacher Toliet, Main Office**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

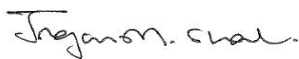

Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"x12" White w/ Yellow Streaks VFT (ABATED 2009/10 CIP)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Hallway**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"x12" White w/ Yellow Streaks VFT (ABATED 2009/10 CIP)**
MATERIAL LOCATION: **1st Floor Hallway**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12"x12" White w/ Yellow Streaks VFT Mastic (ABATED 2009/10 CIP)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Hallway**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12"x12" White w/ Yellow Streaks VFT Mastic (ABATED 2009/10 CIP)**
MATERIAL LOCATION: **1st Floor Hallway**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12"x12" Dark Brown VFT (ABATED 2009/10 CIP)**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen Manager's Office, Basement Lunch Room (East), Basement Room 003, Kitchen**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: 

Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12"x12" Dark Brown VFT (ABATED 2009/10 CIP)**
MATERIAL LOCATION: **Kitchen Manager's Office, Basement Lunch Room (East), Basement Room 003, Kitchen**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12"x12" Dark Brown VFT Mastic (ABATED 2009/10 CIP)**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Kitchen Manager's Office, Basement Lunch Room (East), Basement Room 003, Kitchen**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: 

Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12"x12" Dark Brown VFT Mastic (ABATED 2009/10 CIP)**
MATERIAL LOCATION: **Kitchen Manager's Office, Basement Lunch Room (East), Basement Room 003, Kitchen**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: **0** DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12"x12" White with Red Streaks VFT (ABATED 1/30/10)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Lunch Room (West), & Basement Nurse's Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12"x12" White with Red Streaks VFT (ABATED 1/30/10)**
MATERIAL LOCATION: **Lunch Room (West), & Basement Nurse's Room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12"x12" White w/ Red Streaks VFT Mastic (ABATED 1/3/10)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Lunch Room (West), & Basement Nurse's Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12"x12" White w/ Red Streaks VFT Mastic (ABATED 1/3/10)**
MATERIAL LOCATION: **Lunch Room (West), & Basement Nurse's Room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUIDLING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 24
MATERIAL DESCRIPTION: 12"x12" Pink Grain VFT
HISTORICAL AHERA DAMAGE CATEGORY 6
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Assumed FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Teacher's Lounge Bathroom
MATERIAL QUANTITY: 100 MATERIAL UNITS: SF
DAMAGE QUANTITY: DAMAGE UNITS: SF
COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013 _____

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**


HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12"x12" Pink Grain VFT**
MATERIAL LOCATION: **Teacher's Lounge Bathroom**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

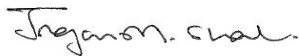

Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" Pink Grain VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Teacher's Lounge Bathroom**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" Pink Grain VFT Mastic**
MATERIAL LOCATION: **Teacher's Lounge Bathroom**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUIDLING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 26
MATERIAL DESCRIPTION: 2'x2' Dot Ceiling Tile
HISTORICAL AHERA DAMAGE CATEGORY 5
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Assumed FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON: Water
Physical Damage
DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Room #201, 202, 203, 204, 206, 207, and 208
MATERIAL QUANTITY: 4200 MATERIAL UNITS: SF
DAMAGE QUANTITY: DAMAGE UNITS: SF
COMMENTS: Damage Distributed Throughout

Inspector's Signature:



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **2'x2' Dot Ceiling Tile**
MATERIAL LOCATION: **Room #201, 202, 203, 204, 206, 207, and 208**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **5** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Remove Damaged tiles as soon as possible if ACBM

Management Planner's Signature: _____

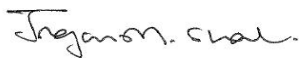

Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUIDLING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 28
MATERIAL DESCRIPTION: Interior Window Glaze
HISTORICAL AHERA DAMAGE CATEGORY 6
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Assumed FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Interior Windows
MATERIAL QUANTITY: 10000 MATERIAL UNITS: LF
DAMAGE QUANTITY: DAMAGE UNITS: LF

COMMENTS:

Inspector's Signature:



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Interior Window Glaze**
MATERIAL LOCATION: **Interior Windows**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUILDING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 29
MATERIAL DESCRIPTION: Light Brown Linoleum
HISTORICAL AHERA DAMAGE CATEGORY 6
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: Assumed FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Office Storage Room, 111**

MATERIAL QUANTITY: **350**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**


HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Light Brown Linoleum**
MATERIAL LOCATION: **Main Office Storage Room, 111**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

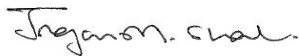

Date: 05/12/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Light Brown Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Office Storage Room, 111**

MATERIAL QUANTITY: **350**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Light Brown Linoleum Mastic**
MATERIAL LOCATION: **Main Office Storage Room, 111**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12 x 12 inch Black w/White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st floor corridors**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12 x 12 inch Black w/White Streaks VFT**
MATERIAL LOCATION: **1st floor corridors**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

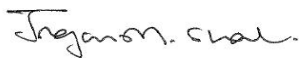

Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31 A**
MATERIAL DESCRIPTION: **12 x 12 inch Black w/White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Corridors**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **31 A**
MATERIAL DESCRIPTION: **12 x 12 inch Black w/White Streaks VFT Mastic**
MATERIAL LOCATION: **1st Floor Corridors**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Brown/White Checked Linoleum (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Stage Assembly Hall**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Brown/White Checked Linoleum (NOT OBSERVED)**
MATERIAL LOCATION: **Stage Assembly Hall**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32A**
MATERIAL DESCRIPTION: **Brown/White Checked Linoleum Mastic (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Stage Assembly Hall**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **32A**
MATERIAL DESCRIPTION: **Brown/White Checked Linoleum Mastic (NOT OBSERVED)**
MATERIAL LOCATION: **Stage Assembly Hall**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12 x 12 White with Grey and White Streaks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12 x 12 White with Grey and White Streaks Floor Tile**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12 x 12 White with Grey and White Streaks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12 x 12 White with Grey and White Streaks Floor Tile Mastic**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12 x 12 Black with White Streaks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12 x 12 Black with White Streaks Floor Tile**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35A**
MATERIAL DESCRIPTION: **12 x 12 Black with White Streaks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **35A**
MATERIAL DESCRIPTION: **12 x 12 Black with White Streaks Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12 x 12 Brown with White Streaks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12 x 12 Brown with White Streaks Floor Tile**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUILDING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 37
MATERIAL DESCRIPTION: 12 x 12 Brown with White Streaks Floor Tile Mastic
HISTORICAL AHERA DAMAGE CATEGORY 6 ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Operations and Maintenance
ASBESTOS TYPE: Assumed FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Throughout
MATERIAL QUANTITY: 5600 MATERIAL UNITS: SF
DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **12 x 12 Brown with White Streaks Floor Tile Mastic**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Black Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd and 3rd Floor Stairwells**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Black Linoleum**
MATERIAL LOCATION: **2nd and 3rd Floor Stairwells**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Black Linoleum Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd and 3rd Floor Stairwells**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Black Linoleum Adhesive**
MATERIAL LOCATION: **2nd and 3rd Floor Stairwells**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Ceramic Floor Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Men's Washroom**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Ceramic Floor Tile Grout**
MATERIAL LOCATION: **2nd Floor Men's Washroom**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Ceramic Floor Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Men's Washroom**

MATERIAL QUANTITY: **80**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Ceramic Floor Tile Adhesive**
MATERIAL LOCATION: **2nd Floor Men's Washroom**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Basement (See Hatching Maps)**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation (ABATED)**
MATERIAL LOCATION: **Throughout Basement (See Hatching Maps)**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Basement (See Hatching Maps)**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation (ABATED)**
MATERIAL LOCATION: **Throughout Basement (See Hatching Maps)**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **MJP on Cardboard Pipe Insulation (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement Girls Bathroom Foyer**

MATERIAL QUANTITY: **2** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **MJP on Cardboard Pipe Insulation (ABATED)**
MATERIAL LOCATION: **Basement Girls Bathroom Foyer**
MATERIAL QUANTITY: **2** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: 05/12/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room, Corridor Basement, and Air Tunnel**
MATERIAL QUANTITY: **68** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/14/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Boiler Room, Corridor Basement, and Air Tunnel**
MATERIAL QUANTITY: **68** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 25281 BUILDING ID: 5790
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Joseph Hennigan
SCHOOL NAME: Alcott High School for the Humanities INSPECTION DATE: 4/14/2013
ADDRESS: 2957 N. Hoyne Avenue IDPH LICENSE NO: 100-18350

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: G
MATERIAL DESCRIPTION: MJP E/F/V on Aircell Pipe Insulation
HISTORICAL AHERA DAMAGE CATEGORY: 1 ACBM with potential for significant damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Operations and Maintenance
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: Deterioration
DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Boiler Room and Air Tunnel Basement
MATERIAL QUANTITY: 9 MATERIAL UNITS: EA
DAMAGE QUANTITY: DAMAGE UNITS: EA
COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUIDLING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
MATERIAL LOCATION: **Boiler Room and Air Tunnel Basement**
MATERIAL QUANTITY: **9** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: **3** DAMAGE UNITS: **EA**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Repair Damage as soon as possible

Management Planner's Signature: _____

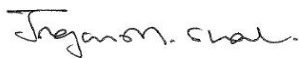

Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **Lab Black Vinyl Sinks**

MATERIAL LOCATION: **Lab 208**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____


Jigar Shah

Date: **05/12/2013**

2ND FLOOR
2013 3 YEAR ASBESTOS
RE-INSPECTION

NEW LAB
HA# 47 - BLACK VINYL SINKS

50 S.F.

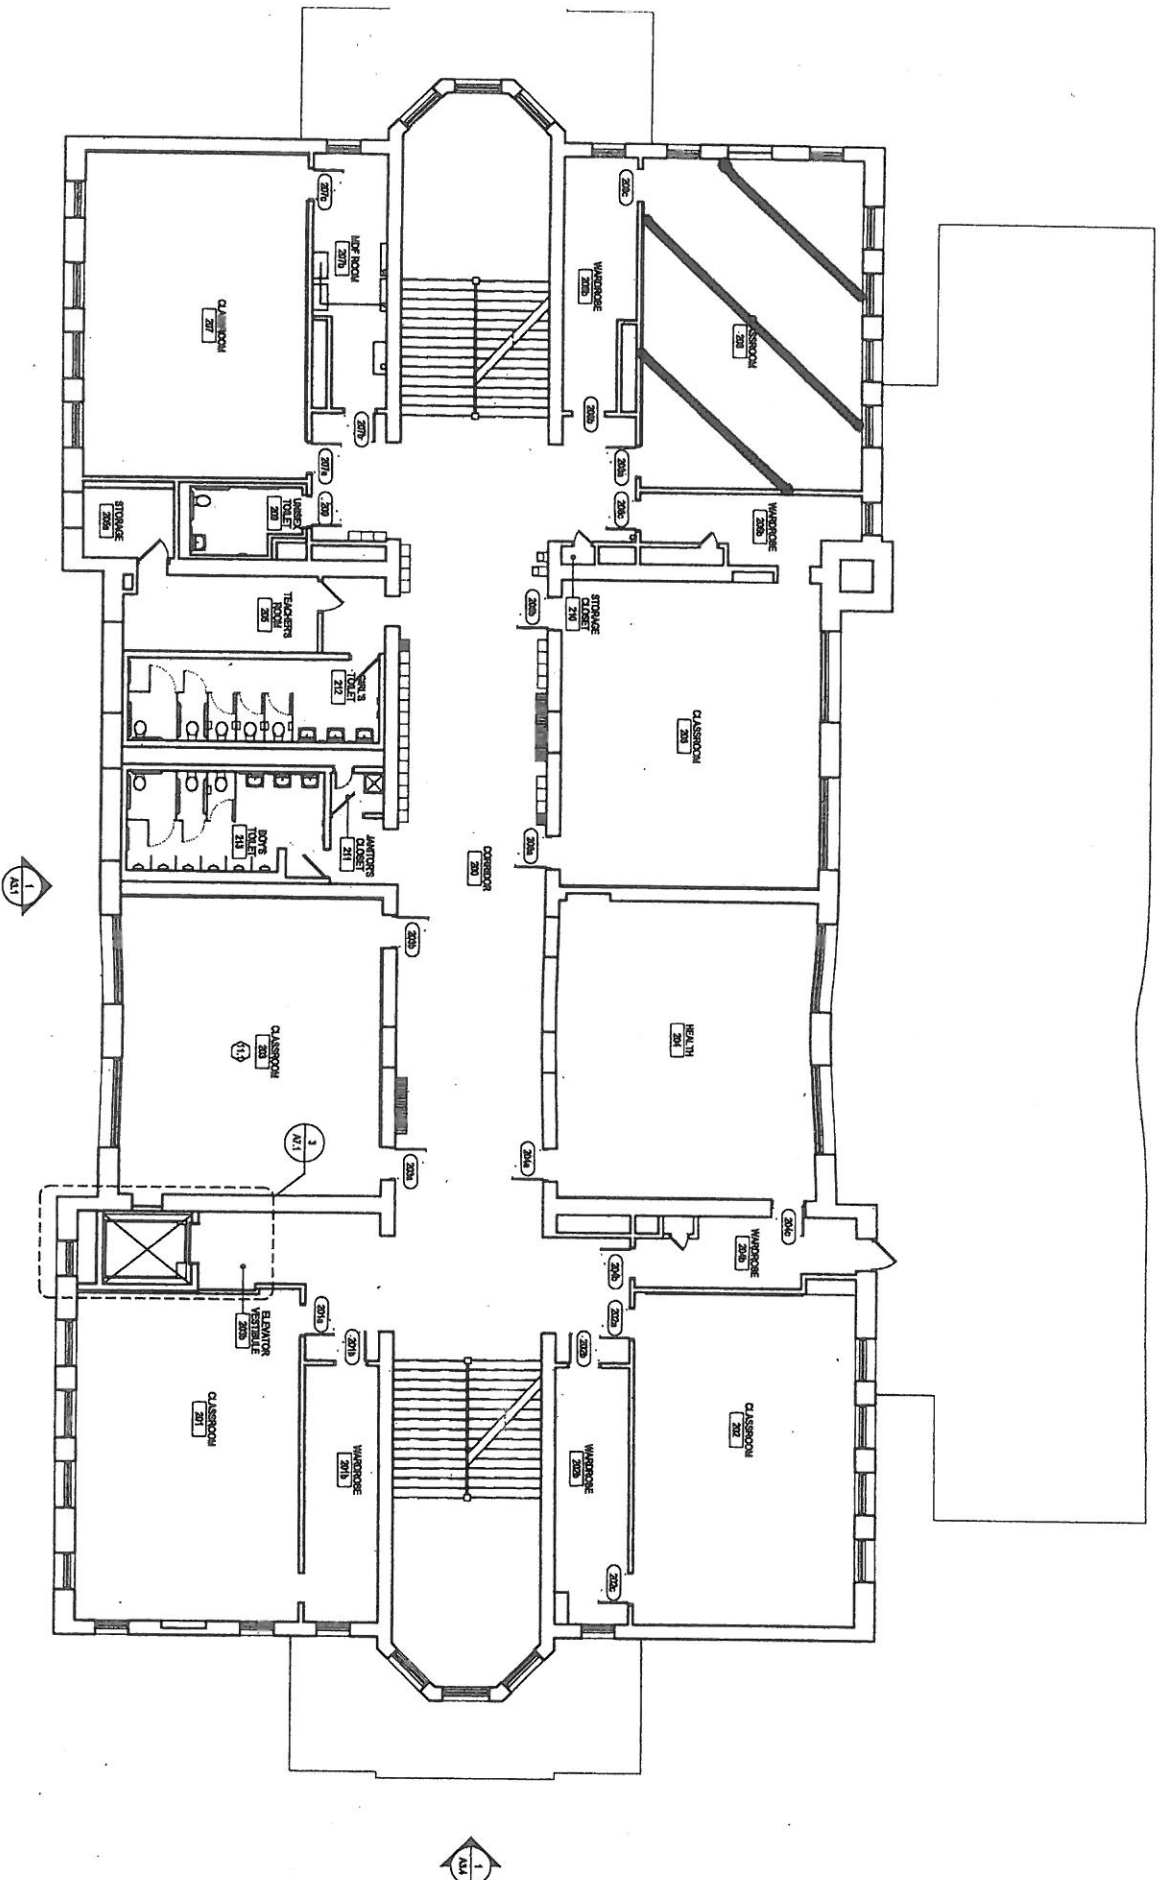

1.2
AS

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for
the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard (Mastic)**
MATERIAL LOCATION: **Rooms 007, 012, 013, 017, Lunchroom**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard (Mastic)**
MATERIAL LOCATION: **Rooms 007, 012, 013, 017, Lunchroom**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

NEW 55 - GRAY VINYL BASEBOARD
HA # 56 - MASTIC ASSOCIATED WITH
HA # 55

150 L.F.

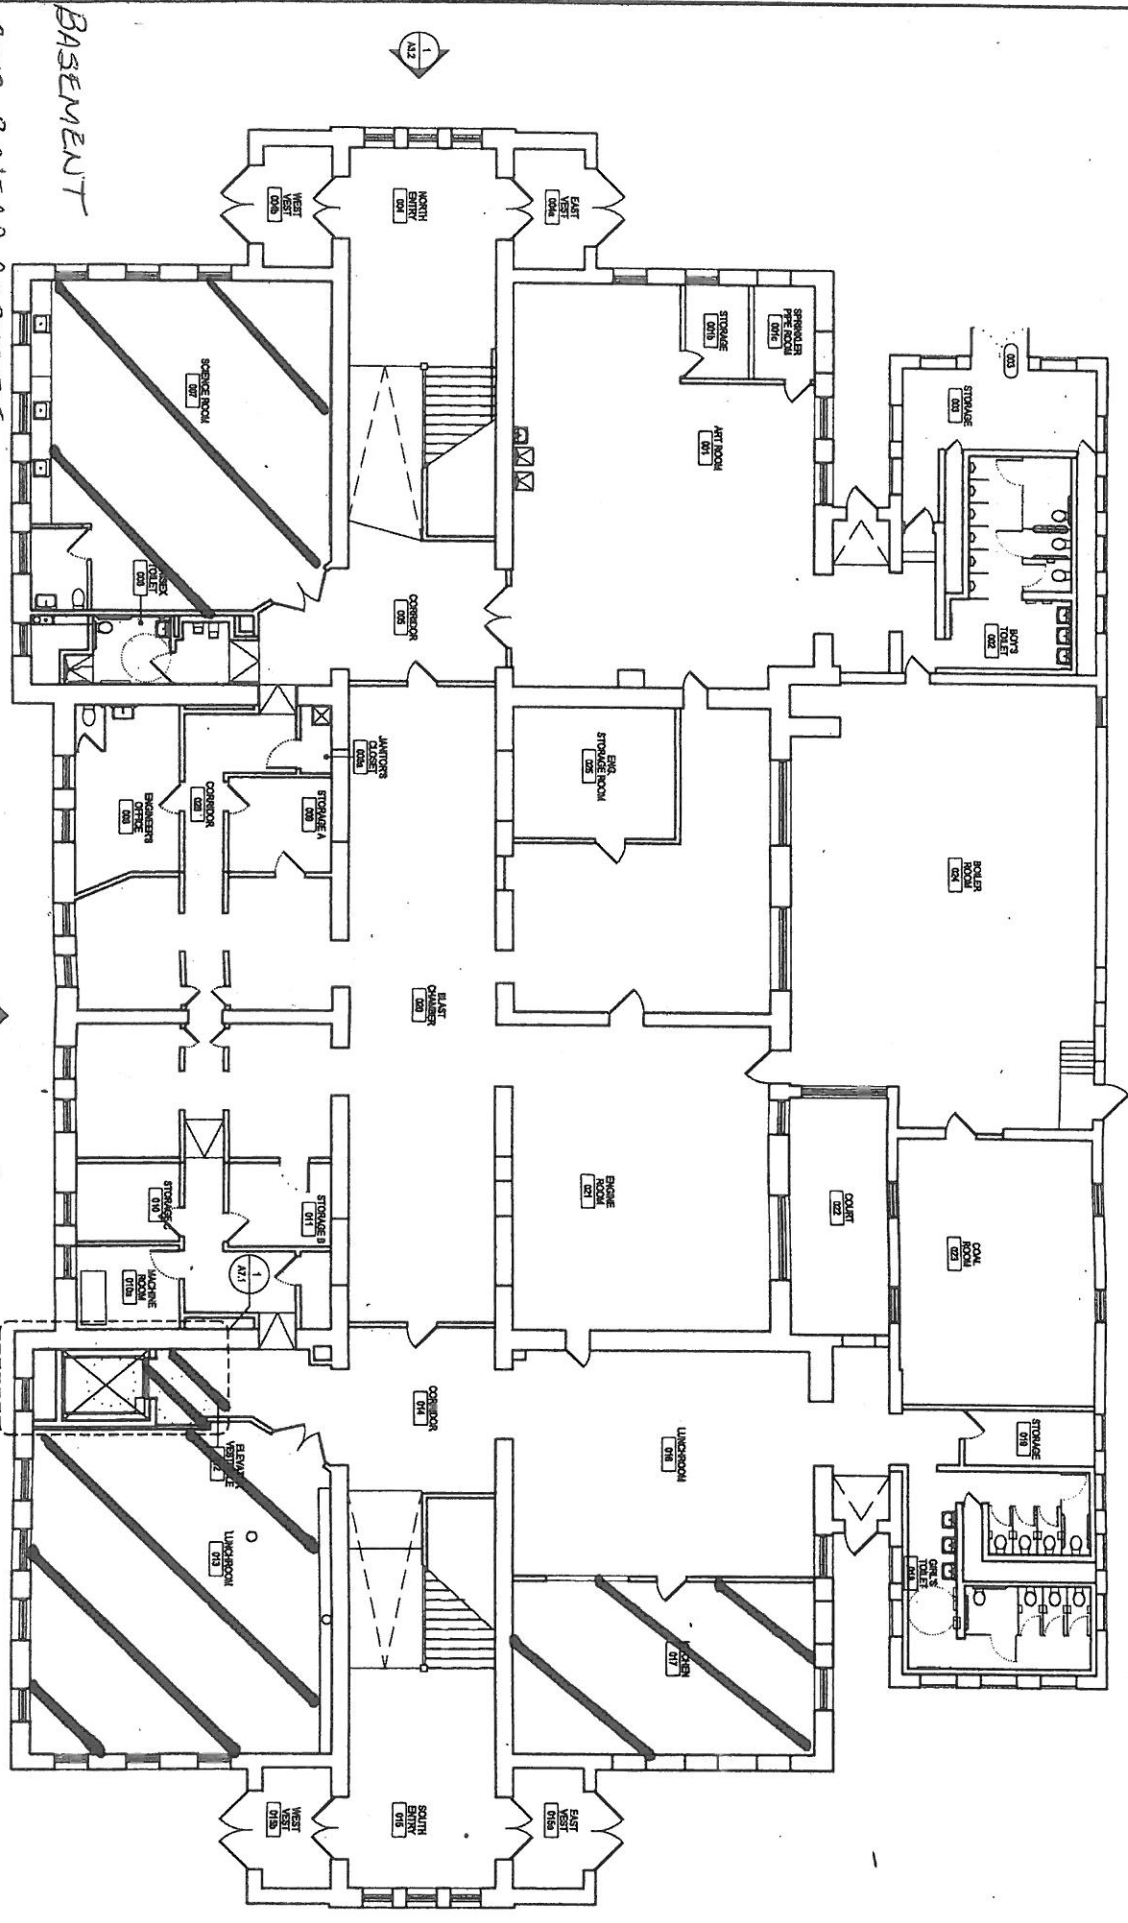

BASEMENT
2013 3 YEAR ASBESTOS
DI-11-DEFLECTION

ALCOTT H 9

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for
the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **12"x12" Cream w/Tan Streaks VFT**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:
New Installation

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **12"x12" Cream w/Tan Streaks VFT**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature:  Date: **05/12/2013**

NEW
HA # 49

12" x 12" CREAM WITH
TAN STREAKS

VFT

180 S.F

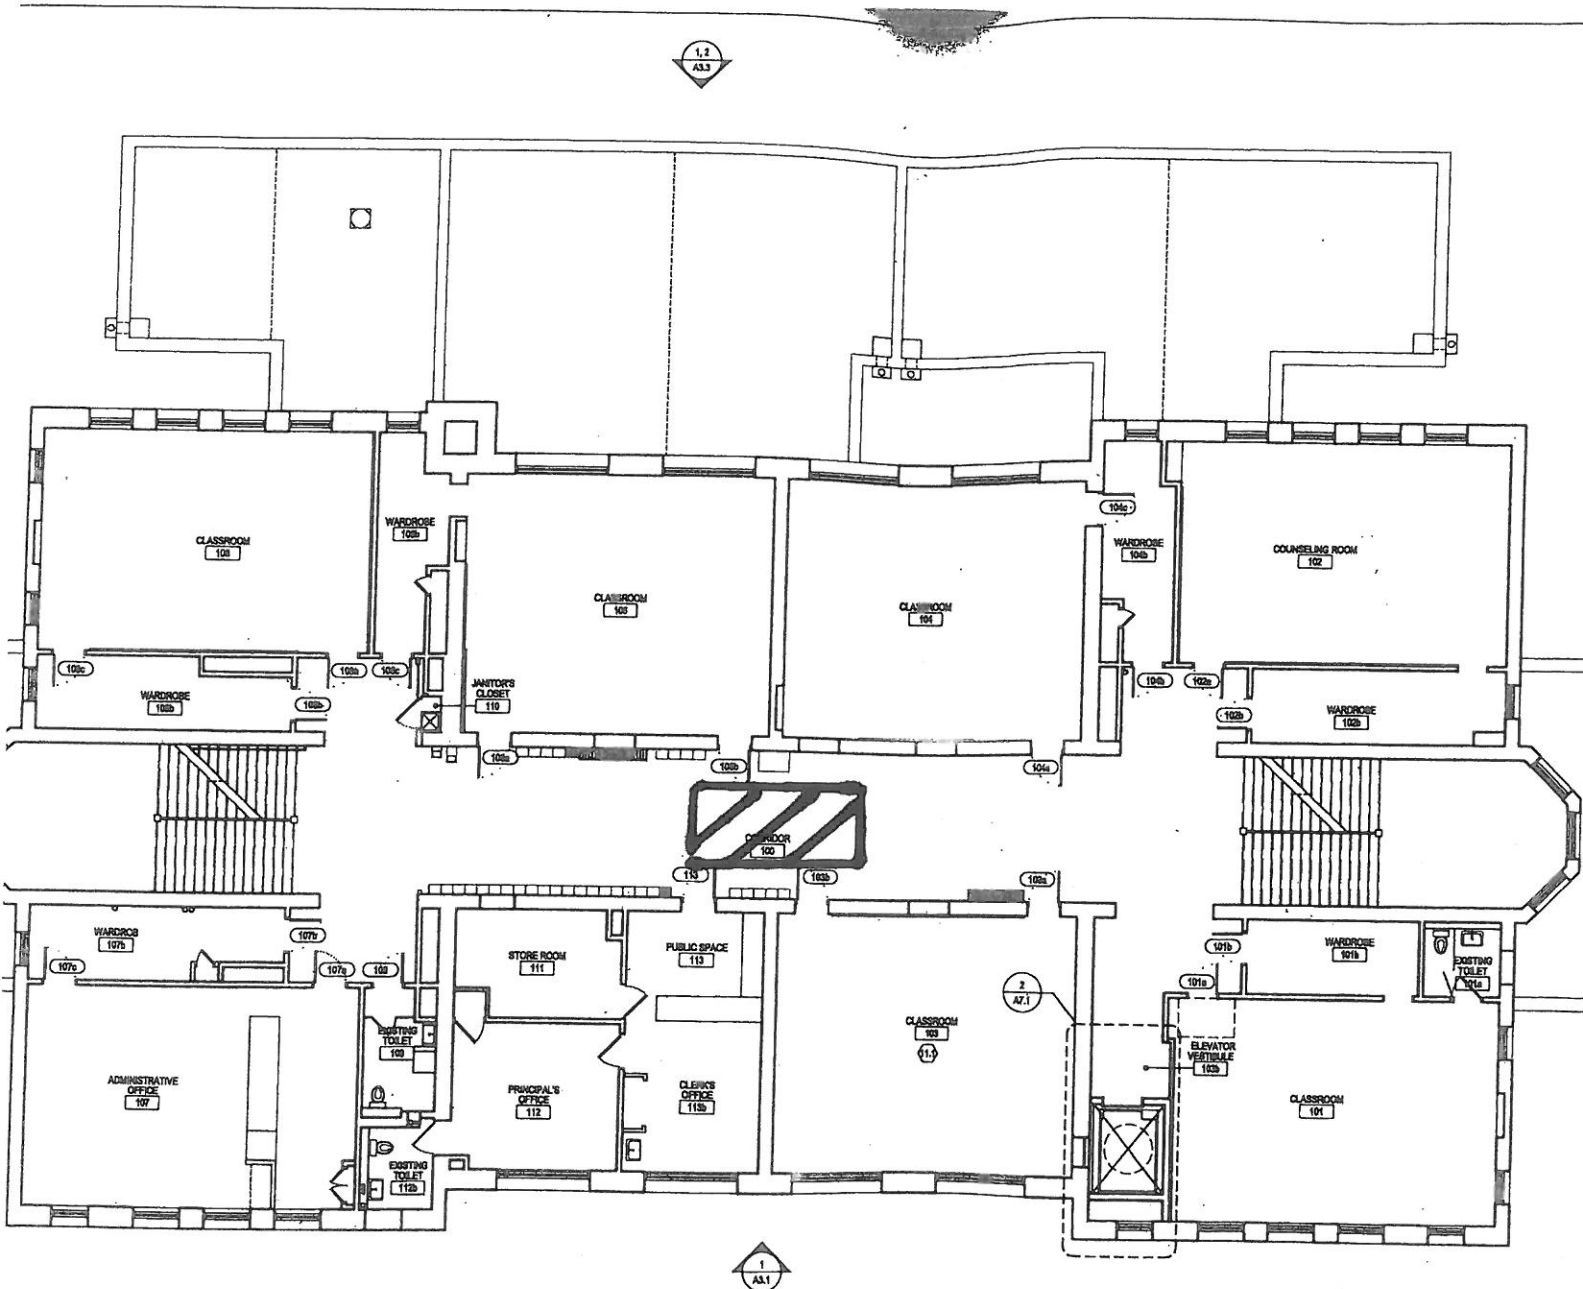

1ST FLOOR

2013 3 YEAR ASBESTOS
RE-INSPECTION

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **Boiler Cloth Rope Insulation**
MATERIAL LOCATION: **Main Boiler Room - Boilers 1 and 2**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **Boiler Cloth Rope Insulation**
MATERIAL LOCATION: **Main Boiler Room - Boilers 1 and 2**
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

NEW HA # 61 CLOTH ROPE BOILER GASKET/INSULATION

600 L.F.

Boiler #1 + Boiler #2

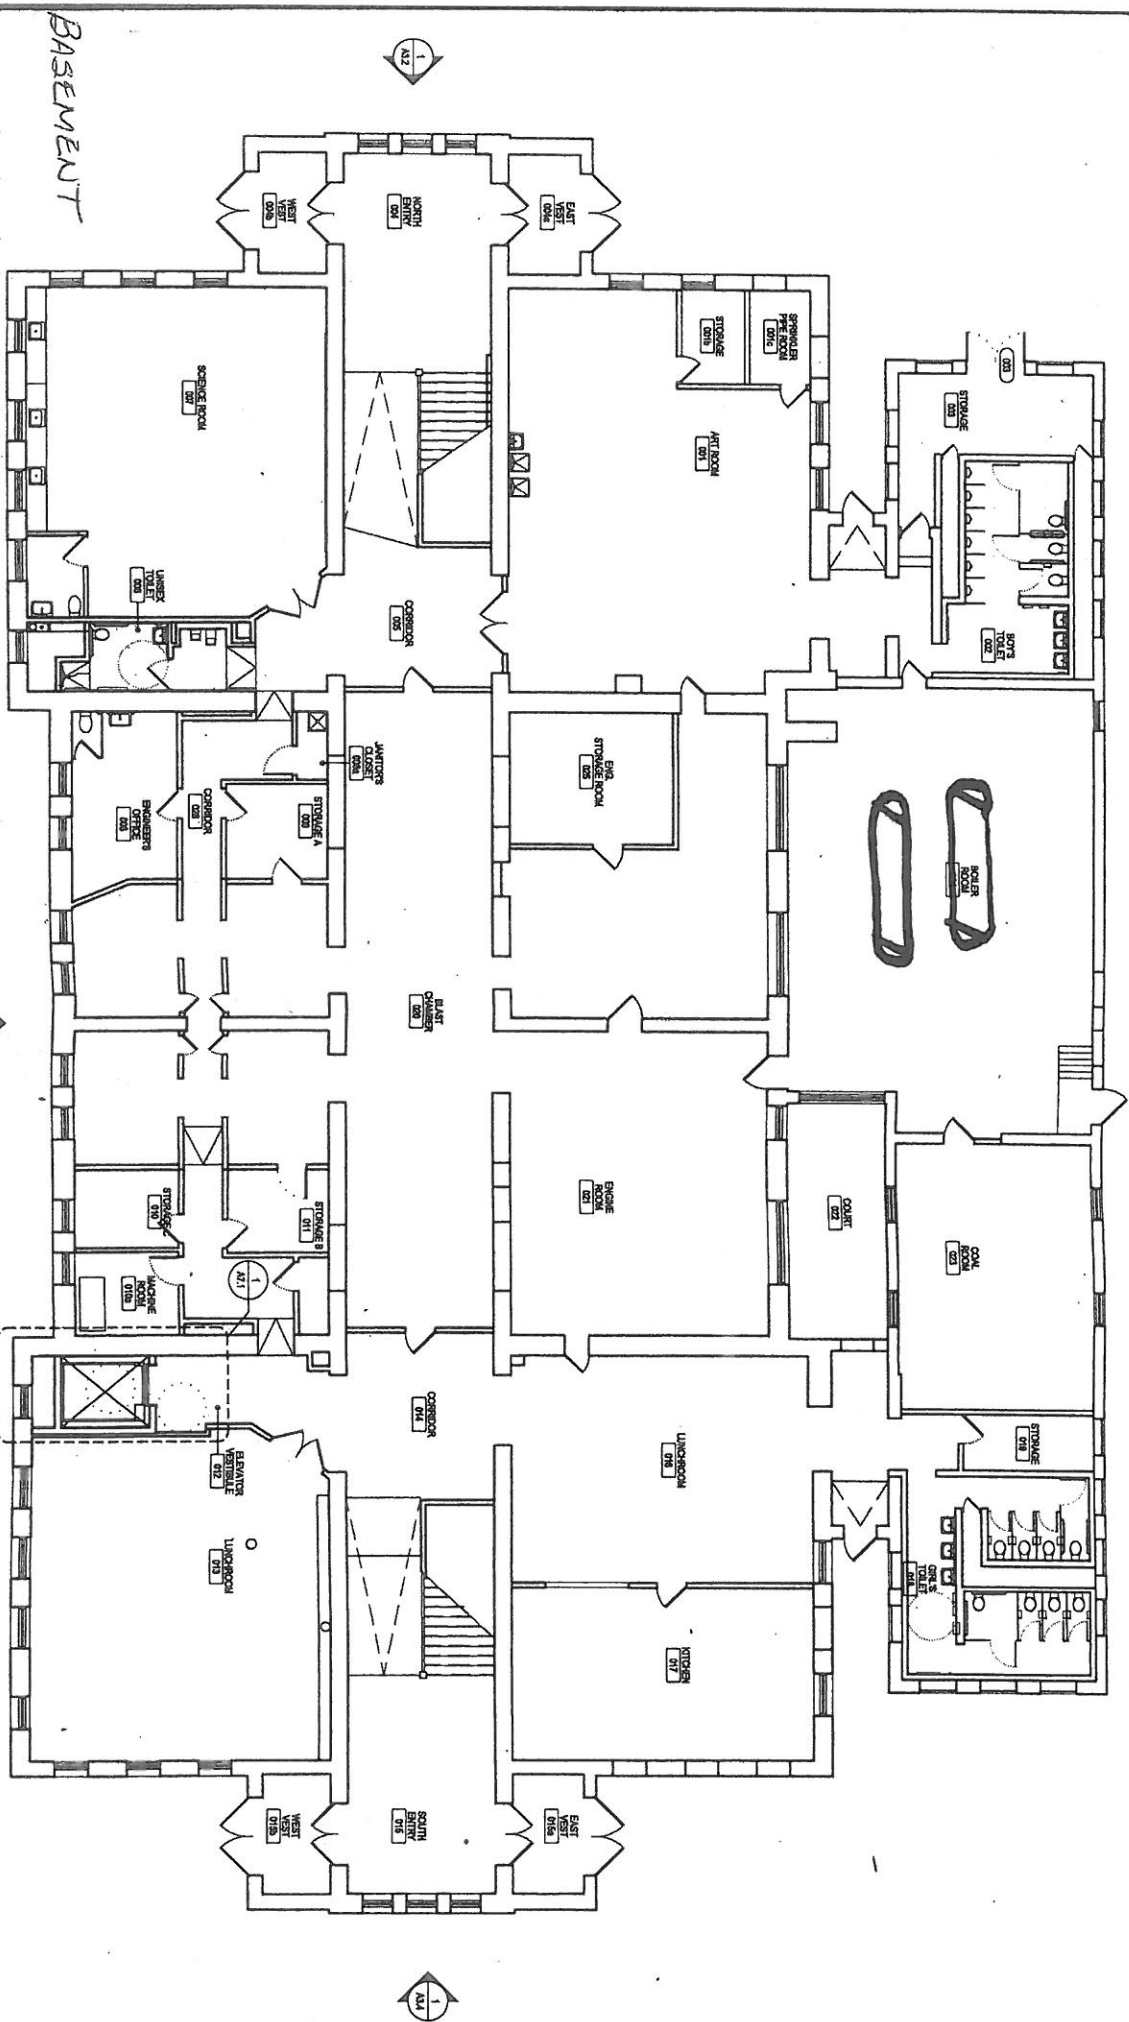

BASEMENT
2013 3 YEAR ASBESTOS
DT 114DEFINITION

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **Gray Rubber Skid Proof Flooring**
MATERIAL LOCATION: **Top of Corridor Landings 1st, 2nd, 3rd Floor**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:
New Installation 2009/10 CIP

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **Gray Rubber Skid Proof Flooring**
MATERIAL LOCATION: **Top of Corridor Landings 1st, 2nd, 3rd Floor**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**


NEW-63 - GRAY RUBBER
HA # - 63

240 S.F.
EACH

NEW
HA # - 64

MASTIC ASSOCIATED WITH HA # 63

SKID PROOF
FLOORING

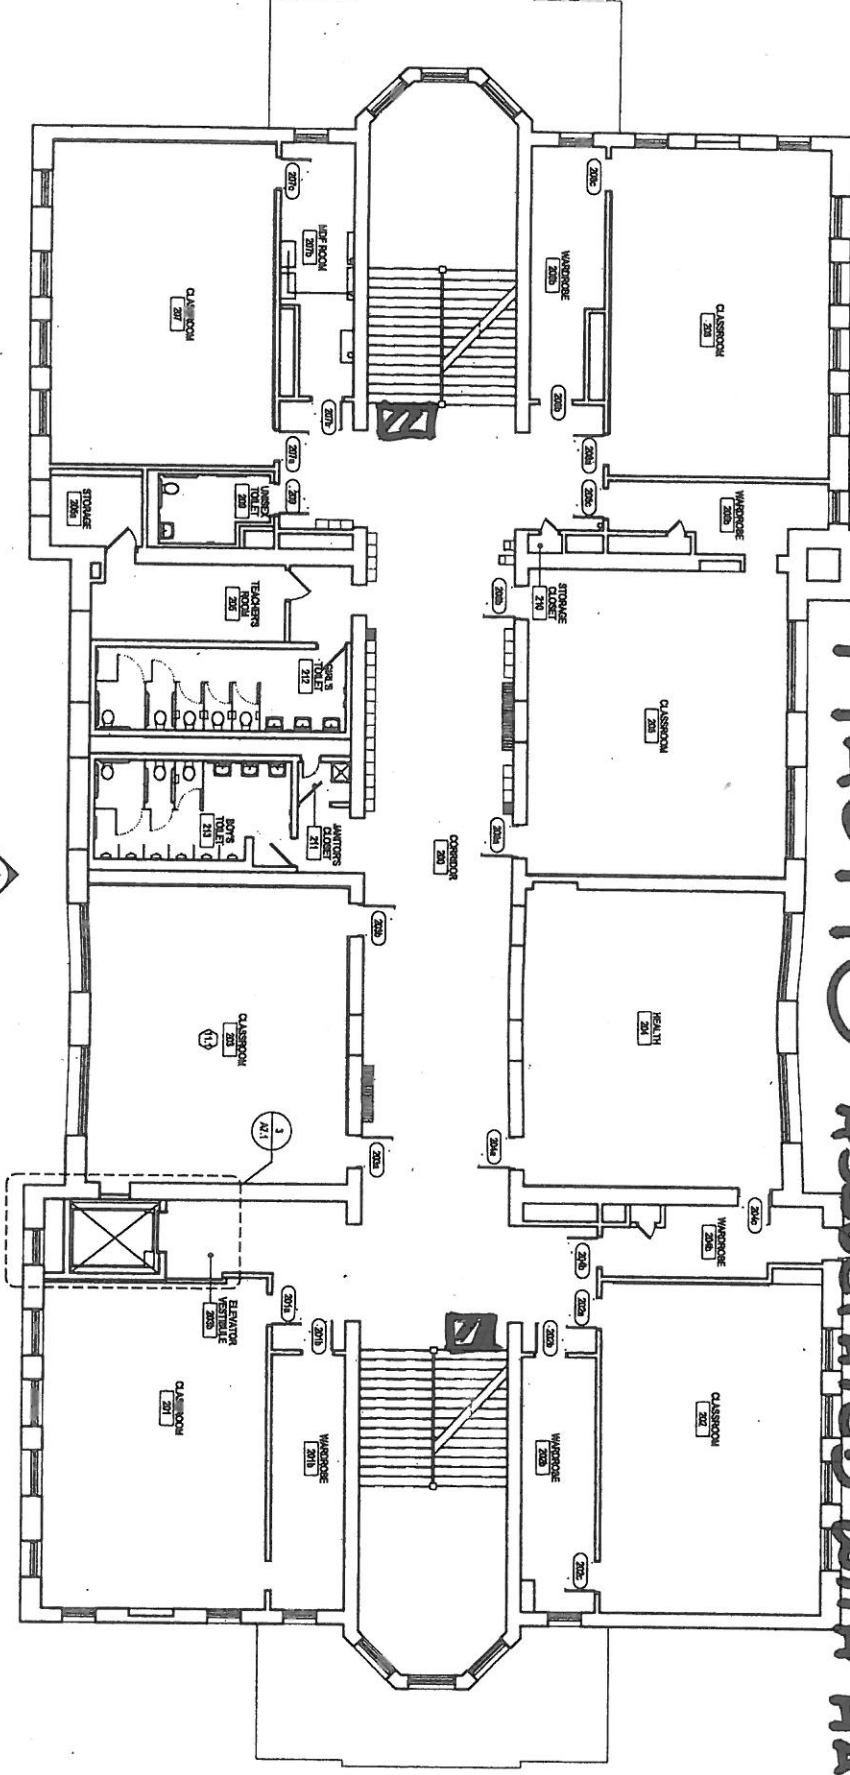


2ND FLOOR

2013 3 YEAR ASBESTOS
RE-INSPECTION

NEW HA # 63 - GRAY RUBBER SKID PROOF FLOORING

240 S.F. EACH

NEW HA # 64 - MASTIC + ASSOCIATED WITH HA # 63

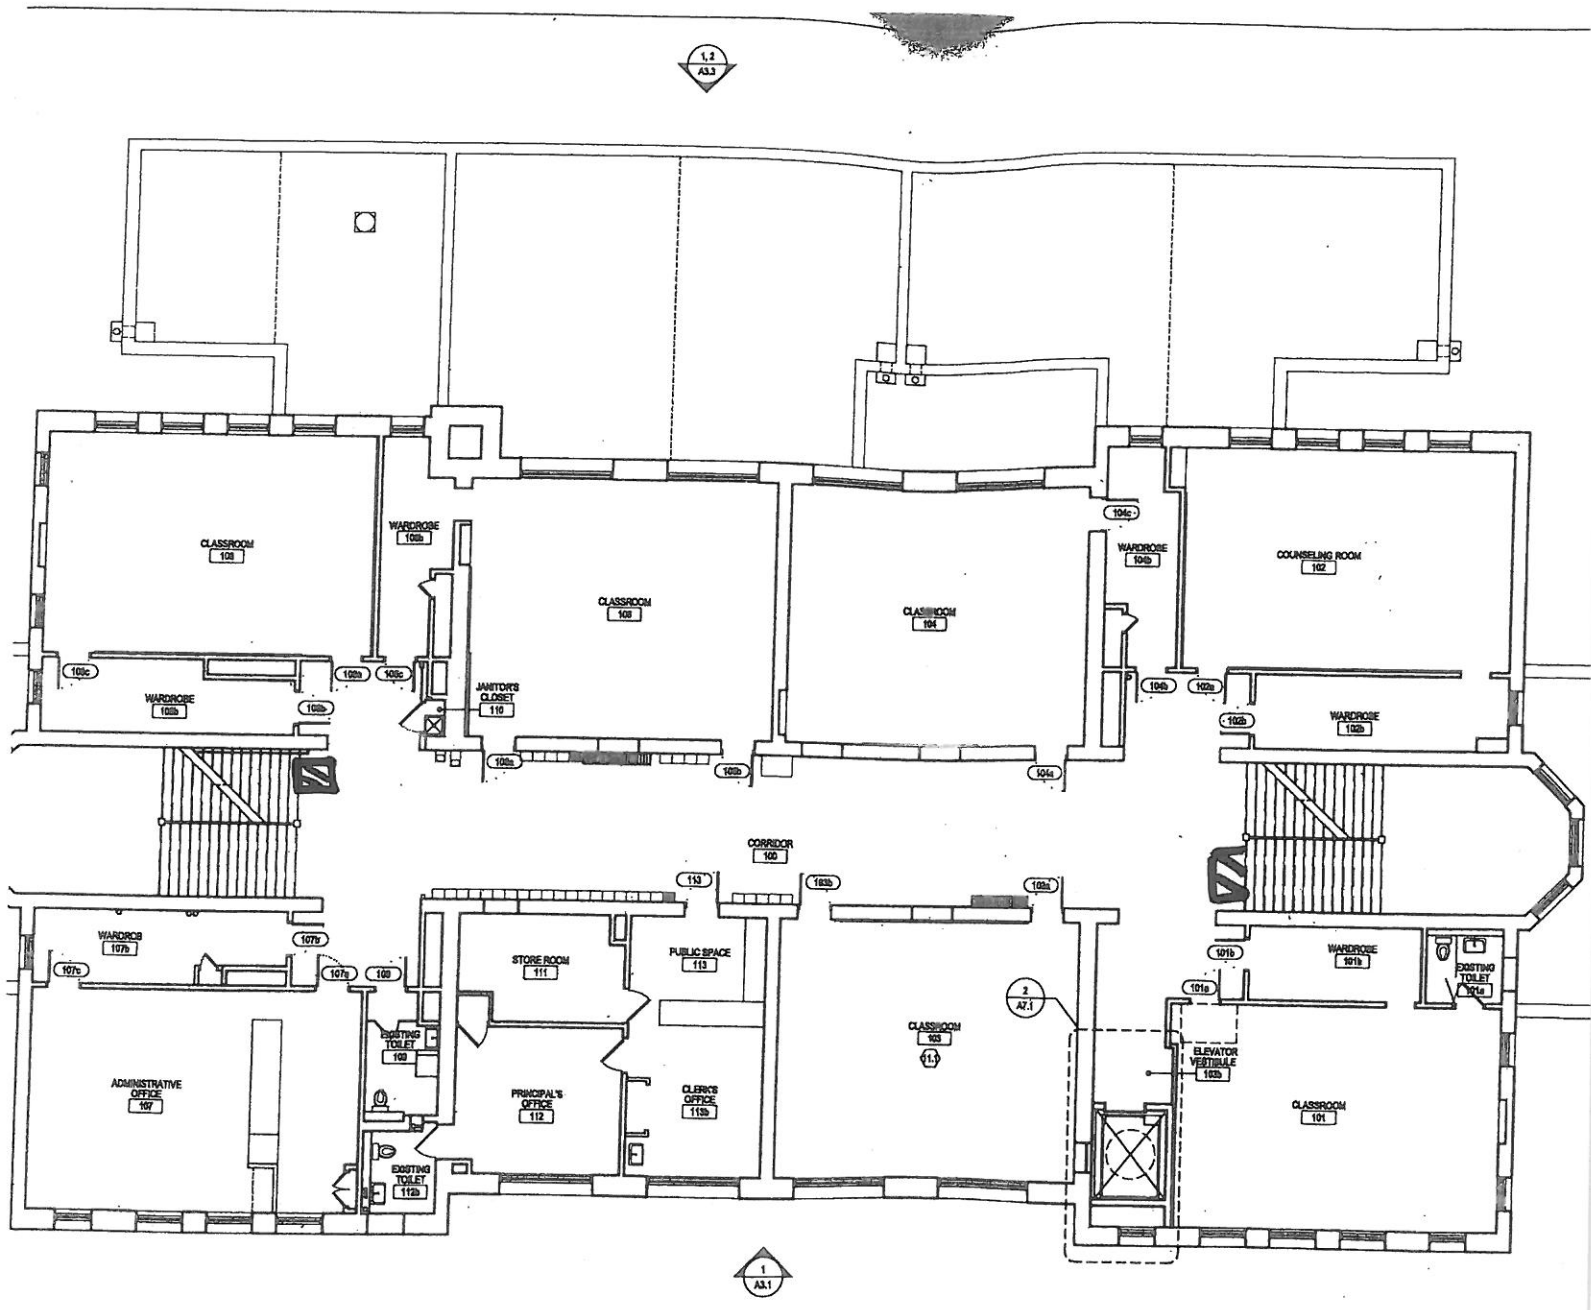

1ST FLOOR

2013 3 YEAR ASBESTOS RE-INSPECTION

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Duct Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:
ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Duct Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

NEW DUCT INSULATION HA # 602

200 S.F.

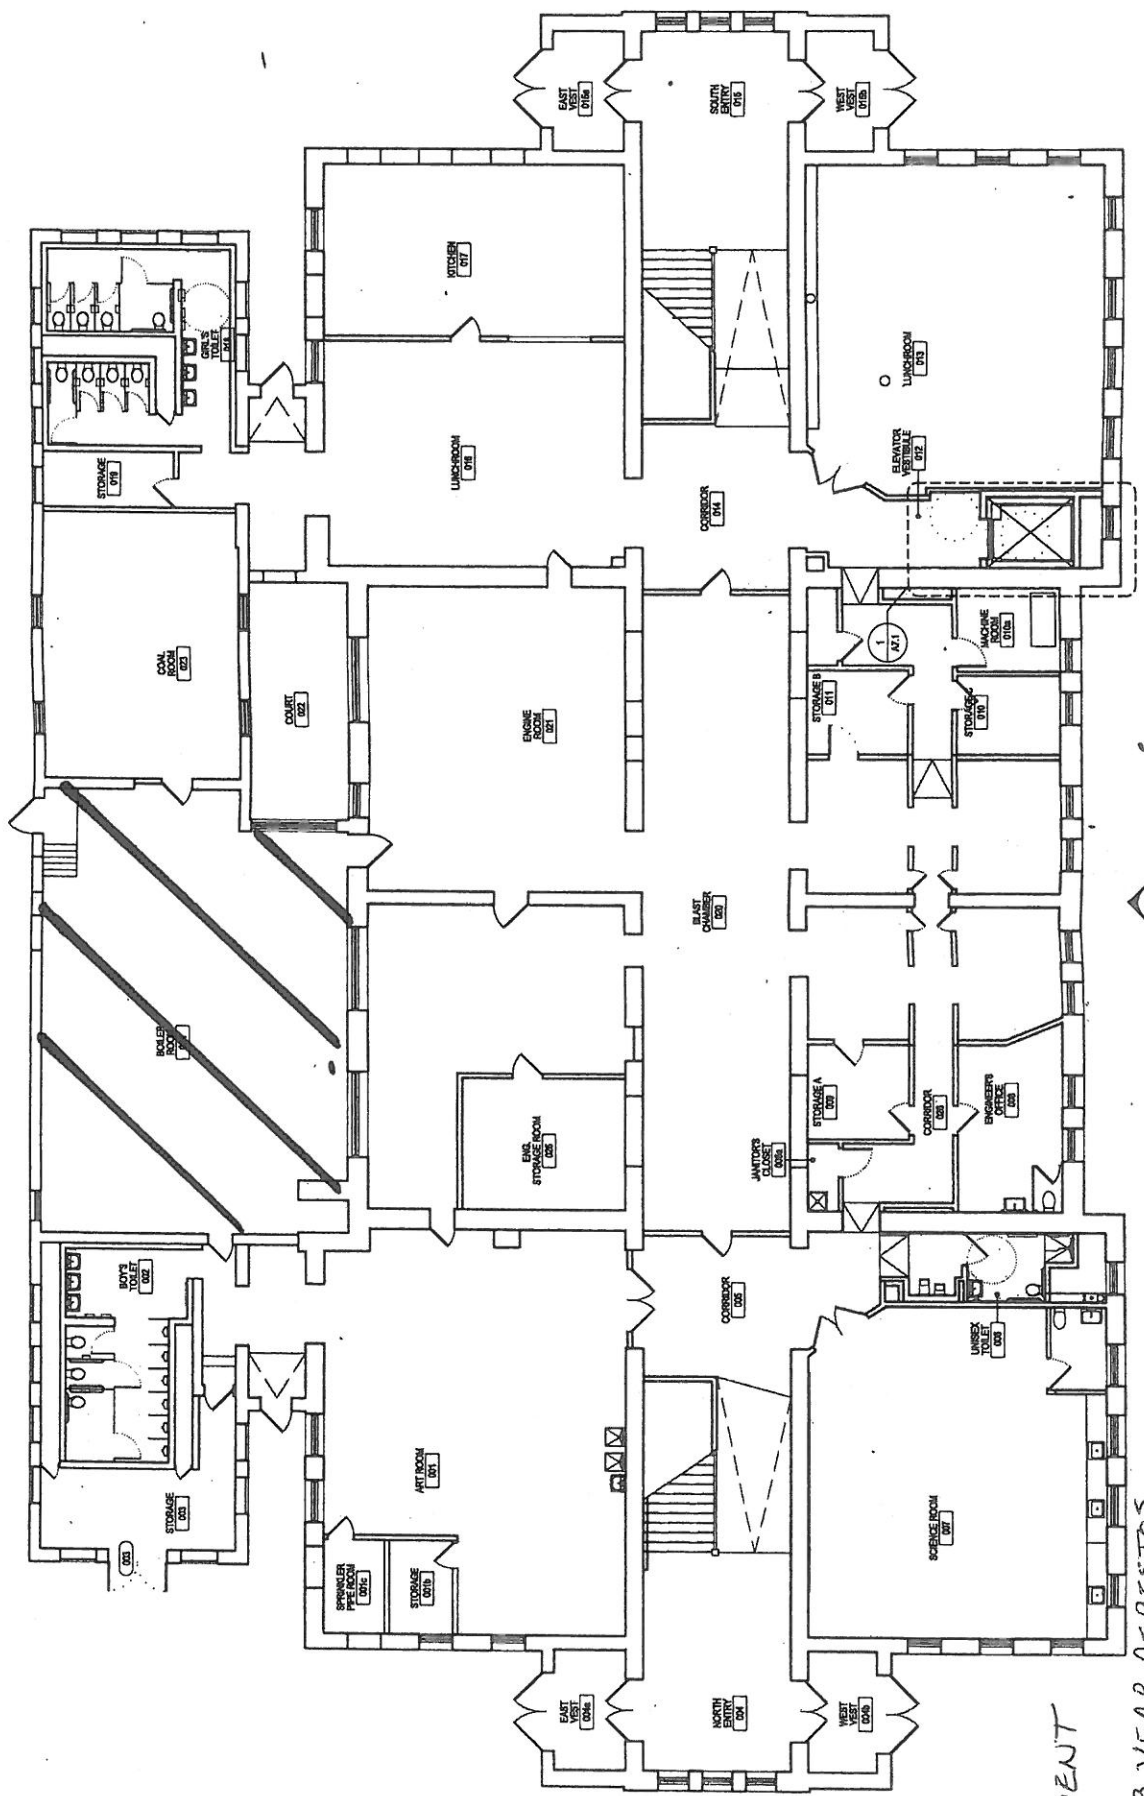

ALCOTT H.S.

BASEMENT

2013 3 YEAR ASBESTOS
DF INSPECTION

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Linoleum Gray**
MATERIAL LOCATION: **Basement Vestibules, Stairway Landings, Corridors, and Offices**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:
New Installation

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Linoleum Gray**
MATERIAL LOCATION: **Basement Vestibules, Stairway Landings, Corridors, and Offices**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

NEW
 HA # 51 - GRAY LINOLEUM
 HA # 52 - GRAY LINOLEUM MASTIC
 750 S.F. EA.

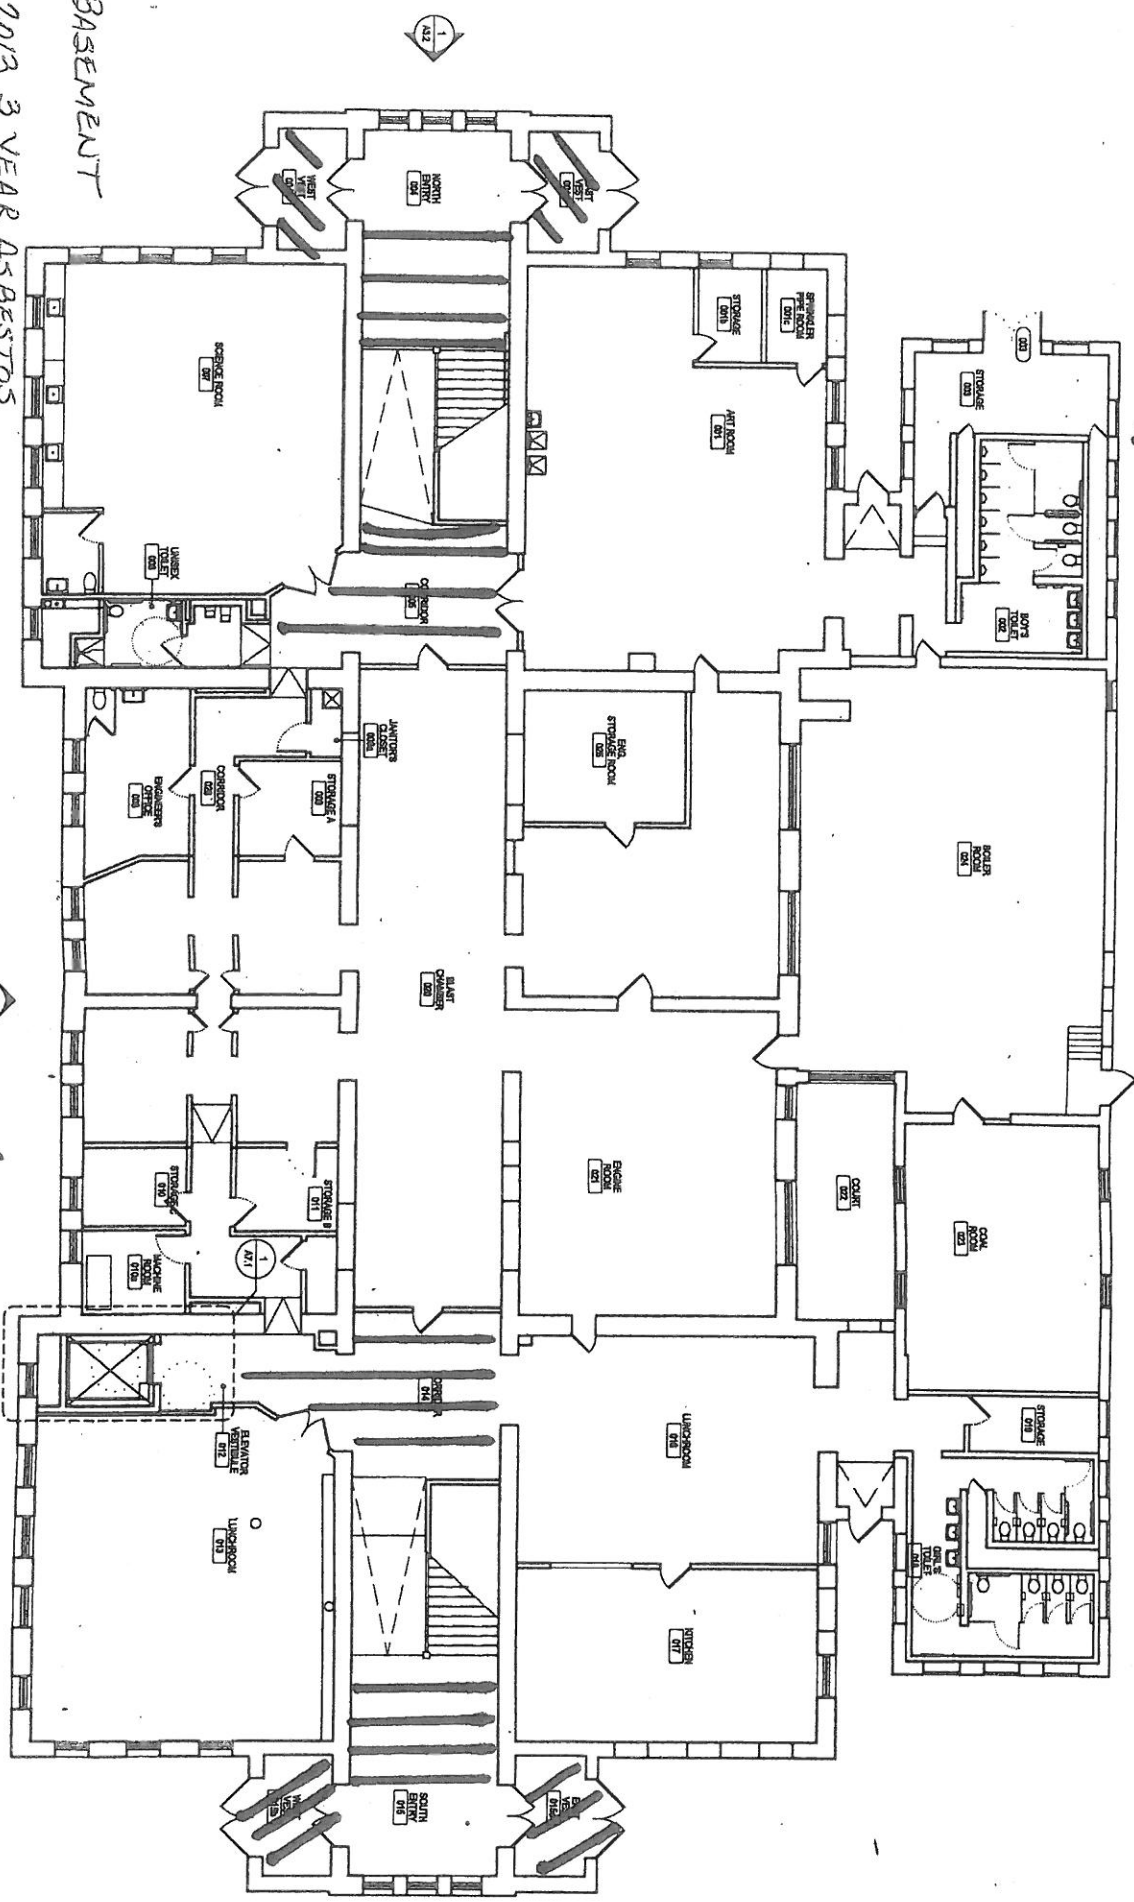


BASEMENT
 2013 3 YEAR ASBESTOS
 DT-114DEFINITION

NEW 51 - GRAY LINOLEUM

HA # 52 - GRAY LINOLEUM MASTIC

750 S.F. EA.

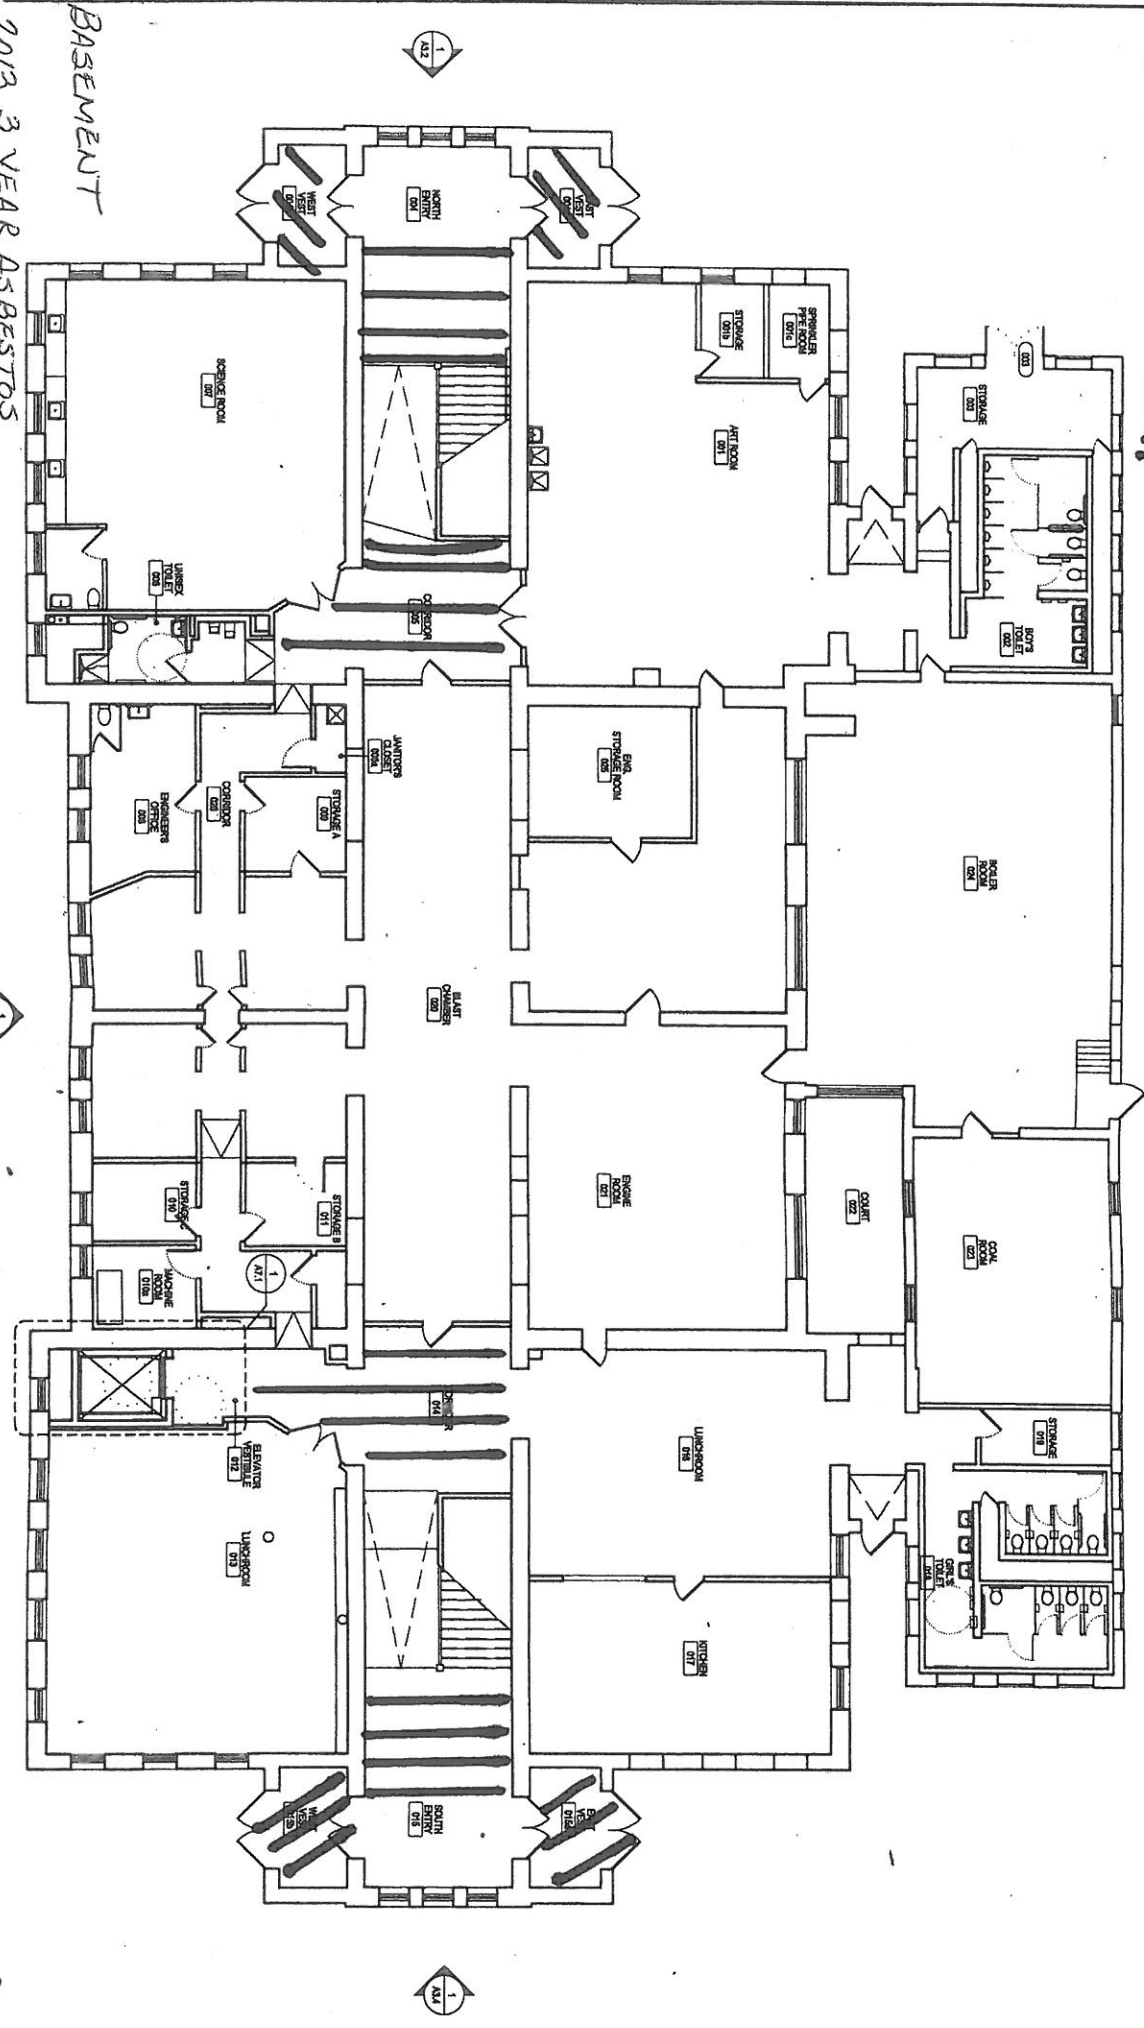

BASEMENT
2013 3 YEAR ASBESTOS
OR IDENTIFICATION

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for
the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **White Vinyl Wall Sheeting**
MATERIAL LOCATION: **Throughout Basement Lower Walls in Lunchrooms, Vestibules, Corridors, and Storage Rooms**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:
ACCESSIBILITY:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Joseph Hennigan

Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **53**

MATERIAL DESCRIPTION: **White Vinyl Wall Sheeting**

MATERIAL LOCATION: **Throughout Basement Lower Walls in Lunchrooms, Vestibules, Corridors, and Storage Rooms**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____




Date: **05/12/2013**

NEW
HA #

53 - WHITE VINYL WALL SHEETING - 1500 S.F.

HA # 53

THROUGHOUT BASEMENT LOWER WAREHOUSE

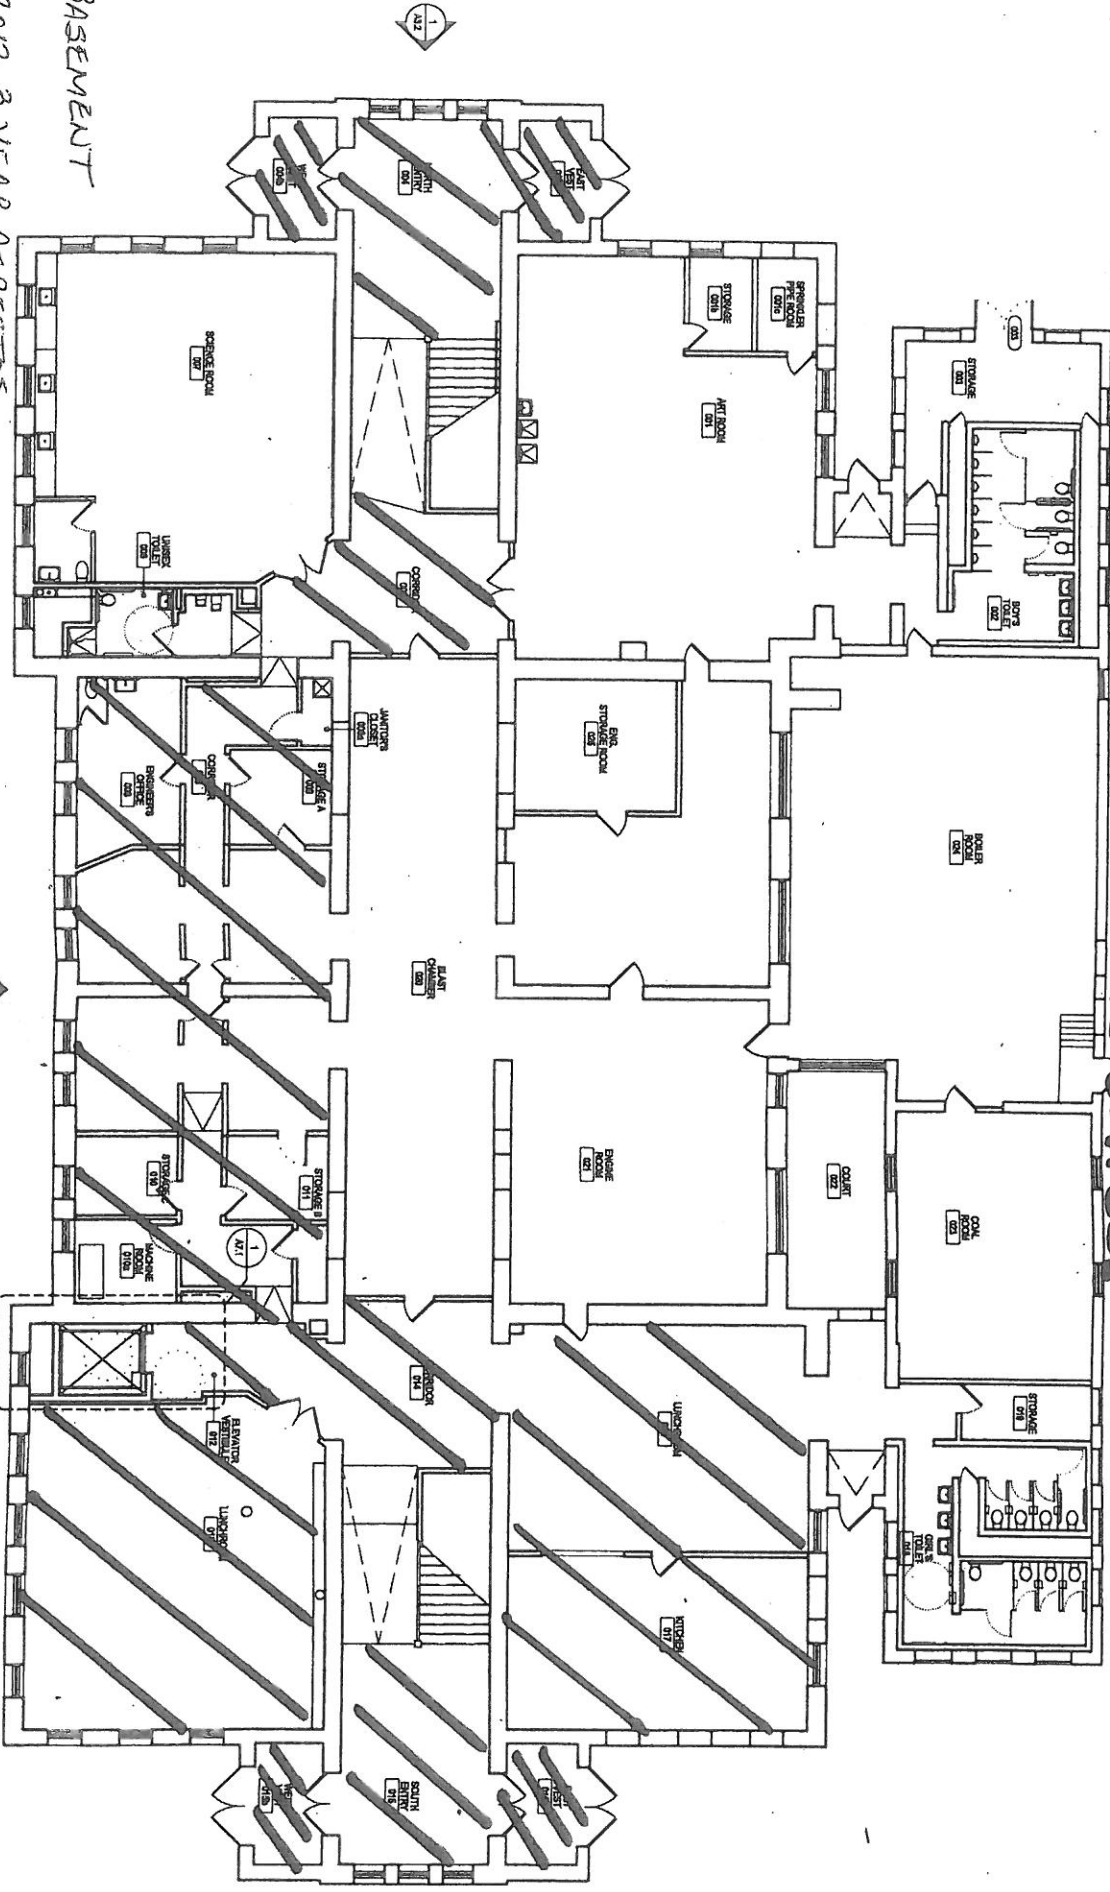

BASEMENT

2013 3 YEAR ASBESTOS
IDENTIFICATION



Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for
the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **White Vinyl Wall Sheeting Adhesive**
MATERIAL LOCATION: **Throughout Basement Lower Walls in Lunchrooms, Vestibules, Corridors, and Storage Rooms**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:
ACCESSIBILITY:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **54**

MATERIAL DESCRIPTION: **White Vinyl Wall Sheeting Adhesive**

MATERIAL LOCATION: **Throughout Basement Lower Walls in Lunchrooms, Vestibules, Corridors, and Storage Rooms**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for
the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard**
MATERIAL LOCATION: **Rooms 007, 012, 013, 017, Lunchroom**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard**
MATERIAL LOCATION: **Rooms 007, 012, 013, 017, Lunchroom**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

NEW 55 - GRAY VINYL BASEBOARD
HA # 56 - MASTIC ASSOCIATED WITH
HA # 55

150 L.F.

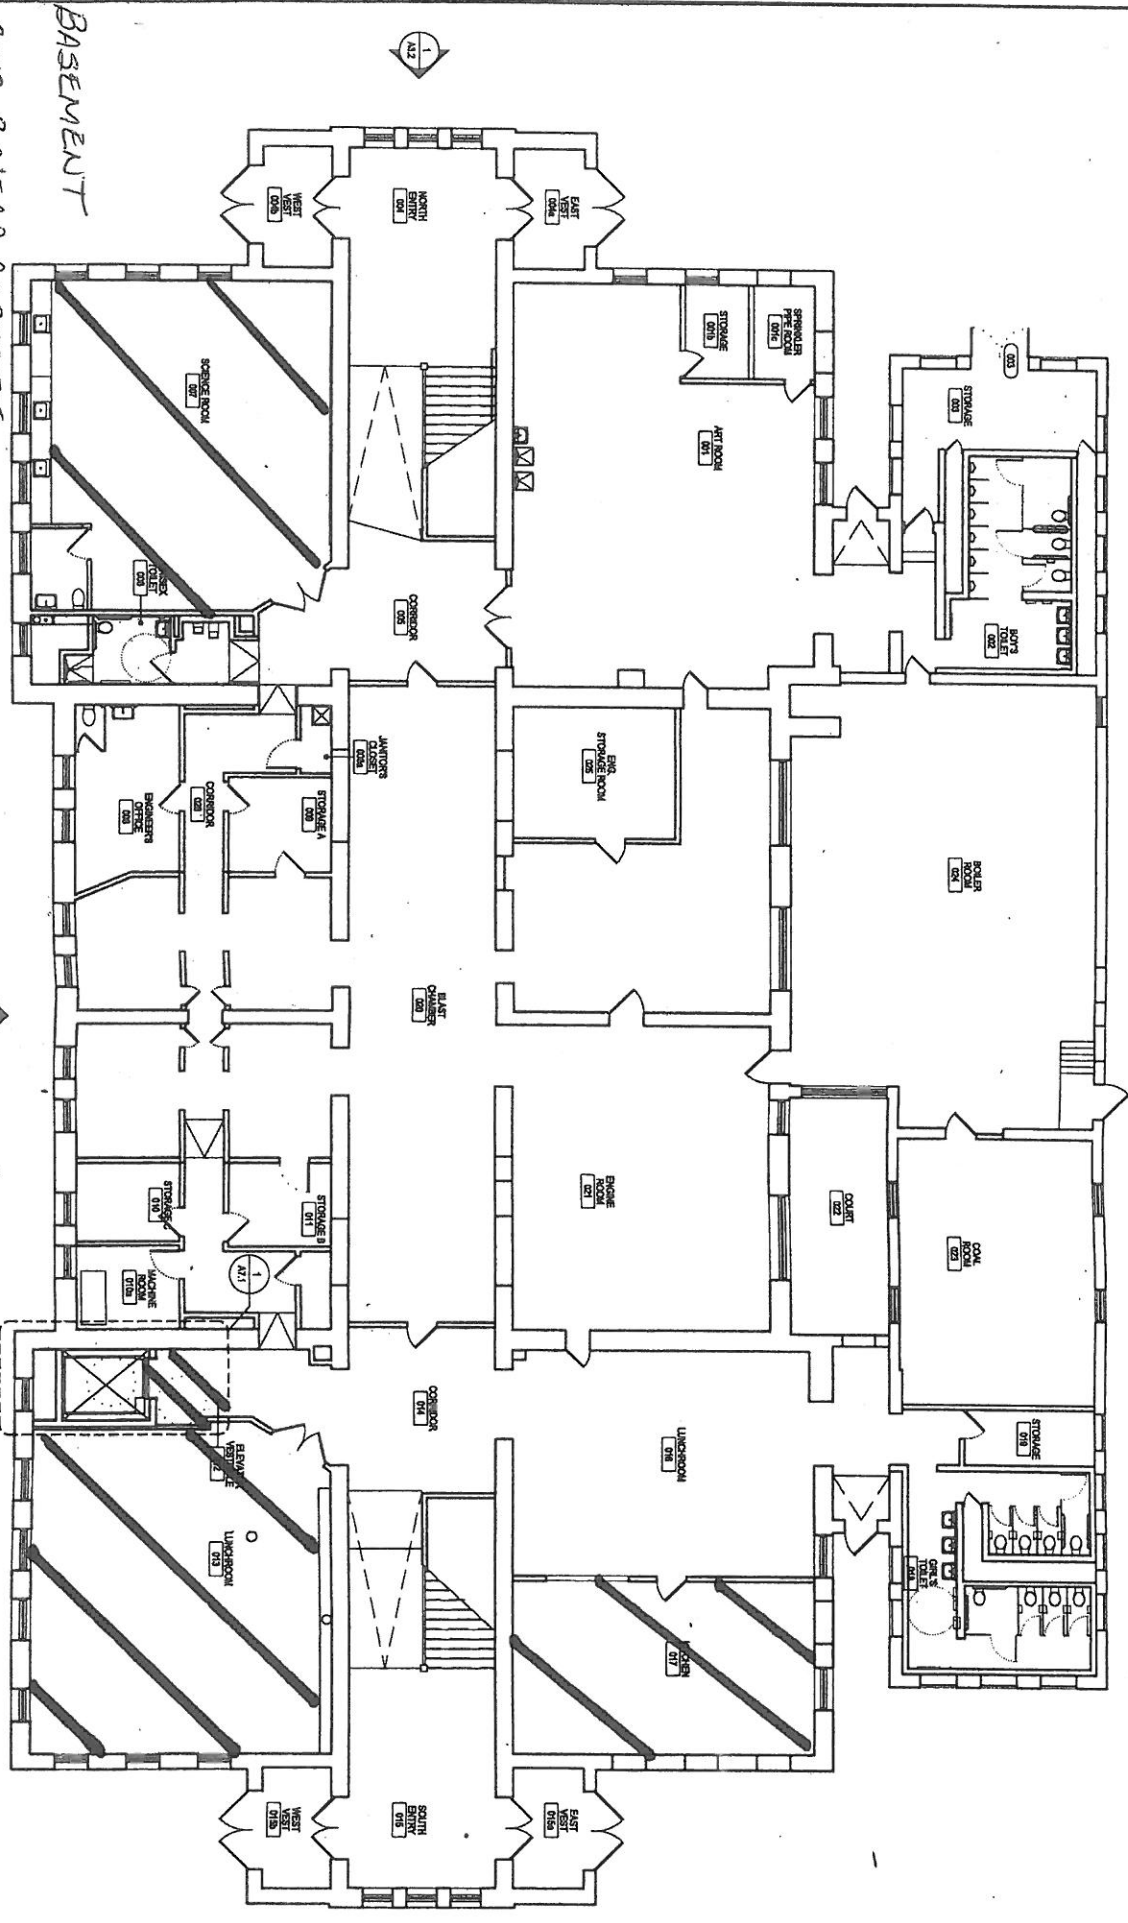

BASEMENT
2013 3 YEAR ASBESTOS
DI-11-DEFECTION

ALCOTT H 9

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **Linoleum White w/Orange and Gray Specks (Mastic)**
MATERIAL LOCATION: **Rooms 206b, 208**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:
New Installation

Inspector's Signature: _____

Joseph Hennigan

Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **Linoleum White w/Orange and Gray Specks (Mastic)**
MATERIAL LOCATION: **Rooms 206b, 208**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

2ND FLOOR
2013 3 YEAR ASBESTOS
RE-INSPECTION

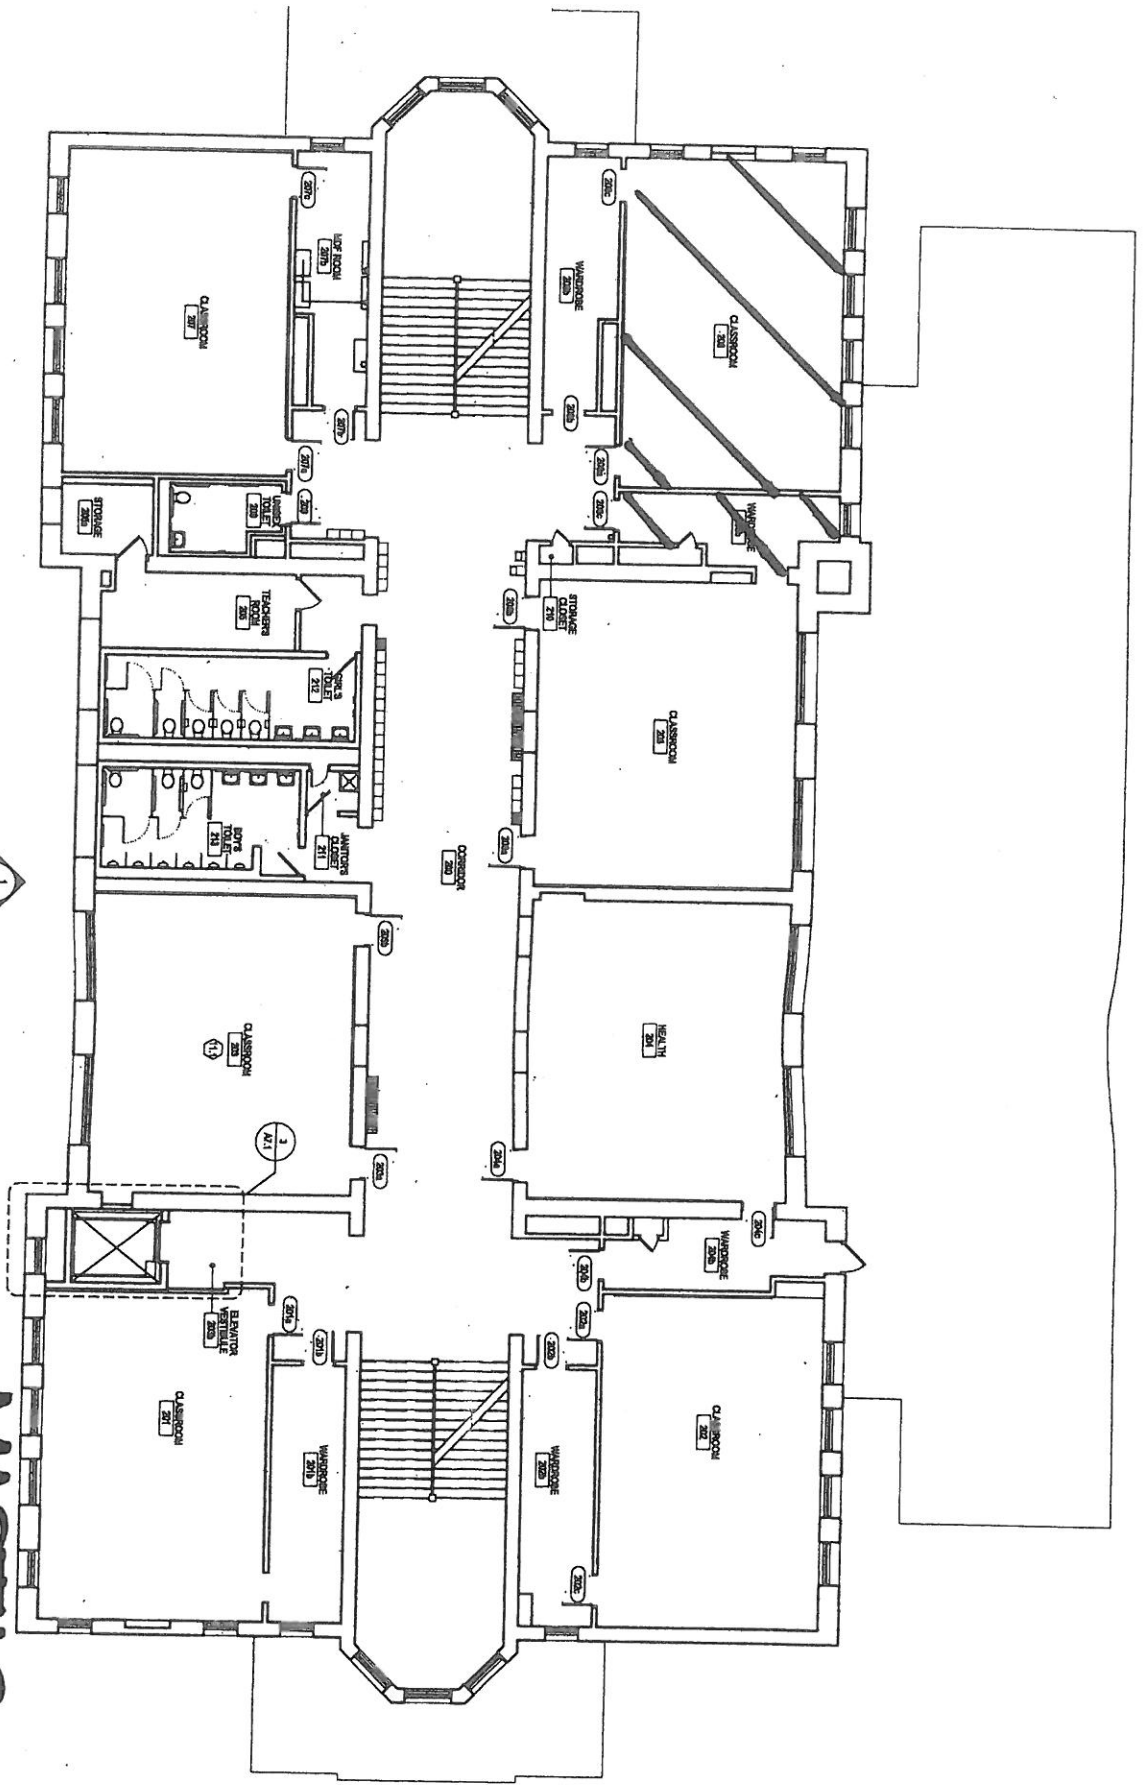

NEW HA # 45 - MASTIC - FOR
WHITE WITH ORANGE
+ GRAY SPECKS 950 S.F.



Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12"x12" Cream w/Tan Streaks VFT (Mastic)**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **180** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**


NEW HA # 50 - MASTIC

ASSOC. WITH

NEW HA # 49

CREAM WITH TAN VET.

180 S.F.

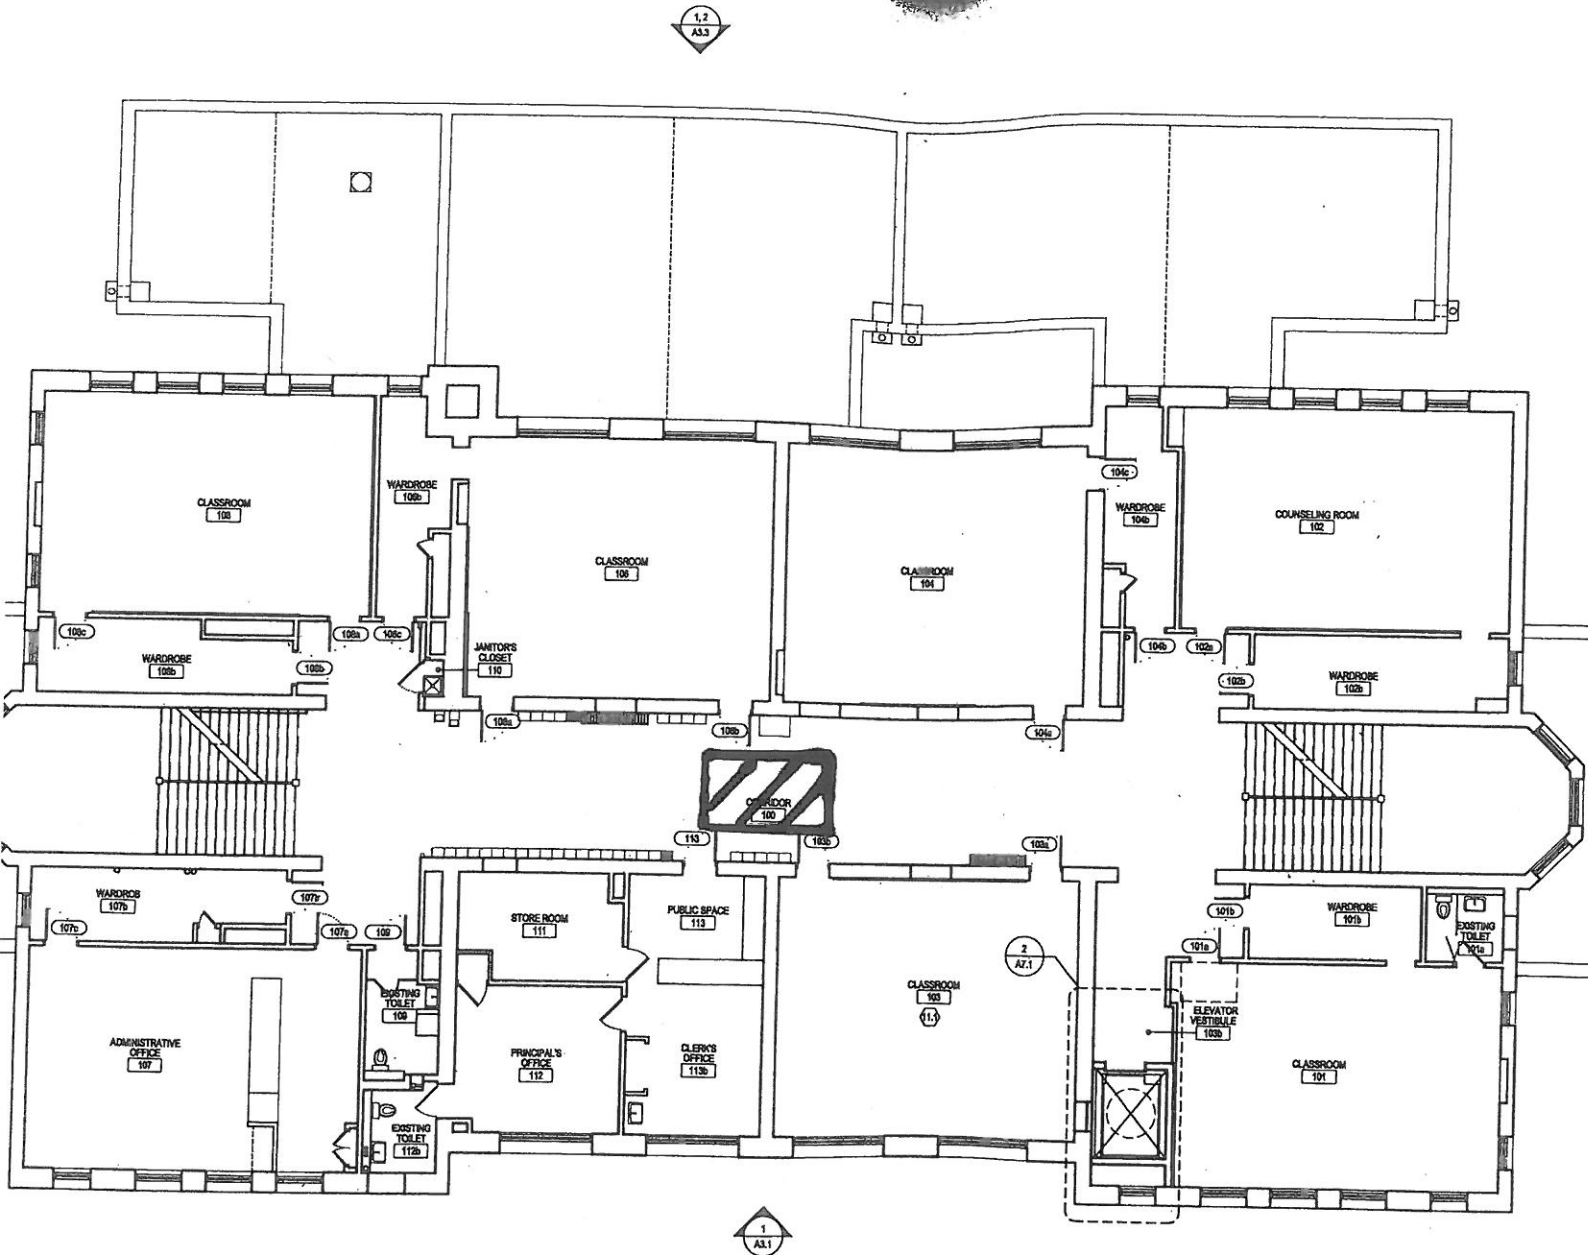

1ST FLOOR

2013 3 YEAR ASBESTOS
RE-INSPECTION

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **Gray Rubber Skid Proof Floor (Mastic)**
MATERIAL LOCATION: **Top of Corridor Landings at Stairwells 1st, 2nd, 3rd Floor**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:
New Installation 2009/10 CIP

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **Gray Rubber Skid Proof Floor (Mastic)**
MATERIAL LOCATION: **Top of Corridor Landings at Stairwells 1st, 2nd, 3rd Floor**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**


NEW-63 - GRAY RUBBER
HA # - 63

240 S.F.
EACH

NEW
HA # - 64

MASTIC ASSOCIATED WITH HA # 63

SKID PROOF
FLOORING

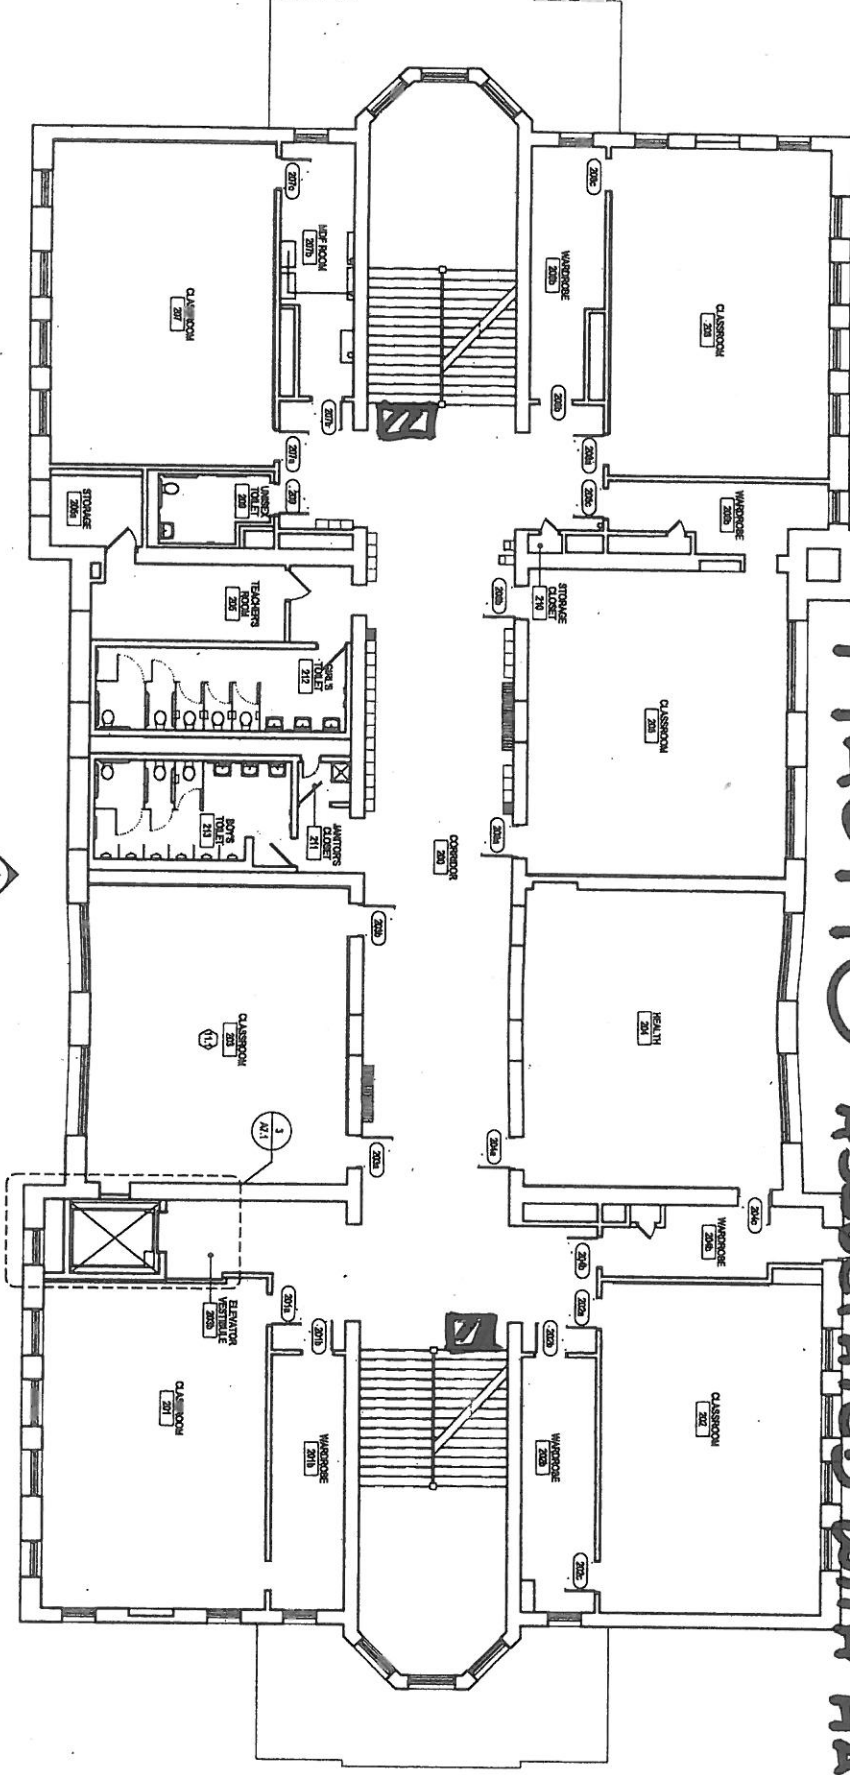


2ND FLOOR

2013 3 YEAR ASBESTOS
RE-INSPECTION

NEW - 63 - GRAY RUBBER
 HA# - 63 - SKID PROOF
 FLOORING
 NEW - 64 - MASTIC ASSOC. WITH HA# 63

240 S.F.
 EACH

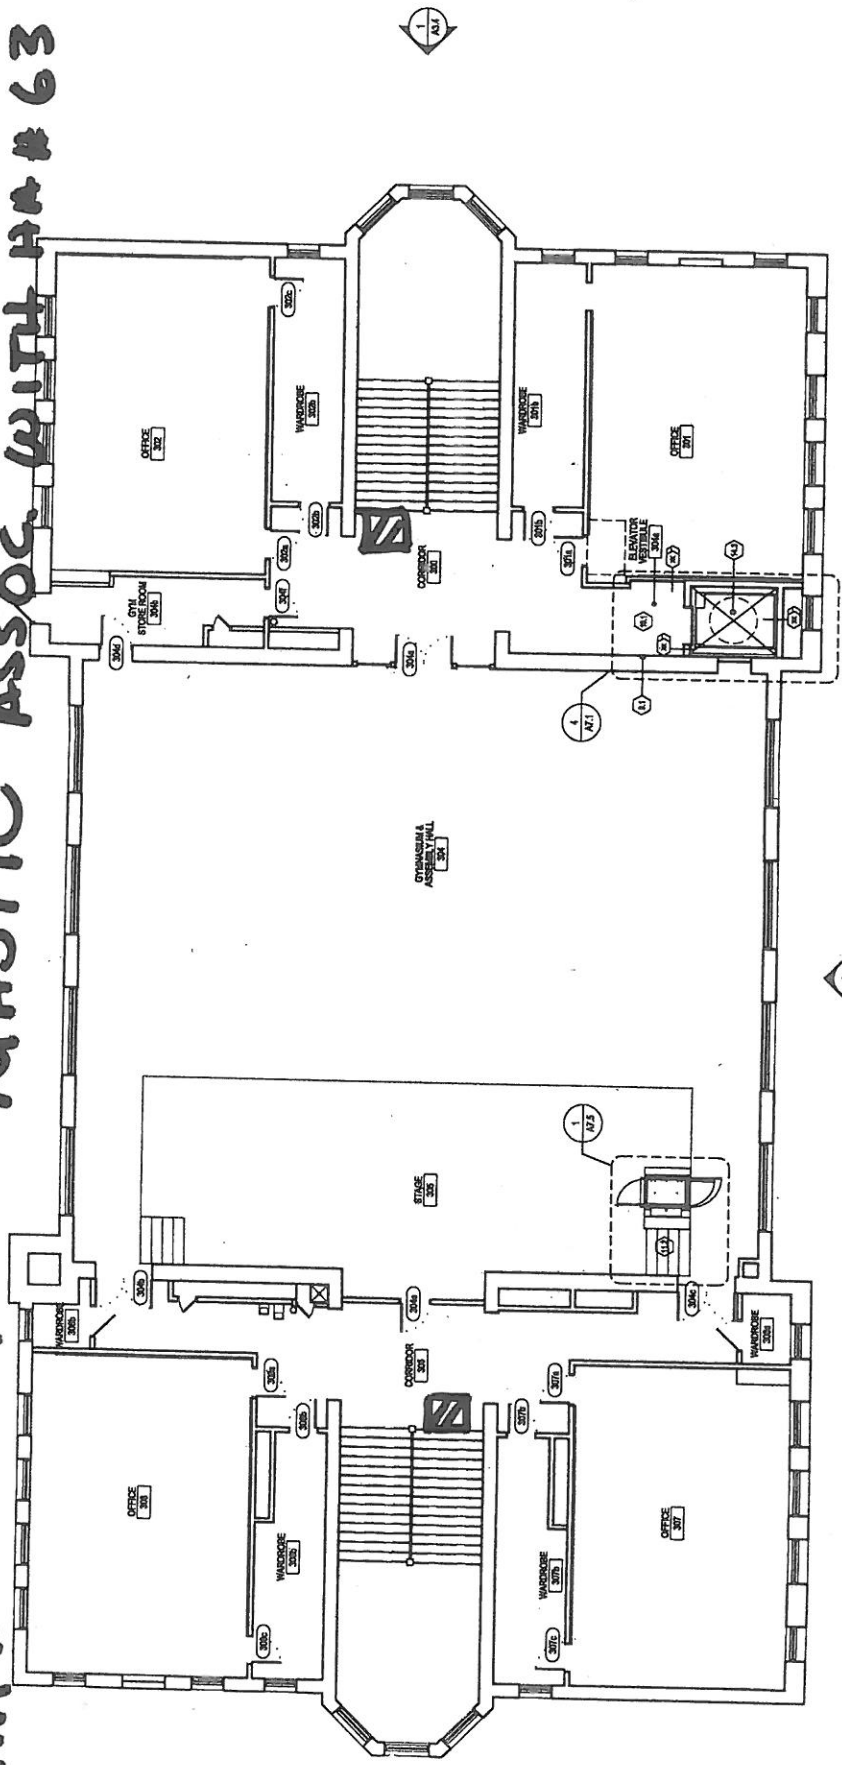


1 THIRD FLOOR PLAN

3RD FLOOR
 2013 3 YEAR ASBESTOS
 RE-INSPECTION

NEW HA # 63 - GRAY RUBBER SKID PROOF FLOORING

240 S.F. EACH

NEW HA # 64 - MASTIC ASSOCIATED WITH HA # 63

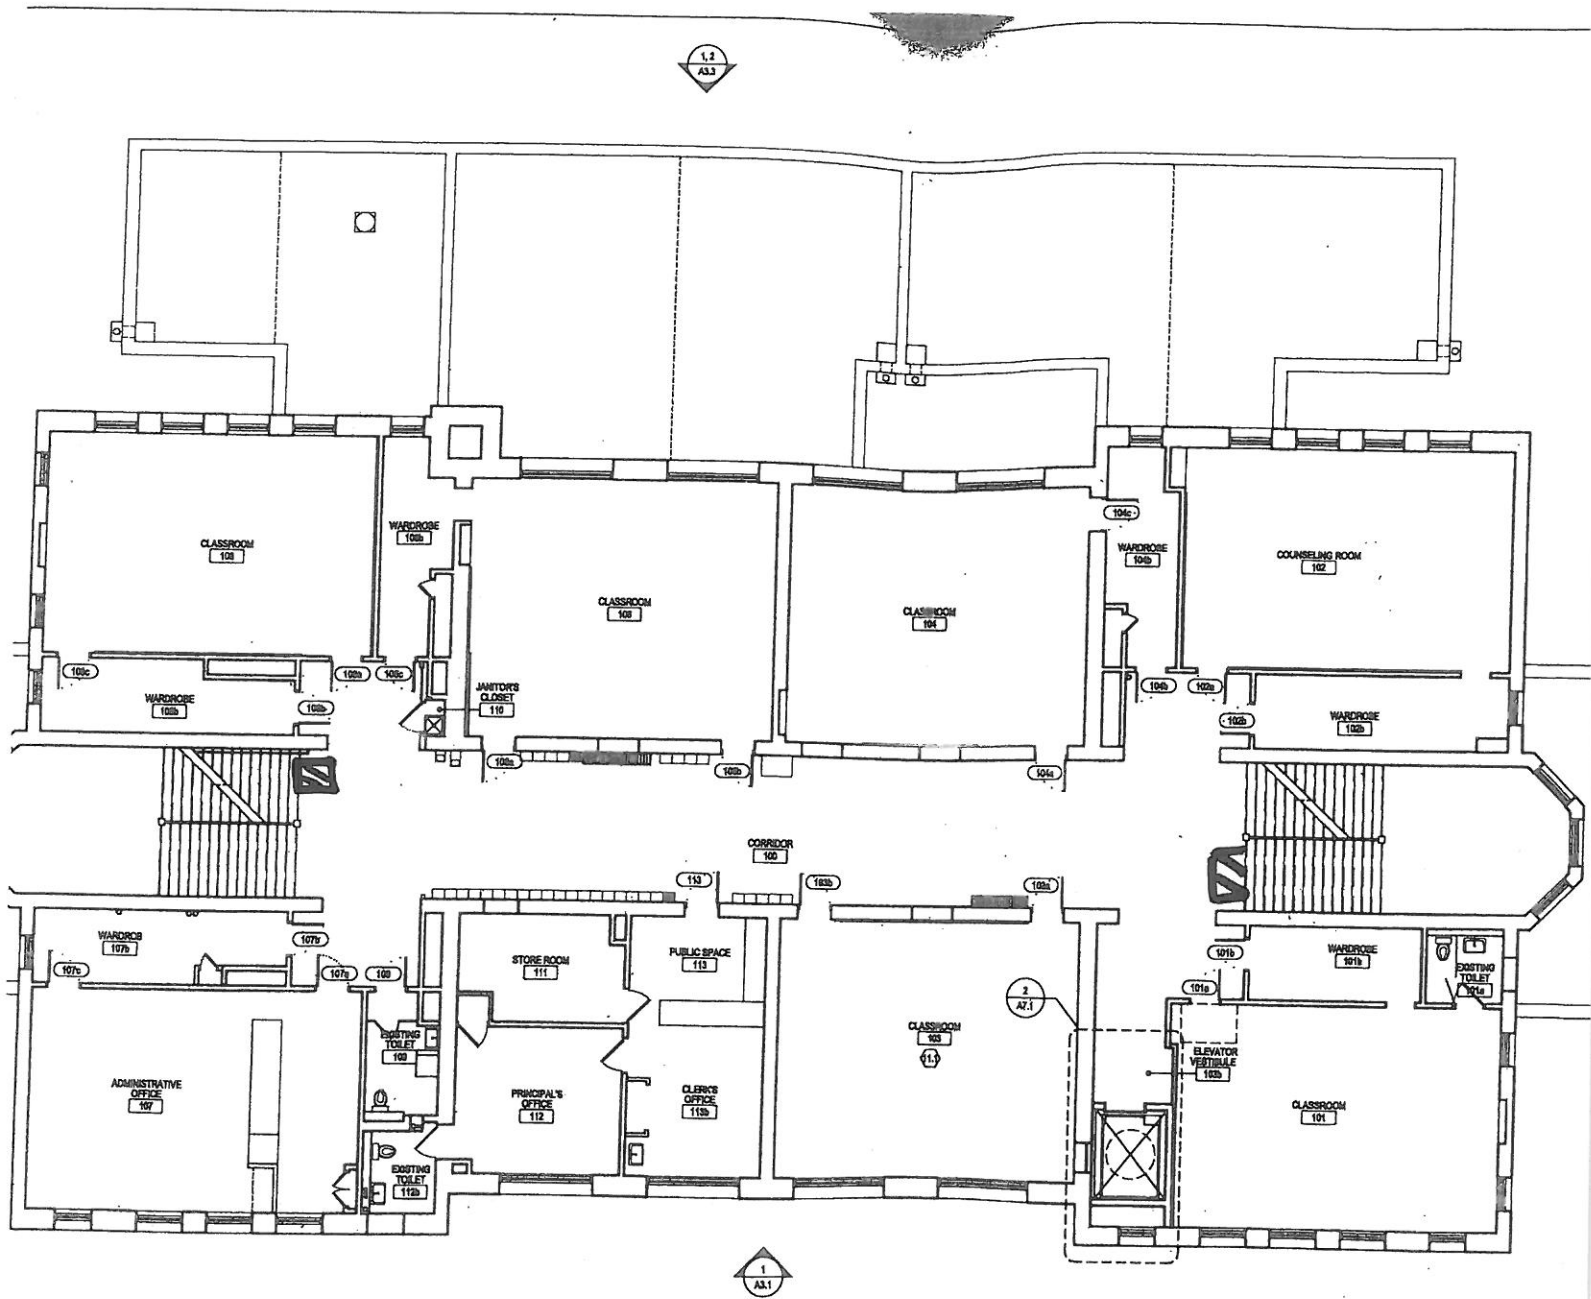

1ST FLOOR

2013 3 YEAR ASBESTOS RE-INSPECTION

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for
the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **Gray Sink Spray-On Undercoating**
MATERIAL LOCATION: **Room 007**
MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **57**

MATERIAL DESCRIPTION: **Gray Sink Spray-On Undercoating**

MATERIAL LOCATION: **Room 007**

MATERIAL QUANTITY: **15** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

NEW HA# 57 - GRAY SPRAY ON SINK UNDERCOATING

15 S.F.

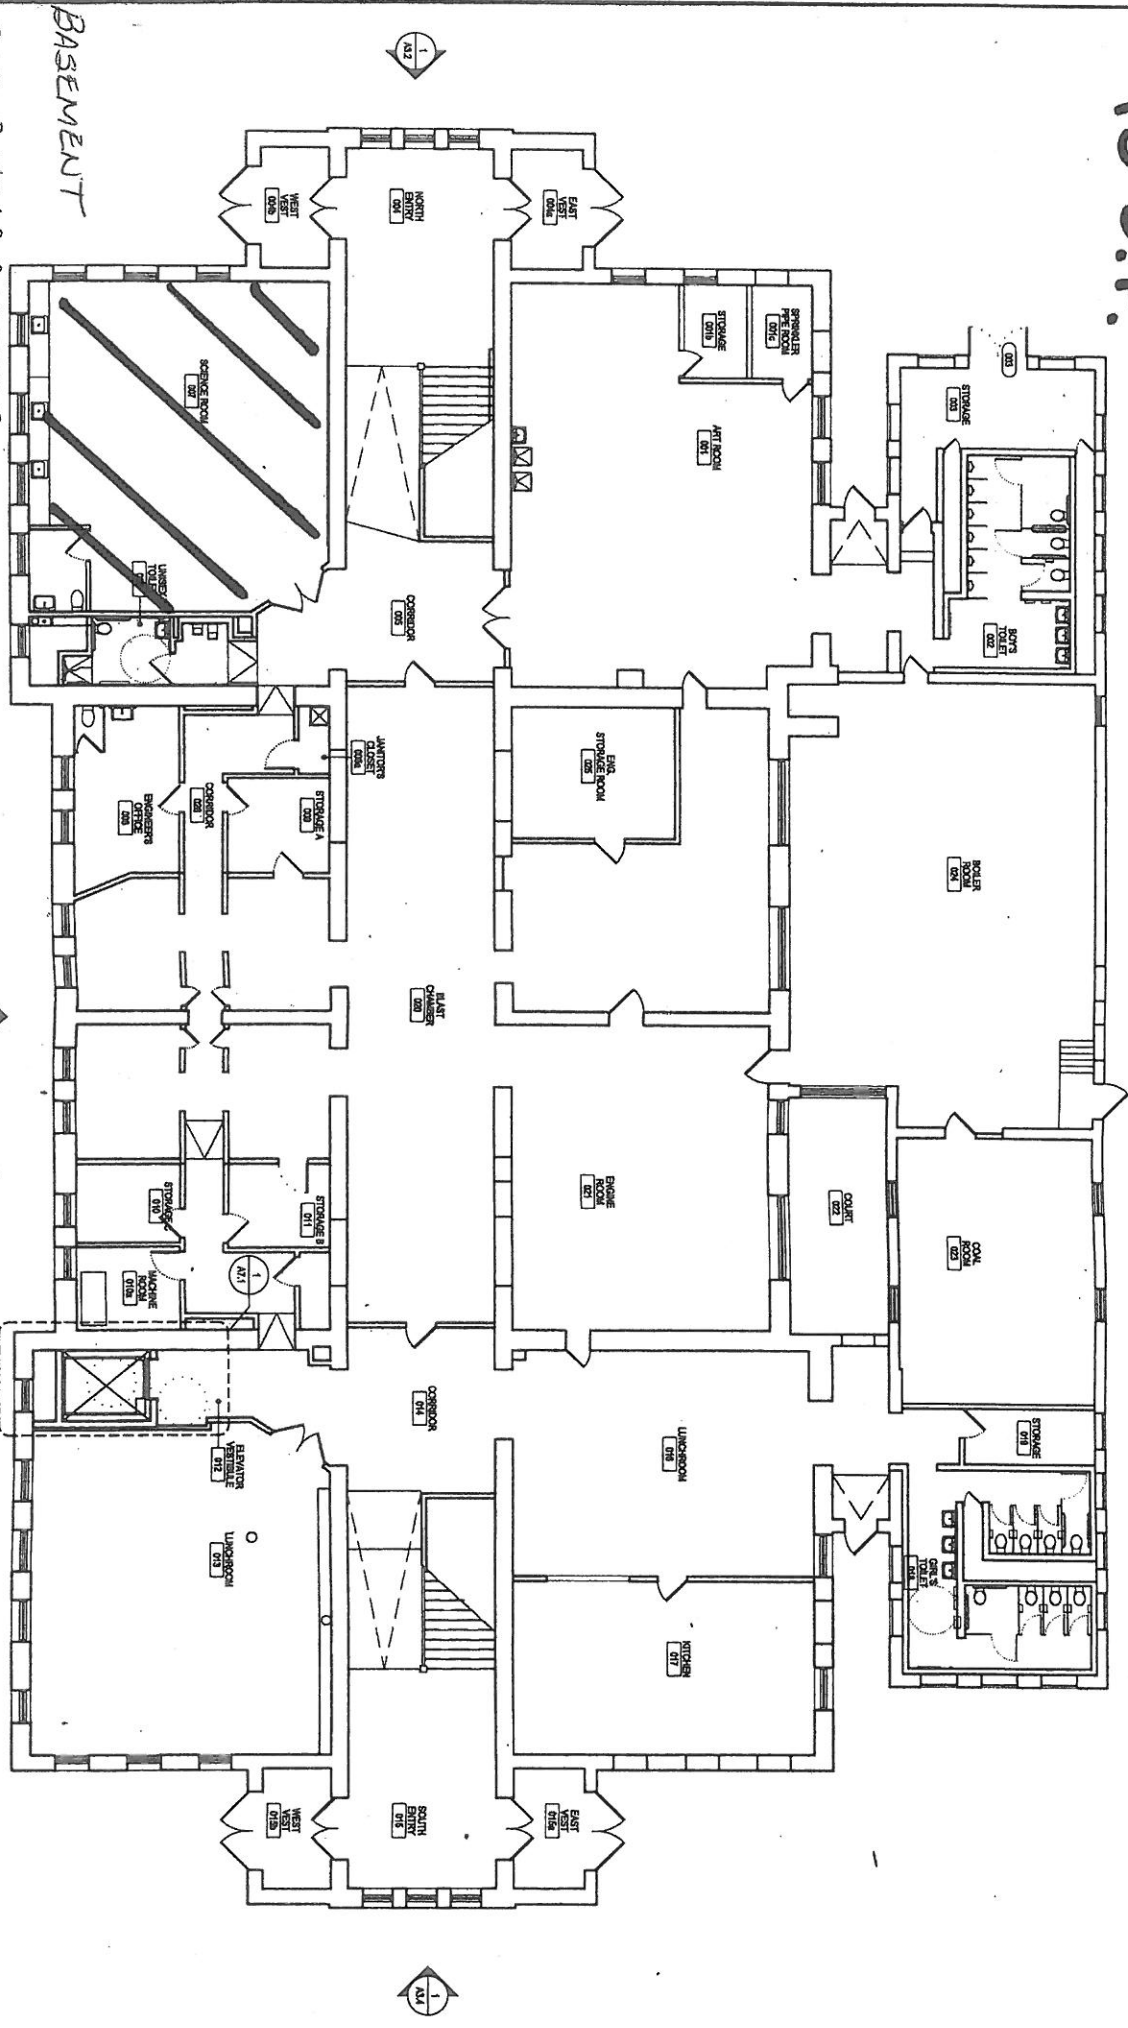

BASEMENT
2013 3 YEAR ASBESTOS
DI-111-DEFLECTION

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout Basement, Corridors, and Offices**
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:
New Installation

Inspector's Signature: _____

Joseph Hennigan

Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout Basement, Corridors, and Offices**
MATERIAL QUANTITY: **7500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature:  Date: **05/12/2013**

NEW 58 - DRYWALL
HA# 59 - DRYWALL COMPOUND

7500 S.F.

THROUGHOUT BASEMENT OFFICES +

CORRIDORS

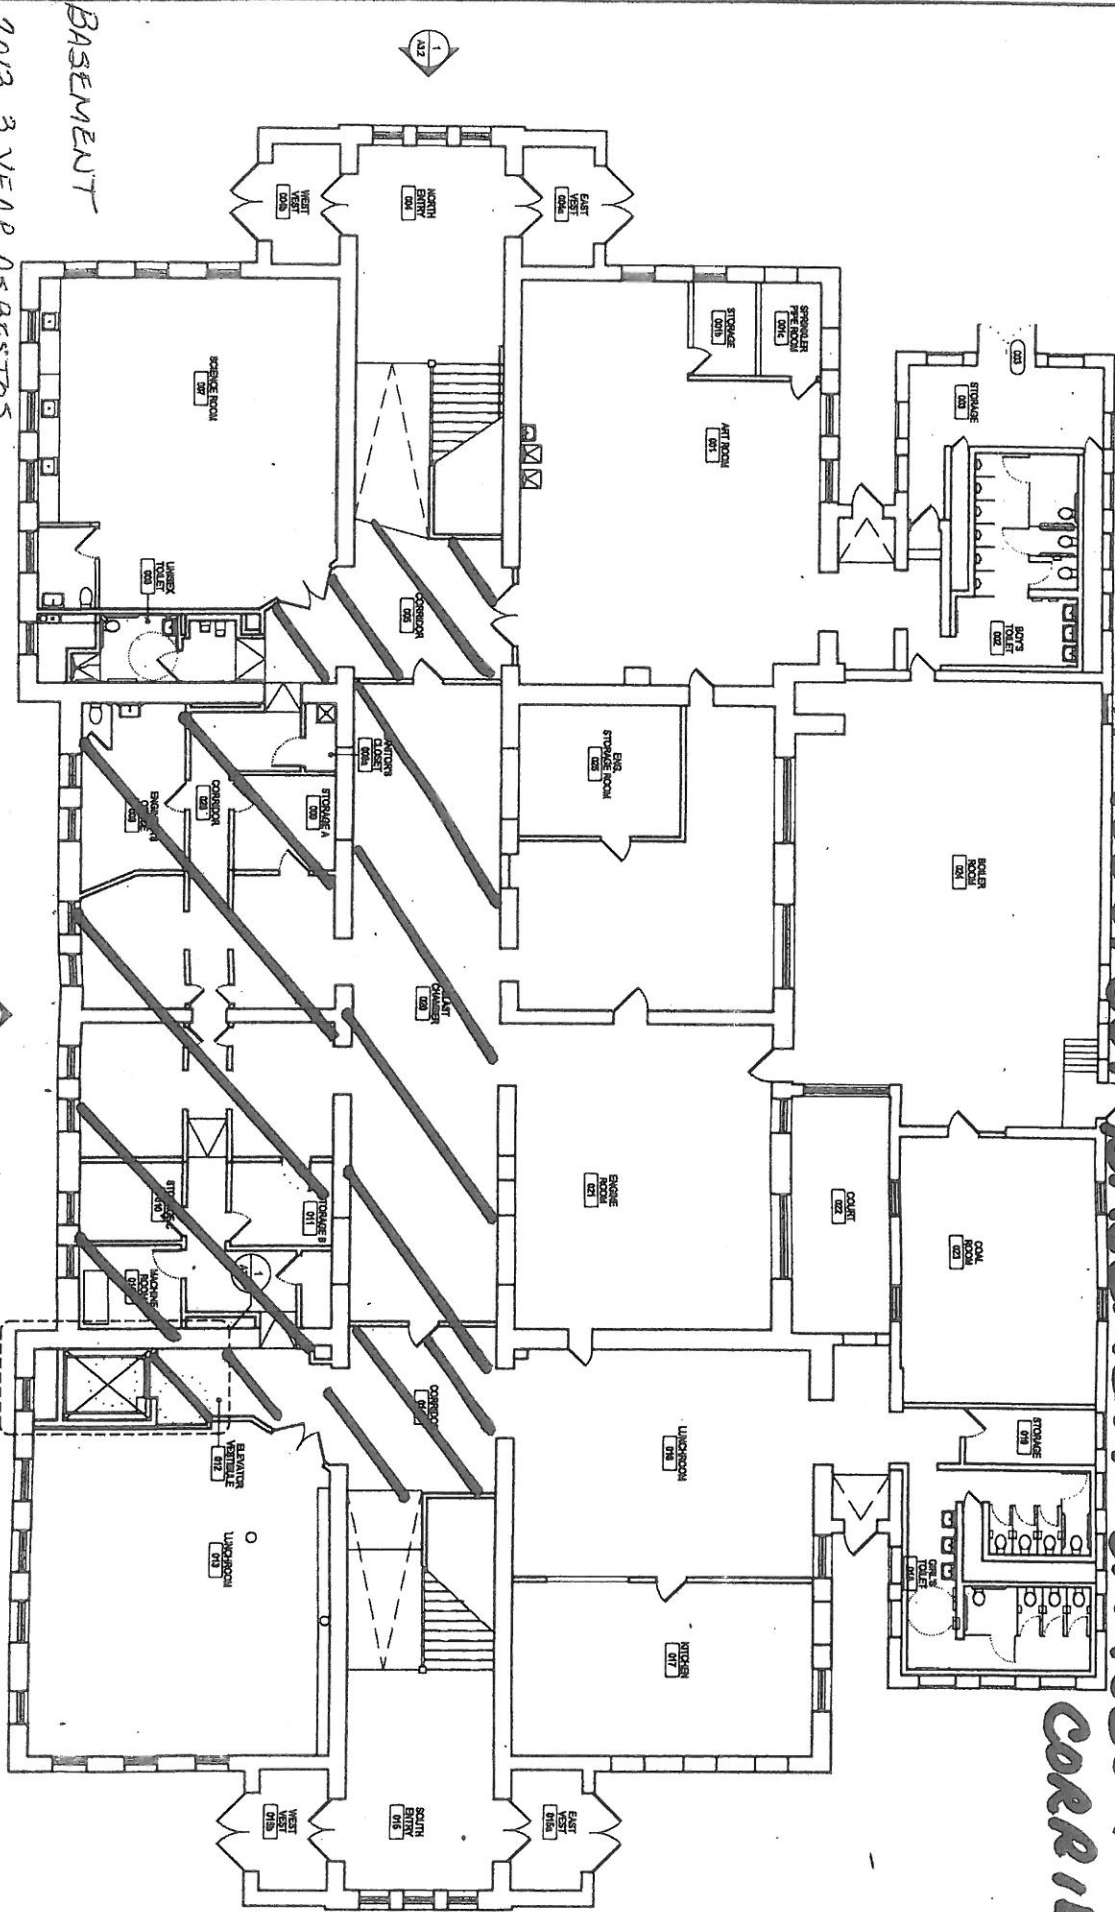

BASEMENT


2013 3 YEAR ASBESTOS
DF 1115DEFINITION

NEW 58 - DRYWALL
HA # 59 - DRYWALL COMPOUND

7500 S.F.

THROUGHOUT BASEMENT OFFICES +

CARRIDGES

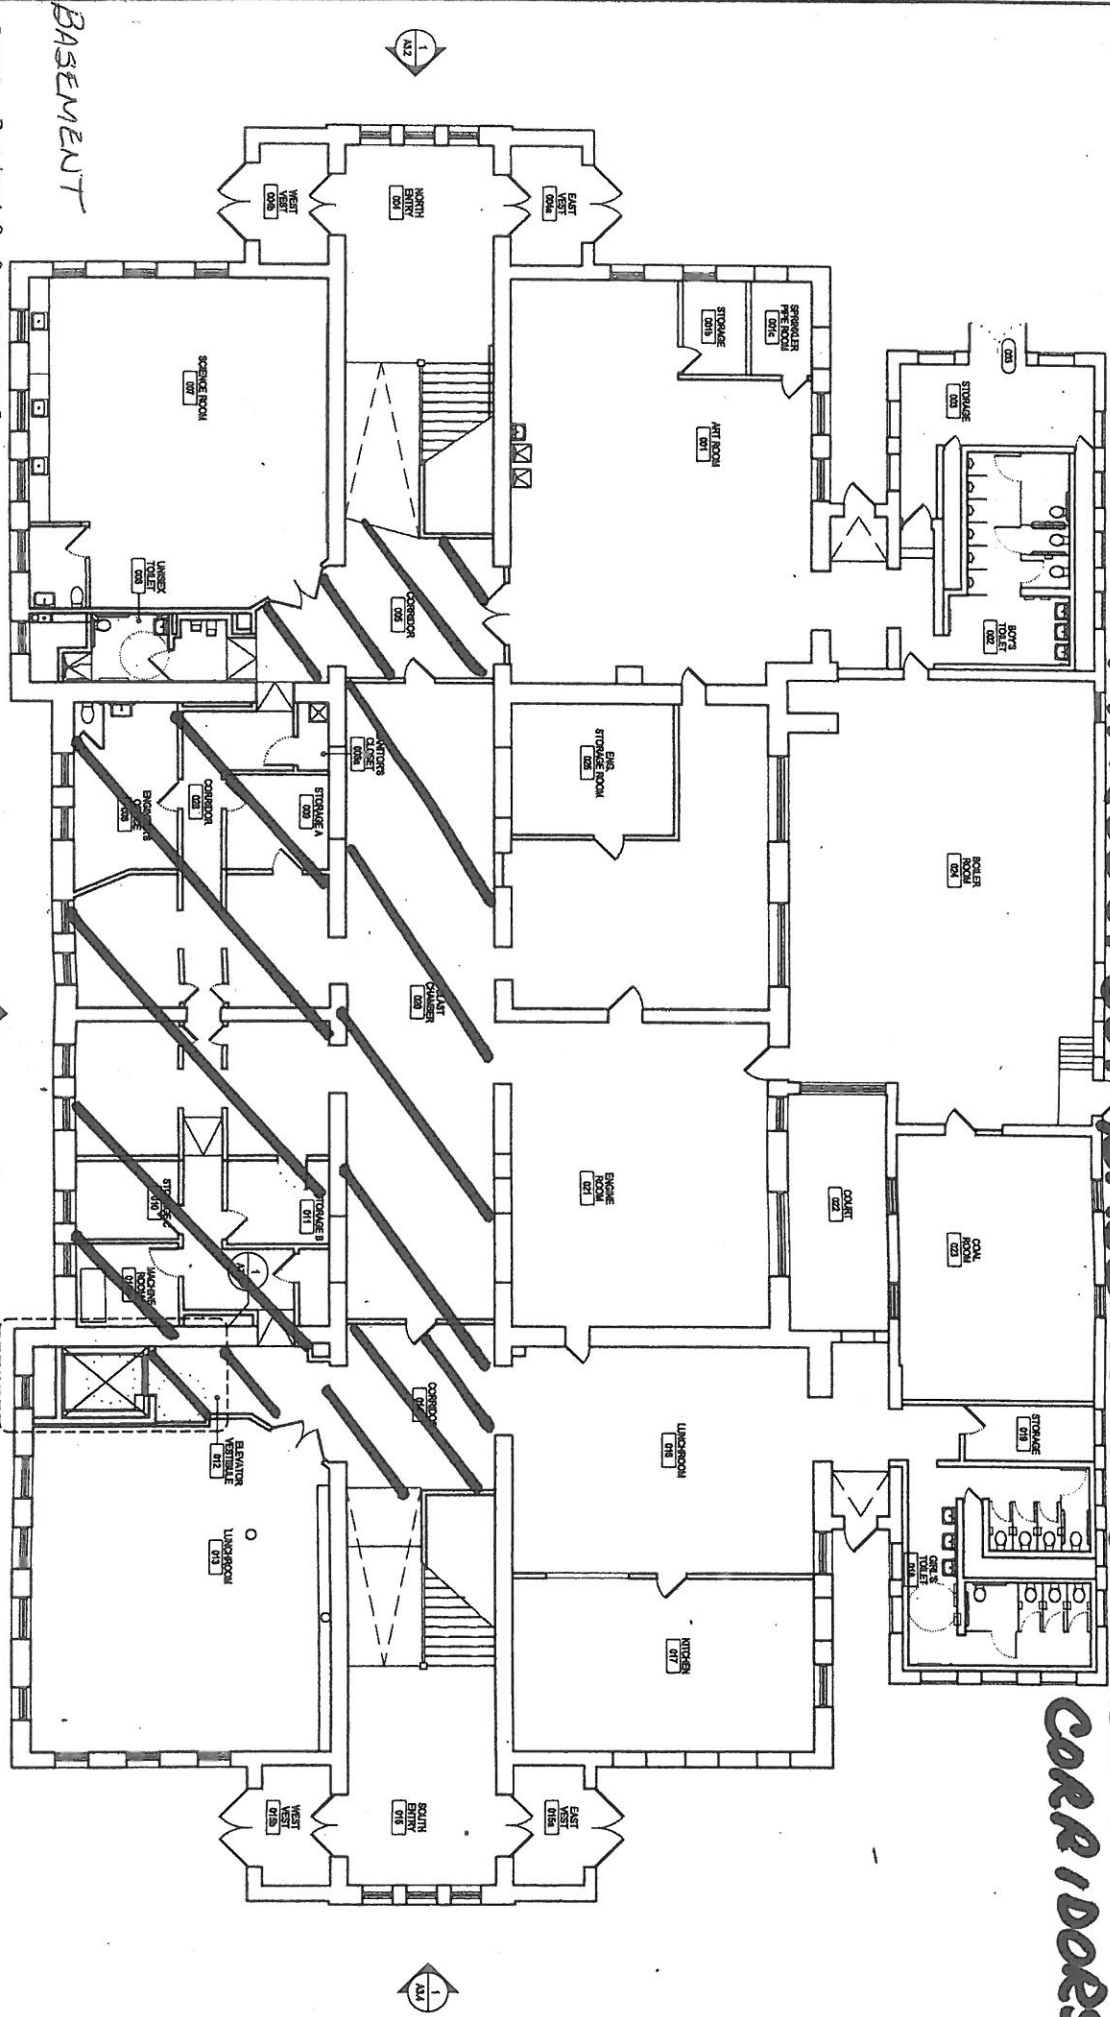

BASEMENT
2013 3 YEAR ASBESTOS
DT-111 DEFECTIVE

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for
the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12"x12" Tan w/Light Brown and White Streaks VFT**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:
New Installation

Inspector's Signature: _____

Joseph Hennigan

Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12"x12" Tan w/Light Brown and White Streaks VFT**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

NEW HA # 42 - VCT -

12" x 12"


TAN WITH LT. BROWN + WHITE STREAKS

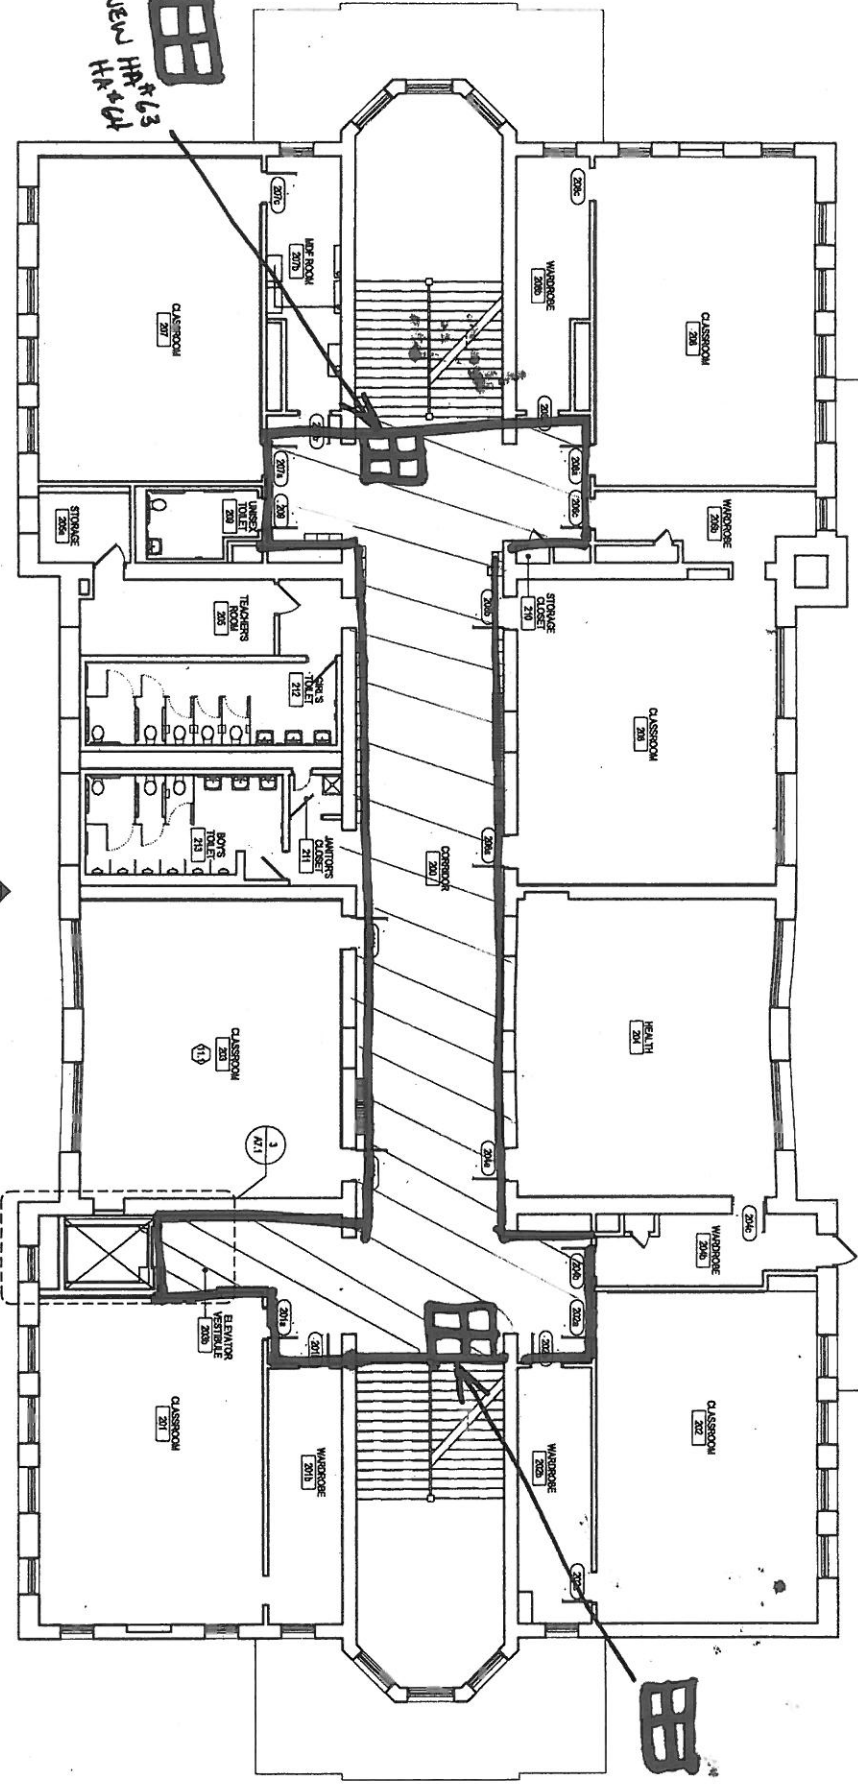

2ND FLOOR
2013 3 YEAR ASBESTOS
RE-INSPECTION

NEW HA # 43

NEW HA # 42 - VFT
 NEW HA # 43 - MASTIC
 12" X 12" TAN WITH
 LT. BROWN + WHITE
 STREAKS

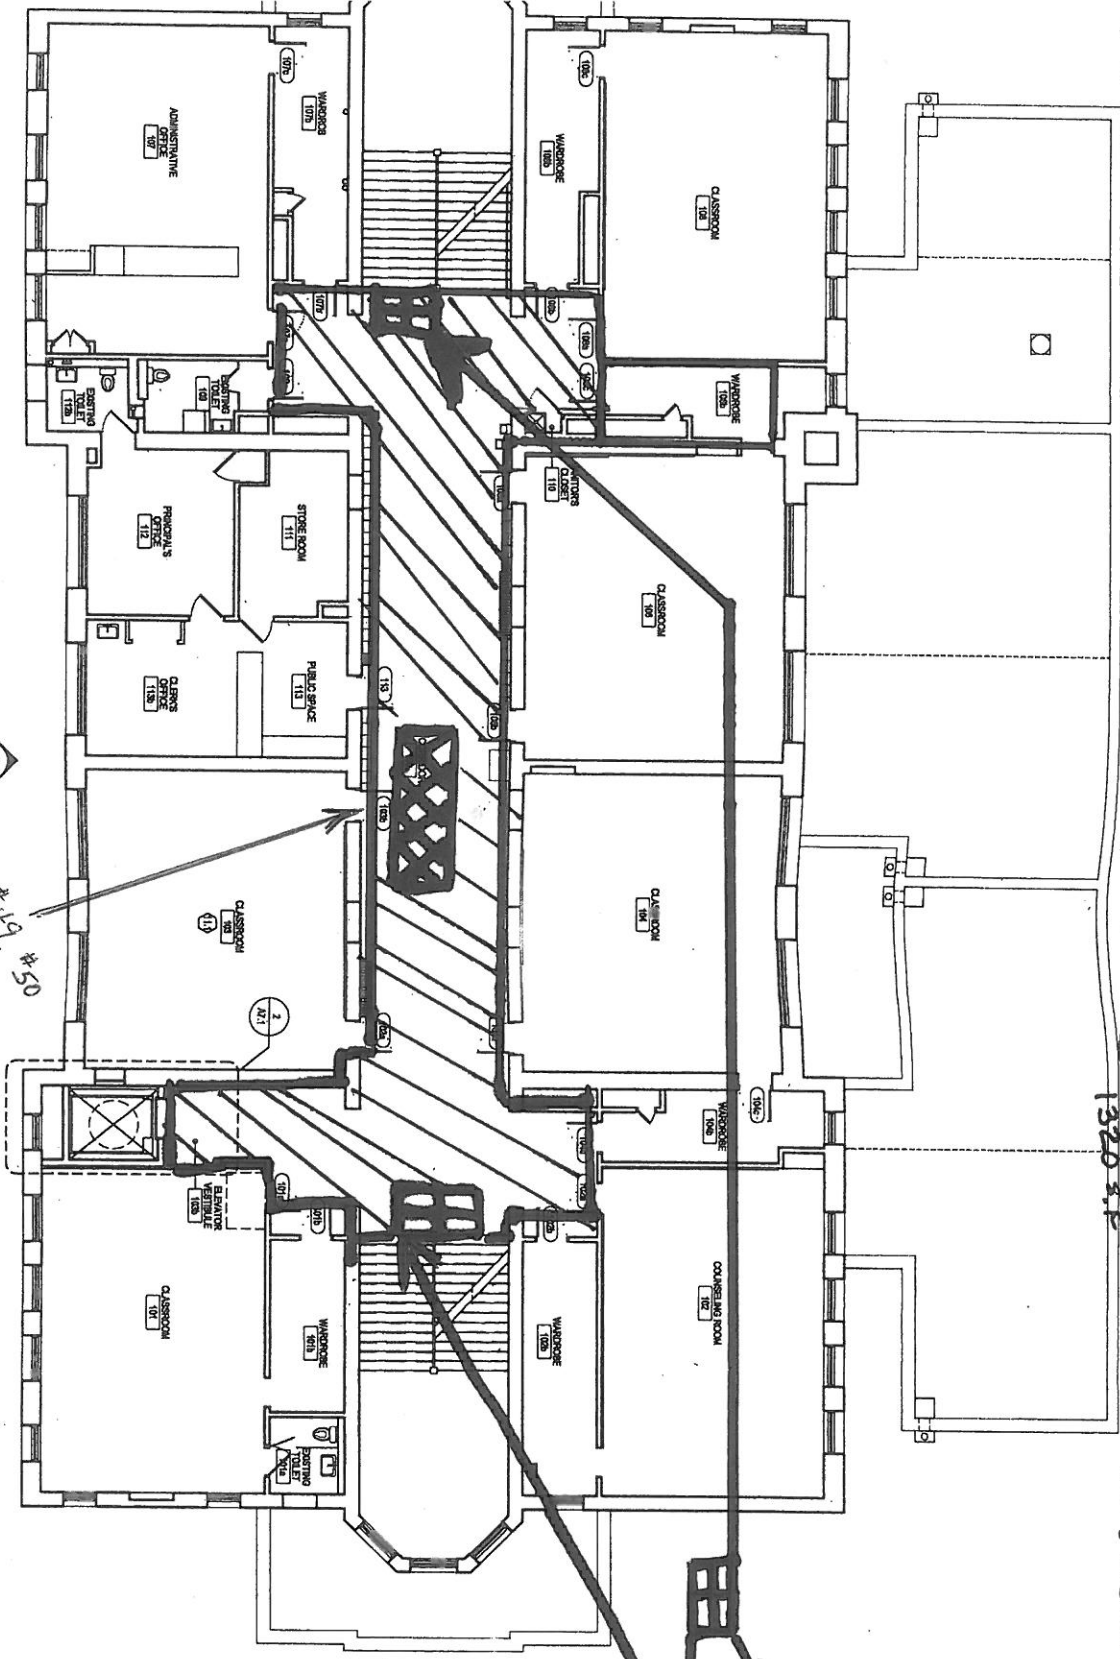

NEW HA # 49, # 50
 * 180 S.F.
 REPLACEMENT
 TILES ARE
 PATCHED IN

NEW HA # 63 +
 AT TOP OF STAIRS
 40 S.F. OR AT
 EACH STAIRWELL

1ST FLOOR
 2013 3 YEAR ASBESTOS
 RE-INSPECTION!

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12"x12" Tan w/Light Brown and White Streaks VFT (Mastic)**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:
New Installation

Inspector's Signature: _____

Joseph Hennigan

Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12"x12" Tan w/Light Brown and White Streaks VFT (Mastic)**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Linoleum White w/Orange and Gray Specks**
MATERIAL LOCATION: **Rooms 206b, 208**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: CONDITION:
AHERA DAMAGE CATEGORY:
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:
New Installation

Inspector's Signature: _____

Joseph Hennigan

Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**


HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Linoleum White w/Orange and Gray Specks**
MATERIAL LOCATION: **Rooms 206b, 208**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

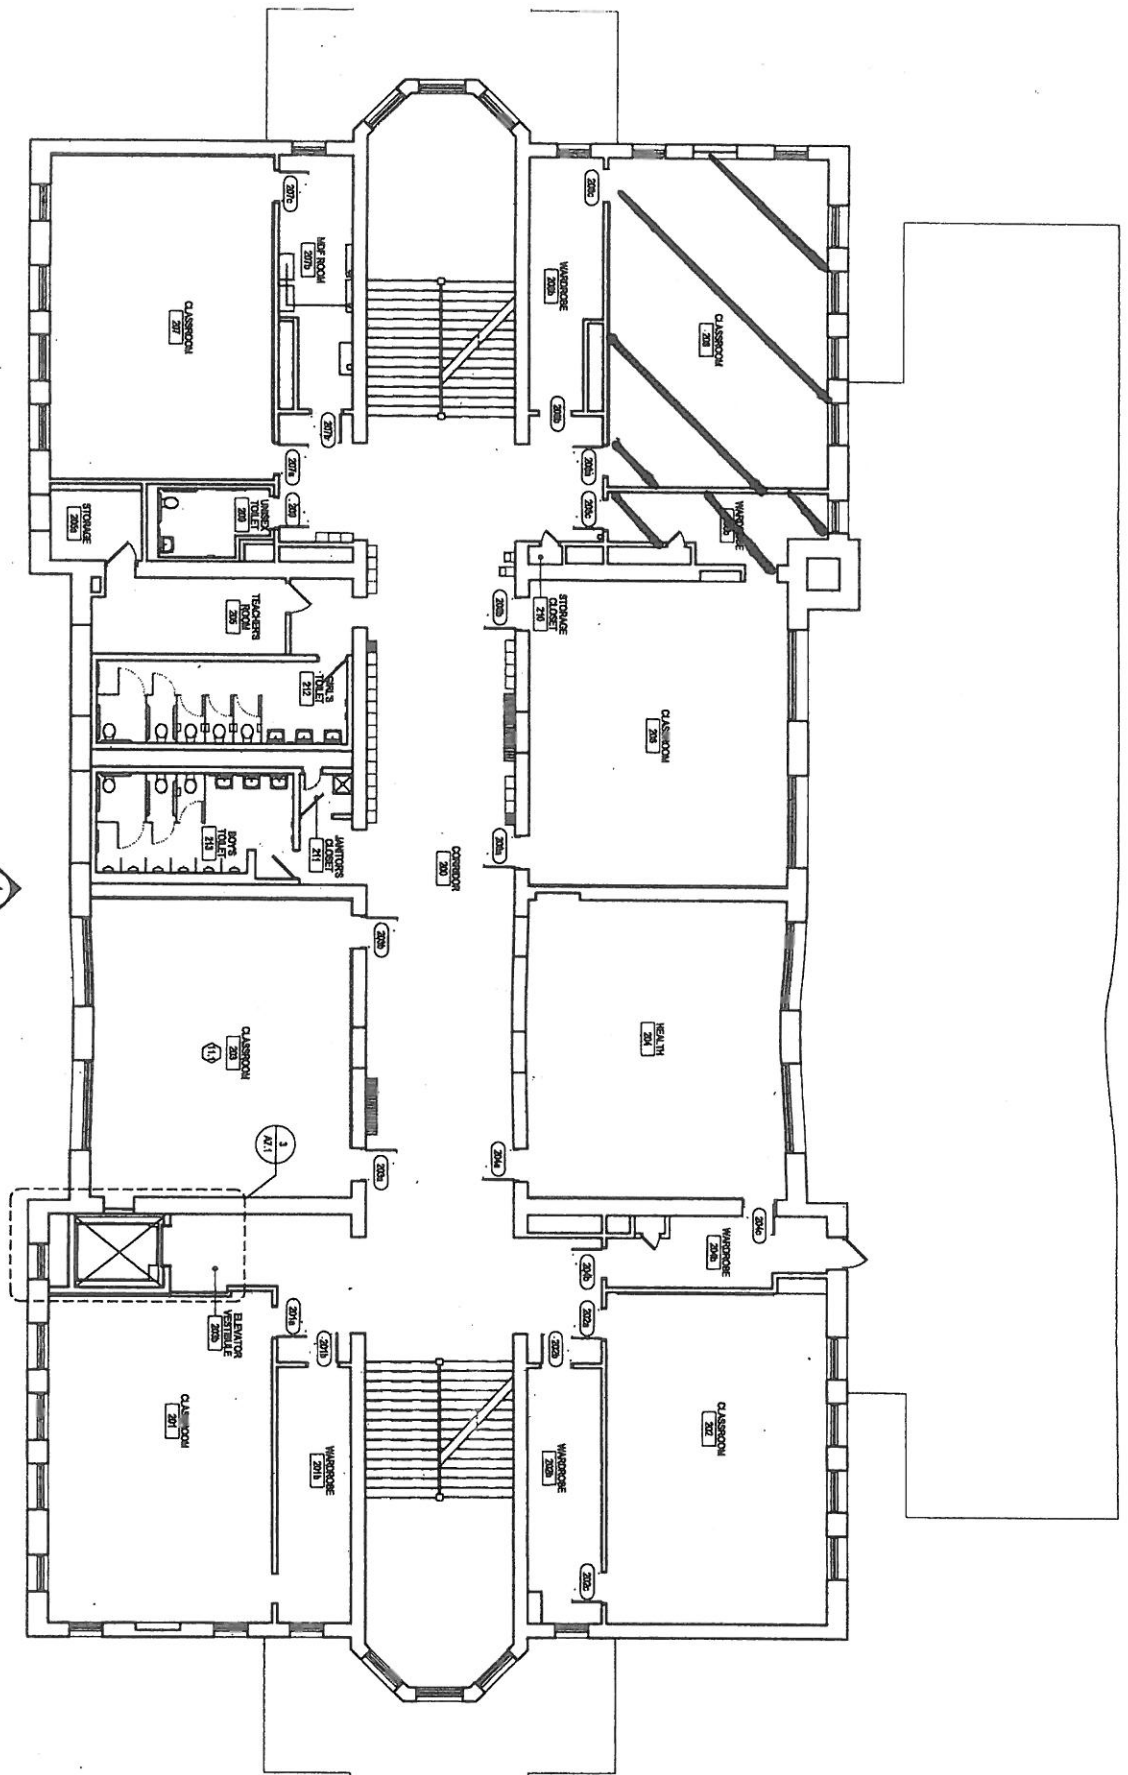

2ND FLOOR
 2013 3 YEAR ASBESTOS
 RE-INSPECTION

NEW 44 - LINOLEUM
 HA # WHITE WITH ORANGE
 + GRAY SPECKS 950 S.F.

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for
the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Lab Fume Hood**
MATERIAL LOCATION: **Lab 208**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:
New Installation


Inspector's Signature: _____

Joseph Hennigan

Date: 04/14/2013

2ND FLOOR
2013 3 YEAR ASBESTOS
RE-INSPECTION

NEW LAB
HA# 48
FUME HOOD

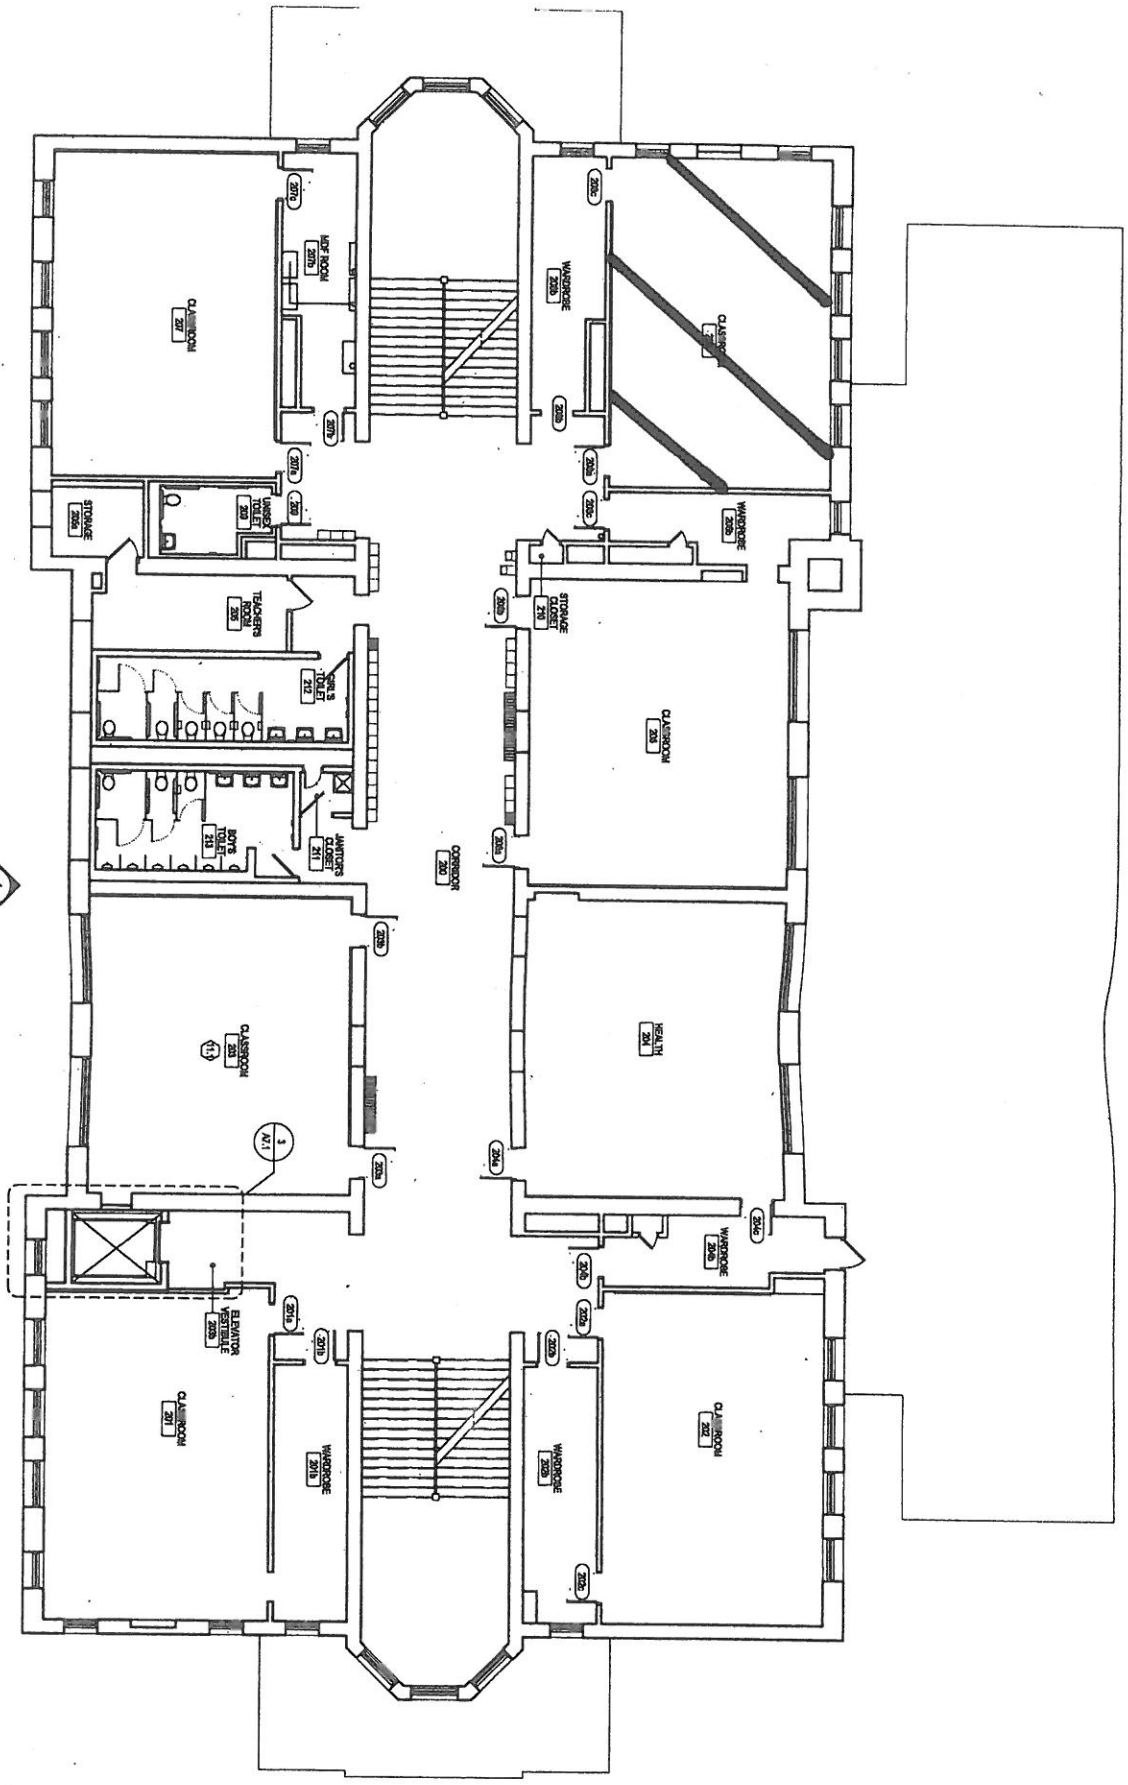

1
A1

1
A1

UN S.E

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Lab Fume Hood**
MATERIAL LOCATION: **Lab 208**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for
the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **Linoleum Gray (Mastic)**
MATERIAL LOCATION: **Basement Vestibules, Stairway Landings, Corridors, And Offices**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:
New Installation

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **Linoleum Gray (Mastic)**
MATERIAL LOCATION: **Basement Vestibules, Stairway Landings, Corridors, And Offices**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

NEW
 HA # 51 - GRAY LINOLEUM
 HA # 52 - GRAY LINOLEUM MASTIC
 750 S.F. EA.

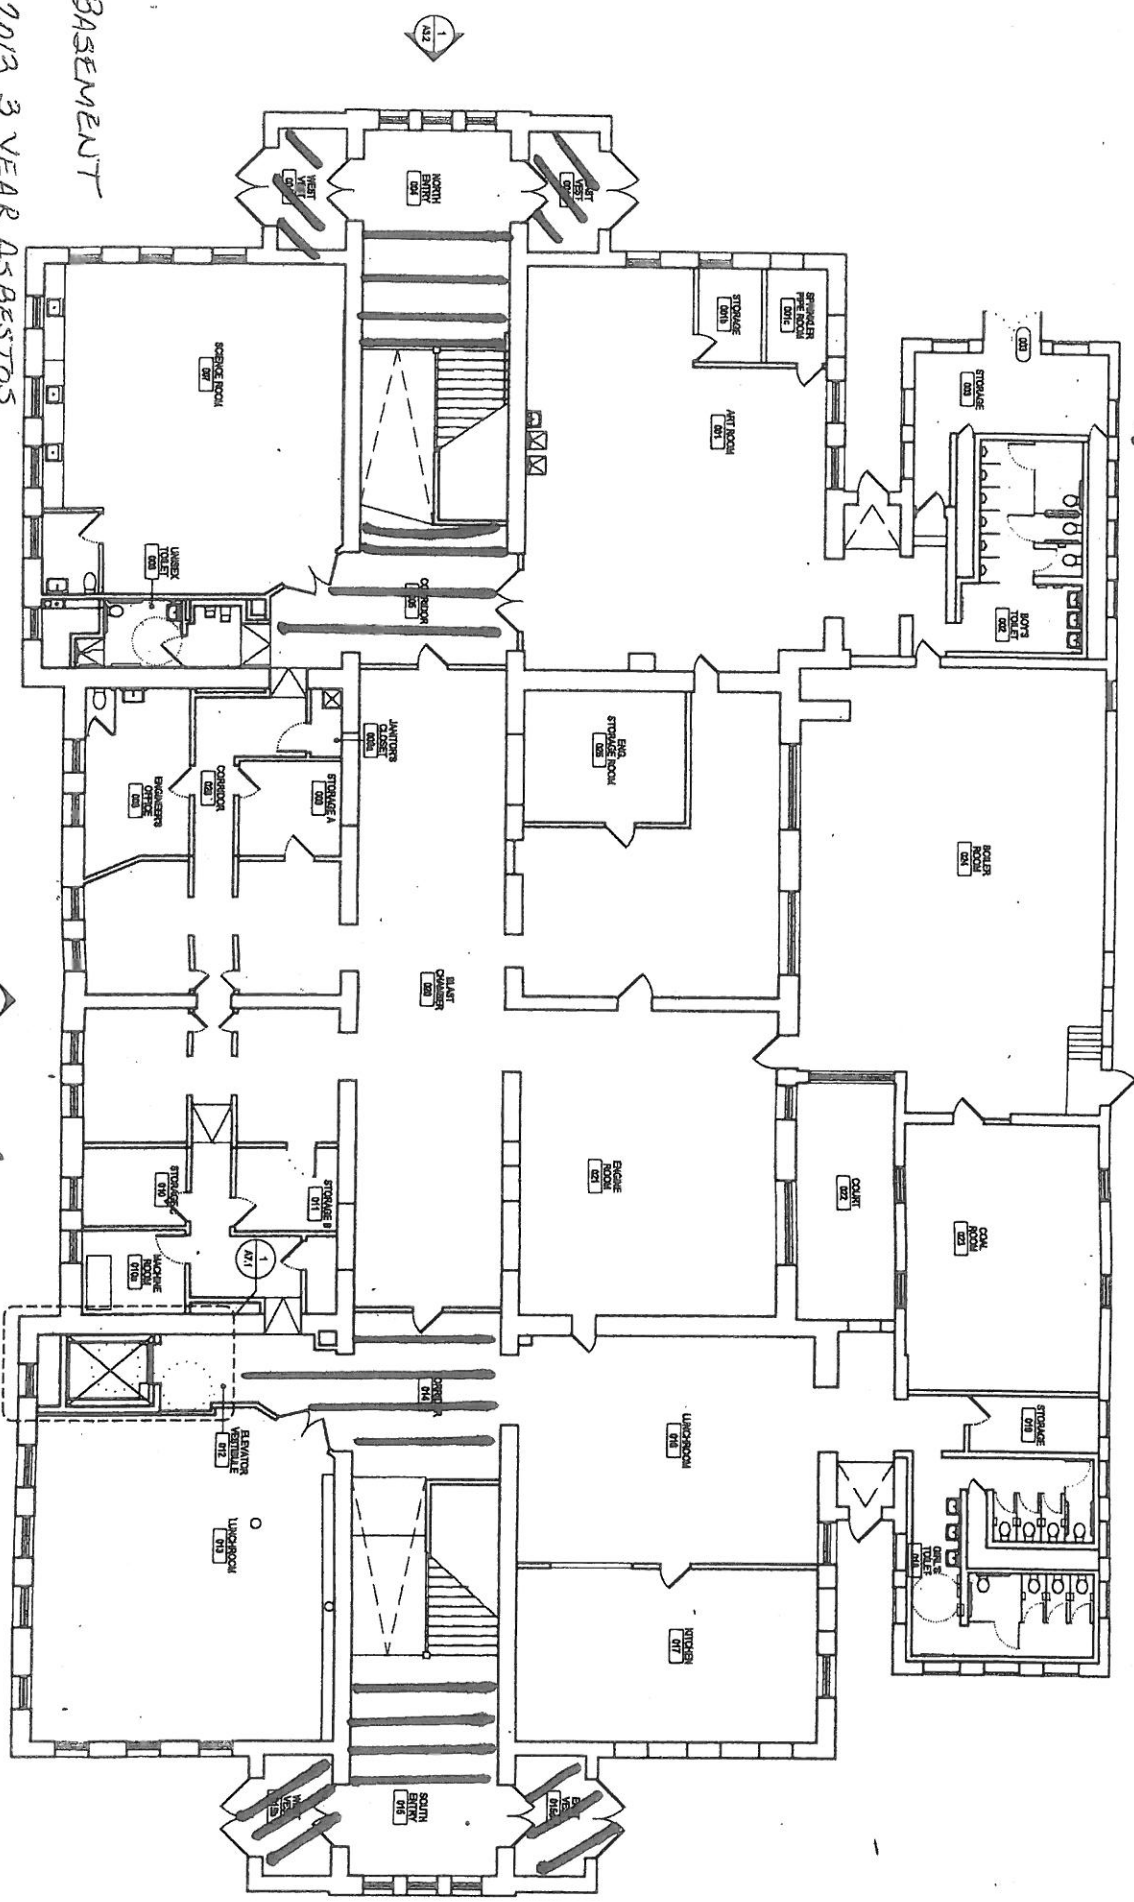


BASEMENT
 2013 3 YEAR ASBESTOS
 DT-114DEFINITION

NEW 51 - GRAY LINOLEUM

HA # 52 - GRAY LINOLEUM MASTIC

750 S.F. EA.

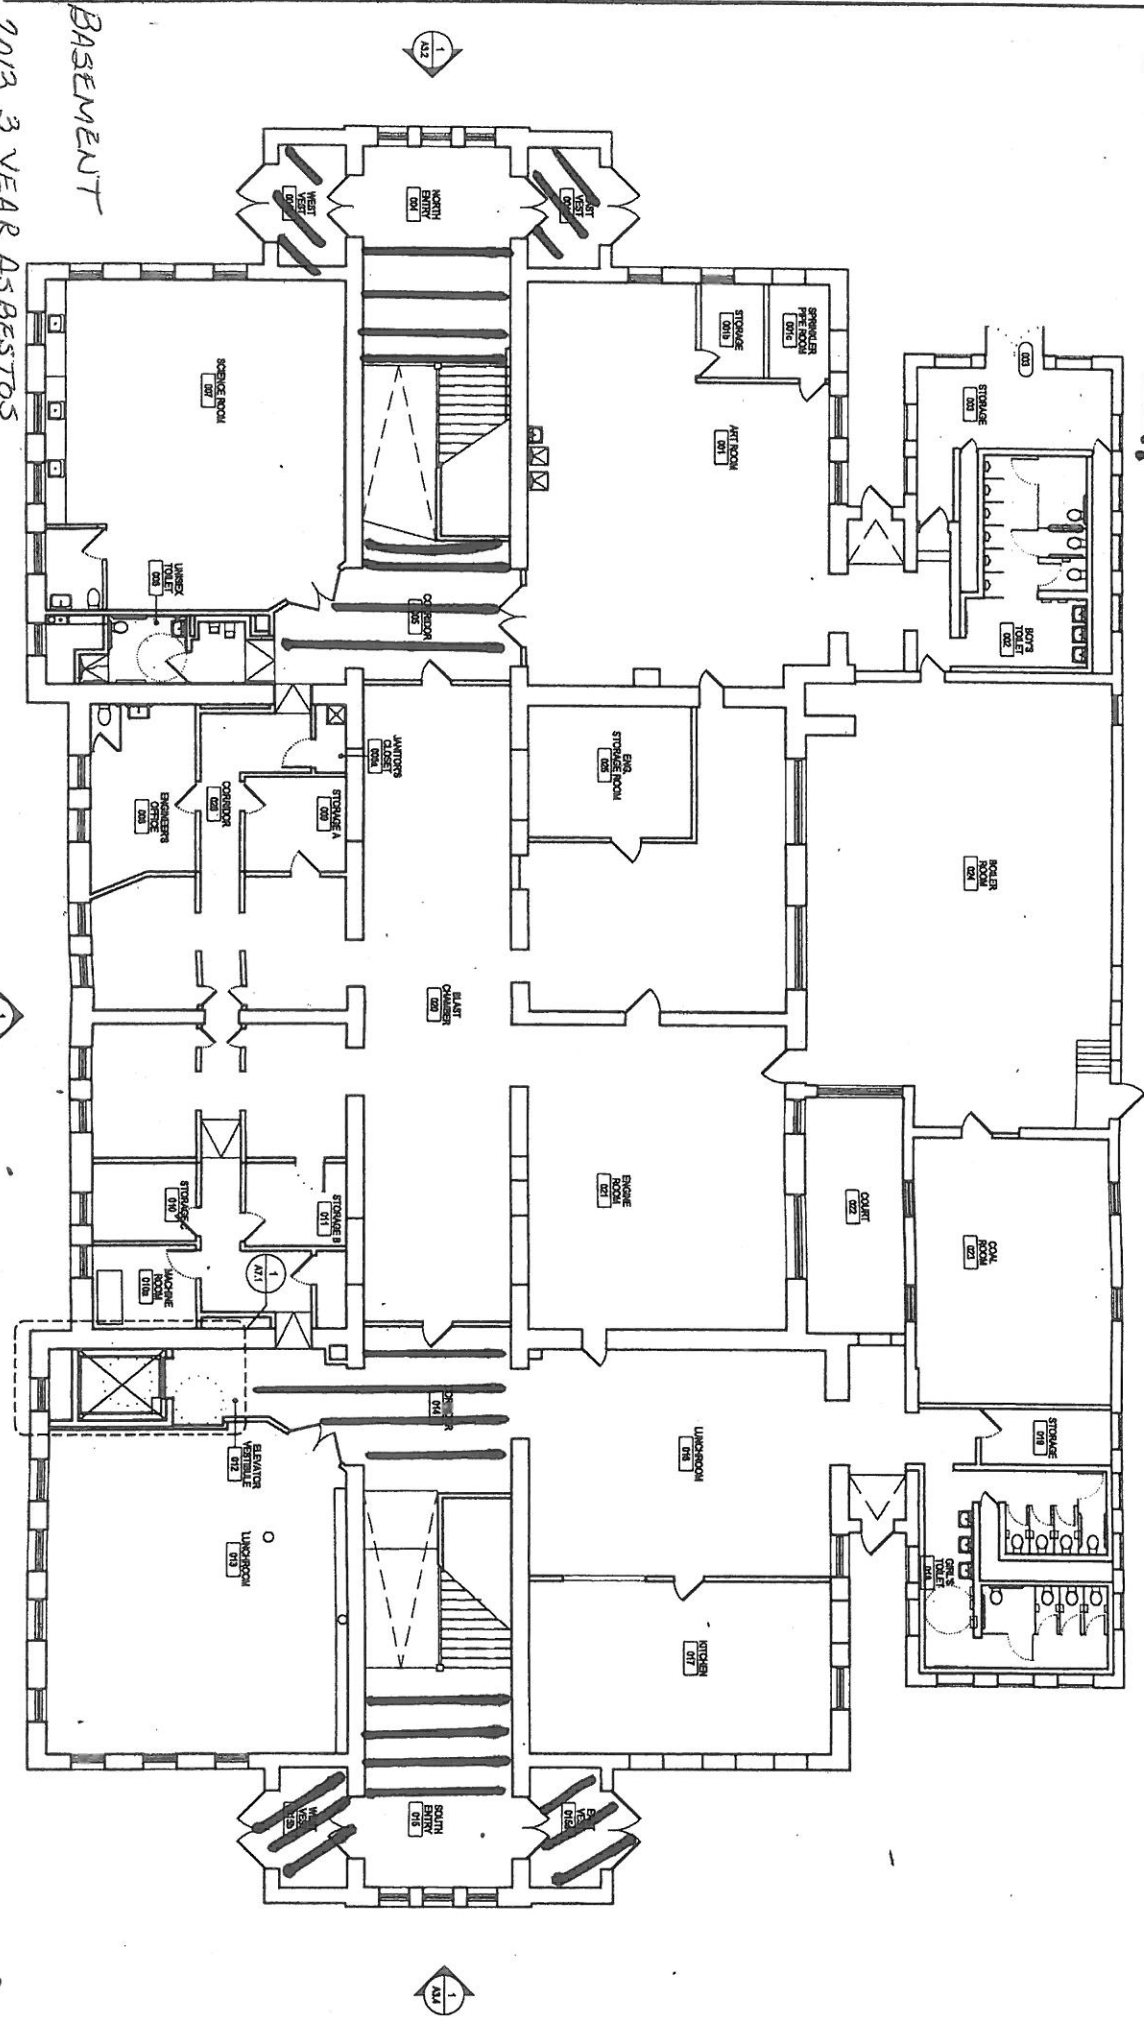

BASEMENT

2013 3 YEAR ASBESTOS
OR IDENTIFICATION

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for
the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **Drywall Compound**
MATERIAL LOCATION: **Throughout Basement, Corridors, and Offices**
MATERIAL QUANTITY: **1** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:
New Installation

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for
the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **Drywall Compound**
MATERIAL LOCATION: **Throughout Basement, Corridors, and Offies**
MATERIAL QUANTITY: **1** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature:  Date: **05/12/2013**

NEW 58 - DRYWALL
HA# 59 - DRYWALL COMPOUND

7500 S.F.

THROUGHOUT BASEMENT OFFICES +

CORRIDORS

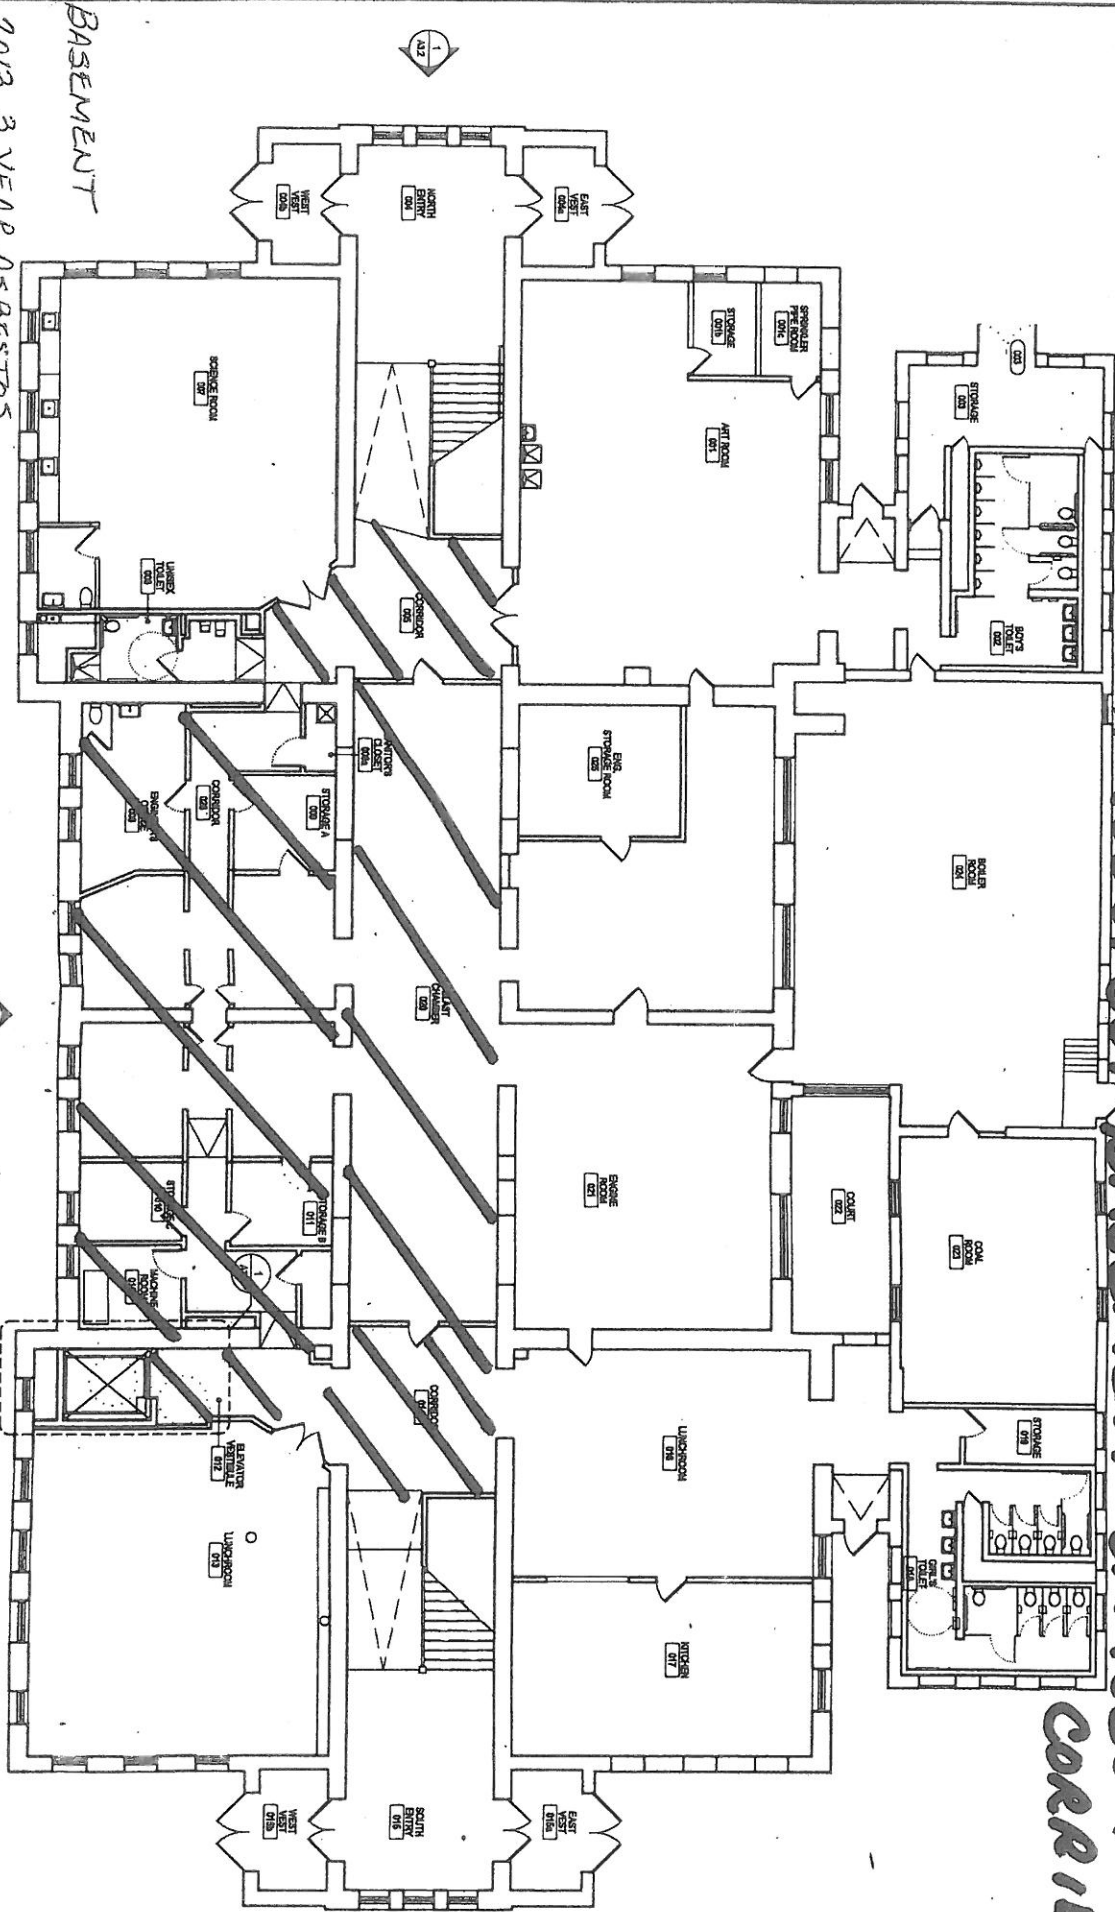


BASEMENT

2013 3 YEAR ASBESTOS
DF 1118570101

NEW 58 - DRYWALL
HA # 59 - DRYWALL COMPOUND

7500 S.F.

THROUGHOUT BASEMENT OFFICES +
CORRIDORS

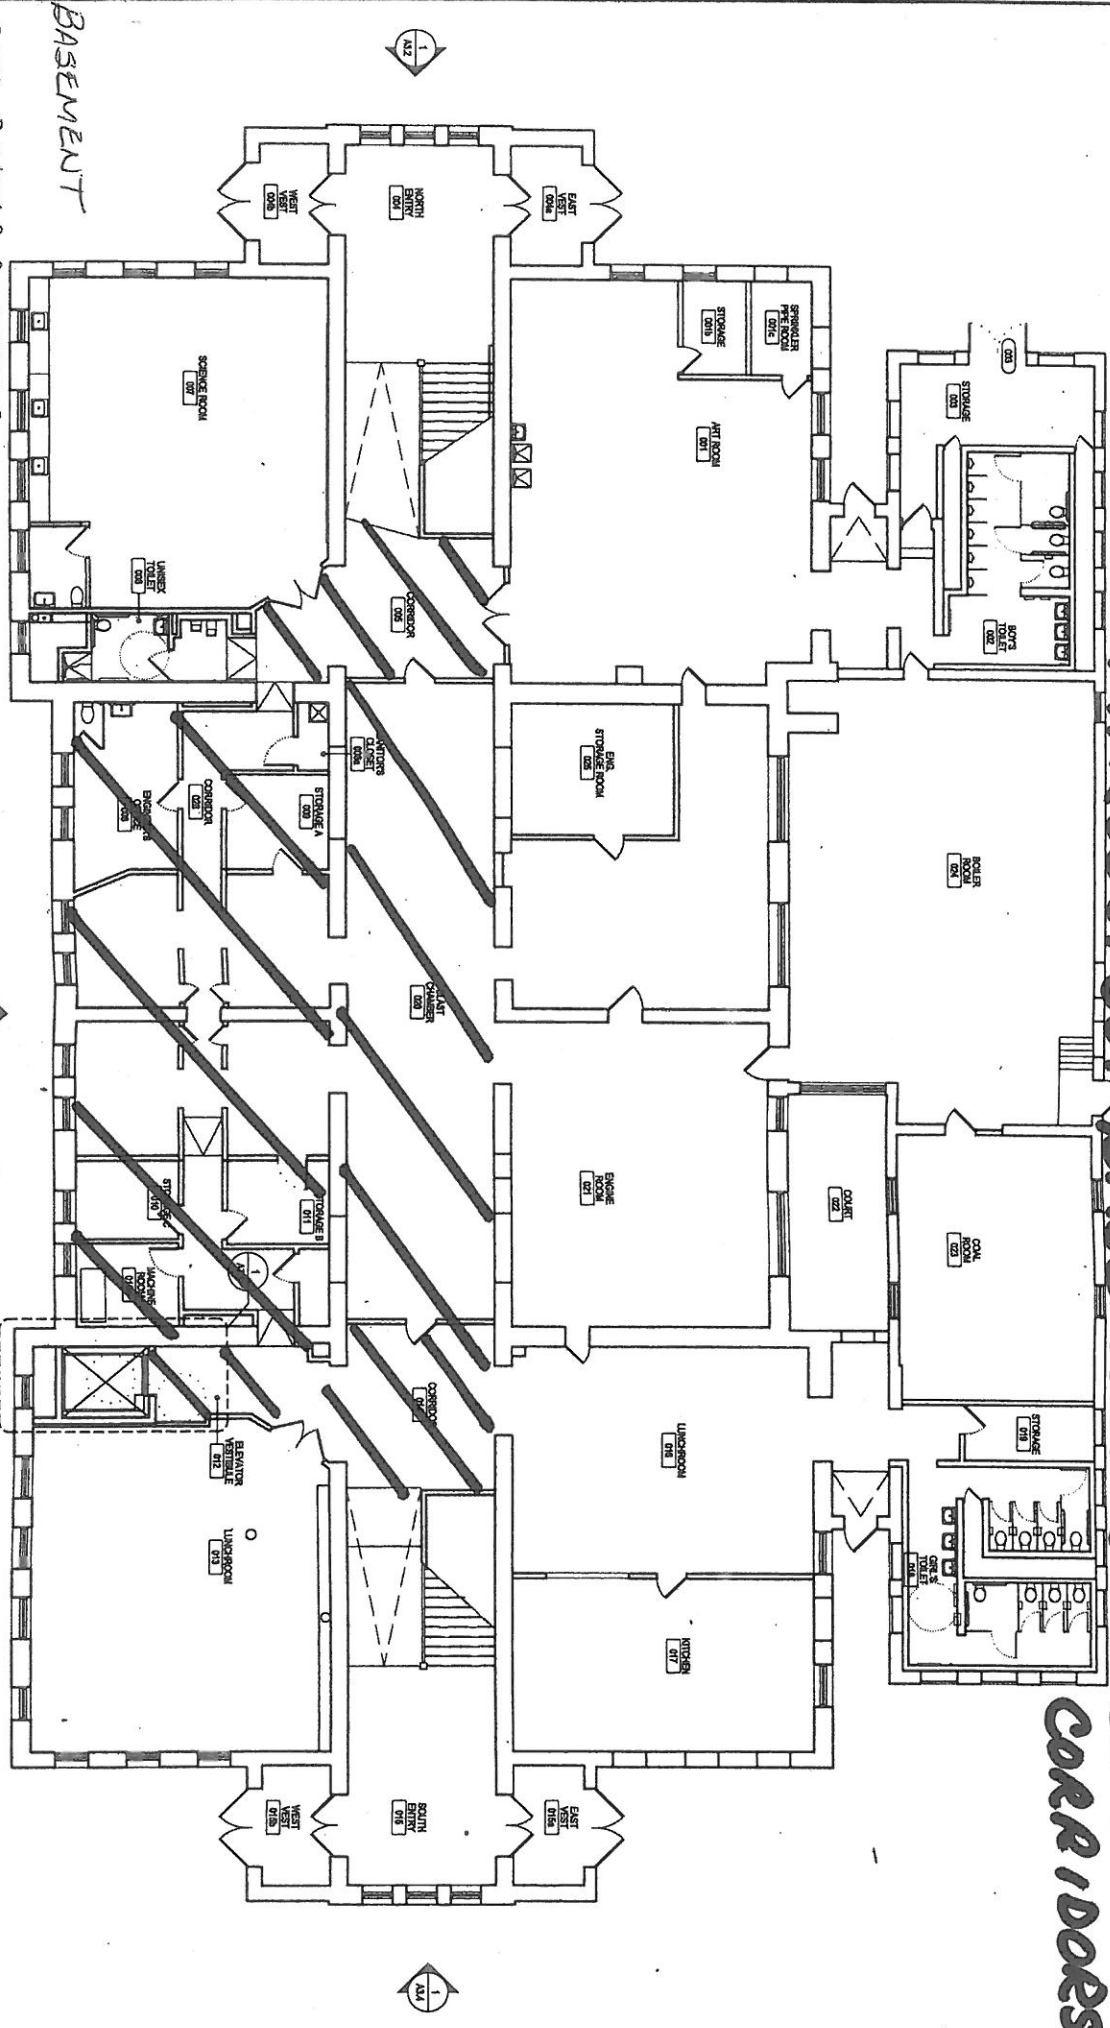

BASEMENT
2013 3 YEAR ASBESTOS
DT-111 DEFECTIVE

Chicago Public Schools

GSG Consultants, Inc. 2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **60**

MATERIAL DESCRIPTION: **Boiler Insulation in Boilers 1 and 2**

MATERIAL LOCATION: **Boiler Room - Main Boilers**

MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION:

AHERA DAMAGE CATEGORY:

ACCESSIBILITY:

DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **Boiler Insulation in Boilers 1 and 2**
MATERIAL LOCATION: **Boiler Room - Main Boilers**
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:


COMMENTS:

Management Planner's Signature:  Date: 05/12/2013

BOILER INSULATION - WHITE

NEW HA # 60

90 S.F. - ON BOILER #1 + BOILER #2 (INTERIOR)

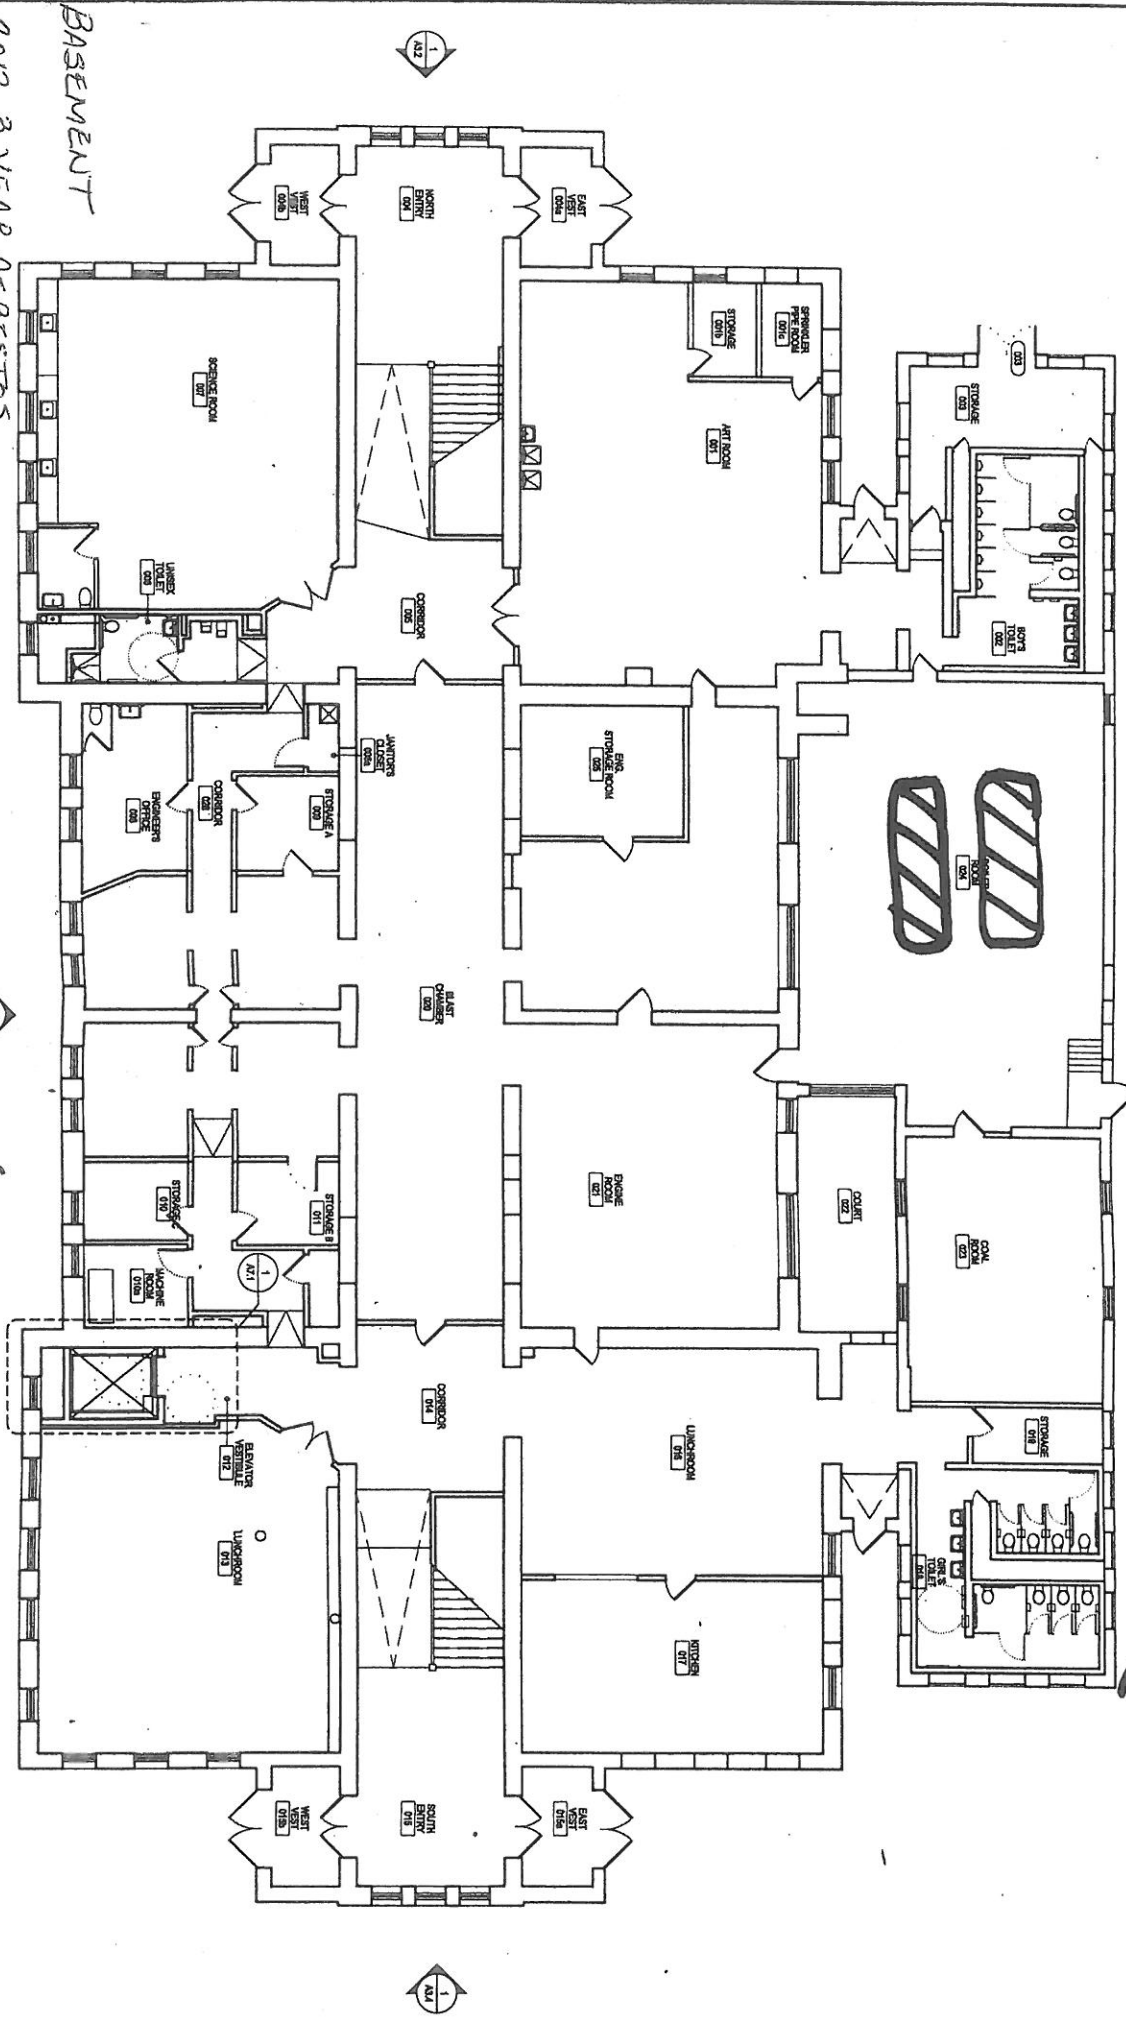

BASEMENT
2013 3 YEAR ASBESTOS
DI-114 DEFECTION

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Joseph Hennigan**
SCHOOL NAME: **Alcott High School for the Humanities** INSPECTION DATE: **4/14/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **Black Vinyl Lab Table and Countertops**
MATERIAL LOCATION: **Lab 208**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY:

ACCESSIBILITY: DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE REASON:
DAMAGE UNITS: **SF**

COMMENTS:
New Installation

Inspector's Signature: _____



Date: 04/14/2013

Chicago Public Schools

GSG Consultants, Inc.
2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25281** BUILDING ID: **5790**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Alcott High School for the Humanities** REVIEW DATE: **5/12/2013**
ADDRESS: **2957 N. Hoyne Avenue** IDPH LICENSE NO: **100-18350**

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **Black Vinyl Lab Table and Countertops**

MATERIAL LOCATION: **Lab 208**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/12/2013**

2ND FLOOR
2013 3 YEAR ASBESTOS
RE-INSPECTION

NEW
HA# 46
LAB TABLE TOPS
+ COUNTERTOPS

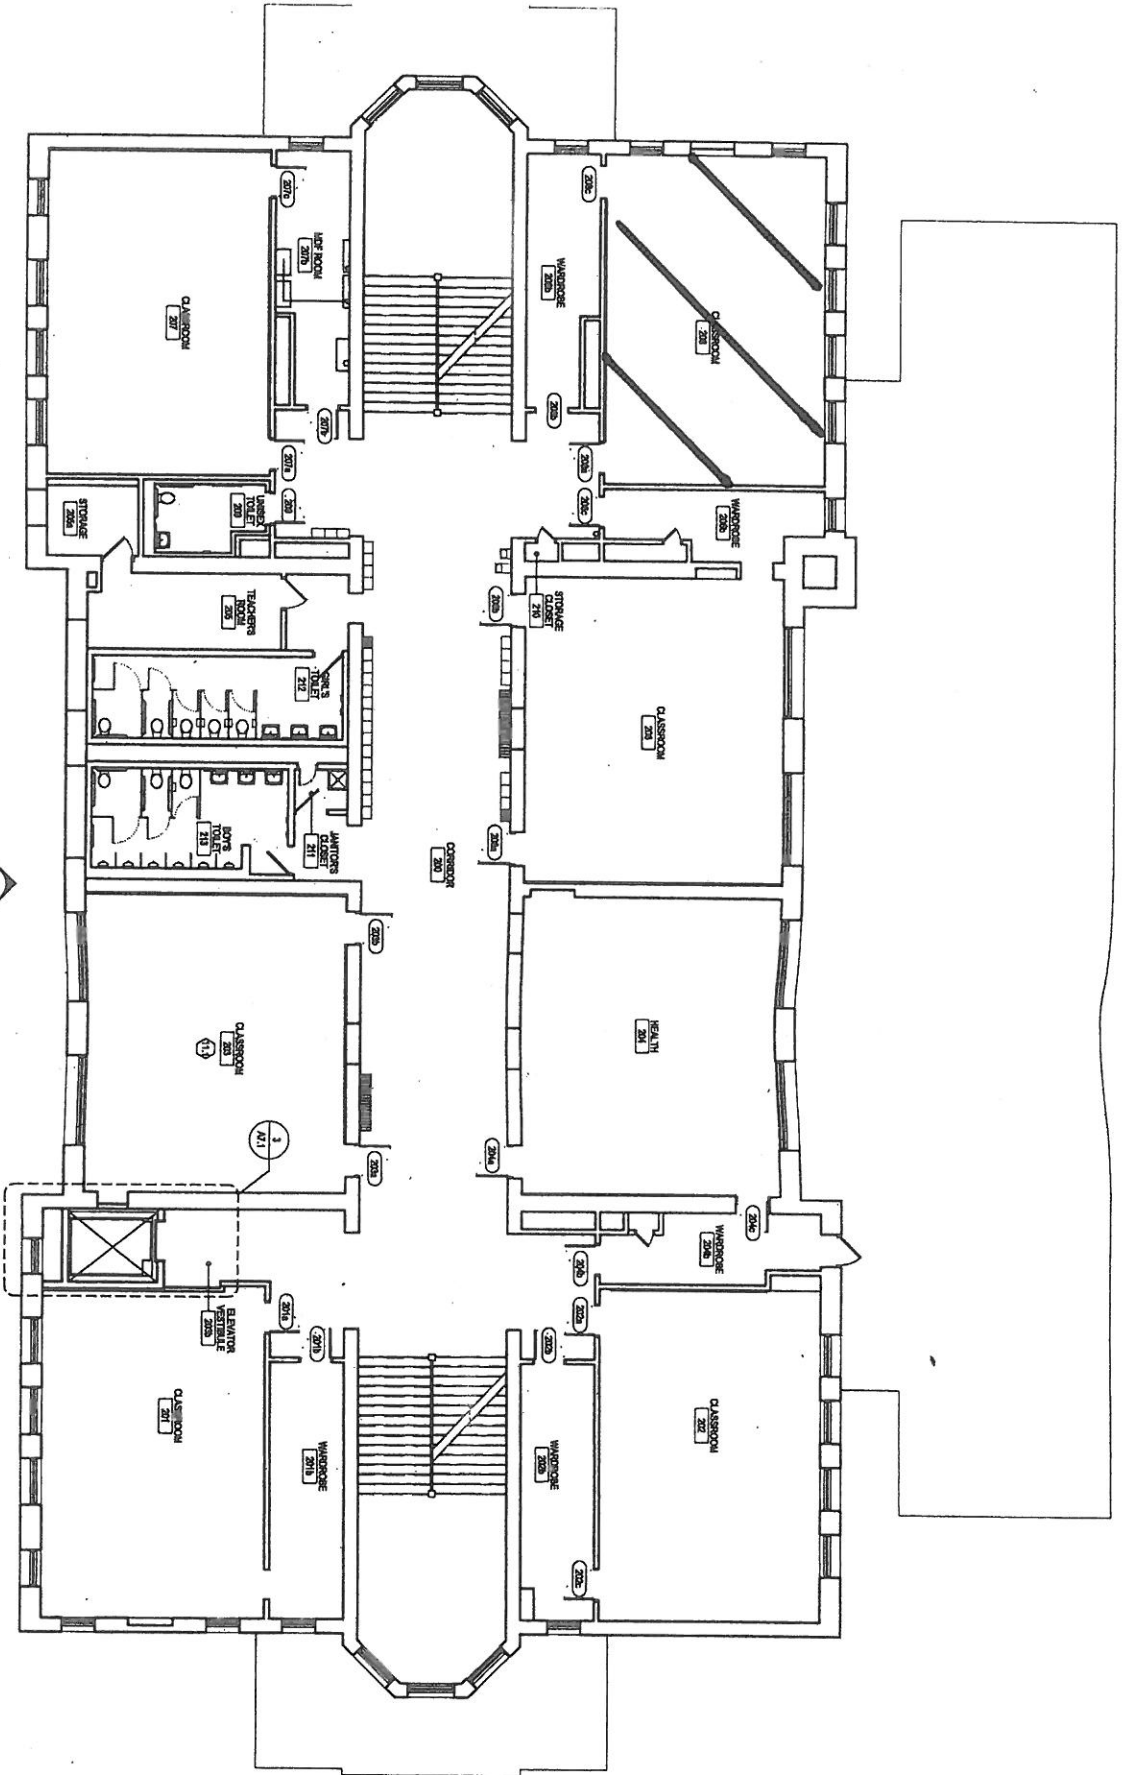

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Approved by the Illinois Department of Public Health and Indiana Department of Environmental Management

This is to certify that JOSEPH L. HENNINGAN
has completed the Contractor/Supervisor Recertification course and passed the examination
on 02/09/2013 with a minimum score of 70% or better. Training was in accordance with U.S.
E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model
Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA and Indiana Rule 326 IAC
18-2.



Y. Kravoff, DPA

02/09/2013
Course Dates: _____
02/09/2014
Expires: _____
13102SR025
Certificate Number: _____

Phone Number: (312) 461-6001
Nicholas J. Pinoff
Director of Training
Doctor of Public Health
FORM # A-000



**ASBESTOS
PROFESSIONAL
LICENSE**

ENDORSEMENTS

TC EXPIRES

INSPECTOR

2/18/2014

ID NUMBER

ISSUED

EXPIRES

100 - 18350

3/21/2013

05/15/2014

PROJECT MANAGER

2/9/2014

AIR SAMPLING PROFESSIONAL

JOSEPH L HENNIGAN

855 W ADAMS, SUITE 200

CHICAGO, IL 60607



Environmental Health

Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois

Department of Public Health

**This license is valid only when accompanied by a valid
training course certificate.**



ASBESTOS PROFESSIONAL LICENSE

INCREMENTS

TO EXPIRES

ID NUMBER

100 - 07342

ISSUED

3/21/2013

EXPIRES

05/15/2014

INSPECTOR

3/21/2014

PROJECT DESIGNER

3/21/2014

MANAGEMENT PLANNER

3/21/2014

PROJECT MANAGER

3/21/2014

AIR SAMPLING PROFESSIONAL

JIGAR M SHAH

855 W ADAMS ST, SUITE 200

CHICAGO, IL 60607

Environmental Health



Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois

Department of Public Health

This license is valid only when accompanied by a valid

training course certificate.

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that JIGAR SHAH
has completed the **ASBESTOS INSPECTOR'S REFRESHER** course and successfully passed the
examination on 02/16/2013 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



N. Kung'ya

02/16/2013

Course Dates:

02/16/2014

Expires:

1302BIR29

Certificate Number:

Phone Number: (312) 491-0081

Director of Training
Nicholas J. Peneff
Doctor of Public Health

FORM # A-010

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed