

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2811
SCHOOL NAME: Gunsaulus Academy
ADDRESS OF SCHOOL: 4420 S. Sacramento
CITY: Chicago, IL, 60632

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/1/2010**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 3/31/2013 ENROLLMENT 831

IDPH INSPECTOR LICENSE NUMBER: 100-09725

IDPH LICENSED INSPECTOR NAME (Please Print): Patrick Hrycyk

IDPH MP LICENSE NUMBER: 100-03613

IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



3/31/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Gunsaulus Academy

4420 S. Sacramento
Chicago, IL, 60632

Unit: 29121
Building ID: 3690

IDPH ID Number: 14-016-2990-2811

REPORT DATE:

Sunday, March 31, 2013

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 22, 2013

RE: Gunsaulus Academy, Unit 29121
4420 S. Sacramento
Chicago, IL, 60632

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Gunsaulus Academy , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Gunsaulus Academy, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Gunsaulus Academy Unit: 29121 Region: 04
Address: 4420 S. Sacramento Chicago, IL, 60632
IDPH ID: 14-016-2990-2811 Building ID: 3690
Contact: Deane, Kevin Phone: 773-535-7215

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: 98600 No of Floors:
Current Occupancy: 831

3. LEA Designated Person

Contact: Ms. Lynn Crivello Phone: (773) 553-3113
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603


4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Patrick Hrycyk


Inspector IDPH license # 100-09725

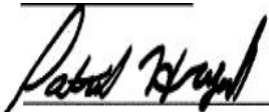Signature: 
Date: 3/22/2013

6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613

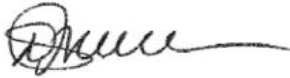Signature: 
Date: 3/31/2013

7. Review Date: 3/31/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 3/31/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Gunsaulus Academy. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3690:

| | |
|----|--|
| 1 | Hard Plaster |
| 12 | 12" x 12" Tan Floor Tile Mastic |
| 13 | 12" x 12" Speckled Gray Floor Tile |
| 15 | 12" x 12" Cream Floor Tile w/Black Specs |
| 16 | 12"x12" Cream Floor Tile w/Black Specs Mastic-HA15 |
| 19 | 12" x 12" Cream w/Brown Specks Floor Tile |
| 2 | 2' x 4' Ceiling Tile |
| 23 | 9" x 9" Beige Floor Tile |
| 25 | 4" Red Baseboard |

| | |
|----|-----------------------------------|
| 26 | 4" Red Baseboard Mastic |
| 27 | Carpet Mastic |
| 3 | 1' x 1' Ceiling Tile |
| J | Pipe Fittings Off Fiberglass Pipe |
| N | Refractory Brick - Non AHERA |

B. The following new homogenous areas have been identified for Building 3690:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

| | |
|----|--|
| 1 | Hard Plaster |
| 10 | 1' x 1' Ceiling Tile Adhesive |
| 12 | 12" x 12" Tan Floor Tile Mastic |
| 13 | 12" x 12" Speckled Gray Floor Tile |
| 15 | 12" x 12" Cream Floor Tile w/Black Specs |
| 16 | 12"x12" Cream Floor Tile w/Black Specs Mastic-HA15 |
| 19 | 12" x 12" Cream w/Brown Specks Floor Tile |
| 2 | 2' x 4' Ceiling Tile |
| 23 | 9" x 9" Beige Floor Tile |
| 25 | 4" Red Baseboard |
| 26 | 4" Red Baseboard Mastic |
| 27 | Carpet Mastic |
| 28 | Blue Carpet Mastic |
| 29 | Green Carpet Mastic |
| 3 | 1' x 1' Ceiling Tile |
| 30 | Brick/Brown Multi Color Ceramic Floor Tile Grout |
| 31 | Yellow Ceramic Wall Tile Grout |
| 32 | Yellow Ceramic Wall Tile Grout Adhesive |
| 33 | Brown Carpet Mastic |
| 34 | Drywall-Wall |
| 35 | Drywall-Compound |
| 36 | Drywall-Wall Tape |
| 37 | Drywall-Ceiling |
| 38 | Drywall-Ceiling-Compound |
| 39 | Drywall-Ceiling-Tape |
| 40 | Orange Carpet Mastic |
| 41 | 9"x 9" Brick Floor Tile |
| 42 | 9"x9" Brick Floor Tile Mastic |
| 43 | 12"x12" Brown Floor Tile w/Brown and White Streaks |
| 44 | 12"x12" Brwn Floor Tile w/ Brwn&Wht Streaks Mastic |
| 45 | 12"x12" Brown Speckled Floor Tile Patch |
| 46 | 12"x12" Brwn Speckled Floor Tile Mastic |
| 6 | Linoleum |
| 9 | Linoleum Mastic |
| J | Pipe Fittings Off Fiberglass Pipe |
| N | Refractory Brick - Non AHERA |

The following areas were deemed to be inaccessible:

| | |
|----|--|
| 12 | 12" x 12" Tan Floor Tile Mastic |
| 16 | 12"x12" Cream Floor Tile w/Black Specs Mastic-HA15 |
| 18 | 9" x 9" Green Floor Tile Mastic - HA17 |
| 24 | 9" x 9" Beige Floor Tile Mastic |
| 26 | 4" Red Baseboard Mastic |
| 27 | Carpet Mastic |
| 28 | Blue Carpet Mastic |
| 29 | Green Carpet Mastic |
| 32 | Yellow Ceramic Wall Tile Grout Adhesive |
| 33 | Brown Carpet Mastic |
| 38 | Drywall-Ceiling-Compound |
| 39 | Drywall-Ceiling-Tape |
| 40 | Orange Carpet Mastic |
| 42 | 9"x9" Brick Floor Tile Mastic |
| 44 | 12"x12" Brwn Floor Tile w/ Brwn&Wht Streaks Mastic |
| 7 | 12" x 12" Brown w/White Speck Floor Tile Mastic |
| 8 | 9" x 9" Brown Floor Tile Mastic |
| N | Refractory Brick - Non AHERA |

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Patrick Hrycyk, IDPH License # 100-09725. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Gunsaulus Academy Building 3690 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Gunsaulus Academy Unit 29121 Building ID 3690

Address 4420 S. Sacramento Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| 1 | Hard Plaster | 31,000 | SF | Throughout | ASSUMED | SURFACE | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 10 | 1' x 1' Ceiling Tile Adhesive | 6,020 | SF | Gym | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 11 | 12" x 12" Tan Floor Tile | 725 | SF | Room 312A and 2nd Floor Teachers' Lounge | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 12 | 12" x 12" Tan Floor Tile Mastic | 300 | SF | 3rd Floor Teacher's Lounge | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 13 | 12" x 12" Speckled Gray Floor Tile | 900 | SF | 1st and 3rd Floor Teacher's Lounges | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 14 | 12" x 12" Speckled Gray Floor Tile Mastic - HA13 | 700 | SF | Room 312A | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 15 | 12" x 12" Cream Floor Tile w/Black Specs | 600 | SF | Front Office and Principle's Office | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 16 | 12"x12" Cream Floor Tile w/Black Specs Mastic-HA15 | 600 | SF | Front Office and Principle's Office | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 17 | 9" x 9" Green Floor Tile | 400 | SF | 1st Floor Principal Office | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 18 | 9" x 9" Green Floor Tile Mastic - HA17 | 400 | SF | 1st Floor Principal Office | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 19 | 12" x 12" Cream w/Brown Specks Floor Tile | 1,500 | SF | Room 115, 206 | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 2 | 2' x 4' Ceiling Tile | 50,000 | SF | Throughout | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 20 | 12" x 12" Cream w/Brown Specks Floor Tile Mastic | 1,500 | SF | Room 115 | CHR | MISC | N | | | | | ACBM with the potential for damage | | Low |
| 21 | Unknown Size Floor Tile | 3,000 | SF | 2nd and 3rd Floor Halls, 3rd Floor Teacher's Lounge | CHR | MISC | N | | | | | | | |
| 22 | Unknown Size Floor Tile Mastic | 3,000 | SF | 2nd and 3rd Floor Halls, 3rd Floor Teacher's Lounge | CHR | MISC | N | | | | | | | Low |
| 23 | 9" x 9" Beige Floor Tile | 300 | SF | Assembly Hall | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 24 | 9" x 9" Beige Floor Tile Mastic | 100 | SF | Assembly Hall | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 25 | 4" Red Baseboard | 350 | LF | Gym | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 26 | 4" Red Baseboard Mastic | 300 | LF | Gym | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 27 | Carpet Mastic | 1,000 | SF | Rooms 212 and 310, Office, Kindergarten Room, and Library | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Gunsaulus Academy Unit 29121 Building ID 3690

Address 4420 S. Sacramento Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| 28 | Blue Carpet Mastic | 500 | SF | Room 110, Office, Principal's Office, 112 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 29 | Green Carpet Mastic | 750 | SF | Rooms 212A Computer, Library and 310 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 3 | 1' x 1' Ceiling Tile | 6,020 | SF | Not Observed | ASSUMED | MISC | N | NONE | 0 | | Yes | ACBM with the potential for damage | | LOW |
| 30 | Brick/Brown Multi Color Ceramic Floor Tile Grout | 6,200 | SF | All Boys' and Girls' Washrooms on 1st, 2nd, and 3rd Floors | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 31 | Yellow Ceramic Wall Tile Grout | 6,200 | SF | All Boys' and Girls' Washrooms on 1st, 2nd and 3rd Floors | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 32 | Yellow Ceramic Wall Tile Grout Adhesive | 420 | SF | All Boys' and Girls' Washrooms on 1st, 2nd and 3rd Floors | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 33 | Brown Carpet Mastic | 120 | SF | Room 312 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 34 | Drywall-Wall | 830 | SF | Rooms 207,217 and 208 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 35 | Drywall-Compound | 142 | LF | Rooms 207,217 and 208 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 36 | Drywall-Wall Tape | 142 | LF | Rooms 207,217 and 208 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 37 | Drywall-Ceiling | 102 | SF | Rooms 207,217 and 208 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 38 | Drywall-Ceiling-Compound | 37 | LF | Rooms 207,218 and 208 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 39 | Drywall-Ceiling-Tape | 37 | LF | Rooms 207,218 and 208 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 4 | 12" x 12" Brown w/White Speck Floor Tile | 4,000 | SF | 2nd, 3rd Floor Halls, 2nd, 3rd Floor Teacher's Lounges, Rooms 312A, 108, Engineer's Office | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 40 | Orange Carpet Mastic | 918 | SF | Room 115 | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 41 | 9"x 9" Brick Floor Tile | 300 | SF | 1st Floor Principal Office | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 42 | 9"x9" Brick Floor Tile Mastic | 300 | SF | 1st Floor Principal | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the | | LOW |

Chicago Public Schools

School Gunsaulus Academy Unit 29121 Building ID 3690

Address 4420 S. Sacramento Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|---|---------------|-----------------------|
| | | | | Office | | | | | | | | potential for damage | | |
| 43 | 12"x12" Brown Floor Tile w/Brown and White Streaks | 200 | SF | Assembly Hall Patch, 1st Floor Principal Office and Washroom | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 44 | 12"x12" Brwn Floor Tile w/ Brwn&Wht Streaks Mastic | 200 | SF | Assembly Hall Patch and 1st Floor Principal Office and Washroom | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 45 | 12"x12" Brown Speckled Floor Tile Patch | 1,800 | SF | Lunchroom | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 46 | 12"x12" Brwn Speckled Floor Tile Mastic | 1,800 | SF | Lunchroom | ASSUMED | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 5 | 9" x 9" Brown Floor Tile | 1,500 | SF | Assembly Hall, Rm 312A, and engineers office | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| 6 | Linoleum | | | Was in Gym and Gym has New Floor | ASSUMED | MISC | N | | | | | | | |
| 7 | 12" x 12" Brown w/White Speck Floor Tile Mastic | 4,000 | SF | 2nd, 3rd Floor Halls and Teacher's Lounge See HA 4 | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 8 | 9" x 9" Brown Floor Tile Mastic | 1,800 | SF | Assembly Hall | CHR | MISC | N | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| 9 | Linoleum Mastic | | | See HA 6 | ASSUMED | MISC | N | | | | | | | |
| D | Pre-formed Pipe Lagging | 300 | LF | Boiler Room | CHR | TSI | Y | NONE | 40 | | No | Any remaining friable ACBM or friable suspect ACBM | | MODERATE |
| E | Fittings Off Pre-formed Pipe Lagging | 50 | LF | Boiler Room | CHR | TSI | N | NONE | 4 | | No | Any remaining friable ACBM or friable suspect ACBM | | MODERATE |
| F | Cardboard Pipe Insulation | 120 | LF | Boiler Room | CHR | TSI | Y | NONE | 0 | | No | Any remaining friable ACBM or friable suspect ACBM | | MODERATE |
| G | Fittings Off Cardboard Pipe Insulation | 50 | LF | Boiler Room | CHR | TSI | Y | NONE | 0 | | No | ACBM with the potential for damage | | LOW |
| H | Air Cell Duct Insulation | 50 | LF | Basement | CHR | TSI | Y | NONE | 0 | | No | Any remaining friable ACBM or friable suspect ACBM | | MODERATE |
| J | Pipe Fittings Off Fiberglass Pipe | 50 | LF | Basement | ASSUMED | TSI | N | NONE | 0 | | Yes | Any remaining friable ACBM or friable suspect ACBM | | MODERATE |
| K | Air Cell Pipe Insulation (Covering) | 240 | LF | Basement - Crawl Space | CHR | TSI | Y | DIST | 150 | | No | Damaged or significantly damaged friable thermal system | 3 | MODERATE |

Chicago Public Schools

School Gunsaulus Academy Unit 29121 Building ID 3690

Address 4420 S. Sacramento Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA No | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category | Damage Reason | Disturbance Potential |
|-------|---------------------------------|-------------------|----------------|------------------------|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|--|---------------|-----------------------|
| L | Fittings Off Air Cell Pipe Runs | 90 | LF | Basement - Crawl Space | CHR | TSI | N | NONE | 50 | | No | insulating ACBM Damaged or significantly damaged friable thermal system insulating ACBM | | MODERATE |
| M | Gaskets Off Boiler | 20 | LF | Boiler Room | CHR | TSI | N | NONE | 0 | | No | ACBM with the potential for damage | | MODERATE |
| N | Refractory Brick - Non AHERA | | SF | Boiler Room | ASSUMED | MISC | N | UNKNO WN | 0 | | Yes | ACBM with the potential for damage | | LOW |

Chicago Public Schools

School Gunsaulus Academy Unit 29121 Building ID 3690

Address 4420 S. Sacramento Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| |
|---|
| Reinspection Date 3/22/2013 |
| Inspector Name Patrick Hrycyk |
| 100-09725 5/15/2013 |
| Inspector's IDPH License Number / Expiration Date |

Inspector's Comments

| HA Number: | Inspector Comments: |
|------------|---------------------------------|
| 1 | |
| 10 | |
| 11 | |
| 12 | |
| 13 | |
| 14 | |
| 15 | |
| 16 | |
| 17 | |
| 18 | |
| 19 | |
| 2 | |
| 20 | Not Observed. |
| 21 | |
| 22 | Not Observed. |
| 23 | |
| 24 | |
| 25 | |
| 26 | |
| 27 | |
| 28 | |
| 29 | Library has new hardwood floor. |
| 3 | |
| 30 | |

Chicago Public Schools

School Gunsaulus Academy Unit 29121 Building ID 3690

Address 4420 S. Sacramento Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|---------------------|
| 31 | |
| 32 | |
| 33 | |
| 34 | |
| 35 | |
| 36 | |
| 37 | |
| 38 | |
| 39 | |
| 4 | |
| 40 | |
| 41 | |
| 42 | |
| 43 | |
| 44 | |
| 45 | |
| 46 | |
| 5 | |
| 6 | Not Observed. |
| 7 | |
| 8 | |
| 9 | Not Observed. |
| D | |
| E | |
| F | |
| G | |
| H | |
| J | |
| K | |

Chicago Public Schools

School Gunsaulus Academy **Unit** 29121 **Building ID** 3690

Address 4420 S. Sacramento **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

| HA Number: | Inspector Comments: |
|------------|---------------------|
| L | |
| M | |
| N | |

Table II

Management Planner's Review

Chicago Public Schools

School Gunsaulus Academy
Address 4420 S. Sacramento

Unit 29121
Chicago, IL, 60632

Building ID 3690
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|--|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|--------------------------------------|----------------------------|
| 1 | Hard Plaster | 31,000 | SF | Throughout | Assumed | SURFACE | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 10 | 1' x 1' Ceiling Tile Adhesive | 6,020 | SF | Gym | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 11 | 12" x 12" Tan Floor Tile | 725 | SF | Room 312A and 2nd Floor Teachers' Lounge | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 12 | 12" x 12" Tan Floor Tile Mastic | 300 | SF | 3rd Floor Teacher's Lounge | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 13 | 12" x 12" Speckled Gray Floor Tile | 900 | SF | 1st and 3rd Floor Teacher's Lounges | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 14 | 12" x 12" Speckled Gray Floor Tile Mastic - HA13 | 700 | SF | Room 312A | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 15 | 12" x 12" Cream Floor Tile w/Black Specs | 600 | SF | Front Office and Principle's Office | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 16 | 12"x12" Cream Floor Tile w/Black Specs Mastic-HA15 | 600 | SF | Front Office and Principle's Office | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 17 | 9" x 9" Green Floor Tile | 400 | SF | 1st Floor Principal Office | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 18 | 9" x 9" Green Floor Tile Mastic - HA17 | 400 | SF | 1st Floor Principal Office | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 19 | 12" x 12" Cream w/Brown Specks Floor Tile | 1,500 | SF | Room 115, 206 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 2 | 2' x 4' Ceiling Tile | 50,000 | SF | Throughout | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 20 | 12" x 12" Cream w/Brown Specks Floor Tile Mastic | 1,500 | SF | Room 115 | Chrysotile | MISC | No | | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 21 | Unknown Size Floor Tile | 3,000 | SF | 2nd and 3rd Floor Halls, 3rd Floor Teacher's Lounge | Chrysotile | MISC | No | | SF | | |
| 22 | Unknown Size Floor Tile Mastic | 3,000 | SF | 2nd and 3rd Floor Halls, 3rd Floor Teacher's Lounge | Chrysotile | MISC | No | | SF | | |
| 23 | 9" x 9" Beige Floor Tile | 300 | SF | Assembly Hall | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 24 | 9" x 9" Beige Floor Tile Mastic | 100 | SF | Assembly Hall | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 25 | 4" Red Baseboard | 350 | LF | Gym | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 26 | 4" Red Baseboard Mastic | 300 | LF | Gym | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 27 | Carpet Mastic | 1,000 | SF | Rooms 212 and 310, Office, Kindergarten Room, and Library | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 28 | Blue Carpet Mastic | 500 | SF | Room 110, Office, Principal's Office, 112 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 29 | Green Carpet Mastic | 750 | SF | Rooms 212A Computer, Library and 310 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 3 | 1' x 1' Ceiling Tile | 6,020 | SF | Not Observed | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 30 | Brick/Brown Multi Color Ceramic Floor Tile Grout | 6,200 | SF | All Boys' and Girls' Washrooms on 1st, 2nd, and 3rd Floors | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 31 | Yellow Ceramic Wall Tile Grout | 6,200 | SF | All Boys' and Girls' Washrooms on 1st, 2nd and 3rd Floors | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 32 | Yellow Ceramic Wall Tile Grout Adhesive | 420 | SF | All Boys' and Girls' Washrooms on | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |

Chicago Public Schools

School Gunsaulus Academy
Address 4420 S. Sacramento

Unit 29121
 Chicago, IL, 60632

Building ID 3690
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|--|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|--|----------------------------|
| | | | | 1st,2nd and 3rd Floors | | | | | | | |
| 33 | Brown Carpet Mastic | 120 | SF | Room 312 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 34 | Drywall-Wall | 830 | SF | Rooms 207,217 and 208 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 35 | Drywall-Compound | 142 | LF | Rooms 207,217 and 208 | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 36 | Drywall-Wall Tape | 142 | LF | Rooms 207,217 and 208 | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 37 | Drywall-Ceiling | 102 | SF | Rooms 207,217 and 208 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 38 | Drywall-Ceiling-Compound | 37 | LF | Rooms 207,218 and 208 | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 39 | Drywall-Ceiling-Tape | 37 | LF | Rooms 207,218 and 208 | Assumed | MISC | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 4 | 12" x 12" Brown w/White Speck Floor Tile | 4,000 | SF | 2nd, 3rd Floor Halls,2nd , 3rd Floor Teacher's Lounges,Rooms 312A,108, Engineer's Office | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 40 | Orange Carpet Mastic | 918 | SF | Room 115 | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 41 | 9"x 9" Brick Floor Tile | 300 | SF | 1st Floor Principal Office | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 42 | 9"x9" Brick Floor Tile Mastic | 300 | SF | 1st Floor Principal Office | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 43 | 12"x12" Brown Floor Tile w/Brown and White Streaks | 200 | SF | Assembly Hall Patch, 1st Floor Principal Office and Washroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 44 | 12"x12" Brwn Floor Tile w/ Brwn&Wht Streaks Mastic | 200 | SF | Assembly Hall Patch and 1st Floor Principal Office and Washroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 45 | 12"x12" Brown Speckled Floor Tile Patch | 1,800 | SF | Lunchroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 46 | 12"x12" Brwn Speckled Floor Tile Mastic | 1,800 | SF | Lunchroom | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 5 | 9" x 9" Brown Floor Tile | 1,500 | SF | Assembly Hall, Rm 312A, and engineers office | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 6 | Linoleum | | | Was in Gym and Gym has New Floor | Assumed | MISC | No | | | | |
| 7 | 12" x 12" Brown w/White Speck Floor Tile Mastic | 4,000 | SF | 2nd, 3rd Floor Halls and Teacher's Lounge See HA 4 | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 8 | 9" x 9" Brown Floor Tile Mastic | 1,800 | SF | Assembly Hall | Chrysotile | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |
| 9 | Linoleum Mastic | | | See HA 6 | Assumed | MISC | No | | | | |
| D | Pre-formed Pipe Lagging | 300 | LF | Boiler Room | Chrysotile | TSI | Yes | 40 | LF | 7 Any remaining friable ACBM or friable suspect ACBM | Repair |
| E | Fittings Off Pre-formed Pipe Lagging | 50 | LF | Boiler Room | Chrysotile | TSI | No | 4 | LF | 7 Any remaining friable ACBM or friable suspect ACBM | Repair |
| F | Cardboard Pipe Insulation | 120 | LF | Boiler Room | Chrysotile | TSI | Yes | 0 | LF | 7 Any remaining friable ACBM or friable suspect ACBM | Operations and Maintenance |
| G | Fittings Off Cardboard Pipe Insulation | 50 | LF | Boiler Room | Chrysotile | TSI | Yes | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| H | Air Cell Duct Insulation | 50 | LF | Basement | Chrysotile | TSI | Yes | 0 | LF | 7 Any remaining friable ACBM or friable | Operations and Maintenance |

Chicago Public Schools

School Gunsaulus Academy
Address 4420 S. Sacramento

Unit 29121
 Chicago, IL, 60632

Building ID 3690
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Num | Material Description | Material Quantity | Material Units | Material Location | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category | Response |
|--------|-------------------------------------|-------------------|----------------|------------------------|---------------|-------------------|---------|-----------------|--------------|---|----------------------------|
| | | | | | | | | | | suspect ACBM | |
| J | Pipe Fittings Off Fiberglass Pipe | 50 | LF | Basement | Assumed | TSI | No | 0 | LF | 7 Any remaining friable ACBM or friable suspect ACBM | Operations and Maintenance |
| K | Air Cell Pipe Insulation (Covering) | 240 | LF | Basement - Crawl Space | Chrysotile | TSI | Yes | 150 | LF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Remove |
| L | Fittings Off Air Cell Pipe Runs | 90 | LF | Basement - Crawl Space | Chrysotile | TSI | No | 50 | LF | 1 Damaged or significantly damaged friable thermal system insulating ACBM | Remove |
| M | Gaskets Off Boiler | 20 | LF | Boiler Room | Chrysotile | TSI | No | 0 | LF | 6 ACBM with the potential for damage | Operations and Maintenance |
| N | Refractory Brick - Non AHERA | | SF | Boiler Room | Assumed | MISC | No | 0 | SF | 6 ACBM with the potential for damage | Operations and Maintenance |

Chicago Public Schools

School Gunsaulus Academy
Address 4420 S. Sacramento

Unit 29121
 Chicago, IL, 60632

Building ID 3690
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| | |
|------------------------------------|---------------|
| Review Date | 3/31/2013 |
| Manager Planner Name | Daniel Juneau |
| 100-03613 | 5/15/2014 |
| Manager IDPH License No/Expiration | |

| HA Number | Management Comments |
|-----------|--|
| 1 | |
| 10 | |
| 11 | |
| 12 | |
| 13 | |
| 14 | |
| 15 | |
| 16 | |
| 17 | |
| 18 | |
| 19 | |
| 2 | |
| 20 | Material may exist beneath existing flooring |
| 21 | |
| 22 | |
| 23 | |
| 24 | |
| 25 | |
| 26 | |
| 27 | |
| 28 | |
| 29 | |
| 3 | |
| 30 | |
| 31 | |
| 32 | |

Chicago Public Schools

School Gunsaulus Academy
Address 4420 S. Sacramento

Unit 29121
 Chicago, IL, 60632

Building ID 3690
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|---|
| 33 | |
| 34 | |
| 35 | |
| 36 | |
| 37 | |
| 38 | |
| 39 | |
| 4 | |
| 40 | |
| 41 | |
| 42 | |
| 43 | |
| 44 | |
| 45 | |
| 46 | |
| 5 | |
| 6 | |
| 7 | |
| 8 | |
| 9 | |
| D | Repair damaged areas of HA N and continue O&M. |
| E | Repair damaged areas of HA E and continue O&M |
| F | |
| G | |
| H | |
| J | |
| K | West Basement Crawlspace abated. Remaining crawlspace areas should be labeled as an Asbestos Hazard until |

Chicago Public Schools

School Gunsaulus Academy
Address 4420 S. Sacramento

Unit 29121
Chicago, IL, 60632

Building ID 3690
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

| HA Number | Management Comments |
|-----------|---|
| | response action can be implemented. |
| L | West Basement Crawlspace Abated. Remaining crawlspace areas should be labeled as an Asbestos Hazard until response action can be implemented. |
| M | |
| N | |

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **Hard Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout**

MATERIAL QUANTITY: **31000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

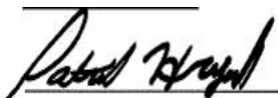

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **Hard Plaster**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **31000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **6020** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

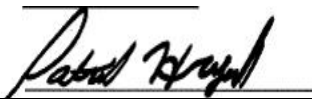

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile Adhesive**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **6020** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 312A and 2nd Floor Teachers' Lounge**
MATERIAL QUANTITY: **725** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

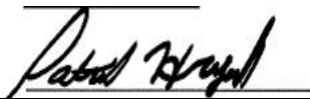

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile**
MATERIAL LOCATION: **Room 312A and 2nd Floor Teachers' Lounge**
MATERIAL QUANTITY: **725** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd Floor Teacher's Lounge**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

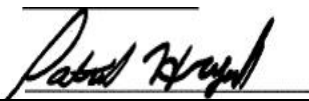

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile Mastic**
MATERIAL LOCATION: **3rd Floor Teacher's Lounge**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **12" x 12" Speckled Gray Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st and 3rd Floor Teacher's Lounges**

MATERIAL QUANTITY: **900**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

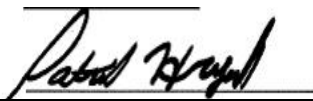

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **12" x 12" Speckled Gray Floor Tile**
MATERIAL LOCATION: **1st and 3rd Floor Teacher's Lounges**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

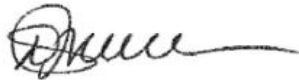

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12" x 12" Speckled Gray Floor Tile Mastic - HA13**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 312A**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

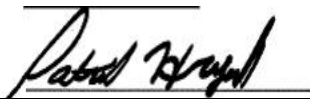

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **12" x 12" Speckled Gray Floor Tile Mastic - HA13**

MATERIAL LOCATION: **Room 312A**

MATERIAL QUANTITY: **700**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12" x 12" Cream Floor Tile w/Black Specs**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Front Office and Principle's Office**

MATERIAL QUANTITY: **600**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

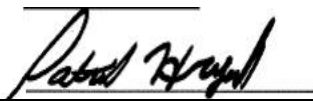

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12" x 12" Cream Floor Tile w/Black Specs**
MATERIAL LOCATION: **Front Office and Principle's Office**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Cream Floor Tile w/Black Specs Mastic-HA15**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Front Office and Principle's Office**

MATERIAL QUANTITY: **600**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

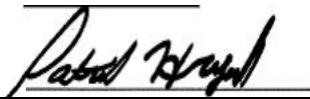

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Cream Floor Tile w/Black Specs Mastic-HA15**
MATERIAL LOCATION: **Front Office and Principle's Office**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

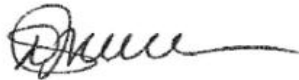

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **1st Floor Principal Office**

MATERIAL QUANTITY: **400**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

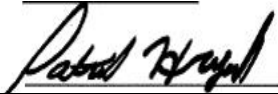

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile**
MATERIAL LOCATION: **1st Floor Principal Office**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile Mastic - HA17**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Principal Office**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

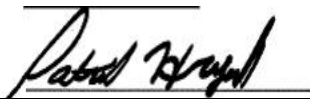

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **9" x 9" Green Floor Tile Mastic - HA17**
MATERIAL LOCATION: **1st Floor Principal Office**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12" x 12" Cream w/Brown Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 115, 206**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

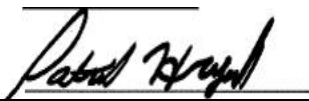

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12" x 12" Cream w/Brown Specks Floor Tile**
MATERIAL LOCATION: **Room 115, 206**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

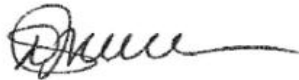

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **2' x 4' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **50000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

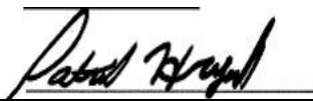

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **2' x 4' Ceiling Tile**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **50000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

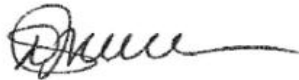

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12" x 12" Cream w/Brown Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**
MATERIAL LOCATION: **Room 115**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Not Observed.**

Inspector's Signature: _____

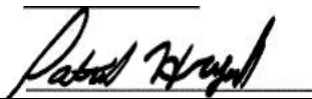

Date: 03/22/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUILDING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12" x 12" Cream w/Brown Specks Floor Tile Mastic**
MATERIAL LOCATION: **Room 115**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Material may exist beneath existing flooring

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Unknown Size Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **2nd and 3rd Floor Halls, 3rd Floor Teacher's Lounge**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

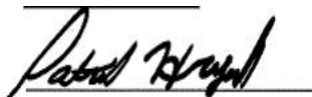

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Unknown Size Floor Tile**
MATERIAL LOCATION: **2nd and 3rd Floor Halls, 3rd Floor Teacher's Lounge**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Unknown Size Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**


MATERIAL LOCATION: **2nd and 3rd Floor Halls, 3rd Floor Teacher's Lounge**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not Observed.**

Inspector's Signature:

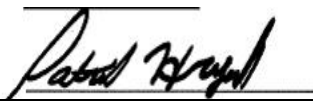

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Unknown Size Floor Tile Mastic**
MATERIAL LOCATION: **2nd and 3rd Floor Halls, 3rd Floor Teacher's Lounge**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **9" x 9" Beige Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

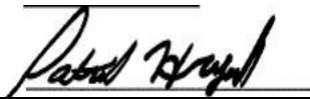

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **9" x 9" Beige Floor Tile**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

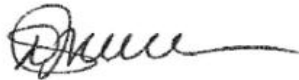

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **9" x 9" Beige Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

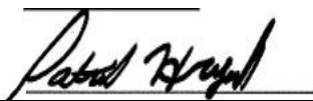

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **9" x 9" Beige Floor Tile Mastic**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **4" Red Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

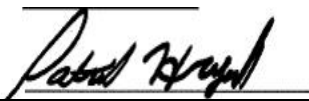

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **4" Red Baseboard**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY: **350**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **4" Red Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____

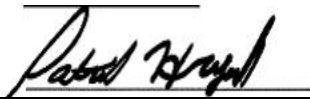

Date: 03/22/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **4" Red Baseboard Mastic**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

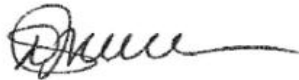

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 212 and 310, Office, Kindergarten Room, and Library**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

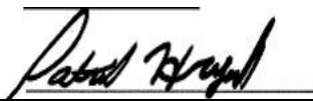

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Rooms 212 and 310, Office, Kindergarten Room, and Library**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 110, Office, Principal's Office, 112**

MATERIAL QUANTITY: **500**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

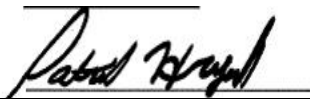

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
MATERIAL LOCATION: **Room 110, Office, Principal's Office, 112**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Green Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 212A Computer, Library and 310**

MATERIAL QUANTITY: **750**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Library has new hardwood floor.**

Inspector's Signature:

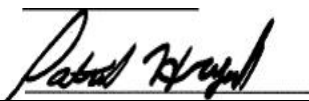

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Green Carpet Mastic**
MATERIAL LOCATION: **Rooms 212A Computer, Library and 310**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Not Observed**
MATERIAL QUANTITY: **6020** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

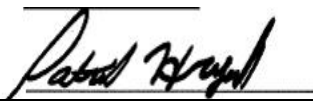

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**
MATERIAL LOCATION: **Not Observed**
MATERIAL QUANTITY: **6020** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

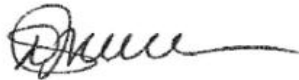

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Brick/Brown Multi Color Ceramic Floor Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Boys' and Girls' Washrooms on 1st, 2nd, and 3rd Floors**
MATERIAL QUANTITY: **6200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

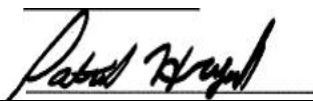

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Brick/Brown Multi Color Ceramic Floor Tile Grout**
MATERIAL LOCATION: **All Boys' and Girls' Washrooms on 1st, 2nd, and 3rd Floors**
MATERIAL QUANTITY: **6200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Yellow Ceramic Wall Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Boys' and Girls' Washrooms on 1st,2nd and 3rd Floors**
MATERIAL QUANTITY: **6200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

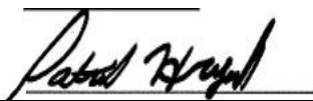

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Yellow Ceramic Wall Tile Grout**
MATERIAL LOCATION: **All Boys' and Girls' Washrooms on 1st,2nd and 3rd Floors**
MATERIAL QUANTITY: **6200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Yellow Ceramic Wall Tile Grout Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Boys' and Girls' Washrooms on 1st,2nd and 3rd Floors**
MATERIAL QUANTITY: **420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

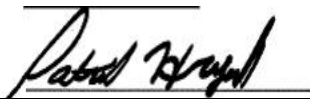

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Yellow Ceramic Wall Tile Grout Adhesive**
MATERIAL LOCATION: **All Boys' and Girls' Washrooms on 1st,2nd and 3rd Floors**
MATERIAL QUANTITY: **420** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 312**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

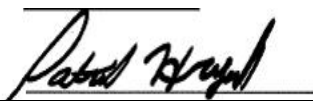

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **Brown Carpet Mastic**

MATERIAL LOCATION: **Room 312**

MATERIAL QUANTITY: **120**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

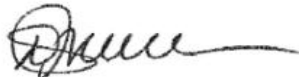

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Drywall-Wall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 207,217 and 208**
MATERIAL QUANTITY: **830** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

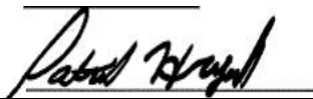

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Drywall-Wall**
MATERIAL LOCATION: **Rooms 207,217 and 208**
MATERIAL QUANTITY: **830** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Drywall-Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 207,217 and 208**
MATERIAL QUANTITY: **142** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

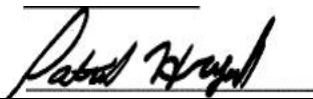

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Drywall-Compound**
MATERIAL LOCATION: **Rooms 207,217 and 208**
MATERIAL QUANTITY: **142** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Drywall-Wall Tape**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 207,217 and 208**
MATERIAL QUANTITY: **142** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

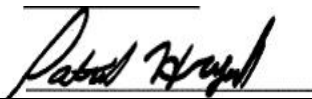

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Drywall-Wall Tape**
MATERIAL LOCATION: **Rooms 207,217 and 208**
MATERIAL QUANTITY: **142** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Drywall-Ceiling**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 207,217 and 208**
MATERIAL QUANTITY: **102** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

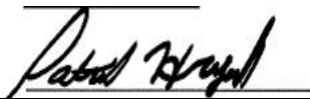

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Drywall-Ceiling**
MATERIAL LOCATION: **Rooms 207,217 and 208**
MATERIAL QUANTITY: **102** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

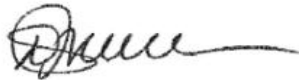

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Drywall-Ceiling-Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 207,218 and 208**
MATERIAL QUANTITY: **37** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

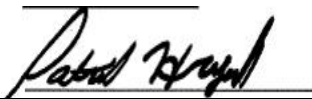

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **Drywall-Ceiling-Compound**

MATERIAL LOCATION: **Rooms 207,218 and 208**

MATERIAL QUANTITY: **37**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

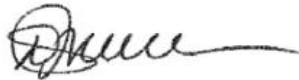

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Drywall-Ceiling-Tape**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 207,218 and 208**
MATERIAL QUANTITY: **37** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

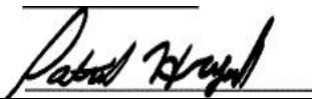

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Drywall-Ceiling-Tape**
MATERIAL LOCATION: **Rooms 207,218 and 208**
MATERIAL QUANTITY: **37** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Speck Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**


MATERIAL LOCATION: **2nd, 3rd Floor Halls, 2nd, 3rd Floor Teacher's Lounges, Rooms 312A, 108, Engineer's Office**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

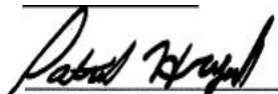

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Speck Floor Tile**
MATERIAL LOCATION: **2nd, 3rd Floor Halls, 2nd , 3rd Floor Teacher's Lounges, Rooms 312A, 108, Engineer's Office**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Orange Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 115**
MATERIAL QUANTITY: **918** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

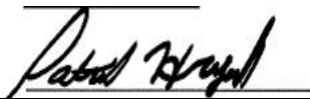

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Orange Carpet Mastic**
MATERIAL LOCATION: **Room 115**
MATERIAL QUANTITY: **918** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

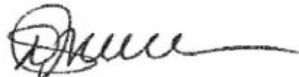

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **9"x 9" Brick Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st Floor Principal Office**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

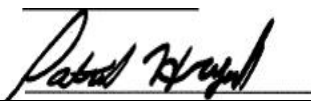

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **9"x 9" Brick Floor Tile**
MATERIAL LOCATION: **1st Floor Principal Office**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **9"x9" Brick Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Principal Office**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

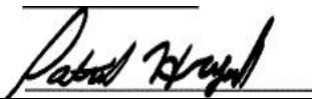

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **9"x9" Brick Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Principal Office**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

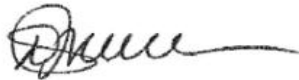

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile w/Brown and While Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**


MATERIAL LOCATION: **Assembly Hall Patch, 1st Floor Principal Office and Washroom**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

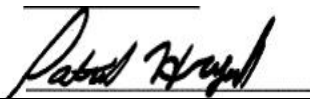

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile w/Brown and While Streaks**
MATERIAL LOCATION: **Assembly Hall Patch, 1st Floor Principal Office and Washroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12"x12" Brwn Floor Tile w/ Brwn&Wht Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Assembly Hall Patch and 1st Floor Principal Office and Washroom**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

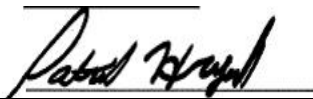

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12"x12" Brwn Floor Tile w/ Brwn&Wht Streaks Mastic**
MATERIAL LOCATION: **Assembly Hall Patch and 1st Floor Principal Office and Washroom**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12"x12" Brown Speckled Floor Tile Patch**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunchroom**

MATERIAL QUANTITY: **1800**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

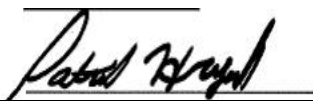

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12"x12" Brown Speckled Floor Tile Patch**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12"x12" Brwn Speckled Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

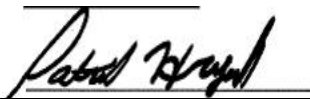

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **46**

MATERIAL DESCRIPTION: **12"x12" Brwn Speckled Floor Tile Mastic**

MATERIAL LOCATION: **Lunchroom**

MATERIAL QUANTITY: **1800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Assembly Hall, Rm 312A, and engineers office**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

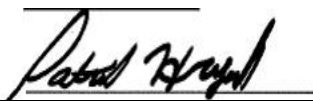

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile**
MATERIAL LOCATION: **Assembly Hall, Rm 312A, and engineers office**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Was in Gym and Gym has New Floor**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:

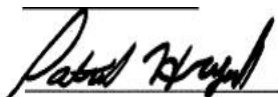

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **6**

MATERIAL DESCRIPTION: **Linoleum**

MATERIAL LOCATION: **Was in Gym and Gym has New Floor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Speck Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd, 3rd Floor Halls and Teacher's Lounge See HA 4**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

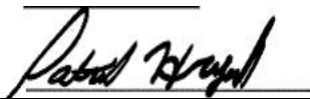

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" x 12" Brown w/White Speck Floor Tile Mastic**
MATERIAL LOCATION: **2nd, 3rd Floor Halls and Teacher's Lounge See HA 4**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

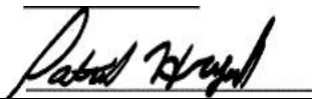

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **9" x 9" Brown Floor Tile Mastic**
MATERIAL LOCATION: **Assembly Hall**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

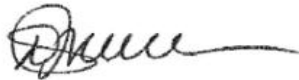

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **See HA 6**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:

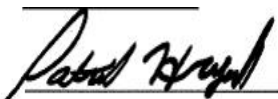

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **9**

MATERIAL DESCRIPTION: **Linoleum Mastic**

MATERIAL LOCATION: **See HA 6**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Pre-formed Pipe Lagging**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

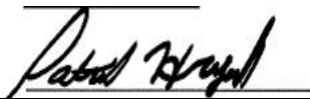

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Pre-formed Pipe Lagging**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **40** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Repair damaged areas of HA N and continue O&M.

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Fittings Off Pre-formed Pipe Lagging**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

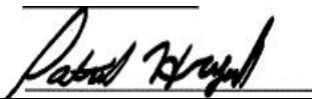

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Fittings Off Pre-formed Pipe Lagging**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **4** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Repair damaged areas of HA E and continue O&M

Management Planner's Signature: _____

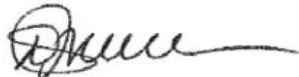

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

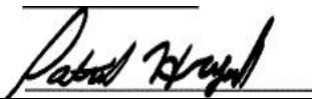

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

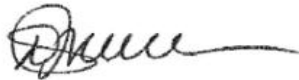

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Fittings Off Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

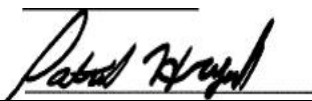

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **Fittings Off Cardboard Pipe Insulation**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Air Cell Duct Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Basement**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____

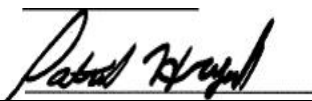

Date: 03/22/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Air Cell Duct Insulation**
MATERIAL LOCATION: **Basement**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

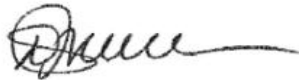

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Pipe Fittings Off Fiberglass Pipe**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Basement**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____

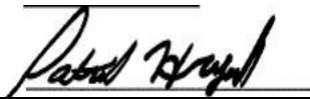

Date: 03/22/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Pipe Fittings Off Fiberglass Pipe**
MATERIAL LOCATION: **Basement**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

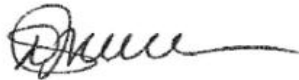

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Air Cell Pipe Insulation (Covering)**
HISTORICAL AHERA DAMAGE CATEGORY **1 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Basement - Crawl Space**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

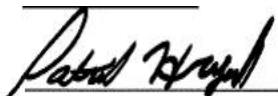

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Air Cell Pipe Insulation (Covering)**
MATERIAL LOCATION: **Basement - Crawl Space**
MATERIAL QUANTITY: **240** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **150** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

West Basement Crawlspace abated. Remaining crawlspace areas should be labeled as an Asbestos Hazard until response action can be implemented.

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **Fittings Off Air Cell Pipe Runs**
HISTORICAL AHERA DAMAGE CATEGORY **1 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Basement - Crawl Space**

MATERIAL QUANTITY: **90**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

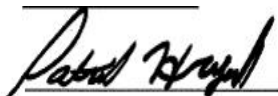

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **L**

MATERIAL DESCRIPTION: **Fittings Off Air Cell Pipe Runs**

MATERIAL LOCATION: **Basement - Crawl Space**

MATERIAL QUANTITY: **90**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **50**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

West Basement Crawlspace Abated. Remaining crawlspace areas should be labeled as an Asbestos Hazard until response action can be implemented.

Management Planner's Signature: _____



Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Gaskets Off Boiler**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

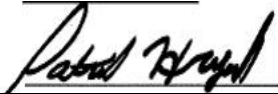

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Gaskets Off Boiler**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

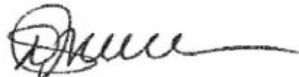

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Gunsaulus Academy** INSPECTION DATE: **3/22/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **Refractory Brick - Non AHERA**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

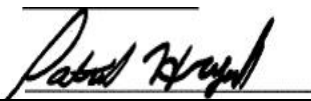

Date: **03/22/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29121** BUIDLING ID: **3690**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Gunsaulus Academy** REVIEW DATE: **3/31/2013**
ADDRESS: **4420 S. Sacramento** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **Refractory Brick - Non AHERA**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

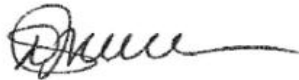

Date: **03/31/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

| ENDORSEMENTS | TC EXPIRES |
|---------------------------|------------|
| INSPECTOR | 12/9/2012 |
| PROJECT MANAGER | 11/2/2012 |
| AIR SAMPLING PROFESSIONAL | |

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.


Illinois Department of
PUBLIC HEALTH

ASBESTOS PROFESSIONAL LICENSE

| ID NUMBER | ISSUED | EXPIRES |
|-------------|-----------|------------|
| 100 - 09725 | 5/31/2012 | 05/15/2013 |

PATRICK L HRYCYK
2942 N. MASON AVE
CHICAGO, IL 60634

Environmental Health



CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PATRICK HRYCYK
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 12/07/2012 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools;
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



N. Penoff

12/07/2012

Course Dates:

12/07/2013

Expires:

1212BIR02

Certificate Number:

Phone Number: (312) 491-0081

Director of Training

Nicholas J. Penoff

Doctor of Public Health

FORM # A-010



Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department
of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance
with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042319


Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012

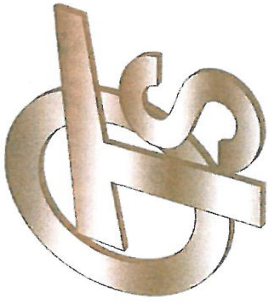

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736


Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013

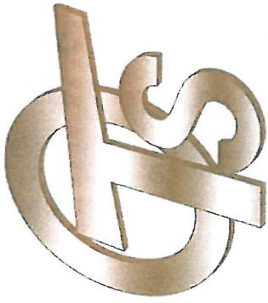

Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau


has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014



Kathy DeSalvo, Director

2013

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 03613

ISSUED
4/11/2013

EXPIRES
05/15/2014

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

| | CODE | KEY |
|--------------------------|-------------|--|
| MATERIAL | | |
| | ACBM | Asbestos Containing Building Materials |
| MATERIAL CATEGORY | | |
| | MISC | Miscellaneous |
| | SURF | Surfacing |
| | TSI | Thermal System Insulation |
| MATERIAL UNITS | | |
| | LF | Linear Feet |
| | SF | Square Feet |
| | CF | Cubic Feet |
| DAMAGE TYPE | | |
| | Loc | Localized |
| | Dist | Distributed |