

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2259
SCHOOL NAME: Hendricks Academy
ADDRESS OF SCHOOL: 4316 S. Princeton
CITY: Chicago, IL, 60609

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **2/17/2010**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/2/2013 ENROLLMENT 284

IDPH INSPECTOR LICENSE NUMBER: 100-09725

IDPH LICENSED INSPECTOR NAME (Please Print): Patrick Hrycyk

IDPH MP LICENSE NUMBER: 100-03613

IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



4/2/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Hendricks Academy

4316 S. Princeton
Chicago, IL, 60609

Unit: 31121
Building ID: 3930

IDPH ID Number: 14-016-2990-2259

REPORT DATE:

Tuesday, April 02, 2013

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

March 19, 2013

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 31121 Region: 04 IDPH ID: 14-016-2990-2259

School: Hendricks Academy Building ID: 3930

Address: 4316 S. Princeton
Chicago, IL, 60609

Building Contact: Middleton, Glen Contact Phone: 773-206-8216

Current Building Owners: Chicago Public Schools

Review Date: 4/2/2013

Inspector: Patrick Hrycyk Inspector IDPH License: 100-09725
Management Planner: Daniel Juneau Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 19, 2013

RE: Hendricks Academy, Unit 31121
4316 S. Princeton
Chicago, IL, 60609

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Hendricks Academy, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Hendricks Academy, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113.

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Hendricks Academy Unit: 31121 Region: 04
Address: 4316 S. Princeton Chicago, IL, 60609
IDPH ID: 14-016-2990-2259 Building ID: 3930
Contact: Middleton, Glen Phone: 773-206-8216

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: 59500 No of Floors:
Current Occupancy: 284

3. LEA Designated Person

Contact: Ms. Lynn Crivello Phone: (773) 553-3113
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603


4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Patrick Hrycyk


Inspector IDPH license # 100-09725

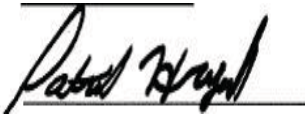Signature: 
Date: 3/19/2013

6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613

Signature: 
Date: 4/2/2013

7. Review Date: 4/2/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 4/2/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Hendricks Academy. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3930:

10	1' x 1' Ceiling Tile
3	1' x 1' Ceiling Tile
3M	1' x 1' Ceiling Tile Mastic
5	Plaster

B. The following new homogenous areas have been identified for Building 3930:

49	Gray W/Black Dot linoleum
49M	Gray W/Black Dot linoleum Mastic
50	Blue Carpet Mastic
51	3' X 3' Rubber Floor White W/Black
51M	3' X 3' Rubber Floor Adhesive
52	3' X 3' Rubber Floor Blue W/White
52M	3' X 3' Rubber Floor Blue W/White Adhesive
53	12"X12" Cream W/Tan Floor Tile
53M	12"X12" Cream W/tan Floor Tile Mastic

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

10	1' x 1' Ceiling Tile
24	TSI In Boiler by Doors
25	Boiler Gasket
26	Refractory Brick
27	Roof Flashing - Not AHERA
28	Exterior Brick - Not AHERA
29	Exterior Mortar - Not AHERA
3	1' x 1' Ceiling Tile
30	Chalk Board/Poster Board Adhesive
31	12" x 12" Tan w/White Specks Floor Tile
32	12" x 12" Tan w/White Specks Floor Tile Mastic
33	12" x 12" Dark Green w/Tan Floor Tile
34	12" x 12" Dark Green w/Tan Floor Tile Mastic
35	Interior Material of Incinerator
36	Vault Door
37	9"x9" Beige with brown streaks floor tile
38	9"x9" Beige with brown straks floor tile mastic
39	Sink Under Coating
3M	1' x 1' Ceiling Tile Mastic
40	Aircell pipe insulation
41	Vibration dampers
42	Cork board wall panels adhesive
43	12x12 Blue floor tile
44	12x12 Blue floor tile mastic
45	4" Dark Blue baseboard
46	4" Dark Blue baseboard mastic
47	Mag pipe insulation
48	Fittings on Mag pipe insulation
49	Gray W/Black Dot linoleum
49M	Gray W/Black Dot linoleum Mastic
5	Plaster
50	Blue Carpet Mastic
51	3' X 3' Rubber Floor White W/Black
51M	3' X 3' Rubber Floor Adhesive
52	3' X 3' Rubber Floor Blue W/White
52M	3' X 3' Rubber Floor Blue W/White Adhesive
53	12"X12" Cream W/Tan Floor Tile
53M	12"X12" Cream W/tan Floor Tile Mastic

The following areas were deemed to be inaccessible:

11M	6" x 12" Brown Floor Tile Mastic
-----	----------------------------------

30	Chalk Board/Poster Board Adhesive
32	12" x 12" Tan w/White Specks Floor Tile Mastic
34	12" x 12" Dark Green w/Tan Floor Tile Mastic
36	Vault Door
38	9"x9" Beige with brown straks floor tile mastic
3M	1' x 1' Ceiling Tile Mastic
42	Cork board wall panels adhesive
44	12x12 Blue floor tile mastic
45	4" Dark Blue baseboard
46	4" Dark Blue baseboard mastic
49M	Gray W/Black Dot linoleum Mastic
50	Blue Carpet Mastic
51M	3' X 3' Rubber Floor Adhesive
52M	3' X 3' Rubber Floor Blue W/White Adhesive
53M	12"X12" Cream W/tan Floor Tile Mastic
6M	12" x 12" Dark Grey Floor Tile Mastic
7M	12" x 12" Beige Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Patrick Hrycyk, IDPH License # 100-09725. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Hendricks Academy Building 3930 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Hendricks Academy Unit 31121 Building ID 3930
 Address 4316 S. Princeton Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500
 Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	12" x 12" Beige (Tan) Floor Tile			Lunchroom, lunchroom storage Auditorium	ABATED	MISC		None						Low
10	1' x 1' Ceiling Tile	2,100	SF		ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
11	12" x 12" Brown Floor Tile	450	SF	1st, 2nd, 3rd Floor Corridor Perimeter	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11M	6" x 12" Brown Floor Tile Mastic	450	SF	1st, 2nd, 3rd floor Corridor Perimeter	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	TSI on Pipe with Metal Cover	80	LF	Girls' 2nd Floor and Boy's 1st Floor Washrooms	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
13	TSI on Valve Coupler/20" Pipe	54	SF	Boiler Room	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
14	TSI on <4" Valves	5	LF	Boiler Room	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
15	TSI Pipe Cover (12" Pipe)	450	LF	Hall/Passageway Fan Room, air tunnel, basement storage rooms, boiler room	AMO_CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
16	TSI 12" Pipe Elbows/Fittings	46	LF	Hall/Passageway Fan Room, air tunnel, basement storage rooms, boiler room	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
17	TSI Cardboard Insulation/Small Pipe Elbows/Fittings	30	LF	Boiler Room and Passageway	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
18	TSI Cardboard Insulation	375	LF	Boiler Room and Passageway	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
19	TSI 4" Valves	10	LF	Boiler and Air Tunnel	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
1M	12" x 12" Beige (Tan) Floor Tile Mastic			Lunchroom and lunchroom storage	ABATED	MISC		None						
2	Cove Base Black	50	SF	Lunchroom	NO_ACBM									
20	TSI Small Pipe/Covers	400	LF	Air Tunnel	AMO_CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
21	TSI Cardboard Insulation	300	LF	Air Tunnel	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Hendricks Academy Unit 31121 Building ID 3930
Address 4316 S. Princeton Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carrow, Conibear and Associates

600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
22	TSI on Small Pipes	28	LF	Air Tunnel	CHR	TSI	Y	NONE	0		No	suspect ACBM Any remaining friable ACBM or friable suspect ACBM		LOW
23	TSI Boiler Coverings	2,000	SF	Boiler Room	AMO_CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
24	TSI In Boiler by Doors	18	SF	Boiler Room	ASSUMED	TSI								
25	Boiler Gasket	18	SF	Boiler Room	ASSUMED	TSI								
26	Refractory Brick	300	SF	Boiler Room	ASSUMED	MISC					No			
27	Roof Flashing - Not AHERA	2,800	LF	Roof	ASSUMED	MISC	N				No			
28	Exterior Brick - Not AHERA	14,000	SF	Building Exterior	ASSUMED	MISC	N				No			
29	Exterior Mortar - Not AHERA	14,000	SF	Building Exterior	ASSUMED	MISC	N				No			
3	1' x 1' Ceiling Tile	3,250	SF	Lunchroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
30	Chalk Board/Poster Board Adhesive	300	SF	All classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	12" x 12" Tan w/White Specks Floor Tile	775	SF	Room 301	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	12" x 12" Tan w/White Specks Floor Tile Mastic	775	SF	Room 301	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	12" x 12" Dark Green w/Tan Floor Tile	1,000	SF	Room 204	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12" x 12" Dark Green w/Tan Floor Tile Mastic	1,000	SF	Room 204	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	Interior Material of Incinerator	120	SF	Boiler Room	ASSUMED	MISC		None						
36	Vault Door	28	SF	Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	9"x9" Beige with brown streaks floor tile	20	SF	Hallway outside 314 and 302, 311-312	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	9"x9" Beige with brown straks floor tile mastic	20	SF	Hallway outside 311 and 312.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	Sink Under Coating	4	SF	Room 312	ASSUMED	MISC								
3M	1' x 1' Ceiling Tile Mastic	3,250	SF	Lunchroom, 1st, 2nd, 3rd floor corridors	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
4	12" x 12" Tan Floor Tile	15,000	SF	102,104,106,108,110,202,206,208,212,302,304,308,312,310, main office, assembly hall, 2nd & 3rd floor corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Hendricks Academy Unit 31121 Building ID 3930

Address 4316 S. Princeton Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
40	Airecell pipe insulation	16	LF	Room 204 under lab sinks.	ASSUMED	TSI	Y	Unknown						Low
41	Vibration dampers	6	LF	2nd floor mechanical space (fan rm #2) and fan room in lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	Cork board wall panels adhesive	300	SF	2nd floor mechanical space	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	12x12 Blue floor tile	1,100	SF	Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basmt passage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	12x12 Blue floor tile mastic	1,100	SF	Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basmt passage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	4" Dark Blue baseboard	270	LF	Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basmt passage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	4" Dark Blue baseboard mastic	270	LF	Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basmt passage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	Mag pipe insulation	70	LF	2nd floor mechanical room	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
48	Fittings on Mag pipe insulation	30	LF	2nd floor mechanical room	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
49	Gray W/Black Dot Inoleum	3,600	SF	Room 305, 306, 303	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49M	Gray W/Black Dot Inoleum Mastic	3,600	SF	Room 305, 306, 303	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
4M	12" x 12" Tan Floor Tile Mastic	21,600	SF	102,104,106,108,110,202,206,208,212,302,304,308,312,310 main office,assembly hall, 2nd & 3rd floor corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Hendricks Academy Unit 31121 Building ID 3930
Address 4316 S. Princeton Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date **3/19/2013**
Inspector Name **Patrick Hrycyk**
100-09725 **5/15/2013**
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
1	Material not observed - 2013
10	
11	
11M	
12	
13	
14	
15	
16	
17	
18	
19	
1M	Material not observed - 2013
2	
20	
21	
22	
23	
24	Material not observed - 2013
25	Material not observed - 2013
26	Material not observed - 2013
27	Non AHERA
28	Non AHERA
29	Non AHERA

Chicago Public Schools

School Hendricks Academy Unit 31121 Building ID 3930
Address 4316 S. Princeton Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
3	
30	
31	
32	
33	
34	
35	Material not observed - 2013
36	
37	
38	
39	Material not observed - 2013
3M	Material not observed in 1st, 2nd, and 3rd floor corridors
4	
40	Material not observed - 2013
41	
42	
43	
44	
45	
46	
47	
48	
49	
49M	
4M	
5	
50	
51	
51M	

Chicago Public Schools

School Hendricks Academy Unit 31121 Building ID 3930
Address 4316 S. Princeton Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
52	
52M	
53	
53M	
6	
6M	
7	
7M	
8	
9	

Table II

Management Planner's Review

Chicago Public Schools

School Hendricks Academy
 Address 4316 S. Princeton

Unit 31121
 Chicago, IL, 60609

Building ID 3930
 Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	12" x 12" Beige (Tan) Floor Tile			Lunchroom, lunchroom storage	Abated	MISC					
10	1" x 1" Ceiling Tile	2,100	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11	12" x 12" Brown Floor Tile	450	SF	1st, 2nd, 3rd Floor Corridor Perimeter	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
11M	6" x 12" Brown Floor Tile Mastic	450	SF	1st, 2nd, 3rd Floor Corridor Perimeter	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
12	TSI on Pipe with Metal Cover	80	LF	Girls 2nd Floor and Girl's and Boy's 1st Floor Washrooms	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
13	TSI on Valve Coupler/20" Pipe	54	SF	Boiler Room	Chrysotile	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
14	TSI on <4" Valves	5	LF	Boiler Room	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
15	TSI Pipe Cover (12" Pipe)	450	LF	Hall/Passageway Fan Room, air tunnel, basement storage rooms, boiler room	Amosite, Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
16	TSI 12" Pipe Elbows/Fittings	46	LF	Hall/Passageway Fan Room, air tunnel, basement storage rooms, boiler room	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
17	TSI Cardboard Insulation/Small Pipe Elbows/Fittings	30	LF	Boiler Room and Passageway	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
18	TSI Cardboard Insulation	375	LF	Boiler Room and Passageway	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
19	TSI 4" Valves	10	LF	Boiler and Air Tunnel	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
1M	12" x 12" Beige (Tan) Floor Tile Mastic			Lunchroom and lunchroom storage	Abated	MISC					
2	Cove Base Black	50	SF	Lunchroom	No ACBM	MISC			SF		
20	TSI Small Pipe/Covers	400	LF	Air Tunnel	Amosite, Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
21	TSI Cardboard Insulation	300	LF	Air Tunnel	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
22	TSI on Small Pipes	28	LF	Air Tunnel	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
23	TSI Boiler Coverings	2,000	SF	Boiler Room	Amosite, Chrysotile	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
24	TSI In Boiler by Doors	18	SF	Boiler Room	Assumed	TSI			SF		
25	Boiler Gasket	18	SF	Boiler Room	Assumed	TSI			SF		
26	Refractory Brick	300	SF	Boiler Room	Assumed	MISC			SF		
27	Roof Flashing - Not AHERA	2,800	LF	Roof	Assumed	MISC	No		LF		
28	Exterior Brick - Not AHERA	14,000	SF	Building Exterior	Assumed	MISC	No		SF		
29	Exterior Mortar - Not AHERA	14,000	SF	Building Exterior	Assumed	MISC	No		SF		

Chicago Public Schools

School Hendricks Academy
Address 4316 S. Princeton

Unit 31121
Chicago, IL, 60609

Building ID 3930
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable Category	Damage Quantity	Damage Units	Damage Category	Response
3	1" x 1" Ceiling Tile	3,250	SF	Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
30	Chalk Board/Poster Board Adhesive	300	SF	All classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
31	12" x 12" Tan w/White Specks Floor Tile	775	SF	Room 301	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
32	12" x 12" Tan w/White Specks Floor Tile Mastic	775	SF	Room 301	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
33	12" x 12" Dark Green w/Tan Floor Tile	1,000	SF	Room 204	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
34	12" x 12" Dark Green w/Tan Floor Tile Mastic	1,000	SF	Room 204	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
35	Interior Material of Incinerator	120	SF	Boiler Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
36	Vault Door	28	SF	Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
37	9"x8" Beige with brown streaks floor tile	20	SF	Hallway outside 314 and 302, 311-312	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
38	9"x8" Beige with brown straks floor tile mastic	20	SF	Hallway outside 311 and 312.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
39	Sink Under Coating	4	SF	Room 312	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
3M	1" x 1" Ceiling Tile Mastic	3,250	SF	Lunchroom; 1st, 2nd, 3rd floor corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
4	12" x 12" Tan Floor Tile	15,000	SF	102, 104, 106, 108, 110, 202, 206, 208, 212, 302, 304, 308, 312, 310, main office-assembly hall, 2nd & 3rd floor corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
40	Aircell pipe insulation	16	LF	Room 204 under lab sinks.	Assumed	TSI	Yes	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
41	Vibration dampers	6	LF	2nd floor mechanical space (fan rm #2) and fan room in lunchroom	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
42	Cork board wall panels adhesive	300	SF	2nd floor mechanical space	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
43	12x12 Blue floor tile	1,100	SF	Hallway by 311, elevator vestibules, stage vestibule, 104 washroom, basmt passage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
44	12x12 Blue floor tile mastic	1,100	SF	Hallway by 311, elevator vestibules, stage vestibule, 104 washroom, basmt passage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
45	4" Dark Blue baseboard	270	LF	Hallway by 311, elevator vestibules, stage vestibule, 104 washroom, basmt passage	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
46	4" Dark Blue baseboard mastic	270	LF	Hallway by 311, elevator vestibules, stage vestibule, 104 washroom, basmt passage	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
47	Mag pipe insulation	70	LF	2nd floor mechanical room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
48	Fittings on Mag pipe insulation	30	LF	2nd floor mechanical room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance

Chicago Public Schools

School Hendricks Academy
Address 4316 S. Princeton

Unit 31121
Chicago, IL, 60609

Building ID 3930
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
49	Gray W/Black Dot linoleum	3,600	SF	Room 305, 306, 303	Assumed	MISC	No	0	SF	suspect ACBM	Operations and Maintenance
49M	Gray W/Black Dot linoleum Mastic	3,600	SF	Room 305, 306, 303	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
4M	12" x 12" Tan Floor Tile Mastic	21,600	SF	102,104,106,108,110,202,206,208,212, 302,304, 308,312,310 main office assembly hall, 2nd & 3rd floor corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
5	Plaster	25,000	SF	Throughout	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
50	Blue Carpet Mastic	2,100	SF	Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
51	3" X 3" Rubber Floor White W/Black	1,625	SF	Lunchroom and lunchroom Storage	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
51M	3" X 3" Rubber Floor Adhesive	3,250	SF	Lunchroom and lunchroom storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
52	3" X 3" Rubber Floor Blue W/White	1,925	SF	Lunchroom, lunchroom storage, and lunchroom manager office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
52M	3" X 3" Rubber Floor Blue W/White Adhesive	3,250	SF	Lunchroom, lunchroom storage, and lunchroom manager office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
53	12"X12" Cream W/Tan Floor Tile	4,214	SF	Main office, principal office, washroom, 1st floor hallway, and hallway by the gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
53M	12"X12" Cream Witan Floor Tile Mastic	4,214	SF	Main office, principal office, washroom, 1st floor hallway, and hallway by the gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
6	12" x 12" Dark Grey Floor Tile	17,000	SF	2nd fl women's washroom, 101, 103, 105, 107, 201, 203, 205, 207, 311	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
6M	12" x 12" Dark Grey Floor Tile Mastic	17,000	SF	2nd fl women's washroom, 101, 103, 105, 107, 201, 203, 205, 207, 311	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
7	12" x 12" Beige Floor Tile	390	SF	Doorways of Rooms 101, 103, and 104	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
7M	12" x 12" Beige Floor Tile Mastic	390	SF	Doorways of Rooms 101, 103, and 104	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
8	2x4 Hanging Ceiling	3,600	SF	Gym	No ACBM	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
9	1" x 1" Ceiling Tile			Library	No ACBM	MISC	No	0	SF		

Chicago Public Schools

School Hendricks Academy
 Address 4316 S. Princeton

Unit 31121
 Chicago, IL, 60609

Building ID 3930
 Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
 600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	4/2/2013
Manager Planner Name	Daniel Juneau
100-03613	5/15/2014
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
10	
11	
11M	
12	
13	
14	
15	
16	
17	
18	

Chicago Public Schools

School Hendricks Academy
Address 4316 S. Princeton

Unit 31121 Building ID 3930
Chicago, IL, 60609 Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
19	
1M	
2	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
3	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
3M	
4	
40	

Chicago Public Schools

School Hendricks Academy
Address 4316 S. Princeton

Unit 31121
Chicago, IL, 60609

Building ID 3930
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
41	
42	
43	
44	
45	
46	
47	
48	
49	
49M	
4M	
5	
50	
51	
51M	
52	
52M	
53	
53M	
6	
6M	
7	
7M	
8	
9	

Chicago Public Schools

School Hendricks Academy
Address 4316 S. Princeton

Unit 31121
Chicago, IL, 60609

Building ID 3930
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates
600 West Van Buren St., Ste 500

Phone: (312) 762-2900 **Fax:** (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **12" x 12" Beige (Tan) Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**


MATERIAL LOCATION: **Lunchroom, lunchroom storage**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

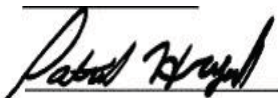

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **1**

MATERIAL DESCRIPTION: **12" x 12" Beige (Tan) Floor Tile**

MATERIAL LOCATION: **Lunchroom, lunchroom storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Auditorium**
MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

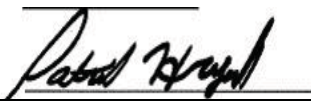

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**
MATERIAL LOCATION: **Auditorium**
MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridor Perimeter**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

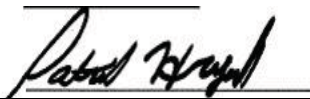

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridor Perimeter**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11M**
MATERIAL DESCRIPTION: **6" x 12" Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, 3rd floor Corridor Perimeter**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

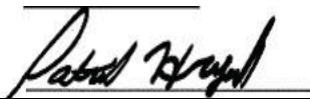

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **11M**
MATERIAL DESCRIPTION: **6" x 12" Brown Floor Tile Mastic**
MATERIAL LOCATION: **1st, 2nd, 3rd floor Corridor Perimeter**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **TSI on Pipe with Metal Cover**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Girl's 2nd Floor and Girl's and Boy's 1st Floor Washrooms**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:

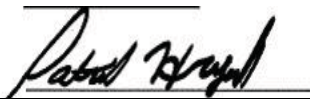

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **TSI on Pipe with Metal Cover**
MATERIAL LOCATION: **Girl's 2nd Floor and Girl's and Boy's 1st Floor Washrooms**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **TSI on Valve Coupler/20" Pipe**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **54** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

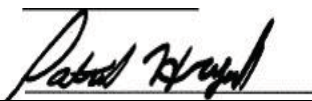

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **TSI on Valve Coupler/20" Pipe**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **54**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **TSI on <4" Valves**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **5** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

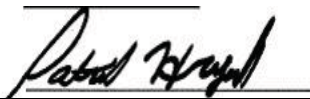

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **TSI on <4" Valves**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **5**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **TSI Pipe Cover (12" Pipe)**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Amosite, Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Hall/Passageway Fan Room, air tunnel, basement storage rooms, boiler room**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

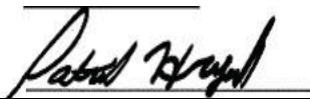

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **TSI Pipe Cover (12" Pipe)**
MATERIAL LOCATION: **Hall/Passageway Fan Room, air tunnel, basement storage rooms, boiler room**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **TSI 12" Pipe Elbows/Fittings**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Hall/Passageway Fan Room, air tunnel, basement storage rooms, boiler room**
MATERIAL QUANTITY: **46** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

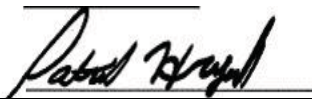

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **TSI 12" Pipe Elbows/Fittings**
MATERIAL LOCATION: **Hall/Passageway Fan Room, air tunnel, basement storage rooms, boiler room**
MATERIAL QUANTITY: **46** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **TSI Cardboard insulation Small Pipe Elbows/Fittings**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room and Passageway**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____

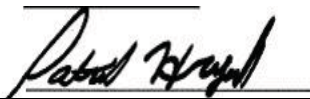

Date: 03/19/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **TSI Cardboard insulationSmall Pipe Elbows/Fittings**

MATERIAL LOCATION: **Boiler Room and Passageway**

MATERIAL QUANTITY: **30**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **TSI Cardboard Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room and Passageway**
MATERIAL QUANTITY: **375** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

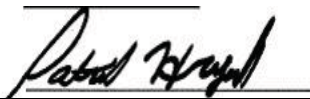

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **TSI Cardboard Insulation**

MATERIAL LOCATION: **Boiler Room and Passageway**

MATERIAL QUANTITY: **375** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **TSI 4" Valves**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler and Air Tunnel**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

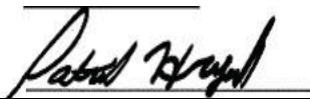

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **TSI 4" Valves**

MATERIAL LOCATION: **Boiler and Air Tunnel**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1M**
MATERIAL DESCRIPTION: **12" x 12" Beige (Tan) Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Lunchroom and lunchroom storage**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

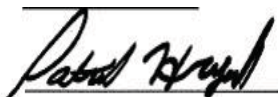

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **1M**

MATERIAL DESCRIPTION: **12" x 12" Beige (Tan) Floor Tile Mastic**

MATERIAL LOCATION: **Lunchroom and lunchroom storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**
MATERIAL DESCRIPTION: **Cove Base Black**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Lunchroom**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

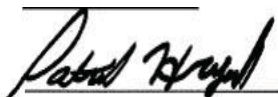

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **2**

MATERIAL DESCRIPTION: **Cove Base Black**

MATERIAL LOCATION: **Lunchroom**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **TSI Small Pipe/Covers**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Amosite, Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Air Tunnel**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

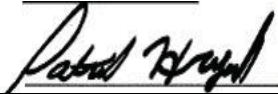

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **TSI Small Pipe/Covers**

MATERIAL LOCATION: **Air Tunnel**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **TSI Cardboard Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Air Tunnel**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

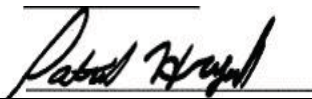

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **TSI Cardboard Insulation**

MATERIAL LOCATION: **Air Tunnel**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **TSI on Small Pipes**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Air Tunnel**
MATERIAL QUANTITY: **28** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

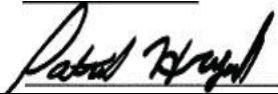

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **TSI on Small Pipes**

MATERIAL LOCATION: **Air Tunnel**

MATERIAL QUANTITY: **28**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **TSI Boiler Coverings**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Amosite, Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

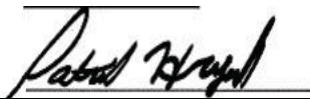

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **TSI Boiler Coverings**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **TSI In Boiler by Doors**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **18** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

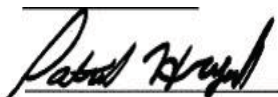

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **TSI In Boiler by Doors**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **18**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Boiler Gasket**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **18**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

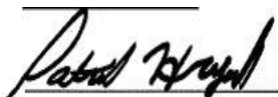

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Boiler Gasket**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **18** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Refractory Brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **300**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

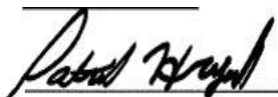

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **Refractory Brick**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Roof Flashing - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY: **2800**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS: **Non AHERA**

Inspector's Signature:

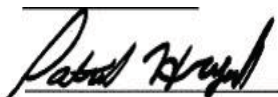

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **Roof Flashing - Not AHERA**

MATERIAL LOCATION: **Roof**

MATERIAL QUANTITY: **2800**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Exterior Brick - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Building Exterior**

MATERIAL QUANTITY: **14000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Non AHERA**

Inspector's Signature:

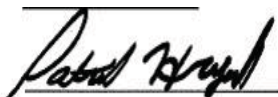

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Exterior Brick - Not AHERA**

MATERIAL LOCATION: **Building Exterior**

MATERIAL QUANTITY: **14000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Exterior Mortar - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Building Exterior**

MATERIAL QUANTITY: **14000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Non AHERA**

Inspector's Signature:

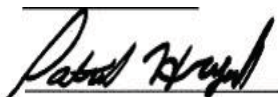

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **Exterior Mortar - Not AHERA**

MATERIAL LOCATION: **Building Exterior**

MATERIAL QUANTITY: **14000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

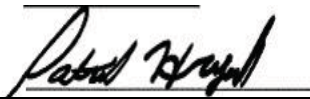

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Chalk Board/Poster Board Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All classrooms**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

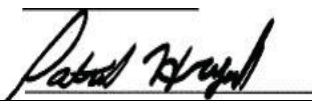

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **Chalk Board/Poster Board Adhesive**

MATERIAL LOCATION: **All classrooms**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12" x 12" Tan w/White Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 301**

MATERIAL QUANTITY: **775**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

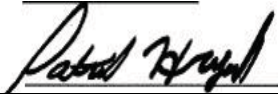

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12" x 12" Tan w/White Specks Floor Tile**
MATERIAL LOCATION: **Room 301**
MATERIAL QUANTITY: **775** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12" x 12" Tan w/White Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 301**
MATERIAL QUANTITY: **775** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

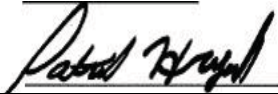

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12" x 12" Tan w/White Specks Floor Tile Mastic**
MATERIAL LOCATION: **Room 301**
MATERIAL QUANTITY: **775** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12" x 12" Dark Green w/Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 204**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

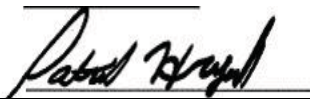

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12" x 12" Dark Green w/Tan Floor Tile**
MATERIAL LOCATION: **Room 204**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12" x 12" Dark Green w/Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 204**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

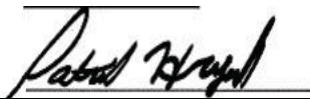

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12" x 12" Dark Green w/Tan Floor Tile Mastic**
MATERIAL LOCATION: **Room 204**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Interior Material of Incinerator**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **120**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

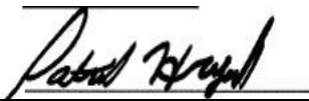

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **Interior Material of Incinerator**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY: **120**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Vault Door**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Office**
MATERIAL QUANTITY: **28** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

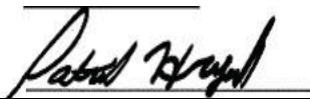

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Vault Door**
MATERIAL LOCATION: **Office**
MATERIAL QUANTITY: **28** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **9"x9" Beige with brown streaks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Hallway outside 314 and 302, 311-312**

MATERIAL QUANTITY: **20**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

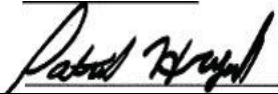

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **9"x9" Beige with brown streaks floor tile**
MATERIAL LOCATION: **Hallway outside 314 and 302, 311-312**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **9"x9" Beige with brown straks floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Hallway outside 311 and 312.**

MATERIAL QUANTITY: **20**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

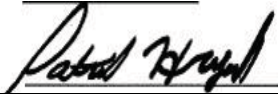

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **38**

MATERIAL DESCRIPTION: **9"x9" Beige with brown straks floor tile mastic**

MATERIAL LOCATION: **Hallway outside 311 and 312.**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Sink Under Coating**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 312**

MATERIAL QUANTITY: **4**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

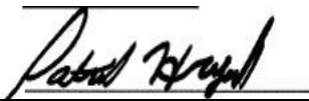

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **Sink Under Coating**

MATERIAL LOCATION: **Room 312**

MATERIAL QUANTITY: **4**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3M**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom; 1st, 2nd, 3rd floor corridors**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Material not observed in 1st, 2nd, and 3rd floor corridors**

Inspector's Signature:

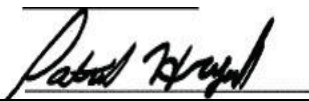

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **3M**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile Mastic**
MATERIAL LOCATION: **Lunchroom; 1st, 2nd, 3rd floor corridors**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **102,104,106,108,110,202,206,208,212,302,304,308,312,310,main office,assembly hall, 2nd & 3rd floor corridors**

MATERIAL QUANTITY: **15000**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

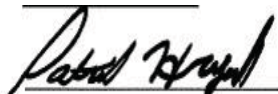

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile**
MATERIAL LOCATION: **102,104,106,108,110,202,206,208,212,302,304,308,312,310,main office,assembly hall, 2nd & 3rd floor corridors**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: 04/02/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Aircell pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Room 204 under lab sinks.**

MATERIAL QUANTITY: **16**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS: **Material not observed - 2013**

Inspector's Signature:

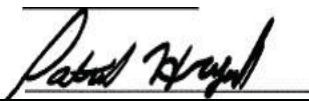

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **Aircell pipe insulation**

MATERIAL LOCATION: **Room 204 under lab sinks.**

MATERIAL QUANTITY: **16**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Vibration dampers**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd floor mechanical space (fan rm #2) and fan room in lunchroom**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

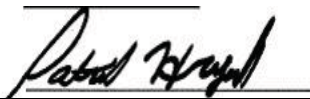

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **Vibration dampers**
MATERIAL LOCATION: **2nd floor mechanical space (fan rm #2) and fan room in lunchroom**
MATERIAL QUANTITY: **6** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Cork board wall panels adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd floor mechanical space**

MATERIAL QUANTITY: **300**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

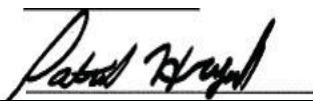

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Cork board wall panels adhesive**
MATERIAL LOCATION: **2nd floor mechanical space**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12x12 Blue floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basm't passage**

MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

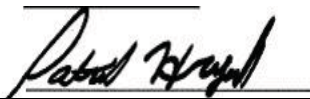

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12x12 Blue floor tile**
MATERIAL LOCATION: **Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basm't passage**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12x12 Blue floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basm't passage**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

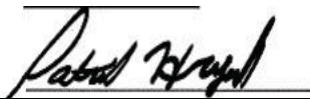

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12x12 Blue floor tile mastic**
MATERIAL LOCATION: **Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basm't passage**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **4" Dark Blue baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basm't passage**
MATERIAL QUANTITY: **270** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

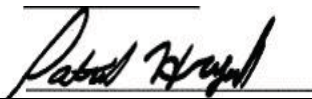

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **4" Dark Blue baseboard**
MATERIAL LOCATION: **Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basm't passage**
MATERIAL QUANTITY: **270** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **4" Dark Blue baseboard mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basm't passage**
MATERIAL QUANTITY: **270** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____

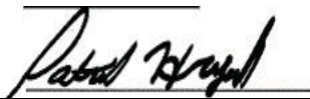

Date: 03/19/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **4" Dark Blue baseboard mastic**
MATERIAL LOCATION: **Hallyway by 311, elevator vestibules, stage vestibule, 104 washroom, basm't passage**
MATERIAL QUANTITY: **270** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **Mag pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd floor mechanical room**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

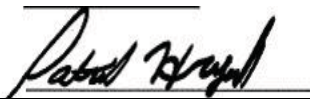

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **47**

MATERIAL DESCRIPTION: **Mag pipe insulation**

MATERIAL LOCATION: **2nd floor mechanical room**

MATERIAL QUANTITY: **70**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **Fittings on Mag pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd floor mechanical room**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

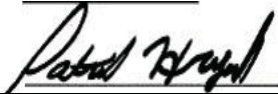

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **48**

MATERIAL DESCRIPTION: **Fittings on Mag pipe insulation**

MATERIAL LOCATION: **2nd floor mechanical room**

MATERIAL QUANTITY: **30**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4M**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **102,104,106,108,110,202,206,208,212,302,304, 308,312,310,main office,assembly hall, 2nd & 3rd floor corridors**

MATERIAL QUANTITY: **21600**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

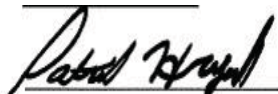

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **4M**
MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile Mastic**
MATERIAL LOCATION: **102,104,106,108,110,202,206,208,212,302,304, 308,312,310,main office,assembly hall, 2nd & 3rd floor corridors**
MATERIAL QUANTITY: **21600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **7**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **7**. **Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

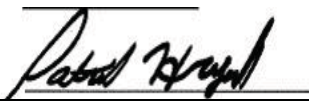

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **Plaster**
MATERIAL LOCATION: **Throughout**
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **12" x 12" Dark Grey Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd fl women's washroom, 101, 103, 105, 107, 201, 203, 205, 207, 311**
MATERIAL QUANTITY: **17000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

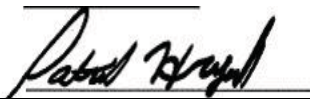

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **12" x 12" Dark Grey Floor Tile**
MATERIAL LOCATION: **2nd fl women's washroom, 101, 103, 105, 107, 201, 203, 205, 207, 311**
MATERIAL QUANTITY: **17000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6M**
MATERIAL DESCRIPTION: **12" x 12" Dark Grey Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd fl women's washroom, 101, 103, 105, 107, 201, 203, 205, 207, 311**
MATERIAL QUANTITY: **17000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

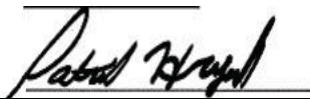

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **6M**
MATERIAL DESCRIPTION: **12" x 12" Dark Grey Floor Tile Mastic**
MATERIAL LOCATION: **2nd fl women's washroom, 101, 103, 105, 107, 201, 203, 205, 207, 311**
MATERIAL QUANTITY: **17000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Doorways of Rooms 101, 103, and 104**

MATERIAL QUANTITY: **390**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

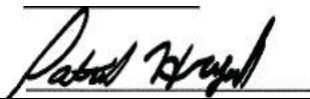

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**
MATERIAL LOCATION: **Doorways of Rooms 101, 103, and 104**
MATERIAL QUANTITY: **390** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7M**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Doorways of Rooms 101, 103, and 104**
MATERIAL QUANTITY: **390** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

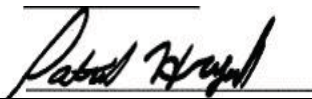

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **7M**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile Mastic**
MATERIAL LOCATION: **Doorways of Rooms 101, 103, and 104**
MATERIAL QUANTITY: **390** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **2'x4' Hanging Ceiling**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY: **3600**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

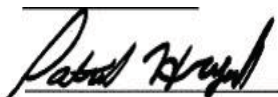

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **2'x4' Hanging Ceiling**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Library**

MATERIAL QUANTITY:


MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:

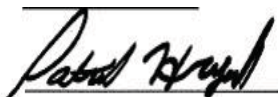

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **9**

MATERIAL DESCRIPTION: **1' x 1' Ceiling Tile**

MATERIAL LOCATION: **Library**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/02/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **49M**
MATERIAL DESCRIPTION: **Gray W/Black Dot linoleum Mastic**
MATERIAL LOCATION: **Room 305, 306, 303**
MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

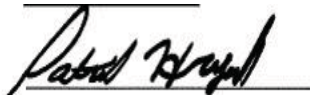

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **49M**
MATERIAL DESCRIPTION: **Gray W/Black Dot linoleum Mastic**
MATERIAL LOCATION: **Room 305, 306, 303**
MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____




Date: 04/02/2013

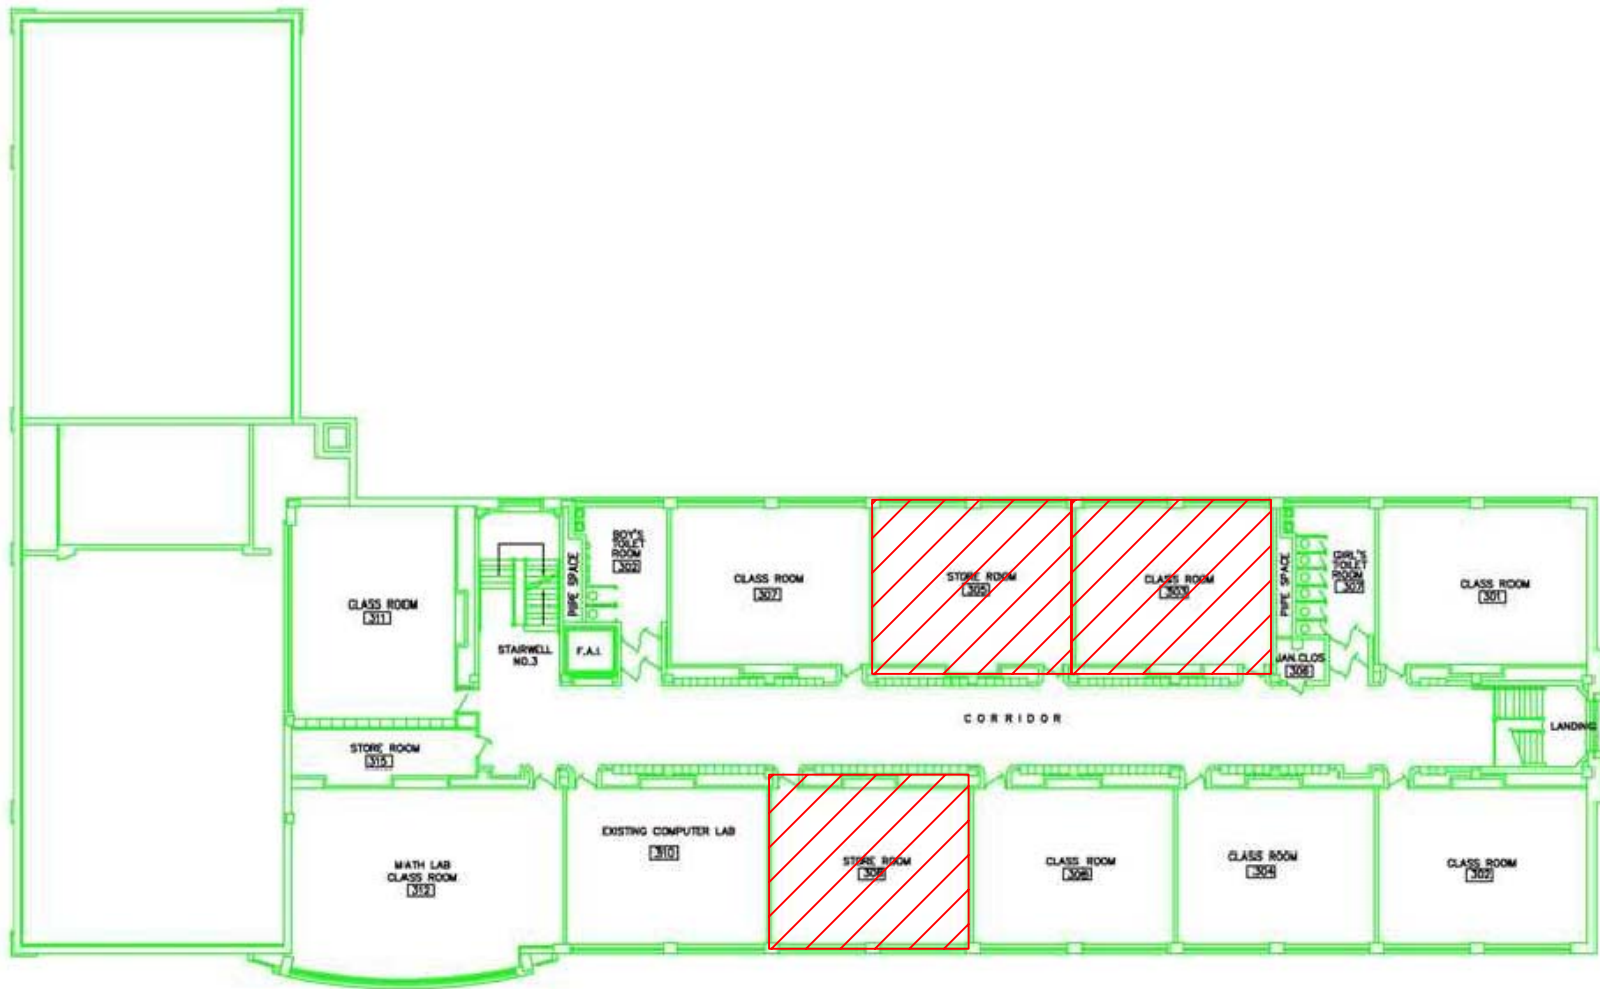

ASBESTOS REINSPECTION KEY NOTES:

 HA-49M Gray with Black Speckles Linoleum Mastic

Hendricks Academy Third Floor
2013 ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Hendricks Academy
4316 S. Princeton Ave.
Chicago, IL 60609

SHEET NAME:
Hendricks Third Floor -
HA-49M

INSPECTED BY:
Pat L. Hrycyk

DRAWN BY: JH	DATE: 3/26/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatltd.com

CCA PROJECT NUMBER
A320130001-199

DATE
3/19/2013

SHEET NUMBER

**CARNOW
CONIBEAR** HA-49M

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Gray W/Black Dot linoleum**
MATERIAL LOCATION: **Room 305, 306, 303**
MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

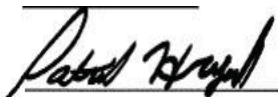

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **Gray W/Black Dot linoleum**
MATERIAL LOCATION: **Room 305, 306, 303**
MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature: _____




Date: 04/02/2013

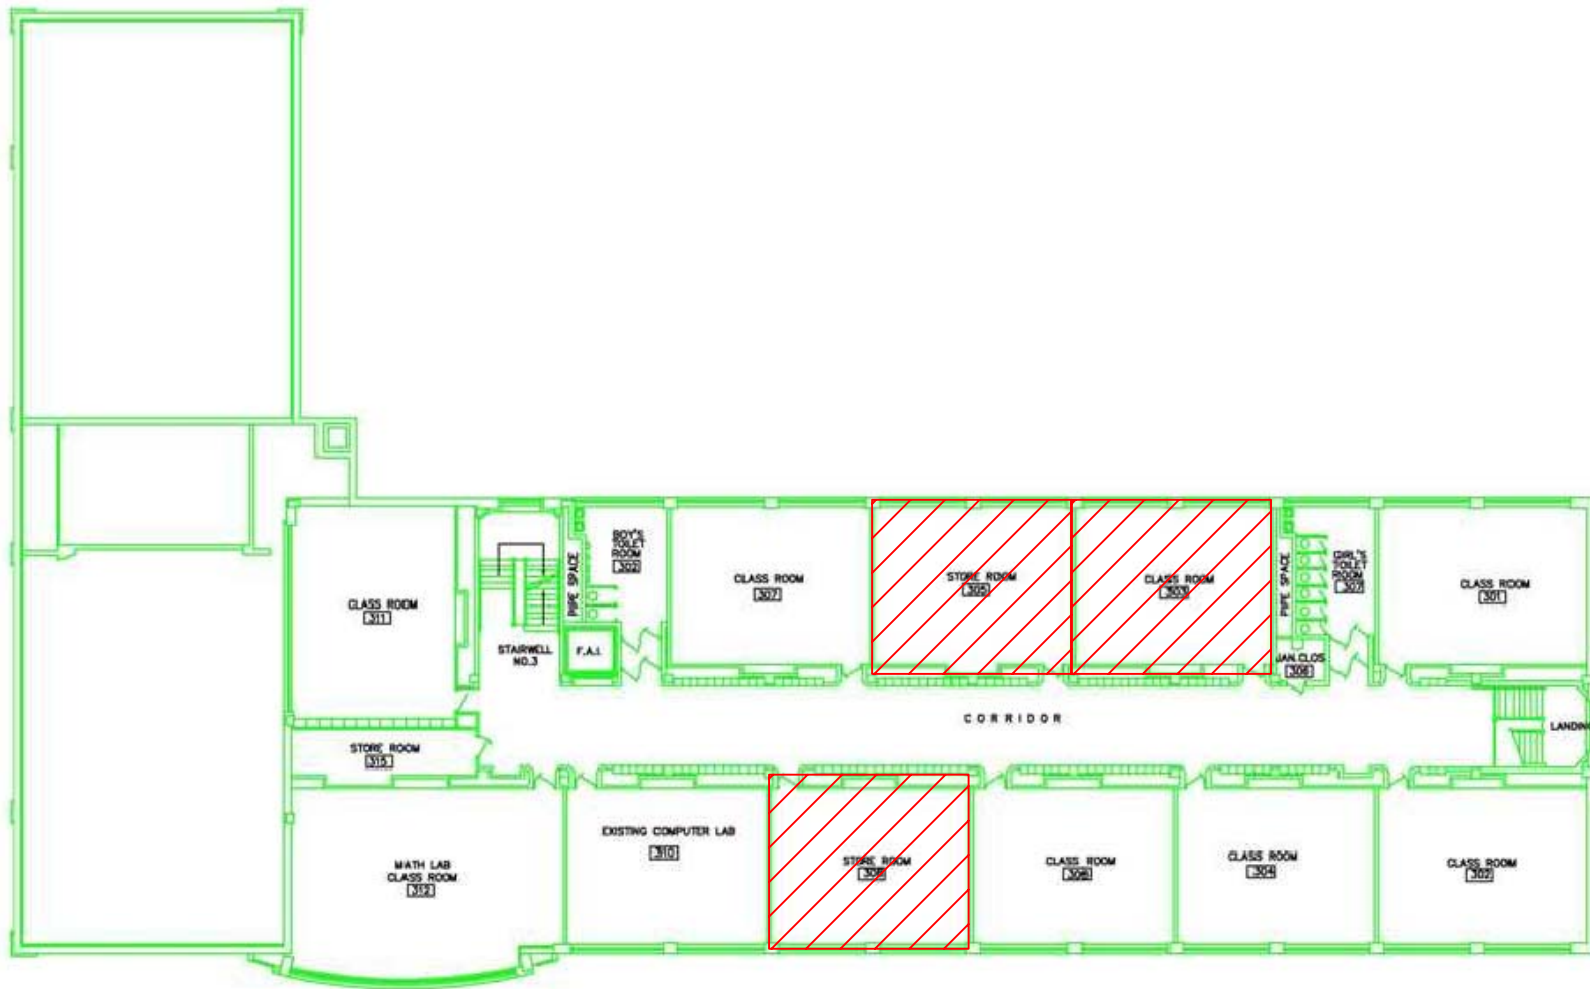

ASBESTOS REINSPECTION KEY NOTES:

 HA-49 Gray with Black Speckles Linoleum

Hendricks Academy Third Floor
2013 ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Hendricks Academy
4316 S. Princeton Ave.
Chicago, IL 60609

SHEET NAME:
Hendricks Third Floor -
HA-49

INSPECTED BY:
Pat L. Hrycyk

DRAWN BY: JH	DATE: 3/26/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR**

CCA PROJECT NUMBER
A320130001-199

DATE
3/19/2013

SHEET NUMBER
HA-49

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **3' X 3' Rubber Floor White W/Black**
MATERIAL LOCATION: **Lunchroom and lunchroom Storage**
MATERIAL QUANTITY: **1625** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

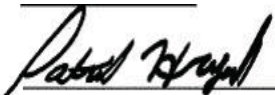

Date: 03/19/2013

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **3' X 3' Rubber Floor White W/Black**
MATERIAL LOCATION: **Lunchroom and lunchroom Storage**
MATERIAL QUANTITY: **1625** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____




Date: **04/02/2013**

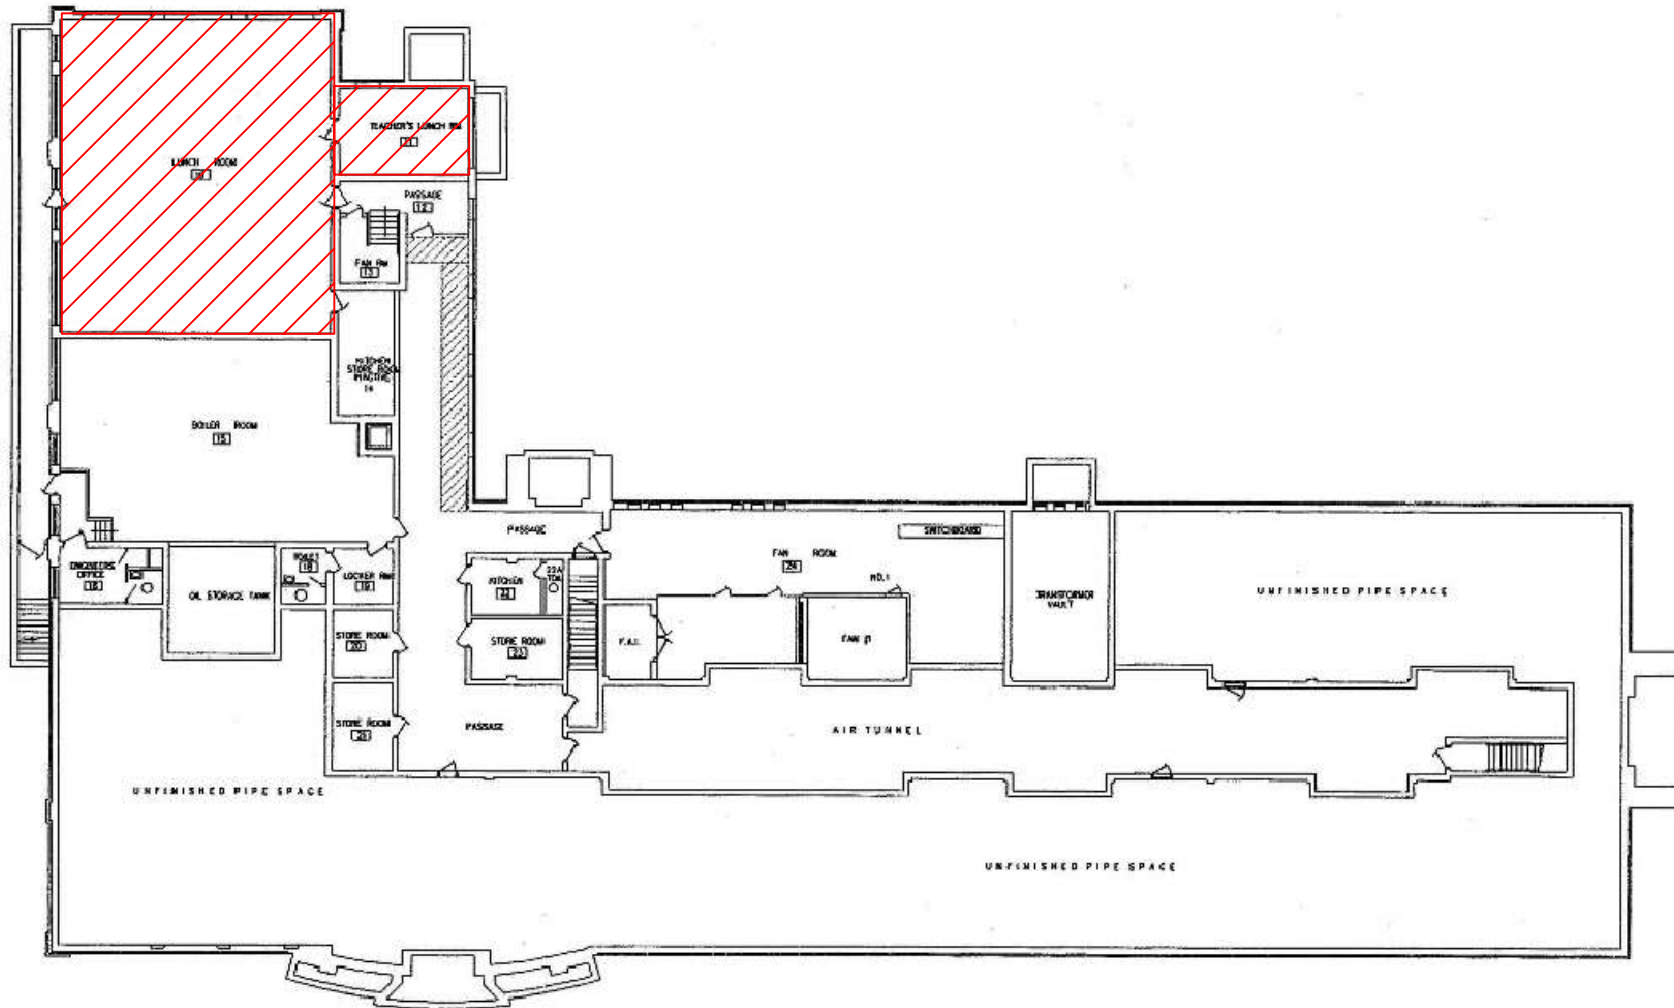

ASBESTOS REINSPECTION KEY NOTES:

HA-51 White with Black 3' x 3' Rubber Floor Tiles

Hendricks Academy Basement
2013 ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Hendricks Academy
4316 S. Princeton Ave.
Chicago, IL 60609

SHEET NAME:
Hendricks Basement -
HA-51

INSPECTED BY:
Pat L. Hrycyk

DRAWN BY: JH	DATE: 3/26/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com



CCA PROJECT NUMBER
A320130001-199

DATE
3/19/2013

SHEET NUMBER
HA-51

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **3' X 3' Rubber Floor Blue W/White**
MATERIAL LOCATION: **Lunchroom, lunchroom storage, and lunchroom manager office**
MATERIAL QUANTITY: **1925** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

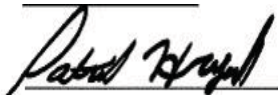

Date: 03/19/2013

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **3' X 3' Rubber Floor Blue W/White**
MATERIAL LOCATION: **Lunchroom, lunchroom storage, and lunchroom manager office**
MATERIAL QUANTITY: **1925** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature: _____




Date: 04/02/2013

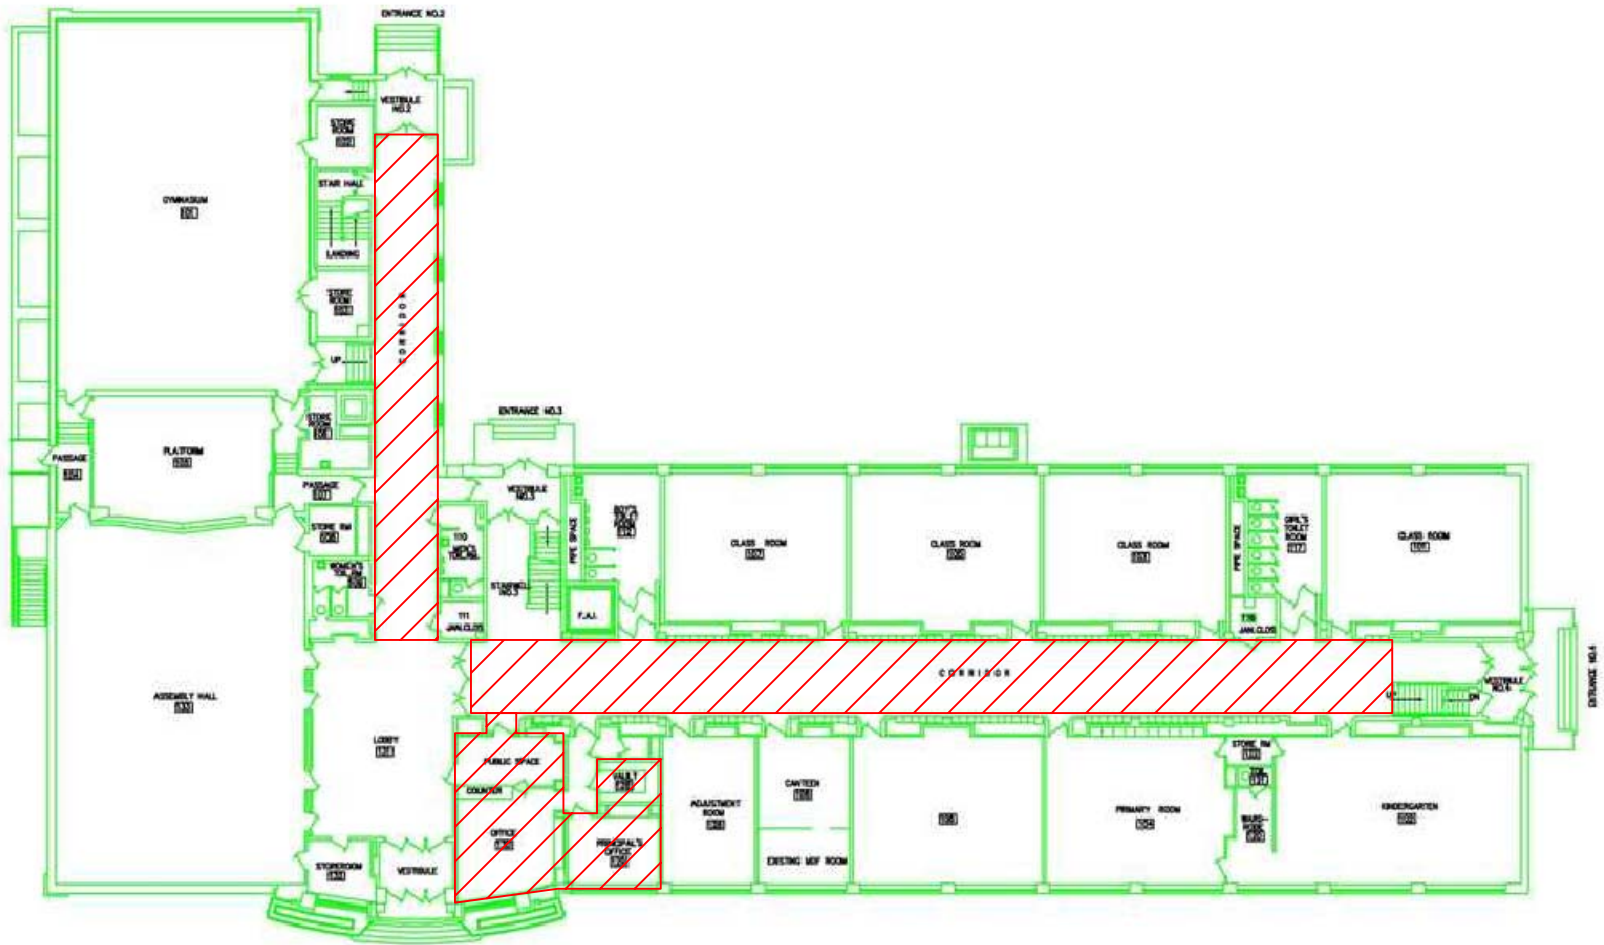

ASBESTOS REINSPECTION KEY NOTES:

 HA-52 Blue with White 3' x 3' Rubber Floor Tiles

Hendricks Academy First Floor
2013 ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Hendricks Academy
4316 S. Princeton Ave.
Chicago, IL 60609

SHEET NAME:
Hendricks First Floor -
HA-52
INSPECTED BY:
Pay L. Hrycyk

DRAWN BY: JH	DATE: 3/26/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com



CCA PROJECT NUMBER
A320130001-199

DATE
3/19/2013

SHEET NUMBER
HA-52

K:\CPSC\2013\2013 Three Year\AHERA\Reinspection\Hendricks Academy First Floor.dwg

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12"X12" Cream W/Tan Floor Tile**
MATERIAL LOCATION: **Main office, principal office, washroom, 1st floor hallway, and hallway by the gym**
MATERIAL QUANTITY: **4214** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

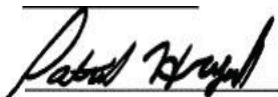

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12"X12" Cream W/Tan Floor Tile**
MATERIAL LOCATION: **Main office, principal office, washroom, 1st floor hallway, and hallway by the gym**
MATERIAL QUANTITY: **4214** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature: _____




Date: **04/02/2013**

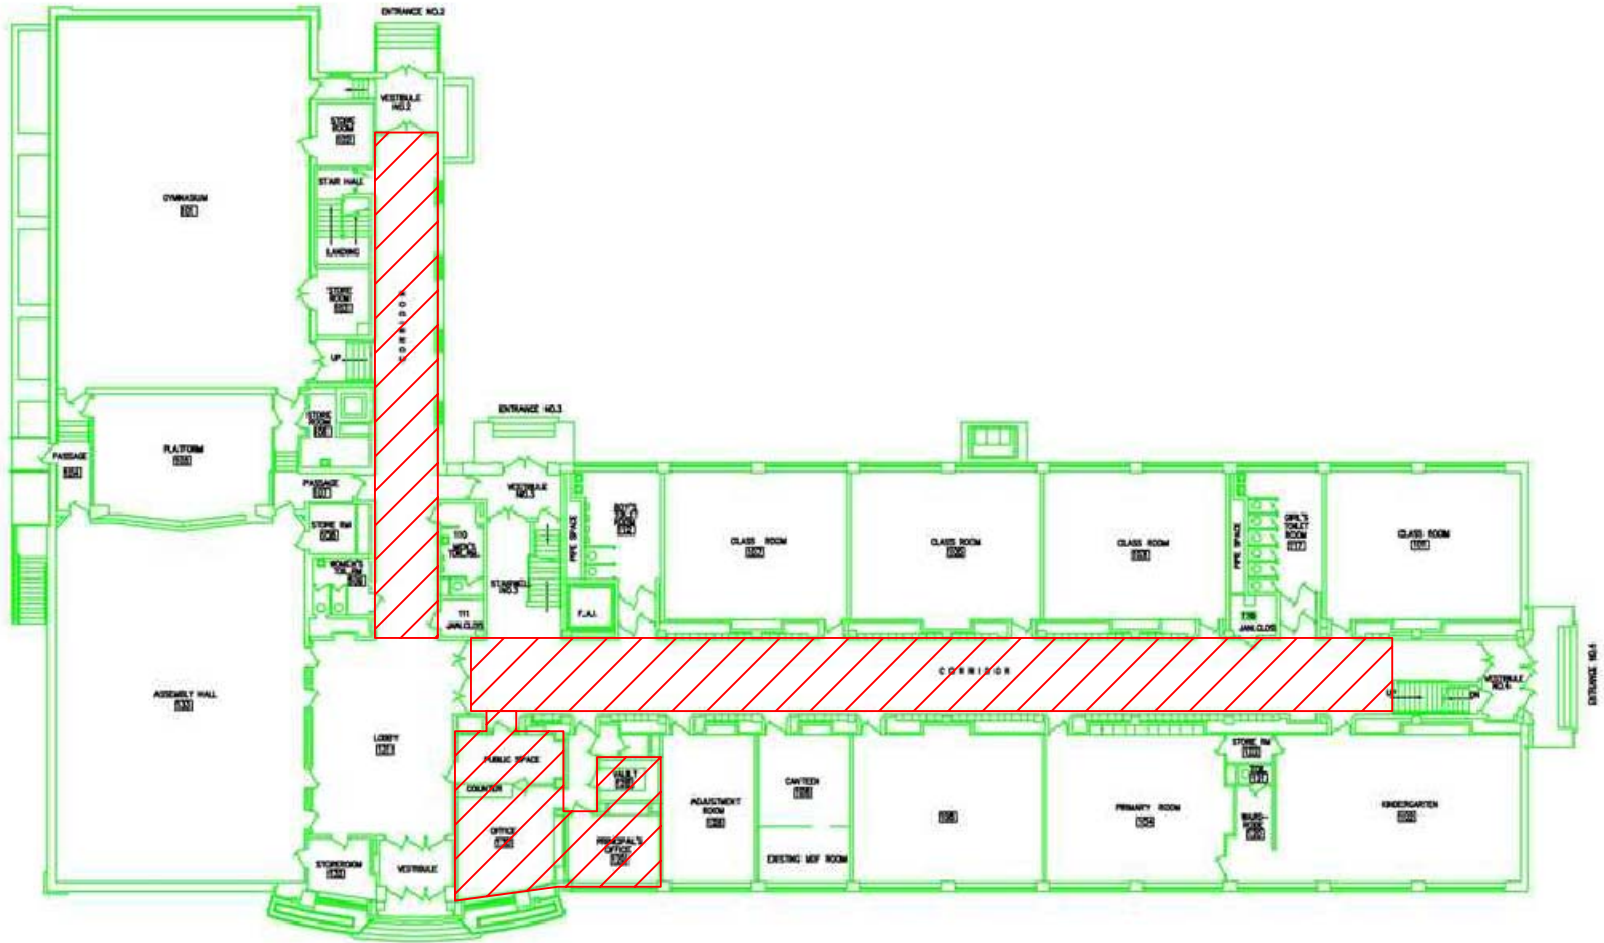

ASBESTOS REINSPECTION KEY NOTES:

 HA-53 Cream with Tan 12" x 12" Floor Tiles

Hendricks Academy First Floor
2013 ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Hendricks Academy
4316 S. Princeton Ave.
Chicago, IL 60609

SHEET NAME:
Hendricks First Floor -
HA-53

INSPECTED BY:
Pay L. Hrycyk

DRAWN BY: JH	DATE: 3/26/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com



CCA PROJECT NUMBER
A320130001-199

DATE
3/19/2013

SHEET NUMBER
HA-53

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
MATERIAL LOCATION: **Library**
MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

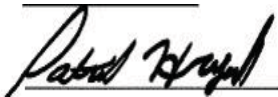

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
MATERIAL LOCATION: **Library**
MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____




Date: **04/02/2013**

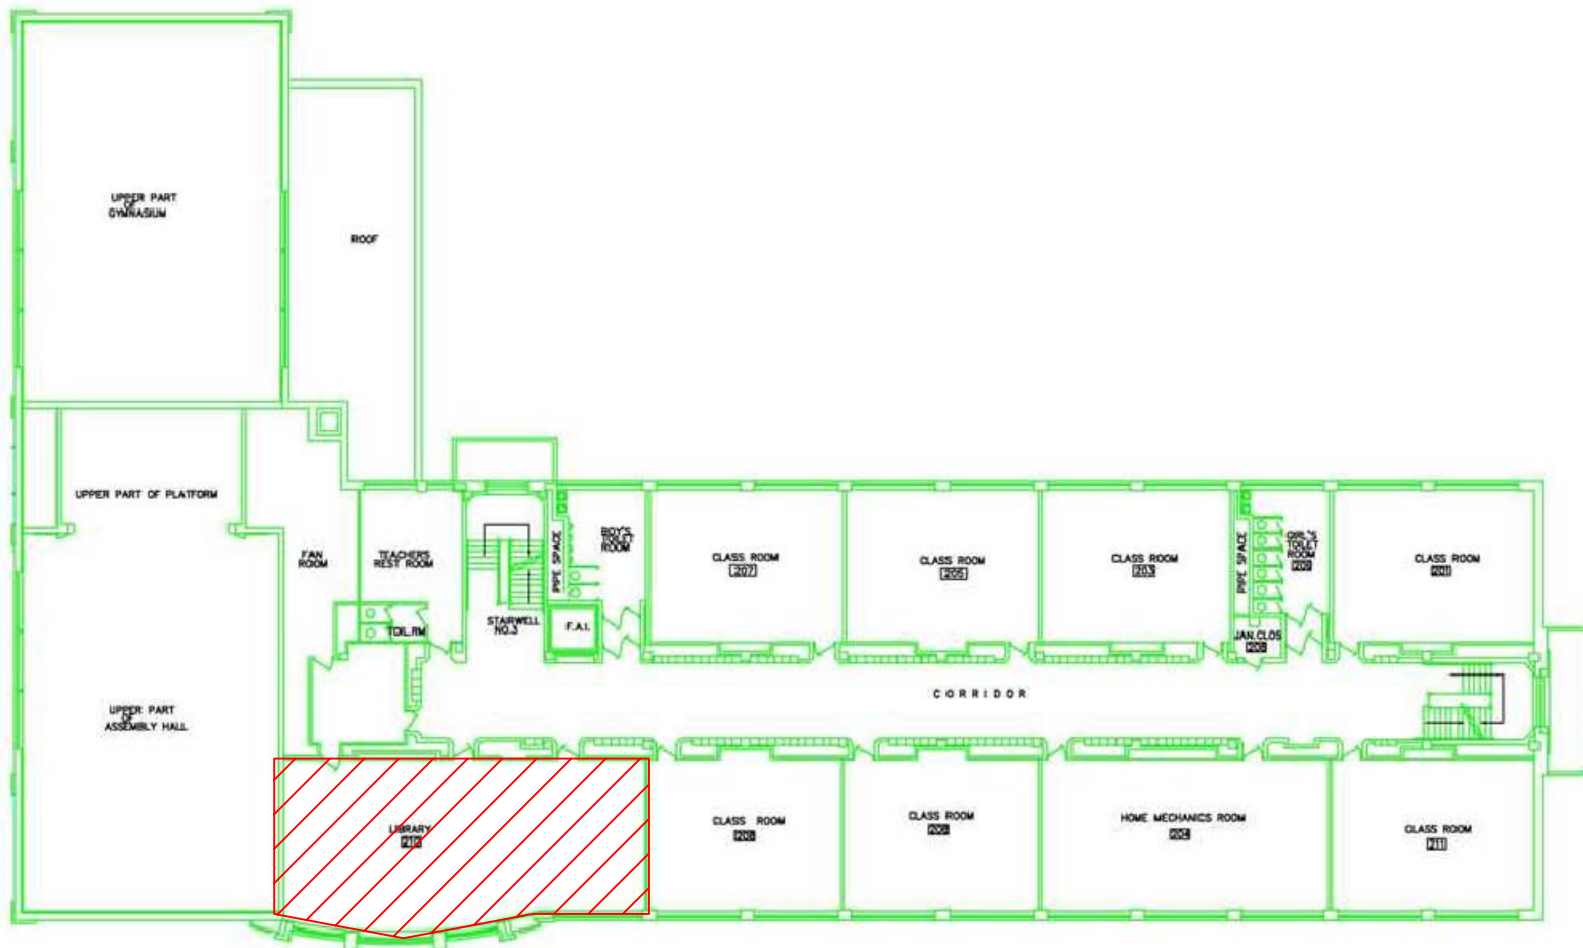

ASBESTOS REINSPECTION KEY NOTES:

 HA-50 Blue Carpet Mastic

Hendricks Academy Second Floor
2013 ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Hendricks Academy
4316 S. Princeton Ave.
Chicago, IL 60609

SHEET NAME:
Hendricks Second Floor -
HA-50

INSPECTED BY:
Pat L. Hrycyk

DRAWN BY: JH	DATE: 3/26/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com



CCA PROJECT NUMBER
A320130001-199

DATE
3/19/2013

SHEET NUMBER
HA-50

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **53M**
MATERIAL DESCRIPTION: **12"X12" Cream W/tan Floor Tile Mastic**
MATERIAL LOCATION: **Main office, principal office, washroom, 1st floor hallway, and hallway by the gym**
MATERIAL QUANTITY: **4214** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:

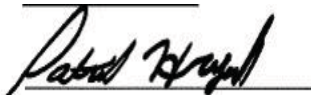

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**


HOMOGENEOUS AREA: **53M**
MATERIAL DESCRIPTION: **12"X12" Cream W/tan Floor Tile Mastic**
MATERIAL LOCATION: **Main office, principal office, washroom, 1st floor hallway, and hallway by the gym**
MATERIAL QUANTITY: **4214** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:


Management Planner's Signature: _____




Date: **04/02/2013**

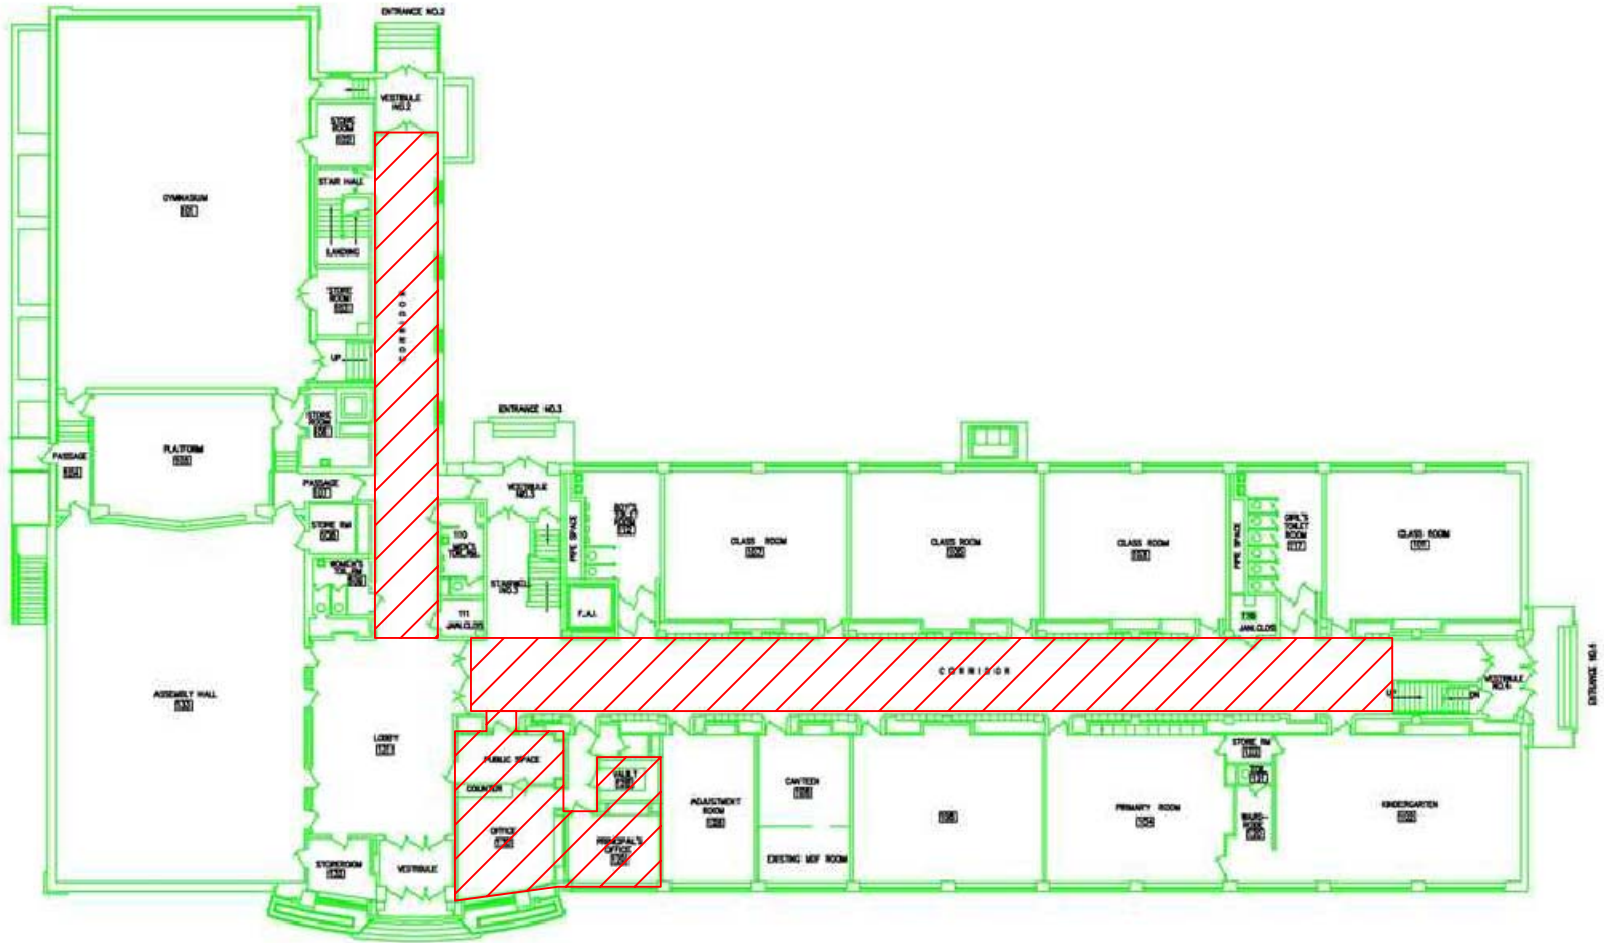

ASBESTOS REINSPECTION KEY NOTES:

 HA-53M Cream with Tan 12" x 12" Floor Tile Mastic

Hendricks Academy First Floor
2013 ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Hendricks Academy
4316 S. Princeton Ave.
Chicago, IL 60609

SHEET NAME:
Hendricks First Floor -
HA-53M

INSPECTED BY:
Pay L. Hrycyk

DRAWN BY: JH	DATE: 3/26/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR** HA-53M

CCA PROJECT NUMBER
A320130001-199

DATE
3/19/2013

SHEET NUMBER

HA-53M

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION


Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **51M**
MATERIAL DESCRIPTION: **3' X 3' Rubber Floor Adhesive**
MATERIAL LOCATION: **Lunchroom and lunchroom storage**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

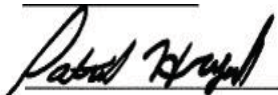

Date: 03/19/2013

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **51M**
MATERIAL DESCRIPTION: **3' X 3' Rubber Floor Adhesive**
MATERIAL LOCATION: **Lunchroom and lunchroom storage**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____




Date: 04/02/2013

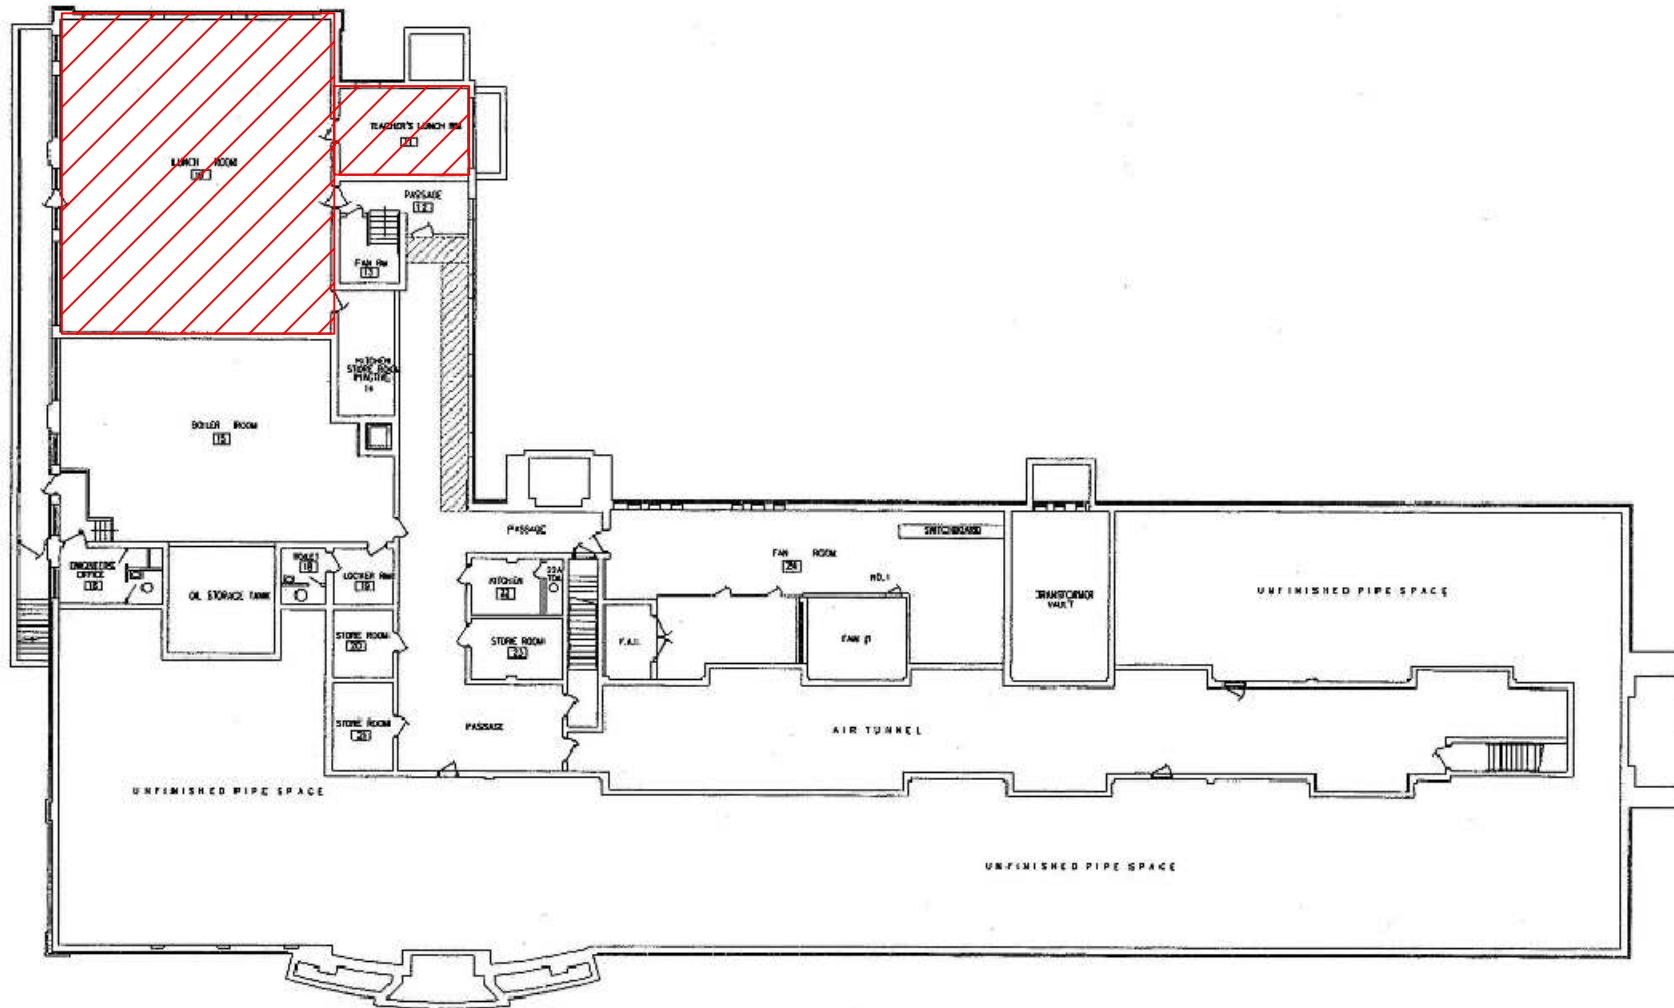

ASBESTOS REINSPECTION KEY NOTES:

 HA-51M White with Black 3' x 3' Rubber Floor Tile Adhesive

Hendricks Academy Basement
2013 ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Hendricks Academy
4316 S. Princeton Ave.
Chicago, IL 60609

SHEET NAME:
Hendricks Basement -
HA-51M

INSPECTED BY:
Pat L. Hrycyk

DRAWN BY: JH	DATE: 3/26/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR** HA-51M

CCA PROJECT NUMBER
A320130001-199

DATE
3/19/2013

SHEET NUMBER

HA-51M

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUIDLING ID: **3930**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Patrick Hrycyk**
SCHOOL NAME: **Hendricks Academy** INSPECTION DATE: **3/19/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **52M**

MATERIAL DESCRIPTION: **3' X 3' Rubber Floor Blue W/White Adhesive**

MATERIAL LOCATION: **Lunchroom, lunchroom storage, and lunchroom manager office**

MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION:


AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

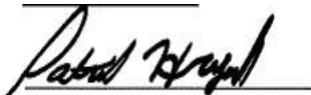

Date: **03/19/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **31121** BUILDING ID: **3930**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hendricks Academy** REVIEW DATE: **4/2/2013**
ADDRESS: **4316 S. Princeton** IDPH LICENSE NO: **100-09725**

HOMOGENEOUS AREA: **52M**
MATERIAL DESCRIPTION: **3' X 3' Rubber Floor Blue W/White Adhesive**
MATERIAL LOCATION: **Lunchroom, lunchroom storage, and lunchroom manager office**
MATERIAL QUANTITY: **3250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____




Date: **04/02/2013**

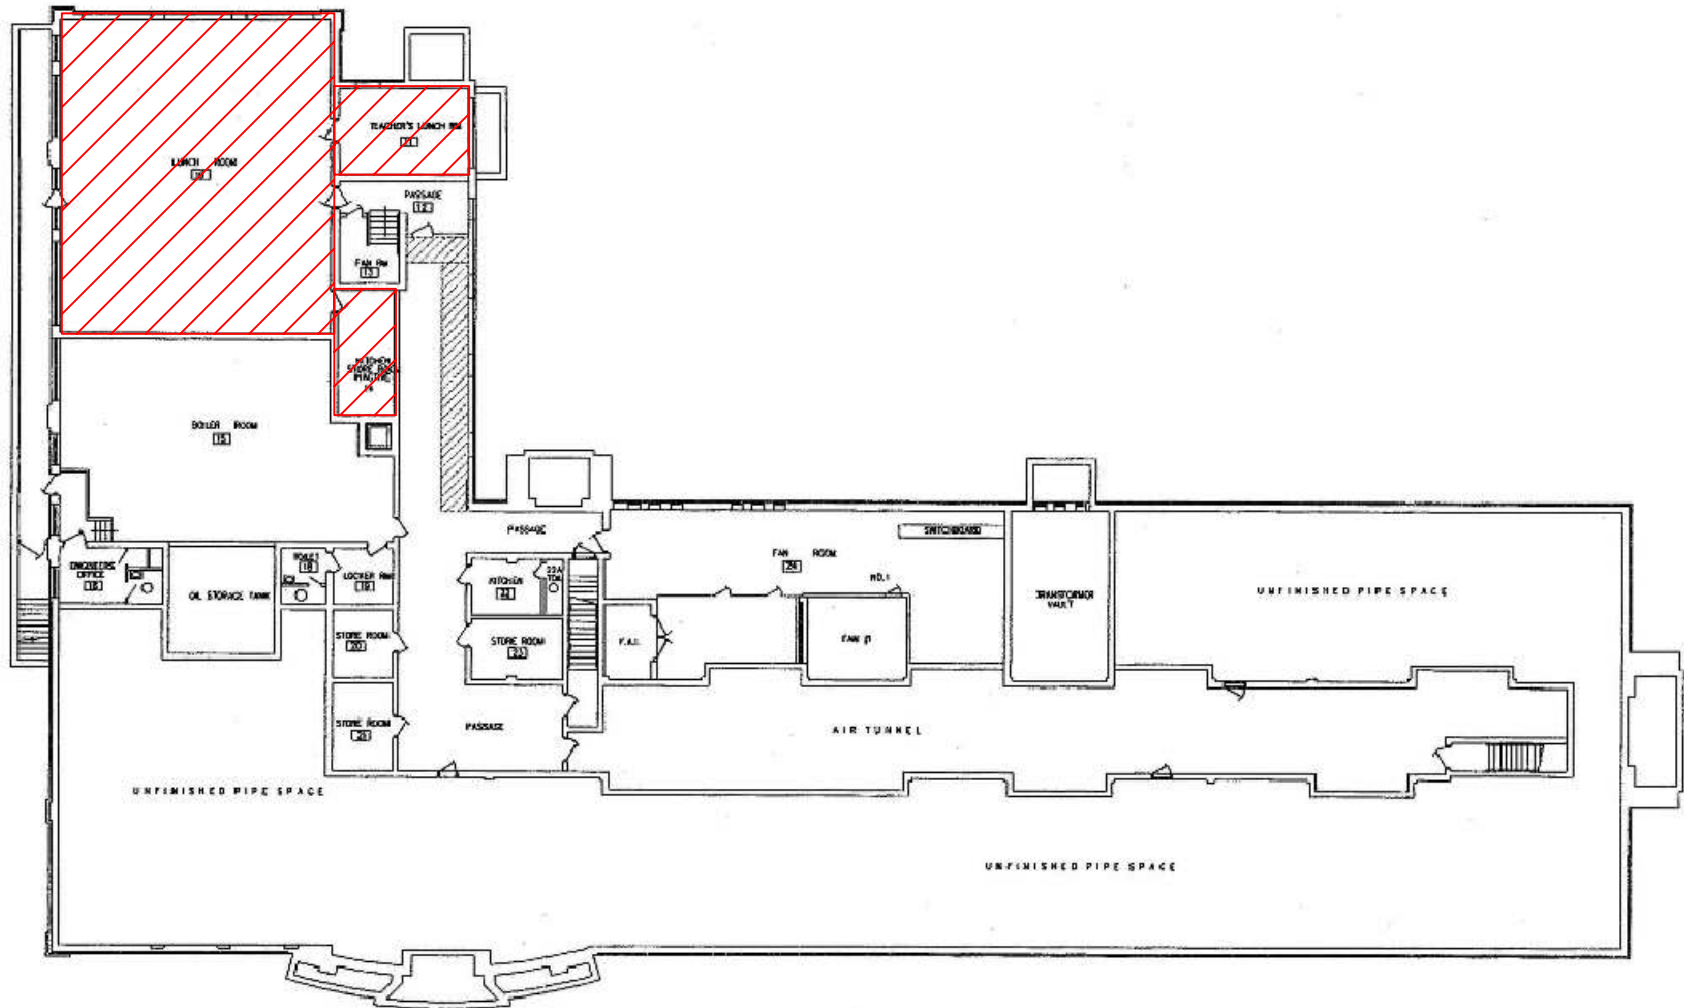

ASBESTOS REINSPECTION KEY NOTES:

 HA-52M Blue with White 3' x 3' Rubber Floor Tile Adhesive

Hendricks Academy Basement
2013 ASBESTOS REINSPECTION



CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Hendricks Academy
4316 S. Princeton Ave.
Chicago, IL 60609

SHEET NAME:
Hendricks Basement -
HA-52M

INSPECTED BY:
Pat L. Hrycyk

DRAWN BY: JH	DATE: 3/26/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 09725

Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR** HA-52M

CCA PROJECT NUMBER
A320130001-199

DATE
3/19/2013

SHEET NUMBER

HA-52M

APPENDIX B

Inspector and Management Planner Licenses

ENDORSEMENTS	TC EXPIRES
INSPECTOR	12/9/2012
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	11/2/2012


Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

Illinois Department of
PUBLIC HEALTH

**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER	ISSUED	EXPIRES
100 - 09725	5/31/2012	05/15/2013

PATRICK L HRYCYK
2942 N. MASON AVE
CHICAGO, IL 60634



Environmental Health

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that PATRICK HRYCYK
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 12/07/2012 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



N. Penney

12/07/2012

Course Dates:

12/07/2013

Expires:

1212BIR02

Certificate Number:

Phone Number: (312) 491-0081

Director of Training

Nicholas J. Penney

Doctor of Public Health

FORM # A-010



Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department
of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance
with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042319

Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012



Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Management Planner Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department
of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance
with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014


Kathy DeSalvo, Director

2013



Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Management Planner Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014


Kathy DeSalvo, Director

2013

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 03613

ISSUED
4/11/2013

EXPIRES
05/15/2014

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed