

ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-048Y  
SCHOOL NAME: Hancock High School  
ADDRESS OF SCHOOL: 4034 W. 56th St.  
CITY: Chicago, IL, 60652

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/8/2010**

**If the address on this form is different than the address of the building, submit a written explanation.**

**SECTION II** (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/18/2013 ENROLLMENT 943  
IDPH INSPECTOR LICENSE NUMBER: 100-02175  
IDPH LICENSED INSPECTOR NAME (Please Print): Ethan Payne  
IDPH MP LICENSE NUMBER: 100-09870  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Todd Huffer

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



4/18/2013

Signature of Designated Person

Date

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Hancock High School**

4034 W. 56th St.  
Chicago, IL, 60652

Unit: 46021  
Building ID: 1200

IDPH ID Number: 14-016-2990-048Y

**REPORT DATE:**

Thursday, April 18, 2013

**Prepared for:**

**Chicago Public Schools  
125 S. Clark Street  
Chicago, IL 60603**

**Prepared by:**

**Carnow, Conibear and Associates**

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

March 19, 2013

Mr. R. Kent Cook  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2013 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299            Unit: 46021            Region: 04            IDPH ID: 14-016-2990-048Y

School: Hancock High School            Building ID: 1200

Address: 4034 W. 56th St.

Chicago, IL, 60652

Building Contact: James, Steven

Contact Phone: 773-535-4547

Current Building Owners: Chicago Public Schools

Review Date: 4/18/2013

Inspector: Ethan Payne

Inspector IDPH License: 100-02175

Management Planner: Todd Huffer

Management Planner IDPH License: 100-09870

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,  
Carnow, Conibear and Associates



Todd Huffer  
100-09870

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: March 19, 2013

RE: Hancock High School, Unit 46021  
4034 W. 56th St.  
Chicago, IL, 60652

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Hancock High School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Hancock High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113.

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Hancock High School                      Unit: 46021                      Region: 04  
Address: 4034 W. 56th St.                      Chicago, IL, 60652  
IDPH ID: 14-016-2990-048Y                      Building ID: 1200  
Contact: James, Steven                      Phone: 773-535-4547

### 2. Description of Facility

Original Construction:                      Additional Construction:  
Total Square Footage: 156300                      No of Floors:  
Current Occupancy: 943

### 3. LEA Designated Person

Contact: Ms. Lynn Crivello                      Phone: (773) 553-3113  
Address: 125 South Clark Street, 17th Floor  
Chicago, IL 60603


### 4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates  
Contact: Dan Juneau  
Address 600 West Van Buren St., Ste 500  
Phone: (312) 762-2900                      Fax: (312) 782-5145

### 5. Inspector

Inspector Name: Ethan Payne


Inspector IDPH license # 100-02175

  
Signature:  
Date: 3/19/2013

### 6. Management Planner

Management Planner Name: Todd Huffer

Management Planner IDPH license # 100-09870

  
Signature:  
Date: 4/18/2013

### 7. Review Date: 4/18/2013

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

  
Signature:

Date: 4/18/2013

Name: Ms. Lynn Crivello

## II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Hancock High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1200:

018	Plaster
019	Plaster
025	Exposed Aircell
029	Mag Block Insulation
083	Mastic for Type S Floor Tile

B. The following new homogenous areas have been identified for Building 1200:



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

2	1'x1' Acoustical Wall Tiles
001	1' x 1' ceiling tile REMOVED
002	9"x9" brown w/white & red streaks floor tile
003	1'x1' Solid Act Ceiling Tile
004	1'x1' Holed Act.
005	1x1 Metal Pan Act.
006	1'x1' Ceiling Tile: pocked Act.
007	2x4 Ceiling Tile
008	9"x9" Grey w/White Streaks Floor Tile
009	9"x9" Green w/White Floor Tile
010	12"x12" Gray VFT
011	9"x9" Gray Floor tile
012	12x 12 Tan VFT
013	9"x9" green VFT
014	Cottage Cheese Sprayed on Material
015	Cove base molding
016	Exposed aicell pipe insulation
017	Trowled on plaster mateial
018	Plaster
019	Plaster
020	Transite Ceiling Panels
022	Pipe Joint Compound
023	Mag Block Insulation
024	Aircell Pipe Insulation
025	Exposed Aircell
027	Mag Block Insulation-removed
029	Mag Block Insulation
033	Chilller Pump piping
034	Heat Pump insulation
035	Pipe joint compound
037	Cold Water Reservoir Tank Insulation
038	Insulation on Cold Water Circulation Pumps
039	Plaster
040	Cottage Cheese Sprayed on Material, acoustical ceiling, concrete ceiling
043	Exposed Aircell
045	Fire Curtain, baby blue
046	Asbestos Oven
047	Fire Brick
048	9"x9" White w/ Green Floor Tile
050	9"x9" Tan w/ Red & White: Floor Tile
051	9"x9" Brown w/ Tan: Floor tile
053	9x9 Green, Tan, Black & orange: Floor
054	9"x9" light Green: Floor

055	12"x12" tan with Black & White: Floor Tile
056	12"x12" Brown tan w/dark & white streaks VFT
057	5"x5" swirl pattern Floor tile: blue
058	5"x5" Gold & Brown Tile: Floor Tile
060	Lab Table Tops
062	9"x9" Green swirl Vft.
063	9"x9" Tan swirl VFT.
064	12"x12" Gray and White Vft
065	Mastic for HA #8 Floor Tile
066	9x9 green w/white vft MASTIC FOR HA #9
067	Mastic for HA #13
068	Mastic for HA #10
069	Mastic for HA #11
070	Mastic for HA #12 Floor Tile
072	9x9 Mastic for Type d Floor Tile
073	Mastic for Type E Floor Tile
074	Mastic for Type F Floor Tile
075	Mastic for Type G Floor Tile
076	Mastic for Type H Floor Tile
077	Mastic for Type M Floor Tile
078	Mastic for Type N Floor Tile
079	Mortar for terrazzo
080	Mastic for Type P Floor Tile
081	5x5 blue swirl pattern vft mastic
082	5x5 gold/brown vft mastic
083	Mastic for Type S Floor Tile
084	Green swirl floor tile mastic
085	Tan swirl floor tile mastic
086	12x 12 gray & white floor tile mastic
087	Mastic for Type A Cove Base Molding
089	12"x12" Brown tan w/dark & white streaks VFT- MASTIC
090	12x12 tan speckled Vft.
091	12x12 tan speckled Vft mastic
093	9"x9" brown w/white & red streaks floor tile mastic
094	12x12 BLACK W/ WHITE STREAKS VFT
095	12x12 BLACK W/ WHITE STREAKS VFT-MASTIC
096	12x12 GRAYISH GREEN VFT
097	12x12 GRAYISH GREEN VFT-MASTIC
098	12x12 BLUE VFT
099	12x12 BLUE VFT-MASTIC
100	PLASTER CEILING PATCH
101	PIPE JOINT COMPOUND
102	12x12 RED VFT
103	12x12 RED VFT-MASTIC
104	12x12 OFF WHITE VFT
104-M	12x12 OFF WHITE VFT-MASTIC
105	9x9 GREEN & GRAY CHECKERBOARD W/ BLACK BORDER VFT
105-M	MASTIC FOR HA #105

107	PURPLE CARPET MASTIC
108	GRAY CARPET MASTIC
109	TAN CARPET MASTIC
110	12x12 WHITE & BLACK CHECKERBOARD VFT
111	12x12 WHITE & BLACK CHECKERBOARD VFT- MASTIC
112	12x12 MARBLE LOOKING TAN VFT
113	12x12 MARBLE LOOKING BLACK VFT
114	MASTIC FOR HA #112 & 113
115	9x9 DARK GREEN VFT
116	9x9 RED VFT
117	MASTIC FOR HA #115 & 116
118	9x9 BROWN & TAN CHECKERBOARD VFT
119	9x9 BROWN & TAN CHECKERBOARD VFT- MASTIC
120	GRAY CARPET MASTIC
121	12x12 White w/ Red & Blue Specks FT
122	12x12 White w/ Red & Blue Specks FT Mastic
123	12x12 Purple FT
124	12x12 Purple FT Mastic
125	12x12 Light Grey w/ White FT
126	12x12 Light Grey w/White FT Mastic
127	Grey Mix Terrazzo
128	Green Carpet Adhesive
129	Peach Linoleum
130	Peach Linoleum Adhesive
131	Brown Carpet Adhesive

The following areas were deemed to be inaccessible:

065	Mastic for HA #8 Floor Tile
066	9x9 green w/white vft MASTIC FOR HA #9
067	Mastic for HA #13
068	Mastic for HA #10
069	Mastic for HA #11
070	Mastic for HA #12 Floor Tile
084	Green swirl floor tile mastic
085	Tan swirl floor tile mastic
086	12x 12 gray & white floor tile mastic
087	Mastic for Type A Cove Base Molding
089	12"x12" Brown tan w/dark & white streaks VFT- MASTIC
091	12x12 tan speckled Vft mastic
093	9"x9" brown w/white & red streaks floor tile mastic
095	12x12 BLACK W/ WHITE STREAKS VFT-MASTIC
097	12x12 GRAYISH GREEN VFT-MASTIC
099	12x12 BLUE VFT-MASTIC
103	12x12 RED VFT-MASTIC

104-M	12x12 OFF WHITE VFT-MASTIC
105-M	MASTIC FOR HA #105
107	PURPLE CARPET MASTIC
108	GRAY CARPET MASTIC
109	TAN CARPET MASTIC
110	12x12 WHITE & BLACK CHECKERBOARD VFT
111	12x12 WHITE & BLACK CHECKERBOARD VFT-MASTIC
114	MASTIC FOR HA #112 & 113
117	MASTIC FOR HA #115 & 116
119	9x9 BROWN & TAN CHECKERBOARD VFT-MASTIC
120	GRAY CARPET MASTIC
124	12x12 Purple FT Mastic
128	Green Carpet Adhesive
130	Peach Linoleum Adhesive
131	Brown Carpet Adhesive

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Ethan Payne, IDPH License # 100-02175. The Management Plan was updated by Todd Huffer, IDPH License # 100-09870. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Hancock High School Building 1200 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
2	1'x1' Acoustical Wall Tiles	4,500	SF	Annex: Corridors, Lobby to auditorium, CL17,CL18,CL20,C L21,CL07,CL10	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
001	1' x 1' ceiling tile REMOVED			music practice rooms	ASSUMED	MISC								
002	9"x9" brown w/white & red streaks floor tile	100	SF	original bldg. Cafeteria snack bar.	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
003	1'x1' Solid Act Ceiling Tile	1,000	SF	Rooms 307,309 (above new drop ceiling)	ASSUMED	MISC	N	NONE	0		No	ACBM with potential for significant damage		MODERATE
004	1'x1' Holed Act.	5,000	SF	Original Building 1st, 2nd,3rd,4th floor & corridor (above new tile)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
005	1x1 Metal Pan Act.			Faculty Lounge, Faculty lounge	ASSUMED	MISC	N							
006	1'x1' Ceiling Tile: pocked Act.	600	SF	Original Building: Ground Floor Lobby, south entrance.	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		MODERATE
007	2x4 Ceiling Tile	900	SF	2nd floor Workout room above gym offices, library	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
008	9"x9" Grey w/White Streaks Floor Tile	15,500	SF	Annex: Halls & Rm's 102,105,104,106,30 2,305,304,405,402, 406, 304, 400, 304, 303, 301, 102, 101, 104, 103, auditorium ramps & stairwells	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
009	9"x9" Green w/White Floor Tile	5,280	SF	Annex: stairwells, 1st, 2nd, 3rd, 4th flr corridors, auditorium stairwells	ASSUMED	MISC	N	LOC	30		No	Damaged or significantly damaged friable misc. ACBM	5	MODERATE
010	12"x12" Gray VFT	900	SF	Original Bldg: Room A434 ( new number Rm. 412, 416)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
011	9"x9" Gray Floor tile	2,800	SF	ROOMS: A434 411, 415, 417, 419, 421, 422A, 442, 428.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				412, 413, 406, A323, 225, 113, 150 (new room numbers: see inspector's comment)										
012	12x 12 Tan VFT	6,000	SF	ROOMS: 420B, 420A, 424, 423, 425, 426, 422A, 422B, 405, 407, 305, 412,413,415,420,43 2,445,444,405,401,4 02,403,325,326,327 new rm,numbers - see ins's comments	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
013	9"x9" green VFT	8,000	SF	Library entrance., ROOMS: 411, 416,424,427,430,43 3,435,312,314,315,3 18 - new room numbers - see inspector's comments	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
014	Cottage Cheese Sprayed on Material	600	SF	Annex: basement corridor, 2nd flr. Library, CL10, CL07	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		MODERATE
015	Cove base molding	2,000	LF	Annex: Rooms 405,402,104,106,40 6,404,102,105,305,3 02,304 - room numbers - see inspector's comments	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
016	Exposed aicell pipe insulation	200	LF	Original Building: Classrms	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		MODERATE
017	Trowled on plaster mateial	1,000	SF	Annex: Lobby	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		MODERATE
018	Plaster	3,900	SF	Annex: 1st, 3rd, 4th floor Classrooms and Corridors	ASSUMED	SURFACE	Y	NONE	0		Yes	ACBM with the potential for damage		MODERATE
019	Plaster	8,000	SF	Original Building: Classrooms and crdrds	ASSUMED	SURFACE	Y	NONE	0		Yes	ACBM with the potential for damage		MODERATE



# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
020	Transite Ceiling Panels	500	SF	Original Building: Gym Storage room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
022	Pipe Joint Compound	1,000	LF	Annex: Pipe Tunnel, basement above ceilings	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		MODERATE
023	Mag Block Insulation	1,000	LF	Annex: Pipe Tunnel	ASSUMED	TSI	Y	DIST	100		No	Damaged or significantly damaged friable thermal system insulating ACBM	5	MODERATE
024	Aircell Pipe Insulation	500	LF	Original Building: Pipe Tunnels	ASSUMED	TSI	Y	LOC	100		No	Damaged or significantly damaged friable thermal system insulating ACBM	5	LOW
025	Exposed Aircell	30	LF	Original Building: Pipe Tunnels	ASSUMED	TSI	Y	DIST	30		Yes	Damaged or significantly damaged friable thermal system insulating ACBM	5	MODERATE
026	Pipe Joint Compound			Original Building: Boiler Rm	ABATED	TSI		None						
027	Mag Block Insulation-removed			Original Building: Boiler Rm: Boiler #1, Boiler #2	ASSUMED	TSI								
029	Mag Block Insulation	1,000	LF	Original Building: Boiler Rm & ADJACENT RMS IN BASEMENT, tunnels to boiler	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		MODERATE
030	Boiler Breeching Material			Original Building: Boiler Rm in basement	ABATED	TSI								
031	Mag Block Insulation			Original Building: Boiler Rm: Oil Preheater	ABATED	TSI								
032	Gasket Material			Original Building: Boiler Rm:	ABATED	TSI								
033	Chiller Pump piping			Annex: Pump Rm Basement	ASSUMED	TSI								
034	Heat Pump insulation			Annx: Basement pump room	ASSUMED	TSI								
035	Pipe joint compound			Annex: Pump Room basement	ASSUMED	TSI								
036	Aircell Pipe Insulation			Convent: basement	ABATED	TSI		Loc						Moderate
037	Cold Water Reservoir Tank Insulation	250	SF	Convent: Pump/Tank Storage	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Rm										
038	Insulation on Cold Water Circulation Pumps	6	LF	Convent: Pump/Tank Storage Rm	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
039	Plaster	5,000	SF	Convent: Student Cafeteria	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		MODERATE
040	Cottage Cheese Sprayed on Material, acoustical ceiling, concrete ceiling	980	SF	Convent: Student Cafeteria	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		LOW
041	9x9 Red Vft			Convent: Student Activity Rm, Basement, Balcony	ABATED	MISC								
042	cove base molding			Convent: Student Activity Rm, Basement	ABATED	MISC								
043	Exposed Aircell			Convent: student activity Rm basement.	ASSUMED	TSI	Y							
044	Chemical Flow Hood-ABATED			Original Building: Science Rm	ABATED	MISC								
045	Fire Curtain, baby blue	3,500	SF	Annex: Auditorium	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
046	Asbestos Oven			Original Building: Science Room	ASSUMED	MISC	N							
047	Fire Brick			Original Building: Art Rm Kila	ASSUMED	MISC	N							
048	9"x9" White w/ Green Floor Tile	2,784	SF	Annex:	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
050	9"x9" Tan w/ Red & White: Floor Tile	100	SF	Annex: Library, room 200	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
051	9"x9" Brown w/ Tan: Floor tile	2,400	SF	Annex: Library and adjacent rooms, 200	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
053	9x9 Green, Tan, Black & orange: Floor	400	SF	Annex: corridor to convent, rooms A413, 318 (new room numbers: 426C, 303, corridor to convent)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
054	9"x9" light Green: Floor	8,300	SF	Original Building: Rooms A426,317,202,204,223,203,205,224,228, 222 - new rm numbers - see ins's	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				com-s										
055	12"x12" tan with Black & White: Floor Tile	200	SF	Original Building; Corridors to Annex on 3rd floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
056	12"x12" Brown tan w/dark & white streaks VFT	50	SF	Original Building; Corridor leading to library, 2nd floor	ASSUMED	MISC	N	NONE	0		No	ACBM with potential for significant damage		MODERATE
057	5"x5" swirl pattern Floor tile: blue	60	SF	Original Building; Parenta Supervisor's teachers Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
058	5"x5" Gold & Brown Tile: Floor Tile	392	SF	Original Building; teachers. Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
060	Lab Table Tops	150	SF	Original Building; Science Room 312 (new room 308)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
062	9"x9" Green swirl Vft.	3,000	SF	Convent: Student Cafeteria, rm 306, 211, 208, 205, 204, 203, 201	ASSUMED	MISC	N	LOC	10		No	ACBM with potential for significant damage		MODERATE
063	9"x9" Tan swirl VFT.	3,000	SF	Convent: Student Cafeteria	ASSUMED	MISC	N	NONE	0		No	ACBM with potential for significant damage		MODERATE
064	12"x12" Gray and White Vft	500	SF	Original Building; Cafeteria Snack Bar	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
065	Mastic for HA #8 Floor Tile	15,500	SF	Annex: Halls & Rm's 102,105,104,106,30 2,305,304,405,402,a auditorium ramps & stairwells	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
066	9x9 green w/white vft MASTIC FOR HA #9	5,280	SF	Annex: stairwells, 1st, 2nd, 3rd, 4th flr corridors, auditorium stairwells	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
067	Mastic for HA #13	8,000	SF	ROOMS: 416,424,427,430,43 3,435,312,314,315,3 18	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
068	Mastic for HA #10	900	SF	Original Bldg; Room A434 (new room number 412)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
069	Mastic for HA #11	2,800	SF	ROOMS: A434, 442, 428, 412, 413, 406, A323, 225.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				113, 150 (see new rm. numbers in comments)										
070	Mastic for HA #12 Floor Tile	6,000	SF	ROOMS: 412,413,415,420,43 2,445,444,405,401,4 02,403,325,326,327 (see new rm.numbers in insp.comments)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
071	9x9 red vft mastic			Convent: Basement activity room	ABATED	MISC								
072	9x9 Mastic for Type d Floor Tile	60	SF	Annex: Storage Rm	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
073	Mastic for Type E Floor Tile			Annex: Natural Gas main	ASSUMED	MISC	N							
074	Mastic for Type F Floor Tile	300	SF	Annex: Student Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
075	Mastic for Type G Floor Tile			Annex: Student Library	ASSUMED	MISC	N							
076	Mastic for Type H Floor Tile			Annex: Classroom	ASSUMED	MISC	N							
077	Mastic for Type M Floor Tile			Original Building: Classroom	ASSUMED	MISC	N							
078	Mastic for Type N Floor Tile			Original Building: Classroom	ASSUMED	MISC	N							
079	Mortar for terrazzo	4,000	SF	Original Building: corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
080	Mastic for Type P Floor Tile			Original Building: Hallway	ASSUMED	MISC	N							
081	5x5 blue swirl pattern vft mastic	150	SF	Original Building: Non Smoking Faculty Lounge	ASSUMED	MISC	N							
082	5x5 gold/brown vft mastic	400	SF	Original Building: Non Smoking Faculty Lounge	ASSUMED	MISC	N	None				ACBM with the potential for damage		Low
083	Mastic for Type S Floor Tile	136	SF	Original Building: Gym Offices/Locker Rm	ASSUMED	MISC	N	LOC	8		Yes	Damaged or significantly damaged friable misc. ACBM		HIGH
084	Green swirl floor tile mastic	3,000	SF	Convent: Student Cafeteria	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
085	Tan swirl floor tile mastic	3,000	SF	Convent: Student Cafeteria	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
086	12x 12 gray & white floor tile mastic	500	SF	Original Building: Cafeteria Snack Bar	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
087	Mastic for Type A Cove Base Molding	180	LF	Original Building and Annex: Classrms and Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
089	12"x12" Brown tan w/dark & white streaks VFT-MASTIC	50	SF	Original Building: Corridor leading to library, 2nd floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
090	12x12 tan speckled Vft.	1,000	SF	2nd flr. Corridor leading to library, rm 209	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
091	12x12 tan speckled Vft mastic	90	SF	2nd flr corridor leading to library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
093	9"x9" brown w/white & red streaks floor tile mastic	100	SF	original bldg. Cafeteria snack bar.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
094	12x12 BLACK W/ WHITE STREAKS VFT	100	SF	ROOM 106B (new room 142)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
095	12x12 BLACK W/ WHITE STREAKS VFT-MASTIC	100	SF	ROOM 106B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
096	12x12 GRAYISH GREEN VFT	2,500	SF	ANNEX: BASEMENT, DRESSING ROOM, CL07, RM 210	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
097	12x12 GRAYISH GREEN VFT-MASTIC	2,500	SF	ANNEX: BASEMENT, DRESSING ROOM, CL07, RM 210	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
098	12x12 BLUE VFT	2,500	SF	ANNEX: BASEMENT UNDER AUDITORIUM	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
099	12x12 BLUE VFT-MASTIC	2,500	SF	ANNEX: BASEMENT UNDER AUDITORIUM	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
100	PLASTER CEILING PATCH	50	SF	CONVENT BASEMENT, STUDENT ACTIVITY ROOM	ASSUMED	SURFACE	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
101	PIPE JOINT COMPOUND	500	LF	CONVENT BASEMENT	ASSUMED	TSI	Y	NONE	0		No	ACBM with potential for significant damage		MODERATE
102	12x12 RED VFT	25	SF	ROOM A423 (new room number 420)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
103	12x12 RED VFT-MASTIC	25	SF	ROOM A423 (new room number 420)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
104	12x12 OFF WHITE VFT	3,900	SF	ROOMS 125, A322, A316, 301, 441, 409, 317, 307, A227 (new room numbers 125, 301, 305, 313, 401, East Corridor)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
104-M	12x12 OFF WHITE VFT-MASTIC	3,900	SF	ROOMS 125, A322, A316, 301, 441, A227 (new room numbers 125, 301, 305, 313, 401, East Corridor)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
105	9x9 GREEN & GRAY CHECKERBOARD W/ BLACK BORDER VFT	5,700	SF	4TH FLR OF ORIGINAL BLDG, A313, A310, 207, 103 (new room numbers: 121, 207, 125)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
105-M	MASTIC FOR HA #105	5,700	SF	4TH FLR OF ORIGINAL BLDG, A313, A310, 207, 103 (new room numbers: 121, 207, 125)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
107	PURPLE CARPET MASTIC	900	SF	ROOM A152 (new room number 101)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
108	GRAY CARPET MASTIC	6,000	SF	ROOMS A141, 155, 144, 146, 148, 147 (new room numbers A141, 101A, 1-7, 105, 103, 109)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
109	TAN CARPET MASTIC	1,800	SF	ROOMS 114, 121 (new room numbers 110, 115)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
110	12x12 WHITE & BLACK CHECKERBOARD VFT	700	SF	ROOM 119	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
111	12x12 WHITE & BLACK CHECKERBOARD VFT-MASTIC	700	SF	ROOM 119	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
112	12x12 MARBLE LOOKING TAN VFT	1,200	SF	LOBBY OF AUDITORIUM	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
113	12x12 MARBLE LOOKING BLACK VFT	1,200	SF	LOBBY OF AUDITORIUM	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
114	MASTIC FOR HA #112 & 113	2,400	SF	LOBBY OF AUDITORIUM	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
115	9x9 DARK GREEN VFT	6,250	SF	AUDITORIUM	ASSUMED	MISC	N	NONE	0		No	ACBM with the		MODERATE

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				FLOOR & WALLS & BALCONY								potential for damage		
116	9x9 RED VFT	2,500	SF	AUDITORIUM FLOOR & WALLS	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
117	MASTIC FOR HA #115 & 116	8,750	SF	AUDITORIUM FLOOR & WALLS	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
118	9x9 BROWN & TAN CHECKERBOARD VFT	2,500	SF	ROOMS 401, 403, C406, C404, C204, C205 (new rm. 415, corridor and Library work and storage rooms)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
119	9x9 BROWN & TAN CHECKERBOARD VFT-MASTIC	2,500	SF	ROOMS 101, C406, C404, C204, C205 (new rm. 415, corridor and Library work and storage rooms)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
120	GRAY CARPET MASTIC	900	SF	ROOM C307 (new room 342)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
121	12x12 White w/ Red & Blue Specks FT	800	SF	Convent Basement	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
122	12x12 White w/ Red & Blue Specks FT Mastic	800	SF	Convent Basement	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
123	12x12 Purple FT	200	SF	Convent Basement	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
124	12x12 Purple FT Mastic	200	SF	Convent Basement	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
125	12x12 Light Grey w/ White FT	1,500	SF	Room 412, 416	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
126	12x12 Light Grey w/White FT Mastic	1,500	SF	Room 412, 416	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
127	Grey Mix Terrazzo	4,500	SF	1st, 2nd, 3rd Floor Hallways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
128	Green Carpet Adhesive	800	SF	Room 310	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
129	Peach Linoleum	3,400	SF	Room 302, 308, 313, 315	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
130	Peach Linoleum Adhesive	3,400	SF	Rooms 302, 308, 313, 315	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
131	Brown Carpet Adhesive	2,000	SF	Main Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>3/19/2013</b>
Inspector Name <b>Ethan Payne</b>
<b>100-02175</b> <b>5/15/2013</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
2	
001	Material Not Observed 2013- Removed
002	
003	
004	
005	Material Not Observed 2013- Removed
006	
007	
008	
009	
010	
011	
012	
013	
014	
015	
016	
017	
018	
019	
020	
022	
023	
024	



# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
025	Material Abated from Boiler Room, remains in pipe tunnels and assumed to be damaged.
026	Material Abated, some material may exist in tunnels
027	Material Not Observed 2013- Removed
029	
030	
031	
032	
033	Visible material has been removed.
034	Visible material has been removed.
035	Visible material has been removed.
036	
037	
038	
039	
040	
041	
042	
043	Not Observed.
044	
045	
046	Not Observed.
047	Not Observed.
048	
050	
051	
053	
054	
055	

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
056	
057	
058	
060	
062	
063	
064	
065	
066	
067	
068	
069	
070	
071	
072	
073	Not Observed.
074	
075	Not Observed.
076	Not Observed.
077	Not Observed.
078	Not Observed.
079	
080	Not Observed.
081	Not Observed.
082	Not Observed.
083	
084	
085	
086	

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
087	
089	
090	
091	
093	
094	
095	
096	
097	
098	
099	
100	
101	
102	
103	
104	
104-M	
105	
105-M	
107	
108	
109	
110	
111	
112	
113	
114	
115	
116	

# Chicago Public Schools

School Hancock High School Unit 46021 Building ID 1200

Address 4034 W. 56th St. Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
117	
118	
119	
120	
121	
122	
123	
124	
125	
126	
127	
128	
129	
130	
131	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Hancock High School  
**Address** 4034 W. 56th St.

**Unit** 46021  
Chicago, IL, 60652

**Building ID** 1200  
**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
2	1'x1' Acoustical Wall Tiles	4,500	SF	Annex: Corridors, Lobby to auditorium, CL17,CL18,CL20,CL21,CL07,CL10	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
001	1' x 1' ceiling tile REMOVED			music practice rooms	Assumed	MISC					
002	9"x9" brown w/white & red streaks floor tile	100	SF	original bldg. Cafeteria snack bar.	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
003	1'x1' Solid Act Ceiling Tile	1,000	SF	Rooms 307,309 (above new drop ceiling)	Assumed	MISC	No	0	SF	5 ACBM with potential for significant damage	Operations and Maintenance
004	1'x1' Holed Act.	5,000	SF	Original Building 1st, 2nd,3rd,4th floor & corridor (above new tile)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
005	1x1 Metal Pan Act.			Faculty Lounge, Faculty lounge	Assumed	MISC	No				
006	1'x1' Ceiling Tile: pocked Act.	600	SF	Original Building: Ground Floor Lobby, south entrance.	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
007	2x4 Ceiling Tile	900	SF	2nd floor Workout room above gym offices, library	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
008	9"x9" Grey w/White Streaks Floor Tile	15,500	SF	Annex: Halls & Rm's 102,105,104,106,302,305,304,405,402, 406, 304, 400, 304, 303, 301, 102, 101, 104, 103, auditorium ramps & stairwells	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
009	9"x9" Green w/White Floor Tile	5,280	SF	Annex: stairwells, 1st, 2nd, 3rd, 4th flr corridors, auditorium stairwells	Assumed	MISC	No	30	SF	4 Damaged or significantly damaged friable misc. ACBM	Repair
010	12"x12" Gray VFT	900	SF	Original Bldg: Room A434 ( new number Rm. 412, 416)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
011	9"x9" Gray Floor tile	2,800	SF	ROOMS: A434 411, 415, 417, 419, 421, 422A, 442, 428, 412, 413, 406, A323, 225, 113, 150 (new room numbers: see inspector's comment	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
012	12x 12 Tan VFT	6,000	SF	ROOMS: 420B, 420A, 424, 423, 425, 426, 422A, 422B, 405, 407, 305, 412,413,415,420,432,445,444,405,401, 402,403,325,326,327 new rm,numbers - see ins's comments	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
013	9"x9" green VFT	8,000	SF	Library entrance., ROOMS: 411, 416,424,427,430,433,435,312,314,315, 318 - new room numbers - see inspector's comments	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
014	Cottage Cheese Sprayed on Material	600	SF	Annex: basement corridor, 2nd flr. Library, CL10, CL07	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance

# Chicago Public Schools

School Hancock High School

Unit 46021

Building ID 1200

Address 4034 W. 56th St.

Chicago, IL, 60652

Region 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
015	Cove base molding	2,000	LF	Annex: Rooms 405,402,104,106,406,404,102,105,305,302,304 - room numbers - see inspector's comments	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
016	Exposed aicell pipe insulation	200	LF	Original Building: Classrms	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
017	Trowled on plaster mateial	1,000	SF	Annex: Lobby	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
018	Plaster	3,900	SF	Annex: 1st, 3rd, 4th floor Classrooms and Corridors	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
019	Plaster	8,000	SF	Original Building: Classrooms and crrdrs	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
020	Transite Ceiling Panels	500	SF	Original Building: Gym Storage room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
022	Pipe Joint Compound	1,000	LF	Annex: Pipe Tunnel, basement above ceilings	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
023	Mag Block Insulation	1,000	LF	Annex: Pipe Tunnel	Assumed	TSI	Yes	100	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Remove
024	Aircell Pipe Insulation	500	LF	Original Building: Pipe Tunnels	Assumed	TSI	Yes	100	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Remove
025	Exposed Aircell	30	LF	Original Building: Pipe Tunnels	Assumed	TSI	Yes	30	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Remove
026	Pipe Joint Compound			Original Building: Boiler Rm	Abated	TSI					
027	Mag Block Insulation-removed			Original Building: Boiler Rm: Boiler #1, Boiler #2	Assumed	TSI					
029	Mag Block Insulation	1,000	LF	Original Building: Boiler Rm & ADJACENT RMS IN BASEMENT, tunnels to boiler	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
030	Boiler Breeching Material			Original Building: Boiler Rm in basement	Abated	TSI					
031	Mag Block Insulation			Original Building: Boiler Rm: Oil Preheater	Abated	TSI					
032	Gasket Material			Original Building: Boiler Rm:	Abated	TSI					
033	Chiller Pump piping			Annex: Pump Rm Basement	Assumed	TSI					
034	Heat Pump insulation			Annx: Basement pump room	Assumed	TSI					
035	Pipe joint compound			Annex: Pump Room basement	Assumed	TSI					
036	Aircell Pipe Insulation			Convent: basement	Abated	TSI					

# Chicago Public Schools

**School** Hancock High School  
**Address** 4034 W. 56th St.

**Unit** 46021  
Chicago, IL, 60652

**Building ID** 1200  
**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
037	Cold Water Reservoir Tank Insulation	250	SF	Convent: Pump/Tank Storage Rm	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
038	Insulation on Cold Water Circulation Pumps	6	LF	Convent: Pump/Tank Storage Rm	Assumed	TSI	Yes	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
039	Plaster	5,000	SF	Convent: Student Cafeteria	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Operations and Maintenance
040	Cottage Cheese Sprayed on Material, acoustical ceiling, concrete ceiling	980	SF	Convent: Student Cafeteria	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
041	9x9 Red Vft			Convent: Student Actviity Rm, Basement, Balcony	Abated	MISC					
042	cove base molding			Convent: Student Activity Rm, Basement	Abated	MISC					
043	Exposed Aircell			Convent: student activitiy Rm basement.	Assumed	TSI	Yes				
044	Chemical Flow Hood-ABATED			Original Building: Science Rm	Abated	MISC					
045	Fire Curtain, baby blue	3,500	SF	Annex: Auditorium	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
046	Asbestos Oven			Original Building: Science Room	Assumed	MISC	No				
047	Fire Brick			Original Building: Art Rm Kiln	Assumed	MISC	No				
048	9"x9" White w/ Green Floor Tile	2,784	SF	Annex:	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
050	9"x9" Tan w/ Red & White: Floor Tile	100	SF	Annex: Library, room 200	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
051	9"x9" Brown w/ Tan: Floor tile	2,400	SF	Annex: Library and adjacent rooms, 200	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
053	9x9 Green, Tan, Black & orange: Floor	400	SF	Annex: corridor to convent, rooms A413, 318 (new room numbers: 426C, 303, corridor to convent)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
054	9"x9" light Green: Floor	8,300	SF	Original Building: Rooms A426,317,202,204,223,203,205,224,22 8,222 - new rm numbers - see ins's com-s	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
055	12"x12" tan with Black & White: Floor Tile	200	SF	Original Building: Corridors to Annex on 3rd floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
056	12"x12" Brown tan w/dark & white streaks VFT	50	SF	Original Building: Corridor leading to library, 2nd floor	Assumed	MISC	No	0	SF	5 ACBM with potential for significant damage	Operations and Maintenance
057	5"x5" swirl pattern Floor tile: blue	60	SF	Original Building: Parenta Supervisor's teachers Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
058	5"x5" Gold & Brown Tile: Floor Tile	392	SF	Original Building: teachers. Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
060	Lab Table Tops	150	SF	Original Building: Science Room 312 (new room 308)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance



# Chicago Public Schools

**School** Hancock High School  
**Address** 4034 W. 56th St.

**Unit** 46021  
 Chicago, IL, 60652

**Building ID** 1200  
**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
062	9"x9" Green swirl Vft.	3,000	SF	Convent: Student Cafeteria, rm 306, 211, 208, 205, 204, 203, 201	Assumed	MISC	No	10	SF	5 ACBM with potential for significant damage	Operations and Maintenance
063	9"x9" Tan swirl VFT.	3,000	SF	Convent: Student Cafeteria	Assumed	MISC	No	0	SF	5 ACBM with potential for significant damage	Operations and Maintenance
064	12"x12" Gray and White Vft	500	SF	Original Building: Cafeteria Snack Bar	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
065	Mastic for HA #8 Floor Tile	15,500	SF	Annex: Halls & Rm's 102,105,104,106,302,305,304,405,402, auditorium ramps & stairwells	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
066	9x9 green w/white vft MASTIC FOR HA #9	5,280	SF	Annex: stairwells, 1st, 2nd, 3rd, 4th flr corridors, auditorium stairwells	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
067	Mastic for HA #13	8,000	SF	ROOMS: 416,424,427,430,433,435,312,314,315, 318	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
068	Mastic for HA #10	900	SF	Original Bldg: Room A434 (new room number 412)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
069	Mastic for HA #11	2,800	SF	ROOMS: A434, 442, 428, 412, 413, 406, A323, 225, 113, 150 (see new rm. numbers in comments)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
070	Mastic for HA #12 Floor Tile	6,000	SF	ROOMS: 412,413,415,420,432,445,444,405,401, 402,403,325,326,327 (see new rm.numbers in insp' comments)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
071	9x9 red vft mastic			Convent: Basement activity room	Abated	MISC					
072	9x9 Mastic for Type d Floor Tile	60	SF	Annex: Storage Rm	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
073	Mastic for Type E Floor Tile			Annex: Natural Gas main	Assumed	MISC	No				
074	Mastic for Type F Floor Tile	300	SF	Annex: Student Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
075	Mastic for Type G Floor Tile			Annex: Student Library	Assumed	MISC	No				
076	Mastic for Type H Floor Tile			Annex: Classroom	Assumed	MISC	No				
077	Mastic for Type M Floor Tile			Original Building: Classroom	Assumed	MISC	No				
078	Mastic for Type N Floor Tile			Original Building: Classroom	Assumed	MISC	No				
079	Mortar for terrazzo	4,000	SF	Original Building: corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
080	Mastic for Type P Floor Tile			Original Building: Hallway	Assumed	MISC	No				
081	5x5 blue swirl pattern vft mastic	150	SF	Original Building: Non Smoking Faculty Lounge	Assumed	MISC	No		SF		
082	5x5 gold/brown vft mastic	400	SF	Original Building: Non Smoking Faculty Lounge	Assumed	MISC	No		SF	6 ACBM with the potential for damage	Operations and Maintenance

# Chicago Public Schools

**School** Hancock High School  
**Address** 4034 W. 56th St.

**Unit** 46021  
Chicago, IL, 60652

**Building ID** 1200  
**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
083	Mastic for Type S Floor Tile	136	SF	Original Building: Gym Offices/Locker Rm	Assumed	MISC	No	8	SF	4 Damaged or significantly damaged friable misc. ACBM	Operations and Maintenance
084	Green swirl floor tile mastic	3,000	SF	Convent: Student Cafeteria	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
085	Tan swirl floor tile mastic	3,000	SF	Convent: Student Cafeteria	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
086	12x 12 gray & white floor tile mastic	500	SF	Original Building: Cafeteria Snack Bar	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
087	Mastic for Type A Cove Base Molding	180	LF	Original Building and Annex: Classrms and Corridors	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
089	12"x12" Brown tan w/dark & white streaks VFT-MASTIC	50	SF	Original Building: Corridor leading to library, 2nd floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
090	12x12 tan speckled Vft.	1,000	SF	2nd flr. Corridor leading to library, rm 209	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
091	12x12 tan speckled Vft mastic	90	SF	2nd flr corridor leading to library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
093	9"x9" brown w/white & red streaks floor tile mastic	100	SF	original bldg. Cafeteria snack bar.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
094	12x12 BLACK W/ WHITE STREAKS VFT	100	SF	ROOM 106B (new room 142)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
095	12x12 BLACK W/ WHITE STREAKS VFT-MASTIC	100	SF	ROOM 106B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
096	12x12 GRAYISH GREEN VFT	2,500	SF	ANNEX: BASEMENT, DRESSING ROOM, CL07, RM 210	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
097	12x12 GRAYISH GREEN VFT-MASTIC	2,500	SF	ANNEX: BASEMENT, DRESSING ROOM, CL07, RM 210	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
098	12x12 BLUE VFT	2,500	SF	ANNEX: BASEMENT UNDER AUDITORIUM	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
099	12x12 BLUE VFT-MASTIC	2,500	SF	ANNEX: BASEMENT UNDER AUDITORIUM	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
100	PLASTER CEILING PATCH	50	SF	CONVENT BASEMENT, STUDENT ACTIVITY ROOM	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
101	PIPE JOINT COMPOUND	500	LF	CONVENT BASEMENT	Assumed	TSI	Yes	0	LF	5 ACBM with potential for significant damage	Operations and Maintenance
102	12x12 RED VFT	25	SF	ROOM A423 (new room number 420)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
103	12x12 RED VFT-MASTIC	25	SF	ROOM A423 (new room number 420)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
104	12x12 OFF WHITE VFT	3,900	SF	ROOMS 125, A322, A316, 301, 441, 409, 317, 307, A227 (new room numbers 125, 301, 305, 313, 401, East Corridor)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
104-M	12x12 OFF WHITE VFT-MASTIC	3,900	SF	ROOMS 125, A322, A316, 301, 441, A227 (new room numbers 125, 301, 305, 313, 401, East Corridor)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

# Chicago Public Schools

**School** Hancock High School  
**Address** 4034 W. 56th St.

**Unit** 46021  
Chicago, IL, 60652

**Building ID** 1200  
**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
105	9x9 GREEN & GRAY CHECKERBOARD W/ BLACK BORDER VFT	5,700	SF	4TH FLR OF ORIGINAL BLDG, A313, A310, 207, 103 (new room numbers: 121, 207, 125)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
105-M	MASTIC FOR HA #105	5,700	SF	4TH FLR OF ORIGINAL BLDG, A313, A310, 207, 103 (new room numbers: 121, 207, 125)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
107	PURPLE CARPET MASTIC	900	SF	ROOM A152 (new room number 101)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
108	GRAY CARPET MASTIC	6,000	SF	ROOMS A141, 155, 144, 146, 148, 147 (new room numbers A141, 101A, 1-7, 105, 103, 109)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
109	TAN CARPET MASTIC	1,800	SF	ROOMS 114, 121 (new room numbers 110, 115)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
110	12x12 WHITE & BLACK CHECKERBOARD VFT	700	SF	ROOM 119	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
111	12x12 WHITE & BLACK CHECKERBOARD VFT-MASTIC	700	SF	ROOM 119	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
112	12x12 MARBLE LOOKING TAN VFT	1,200	SF	LOBBY OF AUDITORIUM	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
113	12x12 MARBLE LOOKING BLACK VFT	1,200	SF	LOBBY OF AUDITORIUM	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
114	MASTIC FOR HA #112 & 113	2,400	SF	LOBBY OF AUDITORIUM	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
115	9x9 DARK GREEN VFT	6,250	SF	AUDITORIUM FLOOR & WALLS & BALCONY	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
116	9x9 RED VFT	2,500	SF	AUDITORIUM FLOOR & WALLS	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
117	MASTIC FOR HA #115 & 116	8,750	SF	AUDITORIUM FLOOR & WALLS	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
118	9x9 BROWN & TAN CHECKERBOARD VFT	2,500	SF	ROOMS 401, 403, C406, C404, C204, C205 (new rm. 415, corridor and Library work and storage rooms)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
119	9x9 BROWN & TAN CHECKERBOARD VFT-MASTIC	2,500	SF	ROOMS 101, C406, C404, C204, C205 (new rm. 415, corridor and Library work and storage rooms)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
120	GRAY CARPET MASTIC	900	SF	ROOM C307 (new room 342)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
121	12x12 White w/ Red & Blue Specks FT	800	SF	Convent Basement	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
122	12x12 White w/ Red & Blue Specks FT Mastic	800	SF	Convent Basement	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
123	12x12 Purple FT	200	SF	Convent Basement	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
124	12x12 Purple FT Mastic	200	SF	Convent Basement	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
125	12x12 Light Grey w/ White FT	1,500	SF	Room 412, 416	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
126	12x12 Light Grey w/White FT Mastic	1,500	SF	Room 412, 416	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
127	Grey Mix Terrazzo	4,500	SF	1st, 2nd, 3rd Floor Hallways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

# Chicago Public Schools

**School** Hancock High School  
**Address** 4034 W. 56th St.

**Unit** 46021  
 Chicago, IL, 60652

**Building ID** 1200  
**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
128	Green Carpet Adhesive	800	SF	Room 310	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
129	Peach Linoleum	3,400	SF	Room 302, 308, 313, 315	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
130	Peach Linoleum Adhesive	3,400	SF	Rooms 302, 308, 313, 315	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
131	Brown Carpet Adhesive	2,000	SF	Main Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Review Date 4/18/2013

HA Number Management Comments

# Chicago Public Schools

**School** Hancock High School  
**Address** 4034 W. 56th St.

**Unit** 46021  
 Chicago, IL, 60652

**Building ID** 1200  
**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

Manager Planner Name	Todd Huffer
100-09870	5/15/2013
Manager IDPH License No/Expiration	

HA Number	Management Comments
2	
001	
002	
003	
004	
005	Material Not Observed 2013- Removed
006	
007	
008	
009	Remove/Repair damaged material and maintain O&M
010	
011	
012	
013	
014	
015	
016	
017	
018	
019	
020	
022	
023	Remove/Repair damaged material and maintain O&M
024	Remove/Repair damaged material and maintain O&M
025	Remove/Repair damaged material and maintain O&M
026	
027	Material Not Observed 2013- Removed

# Chicago Public Schools

**School** Hancock High School  
**Address** 4034 W. 56th St.

**Unit** 46021  
Chicago, IL, 60652

**Building ID** 1200  
**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
029	
030	
031	
032	
033	
034	
035	
036	
037	
038	
039	
040	
041	
042	
043	
044	
045	
046	
047	
048	
050	
051	
053	
054	
055	
056	
057	

# Chicago Public Schools

**School** Hancock High School

**Unit** 46021

**Building ID** 1200

**Address** 4034 W. 56th St.

Chicago, IL, 60652

**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

*Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
058	
060	
062	
063	
064	
065	
066	
067	
068	
069	
070	
071	
072	
073	
074	
075	
076	
077	
078	
079	
080	
081	Not Observed.
082	Not Observed.
083	
084	
085	
086	

# Chicago Public Schools

**School** Hancock High School  
**Address** 4034 W. 56th St.

**Unit** 46021  
 Chicago, IL, 60652

**Building ID** 1200  
**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
087	
089	
090	
091	
093	
094	
095	
096	
097	
098	
099	
100	
101	
102	
103	
104	
104-M	
105	
105-M	
107	
108	
109	
110	
111	
112	
113	
114	



# Chicago Public Schools

**School** Hancock High School

**Unit** 46021

**Building ID** 1200

**Address** 4034 W. 56th St.

Chicago, IL, 60652

**Region** 04

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

*Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
115	
116	
117	
118	
119	
120	
121	
122	
123	
124	
125	
126	
127	
128	
129	
130	
131	

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **2**  
MATERIAL DESCRIPTION: **1'x1' Acoustical Wall Tiles**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Annex: Corridors, Lobby to auditorium, CL17,CL18,CL20,CL21,CL07,CL10**

MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **2**  
MATERIAL DESCRIPTION: **1'x1' Acoustical Wall Tiles**  
MATERIAL LOCATION: **Annex: Corridors, Lobby to auditorium, CL17,CL18,CL20,CL21,CL07,CL10**  
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **001**  
MATERIAL DESCRIPTION: **1' x 1' ceiling tile REMOVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **music practice rooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material Not Observed 2013- Removed**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **001**

MATERIAL DESCRIPTION: **1' x 1' ceiling tile REMOVED**

MATERIAL LOCATION: **music practice rooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **002**  
MATERIAL DESCRIPTION: **9"x9" brown w/white & red streaks floor tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **original bldg. Cafeteria snack bar.**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **002**  
MATERIAL DESCRIPTION: **9"x9" brown w/white & red streaks floor tile**  
MATERIAL LOCATION: **original bldg. Cafeteria snack bar.**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates  
2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **003**  
MATERIAL DESCRIPTION: **1'x1' Solid Act Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Rooms 307,309 (above new drop ceiling)**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **003**  
MATERIAL DESCRIPTION: **1'x1' Solid Act Ceiling Tile**  
MATERIAL LOCATION: **Rooms 307,309 (above new drop ceiling)**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **004**  
MATERIAL DESCRIPTION: **1'x1' Holed Act.**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Building 1st, 2nd,3rd,4th floor & corridor (above new tile)**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **004**  
MATERIAL DESCRIPTION: **1'x1' Holed Act.**  
MATERIAL LOCATION: **Original Building 1st, 2nd,3rd,4th floor & corridor (above new tile)**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005**  
MATERIAL DESCRIPTION: **1x1 Metal Pan Act.**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Faculty Lounge, Faculty lounge**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material Not Observed 2013- Removed**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **005**  
MATERIAL DESCRIPTION: **1x1 Metal Pan Act.**  
MATERIAL LOCATION: **Faculty Lounge, Faculty lounge**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material Not Observed 2013- Removed

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006**  
MATERIAL DESCRIPTION: **1'x1' Ceiling Tile: pocked Act.**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Building: Ground Floor Lobby, south entrance.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **006**  
MATERIAL DESCRIPTION: **1'x1' Ceiling Tile: pocked Act.**  
MATERIAL LOCATION: **Original Building: Ground Floor Lobby, south entrance.**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **007**  
MATERIAL DESCRIPTION: **2x4 Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd floor Workout room above gym offices, library**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **007**  
MATERIAL DESCRIPTION: **2x4 Ceiling Tile**  
MATERIAL LOCATION: **2nd floor Workout room above gym offices, library**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 04/18/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **008**  
MATERIAL DESCRIPTION: **9"x9" Grey w/White Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Annex: Halls & Rm's 102,105,104,106,302,305,304,405,402, 406, 304, 400, 304, 303, 301, 102, 101, 104, 103, auditorium ramps & stariwells**

MATERIAL QUANTITY: **15500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **008**  
MATERIAL DESCRIPTION: **9"x9" Grey w/White Streaks Floor Tile**  
MATERIAL LOCATION: **Annex: Halls & Rm's 102,105,104,106,302,305,304,405,402, 406, 304, 400, 304, 303, 301, 102, 101, 104, 103, auditorium ramps & stariwells**  
MATERIAL QUANTITY: **15500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **009**  
MATERIAL DESCRIPTION: **9"x9" Green w/White Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **4 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Repair  
Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Annex: stairwells, 1st, 2nd, 3rd, 4th flr corridors, auditorium stairwells**  
MATERIAL QUANTITY: **5280** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **009**  
MATERIAL DESCRIPTION: **9"x9" Green w/White Floor Tile**  
MATERIAL LOCATION: **Annex: stairwells, 1st, 2nd, 3rd, 4th flr corridors, auditorium stairwells**  
MATERIAL QUANTITY: **5280** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair  
Operations and Maintenance**

Comments:

Remove/Repair damaged material and maintain O&M

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **010**  
MATERIAL DESCRIPTION: **12"x12" Gray VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Bldg: Room A434 ( new number Rm. 412, 416)**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **010**  
MATERIAL DESCRIPTION: **12"x12" Gray VFT**  
MATERIAL LOCATION: **Original Bldg: Room A434 ( new number Rm. 412, 416)**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **011**  
MATERIAL DESCRIPTION: **9"x9" Gray Floor tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **ROOMS: A434 411, 415, 417, 419, 421, 422A, 442, 428, 412, 413, 406, A323, 225, 113, 150 (new room numbers: see inspector's comment**

MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **011**  
MATERIAL DESCRIPTION: **9"x9" Gray Floor tile**  
MATERIAL LOCATION: **ROOMS: A434 411, 415, 417, 419, 421, 422A, 442, 428, 412, 413, 406, A323, 225, 113, 150 (new room numbers: see inspector's comment)**  
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 04/18/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **012**  
MATERIAL DESCRIPTION: **12x 12 Tan VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **ROOMS: 420B, 420A, 424, 423, 425, 426, 422A, 422B, 405, 407, 305, 412,413,415,420,432,445,444,405,401,402,403,325,326,327 new rm,numbers - see ins's comments**

MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **012**  
MATERIAL DESCRIPTION: **12x 12 Tan VFT**  
MATERIAL LOCATION: **ROOMS: 420B, 420A, 424, 423, 425, 426, 422A, 422B, 405, 407, 305, 412,413,415,420,432,445,444,405,401,402,403,325,326,327 new rm,numbers - see ins's comments**  
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **013**  
MATERIAL DESCRIPTION: **9"x9" green VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Library entrance,. ROOMS: 411, 416,424,427,430,433,435,312,314,315,318 - new room numbers - see inspector's comments**

MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **013**  
MATERIAL DESCRIPTION: **9"x9" green VFT**  
MATERIAL LOCATION: **Library entrance,. ROOMS: 411, 416,424,427,430,433,435,312,314,315,318 - new room numbers - see inspector's comments**  
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **014**  
MATERIAL DESCRIPTION: **Cottage Cheese Sprayed on Material**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Annex: basement corridor, 2nd flr. Library, CL10, CL07**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **014**  
MATERIAL DESCRIPTION: **Cottage Cheese Sprayed on Material**  
MATERIAL LOCATION: **Annex: basement corridor, 2nd flr. Library, CL10, CL07**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **015**  
MATERIAL DESCRIPTION: **Cove base molding**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Annex: Rooms 405,402,104,106,406,404,102,105,305,302,304 - room numbers - see inspector's comments**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **015**  
MATERIAL DESCRIPTION: **Cove base molding**  
MATERIAL LOCATION: **Annex: Rooms 405,402,104,106,406,404,102,105,305,302,304 - room numbers - see inspector's comments**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **016**  
MATERIAL DESCRIPTION: **Exposed aicell pipe insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Building: Classrms**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **016**  
MATERIAL DESCRIPTION: **Exposed aicell pipe insulation**  
MATERIAL LOCATION: **Original Building: Classrms**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **017**  
MATERIAL DESCRIPTION: **Trowled on plaster mateial**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Annex: Lobby**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **017**  
MATERIAL DESCRIPTION: **Trowled on plaster mateial**  
MATERIAL LOCATION: **Annex: Lobby**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **018**  
MATERIAL DESCRIPTION: **Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Annex: 1st, 3rd, 4th floor Classrooms and Corridors**  
MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **018**  
MATERIAL DESCRIPTION: **Plaster**  
MATERIAL LOCATION: **Annex: 1st, 3rd, 4th floor Classrooms and Corridors**  
MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **019**  
MATERIAL DESCRIPTION: **Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Original Building: Classrooms and crrdrs**

MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **019**  
MATERIAL DESCRIPTION: **Plaster**  
MATERIAL LOCATION: **Original Building: Classrooms and crrdrs**  
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **020**  
MATERIAL DESCRIPTION: **Transite Ceiling Panels**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Building: Gym Storage room**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **020**  
MATERIAL DESCRIPTION: **Transite Ceiling Panels**  
MATERIAL LOCATION: **Original Building: Gym Storage room**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **022**  
MATERIAL DESCRIPTION: **Pipe Joint Compound**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Annex: Pipe Tunnel, basement above ceilings**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **022**  
MATERIAL DESCRIPTION: **Pipe Joint Compound**  
MATERIAL LOCATION: **Annex: Pipe Tunnel, basement above ceilings**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **023**  
MATERIAL DESCRIPTION: **Mag Block Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Enclose  
Repair  
See Comments**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Annex: Pipe Tunnel**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **023**  
MATERIAL DESCRIPTION: **Mag Block Insulation**  
MATERIAL LOCATION: **Annex: Pipe Tunnel**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **100** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Enclose**  
**Repair**  
**See Comments**

Comments:

Remove/Repair damaged material and maintain O&M

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **024**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Enclose Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Original Building: Pipe Tunnels**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **024**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **Original Building: Pipe Tunnels**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **100** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Enclose  
Operations and Maintenance**

Comments:

Remove/Repair damaged material and maintain O&M

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **025**  
MATERIAL DESCRIPTION: **Exposed Aircell**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance Repair**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Building: Pipe Tunnels**  
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS: **Material Abated from Boiler Room, remains in pipe tunnels and assumed to be damaged.**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **025**  
MATERIAL DESCRIPTION: **Exposed Aircell**  
MATERIAL LOCATION: **Original Building: Pipe Tunnels**  
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **30** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Operations and Maintenance  
Repair**

Comments:

Remove/Repair damaged material and maintain O&M

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **026**  
MATERIAL DESCRIPTION: **Pipe Joint Compound**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Boiler Rm**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material Abated, some material may exist in tunnels**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **026**  
MATERIAL DESCRIPTION: **Pipe Joint Compound**  
MATERIAL LOCATION: **Original Building: Boiler Rm**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **027**  
MATERIAL DESCRIPTION: **Mag Block Insulation-removed**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Boiler Rm: Boiler #1, Boiler #2**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material Not Observed 2013- Removed**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **027**  
MATERIAL DESCRIPTION: **Mag Block Insulation-removed**  
MATERIAL LOCATION: **Original Building: Boiler Rm: Boiler #1, Boiler #2**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material Not Observed 2013- Removed

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **029**  
MATERIAL DESCRIPTION: **Mag Block Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Enclose Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Building: Boiler Rm & ADJACENT RMS IN BASEMENT, tunnels to boiler**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **029**  
MATERIAL DESCRIPTION: **Mag Block Insulation**  
MATERIAL LOCATION: **Original Building: Boiler Rm & ADJACENT RMS IN BASEMENT, tunnels to boiler**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Enclose  
Operations and Maintenance**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **030**  
MATERIAL DESCRIPTION: **Boiler Breeching Material**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Boiler Rm in basement**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **030**  
MATERIAL DESCRIPTION: **Boiler Breaching Material**  
MATERIAL LOCATION: **Original Building: Boiler Rm in basement**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **031**  
MATERIAL DESCRIPTION: **Mag Block Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Boiler Rm: Oil Preheater**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **031**  
MATERIAL DESCRIPTION: **Mag Block Insulation**  
MATERIAL LOCATION: **Original Building: Boiler Rm: Oil Preheater**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **032**  
MATERIAL DESCRIPTION: **Gasket Material**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Boiler Rm:**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **032**

MATERIAL DESCRIPTION: **Gasket Material**

MATERIAL LOCATION: **Orignal Building: Boiler Rm:**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **033**  
MATERIAL DESCRIPTION: **Chiller Pump piping**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex: Pump Rm Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Visible material has been removed.**

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **033**  
MATERIAL DESCRIPTION: **Chiller Pump piping**  
MATERIAL LOCATION: **Annex: Pump Rm Basement**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **034**  
MATERIAL DESCRIPTION: **Heat Pump insulation**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annx: Basement pump room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Visible material has been removed.**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **034**  
MATERIAL DESCRIPTION: **Heat Pump insulation**  
MATERIAL LOCATION: **Annx: Basement pump room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **035**  
MATERIAL DESCRIPTION: **Pipe joint compound**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex: Pump Room basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Visible material has been removed.**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **035**  
MATERIAL DESCRIPTION: **Pipe joint compound**  
MATERIAL LOCATION: **Annex: Pump Room basement**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **036**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY: **Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Repair Operations and Maintenance**  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Moderate**

MATERIAL LOCATION: **Convent: basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **036**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **Convent: basement**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair  
Operations and Maintenance**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **037**  
MATERIAL DESCRIPTION: **Cold Water Reservoir Tank Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Convent: Pump/Tank Storage Rm**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **037**  
MATERIAL DESCRIPTION: **Cold Water Reservoir Tank Insulation**  
MATERIAL LOCATION: **Convent: Pump/Tank Storage Rm**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **038**  
MATERIAL DESCRIPTION: **Insulation on Cold Water Circulation Pumps**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Convent: Pump/Tank Storage Rm**

MATERIAL QUANTITY: **6** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **038**  
MATERIAL DESCRIPTION: **Insulation on Cold Water Circulation Pumps**  
MATERIAL LOCATION: **Convent: Pump/Tank Storage Rm**  
MATERIAL QUANTITY: **6** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **039**  
MATERIAL DESCRIPTION: **Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Convent: Student Cafeteria**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **039**  
MATERIAL DESCRIPTION: **Plaster**  
MATERIAL LOCATION: **Convent: Student Cafeteria**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **040**  
MATERIAL DESCRIPTION: **Cottage Cheese Sprayed on Material, acoustical ceiling, concrete ceiling**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Convent: Student Cafeteria**

MATERIAL QUANTITY: **980**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **040**  
MATERIAL DESCRIPTION: **Cottage Cheese Sprayed on Material, acoustical ceiling, concrete ceiling**  
MATERIAL LOCATION: **Convent: Student Cafeteria**  
MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **041**  
MATERIAL DESCRIPTION: **9x9 Red Vft**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Convent: Student Actviity Rm, Basement, Balcony**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **041**

MATERIAL DESCRIPTION: **9x9 Red Vft**

MATERIAL LOCATION: **Convent: Student Actviity Rm, Basement, Balcony**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **042**  
MATERIAL DESCRIPTION: **cove base molding**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Convent: Student Activity Rm, Basement**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **042**  
MATERIAL DESCRIPTION: **cove base molding**  
MATERIAL LOCATION: **Convent: Student Activity Rm, Basement**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013** \_\_\_\_\_

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **043**  
MATERIAL DESCRIPTION: **Exposed Aircell**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Convent: student activitiy Rm basement.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **043**  
MATERIAL DESCRIPTION: **Exposed Aircell**  
MATERIAL LOCATION: **Convent: student activitiy Rm basement.**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **044**  
MATERIAL DESCRIPTION: **Chemical Flow Hood-ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Science Rm**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **044**  
MATERIAL DESCRIPTION: **Chemical Flow Hood-ABATED**  
MATERIAL LOCATION: **Original Building: Science Rm**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **045**  
MATERIAL DESCRIPTION: **Fire Curtain, baby blue**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Annex: Auditorium**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **045**  
MATERIAL DESCRIPTION: **Fire Curtain, baby blue**  
MATERIAL LOCATION: **Annex: Auditorium**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 04/18/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **046**  
MATERIAL DESCRIPTION: **Asbestos Oven**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Science Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **046**  
MATERIAL DESCRIPTION: **Asbestos Oven**  
MATERIAL LOCATION: **Original Building: Science Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **047**  
MATERIAL DESCRIPTION: **Fire Brick**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Art Rm Kiln**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **047**  
MATERIAL DESCRIPTION: **Fire Brick**  
MATERIAL LOCATION: **Origianl Building: Art Rm Kiln**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **048**  
MATERIAL DESCRIPTION: **9"x9" White w/ Green Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex:**

MATERIAL QUANTITY: **2784**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **048**  
MATERIAL DESCRIPTION: **9"x9" White w/ Green Floor Tile**  
MATERIAL LOCATION: **Annex:**  
MATERIAL QUANTITY: **2784** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **050**  
MATERIAL DESCRIPTION: **9"x9" Tan w/ Red & White: Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Annex: Library, room 200**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **050**  
MATERIAL DESCRIPTION: **9"x9" Tan w/ Red & White: Floor Tile**  
MATERIAL LOCATION: **Annex: Library, room 200**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **051**  
MATERIAL DESCRIPTION: **9"x9" Brown w/ Tan: Floor tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Annex: Library and adjacent rooms, 200**

MATERIAL QUANTITY: **2400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **051**  
MATERIAL DESCRIPTION: **9"x9" Brown w/ Tan: Floor tile**  
MATERIAL LOCATION: **Annex: Library and adjacent rooms, 200**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **053**  
MATERIAL DESCRIPTION: **9x9 Green, Tan, Black & orange: Floor**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Annex: corridor to convent, rooms A413, 318 (new room numbers: 426C, 303, corridor to convent)**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **053**  
MATERIAL DESCRIPTION: **9x9 Green, Tan, Black & orange: Floor**  
MATERIAL LOCATION: **Annex: corridor to convent, rooms A413, 318 (new room numbers: 426C, 303, corridor to convent)**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **054**  
MATERIAL DESCRIPTION: **9"x9" light Green: Floor**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Original Building: Rooms A426,317,202,204,223,203,205,224,228,222 - new rm numbers - see ins's com-s**

MATERIAL QUANTITY: **8300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **054**  
MATERIAL DESCRIPTION: **9"x9" light Green: Floor**  
MATERIAL LOCATION: **Original Building: Rooms A426,317,202,204,223,203,205,224,228,222 - new rm numbers - see ins's com-s**  
MATERIAL QUANTITY: **8300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **055**  
MATERIAL DESCRIPTION: **12"x12" tan with Black & White: Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Building; Corridors to Annex on 3rd floor**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/19/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **055**  
MATERIAL DESCRIPTION: **12"x12" tan with Black & White: Floor Tile**  
MATERIAL LOCATION: **Original Building; Corridors to Annex on 3rd floor**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **056**  
MATERIAL DESCRIPTION: **12"x12" Brown tan w/dark & white streaks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Building: Corridor leading to library, 2nd floor**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **056**  
MATERIAL DESCRIPTION: **12"x12" Brown tan w/dark & white streaks VFT**  
MATERIAL LOCATION: **Original Building: Corridor leading to library, 2nd floor**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **057**  
MATERIAL DESCRIPTION: **5"x5" swirl pattern Floor tile: blue**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Original Building: Parenta Supervisor's teachers Lounge**

MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **057**  
MATERIAL DESCRIPTION: **5"x5" swirl pattern Floor tile: blue**  
MATERIAL LOCATION: **Original Building: Parenta Supervisor's teachers Lounge**  
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **058**  
MATERIAL DESCRIPTION: **5"x5" Gold & Brown Tile: Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Building: teachers. Lounge**  
MATERIAL QUANTITY: **392** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **058**  
MATERIAL DESCRIPTION: **5"x5" Gold & Brown Tile: Floor Tile**  
MATERIAL LOCATION: **Original Building: teachers. Lounge**  
MATERIAL QUANTITY: **392** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **060**  
MATERIAL DESCRIPTION: **Lab Table Tops**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Building: Science Room 312 (new room 308)**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **060**  
MATERIAL DESCRIPTION: **Lab Table Tops**  
MATERIAL LOCATION: **Original Building: Science Room 312 (new room 308)**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 04/18/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **062**  
MATERIAL DESCRIPTION: **9"x9" Green swirl Vft.**  
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Repair  
Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Convent: Student Cafeteria, rm 306, 211, 208, 205, 204, 203, 201**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **062**  
MATERIAL DESCRIPTION: **9"x9" Green swirl Vft.**  
MATERIAL LOCATION: **Convent: Student Cafeteria, rm 306, 211, 208, 205, 204, 203, 201**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **10** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair  
Operations and Maintenance**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **063**  
MATERIAL DESCRIPTION: **9"x9" Tan swirl VFT.**  
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Convent: Student Cafeteria**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **063**  
MATERIAL DESCRIPTION: **9"x9" Tan swirl VFT.**  
MATERIAL LOCATION: **Convent: Student Cafeteria**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **064**  
MATERIAL DESCRIPTION: **12"x12" Gray and White Vft**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Original Building: Cafeteria Snack Bar**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **064**  
MATERIAL DESCRIPTION: **12"x12" Gray and White Vft**  
MATERIAL LOCATION: **Original Building: Cafeteria Snack Bar**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **065**  
MATERIAL DESCRIPTION: **Mastic for HA #8 Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Annex: Halls & Rm's 102,105,104,106,302,305,304,405,402,auditorium ramps & stariwells**

MATERIAL QUANTITY: **15500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **065**  
MATERIAL DESCRIPTION: **Mastic for HA #8 Floor Tile**  
MATERIAL LOCATION: **Annex: Halls & Rm's 102,105,104,106,302,305,304,405,402,auditorium ramps & stariwells**  
MATERIAL QUANTITY: **15500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 04/18/2013

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **066**  
MATERIAL DESCRIPTION: **9x9 green w/white vft MASTIC FOR HA #9**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Annex: stairwells, 1st, 2nd, 3rd, 4th flr corridors, auditorium stairwells**  
MATERIAL QUANTITY: **5280** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **066**  
MATERIAL DESCRIPTION: **9x9 green w/white vft MASTIC FOR HA #9**  
MATERIAL LOCATION: **Annex: stairwells, 1st, 2nd, 3rd, 4th flr corridors, auditorium stairwells**  
MATERIAL QUANTITY: **5280** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **067**  
MATERIAL DESCRIPTION: **Mastic for HA #13**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ROOMS: 416,424,427,430,433,435,312,314,315,318**  
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **067**  
MATERIAL DESCRIPTION: **Mastic for HA #13**  
MATERIAL LOCATION: **ROOMS: 416,424,427,430,433,435,312,314,315,318**  
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **068**  
MATERIAL DESCRIPTION: **Mastic for HA #10**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Bldg: Room A434 (new room number 412)**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **068**  
MATERIAL DESCRIPTION: **Mastic for HA #10**  
MATERIAL LOCATION: **Original Bldg: Room A434 (new room number 412)**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **069**  
MATERIAL DESCRIPTION: **Mastic for HA #11**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **ROOMS: A434, 442, 428, 412, 413, 406, A323, 225, 113, 150 (see new rm. numbers in comments)**

MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **069**  
MATERIAL DESCRIPTION: **Mastic for HA #11**  
MATERIAL LOCATION: **ROOMS: A434, 442, 428, 412, 413, 406, A323, 225, 113, 150 (see new rm. numbers in comments)**  
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **070**  
MATERIAL DESCRIPTION: **Mastic for HA #12 Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **ROOMS: 412,413,415,420,432,445,444,405,401,402,403,325,326,327 (see new rm.numbers in insp'comments)**

MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **070**  
MATERIAL DESCRIPTION: **Mastic for HA #12 Floor Tile**  
MATERIAL LOCATION: **ROOMS: 412,413,415,420,432,445,444,405,401,402,403,325,326,327 (see new rm.numbers in insp'comments)**  
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **071**  
MATERIAL DESCRIPTION: **9x9 red vft mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Convent: Basement activity room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **071**

MATERIAL DESCRIPTION: **9x9 red vft mastic**

MATERIAL LOCATION: **Convent: Basement activity room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **072**  
MATERIAL DESCRIPTION: **9x9 Mastic for Type d Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Annex: Storage Rm**

MATERIAL QUANTITY: **60**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **072**  
MATERIAL DESCRIPTION: **9x9 Mastic for Type d Floor Tile**  
MATERIAL LOCATION: **Annex: Storage Rm**  
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **073**  
MATERIAL DESCRIPTION: **Mastic for Type E Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex: Natural Gas main**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **073**  
MATERIAL DESCRIPTION: **Mastic for Type E Floor Tile**  
MATERIAL LOCATION: **Annex: Natural Gas main**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **074**  
MATERIAL DESCRIPTION: **Mastic for Type F Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Annex: Student Library**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **074**  
MATERIAL DESCRIPTION: **Mastic for Type F Floor Tile**  
MATERIAL LOCATION: **Annex: Student Library**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **075**  
MATERIAL DESCRIPTION: **Mastic for Type G Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex: Student Library**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **075**  
MATERIAL DESCRIPTION: **Mastic for Type G Floor Tile**  
MATERIAL LOCATION: **Annex: Student Library**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **076**  
MATERIAL DESCRIPTION: **Mastic for Type H Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex: Classroom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **076**  
MATERIAL DESCRIPTION: **Mastic for Type H Floor Tile**  
MATERIAL LOCATION: **Annex: Classroom**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **077**  
MATERIAL DESCRIPTION: **Mastic for Type M Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Classroom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **077**  
MATERIAL DESCRIPTION: **Mastic for Type M Floor Tile**  
MATERIAL LOCATION: **Original Building: Classroom**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **078**  
MATERIAL DESCRIPTION: **Mastic for Type N Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Classroom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **078**  
MATERIAL DESCRIPTION: **Mastic for Type N Floor Tile**  
MATERIAL LOCATION: **Original Building: Classroom**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **079**  
MATERIAL DESCRIPTION: **Mortar for terrazzo**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Original Building: corridor**

MATERIAL QUANTITY: **4000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **079**  
MATERIAL DESCRIPTION: **Mortar for terrazzo**  
MATERIAL LOCATION: **Original Building: corridor**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **080**  
MATERIAL DESCRIPTION: **Mastic for Type P Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Hallway**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **080**  
MATERIAL DESCRIPTION: **Mastic for Type P Floor Tile**  
MATERIAL LOCATION: **Original Building: Hallway**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **081**  
MATERIAL DESCRIPTION: **5x5 blue swirl pattern vft mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Original Building: Non Smoking Faculty Lounge**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **081**  
MATERIAL DESCRIPTION: **5x5 blue swirl pattern vft mastic**  
MATERIAL LOCATION: **Original Building: Non Smoking Faculty Lounge**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:  
Not Observed.

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **082**  
MATERIAL DESCRIPTION: **5x5 gold/brown vft mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Original Building: Non Smoking Faculty Lounge**

MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Not Observed.**

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **082**  
MATERIAL DESCRIPTION: **5x5 gold/brown vft mastic**  
MATERIAL LOCATION: **Original Building: Non Smoking Faculty Lounge**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:  
Not Observed.

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **083**  
MATERIAL DESCRIPTION: **Mastic for Type S Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **4**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**  
MATERIAL LOCATION: **Original Building: Gym Offices/Locker Rm**  
MATERIAL QUANTITY: **136** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **083**  
MATERIAL DESCRIPTION: **Mastic for Type S Floor Tile**  
MATERIAL LOCATION: **Original Building: Gym Offices/Locker Rm**  
MATERIAL QUANTITY: **136** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **8** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **084**  
MATERIAL DESCRIPTION: **Green swirl floor tile mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Convent: Student Cafeteria**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **084**  
MATERIAL DESCRIPTION: **Green swirl floor tile mastic**  
MATERIAL LOCATION: **Convent: Student Cafeteria**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **085**  
MATERIAL DESCRIPTION: **Tan swirl floor tile mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Convent: Student Cafeteria**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **085**  
MATERIAL DESCRIPTION: **Tan swirl floor tile mastic**  
MATERIAL LOCATION: **Convent: Student Cafeteria**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **086**  
MATERIAL DESCRIPTION: **12x 12 gray & white floor tile mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Original Building: Cafeteria Snack Bar**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **086**  
MATERIAL DESCRIPTION: **12x 12 gray & white floor tile mastic**  
MATERIAL LOCATION: **Original Building: Cafeteria Snack Bar**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **087**  
MATERIAL DESCRIPTION: **Mastic for Type A Cove Base Molding**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Original Building and Annex: Classrms and Corridors**  
MATERIAL QUANTITY: **180** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **087**  
MATERIAL DESCRIPTION: **Mastic for Type A Cove Base Molding**  
MATERIAL LOCATION: **Original Building and Annex: Classrms and Corridors**  
MATERIAL QUANTITY: **180** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUILDING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **089**  
MATERIAL DESCRIPTION: **12"x12" Brown tan w/dark & white streaks VFT-MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Original Building: Corridor leading to library, 2nd floor**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **089**  
MATERIAL DESCRIPTION: **12"x12" Brown tan w/dark & white streaks VFT-MASTIC**  
MATERIAL LOCATION: **Original Building: Corridor leading to library, 2nd floor**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **090**  
MATERIAL DESCRIPTION: **12x12 tan speckled Vft.**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2nd flr. Corridor leading to library, rm 209**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/19/2013



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **090**  
MATERIAL DESCRIPTION: **12x12 tan speckled Vft.**  
MATERIAL LOCATION: **2nd flr. Corridor leading to library, rm 209**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **091**  
MATERIAL DESCRIPTION: **12x12 tan speckled Vft mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **2nd flr corridor leading to library**

MATERIAL QUANTITY: **90**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **091**  
MATERIAL DESCRIPTION: **12x12 tan speckled Vft mastic**  
MATERIAL LOCATION: **2nd flr corridor leading to library**  
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **093**  
MATERIAL DESCRIPTION: **9"x9" brown w/white & red streaks floor tile mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **original bldg. Cafeteria snack bar.**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **093**  
MATERIAL DESCRIPTION: **9"x9" brown w/white & red streaks floor tile mastic**  
MATERIAL LOCATION: **original bldg. Cafeteria snack bar.**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **094**  
MATERIAL DESCRIPTION: **12x12 BLACK W/ WHITE STREAKS VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ROOM 106B (new room 142)**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **094**  
MATERIAL DESCRIPTION: **12x12 BLACK W/ WHITE STREAKS VFT**  
MATERIAL LOCATION: **ROOM 106B (new room 142)**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **095**  
MATERIAL DESCRIPTION: **12x12 BLACK W/ WHITE STREAKS VFT-MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ROOM 106B**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **095**  
MATERIAL DESCRIPTION: **12x12 BLACK W/ WHITE STREAKS VFT-MASTIC**  
MATERIAL LOCATION: **ROOM 106B**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **096**  
MATERIAL DESCRIPTION: **12x12 GRAYISH GREEN VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ANNEX: BASEMENT, DRESSING ROOM, CL07, RM 210**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **096**  
MATERIAL DESCRIPTION: **12x12 GRAYISH GREEN VFT**  
MATERIAL LOCATION: **ANNEX: BASEMENT, DRESSING ROOM, CL07, RM 210**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **097**  
MATERIAL DESCRIPTION: **12x12 GRAYISH GREEN VFT-MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ANNEX: BASEMENT, DRESSING ROOM, CL07, RM 210**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **097**  
MATERIAL DESCRIPTION: **12x12 GRAYISH GREEN VFT-MASTIC**  
MATERIAL LOCATION: **ANNEX: BASEMENT, DRESSING ROOM, CL07, RM 210**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **098**  
MATERIAL DESCRIPTION: **12x12 BLUE VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ANNEX: BASEMENT UNDER AUDITORIUM**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **098**  
MATERIAL DESCRIPTION: **12x12 BLUE VFT**  
MATERIAL LOCATION: **ANNEX: BASEMENT UNDER AUDITORIUM**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **099**  
MATERIAL DESCRIPTION: **12x12 BLUE VFT-MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ANNEX: BASEMENT UNDER AUDITORIUM**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **099**  
MATERIAL DESCRIPTION: **12x12 BLUE VFT-MASTIC**  
MATERIAL LOCATION: **ANNEX: BASEMENT UNDER AUDITORIUM**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates  
2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **100**  
MATERIAL DESCRIPTION: **PLASTER CEILING PATCH**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **CONVENT BASEMENT, STUDENT ACTIVITY ROOM**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **100**  
MATERIAL DESCRIPTION: **PLASTER CEILING PATCH**  
MATERIAL LOCATION: **CONVENT BASEMENT, STUDENT ACTIVITY ROOM**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **101**  
MATERIAL DESCRIPTION: **PIPE JOINT COMPOUND**  
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **CONVENT BASEMENT**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **101**  
MATERIAL DESCRIPTION: **PIPE JOINT COMPOUND**  
MATERIAL LOCATION: **CONVENT BASEMENT**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **102**  
MATERIAL DESCRIPTION: **12x12 RED VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ROOM A423 (new room number 420)**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **102**  
MATERIAL DESCRIPTION: **12x12 RED VFT**  
MATERIAL LOCATION: **ROOM A423 (new room number 420)**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 04/18/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **103**  
MATERIAL DESCRIPTION: **12x12 RED VFT-MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ROOM A423 (new room number 420)**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **103**  
MATERIAL DESCRIPTION: **12x12 RED VFT-MASTIC**  
MATERIAL LOCATION: **ROOM A423 (new room number 420)**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **104**  
MATERIAL DESCRIPTION: **12x12 OFF WHITE VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **ROOMS 125, A322, A316, 301, 441, 409, 317, 307, A227 (new room numbers 125, 301, 305, 313, 401, East Corridor)**

MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **104**  
MATERIAL DESCRIPTION: **12x12 OFF WHITE VFT**  
MATERIAL LOCATION: **ROOMS 125, A322, A316, 301, 441, 409, 317, 307, A227 (new room numbers 125, 301, 305, 313, 401, East Corridor)**  
MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 04/18/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **104-M**  
MATERIAL DESCRIPTION: **12x12 OFF WHITE VFT-MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **ROOMS 125, A322, A316, 301, 441, A227 (new room numbers 125, 301, 305, 313, 401, East Corridor)**

MATERIAL QUANTITY: **3900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **104-M**  
MATERIAL DESCRIPTION: **12x12 OFF WHITE VFT-MASTIC**  
MATERIAL LOCATION: **ROOMS 125, A322, A316, 301, 441, A227 (new room numbers 125, 301, 305, 313, 401, East Corridor)**  
MATERIAL QUANTITY: **3900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **105**  
MATERIAL DESCRIPTION: **9x9 GREEN & GRAY CHECKERBOARD W/ BLACK BORDER VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **4TH FLR OF ORIGINAL BLDG, A313, A310, 207, 103 (new room numbers: 121, 207, 125)**

MATERIAL QUANTITY: **5700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **105**  
MATERIAL DESCRIPTION: **9x9 GREEN & GRAY CHECKERBOARD W/ BLACK BORDER VFT**  
MATERIAL LOCATION: **4TH FLR OF ORIGINAL BLDG, A313, A310, 207, 103 (new room numbers: 121, 207, 125)**  
MATERIAL QUANTITY: **5700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 04/18/2013

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **105-M**  
MATERIAL DESCRIPTION: **MASTIC FOR HA #105**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **4TH FLR OF ORIGINAL BLDG, A313, A310, 207, 103 (new room numbers: 121, 207, 125)**  
MATERIAL QUANTITY: **5700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **105-M**  
MATERIAL DESCRIPTION: **MASTIC FOR HA #105**  
MATERIAL LOCATION: **4TH FLR OF ORIGINAL BLDG, A313, A310, 207, 103 (new room numbers: 121, 207, 125)**  
MATERIAL QUANTITY: **5700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **107**  
MATERIAL DESCRIPTION: **PURPLE CARPET MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ROOM A152 (new room number 101)**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **107**  
MATERIAL DESCRIPTION: **PURPLE CARPET MASTIC**  
MATERIAL LOCATION: **ROOM A152 (new room number 101)**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **108**  
MATERIAL DESCRIPTION: **GRAY CARPET MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **ROOMS A141, 155, 144, 146, 148, 147 (new room numbers A141, 101A, 1-7, 105, 103, 109)**

MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **108**  
MATERIAL DESCRIPTION: **GRAY CARPET MASTIC**  
MATERIAL LOCATION: **ROOMS A141, 155, 144, 146, 148, 147 (new room numbers A141, 101A, 1-7, 105, 103, 109)**  
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **109**  
MATERIAL DESCRIPTION: **TAN CARPET MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ROOMS 114, 121 (new room numbers 110, 115)**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **109**  
MATERIAL DESCRIPTION: **TAN CARPET MASTIC**  
MATERIAL LOCATION: **ROOMS 114, 121 (new room numbers 110, 115)**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **110**  
MATERIAL DESCRIPTION: **12x12 WHITE & BLACK CHECKERBOARD VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ROOM 119**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **110**  
MATERIAL DESCRIPTION: **12x12 WHITE & BLACK CHECKERBOARD VFT**  
MATERIAL LOCATION: **ROOM 119**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **111**  
MATERIAL DESCRIPTION: **12x12 WHITE & BLACK CHECKERBOARD VFT-MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ROOM 119**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **111**  
MATERIAL DESCRIPTION: **12x12 WHITE & BLACK CHECKERBOARD VFT-MASTIC**  
MATERIAL LOCATION: **ROOM 119**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **112**  
MATERIAL DESCRIPTION: **12x12 MARBLE LOOKING TAN VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **LOBBY OF AUDITORIUM**

MATERIAL QUANTITY: **1200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **112**  
MATERIAL DESCRIPTION: **12x12 MARBLE LOOKING TAN VFT**  
MATERIAL LOCATION: **LOBBY OF AUDITORIUM**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **113**  
MATERIAL DESCRIPTION: **12x12 MARBLE LOOKING BLACK VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **LOBBY OF AUDITORIUM**

MATERIAL QUANTITY: **1200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **113**  
MATERIAL DESCRIPTION: **12x12 MARBLE LOOKING BLACK VFT**  
MATERIAL LOCATION: **LOBBY OF AUDITORIUM**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **114**  
MATERIAL DESCRIPTION: **MASTIC FOR HA #112 & 113**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **LOBBY OF AUDITORIUM**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **114**  
MATERIAL DESCRIPTION: **MASTIC FOR HA #112 & 113**  
MATERIAL LOCATION: **LOBBY OF AUDITORIUM**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **115**  
MATERIAL DESCRIPTION: **9x9 DARK GREEN VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **AUDITORIUM FLOOR & WALLS & BALCONY**  
MATERIAL QUANTITY: **6250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **115**  
MATERIAL DESCRIPTION: **9x9 DARK GREEN VFT**  
MATERIAL LOCATION: **AUDITORIUM FLOOR & WALLS & BALCONY**  
MATERIAL QUANTITY: **6250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **116**  
MATERIAL DESCRIPTION: **9x9 RED VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **AUDITORIUM FLOOR & WALLS**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **116**  
MATERIAL DESCRIPTION: **9x9 RED VFT**  
MATERIAL LOCATION: **AUDITORIUM FLOOR & WALLS**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **117**  
MATERIAL DESCRIPTION: **MASTIC FOR HA #115 & 116**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **AUDITORIUM FLOOR & WALLS**  
MATERIAL QUANTITY: **8750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **117**  
MATERIAL DESCRIPTION: **MASTIC FOR HA #115 & 116**  
MATERIAL LOCATION: **AUDITORIUM FLOOR & WALLS**  
MATERIAL QUANTITY: **8750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **118**  
MATERIAL DESCRIPTION: **9x9 BROWN & TAN CHECKERBOARD VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **ROOMS 401, 403, C406, C404, C204, C205 (new rm. 415, corridor and Library work and storage rooms)**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **118**  
MATERIAL DESCRIPTION: **9x9 BROWN & TAN CHECKERBOARD VFT**  
MATERIAL LOCATION: **ROOMS 401, 403, C406, C404, C204, C205 (new rm. 415, corridor and Library work and storage rooms)**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 04/18/2013

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **119**  
MATERIAL DESCRIPTION: **9x9 BROWN & TAN CHECKERBOARD VFT-MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **ROOMS 101, C406, C404, C204, C205 (new rm. 415, corridor and Library work and storage rooms)**

MATERIAL QUANTITY: **2500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **119**  
MATERIAL DESCRIPTION: **9x9 BROWN & TAN CHECKERBOARD VFT-MASTIC**  
MATERIAL LOCATION: **ROOMS 101, C406, C404, C204, C205 (new rm. 415, corridor and Library work and storage rooms)**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **120**  
MATERIAL DESCRIPTION: **GRAY CARPET MASTIC**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **ROOM C307 (new room 342)**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **120**  
MATERIAL DESCRIPTION: **GRAY CARPET MASTIC**  
MATERIAL LOCATION: **ROOM C307 (new room 342)**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

## Carnow, Conibear and Associates 2013 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **121**  
MATERIAL DESCRIPTION: **12x12 White w/ Red & Blue Specks FT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Convent Basement**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **121**  
MATERIAL DESCRIPTION: **12x12 White w/ Red & Blue Specks FT**  
MATERIAL LOCATION: **Convent Basement**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **122**  
MATERIAL DESCRIPTION: **12x12 White w/ Red & Blue Specks FT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Convent Basement**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **122**  
MATERIAL DESCRIPTION: **12x12 White w/ Red & Blue Specks FT Mastic**  
MATERIAL LOCATION: **Convent Basement**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **123**  
MATERIAL DESCRIPTION: **12x12 Purple FT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Convent Basement**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **123**  
MATERIAL DESCRIPTION: **12x12 Purple FT**  
MATERIAL LOCATION: **Convent Basement**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **124**  
MATERIAL DESCRIPTION: **12x12 Purple FT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Convent Basement**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **124**  
MATERIAL DESCRIPTION: **12x12 Purple FT Mastic**  
MATERIAL LOCATION: **Convent Basement**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **125**  
MATERIAL DESCRIPTION: **12x12 Light Grey w/ White FT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Room 412, 416**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **125**  
MATERIAL DESCRIPTION: **12x12 Light Grey w/ White FT**  
MATERIAL LOCATION: **Room 412, 416**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **126**  
MATERIAL DESCRIPTION: **12x12 Light Grey w/White FT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Room 412, 416**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **126**  
MATERIAL DESCRIPTION: **12x12 Light Grey w/White FT Mastic**  
MATERIAL LOCATION: **Room 412, 416**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **127**  
MATERIAL DESCRIPTION: **Grey Mix Terrazzo**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Hallways**  
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **127**  
MATERIAL DESCRIPTION: **Grey Mix Terrazzo**  
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Hallways**  
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **128**  
MATERIAL DESCRIPTION: **Green Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Room 310**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **128**  
MATERIAL DESCRIPTION: **Green Carpet Adhesive**  
MATERIAL LOCATION: **Room 310**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **129**  
MATERIAL DESCRIPTION: **Peach Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Room 302, 308, 313, 315**  
MATERIAL QUANTITY: **3400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **129**  
MATERIAL DESCRIPTION: **Peach Linoleum**  
MATERIAL LOCATION: **Room 302, 308, 313, 315**  
MATERIAL QUANTITY: **3400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **130**  
MATERIAL DESCRIPTION: **Peach Linoleum Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Rooms 302, 308, 313, 315**  
MATERIAL QUANTITY: **3400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**



# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **130**  
MATERIAL DESCRIPTION: **Peach Linoleum Adhesive**  
MATERIAL LOCATION: **Rooms 302, 308, 313, 315**  
MATERIAL QUANTITY: **3400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ethan Payne**  
SCHOOL NAME: **Hancock High School** INSPECTION DATE: **3/19/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **131**  
MATERIAL DESCRIPTION: **Brown Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Main Office**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/19/2013**

# Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46021** BUIDLING ID: **1200**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Hancock High School** REVIEW DATE: **4/18/2013**  
ADDRESS: **4034 W. 56th St.** IDPH LICENSE NO: **100-02175**

---

HOMOGENEOUS AREA: **131**  
MATERIAL DESCRIPTION: **Brown Carpet Adhesive**  
MATERIAL LOCATION: **Main Office**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Operations and Maintenance

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/18/2013**

# **Chicago Public Schools**

**Carnow, Conibear and Associates**

***2013 AHERA REINSPECTION***

# APPENDIX B

## Inspector and Management Planner Licenses

---

# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

ETHAN PAYNE

This is to certify that \_\_\_\_\_  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 03/21/2012 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



*Nicholas J. Peneff*

03/21/2012

Course Dates:

03/21/2013

Expires:

1203BIR13

Certificate Number:

Phone Number: (312) 491-0081

Director of Training

Nicholas J. Peneff

Doctor of Public Health

FORM # A-010



Pat Quinn, Governor

525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • [www.idph.state.il.us](http://www.idph.state.il.us)

5/22/2012

ETHAN M PAYNE  
11529 S. PEORIA  
CHICAGO, IL 60643

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 02175

Enclosed is your Asbestos Professional License that expires 05/15/2013

CERTIFICATE EXPIRATION DATE


INSPECTOR

3/21/2013

PROJECT MANAGER  
AIR SAMPLING PROFESSIONAL

~~7/29/2012~~

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.  
Our WEB address is <http://www.idph.state.il.us/envhealth/chhome.htm>

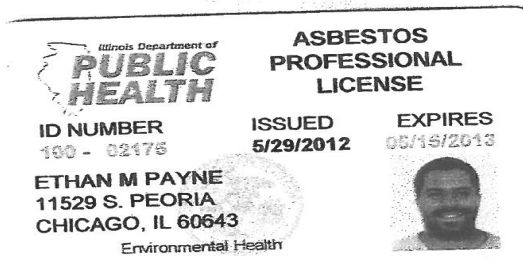



# Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

## Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

# Todd Huffer

**has successfully completed the 4 hour Asbestos Building Inspector Refresher Course** and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042317

Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013


Kathy DeSalvo, Director

# 2012





# Todd Huffer

Illinois Licensed Asbestos Inspector, Management Planner,  
Project Manager, and Air Sampling Professional

 **ASBESTOS  
PROFESSIONAL  
LICENSE**

<b>ID NUMBER</b> <b>100 - 09870</b>	<b>ISSUED</b> <b>4/4/2012</b>	<b>EXPIRES</b> <b>05/15/2013</b>
--	----------------------------------	-------------------------------------

**TODD T HUFFER**  
918 N WOLCOTT UNIT 6  
CHICAGO, IL 60622

   
Environmental Health

<b>ENDORSEMENTS</b>	<b>TC EXPIRES</b>
INSPECTOR	12/8/2012
MANAGEMENT PLANNER	1/19/2013
PROJECT MANAGER	9/8/2012
AIR SAMPLING PROFESSIONAL	

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

**CARNOW  
CONIBEAR**



# Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

## Asbestos Management Planner Refresher

*Occupational Training and Supply, Inc. certifies that*

# Todd Huffer

**has successfully completed the 4 hour Asbestos Management Planner Refresher Course**  
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPRI302250735

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed