

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0533
SCHOOL NAME: Jones Magnet High School
ADDRESS OF SCHOOL: 606 S. State
CITY: Chicago, IL, 60605

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/17/2010**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 3/24/2013 ENROLLMENT 878
IDPH INSPECTOR LICENSE NUMBER: 100-11170
IDPH LICENSED INSPECTOR NAME (Please Print): Jesus Delgado
IDPH MP LICENSE NUMBER: 100-03613
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Ms. Lynn Crivello PHONE: (773) 553-3113



3/24/2013

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Jones Magnet High School

606 S. State
Chicago, IL, 60605

Unit: 47021
Building ID: 1060

IDPH ID Number: 14-016-2990-0533

REPORT DATE:

Sunday, March 24, 2013

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 04, 2013

RE: Jones Magnet High School, Unit 47021
606 S. State
Chicago, IL, 60605

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2013 asbestos three year re-inspection has been completed at Jones Magnet High School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Jones Magnet High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Ms. Lynn Crivello, the designated Local Education Authority's Designated Person at (773) 553-3113 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Jones Magnet High School Unit: 47021 Region: 03
Address: 606 S. State Chicago, IL, 60605
IDPH ID: 14-016-2990-0533 Building ID: 1060
Contact: Casasanto, Daniel Phone:

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: 132300 No of Floors:
Current Occupancy: 878

3. LEA Designated Person


Contact: Ms. Lynn Crivello Phone: (773) 553-3113
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603

4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Jesus Delgado

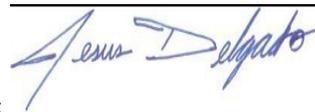


Signature:
Date: 3/4/2013

Inspector IDPH license # 100-11170

6. Management Planner

Management Planner Name: Daniel Juneau

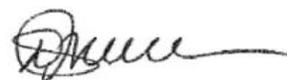

Signature:
Date: 3/24/2013

Management Planner IDPH license # 100-03613

7. Review Date: 3/24/2013

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.



Signature:

Date: 3/24/2013

Name: Ms. Lynn Crivello

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Jones Magnet High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1060:

5E 12" x 12" White & Gray Floor Tile

B. The following new homogenous areas have been identified for Building 1060:

106

Window Expansion Caulk

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

102	12" x 12" Blue and White Tile
102M	12 x 12 Blue & White Tile Mastic
103	Terrazo Floor
104	Ceramic Tile and Grout
104M	Ceramic Tile Mastic
105	12 x 12 White w/ Specs Floor Tile
105M	12 x 12 White w/Specs Floor Tile Mastic
106	Window Expansion Caulk
25	Insulation Inside Fire Doors
26	Vibration Damper
29	Linoleum
30	Linoleum Mastic
31	12" x 12" Brown Floor Tile w/White & Brown Specks
32	12" x 12" Brn Floor Tile w/Wh & Brn Specks Mastic
33	Brown Linoleum
34	Brown Linoleum Adhesive
35	Black Lab Counters and Sinks
36	Black Lab Tables
37	Fume Hood Interior Materials
38	Gray Lab Counters and Sinks
39	Gray Lab Tables
40	12" x 12" White w/Brown Streaks Floor Tile
41	12" x 12" White w/Brown Streaks Floor Tile Mastic
42	12" x 12" Brown Mix Floor Tile
43	12" x 12" Brown Mix Floor Tile Mastic
44	12" x 12" Yellow Mix Floor Tile
45	12" x 12" Yellow Mix Floor Tile Mastic
46	12" x 12" Beige w/Brown Streaks Floor Tile
47	12" x 12" Beige w/Brown Streaks Floor Tile Mastic
48	12" x 12" White w/Medium Brown Specks Floor Tile
49	12" x 12" White w/Medium Brown Specks FT Mastic
50	12" x 12" Brown w/Specs Floor Tile
51	12" x 12" Brown w/Specs Floor Tile Mastic
52	12" x 12" Beige w/Gray Floor Tile
53	12" x 12" Beige w/Gray Floor Tile Mastic
54	12" X 12" Dark Gray w/Light Gray Floor Tile
55	12" X 12" Dark Gray w/Light Gray Floor Tile Mastic
56	12" x 12" White w/Gray Patches Floor Tile
57	12" x 12" White w/Gray Patches Floor Tile Mastic
58	4" Gray Vinyl Baseboard
59	4" Gray Vinyl Baseboard Adhesive
5B	12" x 12" White Floor Tile
5E	12" x 12" White & Gray Floor Tile
60	4" Brown Vinyl Baseboard

61	4" Brown Vinyl Baseboard Adhesive
62	4" Beige Vinyl Baseboard
63	4" Beige Vinyl Baseboard Adhesive
64	4" Yellow Vinyl Baseboard
65	4" Yellow Vinyl Baseboard Adhesive
66	4" Cream Vinyl Baseboard
67	4" Cream Vinyl Baseboard Adhesive
68	4" Gray Vinyl Baseboard
69	4" Gray Vinyl Baseboard Adhesive
70	Marker Board Adhesive
71	Poster Board Adhesive
72	Stair Treads
73	Stair Tread Adhesive
74	2' x 4' Lay-in Ceiling Panels
75	Gray Rubber Flooring Adhesive
76	Gray Carpet Adhesive
77	Brown/Gray Carpet Adhesive
78	Drywall
79	Drywall Compound
80	Chalk Board Adhesive
HA-100	1'x1' grooved splined white Ceiling Tile
HA-101	Gray coating under the Kitchen sink
J	Tank Insulation

The following areas were deemed to be inaccessible:

102M	12 x 12 Blue & White Tile Mastic
103	Terrazo Floor
104M	Ceramic Tile Mastic
105M	12 x 12 White w/Specs Floor Tile Mastic
25	Insulation Inside Fire Doors
26	Vibration Damper
30	Linoleum Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Jesus Delgado, IDPH License # 100-11170. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Jones Magnet High School Building 1060 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Jones Magnet High School Unit 47021 Building ID 1060

Address 606 S. State Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Rooms 604 & 606										
17	Brown Linoleum			Under Lockers on the 1st, 2nd, 3rd, 4th, 5th & 6th Floor & Locker Alcoves 504A & 604A	NO_ACBM	MISC								
18	Brown Linoleum Mastic			Under Lockers on the 1st, 2nd, 3rd, 4th, 5th & 6th Floor & Locker Alcoves 504A & 604A	NO_ACBM	MISC								
19	Drywall			Throughout School	NO_ACBM	MISC								
20	Exterior Brick - Not AHERA			Throughout Exterior of Building	NO_ACBM	MISC								
21	Exterior Brick Mortar - Not AHERA			Exterior of Building	NO_ACBM	MISC								
22	Exterior Joint Compound			Exterior of School	NO_ACBM	MISC								
23	Roof Flashing - Not AHERA			Roof, 6th Floor	CHR	MISC								
24	Roof Core - Not AHERA			Roof Above Rooms 600-608	NO_ACBM	MISC								
25	Insulation Inside Fire Doors	2,750	SF	Throughout School	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	Vibration Damper	100	SF	7th Floor Mechanical Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	Roof Flashing - Not AHERA			Above the 7th Floor	CHR	MISC								
28	Roof Core - Not AHERA			Above the 7th Floor Mechanical Room	NO_ACBM	MISC								
29	Linoleum	4,500	SF	Rooms 601, 604, and 605	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	Linoleum Mastic	4,500	SF	Rooms 600, 601, 608, 604, and 605	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	12" x 12" Brown Floor Tile w/White & Brown Specks			Room 606	ASSUMED	MISC	N							
32	12" x 12" Brn Floor Tile w/Wh & Brn Specks Mastic			Room 606	ASSUMED	MISC	N							
33	Brown Linoleum	5,600	SF	Classrooms 601 - 606	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	Brown Linoleum Adhesive	5,600	SF	Classrooms 601 - 606	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	Black Lab Counters and Sinks	800	SF	Classrooms 603 - 606	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	Black Lab Tables	340	SF	Classrooms 604 - 606	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	Fume Hood Interior Materials	120	SF	Classrooms 601A, 604A, 605A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Jones Magnet High School Unit 47021 Building ID 1060

Address 606 S. State Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
38	Gray Lab Counters and Sinks	480	SF	Classrooms 601 - 602	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	Gray Lab Tables	260	SF	Classrooms 601 - 602	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	12" x 12" White w/Brown Streaks Floor Tile	26,750	SF	Classrooms and Offices 200 - 207, 214A, 214B, 217, 218, 300 - 307, 400 - 407, 500 - 507 and 2, 3, 4, 5, 6,d	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	12" x 12" White w/Brown Streaks Floor Tile Mastic	26,750	SF	Classrooms and Offices 200 - 207, 214A, 214B, 217, 218, 300 - 307, 400 - 407, 500 - 507,1,2, 3, 4, 5, 6	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12" x 12" Brown Mix Floor Tile	5,152	SF	Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401 - 403, 405 - 407, 501 - 507 and 1,2, 3, 4, 5, 6	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	12" x 12" Brown Mix Floor Tile Mastic	5,152	SF	Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401 - 403, 405 - 407, 501 - 507, and 2, 3, 4, 5, 6	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	12" x 12" Yellow Mix Floor Tile	1,500	SF	Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401 - 403, 405 - 407, 501 - 507	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	12" x 12" Yellow Mix Floor Tile Mastic	1,500	SF	Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401 - 403, 405 - 407, 501 - 507	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	12" x 12" Beige w/Brown Streaks Floor Tile	16	SF	221 Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47	12" x 12" Beige w/Brown Streaks Floor Tile Mastic	16	SF	221 Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	12" x 12" White w/Medium Brown Specks Floor Tile	500	SF	AuditoriumExits by stairs,Café,Mgr.Off.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	12" x 12" White w/Medium Brown Specks	500	SF	AuditoriumExits by	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Jones Magnet High School Unit 47021 Building ID 1060

Address 606 S. State Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	FT Mastc			stairs,Cafeteria/Foyer, KitchenCorridor/LwerStairs, Perf.ArtsStairway, Caf�.Mgr.Of f.								potential for damage		
50	12" x 12" Brown w/Specks Floor Tile	2,700	SF	Auditorium and Stage, Kitchen Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51	12" x 12" Brown w/Specks Floor Tile Mastc	2,700	SF	Auditorium and Stage & Kitchen Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	12" x 12" Beige w/Gray Floor Tile	1,200	SF	Corridor to Performing Arts Wing	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	12" x 12" Beige w/Gray Floor Tile Mastc	600	SF	Corridor to Cafeteria, Stair Landings, Corridor to Performing Arts Wing	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54	12" X 12" Dark Gray w/Light Gray Floor Tile	1,150	SF	Engineer's Office, 105I, 105J	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	12" X 12" Dark Gray w/Light Gray Floor Tile Mastc	1,150	SF	Engineer's Office, 105I, 105J	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	12" x 12" White w/Gray Patches Floor Tile	554	SF	As Patches in Cafeteria, Kitchen Storage and Elevators	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
57	12" x 12" White w/Gray Patches Floor Tile Mastc	554	SF	As Patches in Cafeteria, Kitchen Storage and Elevators	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58	4" Gray Vinyl Baseboard	116	LF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
59	4" Gray Vinyl Baseboard Adhesive	116	LF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5A	12"x12" Brown w/Beige Floor Tile	6,600	SF	Performing Arts Foyer, 221 & Office, 224, Lecture Hall & Stage, Theater,	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5B	12" x 12" White Floor Tile			Corridors Throughout	ASSUMED	MISC								
5E	12" x 12" White & Gray Floor Tile	990	SF	Classrooms 600	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
6	9" x 9" Tan Floor Tile			North Stair Landings	CHR	MISC	N							

Chicago Public Schools

School Jones Magnet High School Unit 47021 Building ID 1060

Address 606 S. State Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
60	4" Brown Vinyl Baseboard	68	LF	605A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
61	4" Brown Vinyl Baseboard Adhesive	68	LF	605A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
62	4" Beige Vinyl Baseboard	950	LF	Office Area and Classrooms 600, 604, 604A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	4" Beige Vinyl Baseboard Adhesive	950	LF	Office Area and Classrooms 600, 604, 604A	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
64	4" Yellow Vinyl Baseboard	280	LF	Classrooms 601, 602	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
65	4" Yellow Vinyl Baseboard Adhesive	280	LF	Classrooms 601, 602	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
66	4" Cream Vinyl Baseboard	4,100	LF	Library, Classrooms & Offices 200-207, 214A, 214B, 217, 218, 300-308, 400-403, 405-407, 500-507, 1, 2, 3, 4, 5, 6	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
67	4" Cream Vinyl Baseboard Adhesive	4,100	LF	Library, Classrooms & Offices 200-207, 214A, 214B, 217, 218, 300-308, 400-403, 405-407, 500-507, 1, 2, 3, 4, 5, 6	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
68	4" Gray Vinyl Baseboard	400	LF	2nd-6th Floor Corridors, Classroom 404	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
69	4" Gray Vinyl Baseboard Adhesive	400	LF	2nd-6th Floor Corridors, Classroom 404	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
70	Marker Board Adhesive	1,000	SF	Classrooms 201, 301, 304-308, 401-407, 501-507, 601, 602, 604-606	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
71	Poster Board Adhesive	440	LF	Classrooms 201, 202, 204-207, 307, 308, 604, 605 and the 3rd and 6th Floor Corridors, 601, 602	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
72	Stair Treads	630	SF	Rear Stairway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
73	Stair Tread Adhesive	630	SF	Rear Stairway	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Jones Magnet High School Unit 47021 Building ID 1060

Address 606 S. State Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
74	2' x 4' Lay-in Ceiling Panels	87,000	SF	1st - 6th Floor Classrooms, Library, Offices, Corridors	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
75	Gray Rubber Flooring Adhesive	600	SF	Shipping/Receiving Dock	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
76	Gray Carpet Adhesive	1,144	SF	Classroom 404	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
77	Brown/Gray Carpet Adhesive	7,000	SF	1st Floor Offices, Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
78	Drywall	12,000	SF	1st - 6th Floor Classrooms, Library, Offices, Corridors	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
79	Drywall Compound	12,000	SF	1st - 6th Floor Classrooms, Library, Offices, Corridors	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
80	Chalk Board Adhesive	700	SF	Classrooms 201, 202, 204-207	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
B	Elbows on Fiberglass Pipe Runs	65	LF	7th Floor Mechanical Room	AMO_CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
D	Elbows on Fiberglass Pipe Runs	350	LF	Throughout School	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
E	Breeching Duct Insulation			Boiler Room and Chiller Area	CHR	TSI	Y							
G	Tank Insulation (Tar Paper)			Boiler Room and Chiller Room	CHR	TSI	Y							
H	Pipe Insulation Tar Paper			Boiler Room	NO_ACBM	TSI								
HA-100	1'x1' grooved splined white Ceiling Tile	10,000	SF	Two floors of the building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
HA-101	Gray coating under the Kitchen sink	5	SF	Kitchen and Office Area	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
I	Boiler Gasket Insulation			Boiler Room	NO_ACBM	MISC					No			
J	Tank Insulation	250	SF	Mechanical Area by Kitchen	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Jones Magnet High School Unit 47021 Building ID 1060

Address 606 S. State Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 3/4/2013
Inspector Name Jesus Delgado
100-11170 5/15/2013
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
8B	Material not observed - 2013
8D	Material not observed - 2013
8E	
8F	Material not observed
9	Material not observed
1	
10	Material not observed
102	
102M	
103	
104	
104M	
105	
105M	
106	
11	Material not observed
12	
13	
14	Material not observed
15	Material not observed
16	
17	Material not observed
18	Material not observed
19	

Chicago Public Schools

School Jones Magnet High School Unit 47021 Building ID 1060

Address 606 S. State Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	Material not observed
32	Material not observed
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	

Chicago Public Schools

School Jones Magnet High School Unit 47021 Building ID 1060

Address 606 S. State Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
5A	
5B	Material not observed - 2013
5E	
6	Material not observed
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
70	
71	
72	
73	

Chicago Public Schools

School Jones Magnet High School Unit 47021 Building ID 1060

Address 606 S. State Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
74	
75	
76	
77	
78	
79	
80	
B	
D	
E	Material not observed
G	Material not observed
H	
HA-100	
HA-101	
I	
J	

Table II

Management Planner's Review

Chicago Public Schools

School Jones Magnet High School

Unit 47021

Building ID 1060

Address 606 S. State

Chicago, IL, 60605

Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
8B	12" x 12" White Floor Tile Mastic			1st Floor Corridor & Locker Room, 3rd & 5th Floors Lobby Areas, 304A & 504A (Alcove)	Chrysotile	MISC	No				
8D	12" x 12" Gray w/White Floor Tile Mastic			Classroom 504	Chrysotile	MISC	No				
8E	12"x 12" White w/Gray Floor Tile Mastic	500	SF	Classrooms 600	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
8F	12" x 12" Orange Floor Tile Mastic			Gymnasium	Chrysotile	MISC	No				
9	9" x 9" Tan Floor Tile Mastic			North Stair Landings	Chrysotile	MISC	No				
1	Hard Plaster			3rd Through 5th Floor Corridors	No ACBM	SURFACE					
10	9" x 9" White Floor Tile Mastic			Basement Corridor and Elevator Lobby	Chrysotile	MISC	No				
102	12" x 12" Blue and White Tile	6,400	SF	Kitchen Supply Room, Cafeteria, Stair Landing & Entrance	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
102M	12 x 12 Blue & White Tile Mastic	6,400	Sf	Kitchen Supply Room, Cafeteria, Stairs, Entrance, Stair Landing	Assumed	MISC	No	0	Sf	6 ACBM with the potential for damage	Operations and Maintenance
103	Terrazo Floor	18,500	SF	Throughout Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
104	Ceramic Tile and Grout	3,072	SF	All Bathroom Walls and Floors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
104M	Ceramic Tile Mastic	3,072	SF	All Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
105	12 x 12 White w/ Specs Floor Tile	108	SF	Kitchen Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
105M	12 x 12 White w/Specs Floor Tile Mastic	108	SF	Kitchen Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
106	Window Expansion Caulk	15,000	LF	Throughout Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
11	2' x 4' White (Wormy) Ceiling Tile			Rooms 600, 601, and 606	No ACBM	MISC					
12	Brown Baseboard			Throughout School	No ACBM	MISC					
13	Brown Baseboard Mastic			Throughout Building	No ACBM	MISC					
14	Black Baseboard			Room 403 and 402	No ACBM	MISC					
15	Black Baseboard Mastic			Classrooms 402 & 403	No ACBM	MISC					
16	Carpet Mastic			Faculty Lunchroom, Library Room (500), Rooms 604 & 606	No ACBM	MISC					
17	Brown Linoleum			Under Lockers on the 1st, 2nd, 3rd, 4th, 5th & 6th Floor & Locker Alcoves 504A & 604A	No ACBM	MISC					
18	Brown Linoleum Mastic			Under Lockers on the 1st, 2nd, 3rd, 4th, 5th & 6th Floor & Locker Alcoves 504A & 604A	No ACBM	MISC					
19	Drywall			Throughout School	No ACBM	MISC					
20	Exterior Brick - Not AHERA			Throughout Exterior of Building	No ACBM	MISC					
21	Exterior Brick Mortar - Not AHERA			Exterior of Building	No ACBM	MISC					

Chicago Public Schools

School Jones Magnet High School

Unit 47021

Building ID 1060

Address 606 S. State

Chicago, IL, 60605

Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
22	Exterior Joint Compound			Exterior of School	No ACBM	MISC					
23	Roof Flashing - Not AHERA			Roof, 6th Floor	Chrysotile	MISC					
24	Roof Core - Not AHERA			Roof Above Rooms 600-608	No ACBM	MISC					
25	Insulation Inside Fire Doors	2,750	SF	Throughout School	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
26	Vibration Damper	100	SF	7th Floor Mechanical Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
27	Roof Flashing - Not AHERA			Above the 7th Floor	Chrysotile	MISC					
28	Roof Core - Not AHERA			Above the 7th Floor Mechanical Room	No ACBM	MISC					
29	Linoleum	4,500	SF	Rooms 601, 604, and 605	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
30	Linoleum Mastic	4,500	SF	Rooms 600, 601, 608, 604, and 605	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
31	12" x 12" Brown Floor Tile w/White & Brown Specks			Room 606	Assumed	MISC	No				
32	12" x 12" Brn Floor Tile w/Wh & Brn Specks Mastic			Room 606	Assumed	MISC	No				
33	Brown Linoleum	5,600	SF	Classrooms 601 - 606	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
34	Brown Linoleum Adhesive	5,600	SF	Classrooms 601 - 606	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
35	Black Lab Counters and Sinks	800	SF	Classrooms 603 - 606	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
36	Black Lab Tables	340	SF	Classrooms 604 - 606	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
37	Fume Hood Interior Materials	120	SF	Classrooms 601A, 604A, 605A	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
38	Gray Lab Counters and Sinks	480	SF	Classrooms 601 - 602	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
39	Gray Lab Tables	260	SF	Classrooms 601 - 602	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
40	12" x 12" White w/Brown Streaks Floor Tile	26,750	SF	Classrooms and Offices 200 - 207, 214A, 214B, 217, 218, 300 - 307, 400 - 407, 500 - 507 and 2, 3, 4, 5, 6,d	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
41	12" x 12" White w/Brown Streaks Floor Tile Mastic	26,750	SF	Classrooms and Offices 200 - 207, 214A, 214B, 217, 218, 300 - 307, 400 - 407, 500 - 507,1,2, 3, 4, 5, 6	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
42	12" x 12" Brown Mix Floor Tile	5,152	SF	Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403, 405 - 407, 501 - 507 and 1,2, 3, 4, 5, 6	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
43	12" x 12" Brown Mix Floor Tile Mastic	5,152	SF	Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403, 405 - 407, 501 - 507, and 2, 3, 4, 5, 6	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
44	12" x 12" Yellow Mix Floor Tile	1,500	SF	Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403, 405 - 407, 501 - 507	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
45	12" x 12" Yellow Mix Floor Tile Mastic	1,500	SF	Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403,	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Jones Magnet High School

Unit 47021

Building ID 1060

Address 606 S. State

Chicago, IL, 60605

Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				405 - 407, 501 - 507							
46	12" x 12" Beige w/Brown Streaks Floor Tile	16	SF	221 Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
47	12" x 12" Beige w/Brown Streaks Floor Tile Mastic	16	SF	221 Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
48	12" x 12" White w/Medium Brown Specks Floor Tile	500	SF	AuditoriumExits by stairs,Café.Mgr.Off.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
49	12" x 12" White w/Medium Brown Specks FT Mastic	500	SF	AuditoriumExits by stairs,Cafeteria/Foyer,KitchenCorridor/LwerStairs,Perf.ArtsStairway,Café.Mgr.Off.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
50	12" x 12" Brown w/Specks Floor Tile	2,700	SF	Auditorium and Stage, Kitchen Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
51	12" x 12" Brown w/Specks Floor Tile Mastic	2,700	SF	Auditorium and Stage & Kitchen Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
52	12" x 12" Beige w/Gray Floor Tile	1,200	SF	Corridor to Performing Arts Wing	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
53	12" x 12" Beige w/Gray Floor Tile Mastic	600	SF	Corridor to Cafeteria, Stair Landings, Corridor to Performing Arts Wing	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
54	12" X 12" Dark Gray w/Light Gray Floor Tile	1,150	SF	Engineer's Office, 105I, 105J	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
55	12" X 12" Dark Gray w/Light Gray Floor Tile Mastic	1,150	SF	Engineer's Office, 105I, 105J	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
56	12" x 12" White w/Gray Patches Floor Tile	554	SF	As Patches in Cafeteria, Kitchen Storage and Elevators	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
57	12" x 12" White w/Gray Patches Floor Tile Mastic	554	SF	As Patches in Cafeteria, Kitchen Storage and Elevators	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
58	4" Gray Vinyl Baseboard	116	LF	Engineer's Office	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
59	4" Gray Vinyl Baseboard Adhesive	116	LF	Engineer's Office	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
5A	12"x12" Brown w/Beige Floor Tile	6,600	SF	Performing Arts Foyer, 221 & Office, 224, Lecture Hall & Stage, Theater,	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
5B	12" x 12" White Floor Tile			Corridors Throughout	Assumed	MISC					
5E	12" x 12" White & Gray Floor Tile	990	SF	Classrooms 600	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
6	9" x 9" Tan Floor Tile			North Stair Landings	Chrysotile	MISC	No				
60	4" Brown Vinyl Baseboard	68	LF	605A	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
61	4" Brown Vinyl Baseboard Adhesive	68	LF	605A	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
62	4" Beige Vinyl Baseboard	950	LF	Office Area and Classrooms 600, 604, 604A	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
63	4" Beige Vinyl Baseboard Adhesive	950	LF	Office Area and Classrooms 600, 604, 604A	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
64	4" Yellow Vinyl Baseboard	280	LF	Classrooms 601, 602	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
65	4" Yellow Vinyl Baseboard Adhesive	280	LF	Classrooms 601, 602	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
66	4" Cream Vinyl Baseboard	4,100	LF	Library, Classrooms & Offices 200-207,	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Jones Magnet High School

Unit 47021

Building ID 1060

Address 606 S. State

Chicago, IL, 60605

Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				214A, 214B, 217, 218, 300-308, 400-403, 405-407, 500-507, 1, 2, 3, 4, 5, 6							
67	4" Cream Vinyl Baseboard Adhesive	4,100	LF	Library, Classrooms & Offices 200-207, 214A, 214B, 217, 218, 300-308, 400-403, 405-407, 500-507, 1, 2, 3, 4, 5, 6	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
68	4" Gray Vinyl Baseboard	400	LF	2nd-6th Floor Corridors, Classroom 404	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
69	4" Gray Vinyl Baseboard Adhesive	400	LF	2nd-6th Floor Corridors, Classroom 404	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
70	Marker Board Adhesive	1,000	SF	Classrooms 201, 301, 304-308, 401-407, 501-507, 601, 602, 604-606	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
71	Poster Board Adhesive	440	LF	Classrooms 201, 202, 204-207, 307, 308, 604, 605 and the 3rd and 6th Floor Corridors, 601, 602	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
72	Stair Treads	630	SF	Rear Stairway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
73	Stair Tread Adhesive	630	SF	Rear Stairway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
74	2' x 4' Lay-in Ceiling Panels	87,000	SF	1st - 6th Floor Classrooms, Library, Offices, Corridors	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
75	Gray Rubber Flooring Adhesive	600	SF	Shipping/Receiving Dock	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
76	Gray Carpet Adhesive	1,144	SF	Classroom 404	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
77	Brown/Gray Carpet Adhesive	7,000	SF	1st Floor Offices, Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
78	Drywall	12,000	SF	1st - 6th Floor Classrooms, Library, Offices, Corridors	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
79	Drywall Compound	12,000	SF	1st - 6th Floor Classrooms, Library, Offices, Corridors	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
80	Chalk Board Adhesive	700	SF	Classrooms 201, 202, 204-207	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
B	Elbows on Fiberglass Pipe Runs	65	LF	7th Floor Mechanical Room	Amosite, Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Operations and Maintenance
D	Elbows on Fiberglass Pipe Runs	350	LF	Throughout School	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Repair
E	Breeching Duct Insulation			Boiler Room and Chiller Area	Chrysotile	TSI	Yes				
G	Tank Insulation (Tar Paper)			Boiler Room and Chiller Room	Chrysotile	TSI	Yes				
H	Pipe Insulation Tar Paper			Boiler Room	No ACBM	TSI					
HA-100	1'x1' grooved splined white Ceiling Tile	10,000	SF	Two floors of the building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
HA-101	Gray coating under the Kitchen sink	5	SF	Kitchen and Office Area	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Operations and Maintenance
I	Boiler Gasket Insulation			Boiler Room	No ACBM	MISC					
J	Tank Insulation	250	SF	Mechanical Area by Kitchen	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Operations and Maintenance

Chicago Public Schools

School Jones Magnet High School
Address 606 S. State

Unit 47021
 Chicago, IL, 60605

Building ID 1060
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	3/24/2013
Manager Planner Name	Daniel Juneau
100-03613	5/15/2014
Manager IDPH License No/Expiration	

HA Number	Management Comments
8B	Material not observed - 2013 Re-Inspection
8D	Material not observed - 2013 Re-Inspection
8E	
8F	Material not observed - 2013 Re-Inspection
9	Material not observed - 2013 Re-Inspection
1	
10	Material not observed - 2013 Re-Inspection

Chicago Public Schools

School Jones Magnet High School

Unit 47021

Building ID 1060

Address 606 S. State

Chicago, IL, 60605

Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
102	
102M	
103	
104	
104M	
105	
105M	
106	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	

Chicago Public Schools

School Jones Magnet High School

Unit 47021

Building ID 1060

Address 606 S. State

Chicago, IL, 60605

Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
30	
31	Material not observed - 2013 Re-Inspection
32	Material not observed - 2013 Re-Inspection
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	

Chicago Public Schools

School Jones Magnet High School

Unit 47021

Building ID 1060

Address 606 S. State

Chicago, IL, 60605

Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
57	
58	
59	
5A	
5B	Material not observed - 2013 Re-Inspection
5E	
6	Material not observed - 2013 Re-Inspection
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	

Chicago Public Schools

School Jones Magnet High School
Address 606 S. State

Unit 47021
Chicago, IL, 60605

Building ID 1060
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
80	
B	
D	REpair damaged insulation in salient locations and continue O&M
E	Material not observed - 2013 Re-Inspection
G	Material not observed - 2013 Re-Inspection
H	
HA-100	
HA-101	
I	
J	

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8B**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor & Locker Room, 3rd & 5th Floors Lobby Areas, 304A & 504A (Alcove)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **8B**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Corridor & Locker Room, 3rd & 5th Floors Lobby Areas, 304A & 504A (Alcove)**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed - 2013 Re-Inspection

Management Planner's Signature: _____

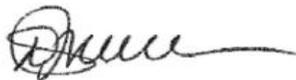

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8D**
MATERIAL DESCRIPTION: **12" x 12" Gray w/White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Classroom 504**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **8D**
MATERIAL DESCRIPTION: **12" x 12" Gray w/White Floor Tile Mastic**
MATERIAL LOCATION: **Classroom 504**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed - 2013 Re-Inspection

Management Planner's Signature: _____

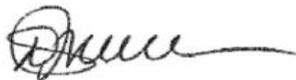

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8E**
MATERIAL DESCRIPTION: **12"x 12" White w/Gray Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms 600**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **8E**
MATERIAL DESCRIPTION: **12"x 12" White w/Gray Floor Tile Mastic**
MATERIAL LOCATION: **Classrooms 600**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

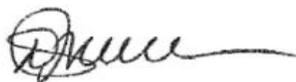

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8F**
MATERIAL DESCRIPTION: **12" x 12" Orange Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Gymnasium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **8F**
MATERIAL DESCRIPTION: **12" x 12" Orange Floor Tile Mastic**
MATERIAL LOCATION: **Gymnasium**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed - 2013 Re-Inspection

Management Planner's Signature: _____

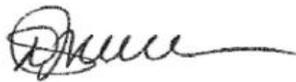

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **North Stair Landings**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile Mastic**
MATERIAL LOCATION: **North Stair Landings**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed - 2013 Re-Inspection

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **Hard Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd Through 5th Floor Corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **1**

MATERIAL DESCRIPTION: **Hard Plaster**

MATERIAL LOCATION: **3rd Through 5th Floor Corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **9" x 9" White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement Corridor and Elevator Lobby**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **9" x 9" White Floor Tile Mastic**
MATERIAL LOCATION: **Basement Corridor and Elevator Lobby**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed - 2013 Re-Inspection

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **102**
MATERIAL DESCRIPTION: **12" x 12" Blue and White Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen Supply Room, Cafeteria, Stair Landing & Entrance**

MATERIAL QUANTITY: **6400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **102**
MATERIAL DESCRIPTION: **12" x 12" Blue and White Tile**
MATERIAL LOCATION: **Kitchen Supply Room, Cafeteria, Stair Landing & Entrance**
MATERIAL QUANTITY: **6400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **102M**
MATERIAL DESCRIPTION: **12 x 12 Blue & White Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen Supply Room, Cafeteria, Stairs, Entrance, Stair Landing**

MATERIAL QUANTITY: **6400** MATERIAL UNITS: **Sf**

DAMAGE QUANTITY: DAMAGE UNITS: **Sf**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **102M**
MATERIAL DESCRIPTION: **12 x 12 Blue & White Tile Mastic**
MATERIAL LOCATION: **Kitchen Supply Room, Cafeteria, Stairs, Entrance, Stair Landing**
MATERIAL QUANTITY: **6400** MATERIAL UNITS: **Sf**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **Sf**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

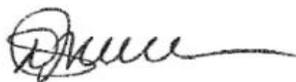

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **103**
MATERIAL DESCRIPTION: **Terrazo Floor**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **18500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **103**
MATERIAL DESCRIPTION: **Terrazo Floor**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **18500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **Ceramic Tile and Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Bathroom Walls and Floors**
MATERIAL QUANTITY: **3072** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **Ceramic Tile and Grout**
MATERIAL LOCATION: **All Bathroom Walls and Floors**
MATERIAL QUANTITY: **3072** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **104M**
MATERIAL DESCRIPTION: **Ceramic Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Bathrooms**
MATERIAL QUANTITY: **3072** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **104M**
MATERIAL DESCRIPTION: **Ceramic Tile Mastic**
MATERIAL LOCATION: **All Bathrooms**
MATERIAL QUANTITY: **3072** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

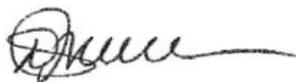

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **12 x 12 White w/ Specs Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen Storage**
MATERIAL QUANTITY: **108** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **12 x 12 White w/ Specs Floor Tile**
MATERIAL LOCATION: **Kitchen Storage**
MATERIAL QUANTITY: **108** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **105M**
MATERIAL DESCRIPTION: **12 x 12 White w/Specs Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen Storage**

MATERIAL QUANTITY: **108**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **105M**
MATERIAL DESCRIPTION: **12 x 12 White w/Specs Floor Tile Mastic**
MATERIAL LOCATION: **Kitchen Storage**
MATERIAL QUANTITY: **108** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

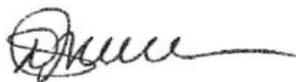

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **2' x 4' White (Wormy) Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 600, 601, and 606**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **2' x 4' White (Wormy) Ceiling Tile**
MATERIAL LOCATION: **Rooms 600, 601, and 606**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Brown Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout School**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **Brown Baseboard**

MATERIAL LOCATION: **Throughout School**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Brown Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Brown Baseboard Mastic**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Black Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 403 and 402**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Black Baseboard**
MATERIAL LOCATION: **Room 403 and 402**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Black Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Classrooms 402 & 403**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Black Baseboard Mastic**
MATERIAL LOCATION: **Classrooms 402 & 403**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

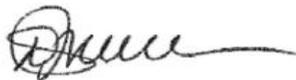

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Faculty Lunchroom, Library Room (500), Rooms 604 & 606**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Faculty Lunchroom, Library Room (500), Rooms 604 & 606**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Brown Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Under Lockers on the 1st, 2nd, 3rd, 4th, 5th & 6th Floor & Locker Alcoves 504A & 604A**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Brown Linoleum**
MATERIAL LOCATION: **Under Lockers on the 1st, 2nd, 3rd, 4th, 5th & 6th Floor & Locker Alcoves 504A & 604A**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

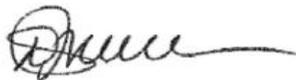

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Brown Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Under Lockers on the 1st, 2nd, 3rd, 4th, 5th & 6th Floor & Locker Alcoves 504A & 604A**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:

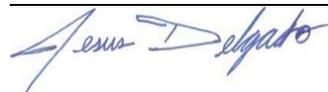

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Brown Linoleum Mastic**
MATERIAL LOCATION: **Under Lockers on the 1st, 2nd, 3rd, 4th, 5th & 6th Floor & Locker Alcoves 504A & 604A**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout School**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Throughout School**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Exterior Brick - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Exterior of Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Exterior Brick - Not AHERA**

MATERIAL LOCATION: **Throughout Exterior of Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Exterior Brick Mortar - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Exterior Brick Mortar - Not AHERA**
MATERIAL LOCATION: **Exterior of Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Exterior Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of School**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **Exterior Joint Compound**

MATERIAL LOCATION: **Exterior of School**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Roof Flashing - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof, 6th Floor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **Roof Flashing - Not AHERA**

MATERIAL LOCATION: **Roof, 6th Floor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Roof Core - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof Above Rooms 600-608**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **Roof Core - Not AHERA**

MATERIAL LOCATION: **Roof Above Rooms 600-608**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Insulation Inside Fire Doors**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout School**
MATERIAL QUANTITY: **2750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Insulation Inside Fire Doors**
MATERIAL LOCATION: **Throughout School**
MATERIAL QUANTITY: **2750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Vibration Damper**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **7th Floor Mechanical Room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Vibration Damper**
MATERIAL LOCATION: **7th Floor Mechanical Room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

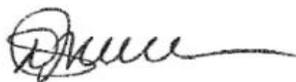

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Roof Flashing - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Above the 7th Floor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **27**

MATERIAL DESCRIPTION: **Roof Flashing - Not AHERA**

MATERIAL LOCATION: **Above the 7th Floor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Roof Core - Not AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Above the 7th Floor Mechanical Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Roof Core - Not AHERA**

MATERIAL LOCATION: **Above the 7th Floor Mechanical Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 601, 604, and 605**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Linoleum**
MATERIAL LOCATION: **Rooms 601, 604, and 605**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

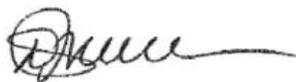

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 600, 601, 608, 604, and 605**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Linoleum Mastic**
MATERIAL LOCATION: **Rooms 600, 601, 608, 604, and 605**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

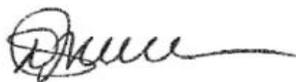

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/White & Brown Specks**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 606**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile w/White & Brown Specks**
MATERIAL LOCATION: **Room 606**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed - 2013 Re-Inspection

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12" x 12" Brn Floor Tile w/Wh & Brn Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 606**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **12" x 12" Brn Floor Tile w/Wh & Brn Specks Mastic**
MATERIAL LOCATION: **Room 606**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed - 2013 Re-Inspection

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Brown Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms 601 - 606**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Brown Linoleum**
MATERIAL LOCATION: **Classrooms 601 - 606**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Brown Linoleum Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms 601 - 606**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Brown Linoleum Adhesive**
MATERIAL LOCATION: **Classrooms 601 - 606**
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

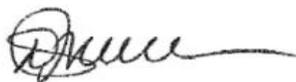

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Black Lab Counters and Sinks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms 603 - 606**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Black Lab Counters and Sinks**
MATERIAL LOCATION: **Classrooms 603 - 606**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

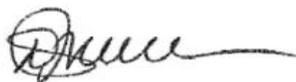

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Black Lab Tables**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms 604 - 606**

MATERIAL QUANTITY: **340**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

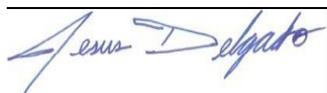

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Black Lab Tables**
MATERIAL LOCATION: **Classrooms 604 - 606**
MATERIAL QUANTITY: **340** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Fume Hood Interior Materials**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms 601A, 604A, 605A**

MATERIAL QUANTITY: **120**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

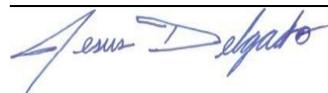

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Fume Hood Interior Materials**
MATERIAL LOCATION: **Classrooms 601A, 604A, 605A**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Gray Lab Counters and Sinks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms 601 - 602**
MATERIAL QUANTITY: **480** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Gray Lab Counters and Sinks**
MATERIAL LOCATION: **Classrooms 601 - 602**
MATERIAL QUANTITY: **480** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Gray Lab Tables**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms 601 - 602**
MATERIAL QUANTITY: **260** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Gray Lab Tables**
MATERIAL LOCATION: **Classrooms 601 - 602**
MATERIAL QUANTITY: **260** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **12" x 12" White w/Brown Streaks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms and Offices 200 - 207, 214A, 214B, 217, 218, 300 - 307, 400 - 407, 500 - 507 and 2, 3, 4, 5, 6,d**

MATERIAL QUANTITY: **26750**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

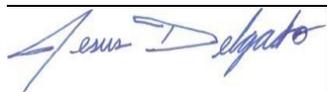

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **12" x 12" White w/Brown Streaks Floor Tile**
MATERIAL LOCATION: **Classrooms and Offices 200 - 207, 214A, 214B, 217, 218, 300 - 307, 400 - 407, 500 - 507 and 2, 3, 4, 5, 6,d**
MATERIAL QUANTITY: **26750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12" x 12" White w/Brown Streaks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms and Offices 200 - 207, 214A, 214B, 217, 218, 300 - 307, 400 - 407, 500 - 507, 1, 2, 3, 4, 5, 6**

MATERIAL QUANTITY: **26750**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12" x 12" White w/Brown Streaks Floor Tile Mastic**
MATERIAL LOCATION: **Classrooms and Offices 200 - 207, 214A, 214B, 217, 218, 300 - 307, 400 - 407, 500 - 507, 1, 2, 3, 4, 5, 6**
MATERIAL QUANTITY: **26750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12" x 12" Brown Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403, 405 - 407, 501 - 507 and 1,2, 3, 4, 5, 6**

MATERIAL QUANTITY: **5152**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12" x 12" Brown Mix Floor Tile**
MATERIAL LOCATION: **Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403, 405 - 407, 501 - 507 and 1,2, 3, 4, 5, 6**
MATERIAL QUANTITY: **5152** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12" x 12" Brown Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403, 405 - 407, 501 - 507, and 2, 3, 4, 5, 6**

MATERIAL QUANTITY: **5152**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **12" x 12" Brown Mix Floor Tile Mastic**
MATERIAL LOCATION: **Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403, 405 - 407, 501 - 507, and 2, 3, 4, 5, 6**
MATERIAL QUANTITY: **5152** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12" x 12" Yellow Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403, 405 - 407, 501 - 507**

MATERIAL QUANTITY: **1500**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

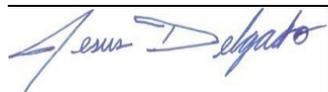

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **12" x 12" Yellow Mix Floor Tile**
MATERIAL LOCATION: **Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403, 405 - 407, 501 - 507**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

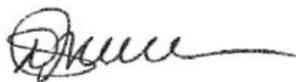

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12" x 12" Yellow Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403, 405 - 407, 501 - 507**

MATERIAL QUANTITY: **1500**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

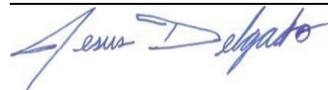

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **12" x 12" Yellow Mix Floor Tile Mastic**
MATERIAL LOCATION: **Classrooms and Offices 201 - 202, 204 - 207, 302 - 303, 304 - 307, 401- 403, 405 - 407, 501 - 507**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12" x 12" Beige w/Brown Streaks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **221 Office**
MATERIAL QUANTITY: **16** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

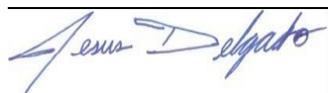

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **46**
MATERIAL DESCRIPTION: **12" x 12" Beige w/Brown Streaks Floor Tile**
MATERIAL LOCATION: **221 Office**
MATERIAL QUANTITY: **16** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

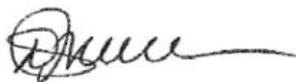

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **12" x 12" Beige w/Brown Streaks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **221 Office**
MATERIAL QUANTITY: **16** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **47**
MATERIAL DESCRIPTION: **12" x 12" Beige w/Brown Streaks Floor Tile Mastic**
MATERIAL LOCATION: **221 Office**
MATERIAL QUANTITY: **16** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

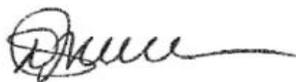

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **12" x 12" White w/Medium Brown Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Auditorium Exits by stairs, Café, Mgr. Off.**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **12" x 12" White w/Medium Brown Specks Floor Tile**
MATERIAL LOCATION: **Auditorium Exits by stairs, Café, Mgr. Off.**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

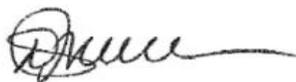

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **12" x 12" White w/Medium Brown Specks FT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Auditorium Exits by stairs, Cafeteria/Foyer, Kitchen Corridor/Lwer Stairs, Perf. Arts Stairway, Café.Mgr. Off.**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

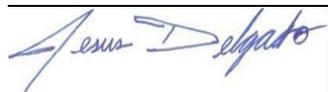

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **12" x 12" White w/Medium Brown Specks FT Mastic**
MATERIAL LOCATION: **Auditorium Exits by stairs, Cafeteria/Foyer, Kitchen Corridor/Lwer Stairs, Perf. Arts Stairway, Café.Mgr.Off.**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12" x 12" Brown w/Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Auditorium and Stage, Kitchen Office**
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12" x 12" Brown w/Specks Floor Tile**
MATERIAL LOCATION: **Auditorium and Stage, Kitchen Office**
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

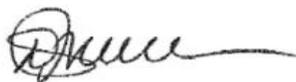

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12" x 12" Brown w/Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Auditorium and Stage & Kitchen Office**

MATERIAL QUANTITY: **2700**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **12" x 12" Brown w/Specks Floor Tile Mastic**
MATERIAL LOCATION: **Auditorium and Stage & Kitchen Office**
MATERIAL QUANTITY: **2700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12" x 12" Beige w/Gray Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Corridor to Performing Arts Wing**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **12" x 12" Beige w/Gray Floor Tile**
MATERIAL LOCATION: **Corridor to Performing Arts Wing**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

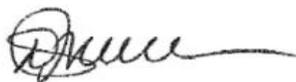

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12" x 12" Beige w/Gray Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Corridor to Cafeteria, Stair Landings, Corridor to Performing Arts Wing**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **12" x 12" Beige w/Gray Floor Tile Mastic**
MATERIAL LOCATION: **Corridor to Cafeteria, Stair Landings, Corridor to Performing Arts Wing**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

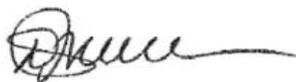

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12" X 12" Dark Gray w/Light Gray Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Engineer's Office, 105I, 105J**

MATERIAL QUANTITY: **1150**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **12" X 12" Dark Gray w/Light Gray Floor Tile**
MATERIAL LOCATION: **Engineer's Office, 105I, 105J**
MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12" X 12" Dark Gray w/Light Gray Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Engineer's Office, 105I, 105J**

MATERIAL QUANTITY: **1150**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **12" X 12" Dark Gray w/Light Gray Floor Tile Mastic**
MATERIAL LOCATION: **Engineer's Office, 105I, 105J**
MATERIAL QUANTITY: **1150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

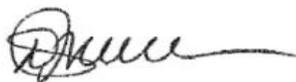

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **12" x 12" White w/Gray Patches Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **As Patches in Cafeteria, Kitchen Storage and Elevators**

MATERIAL QUANTITY: **554** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **12" x 12" White w/Gray Patches Floor Tile**
MATERIAL LOCATION: **As Patches in Cafeteria, Kitchen Storage and Elevators**
MATERIAL QUANTITY: **554** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

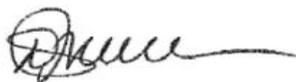

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **12" x 12" White w/Gray Patches Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **As Patches in Cafeteria, Kitchen Storage and Elevators**

MATERIAL QUANTITY: **554** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

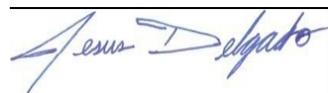

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **12" x 12" White w/Gray Patches Floor Tile Mastic**
MATERIAL LOCATION: **As Patches in Cafeteria, Kitchen Storage and Elevators**
MATERIAL QUANTITY: **554** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY: **116**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **116** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **116** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard Adhesive**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **116** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

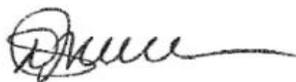

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5A**
MATERIAL DESCRIPTION: **12"x12" Brown w/Beige Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Performing Arts Foyer, 221 & Office, 224, Lecture Hall & Stage, Theater,**

MATERIAL QUANTITY: **6600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **5A**
MATERIAL DESCRIPTION: **12"x12" Brown w/Beige Floor Tile**
MATERIAL LOCATION: **Performing Arts Foyer, 221 & Office, 224, Lecture Hall & Stage, Theater,**
MATERIAL QUANTITY: **6600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5B**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Corridors Throughout**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed - 2013**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **5B**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**
MATERIAL LOCATION: **Corridors Throughout**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed - 2013 Re-Inspection

Management Planner's Signature: _____

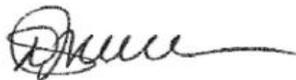

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5E**
MATERIAL DESCRIPTION: **12" x 12" White & Gray Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms 600**
MATERIAL QUANTITY: **990** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**


HOMOGENEOUS AREA: **5E**
MATERIAL DESCRIPTION: **12" x 12" White & Gray Floor Tile**
MATERIAL LOCATION: **Classrooms 600**
MATERIAL QUANTITY: **990** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

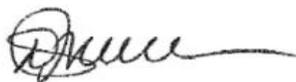

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **North Stair Landings**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **9" x 9" Tan Floor Tile**
MATERIAL LOCATION: **North Stair Landings**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed - 2013 Re-Inspection

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **605A**
MATERIAL QUANTITY: **68** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard**
MATERIAL LOCATION: **605A**
MATERIAL QUANTITY: **68** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **605A**
MATERIAL QUANTITY: **68** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **4" Brown Vinyl Baseboard Adhesive**
MATERIAL LOCATION: **605A**
MATERIAL QUANTITY: **68** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

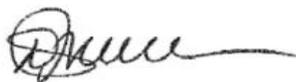

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **4" Beige Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Office Area and Classrooms 600, 604, 604A**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **4" Beige Vinyl Baseboard**
MATERIAL LOCATION: **Office Area and Classrooms 600, 604, 604A**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

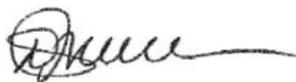

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **4" Beige Vinyl Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Office Area and Classrooms 600, 604, 604A**

MATERIAL QUANTITY: **950**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **4" Beige Vinyl Baseboard Adhesive**
MATERIAL LOCATION: **Office Area and Classrooms 600, 604, 604A**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **4" Yellow Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms 601, 602**
MATERIAL QUANTITY: **280** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

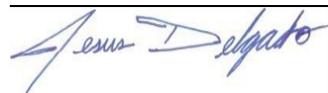

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **4" Yellow Vinyl Baseboard**
MATERIAL LOCATION: **Classrooms 601, 602**
MATERIAL QUANTITY: **280** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **4" Yellow Vinyl Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms 601, 602**

MATERIAL QUANTITY: **280**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **4" Yellow Vinyl Baseboard Adhesive**
MATERIAL LOCATION: **Classrooms 601, 602**
MATERIAL QUANTITY: **280** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

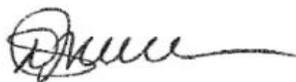

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **4" Cream Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Library, Classrooms & Offices 200-207, 214A, 214B, 217, 218, 300-308, 400-403, 405-407, 500-507, 1, 2, 3, 4, 5 ,6**

MATERIAL QUANTITY: **4100**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

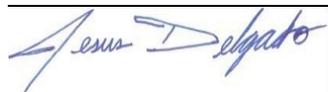

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **4" Cream Vinyl Baseboard**
MATERIAL LOCATION: **Library, Classrooms & Offices 200-207, 214A, 214B, 217, 218, 300-308, 400-403, 405-407, 500-507, 1, 2, 3, 4, 5, 6**
MATERIAL QUANTITY: **4100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **4" Cream Vinyl Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Library, Classrooms & Offices 200-207, 214A, 214B, 217, 218, 300-308, 400-403, 405-407, 500-507, 1, 2, 3, 4, 5 ,6**

MATERIAL QUANTITY: **4100**


MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

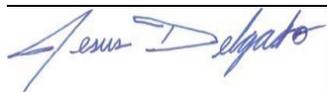

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **4" Cream Vinyl Baseboard Adhesive**
MATERIAL LOCATION: **Library, Classrooms & Offices 200-207, 214A, 214B, 217, 218, 300-308, 400-403, 405-407, 500-507, 1, 2, 3, 4, 5, 6**
MATERIAL QUANTITY: **4100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd-6th Floor Corridors, Classroom 404**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard**
MATERIAL LOCATION: **2nd-6th Floor Corridors, Classroom 404**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

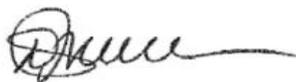

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd-6th Floor Corridors, Classroom 404**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **4" Gray Vinyl Baseboard Adhesive**
MATERIAL LOCATION: **2nd-6th Floor Corridors, Classroom 404**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

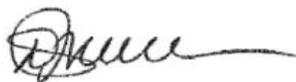

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **70**
MATERIAL DESCRIPTION: **Marker Board Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms 201, 301, 304-308, 401-407, 501-507, 601, 602, 604-606**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **70**
MATERIAL DESCRIPTION: **Marker Board Adhesive**
MATERIAL LOCATION: **Classrooms 201, 301, 304-308, 401-407, 501-507, 601, 602, 604-606**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

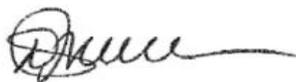

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **71**
MATERIAL DESCRIPTION: **Poster Board Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Classrooms 201, 202, 204-207, 307, 308, 604, 605 and the 3rd and 6th Floor Corridors, 601, 602**

MATERIAL QUANTITY: **440** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:

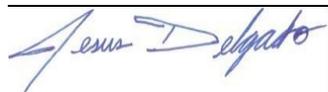

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **71**
MATERIAL DESCRIPTION: **Poster Board Adhesive**
MATERIAL LOCATION: **Classrooms 201, 202, 204-207, 307, 308, 604, 605 and the 3rd and 6th Floor Corridors, 601, 602**
MATERIAL QUANTITY: **440** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

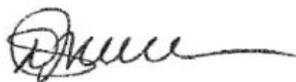

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **Stair Treads**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rear Stairway**
MATERIAL QUANTITY: **630** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

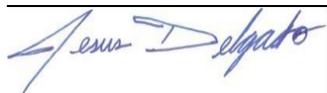

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **Stair Treads**
MATERIAL LOCATION: **Rear Stairway**
MATERIAL QUANTITY: **630** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **Stair Tread Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rear Stairway**
MATERIAL QUANTITY: **630** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

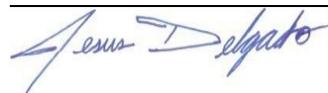

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **Stair Tread Adhesive**
MATERIAL LOCATION: **Rear Stairway**
MATERIAL QUANTITY: **630** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

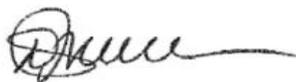

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **74**
MATERIAL DESCRIPTION: **2' x 4' Lay-in Ceiling Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st - 6th Floor Classrooms, Library, Offices, Corridors**
MATERIAL QUANTITY: **87000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **74**
MATERIAL DESCRIPTION: **2' x 4' Lay-in Ceiling Panels**
MATERIAL LOCATION: **1st - 6th Floor Classrooms, Library, Offices, Corridors**
MATERIAL QUANTITY: **87000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

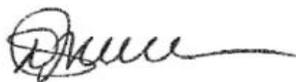

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **75**
MATERIAL DESCRIPTION: **Gray Rubber Flooring Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Shipping/Receiving Dock**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **75**
MATERIAL DESCRIPTION: **Gray Rubber Flooring Adhesive**
MATERIAL LOCATION: **Shipping/Receiving Dock**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

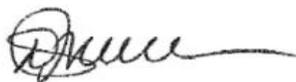

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **Gray Carpet Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classroom 404**
MATERIAL QUANTITY: **1144** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **Gray Carpet Adhesive**
MATERIAL LOCATION: **Classroom 404**
MATERIAL QUANTITY: **1144** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **Brown/Gray Carpet Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Offices, Library**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **Brown/Gray Carpet Adhesive**
MATERIAL LOCATION: **1st Floor Offices, Library**
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st - 6th Floor Classrooms, Library, Offices, Corridors**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **1st - 6th Floor Classrooms, Library, Offices, Corridors**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **Drywall Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st - 6th Floor Classrooms, Library, Offices, Corridors**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **Drywall Compound**
MATERIAL LOCATION: **1st - 6th Floor Classrooms, Library, Offices, Corridors**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

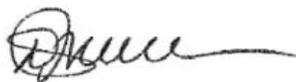

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **Chalk Board Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms 201, 202, 204-207**

MATERIAL QUANTITY: **700**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **Chalk Board Adhesive**
MATERIAL LOCATION: **Classrooms 201, 202, 204-207**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Elbows on Fiberglass Pipe Runs**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Amosite, Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **7th Floor Mechanical Room**

MATERIAL QUANTITY: **65**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Elbows on Fiberglass Pipe Runs**
MATERIAL LOCATION: **7th Floor Mechanical Room**
MATERIAL QUANTITY: **65** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

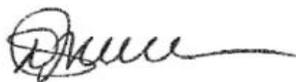

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates
2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Elbows on Fiberglass Pipe Runs**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout School**

MATERIAL QUANTITY: **350**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Elbows on Fiberglass Pipe Runs**
MATERIAL LOCATION: **Throughout School**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

REpair damaged insulation in salient locations and continue O&M

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Breeching Duct Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room and Chiller Area**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Breeching Duct Insulation**
MATERIAL LOCATION: **Boiler Room and Chiller Area**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed - 2013 Re-Inspection

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates 2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Tank Insulation (Tar Paper)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room and Chiller Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Material not observed**

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Tank Insulation (Tar Paper)**
MATERIAL LOCATION: **Boiler Room and Chiller Room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Material not observed - 2013 Re-Inspection

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Pipe Insulation Tar Paper**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Pipe Insulation Tar Paper**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-100**
MATERIAL DESCRIPTION: **1'x1' grooved splined white Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Two floors of the building**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **HA-100**
MATERIAL DESCRIPTION: **1'x1' grooved splined white Ceiling Tile**
MATERIAL LOCATION: **Two floors of the building**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

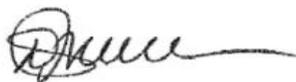

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **HA-101**
MATERIAL DESCRIPTION: **Gray coating inder the Kitchen sink**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen and Office Area**

MATERIAL QUANTITY: **5**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **HA-101**
MATERIAL DESCRIPTION: **Gray coating inder the Kitchen sink**
MATERIAL LOCATION: **Kitchen and Office Area**
MATERIAL QUANTITY: **5** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Boiler Gasket Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **Boiler Gasket Insulation**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Operations and Maintenance**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.


The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Mechanical Area by Kitchen**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:

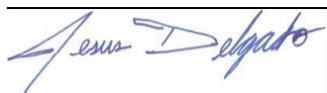

Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUIDLING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Tank Insulation**
MATERIAL LOCATION: **Mechanical Area by Kitchen**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Operations and Maintenance

Comments:

Management Planner's Signature: _____

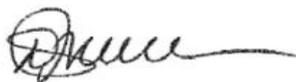

Date: **03/24/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Jesus Delgado**
SCHOOL NAME: **Jones Magnet High School** INSPECTION DATE: **3/4/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **Window Expansion Caulk**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **LF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:



Date: **03/04/2013**

Chicago Public Schools

Carnow, Conibear and Associates

2013 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **47021** BUILDING ID: **1060**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Jones Magnet High School** REVIEW DATE: **3/24/2013**
ADDRESS: **606 S. State** IDPH LICENSE NO: **100-11170**

HOMOGENEOUS AREA: **106**

MATERIAL DESCRIPTION: **Window Expansion Caulk**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: **15000**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

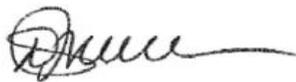


Date: **03/24/2013**

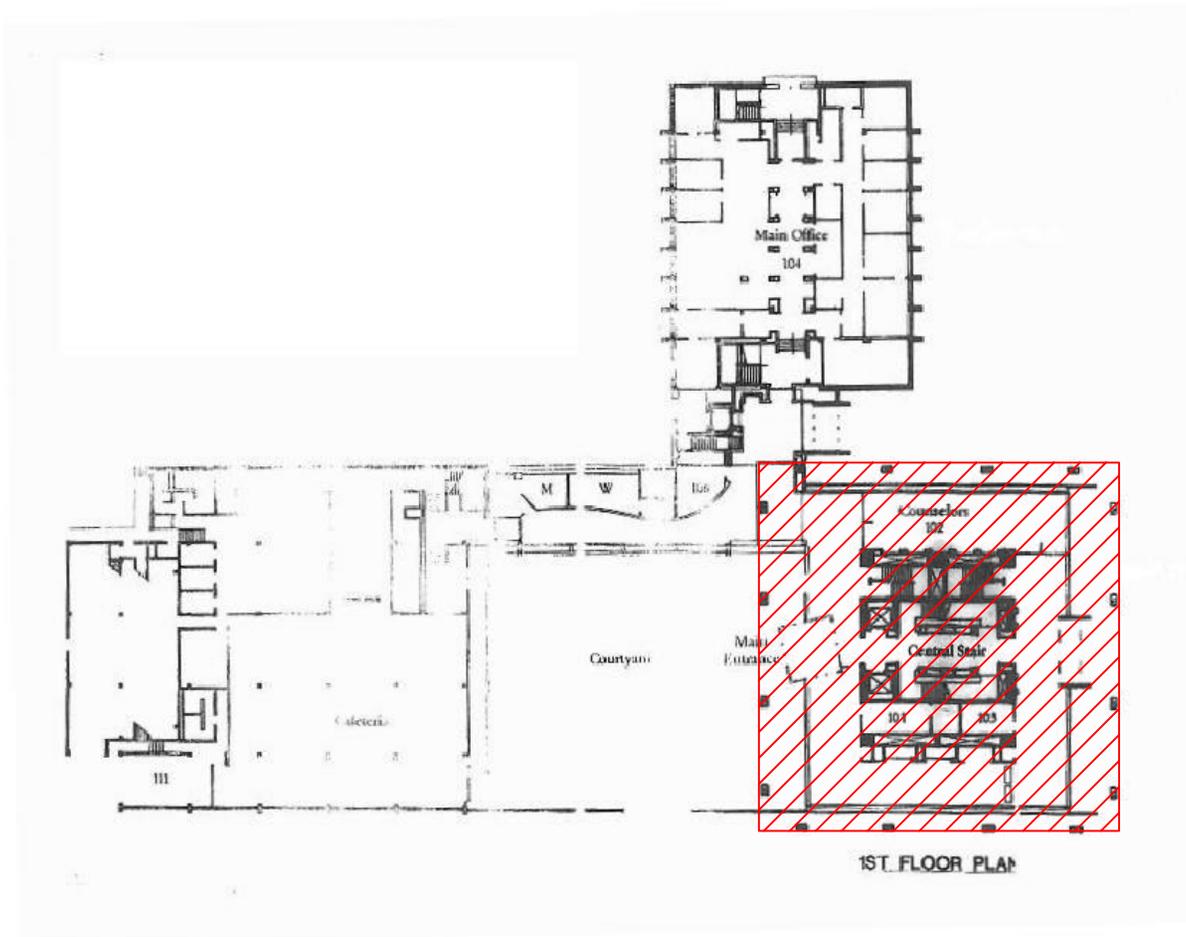

ASBESTOS REINSPECTION KEY NOTES:

 HA-106 Window Expansion Caulk

Jones Magnet H.S. First Floor
2013 Asbestos Reinspection

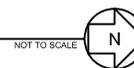

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Jones Magnet High School
606 S State St.
Chicago, IL 60605

SHEET NAME:
Jones Magnet H.S. First Floor
- HA-106

INSPECTED BY:
Jesus Delgado

DRAWN BY: MJW	DATE: 3/14/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 11170


Carnow, Conibear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR** HA-106


CCA PROJECT NUMBER
A320130001-57

DATE
03/04/2013


SHEET NUMBER

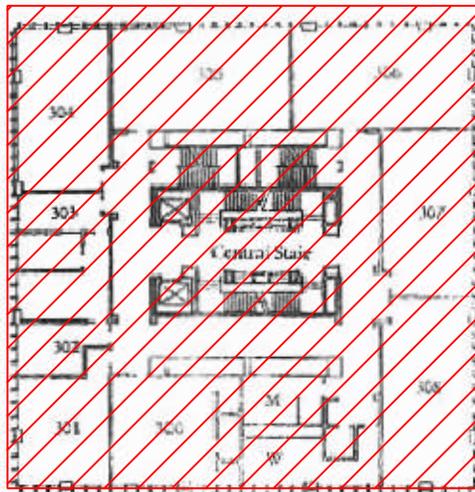


3RD FLOOR PLAN

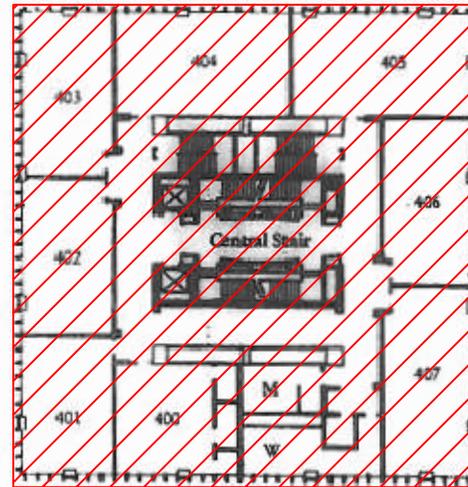

4TH FLOOR PLAN

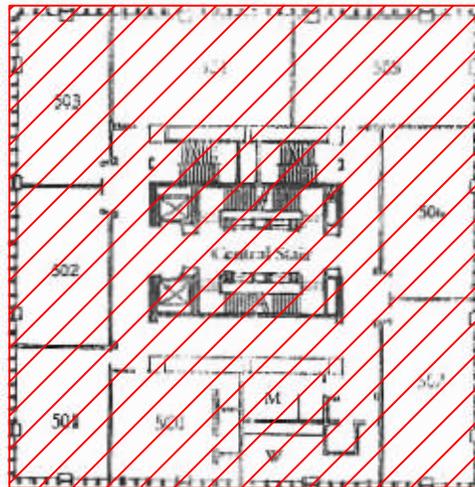

5TH FLOOR PLAN

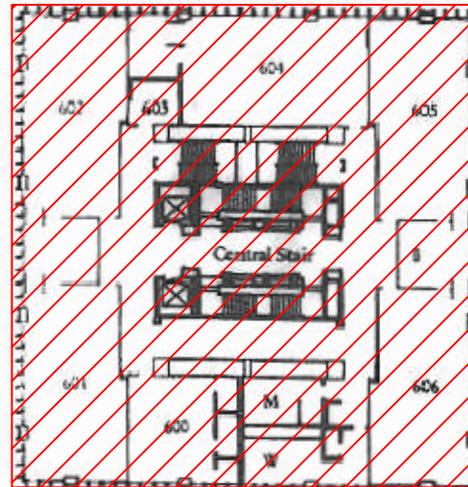


6TH FLOOR PLAN

ASBESTOS REINSPECTION KEY NOTES:

 HA-106 Window Expansion Caulk

Jones Magnet H.S. Floors 3 To 6
2013 Asbestos Reinspection

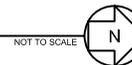

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Jones Magnet High School
606 S State St.
Chicago, IL 60605

SHEET NAME:
Jones Magnet H.S. Floors 3
To 6 - HA-106
INSPECTED BY:
Jesus Delgado

DRAWN BY: MJW	DATE: 3/14/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:


IDPH License #:100- 11170

Carnow, Conbear & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

**CARNOW
CONIBEAR** HA-106

CCA PROJECT NUMBER
A320130001-57
DATE
03/04/2013
SHEET NUMBER

C:\Users\jdelgado\Desktop\2013 Asbestos Reinspection\2013 Asbestos Reinspection\Jones Magnet High School\Jones Magnet H.S. Floors 3 to 6.dwg

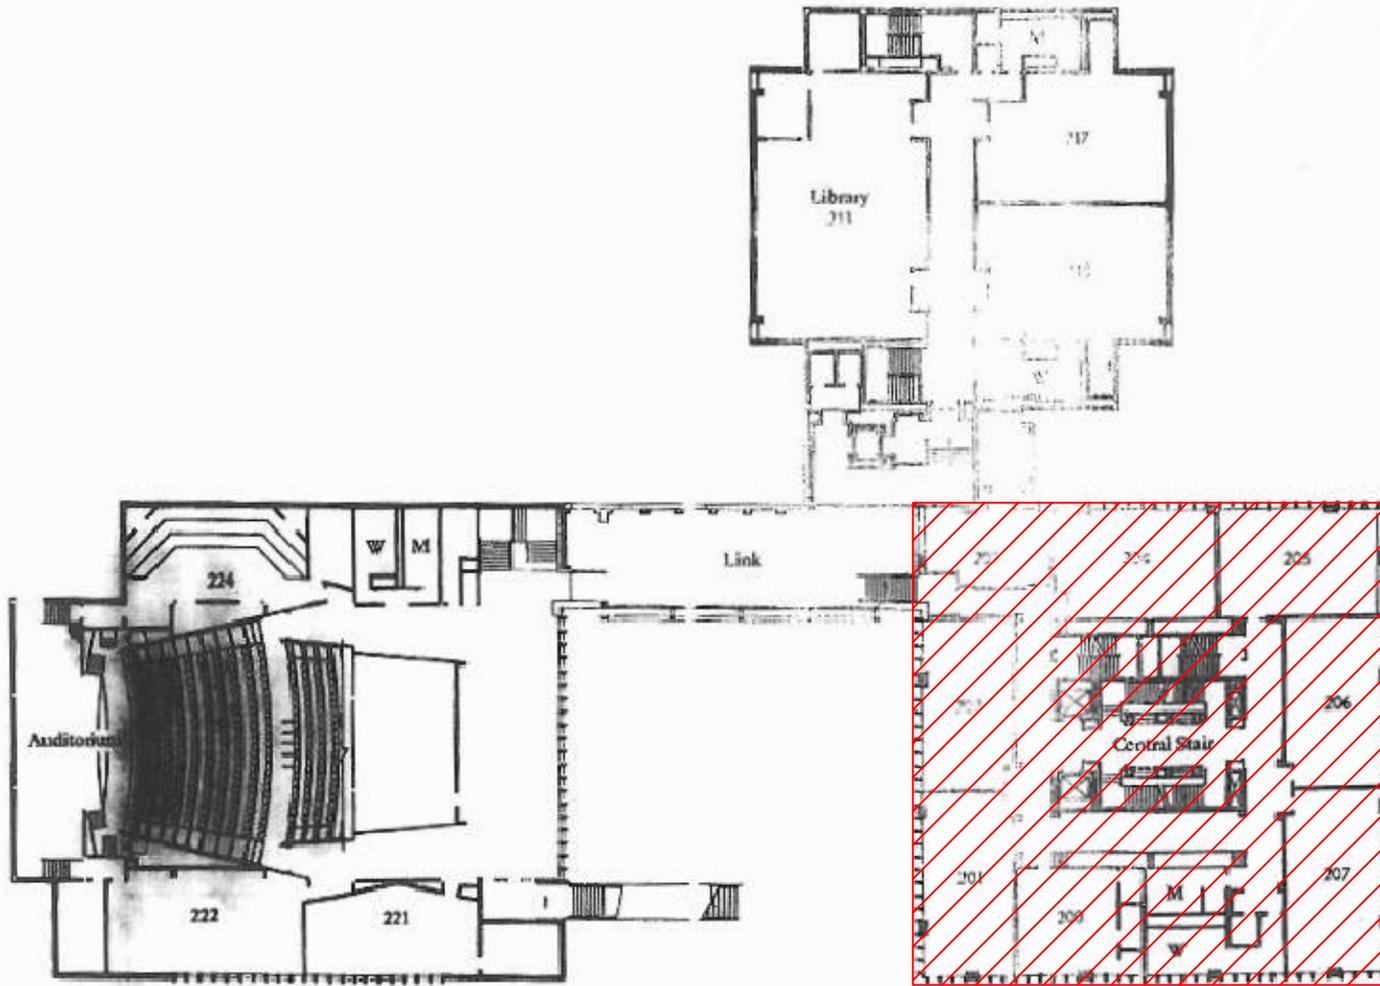


2ND FLOOR PLAN

ASBESTOS REINSPECTION KEY NOTES:

 HA-106 Window Expansion Caulk

Jones Magnet H.S. Second Floor
2013 Asbestos Reinspection

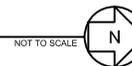

CLIENT:
Chicago Public Schools
125 South Clark Street,
Chicago, Illinois 60603

PROJECT NAME:
2013 AHERA Reinspection
Jones Magnet High School
606 S State St.
Chicago, IL 60605

SHEET NAME:
Jones Magnet H.S. Second
Floor - HA-106

INSPECTED BY:
Jesus Delgado

DRAWN BY: MJW	DATE: 3/14/2013	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:
REVISED BY:	DATE:	CHECKED BY:

IDPH License #:100- 11170

Carnow, Conibeal & Assoc., Ltd.
Environmental Consulting Services
600 W. Van Buren St., Suite 500, Chicago, IL 60607
t: 312.782.4486 f: 312.782.5145
www.ccaatd.com

CCA PROJECT NUMBER
A320130001-57


DATE
03/04/2013

SHEET NUMBER

**CARNOW
CONIBEAR** HA-106

APPENDIX B

Inspector and Management Planner Licenses

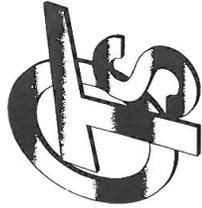

Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Jesus Delgado

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1301040034

Exam Date: 1/4/2013

Course Date: 1/4/2013

Expiration Date: 1/4/2014


Kathy DeSalvo, Director

2013



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.idph.state.il.us

Pat Quinn, Governor

2/7/2013

JESUS M DELGADO
5256 HARCOURT ST
OAK FOREST, IL 60452

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 11170

Enclosed is your Asbestos Professional License that expires 05/15/2014

CERTIFICATE EXPIRATION DATE

INSPECTOR 1/4/2014

PROJECT MANAGER 11/2/2013
AIR SAMPLING PROFESSIONAL

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897. Our WEB address is <http://www.idph.state.il.us/envhealth/ehhome.htm>

Illinois Department of
PUBLIC HEALTH

ASBESTOS PROFESSIONAL LICENSE

ID NUMBER	ISSUED	EXPIRES
100 - 11170	2/19/2013	05/15/2014

JESUS M DELGADO
5256 HARCOURT ST
OAK FOREST, IL 60452

Environmental Health





Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Building Inspector Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: BIR1212042319

Exam Date: 12/4/2012

Course Date: 12/4/2012

Expiration Date: 12/4/2013

Kathy DeSalvo, Director

2012



Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Management Planner Refresher Course
and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014



Kathy DeSalvo, Director

2013



Occupational Training & Supply, Inc.

7233 Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training and Supply, Inc. certifies that

Daniel Juneau

has successfully completed the 4 hour Asbestos Management Planner Refresher Course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 10 CFR 763 Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Certificate: MPR1302250736

Exam Date: 2/25/2013

Course Date: 2/25/2013

Expiration Date: 2/25/2014

Kathy DeSalvo, Director

2013

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER
100 - 03613

ISSUED
4/11/2013

EXPIRES
05/15/2014

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/4/2013

MANAGEMENT PLANNER

2/25/2014

PROJECT MANAGER

12/3/2013

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed