

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2214
SCHOOL NAME: Garvy School, John
ADDRESS OF SCHOOL: 5225 N Oak Park Avenue
CITY: Chicago, IL, 60656

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **2/19/2013**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: _____ ENROLLMENT 806
IDPH INSPECTOR LICENSE NUMBER: 100-06327
IDPH LICENSED INSPECTOR NAME (Please Print): Roberto Rivera
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Garvy School, John

5225 N Oak Park Avenue
Chicago, IL, 60656

Unit: 23301
Building ID: 3510

IDPH ID Number: 14-016-2990-2214

REPORT DATE:

Prepared for:
Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:
GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone (312) 733-6262

Fax (312) 733-5612

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

February 24, 2016

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

GSG Consultants, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1,2,6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 23301 Region: 01 IDPH ID: 14-016-2990-2214

School: Garvy School, John Building ID: 3510

Address: 5225 N Oak Park Avenue
Chicago, IL, 60656

Building Contact: Zacarias, Charlie Contact Phone: 773-600-3611


Current Building Owners: Chicago Public Schools

Review Date: 05/10/2016

Inspector: Roberto Rivera Inspector IDPH License: 100-06327
Management Planner: Jigar Shah Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 733-6262

Sincerely,
GSG Consultants, Inc.

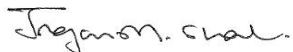

Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: February 24, 2016

RE: Garvy School, John, Unit 23301
5225 N Oak Park Avenue
Chicago, IL, 60656

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Garvy School, John , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Garvy School, John, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Garvy School, John Unit: 23301 Region: 01
Address: 5225 N Oak Park Avenue Chicago, IL, 60656
IDPH ID: 14-016-2990-2214 Building ID: 3510
Contact: Zacarias, Charlie Phone: 773-600-3611

2. Description of Facility

Original Construction: 1936 Additional Construction: 2010,1947
Total Square Footage: 26875 No of Floors: 2
Current Occupancy: 806

3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603

4. Managing Environmental Consultant

MEC: GSG Consultants, Inc.
Contact: Arturo Saenz
Address 855 W. Adams St., Ste. 200
Phone: (312) 733-6262 Fax: (312) 733-5612

5. Inspector

Inspector Name: Roberto Rivera

Inspector IDPH license # 100-06327




Signature:
Date: 2/24/2016

6. Management Planner

Management Planner Name: Jigar Shah

Management Planner IDPH license # 100-07342



Signature:
Date: 05/10/2016

7. Review Date: 05/10/2016

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date:

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

GSG Consultants, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Garvy School, John. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3510:

B. The following new homogenous areas have been identified for Building 3510:

125	12X12 light beige with tan streaks VFT
125A	12X12 light beige with tan streaks VFT Mastic
126	2 x 4 Ceiling Tile
127	2' x 4' Ceiling Tile
128	12" X 12" Sand VFT
128A	12" X 12" Sand VFT Mastic

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

09	9"x9" Dark Brown VFT Mastic
101	12" x 12" Gray with Dark Streaks VFT
101 A	12" x 12" Gray with Dark Streaks VFT Mastic
111	12"x12" White with Black Specs Floor Tile
112	12"x12" White with Black Specs Floor Tile Mastic
113	2'x2' Smooth White Ceiling Tile
114	Beige Terrazzo
115	Drywall
116	Drywall Joint Compound
117	12' X 12" White w/black specs VFT
118	12' X 12" White w/black specs VFT Mastic
119	Fire Door
120	12' X 12" Red VFT
121	12' X 12" Red VFT Mastic
122	12' X 12": Gray VFT
123	12' X 12" Gray VFT Mastic
124	Curtain Wall
125	12X12 light beige with tan streaks VFT
125A	12X12 light beige with tan streaks VFT Mastic
126	2 x 4 Ceiling Tile
127	2' x 4' Ceiling Tile
128	12" X 12" Sand VFT
128A	12" X 12" Sand VFT Mastic
14	12"x12" White w/ Tan Speckles VFT
28	12"x12" Off White VFT Mastic
29	12 x 12 inch White w/Tan Specks VFT
29 A	12 x 12 inch White w/Tan Specks VFT Mastic
30	12 x 12 inch White VFT
30 A	12 x 12 inch White VFT Mastic
31	12"X12" White w/Blue Gray Specks VFT
31A	12"X12" White w/Blue Gray Specks VFT Mastic
32	18"X18' Carpet Squares Mastic

The following areas were deemed to be inaccessible:

113	2'x2' Smooth White Ceiling Tile
125A	12X12 light beige with tan streaks VFT Mastic
126	2 x 4 Ceiling Tile
127	2' x 4' Ceiling Tile

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Roberto Rivera, IDPH License # 100-06327. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Garvy School, John Building 3510 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Garvy School, John Unit 23301 Building ID 3510

Address 5225 N Oak Park Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
11	12"x12" Tan VFT Mastic	2,430	SF	Rooms 101, 102, 103, and 104; Rooms 201, 202, 204, 206 and 105A (under existing VFT); Main Office (under carpet) - 1951	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
110	Textured Drywall Joint Compound			The 2000 Mobile Unit was demolished in 2010.										
111	12"x12" White with Black Specs Floor Tile	1,900	SF	1ST Floor: Corridor; 2ND Floor: Corridor and Storage Room 214 - Bldg 1937	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
112	12"x12" White with Black Specs Floor Tile Mastic	1,900	SF	1ST Floor: Corridor; 2ND Floor: Corridor and Storage Room 214 - Bldg 1937	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
113	2'x2' Smooth White Ceiling Tile	675	SF	1st Floor: Corridor and Vestibule 106; 2nd Floor Corridor by Rms 214, 214 Storage	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
114	Beige Terrazzo	215	SF	1st Floor: Stairwell	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
115	Drywall	750	SF	2nd Floor: Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
116	Drywall Joint Compound	750	SF	2nd Floor: Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
117	12' X 12" White w/black specs VFT	2,500	SF	1st and 2nd floor corridors; Rm 105A - Bldg 1951 (Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
118	12' X 12" White w/black specs VFT Mastic	2,500	SF	1st and 2nd floor corridors; Rm 105A - Bldg 1951 (Some VFT, NOT reflected in the Material Quantity here, were abated in	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Garvy School, John Unit 23301 Building ID 3510

Address 5225 N Oak Park Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				2010)										
119	Fire Door	7	EA	Room 205 (Teacher's Lounge), Bookroom, Auditorium and Gymnasium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
120	12' X 12" Red VFT	150	SF	1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
121	12' X 12" Red VFT Mastic	150	SF	1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
122	12' X 12": Gray VFT	150	SF	1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
123	12' X 12" Gray VFT Mastic	150	SF	1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
124	Curtain Wall	700	SF	Gymnasium platform	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
125	12X12 light beige with tan streaks VFT	2,800	SF	Rooms 201, 202, 204, and 206 - 1951 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
125A	12X12 light beige with tan streaks VFT Mastic	2,800	SF	Rooms 201, 202, 204, and 206 - 1951 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
126	2 x 4 Ceiling Tile	4,900	SF	Rooms 107, 108, 109, 110, 111, and 112; 1st Floor Corridor - 1937 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
127	2' x 4' Ceiling Tile	3,500	SF	Rms 101, 102, 103, and 104; 1st Floor Corridor - 1951 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
128	12" X 12" Sand VFT	2,600	SF	Assembly Hall - 1937 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
128A	12" X 12" Sand VFT Mastic	2,600	SF	Assembly Hall - 1937 Bldg.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	12"x12" Blue/Gray VFT	2,430	SF	Rooms 101, 102,	CHR	MISC	N	NONE	0		No	ACBM with the		MODERATE

Chicago Public Schools

School Garvy School, John Unit 23301 Building ID 3510

Address 5225 N Oak Park Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				103, 104, and 105; Rooms 201, 202, 204, 206 (under existing VFT); Main Office (under the carpet) - 1951								potential for damage		
14	12"x12" White w/ Tan Speckles VFT	800	SF	Rooms 111 - 1937	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
15	12"x12" White w/ Tan Specks VFT	1,000	SF	Room 203 (under existing VFT) - 1951	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	12"x12" Brown VFT	1,800	SF	Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT in all three) - 1937	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	12"x12" White VFT	1,800	SF	Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT in all three) - 1937	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
18	12"x12" Tan VFT - REMOVED			NE Gym Vestibule 1937 - REMOVED		MISC								
19	12"x12" Blue/Gray VFT - REMOVED			NE Gym Vestibule 1937 - REMOVED		MISC								
20	12"x12" Off White VFT	150	SF	Engineer's Office 1937	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12"x12" Blue/Gray VFT Mastic	2,430	SF	Rooms 101, 102, 103, 104; Rooms 201, 202, 204, and 206 (under existing VFT, in all four rooms; Main Office - 1951	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	12"x12" White w/ Tan Specks VFT Mastic	800	SF	Room 111 - 1937	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	12"x12" White w/ Tan Specks VFT Mastic	1,000	SF	Room 203 (under existing VFT) - 1951	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12"x12" Brown VFT Mastic	1,800	SF	Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Garvy School, John Unit 23301 Building ID 3510

Address 5225 N Oak Park Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				existing VFT) - 1937										
25	12"x12" White VFT Mastic	1,800	SF	Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT) - 1937	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	12"x12" Tan VFT Mastic REMOVED			NE Gym Vestibule 1937 - REMOVED		MISC								
27	12"x12" Blue/Gray VFT Mastic - REMOVED			NE Gym Vestibule 1937 - REMOVED		MISC								
28	12"x12" Off White VFT Mastic	150	SF	Engineer's Office - 1937	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	12 x 12 inch White w/Tan Specks VFT	4,000	SF	Rooms 201, 202 & 204 (all under existing VFT); Teacher's Lounge - 1951	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29 A	12 x 12 inch White w/Tan Specks VFT Mastic	4,000	SF	Rooms 201, 202 & 204 (all under existing VFT); Teacher's Lounge - 1951	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	12 x 12 inch White VFT	750	SF	Room 109 - 1937 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
30 A	12 x 12 inch White VFT Mastic	750	SF	Room 109 - 1937 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	12"X12" White w/Blue Gray Specks VFT	2,500	SF	1st Floor Corridor (Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31A	12"X12" White w/Blue Gray Specks VFT Mastic	2,500	SF	1st Floor Corridor (Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	18"X18" Carpet Squares Mastic	1,500	SF	Main Office; Library 209	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A	Cardboard Pipe Insulation	430	LF	All Unfinished Pipe Areas, Boiler Room, Engineer Storage.	CHR	TSI	Y	DIST	40		No	Damaged or significantly damaged friable thermal system	3	LOW

Chicago Public Schools

School Garvy School, John Unit 23301 Building ID 3510

Address 5225 N Oak Park Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Janitor Room - 1937								insulating ACBM		
B	MJP E/F/V on Cardboard Pipe Insulation	41	LF	All Unfinished Pipe Areas, Boiler Room, Engineer Storage, Janitor Room - 1937	CHR	TSI	Y	DIST	3		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	LOW
C	MJP E/F/V on Fiberglass Pipe Insulation	30	LF	Basement Storage Area by Electrical Room - 1937	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
E	Aircell Pipe Insulation	880	LF	All Unfinished Pipe Areas, Boiler Room, Janitor Room, Tunnel, Engineer Storage - 1937	CHR	TSI	Y	DIST	20		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	MODERATE
F	MJP E/F/V on Aircell Pipe Insulation	136	LF	All Unfinished Pipe Areas, Boiler Room, Janitor Room, Tunnel, Engineer Storage - 1937	CHR	TSI	Y	DIST	5		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	MODERATE
G	Aircell Duct Covering	2,400	SF	Unexcavated Areas, Boiler Room - 1937	CHR	TSI	Y	DIST	200		No	Damaged or significantly damaged friable thermal system insulating ACBM	2	LOW
K	Cardboard Pipe Insulation	450	LF	Pump Room, Fan Room, All Unfinished Areas - 1951	CHR	TSI	Y	DIST	30		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	MODERATE
L	MJP E/F/V on Cardboard Pipe Insulation	45	LF	Pump Room, Fan Room, All Unfinished Areas - 1951	CHR	TSI	Y	DIST	3		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	LOW
M	Aircell Pipe Insulation	635	LF	Pump Room, Fan Room, All Unfinished Areas - 1951	CHR	TSI	Y	DIST	60		No	Damaged or significantly damaged friable thermal system insulating ACBM	2	LOW
N	MJP E/F/V on Aircell Pipe Insulation	64	LF	Pump Room, Fan Room, All Unfinished Areas - 1951	CHR	TSI	Y	DIST	5		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	LOW
O	Mag Block Pipe Insulation	35	LF	Boiler Room - 1937	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
P	MJP E/F/V on Mag Block Pipe Insulation	8	LF	Boiler Room - 1937	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Garvy School, John Unit 23301 Building ID 3510

Address 5225 N Oak Park Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 2/24/2016
Inspector Name Roberto Rivera
100-06327 1/6/2017
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
03	Inspector found no damaged material.
04	
05	
08	
09	
10	
101	
101 A	
102	The 2000 Mobile Bldg was demolished in 2010.
103	The 2000 Mobile Unit was demolished in 2010.
104	The 2000 Mobile Unit was demolished in 2010.
105	The 2000 Mobile Unit was demolished in 2010.
106	The 2000 Mobile Unit was demolished in 2010.
107	The 2000 Mobile Bldg was demolished in 2010.
108	The 2000 Mobile Unit was demolished in 2010.
109	The 2000 Mobile Unit was demolished in 2010.
11	
110	The 2000 Mobile Unit was demolished in 2010.
111	
112	
113	
114	
115	
116	

Chicago Public Schools

School Garvy School, John Unit 23301 Building ID 3510

Address 5225 N Oak Park Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
117	Some VFT, NOT reflected in the Material Quantity here, were abated in 2010
118	Some VFT, NOT reflected in the Material Quantity here, were abated in 2010
119	
120	
121	
122	
123	
124	
125	
125A	
126	
127	
128	
128A	
13	
14	
15	
16	
17	
18	Material REMOVED, unknown date
19	Material REMOVED, unknown date
20	
21	
22	
23	
24	
25	
26	Material REMOVED, unknown date
27	Material REMOVED, unknown date

Chicago Public Schools

School Garvy School, John Unit 23301 Building ID 3510

Address 5225 N Oak Park Avenue Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
28	
29	
29 A	
30	
30 A	
31	Some VFT, NOT reflected in the Material Quantity here, were abated in 2010
31A	Some VFT, NOT reflected in the Material Quantity here, were abated in 2010
32	
A	Damage in Unfinished Pipe Area
B	Damage in Unfinished Pipe Area
C	
E	Damage in Unfinished Pipe Area
F	Damage in Unfinished Pipe Area
G	Damage in Unexcavated Areas
K	Damage in Unfinished Areas
L	Damage in Unfinished Areas
M	Damage in Unfinished Areas
N	Damage in Unfinished Areas
O	
P	

Table II

Management Planner's Review

Chicago Public Schools

School Garvy School, John
Address 5225 N Oak Park Avenue

Unit 23301
 Chicago, IL, 60656

Building ID 3510
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
03	Acoustical Plaster	6,000	SF	Assembly Hall 1951	Chrysotile	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	12"x12" Beige VFT	690	SF	Computer Room (207) 1937	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	9"x9" Dark Brown VFT	20	SF	Engineer's Bathroom 1937	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	12"x12" Beige VFT Mastic	690	SF	Computer Room (207), 1937	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	9"x9" Dark Brown VFT Mastic	20	SF	Engineer's Bathroom - 1937	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	12"x12" Tan VFT	2,430	SF	Room 101, 102, 103, and 104; Rooms 201, 202, 204, 206 and 105A (under existing VFT), Main Office - 1951	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
101	12" x 12" Gray with Dark Streaks VFT	500	SF	Room 105A - 1951 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
101 A	12" x 12" Gray with Dark Streaks VFT Mastic	500	SF	Room 105A - 1951 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
102	12" x 12" Off White w/ Tan Specks VFT			The 2000 Mobile Unit was demolished in 2010.		MISC					
103	12" x 12" Off White w/ Tan Specks VFT Mastic			The 2000 Mobile Unit was demolished in 2010.		MISC					
104	2' x 2' White Ceiling Tile			The 2000 Mobile Unit was demolished in 2010.		MISC					
105	Drywall			The 2000 Mobile Unit was demolished in 2010.		MISC					
106	Drywall Joint Compound			The 2000 Mobile Unit was demolished in 2010.							
107	Vinyl Baseboard			The 2000 Mobile Unit was demolished in 2010.							
108	Vinyl Baseboard Mastic			The 2000 Mobile Unit was demolished in 2010.							
109	Texture Drywall			The 2000 Mobile Unit was demolished in 2010.							
11	12"x12" Tan VFT Mastic	2,430	SF	Rooms 101, 102, 103, and 104; Rooms 201, 202, 204, 206 and 105A (under existing VFT); Main Office (under carpet) - 1951	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
110	Textured Drywall Joint Compound			The 2000 Mobile Unit was demolished in 2010.							
111	12"x12" White with Black Specs Floor Tile	1,900	SF	1ST Floor: Corridor; 2ND Floor: Corridor and Storage Room 214 - Bldg 1937	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
112	12"x12" White with Black Specs Floor Tile Mastic	1,900	SF	1ST Floor: Corridor; 2ND Floor:	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Garvy School, John
Address 5225 N Oak Park Avenue

Unit 23301
Chicago, IL, 60656

Building ID 3510
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Corridor and Storage Room 214 - Bldg 1937							
113	2'x2' Smooth White Ceiling Tile	675	SF	1st Floor: Corridor and Vestibule 106; 2nd Floor Corridor by Rms 214, 214 Storage	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
114	Beige Terrazzo	215	SF	1st Floor: Stairwell	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
115	Drywall	750	SF	2nd Floor: Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
116	Drywall Joint Compound	750	SF	2nd Floor: Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
117	12' X 12" White w/black specs VFT	2,500	SF	1st and 2nd floor corridors; Rm 105A - Bldg 1951 (Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
118	12' X 12" White w/black specs VFT Mastic	2,500	SF	1st and 2nd floor corridors; Rm 105A - Bldg 1951 (Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
119	Fire Door	7	EA	Room 205 (Teacher's Lounge), Bookroom, Auditorium and Gymnasium	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
120	12' X 12" Red VFT	150	SF	1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
121	12' X 12" Red VFT Mastic	150	SF	1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
122	12' X 12": Gray VFT	150	SF	1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
123	12' X 12" Gray VFT Mastic	150	SF	1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
124	Curtain Wall	700	SF	Gymnasium platform	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
125	12X12 light beige with tan streaks VFT	2,800	SF	Rooms 201, 202, 204, and 206 - 1951 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
125A	12X12 light beige with tan streaks VFT Mastic	2,800	SF	Rooms 201, 202, 204, and 206 - 1951 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
126	2 x 4 Ceiling Tile	4,900	SF	Rooms 107, 108, 109, 110, 111, and 112; 1st Floor Corridor - 1937 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
127	2' x 4' Ceiling Tile	3,500	SF	Rms 101, 102, 103, and 104; 1st Floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Garvy School, John
Address 5225 N Oak Park Avenue

Unit 23301
 Chicago, IL, 60656

Building ID 3510
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Corridor - 1951 Bldg							
128	12" X 12" Sand VFT	2,600	SF	Assembly Hall - 1937 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
128A	12" X 12" Sand VFT Mastic	2,600	SF	Assembly Hall - 1937 Bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	12"x12" Blue/Gray VFT	2,430	SF	Rooms 101, 102, 103, 104, and 105; Rooms 201, 202, 204, 206 (under existing VFT); Main Office (under the carpet) - 1951	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	12"x12" White w/ Tan Speckles VFT	800	SF	Rooms 111 - 1937	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12"x12" White w/ Tan Specks VFT	1,000	SF	Room 203 (under existing VFT) - 1951	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	12"x12" Brown VFT	1,800	SF	Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT in all three) - 1937	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	12"x12" White VFT	1,800	SF	Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT in all three) - 1937	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12"x12" Tan VFT - REMOVED			NE Gym Vestibule 1937 - REMOVED		MISC					
19	12"x12" Blue/Gray VFT - REMOVED			NE Gym Vestibule 1937 - REMOVED		MISC					
20	12"x12" Off White VFT	150	SF	Engineer's Office 1937	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12"x12" Blue/Gray VFT Mastic	2,430	SF	Rooms 101, 102, 103, 104; Rooms 201, 202, 204, and 206 (under existing VFT, in all four rooms; Main Office - 1951	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12"x12" White w/ Tan Specks VFT Mastic	800	SF	Room 111 - 1937	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12"x12" White w/ Tan Specks VFT Mastic	1,000	SF	Room 203 (under existing VFT) - 1951	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12"x12" Brown VFT Mastic	1,800	SF	Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT) - 1937	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12"x12" White VFT Mastic	1,800	SF	Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT) - 1937	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	12"x12" Tan VFT Mastic REMOVED			NE Gym Vestibule 1937 - REMOVED		MISC					
27	12"x12" Blue/Gray VFT Mastic - REMOVED			NE Gym Vestibule 1937 - REMOVED		MISC					
28	12"x12" Off White VFT Mastic	150	SF	Engineer's Office - 1937	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	12 x 12 inch White w/Tan Specks VFT	4,000	SF	Rooms 201, 202 & 204 (all under existing VFT); Teacher's Lounge - 1951	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29 A	12 x 12 inch White w/Tan Specks VFT Mastic	4,000	SF	Rooms 201, 202 & 204 (all under	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Garvy School, John
Address 5225 N Oak Park Avenue

Unit 23301
Chicago, IL, 60656

Building ID 3510
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				existing VFT); Teacher's Lounge - 1951							
30	12 x 12 inch White VFT	750	SF	Room 109 - 1937 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30 A	12 x 12 inch White VFT Mastic	750	SF	Room 109 - 1937 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12"X12" White w/Blue Gray Specks VFT	2,500	SF	1st Floor Corridor (Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31A	12"X12" White w/Blue Gray Specks VFT Mastic	2,500	SF	1st Floor Corridor (Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	18"X18' Carpet Squares Mastic	1,500	SF	Main Office; Library 209	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Cardboard Pipe Insulation	430	LF	All Unfinished Pipe Areas, Boiler Room, Engineer Storage, Janitor Room - 1937	Chrysotile	TSI	Yes	40	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
B	MJP E/F/V on Cardboard Pipe Insulation	41	LF	All Unfinished Pipe Areas, Boiler Room, Engineer Storage, Janitor Room - 1937	Chrysotile	TSI	Yes	3	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
C	MJP E/F/V on Fiberglass Pipe Insulation	30	LF	Basement Storage Area by Electrical Room - 1937	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
E	Aircell Pipe Insulation	880	LF	All Unfinished Pipe Areas, Boiler Room, Janitor Room, Tunnel, Engineer Storage - 1937	Chrysotile	TSI	Yes	20	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
F	MJP E/F/V on Aircell Pipe Insulation	136	LF	All Unfinished Pipe Areas, Boiler Room, Janitor Room, Tunnel, Engineer Storage - 1937	Chrysotile	TSI	Yes	5	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
G	Aircell Duct Covering	2,400	SF	Unexcavated Areas, Boiler Room - 1937	Chrysotile	TSI	Yes	200	SF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
K	Cardboard Pipe Insulation	450	LF	Pump Room, Fan Room, All Unfinished Areas - 1951	Chrysotile	TSI	Yes	30	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
L	MJP E/F/V on Cardboard Pipe Insulation	45	LF	Pump Room, Fan Room, All Unfinished Areas - 1951	Chrysotile	TSI	Yes	3	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
M	Aircell Pipe Insulation	635	LF	Pump Room, Fan Room, All Unfinished Areas - 1951	Chrysotile	TSI	Yes	60	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
N	MJP E/F/V on Aircell Pipe Insulation	64	LF	Pump Room, Fan Room, All Unfinished Areas - 1951	Chrysotile	TSI	Yes	5	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
O	Mag Block Pipe Insulation	35	LF	Boiler Room - 1937	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
P	MJP E/F/V on Mag Block Pipe Insulation	8	LF	Boiler Room - 1937	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Garvy School, John
Address 5225 N Oak Park Avenue

Unit 23301
 Chicago, IL, 60656

Building ID 3510
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.
 855 W. Adams St., Ste. 200
 Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

Review Date	5/10/2016
Manager Planner Name	Jigar Shah
100-07342	1/19/2017
Manager IDPH License No/Expiration	

HA Number	Management Comments
03	
04	
05	
08	
09	
10	
101	

Chicago Public Schools

School Garvy School, John
Address 5225 N Oak Park Avenue

Unit 23301
 Chicago, IL, 60656

Building ID 3510
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.
 855 W. Adams St., Ste. 200
 Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
101 A	
102	
103	
104	
105	
106	
107	
108	
109	
11	
110	
111	
112	
113	
114	
115	
116	
117	
118	
119	
120	
121	
122	
123	
124	
125	
125A	

Chicago Public Schools

School Garvy School, John
Address 5225 N Oak Park Avenue

Unit 23301
 Chicago, IL, 60656

Building ID 3510
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
126	
127	
128	
128A	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
29 A	
30	
30 A	
31	
31A	
32	

Chicago Public Schools

School Garvy School, John
Address 5225 N Oak Park Avenue

Unit 23301
Chicago, IL, 60656

Building ID 3510
Region 01

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
A	Repair Damaged ACM
B	Repair Damaged ACM
C	
E	Repair Damaged ACM
F	Repair Damaged ACM
G	Repair Damaged ACM
K	Repair Damaged ACM
L	Repair Damaged ACM
M	Repair Damaged ACM
N	Repair Damaged ACM
O	
P	

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **Acoustical Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged friable surfacing ACBM**
HISTORICAL DAMAGE REASON: **Water**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Assembly Hall 1951**

MATERIAL QUANTITY: **6000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS: **Inspector found no damaged material.**

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **Acoustical Plaster**
MATERIAL LOCATION: **Assembly Hall 1951**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **12"x12" Beige VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Computer Room (207) 1937**
MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **12"x12" Beige VFT**
MATERIAL LOCATION: **Computer Room (207) 1937**
MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **9"x9" Dark Brown VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Bathroom 1937**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **9"x9" Dark Brown VFT**
MATERIAL LOCATION: **Engineer's Bathroom 1937**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **12"x12" Beige VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Computer Room (207), 1937**
MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **12"x12" Beige VFT Mastic**
MATERIAL LOCATION: **Computer Room (207), 1937**
MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **9"x9" Dark Brown VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Bathroom - 1937**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **9"x9" Dark Brown VFT Mastic**
MATERIAL LOCATION: **Engineer's Bathroom - 1937**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **12"x12" Tan VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Room 101, 102, 103, and 104; Rooms 201, 202, 204, 206 and 105A(under existing VFT), Main Office - 1951**

MATERIAL QUANTITY: **2430** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **12"x12" Tan VFT**
MATERIAL LOCATION: **Room 101, 102, 103, and 104; Rooms 201, 202, 204, 206 and 105A(under existing VFT), Main Office - 1951**
MATERIAL QUANTITY: **2430** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUILDING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 101
MATERIAL DESCRIPTION: 12" x 12" Gray with Dark Streaks VFT
HISTORICAL AHERA DAMAGE CATEGORY: 6 ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: Assumed FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: MODERATE
MATERIAL LOCATION: Room 105A - 1951 Building
MATERIAL QUANTITY: 500 MATERIAL UNITS: SF
DAMAGE QUANTITY: DAMAGE UNITS: SF
COMMENTS:

Inspector's Signature: Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **101**
MATERIAL DESCRIPTION: **12" x 12" Gray with Dark Streaks VFT**
MATERIAL LOCATION: **Room 105A - 1951 Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **101 A**
MATERIAL DESCRIPTION: **12" x 12" Gray with Dark Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 105A - 1951 Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **101 A**
MATERIAL DESCRIPTION: **12" x 12" Gray with Dark Streaks VFT Mastic**
MATERIAL LOCATION: **Room 105A - 1951 Building**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

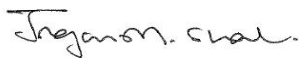

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 102
MATERIAL DESCRIPTION: 12" x 12" Off White w/ Tan Specks VFT
HISTORICAL AHERA DAMAGE CATEGORY ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: The 2000 Mobile Unit was demolished in 2010.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: The 2000 Mobile Bldg was demolished in 2010.

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **102**
MATERIAL DESCRIPTION: **12" x 12" Off White w/ Tan Specks VFT**
MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **103**
MATERIAL DESCRIPTION: **12" x 12" Off White w/ Tan Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **The 2000 Mobile Unit was demolished in 2010.**

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **103**
MATERIAL DESCRIPTION: **12" x 12" Off White w/ Tan Specks VFT Mastic**
MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **2' x 2' White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **The 2000 Mobile Unit was demolished in 2010.**

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **104**
MATERIAL DESCRIPTION: **2' x 2' White Ceiling Tile**
MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 105
MATERIAL DESCRIPTION: Drywall
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: The 2000 Mobile Unit was demolished in 2010.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: The 2000 Mobile Unit was demolished in 2010.

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **The 2000 Mobile Unit was demolished in 2010.**

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **107**
MATERIAL DESCRIPTION: **Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **The 2000 Mobile Bldg was demolished in 2010.**

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **107**
MATERIAL DESCRIPTION: **Vinyl Baseboard**
MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 108
MATERIAL DESCRIPTION: Vinyl Baseboard Mastic
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: The 2000 Mobile Unit was demolished in 2010.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: The 2000 Mobile Unit was demolished in 2010.

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **108**
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**
MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 109
MATERIAL DESCRIPTION: Texture Drywall
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: The 2000 Mobile Unit was demolished in 2010.

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: The 2000 Mobile Unit was demolished in 2010.

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **109**
MATERIAL DESCRIPTION: **Texture Drywall**
MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12"x12" Tan VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 101, 102, 103, and 104; Rooms 201, 202, 204, 206 and 105A (under existing VFT); Main Office (under carpet) - 1951**

MATERIAL QUANTITY: **2430** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **12"x12" Tan VFT Mastic**
MATERIAL LOCATION: **Rooms 101, 102, 103, and 104; Rooms 201, 202, 204, 206 and 105A (under existing VFT); Main Office (under carpet) - 1951**
MATERIAL QUANTITY: **2430** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **110**
MATERIAL DESCRIPTION: **Textured Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **The 2000 Mobile Unit was demolished in 2010.**

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **110**
MATERIAL DESCRIPTION: **Textured Drywall Joint Compound**
MATERIAL LOCATION: **The 2000 Mobile Unit was demolished in 2010.**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **111**
MATERIAL DESCRIPTION: **12"x12" White with Black Specs Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1ST Floor: Corridor; 2ND Floor: Corridor and Storage Room 214 - Bldg 1937**
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **111**
MATERIAL DESCRIPTION: **12"x12" White with Black Specs Floor Tile**
MATERIAL LOCATION: **1ST Floor: Corridor; 2ND Floor: Corridor and Storage Room 214 - Bldg 1937**
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **112**
MATERIAL DESCRIPTION: **12"x12" White with Black Specs Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1ST Floor: Corridor; 2ND Floor: Corridor and Storage Room 214 - Bldg 1937**
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **112**
MATERIAL DESCRIPTION: **12"x12" White with Black Specs Floor Tile Mastic**
MATERIAL LOCATION: **1ST Floor: Corridor; 2ND Floor: Corridor and Storage Room 214 - Bldg 1937**
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **113**
MATERIAL DESCRIPTION: **2'x2' Smooth White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor: Corridor and Vestibule 106; 2nd Floor Corridor by Rms 214, 214 Storage**
MATERIAL QUANTITY: **675** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **113**
MATERIAL DESCRIPTION: **2'x2' Smooth White Ceiling Tile**
MATERIAL LOCATION: **1st Floor: Corridor and Vestibule 106; 2nd Floor Corridor by Rms 214, 214 Storage**
MATERIAL QUANTITY: **675** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **114**
MATERIAL DESCRIPTION: **Beige Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st Floor: Stairwell**
MATERIAL QUANTITY: **215** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: *Roberto Rivera*

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **114**
MATERIAL DESCRIPTION: **Beige Terrazzo**
MATERIAL LOCATION: **1st Floor: Stairwell**
MATERIAL QUANTITY: **215** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **115**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **2nd Floor: Corridor**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **115**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **2nd Floor: Corridor**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

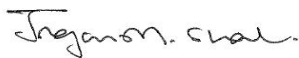

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUILDING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 116
MATERIAL DESCRIPTION: Drywall Joint Compound
HISTORICAL AHERA DAMAGE CATEGORY: 6 ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: Assumed FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: 2nd Floor: Corridor
MATERIAL QUANTITY: 750 MATERIAL UNITS: SF
DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS:

Inspector's Signature: Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **116**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
MATERIAL LOCATION: **2nd Floor: Corridor**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **117**
MATERIAL DESCRIPTION: **12' X 12" White w/black specs VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:


DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **1st and 2nd floor corridors; Rm 105A - Bldg 1951
(Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Some VFT, NOT reflected in the Material Quantity here, were abated in 2010**

Inspector's Signature: 

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **117**
MATERIAL DESCRIPTION: **12' X 12" White w/black specs VFT**
MATERIAL LOCATION: **1st and 2nd floor corridors; Rm 105A - Bldg 1951
(Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 118
MATERIAL DESCRIPTION: 12' X 12" White w/black specs VFT Mastic
HISTORICAL AHERA DAMAGE CATEGORY 6 ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: Assumed FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:


DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st and 2nd floor corridors; Rm 105A - Bldg 1951
(Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Some VFT, NOT reflected in the Material Quantity here, were abated in 2010**

Inspector's Signature: 

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **118**
MATERIAL DESCRIPTION: **12' X 12" White w/black specs VFT Mastic**
MATERIAL LOCATION: **1st and 2nd floor corridors; Rm 105A - Bldg 1951
(Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **119**
MATERIAL DESCRIPTION: **Fire Door**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 205 (Teacher's Lounge), Bookroom, Auditorium and Gymnasium**
MATERIAL QUANTITY: **7** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature: *Roberto Rivera*

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **119**
MATERIAL DESCRIPTION: **Fire Door**
MATERIAL LOCATION: **Room 205 (Teacher's Lounge), Bookroom, Auditorium and Gymnasium**
MATERIAL QUANTITY: **7** MATERIAL UNITS: **EA**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

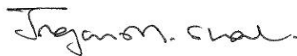

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **120**
MATERIAL DESCRIPTION: **12' X 12" Red VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **120**
MATERIAL DESCRIPTION: **12' X 12" Red VFT**
MATERIAL LOCATION: **1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **121**
MATERIAL DESCRIPTION: **12' X 12" Red VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **121**
MATERIAL DESCRIPTION: **12' X 12" Red VFT Mastic**
MATERIAL LOCATION: **1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **122**
MATERIAL DESCRIPTION: **12' X 12": Gray VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **122**
MATERIAL DESCRIPTION: **12' X 12": Gray VFT**
MATERIAL LOCATION: **1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **123**
MATERIAL DESCRIPTION: **12' X 12" Gray VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: *Roberto Rivera*

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **123**
MATERIAL DESCRIPTION: **12' X 12" Gray VFT Mastic**
MATERIAL LOCATION: **1st and 2nd floor corridors; Rms 105A, 203; main office -1951 Bldg.**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **124**
MATERIAL DESCRIPTION: **Curtain Wall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gymnasium platform**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **124**
MATERIAL DESCRIPTION: **Curtain Wall**
MATERIAL LOCATION: **Gymnasium platform**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **12"x12" Blue/Gray VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Rooms 101, 102, 103, 104, and 105; Rooms 201, 202, 204, 206 (under existing VFT); Main Office (under the carpet) - 1951**

MATERIAL QUANTITY: **2430** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **12"x12" Blue/Gray VFT**
MATERIAL LOCATION: **Rooms 101, 102, 103, 104, and 105; Rooms 201, 202, 204, 206 (under existing VFT); Main Office (under the carpet) - 1951**
MATERIAL QUANTITY: **2430** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Speckles VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rooms 111 - 1937**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Speckles VFT**
MATERIAL LOCATION: **Rooms 111 - 1937**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 203 (under existing VFT) - 1951**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT**
MATERIAL LOCATION: **Room 203 (under existing VFT) - 1951**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Brown VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT in all three) - 1937**

MATERIAL QUANTITY: **1800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Brown VFT**
MATERIAL LOCATION: **Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT in all three) - 1937**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 17
MATERIAL DESCRIPTION: 12"x12" White VFT
HISTORICAL AHERA DAMAGE CATEGORY 6 ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: Chrysotile FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: MODERATE

MATERIAL LOCATION: Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT in all three) - 1937

MATERIAL QUANTITY: 1800

MATERIAL UNITS: SF

DAMAGE QUANTITY:

DAMAGE UNITS: SF

COMMENTS:

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12"x12" White VFT**
MATERIAL LOCATION: **Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT in all three) - 1937**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 18
MATERIAL DESCRIPTION: 12"x12" Tan VFT - REMOVED
HISTORICAL AHERA DAMAGE CATEGORY ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: NE Gym Vestibule 1937 - REMOVED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Material REMOVED, unknown date

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"x12" Tan VFT - REMOVED**
MATERIAL LOCATION: **NE Gym Vestibule 1937 - REMOVED**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 19
MATERIAL DESCRIPTION: 12"x12" Blue/Gray VFT - REMOVED
HISTORICAL AHERA DAMAGE CATEGORY ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: NE Gym Vestibule 1937 - REMOVED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Material REMOVED, unknown date

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **12"x12" Blue/Gray VFT - REMOVED**

MATERIAL LOCATION: **NE Gym Vestibule 1937 - REMOVED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12"x12" Off White VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office 1937**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12"x12" Off White VFT**
MATERIAL LOCATION: **Engineer's Office 1937**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12"x12" Blue/Gray VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 101, 102, 103, 104; Rooms 201, 202, 204, and 206 (under existing VFT, in all four rooms; Main Office - 1951**

MATERIAL QUANTITY: **2430**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12"x12" Blue/Gray VFT Mastic**
MATERIAL LOCATION: **Rooms 101, 102, 103, 104; Rooms 201, 202, 204, and 206 (under existing VFT, in all four rooms; Main Office - 1951**
MATERIAL QUANTITY: **2430** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 111 - 1937**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT Mastic**
MATERIAL LOCATION: **Room 111 - 1937**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 203 (under existing VFT) - 1951**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: 

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Specks VFT Mastic**
MATERIAL LOCATION: **Room 203 (under existing VFT) - 1951**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12"x12" Brown VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT) - 1937**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12"x12" Brown VFT Mastic**
MATERIAL LOCATION: **Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT) - 1937**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" White VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT) - 1937**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" White VFT Mastic**
MATERIAL LOCATION: **Rooms 108 and 110; Cafeteria Office, Cafeteria Storage, Kitchen (under existing VFT) - 1937**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 26
MATERIAL DESCRIPTION: 12"x12" Tan VFT Mastic REMOVED
HISTORICAL AHERA DAMAGE CATEGORY ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: NE Gym Vestibule 1937 - REMOVED

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Material REMOVED, unknown date

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12"x12" Tan VFT Mastic REMOVED**
MATERIAL LOCATION: **NE Gym Vestibule 1937 - REMOVED**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 27
MATERIAL DESCRIPTION: 12"x12" Blue/Gray VFT Mastic - REMOVED
HISTORICAL AHERA DAMAGE CATEGORY ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: NE Gym Vestibule 1937 - REMOVED

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Material REMOVED, unknown date

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12"x12" Blue/Gray VFT Mastic - REMOVED**
MATERIAL LOCATION: **NE Gym Vestibule 1937 - REMOVED**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12"x12" Off White VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office - 1937**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **12"x12" Off White VFT Mastic**
MATERIAL LOCATION: **Engineer's Office - 1937**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12 x 12 inch White w/Tan Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 201, 202 & 204 (all under existing VFT); Teacher's Lounge - 1951**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **12 x 12 inch White w/Tan Specks VFT**
MATERIAL LOCATION: **Rooms 201, 202 & 204 (all under existing VFT); Teacher's Lounge - 1951**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUILDING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 29 A
MATERIAL DESCRIPTION: 12 x 12 inch White w/Tan Specks VFT Mastic
HISTORICAL AHERA DAMAGE CATEGORY: 6 ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: Assumed FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Rooms 201, 202 & 204 (all under existing VFT); Teacher's Lounge - 1951
MATERIAL QUANTITY: 4000 MATERIAL UNITS: SF
DAMAGE QUANTITY: DAMAGE UNITS: SF

COMMENTS:

Inspector's Signature: Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **29 A**
MATERIAL DESCRIPTION: **12 x 12 inch White w/Tan Specks VFT Mastic**
MATERIAL LOCATION: **Rooms 201, 202 & 204 (all under existing VFT); Teacher's Lounge - 1951**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12 x 12 inch White VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 109 - 1937 Building**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12 x 12 inch White VFT**
MATERIAL LOCATION: **Room 109 - 1937 Building**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30 A**
MATERIAL DESCRIPTION: **12 x 12 inch White VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 109 - 1937 Building**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: *Roberto Rivera*

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **30 A**
MATERIAL DESCRIPTION: **12 x 12 inch White VFT Mastic**
MATERIAL LOCATION: **Room 109 - 1937 Building**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12"X12" White w/Blue Gray Specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Corridor (Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Some VFT, NOT reflected in the Material Quantity here, were abated in 2010**

Inspector's Signature: 

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12"X12" White w/Blue Gray Specks VFT**
MATERIAL LOCATION: **1st Floor Corridor (Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31A**
MATERIAL DESCRIPTION: **12"X12" White w/Blue Gray Specks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Corridor (Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)**

MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS: **Some VFT, NOT reflected in the Material Quantity here, were abated in 2010**

Inspector's Signature: 

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **31A**
MATERIAL DESCRIPTION: **12"X12" White w/Blue Gray Specks VFT Mastic**
MATERIAL LOCATION: **1st Floor Corridor (Some VFT, NOT reflected in the Material Quantity here, were abated in 2010)**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **18"X18' Carpet Squares Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office; Library 209**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **18"X18' Carpet Squares Mastic**
MATERIAL LOCATION: **Main Office; Library 209**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: A
MATERIAL DESCRIPTION: Cardboard Pipe Insulation
HISTORICAL AHERA DAMAGE CATEGORY 1 Damaged or significantly damaged friable thermal system insulating ACBM
HISTORICAL DAMAGE REASON: Deterioration
HISTORICAL RESPONSE ACTION: Repair
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: Deterioration
DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: All Unfinished Pipe Areas, Boiler Room, Engineer Storage, Janitor Room - 1937
MATERIAL QUANTITY: 430 MATERIAL UNITS: LF
DAMAGE QUANTITY: DAMAGE UNITS: LF
COMMENTS: Damage in Unfinished Pipe Area

Inspector's Signature: Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
MATERIAL LOCATION: **All Unfinished Pipe Areas, Boiler Room, Engineer Storage, Janitor Room - 1937**
MATERIAL QUANTITY: **430** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **40** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All Unfinished Pipe Areas, Boiler Room, Engineer Storage, Janitor Room - 1937**
MATERIAL QUANTITY: **41** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS: **Damage in Unfinished Pipe Area**

Inspector's Signature: 

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
MATERIAL LOCATION: **All Unfinished Pipe Areas, Boiler Room, Engineer Storage, Janitor Room - 1937**
MATERIAL QUANTITY: **41** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **3** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM

Management Planner's Signature: _____



Date: 05/10/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: C
MATERIAL DESCRIPTION: MJP E/F/V on Fiberglass Pipe Insulation
HISTORICAL AHERA DAMAGE CATEGORY 6 ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Basement Storage Area by Electrical Room - 1937
MATERIAL QUANTITY: 30 MATERIAL UNITS: LF
DAMAGE QUANTITY: DAMAGE UNITS: LF

COMMENTS:

Inspector's Signature: Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation**
MATERIAL LOCATION: **Basement Storage Area by Electrical Room - 1937**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUILDING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: E
MATERIAL DESCRIPTION: Aircell Pipe Insulation
HISTORICAL AHERA DAMAGE CATEGORY: 1 ACBM with potential for significant damage
HISTORICAL DAMAGE REASON: Deterioration
HISTORICAL RESPONSE ACTION: Repair
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: Deterioration
DISTURBANCE POTENTIAL: MODERATE
MATERIAL LOCATION: All Unfinished Pipe Areas, Boiler Room, Janitor Room, Tunnel, Engineer Storage - 1937
MATERIAL QUANTITY: 880 MATERIAL UNITS: LF
DAMAGE QUANTITY: DAMAGE UNITS: LF
COMMENTS: Damage in Unfinished Pipe Area

Inspector's Signature: Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **All Unfinished Pipe Areas, Boiler Room, Janitor Room, Tunnel, Engineer Storage - 1937**
MATERIAL QUANTITY: **880** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **20** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: F
MATERIAL DESCRIPTION: MJP E/F/V on Aircell Pipe Insulation
HISTORICAL AHERA DAMAGE CATEGORY 1 Damaged or significantly damaged friable thermal system insulating ACBM
HISTORICAL DAMAGE REASON: Deterioration
HISTORICAL RESPONSE ACTION: Repair
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: Deterioration
DISTURBANCE POTENTIAL: MODERATE
MATERIAL LOCATION: All Unfinished Pipe Areas, Boiler Room, Janitor Room, Tunnel, Engineer Storage - 1937
MATERIAL QUANTITY: 136 MATERIAL UNITS: LF
DAMAGE QUANTITY: DAMAGE UNITS: LF
COMMENTS: Damage in Unfinished Pipe Area

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
MATERIAL LOCATION: **All Unfinished Pipe Areas, Boiler Room, Janitor Room, Tunnel, Engineer Storage - 1937**
MATERIAL QUANTITY: **136** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **5** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM

Management Planner's Signature: _____

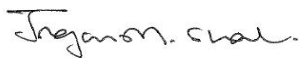

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: G
MATERIAL DESCRIPTION: Aircell Duct Covering
HISTORICAL AHERA DAMAGE CATEGORY 1 ACBM with the potential for damage
HISTORICAL DAMAGE REASON: Delamination
HISTORICAL RESPONSE ACTION: Repair
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: Delamination
DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Unexcavated Areas, Boiler Room - 1937
MATERIAL QUANTITY: 2400 MATERIAL UNITS: SF
DAMAGE QUANTITY: DAMAGE UNITS: SF
COMMENTS: Damage in Unexcavated Areas

Inspector's Signature:



Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Aircell Duct Covering**
MATERIAL LOCATION: **Unexcavated Areas, Boiler Room - 1937**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **200** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM

Management Planner's Signature: _____

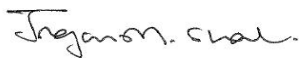

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: K
MATERIAL DESCRIPTION: Cardboard Pipe Insulation
HISTORICAL AHERA DAMAGE CATEGORY 1 Damaged or significantly damaged friable thermal system insulating ACBM
HISTORICAL DAMAGE REASON: Deterioration
HISTORICAL RESPONSE ACTION: Repair
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: Deterioration
DISTURBANCE POTENTIAL: MODERATE
MATERIAL LOCATION: Pump Room, Fan Room, All Unfinished Areas - 1951
MATERIAL QUANTITY: 450 MATERIAL UNITS: LF
DAMAGE QUANTITY: DAMAGE UNITS: LF
COMMENTS: Damage in Unfinished Areas

Inspector's Signature: Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
MATERIAL LOCATION: **Pump Room, Fan Room, All Unfinished Areas - 1951**
MATERIAL QUANTITY: **450** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **30** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM

Management Planner's Signature: _____

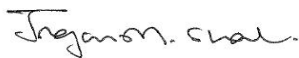

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUILDING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: L
MATERIAL DESCRIPTION: MJP E/F/V on Cardboard Pipe Insulation
HISTORICAL AHERA DAMAGE CATEGORY: 1 ACBM with the potential for damage
HISTORICAL DAMAGE REASON: Deterioration
HISTORICAL RESPONSE ACTION: Repair
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: Deterioration
DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Pump Room, Fan Room, All Unfinished Areas - 1951
MATERIAL QUANTITY: 45 MATERIAL UNITS: LF
DAMAGE QUANTITY: DAMAGE UNITS: LF
COMMENTS: Damage in Unfinished Areas

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**
MATERIAL LOCATION: **Pump Room, Fan Room, All Unfinished Areas - 1951**
MATERIAL QUANTITY: **45** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **3** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUIDLING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: M
MATERIAL DESCRIPTION: Aircell Pipe Insulation
HISTORICAL AHERA DAMAGE CATEGORY 1 Damaged or significantly damaged friable thermal system insulating ACBM
HISTORICAL DAMAGE REASON: Delamination
HISTORICAL RESPONSE ACTION: Repair
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: Delamination
DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Pump Room, Fan Room, All Unfinished Areas - 1951
MATERIAL QUANTITY: 635 MATERIAL UNITS: LF
DAMAGE QUANTITY: DAMAGE UNITS: LF
COMMENTS: Damage in Unfinished Areas

Inspector's Signature: Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Pump Room, Fan Room, All Unfinished Areas - 1951**
MATERIAL QUANTITY: **635** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **60** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Pump Room, Fan Room, All Unfinished Areas - 1951**
MATERIAL QUANTITY: **64** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **64** DAMAGE UNITS: **LF**
COMMENTS: **Damage in Unfinished Areas**

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **MJP E/F/V on Aircell Pipe Insulation**
MATERIAL LOCATION: **Pump Room, Fan Room, All Unfinished Areas - 1951**
MATERIAL QUANTITY: **64** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **5** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM

Management Planner's Signature: _____

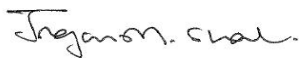

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler Room - 1937**

MATERIAL QUANTITY: **35**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **02/24/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUIDLING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **0**
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**
MATERIAL LOCATION: **Boiler Room - 1937**
MATERIAL QUANTITY: **35** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 23301 BUILDING ID: 3510
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Roberto Rivera
SCHOOL NAME: Garvy School, John INSPECTION DATE: 2/24/2016
ADDRESS: 5225 N Oak Park Avenue IDPH LICENSE NO: 100-06327

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: P
MATERIAL DESCRIPTION: MJP E/F/V on Mag Block Pipe Insulation
HISTORICAL AHERA DAMAGE CATEGORY: 6 ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: Chrysotile FRIABLE: Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW
MATERIAL LOCATION: Boiler Room - 1937
MATERIAL QUANTITY: 8 MATERIAL UNITS: LF
DAMAGE QUANTITY: DAMAGE UNITS: LF

COMMENTS:

Inspector's Signature: Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **P**
MATERIAL DESCRIPTION: **MJP E/F/V on Mag Block Pipe Insulation**
MATERIAL LOCATION: **Boiler Room - 1937**
MATERIAL QUANTITY: **8** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **125A**
MATERIAL DESCRIPTION: **12X12 light beige with tan streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 201, 202, 204, and 206 - 1951 Bldg**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **125A**
MATERIAL DESCRIPTION: **12X12 light beige with tan streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 201, 202, 204, and 206 - 1951 Bldg**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **127**
MATERIAL DESCRIPTION: **2' x 4' Ceiling Tile**
MATERIAL LOCATION: **Rms 101, 102, 103, and 104; 1st Floor Corridor - 1951 Bldg**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature:  Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**


HOMOGENEOUS AREA: **128A**
MATERIAL DESCRIPTION: **12" X 12" Sand VFT Mastic**
MATERIAL LOCATION: **Assembly Hall - 1937 Bldg.**
MATERIAL QUANTITY: **2600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

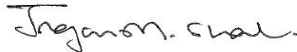

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **126**
MATERIAL DESCRIPTION: **2 x 4 Ceiling Tile**
MATERIAL LOCATION: **Rooms 107, 108, 109, 110, 111, and 112; 1st Floor Corridor - 1937 Bldg**
MATERIAL QUANTITY: **4900** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **126**
MATERIAL DESCRIPTION: **2 x 4 Ceiling Tile**
MATERIAL LOCATION: **Rooms 107, 108, 109, 110, 111, and 112; 1st Floor Corridor - 1937 Bldg**
MATERIAL QUANTITY: **4900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

Jigar Shah

Date: 05/10/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **128**
MATERIAL DESCRIPTION: **12" X 12" Sand VFT**
MATERIAL LOCATION: **Assembly Hall - 1937 Bldg.**
MATERIAL QUANTITY: **2600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Roberto Rivera**
SCHOOL NAME: **Garvy School, John** INSPECTION DATE: **2/24/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **125**
MATERIAL DESCRIPTION: **12X12 light beige with tan streaks VFT**
MATERIAL LOCATION: **Rooms 201, 202, 204, and 206 - 1951 Bldg**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____

Roberto Rivera

Date: 02/24/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23301** BUILDING ID: **3510**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Garvy School, John** REVIEW DATE: **5/10/2016**
ADDRESS: **5225 N Oak Park Avenue** IDPH LICENSE NO: **100-06327**

HOMOGENEOUS AREA: **125**
MATERIAL DESCRIPTION: **12X12 light beige with tan streaks VFT**
MATERIAL LOCATION: **Rooms 201, 202, 204, and 206 - 1951 Bldg**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

Jigar Shah

Date: **05/10/2016**

APPENDIX B

Inspector and Management Planner Licenses

2016



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Roberto Rivera

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 1/6/2016

Exam Date: 1/6/2016

Expiration Date: 1/6/2017

Certificate Number: BIR1601060030



Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

4/20/2016

ROBERTO RIVERA
855 WEST ADAMS STREET, STE 200
CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 06327

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License


 <p>ASBESTOS PROFESSIONAL LICENSE</p>			<p>ENDORSEMENTS</p> <p>SUPERVISOR/WORKER INSPECTOR</p>	<p>TC EXPIRES</p> <p>1/20/2017 1/6/2017</p>
<p>ID NUMBER 000 - 06327</p>	<p>ISSUED 4/20/2016</p>	<p>EXPIRES 05/15/2017</p>	<p>PROJECT MANAGER AIR SAMPLING PROFESSIONAL</p>	<p>1/20/2017</p>
<p>ROBERTO RIVERA 855 WEST ADAMS STREET, ST CHICAGO, IL 60607</p> <p>Environmental Health</p>			<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

2016

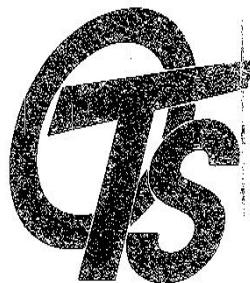

OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016

Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270320


Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

4/20/2016

JIGAR M SHAH
 855 W ADAMS ST, SUITE 200
 CHICAGO, IL 60607


ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

		ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 109 - 07342	ISSUED 4/20/2016	EXPIRES 05/15/2017		INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/19/2017 2/2/2017 1/27/2017 2/26/2017
JIGAR M SHAH 855 W ADAMS ST, SUITE 200 CHICAGO, IL 60607 Environmental Health		Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.			

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
 EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed