

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2220
SCHOOL NAME: Goethe School
ADDRESS OF SCHOOL: 2236 N. Rockwell Avenue
CITY: Chicago, IL, 60647

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/11/2013**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 5/18/2016 ENROLLMENT 784
IDPH INSPECTOR LICENSE NUMBER: 100-07210
IDPH LICENSED INSPECTOR NAME (Please Print): Michael Holvay
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



5/18/2016

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Goethe School

2236 N. Rockwell Avenue
Chicago, IL, 60647

Unit: 23341
Building ID: 3560

IDPH ID Number: 14-016-2990-2220

REPORT DATE:

Wednesday, May 18, 2016

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone (312) 733-6262

Fax (312) 733-5612

DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW

March 2, 2016

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

GSG Consultants, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1,2,6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 23341 Region: 02 IDPH ID: 14-016-2990-2220

School: Goethe School Building ID: 3560

Address: 2236 N. Rockwell Avenue
Chicago, IL, 60647

Building Contact: Mcardle, James Contact Phone: 773-624-3340

Current Building Owners: Chicago Public Schools

Review Date: 04/18/2016

Inspector: Michael Holvay Inspector IDPH License: 100-07210
Management Planner: Jigar Shah Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 733-6262

Sincerely,
GSG Consultants, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 02, 2016

RE: Goethe School, Unit 23341
2236 N. Rockwell Avenue
Chicago, IL, 60647

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Goethe School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Goethe School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197.

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School:	Goethe School	Unit:	23341	Region:	02
Address:	2236 N. Rockwell Avenue		Chicago, IL, 60647		
IDPH ID:	14-016-2990-2220		Building ID:	3560	
Contact:	Mcardle, James		Phone:	773-624-3340	

2. Description of Facility

Original Construction:	1895	Additional Construction:	1988
Total Square Footage:	57508	No of Floors:	3
Current Occupancy:	784		

3. LEA Designated Person

Contact:	Robert Christlieb	Phone:	(773) 553-3197
Address:	125 South Clark Street, 17th Floor		
	Chicago, IL 60603		


4. Managing Environmental Consultant

MEC:	GSG Consultants, Inc.		
Contact:	Arturo Saenz		
Address	855 W. Adams St., Ste. 200		
Phone:	(312) 733-6262	Fax:	(312) 733-5612

5. Inspector

Inspector Name: Michael Holvay


Inspector IDPH license # 100-07210

Signature: 
Date: 3/2/2016

6. Management Planner

Management Planner Name: Jigar Shah


Management Planner IDPH license # 100-07342

Signature: 
Date: 04/18/2016

7. Review Date: 04/18/2016

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 5/18/2016

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

GSG Consultants, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Goethe School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3560:

08	MJP E/F/V on Aircell Pipe Insulation
09	Cardboard Pipe Insulation
10	MJP E/F/V on Cardboard Pipe Insulation
12	Aircell Duct Insulation
19	12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)
20	12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)
21	12" x 12" Brown w/ Wht. & Black Specks VFT(NOT OBSERVED)

B. The following new homogenous areas have been identified for Building 3560:

40	1x1 White Ceiling Tile
41	1x1 White Ceiling Tile Matic
42	Tank Insulation

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01	Hard Coat Plaster
02	2'x4' Ceiling Tile
04	12"x12" Beige w/ Brown Spots VFT
05	12"x12" White VFT
06	12"x12" Brown w/ White Spots VFT
19	12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)
20	12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)
21	12" x 12" Brown w/ Wht. & Black Specks VFT(NOT OBSERVED)
27	1' x 1' White w/ Grooves Ceiling Tile
28	1' x 1' White w/ Grooves Ceiling Tile Mastic
29	1' x 1' White w/ Dots and Grooves Ceiling Tile
30	1' x 1' White w/ Dots & Grooves Cng. Tile Mastic
31	Vinyl Baseboard
32	Vinyl Baseboard Mastic
33	Drywall
34	Drywall Joint Compound
37	12x12 White w/ Tan Specs VFT
37M	12x12 White w/ tan specs VFT Mastic
38	12x12 Green with Gray + Dark Green specs VFT
38M	12x12 Green w/ gray + Dark green specs VFT Mastic
39	White Spray-On Under sink coating
40	1x1 White Ceiling Tile
41	1x1 White Ceiling Tile Matic
42	Tank Insulation

The following areas were deemed to be inaccessible:

40	1x1 White Ceiling Tile
41	1x1 White Ceiling Tile Matic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Michael Holvay, IDPH License # 100-07210. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and

Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Goethe School Building 3560 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Goethe School Unit 23341 Building ID 3560

Address 2236 N. Rockwell Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Hard Coat Plaster	60,000	SF	Throughout - 1885 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
02	2'x4' Ceiling Tile	500	SF	Room 106 - 1885 Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
03	12"x12" Brown VFT	16,700	SF	Throughout - 1885 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
04	12"x12" Beige w/ Brown Spots VFT	2,500	SF	Rooms 106 & 206 - 1st , 2nd floor corridors. 1885 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
05	12"x12" White VFT	1,500	SF	First and Second Floor Hallways, Lunchroom Managers office, Kitchen, Room 001-1885 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
06	12"x12" Brown w/ White Spots VFT	1,500	SF	First and Second Floor Hallways, Lunchroom Managers office, Kitchen - 1885 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
07	Air Cell Pipe Insulation	180	LF	Rooms 001, 002, 003, 004, Boiler Room, Coal Room-1885 Building	CHR	TSI	Y	LOC	1		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	MODERATE
08	MJP E/F/V on Aircell Pipe Insulation	35	LF	Rooms 001, 002, 003, 004, Boiler Room, Coal Room, Basement corridor's-1885 Building	CHR	TSI	Y	NONE	3		Yes	Damaged or significantly damaged friable thermal system insulating ACBM		LOW
09	Cardboard Pipe Insulation	320	LF	Coal Room, Room 003, Room 004 and 004 Storage Room, Basement Corridor, South Fan Room, Boys + Girls Toilet, Basement- 1885 Building	CHR	TSI	Y	LOC	5		Yes	Damaged or significantly damaged friable thermal system insulating ACBM		MODERATE
10	MJP E/F/V on Cardboard Pipe Insulation	21	LF	Coal Room, Room 003, Room 004 and 004 Storage Room, Basement Corridor, South Fan Room, Boys+Girls Toilet,	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage		MODERATE

Chicago Public Schools

School Goethe School Unit 23341 Building ID 3560

Address 2236 N. Rockwell Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Bastment- 1885 Building										
11	MJP E/F/V on Fiberglass Pipe Insulation	124	LF	Basement Girls Toilet, Rooms 001, 003, 004, 104 wardrobe, Basement Corridor, Pump Room, N. Fan Room- 1885 Building	CHR	TSI	Y	NONE	17		No	Damaged or significantly damaged friable thermal system insulating ACBM		MODERATE
12	Aircell Duct Insulation	480	SF	Basement Corridor- 1885 Building	CHR	TSI	Y	DIST	2		Yes	Damaged or significantly damaged friable thermal system insulating ACBM	2	LOW
13	12"x12" Brown VFT Mastic	18,450	SF	Throughout - 1885 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	12"x12" Beige w/ Brown Spots VFT Mastic	1,350	SF	Rooms 106 & 206- 1885 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	12"x12" White VFT Mastic	2,500	SF	First and Second Floor Hallways, Lunchroom, Managers office, Kitchen, RM 001 - 1885 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	12" x12" Brown w/ White Spots VFT Mastic	2,500	SF	First and Second Floor Corridors, Lunchroom Managers office, Kitchen, - 1885 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	9" x 9" Brown w/ Streaks VFT	180	SF	Room 308 Wardrobe- 1885 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
18	9" x 9" Brown w/ Streaks VFT Mastic	180	SF	Room 308 Wardrobe- 1885 Building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)	0		Room # 500 through # 503 - 1987 Annex	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
20	12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)	0		Room # 500 through # 503 - 1987 Annex	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
21	12" x 12" Brown w/ Wht. & Black Specks VFT(NOT OBSERVED)	0		Throughout - 1987 Annex	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
22	12" x 12" Brown w/ Wht. & Black Specks VFT Mastic (ABATED)			Throughout (See Hatching Maps) - 1987 Annex	ABATED						No			

Chicago Public Schools

School Goethe School Unit 23341 Building ID 3560

Address 2236 N. Rockwell Avenue Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
23	12" x 12" Beige w/ Brown Specks VFT (ABATED)			Room 400, AP Room - 1987 Annex	ABATED						No			
24	12" x 12" Beige w/ Brown Specks VFT Mastic (ABATED)			Room 400, AP Room - 1987 Annex	ABATED						No			
25	12" x 12" White w/ Blue Specks VFT (NOT OBSERVED)			Room # 401 - 1987 Annex							No			
26	12" x 12" White w/ Blue Specks VFT Mastic (NOT OBSERVED)			Room # 401 - 1987 Annex							No			
27	1' x 1' White w/ Grooves Ceiling Tile	20,000	SF	Throughout - 1987 Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
28	1' x 1' White w/ Grooves Ceiling Tile Mastic	20,000	SF	Throughout - 1987 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	1' x 1' White w/ Dots and Grooves Ceiling Tile	1,200	SF	Room 400 - 1987 Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
30	1' x 1' White w/ Dots & Grooves Clng. Tile Mastic	1,200	SF	Room 400 - 1987 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	Vinyl Baseboard	3,500	LF	Throughout - 1987 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	Vinyl Baseboard Mastic	3,500	LF	Throughout - 1987 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	Drywall	50,000	SF	Throughout - 1987 Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
34	Drywall Joint Compound	5,000	LF	Throughout - 1987 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)			Lunchroom--REMOVED	ABATED	MISC								Low
36	12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)			Lunchroom--REMOVED	ABATED	MISC		None						Low
37	12x12 White w/ Tan Specs VFT	14,000	SF	1st fl classrooms (400 thru 405) + staff rooms #06-#09; 2nd fl classrooms(500 thru 507)--1987 annex bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
37M	12x12 White w/ tan specs VFT Mastic	14,000	SF	1st fl classrooms (400 thru 405) + staff rooms #06-#09; 2nd fl classrooms(500 thru 507)--1987 annex bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12x12 Green with Gray + Dark Green specs VFT	7,800	SF	1st fl corridor (4000 SF); 2nd fl corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Goethe School **Unit** 23341 **Building ID** 3560

Address 2236 N. Rockwell Avenue **Region** 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				(3800 SF)--1987 annex bldg										
38M	12x12 Green w/ gray + Dark green specs VFT Mastic	7,800	SF	1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	White Spray-On Under sink coating	3	SF	under sink in cabinet room #402--1987 annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	1x1 White Ceiling Tile	2,800	SF	3rd Floor Gym	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
41	1x1 White Ceiling Tile Matic	2,800	SF	3rd Floor Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	Tank Insulation	40	SF	Boiler Room	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Goethe School **Unit** 23341 **Building ID** 3560

Address 2236 N. Rockwell Avenue **Region** 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

Reinspection Date **3/2/2016**

Inspector Name **Michael Holvay**

100-07210

1/18/2017

Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
03	
04	
05	
06	
07	Damage located in Boiler Room
08	
09	Damage located in basement boys toilet room
10	
11	
12	minor delamination in Basement Corridor
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	

Chicago Public Schools

School Goethe School **Unit** 23341 **Building ID** 3560

Address 2236 N. Rockwell Avenue **Region** 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
37M	
38	
38M	
39	
40	
41	
42	

Table II

Management Planner's Review

Chicago Public Schools

School Goethe School
Address 2236 N. Rockwell Avenue

Unit 23341
Chicago, IL, 60647

Building ID 3560
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Hard Coat Plaster	60,000	SF	Throughout - 1885 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02	2'x4' Ceiling Tile	500	SF	Room 106 - 1885 Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	12"x12" Brown VFT	16,700	SF	Throughout - 1885 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	12"x12" Beige w/ Brown Spots VFT	2,500	SF	Rooms 106 & 206 - 1st , 2nd floor corridors. 1885 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	12"x12" White VFT	1,500	SF	First and Second Floor Hallways, Lunchroom Managers office, Kitchen, Room 001- 1885 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	12"x12" Brown w/ White Spots VFT	1,500	SF	First and Second Floor Hallways, Lunchroom Managers office, Kitchen - 1885 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	Air Cell Pipe Insulation	180	LF	Rooms 001, 002, 003, 004, Boiler Room, Coal Room- 1885 Building	Chrysotile	TSI	Yes	1	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
08	MJP E/F/V on Aircell Pipe Insulation	35	LF	Rooms 001, 002, 003, 004, Boiler Room, Coal Room, Basement corridor's- 1885 Building	Chrysotile	TSI	Yes	3	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
09	Cardboard Pipe Insulation	320	LF	Coal Room, Room 003, Room 004 and 004 Storage Room, Basement Corridor, South Fan Room, Boys + Girls Toilet, Basement- 1885 Building	Chrysotile	TSI	Yes	5	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
10	MJP E/F/V on Cardboard Pipe Insulation	21	LF	Coal Room, Room 003, Room 004 and 004 Storage Room, Basement Corridor, South Fan Room, Boys+Girls Toilet, Bastment- 1885 Building	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
11	MJP E/F/V on Fiberglass Pipe Insulation	124	LF	Basement Girls Toilet, Rooms 001, 003, 004, 104 wardrobe, Basement Corridor, Pump Room, N. Fan Room- 1885 Building	Chrysotile	TSI	Yes	17	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
12	Aircell Duct Insulation	480	SF	Basement Corridor- 1885 Building	Chrysotile	TSI	Yes	2	SF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
13	12"x12" Brown VFT Mastic	18,450	SF	Throughout - 1885 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	12"x12" Beige w/ Brown Spots VFT Mastic	1,350	SF	Rooms 106 & 206- 1885 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12"x12" White VFT Mastic	2,500	SF	First and Second Floor Hallways, Lunchroom, Managers office, Kitchen, RM 001 - 1885 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	12" x12" Brown w/ White Spots VFT Mastic	2,500	SF	First and Second Floor Corridors,	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Goethe School

Unit 23341

Building ID 3560

Address 2236 N. Rockwell Avenue

Chicago, IL, 60647

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Lunchroom Managers office, Kitchen, - 1885 Building							
17	9" x 9" Brown w/ Streaks VFT	180	SF	Room 308 Wardrobe- 1885 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	9" x 9" Brown w/ Streaks VFT Mastic	180	SF	Room 308 Wardrobe- 1885 Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)	0		Room # 500 through # 503 - 1987 Annex	Assumed	MISC	No	0		6 ACBM with the potential for damage	
20	12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)	0		Room # 500 through # 503 - 1987 Annex	Assumed	MISC	No	0		6 ACBM with the potential for damage	
21	12" x 12" Brown w/ Wht. & Black Specks VFT(NOT OBSERVED)	0		Throughout - 1987 Annex	Assumed	MISC	No	0		6 ACBM with the potential for damage	
22	12" x 12" Brown w/ Wht. & Black Specks VFT Mastic (ABATED)			Throughout (See Hatching Maps) - 1987 Annex	Abated						
23	12" x 12" Beige w/ Brown Specks VFT (ABATED)			Room 400, AP Room - 1987 Annex	Abated						
24	12" x 12" Beige w/ Brown Specks VFT Mastic (ABATED)			Room 400, AP Room - 1987 Annex	Abated						
25	12" x 12" White w/ Blue Specks VFT (NOT OBSERVED)			Room # 401 - 1987 Annex							
26	12" x 12" White w/ Blue Specks VFT Mastic (NOT OBSERVED)			Room # 401 - 1987 Annex							
27	1' x 1' White w/ Grooves Ceiling Tile	20,000	SF	Throughout - 1987 Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	1' x 1' White w/ Grooves Ceiling Tile Mastic	20,000	SF	Throughout - 1987 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	1' x 1' White w/ Dots and Grooves Ceiling Tile	1,200	SF	Room 400 - 1987 Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	1' x 1' White w/ Dots & Grooves Cing. Tile Mastic	1,200	SF	Room 400 - 1987 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	Vinyl Baseboard	3,500	LF	Throughout - 1987 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
32	Vinyl Baseboard Mastic	3,500	LF	Throughout - 1987 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
33	Drywall	50,000	SF	Throughout - 1987 Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	Drywall Joint Compound	5,000	LF	Throughout - 1987 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
35	12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)			Lunchroom--REMOVED	Abated	MISC					
36	12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)			Lunchroom--REMOVED	Abated	MISC					
37	12x12 White w/ Tan Specs VFT	14,000	SF	1st fl classrooms (400 thru 405) + staff rooms #06-#09; 2nd fl classrooms(500 thru 507)--1987 annex bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37M	12x12 White w/ tan specs VFT Mastic	14,000	SF	1st fl classrooms (400 thru 405) + staff rooms #06-#09; 2nd fl classrooms(500	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Goethe School
Address 2236 N. Rockwell Avenue

Unit 23341
Chicago, IL, 60647

Building ID 3560
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				thru 507)--1987 annex bldg							
38	12x12 Green with Gray + Dark Green specs VFT	7,800	SF	1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)--1987 annex bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38M	12x12 Green w/ gray + Dark green specs VFT Mastic	7,800	SF	1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	White Spray-On Under sink coating	3	SF	under sink in cabinet room #402--1987 annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	1x1 White Ceiling Tile	2,800	SF	3rd Floor Gym	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	1x1 White Ceiling Tile Matic	2,800	SF	3rd Floor Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	Tank Insulation	40	SF	Boiler Room	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Goethe School
Address 2236 N. Rockwell Avenue

Unit 23341
Chicago, IL, 60647

Building ID 3560
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

Review Date	4/18/2016
Manager Planner Name	Jigar Shah
100-07342	1/19/2017
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	
04	
05	
06	
07	Repair Damaged ACM ASAP; Follow O & M
08	Repair Damaged ACM ASAP; Follow O & M
09	Repair Damaged ACM, Follow O & M
10	
11	Repair Damage ASAP, Follow O & M
12	Repair Damaged ACM ASAP; Follow O & M
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	

Chicago Public Schools

School Goethe School
Address 2236 N. Rockwell Avenue

Unit 23341
Chicago, IL, 60647

Building ID 3560
Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.
855 W. Adams St., Ste. 200
Phone: (312) 733-6262 Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
37M	
38	
38M	
39	
40	
41	
42	

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	01		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout - 1885 Building**

MATERIAL QUANTITY: **60000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	01		
MATERIAL DESCRIPTION:	Hard Coat Plaster		
MATERIAL LOCATION:	Throughout - 1885 Building		
MATERIAL QUANTITY:	60000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02		
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 Damaged or significantly damaged friable misc. ACBM		
HISTORICAL DAMAGE REASON:	Water		
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 106 - 1885 Building**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	02		
MATERIAL DESCRIPTION:	2'x4' Ceiling Tile		
MATERIAL LOCATION:	Room 106 - 1885 Building		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **12"x12" Brown VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout - 1885 Building**
MATERIAL QUANTITY: **16700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	03		
MATERIAL DESCRIPTION:	12"x12" Brown VFT		
MATERIAL LOCATION:	Throughout - 1885 Building		
MATERIAL QUANTITY:	16700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	04		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Brown Spots VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 106 & 206 - 1st , 2nd floor corridors. 1885 Building		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	04		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Brown Spots VFT		
MATERIAL LOCATION:	Rooms 106 & 206 - 1st , 2nd floor corridors. 1885 Building		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **12"x12" White VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **First and Second Floor Hallways, Lunchroom Managers office, Kitchen, Room 001-1885 Building**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	12"x12" White VFT		
MATERIAL LOCATION:	First and Second Floor Hallways, Lunchroom Managers office, Kitchen, Room 001- 1885 Building		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **12"x12" Brown w/ White Spots VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **First and Second Floor Hallways, Lunchroom Managers office, Kitchen - 1885 Building**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	06		
MATERIAL DESCRIPTION:	12"x12" Brown w/ White Spots VFT		
MATERIAL LOCATION:	First and Second Floor Hallways, Lunchroom Managers office, Kitchen - 1885 Building		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07		
MATERIAL DESCRIPTION:	Air Cell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 Damaged or significantly damaged friable thermal system insulating ACM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 001, 002, 003, 004, Boiler Room, Coal Room- 1885 Building		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:	Damage located in Boiler Room		

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	07		
MATERIAL DESCRIPTION:	Air Cell Pipe Insulation		
MATERIAL LOCATION:	Rooms 001, 002, 003, 004, Boiler Room, Coal Room- 1885 Building		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	1	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM ASAP; Follow O & M

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 Damaged or significantly damaged friable thermal system insulating ACM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 001, 002, 003, 004, Boiler Room, Coal Room, Basement corridor's- 1885 Building**

MATERIAL QUANTITY: **35** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	MJP E/F/V on Aircell Pipe Insulation		
MATERIAL LOCATION:	Rooms 001, 002, 003, 004, Boiler Room, Coal Room, Basement corridor's- 1885 Building		
MATERIAL QUANTITY:	35	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	3	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM ASAP; Follow O & M

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Coal Room, Room 003, Room 004 and 004 Storage Room, Basement Corridor, South Fan Room, Boys + Girls Toilet, Basement- 1885 Building**

MATERIAL QUANTITY: **320** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS: **Damage located in basement boys toilet room**

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
MATERIAL LOCATION:	Coal Room, Room 003, Room 004 and 004 Storage Room, Basement Corridor, South Fan Room, Boys + Girls Toilet, Basement- 1885 Building		
MATERIAL QUANTITY:	320	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	5	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair Damaged ACM, Follow O & M

Management Planner's Signature: _____



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Coal Room, Room 003, Room 004 and 004 Storage Room, Basement Corridor, South Fan Room, Boys+Girls Toilet, Basement- 1885 Building**

MATERIAL QUANTITY: **21** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
MATERIAL LOCATION:	Coal Room, Room 003, Room 004 and 004 Storage Room, Basement Corridor, South Fan Room, Boys+Girls Toilet, Basement- 1885 Building		
MATERIAL QUANTITY:	21	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 Damaged or significantly damaged friable thermal system insulating ACM		
HISTORICAL DAMAGE REASON:	Deterioration Physical Damage		
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Basement Girls Toilet, Rooms 001, 003, 004, 104 wardrobe, Basement Corridor, Pump Room, N. Fan Room- 1885 Building**

MATERIAL QUANTITY: **124**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	MJP E/F/V on Fiberglass Pipe Insulation		
MATERIAL LOCATION:	Basement Girls Toilet, Rooms 001, 003, 004, 104 wardrobe, Basement Corridor, Pump Room, N. Fan Room- 1885 Building		
MATERIAL QUANTITY:	124	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	17	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damage ASAP, Follow O & M

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	Aircell Duct Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 Damaged or significantly damaged friable thermal system insulating ACM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes


RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON:	Delamination		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement Corridor- 1885 Building		
MATERIAL QUANTITY:	480	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	minor delamination in Basement Corridor		

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	12		
MATERIAL DESCRIPTION:	Aircell Duct Insulation		
MATERIAL LOCATION:	Basement Corridor- 1885 Building		
MATERIAL QUANTITY:	480	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	2	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair Damaged ACM ASAP; Follow O & M

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **12"x12" Brown VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout - 1885 Building**

MATERIAL QUANTITY: **18450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	13		
MATERIAL DESCRIPTION:	12"x12" Brown VFT Mastic		
MATERIAL LOCATION:	Throughout - 1885 Building		
MATERIAL QUANTITY:	18450	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" Beige w/ Brown Spots VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 106 & 206- 1885 Building**
MATERIAL QUANTITY: **1350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	12"x12" Beige w/ Brown Spots VFT Mastic		
MATERIAL LOCATION:	Rooms 106 & 206- 1885 Building		
MATERIAL QUANTITY:	1350	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" White VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First and Second Floor Hallways, Lunchroom, Managers office, Kitchen, RM 001 - 1885 Building**

MATERIAL QUANTITY: **2500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	12"x12" White VFT Mastic		
MATERIAL LOCATION:	First and Second Floor Hallways, Lunchroom, Managers office, Kitchen, RM 001 - 1885 Building		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	12" x12" Brown w/ White Spots VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	First and Second Floor Corridors, Lunchroom Managers office, Kitchen, - 1885 Building		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	12" x12" Brown w/ White Spots VFT Mastic		
MATERIAL LOCATION:	First and Second Floor Corridors, Lunchroom Managers office, Kitchen, - 1885 Building		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	9" x 9" Brown w/ Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 308 Wardrobe- 1885 Building		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	9" x 9" Brown w/ Streaks VFT		
MATERIAL LOCATION:	Room 308 Wardrobe- 1885 Building		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	9" x 9" Brown w/ Streaks VFT Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 308 Wardrobe- 1885 Building		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	18		
MATERIAL DESCRIPTION:	9" x 9" Brown w/ Streaks VFT Mastic		
MATERIAL LOCATION:	Room 308 Wardrobe- 1885 Building		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room # 500 through # 503 - 1987 Annex**

MATERIAL QUANTITY: **0**

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	19		
MATERIAL DESCRIPTION:	12" x 12" White w/ Brown Specks VFT (NOT OBSERVED)		
MATERIAL LOCATION:	Room # 500 through # 503 - 1987 Annex		
MATERIAL QUANTITY:	0	MATERIAL UNITS:	
DAMAGE QUANTITY:	0	DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room # 500 through # 503 - 1987 Annex**

MATERIAL QUANTITY: **0**

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	12" x 12" White w/ Brown Specks VFT Mastic (NOT OBSERVED)		
MATERIAL LOCATION:	Room # 500 through # 503 - 1987 Annex		
MATERIAL QUANTITY:	0	MATERIAL UNITS:	
DAMAGE QUANTITY:	0	DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12" x 12" Brown w/ Wht. & Black Specks VFT(NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout - 1987 Annex**

MATERIAL QUANTITY: **0**

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	21		
MATERIAL DESCRIPTION:	12" x 12" Brown w/ Wht. & Black Specks VFT(NOT OBSERVED)		
MATERIAL LOCATION:	Throughout - 1987 Annex		
MATERIAL QUANTITY:	0	MATERIAL UNITS:	
DAMAGE QUANTITY:	0	DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22	
MATERIAL DESCRIPTION:	12" x 12" Brown w/ Wht. & Black Specks VFT Mastic (ABATED)	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout (See Hatching Maps) - 1987 Annex

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	12" x 12" Brown w/ Wht. & Black Specks VFT Mastic (ABATED)		
MATERIAL LOCATION:	Throughout (See Hatching Maps) - 1987 Annex		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Brown Specks VFT (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 400, AP Room - 1987 Annex**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	23		
MATERIAL DESCRIPTION:	12" x 12" Beige w/ Brown Specks VFT (ABATED)		
MATERIAL LOCATION:	Room 400, AP Room - 1987 Annex		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Brown Specks VFT Mastic (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 400, AP Room - 1987 Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	12" x 12" Beige w/ Brown Specks VFT Mastic (ABATED)		
MATERIAL LOCATION:	Room 400, AP Room - 1987 Annex		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12" x 12" White w/ Blue Specks VFT (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room # 401 - 1987 Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	12" x 12" White w/ Blue Specks VFT (NOT OBSERVED)		
MATERIAL LOCATION:	Room # 401 - 1987 Annex		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12" x 12" White w/ Blue Specks VFT Mastic (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room # 401 - 1987 Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	12" x 12" White w/ Blue Specks VFT Mastic (NOT OBSERVED)		
MATERIAL LOCATION:	Room # 401 - 1987 Annex		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **1' x 1' White w/ Grooves Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	27		
MATERIAL DESCRIPTION:	1' x 1' White w/ Grooves Ceiling Tile		
MATERIAL LOCATION:	Throughout - 1987 Annex		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	1' x 1' White w/ Grooves Ceiling Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1987 Annex		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	28		
MATERIAL DESCRIPTION:	1' x 1' White w/ Grooves Ceiling Tile Mastic		
MATERIAL LOCATION:	Throughout - 1987 Annex		
MATERIAL QUANTITY:	20000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **1' x 1' White w/ Dots and Grooves Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 400 - 1987 Annex**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	29		
MATERIAL DESCRIPTION:	1' x 1' White w/ Dots and Grooves Ceiling Tile		
MATERIAL LOCATION:	Room 400 - 1987 Annex		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **1' x 1' White w/ Dots & Grooves CIng. Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 400 - 1987 Annex**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	1' x 1' White w/ Dots & Grooves Cing. Tile Masti		
MATERIAL LOCATION:	Room 400 - 1987 Annex		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	Vinyl Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1987 Annex		
MATERIAL QUANTITY:	3500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	Vinyl Baseboard		
MATERIAL LOCATION:	Throughout - 1987 Annex		
MATERIAL QUANTITY:	3500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	Vinyl Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout - 1987 Annex		
MATERIAL QUANTITY:	3500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	Vinyl Baseboard Mastic		
MATERIAL LOCATION:	Throughout - 1987 Annex		
MATERIAL QUANTITY:	3500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

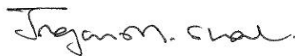

Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **50000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	Drywall		
MATERIAL LOCATION:	Throughout - 1987 Annex		
MATERIAL QUANTITY:	50000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout - 1987 Annex**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	Drywall Joint Compound		
MATERIAL LOCATION:	Throughout - 1987 Annex		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: Low

MATERIAL LOCATION: Lunchroom--REMOVED

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)		
MATERIAL LOCATION:	Lunchroom--REMOVED		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Lunchroom--REMOVED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	12 x 12 White with Gray and Brown Specs Floor Tile (ABATED)		
MATERIAL LOCATION:	Lunchroom--REMOVED		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12x12 White w/ Tan Specs VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **1st fl classrooms (400 thru 405) + staff rooms #06-#09; 2nd fl classrooms(500 thru 507)--1987 annex bldg**

MATERIAL QUANTITY: **14000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	12x12 White w/ Tan Specs VFT		
MATERIAL LOCATION:	1st fl classrooms (400 thru 405) + staff rooms #06-#09; 2nd fl classrooms(500 thru 507)--1987 annex bldg		
MATERIAL QUANTITY:	14000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37M**
MATERIAL DESCRIPTION: **12x12 White w/ tan specs VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st fl classrooms (400 thru 405) + staff rooms #06-#09; 2nd fl classrooms(500 thru 507)--1987 annex bldg**

MATERIAL QUANTITY: **14000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	37M		
MATERIAL DESCRIPTION:	12x12 White w/ tan specs VFT Mastic		
MATERIAL LOCATION:	1st fl classrooms (400 thru 405) + staff rooms #06-#09; 2nd fl classrooms(500 thru 507)--1987 annex bldg		
MATERIAL QUANTITY:	14000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12x12 Green with Gray + Dark Green specs VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)--1987 annex bldg		
MATERIAL QUANTITY:	7800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	12x12 Green with Gray + Dark Green specs VFT		
MATERIAL LOCATION:	1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)--1987 annex bldg		
MATERIAL QUANTITY:	7800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38M**
MATERIAL DESCRIPTION: **12x12 Green w/ gray + Dark green specs VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)**

MATERIAL QUANTITY: **7800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	38M		
MATERIAL DESCRIPTION:	12x12 Green w/ gray + Dark green specs VFT Mastic		
MATERIAL LOCATION:	1st fl corridor (4000 SF); 2nd fl corridor (3800 SF)		
MATERIAL QUANTITY:	7800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **White Spray-On Under sink coating**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **under sink in cabinet room #402--1987 annex**

MATERIAL QUANTITY: **3** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goethe School	REVIEW DATE:	4/18/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	White Spray-On Under sink coating		
MATERIAL LOCATION:	under sink in cabinet room #402--1987 annex		
MATERIAL QUANTITY:	3	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 04/18/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **1x1 White Ceiling Tile Matic**
MATERIAL LOCATION: **3rd Floor Gym**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **4/18/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**


HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **1x1 White Ceiling Tile Matic**
MATERIAL LOCATION: **3rd Floor Gym**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

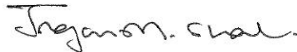

Date: **04/18/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23341	BUILDING ID:	3560
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Holvay		
SCHOOL NAME:	Goethe School	INSPECTION DATE:	3/2/2016		
ADDRESS:	2236 N. Rockwell Avenue	IDPH LICENSE NO:	100-07210		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	1x1 White Ceiling Tile		
MATERIAL LOCATION:	3rd Floor Gym		
MATERIAL QUANTITY:	2800	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	Yes
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Not Reachable	DAMAGE REASON:	
		DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:


Michael Holvay
Project Manager

Date: 03/02/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **4/18/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**


HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **1x1 White Ceiling Tile**
MATERIAL LOCATION: **3rd Floor Gym**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

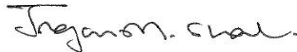

Date: **04/18/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Holvay**
SCHOOL NAME: **Goethe School** INSPECTION DATE: **3/2/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Tank Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **TSI** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature:


Michael Holvay
Project Manager

Date: **03/02/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23341** BUILDING ID: **3560**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Goethe School** REVIEW DATE: **4/18/2016**
ADDRESS: **2236 N. Rockwell Avenue** IDPH LICENSE NO: **100-07210**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Tank Insulation**
MATERIAL LOCATION: **Boiler Room**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **04/18/2016**

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

4/18/2016

MICHAEL HOLVAY
855 WEST ADAMS ST., Suite 200
CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07210

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

			ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 100 - 07210	ISSUED 4/18/2016	EXPIRES 03/13/2017	INSPECTOR		9/18/2016	
MICHAEL HOLVAY 855 WEST ADAMS ST., Suite 20 CHICAGO, IL 60607 Environmental Health					PROJECT MANAGER 1/20/2017	
			AIR SAMPLING PROFESSIONAL			
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.			

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Michael Holvay


has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 9/18/2015


Exam Date: 9/18/2015

Expiration Date: 9/18/2016

Certificate Number: BIR1509183493


Kathy DeSalvo, Director

2016

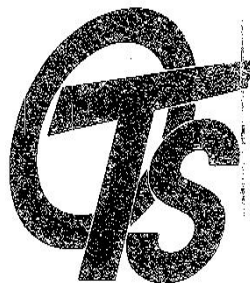

OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah


has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016

Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270320


Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

4/20/2016

JIGAR M SHAH
855 W ADAMS ST, SUITE 200
CHICAGO, IL 60607



ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
	ID NUMBER 100 - 07342	ISSUED 4/20/2016	INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/19/2017 2/2/2017 1/27/2017 2/26/2017
JIGAR M SHAH 855 W ADAMS ST, SUITE 200 CHICAGO, IL 60607 Environmental Health		EXPIRES 05/15/2017 	Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES

Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed