

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2223  
SCHOOL NAME: Goudy School  
ADDRESS OF SCHOOL: 5120 N Winthrop Avenue  
CITY: Chicago, IL, 60640

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **4/4/2013**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 5/23/2016 ENROLLMENT 741  
IDPH INSPECTOR LICENSE NUMBER: 100-11093  
IDPH LICENSED INSPECTOR NAME (Please Print): David Avila  
IDPH MP LICENSE NUMBER: 100-07342  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



5/23/2016

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Goudy School**

5120 N Winthrop Avenue  
Chicago, IL, 60640

Unit: 23371  
Building ID: 3590

IDPH ID Number: 14-016-2990-2223

**REPORT DATE:**

Monday, May 23, 2016

**Prepared for:**

**Chicago Public Schools**  
**125 S. Clark Street**  
**Chicago, IL 60603**

**Prepared by:**

**GSG Consultants, Inc.**

855 W. Adams St., Ste. 200

Phone (312) 733-6262

Fax (312) 733-5612

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

March 29, 2016

Mr. R. Kent Cook  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

GSG Consultants, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1,2,6 Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 23371                      Region: 01                      IDPH ID: 14-016-2990-2223

School: Goudy School                      Building ID: 3590

Address: 5120 N Winthrop Avenue  
Chicago, IL, 60640

Building Contact: Roman, Hector                      Contact Phone: 773-319-8716

Current Building Owners: Chicago Public Schools

Review Date: 05/20/2016

Inspector: David Avila                      Inspector IDPH License: 100-11093  
Management Planner: Jigar Shah                      Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 733-6262

Sincerely,  
GSG Consultants, Inc.



Jigar Shah  
100-07342

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: March 29, 2016

RE: Goudy School, Unit 23371  
5120 N Winthrop Avenue  
Chicago, IL, 60640

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Goudy School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Goudy School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School:	Goudy School	Unit:	23371	Region:	01
Address:	5120 N Winthrop Avenue		Chicago, IL, 60640		
IDPH ID:	14-016-2990-2223		Building ID:	3590	
Contact:	Roman, Hector		Phone:	773-319-8716	

### 2. Description of Facility

Original Construction:	1937	Additional Construction:	2003,1953
Total Square Footage:	48127	No of Floors:	3
Current Occupancy:	741		

### 3. LEA Designated Person

Contact:	Robert Christlieb	Phone:	(773) 553-3197
Address:	125 South Clark Street, 17th Floor		
	Chicago, IL 60603		


### 4. Managing Environmental Consultant

MEC:	GSG Consultants, Inc.		
Contact:	Arturo Saenz		
Address	855 W. Adams St., Ste. 200		
Phone:	(312) 733-6262	Fax:	(312) 733-5612

### 5. Inspector

Inspector Name: David Avila


Inspector IDPH license # 100-11093

Signature:   
Date: 3/29/2016

### 6. Management Planner

Management Planner Name: Jigar Shah


Management Planner IDPH license # 100-07342

Signature:   
Date: 05/20/2016

### 7. Review Date: 05/20/2016

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 5/23/2016

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

GSG Consultants, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Goudy School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3590:

B. The following new homogenous areas have been identified for Building 3590:

52

Carpet Mastic



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

36	Terrazzo
37	Carpet mastic
38	Terazo
39	Drywall system
40	2' X 4' ceiling tile
41	12" X 12" off-white with tan streaks VFT
41A	12" X 12" off-white with tan streaks, mastic
42	12" X 12" beige with white-and-tan streaks, VFT
42A	12" X 12" beige with white-and-tan streaks, Mastic
43	12" x 12" blue/green- streaked VFT
43A	12" X 12" blue/green-streaked, Mastic
44	12" X 12" yellow streaked VFT
44A	12" X 12" yellow streaked mastic
45	12" x 12" white with blue-and-black specks, VFT
45A	12" x 12" white with blue-and-black specks, mastic
46	2'X 4' smooth ceiling tile
47	Spray-on fire proofing
48	9" X 9" tan VFT
48A	9' X 9" tan, mastic
49	1' X 1' ceiling tile
49A	1' X 1' ceiling tile, mastic
50	Decorative plaster
51	Tectum wall panels
52	Carpet Mastic
A	12"x12" White w/ Tan Vinyl Floor Tile
H	12"x12" Tan Vinyl Floor Tile
N	9"x9" Red Vinyl Floor Tile Mastic
U	12"x12" White Textured Vinyl Floor Tile NOT OBSERVED
V	12"x12" White Textured Vinyl Floor Tile Mastic NOT OBSERVED
W	12"x12" Tan VFT
Y	12x12 inch White w/beige streaks VFT
Y1	12x12 inch White w/beige streaks VFT Mastic
Z	Carpet Mastic
Z1	2' x 4' ceiling tiles
Z2	2' x 4' ceiling tiles

The following areas were deemed to be inaccessible:

47	Spray-on fire proofing
49	1' X 1' ceiling tile
49A	1' X 1' ceiling tile, mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by David Avila, IDPH License # 100-11093. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Goudy School Building 3590 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Goudy School Unit 23371 Building ID 3590

Address 5120 N Winthrop Avenue Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
07	Mudded Joint Packing on Fiber Glass Insulation	75	LF	Boiler Room, & Switch Room Storage - 1936	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
08	Mudded Joint Compound on Cardboard Pipe Insulation	55	LF	Boiler Room, Air Tunnel #4, & Unexcavated Areas - 1936	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
10	Aircell Pipe Insulation	950	LF	Air Tunnel, Boiler, Pump, & Fan Rooms, Unex. Areas, NW Fan Rooms, Boiler Closet - 1936	CHR	TSI	Y	DIST	5		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	LOW
11	Cardboard Pipe Insulation	1,000	LF	Boiler Room, Air Tunnel #4, & Unexcavated Areas - 1936	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
20	Mag Block Pipe Insulation	50	LF	Boiler Room, Pump Room, Air Tunnel - 1936	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
22	Aircell Duct Insulation	2,000	SF	Un-Excavated Crawl Area 1936	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
24	Mudded Joint Packing on Aircell Pipe Insulation	200	LF	Air Tunnel, Boiler, Pump, & Fan Rooms, Unex. Areas, SE & NW Fan Rooms, Boiler Closet - 1936	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
25	Aircell Pipe Insulation	1,500	LF	Basement - 1954	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
26	Cardboard Pipe Insulation	1,000	LF	Unexcavated Areas - 1954	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
31	Mudded Joint Packing on Aircell Pipe Insulation	300	LF	Corridor and unexcavated crawl space - 1954	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
32	MJP E/F/V on Mag Block Pipe Insulation	50	LF	Boiler Room, Pump Room & Tunnel - 1936	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
33	Mag Block Pipe Insulation	250	LF	Unexcavated Areas - 1954	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
34	MJP E/F/V on Mag Block Pipe Insulation	25	LF	Unexcavated Areas - 1954	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
35	MJP E/F/V on Cardboard Pipe Insulation	20	LF	Unexcavated Areas - 1954	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Goudy School Unit 23371 Building ID 3590

Address 5120 N Winthrop Avenue Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
36	Terrazzo	2,500	SF	Stairwells - 1936 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
37	Carpet mastic	3,000	SF	Library (321) - 2003 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	Terazo	5,800	SF	Stairwells; 1st, 2nd, and 3rd floor corridors; boys, girls, and faculty toilets all floors - 2003 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
39	Drywall system	2,500	SF	1st, 2nd, and 3rd floor boys and girls toilets; Rms 314, 316, 214 and 218 - 2003 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
40	2' X 4' ceiling tile	10,000	SF	Throughout 2003 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
41	12" X 12" off-white with tan streaks VFT	3,600	SF	Rms 314, 316, 214, 216, 218, 225, 116, 114, and 125 - 2003 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
41A	12" X 12" off-white with tan streaks, mastic	3,600	SF	Rms 314, 316, 214, 216, 218, 225, 116, 114, and 125 - 2003 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12" X 12" beige with white-and-tan streaks, VFT	4,500	SF	Rms 323, 314, 316, 214, 216, 218, 225, 223, 116, 114, and 125 - 2003 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
42A	12" X 12" beige with white-and-tan streaks, Mastic	4,500	SF	Rms 323, 314, 316, 214, 216, 218, 225, 223, 116, 114, and 125 - 2003 Addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	12" x 12" blue/green- streaked VFT	2,000	SF	Rms 318, 314, 316, Storage 315, 214, 216, 218, 225, 116, 114, 125, 121F, 121E (Women), 121D (Men), and 121B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
43A	12" X 12" blue/green-streaked, Mastic	2,000	SF	Rms 318, 314, 316, Storage 315, 214, 216, 218, 225, 116, 114, 125, 121F, 121E (Women),	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

**School** Goudy School **Unit** 23371 **Building ID** 3590  
**Address** 5120 N Winthrop Avenue **Region** 01

### Inspector's Reinspection Findings Table 1

*Inspector's Comments are Summarized at the End of the Report*

[illegible]

# Chicago Public Schools

School Goudy School Unit 23371 Building ID 3590

Address 5120 N Winthrop Avenue Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
D	12"x12" White w/ Tan Vinyl Floor Tile Mastic	1,600	SF	Rooms 112, 113 - 1954	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
E	12"x12" Tan Vinyl Floor Tile Mastic	5,950	SF	1st, 2nd, & 3rd Floor Corridors and Main Office - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
F	9"x9" Brown Vinyl Floor Tile Mastic	100	SF	Room 110 Storage Closet and Wardrobe - 1936 Bldg	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
G	Tan Linoleum Mastic - REMOVED			Room 111 - 1936	ABATED									
H	12"x12" Tan Vinyl Floor Tile	5,950	SF	1st, 2nd, & 3rd Floor Corridors and Main Office - 1936	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
I	Green Linoleum			Assembly Hall - 1936	NO_ACBM									
J	Green Linoleum Mastic			Assembly Hall - 1936	NO_ACBM									
M	9"x9" Red Vinyl Floor Tile	150	SF	Engineer's Office, Basement Janitors Closet(Boiler Room Closet) - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
N	9"x9" Red Vinyl Floor Tile Mastic	150	SF	Engineer's Office, Basement Janitors Closet(Boiler Room Closet) - 1936	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
O	Brown Linoleum			1st Floor Storage (closet next to Auditorium) - 1936	NO_ACBM									
P	Brown Linoleum Mastic			1st Floor Storage (closet next to Auditorium) - 1936	NO_ACBM									
Q	9"x9" Grey w/ White & Pink Streaks VFT	250	SF	Office Supply Store Room - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
R	9"x9" Grey w/ White & Pink Streaks VFTMastic	250	SF	Office Supply Store Room - 1936	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
S	9"x9" Pink Vinyl Floor Tile ABATED			1st Floor Vault - 1954 (New Connection Corridor to 2003-2004 Annex)	ABATED	MISC		None						
T	9"x9" Pink Vinyl Floor Tile Mastic - ABATED			1st Floor Vault - 1954 (New Connection Corridor to 2003-2004	ABATED	MISC		None						



# Chicago Public Schools

School Goudy School Unit 23371 Building ID 3590

Address 5120 N Winthrop Avenue Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Annex)										
U	12"x12" White Textured Vinyl Floor Tile NOT OBSERVED			1st Floor Vault - 1954 NOT OBSERVED	ASSUMED	MISC						ACBM with the potential for damage		
V	12"x12" White Textured Vinyl Floor Tile Mastic NOT OBSERVED			1st Floor Vault - 1954 NOT OBSERVED	ASSUMED	MISC	N					ACBM with the potential for damage		LOW
W	12"x12" Tan VFT	3,500	SF	2nd, & 3rd Floor Corridors & Room 13; Room 212; 312, 313 - 1954	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
X	12"x12" Tan VFT Mastic	3,500	SF	2nd, & 3rd Floor Corridors & Rooms 212 & 213, 312, 313 - 1954	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
Y	12x12 inch White w/beige streaks VFT	575	SF	1st, 2nd, 3rd Floor former vaulted area (corridors) - 1954 addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
Y1	12x12 inch White w/beige streaks VFT Mastic	575	SF	1st, 2nd, 3rd Floor former vaulted area (corridors) - 1954 addition	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
Z	Carpet Mastic	200	SF	Main Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
Z1	2' x 4' ceiling tiles	40,000	SF	Throughout 1936 Building	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
Z2	2' x 4' ceiling tiles	5,000	SF	1st, 2nd, 3rd Floor Corridors; Rooms 313, 312, 213, 212, 113, and 112 - 1954 Addition	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Goudy School **Unit** 23371 **Building ID** 3590

**Address** 5120 N Winthrop Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date **3/29/2016**

Inspector Name **David Avila**

**100-11093**

**5/15/2017**

Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
07	
08	
10	5 LF Damage in Air Tunnel
11	
20	
22	
24	
25	
26	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
41A	
42	
42A	
43	

# Chicago Public Schools

**School** Goudy School **Unit** 23371 **Building ID** 3590

**Address** 5120 N Winthrop Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
43A	
44	
44A	
45	
45A	
46	
47	
48	
48A	
49	
49A	
50	
51	
52	
A	
B	
C	
D	
E	
F	
G	
H	
I	
J	
M	
N	
O	
P	
Q	

# Chicago Public Schools

**School** Goudy School **Unit** 23371 **Building ID** 3590

**Address** 5120 N Winthrop Avenue **Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
R	
S	
T	
U	NOT OBSERVED
V	NOT OBSERVED
W	Room 212 Possible under Carpet
X	
Y	
Y1	
Z	
Z1	
Z2	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School**    Goudy School  
**Address**    5120 N Winthrop Avenue

**Unit**    23371  
Chicago, IL, 60640

**Building ID**    3590  
**Region**    01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)**    GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone:    (312) 733-6262

Fax:    (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
07	Mudded Joint Packing on Fiber Glass Insulation	75	LF	Boiler Room, & Switch Room Storage - 1936	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
08	Mudded Joint Compound on Cardboard Pipe Insulation	55	LF	Boiler Room, Air Tunnel #4, & Unexcavated Areas - 1936	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
10	Aircell Pipe Insulation	950	LF	Air Tunnel, Boiler, Pump , & Fan Rooms, Unex. Areas, NW Fan Rooms, Boiler Closet - 1936	Chrysotile	TSI	Yes	5	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
11	Cardboard Pipe Insulation	1,000	LF	Boiler Room, Air Tunnel #4, & Unexcavated Areas - 1936	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
20	Mag Block Pipe Insulation	50	LF	Boiler Room, Pump Room, Air Tunnel - 1936	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
22	Aircell Duct Insulation	2,000	SF	Un-Excavated Crawl Area 1936	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	Mudded Joint Packing on Aircell Pipe Insulation	200	LF	Air Tunnel, Boiler, Pump , & Fan Rooms, Unex. Areas, SE & NW Fan Rooms, Boiler Closet - 1936	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
25	Aircell Pipe Insulation	1,500	LF	Basement - 1954	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
26	Cardboard Pipe Insulation	1,000	LF	Unexcavated Areas - 1954	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
31	Mudded Joint Packing on Aircell Pipe Insulation	300	LF	Corridor and unexcavated crawl space - 1954	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
32	MJP E/F/V on Mag Block Pipe Insulation	50	LF	Boiler Room, Pump Room & Tunnel - 1936	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
33	Mag Block Pipe Insulation	250	LF	Unexcavated Areas - 1954	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
34	MJP E/F/V on Mag Block Pipe Insulation	25	LF	Unexcavated Areas - 1954	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
35	MJP E/F/V on Cardboard Pipe Insulation	20	LF	Unexcavated Areas - 1954	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
36	Terrazzo	2,500	SF	Stairwells - 1936 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Carpet mastic	3,000	SF	Library (321) - 2003 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	Terazo	5,800	SF	Stairwells; 1st, 2nd, and 3rd floor corridors; boys, girls, and faculty toilets all floors - 2003 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	Drywall system	2,500	SF	1st, 2nd, and 3rd floor boys and girls toilets; Rms 314, 316, 214 and 218 - 2003 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	2' X 4' ceiling tile	10,000	SF	Throughout 2003 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	12" X 12" off-white with tan streaks VFT	3,600	SF	Rms 314, 316, 214, 216, 218, 225, 116, 114, and 125 - 2003 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41A	12" X 12" off-white with tan streaks, mastic	3,600	SF	Rms 314, 316, 214, 216, 218, 225, 116,	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Goudy School  
**Address** 5120 N Winthrop Avenue

**Unit** 23371  
Chicago, IL, 60640

**Building ID** 3590  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				114, and 125 - 2003 Addition							
42	12" X 12" beige with white-and-tan streaks, VFT	4,500	SF	Rms 323, 314, 316, 214, 216, 218, 225, 223, 116, 114, and 125 - 2003 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42A	12" X 12" beige with white-and-tan streaks, Mastic	4,500	SF	Rms 323, 314, 316, 214, 216, 218, 225, 223, 116, 114, and 125 - 2003 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	12" x 12" blue/green- streaked VFT	2,000	SF	Rms 318, 314, 316, Storage 315, 214, 216, 218, 225, 116, 114, 125, 121F, 121E (Women), 121D (Men), and 121B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43A	12" X 12" blue/green-streaked, Mastic	2,000	SF	Rms 318, 314, 316, Storage 315, 214, 216, 218, 225, 116, 114, 125, 121F, 121E (Women), 121D (Men), and 121B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	12" X 12" yellow streaked VFT	100	SF	Multipurpose - 2003 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44A	12" X 12" yellow streaked mastic	100	SF	Multipurpose - 2003 Addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	12" x 12" white with blue-and-black specks, VFT	5,800	SF	Multipurpose, Serving Room 217A, Elevator	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45A	12" x 12" white with blue-and-black specks, mastic	5,800	SF	Multipurpose, Serving Room 217A, Elevator	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	2'X 4' smooth ceiling tile	2,600	SF	Kitchen, Serving Room, Women's Toilet 121 E, Men's Toilet 121 D, Dishwasher Room 127	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	Spray-on fire proofing	10,000	SF	Throughout 2003 Addition	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	9" X 9" tan VFT	100	SF	Room 110 Storage Closet & Wardrobe - 1936 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48A	9' X 9" tan, mastic	100	SF	Room 110 Storage Closet & Wardrobe - 1936 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	1' X 1' ceiling tile	3,000	SF	Assembly Hall, 1936 bldg	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49A	1' X 1' ceiling tile, mastic	3,000	SF	Assembly Hall, 1936 bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	Decorative plaster	1,500	SF	Assembly Hall - 1936 Bldg	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	Tectum wall panels	2,000	SF	Gym- 1936 Bldg	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	Carpet Mastic	800	SF	Room 212	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	12"x12" White w/ Tan Vinyl Floor Tile	1,600	SF	Rooms 112, 113 - 1954	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
B	9"x9" Brown Vinyl Floor Tile	100	SF	Room 110 Storage Closet and Wardrobe - 1936 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C	Tan Linoleum - REMOVED			Room 111 (Kitchen) - 1936	Abated						
D	12"x12" White w/ Tan Vinyl Floor Tile Mastic	1,600	SF	Rooms 112, 113 - 1954	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
E	12"x12" Tan Vinyl Floor Tile Mastic	5,950	SF	1st, 2nd, & 3rd Floor Corridors and	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School**    Goudy School  
**Address**    5120 N Winthrop Avenue

**Unit**    23371  
Chicago, IL, 60640

**Building ID**    3590  
**Region**    01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)**    GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone:    (312) 733-6262                      Fax:    (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Main Office - 1936							
F	9"x9" Brown Vinyl Floor Tile Mastic	100	SF	Room 110 Storage Closet and Wardrobe - 1936 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	Tan Linoleum Mastic - REMOVED			Room 111 - 1936	Abated						
H	12"x12" Tan Vinyl Floor Tile	5,950	SF	1st, 2nd, & 3rd Floor Corridors and Main Office - 1936	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
I	Green Linoleum			Assembly Hall - 1936	No ACBM						
J	Green Linoleum Mastic			Assembly Hall - 1936	No ACBM						
M	9"x9" Red Vinyl Floor Tile	150	SF	Engineer's Office, Basement Janitors Closet(Boiler Room Closet) - 1936	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
N	9"x9" Red Vinyl Floor Tile Mastic	150	SF	Engineer's Office, Basement Janitors Closet(Boiler Room Closet) - 1936	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
O	Brown Linoleum			1st Floor Storage (closet next to Auditorium) - 1936	No ACBM						
P	Brown Linoleum Mastic			1st Floor Storage (closet next to Auditorium) - 1936	No ACBM						
Q	9"x9" Grey w/ White & Pink Streaks VFT	250	SF	Office Supply Store Room - 1936	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
R	9"x9" Grey w/ White & Pink Streaks VFTMastic	250	SF	Office Supply Store Room - 1936	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
S	9"x9" Pink Vinyl Floor Tile ABATED			1st Floor Vault - 1954 (New Connection Corridor to 2003-2004 Annex)	Abated	MISC					
T	9"x9" Pink Vinyl Floor Tile Mastic - ABATED			1st Floor Vault - 1954 (New Connection Corridor to 2003-2004 Annex)	Abated	MISC					
U	12"x12" White Textured Vinyl Floor Tile NOT OBSERVED			1st Floor Vault - 1954 NOT OBSERVED	Assumed	MISC				6 ACBM with the potential for damage	Follow O&M Plan
V	12"x12" White Textured Vinyl Floor Tile Mastic NOT OBSERVED			1st Floor Vault - 1954 NOT OBSERVED	Assumed	MISC	No			6 ACBM with the potential for damage	Follow O&M Plan
W	12"x12" Tan VFT	3,500	SF	2nd, & 3rd Floor Corridors & Room 13; Room 212; 312, 313 - 1954	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
X	12"x12" Tan VFT Mastic	3,500	SF	2nd, & 3rd Floor Corridors & Rooms 212 & 213, 312, 313 - 1954	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Y	12x12 inch White w/beige streaks VFT	575	SF	1st, 2nd, 3rd Floor former vaulted area (corridors) - 1954 addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Y1	12x12 inch White w/beige streaks VFT Mastic	575	SF	1st, 2nd, 3rd Floor former vaulted area (corridors) - 1954 addition	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Z	Carpet Mastic	200	SF	Main Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Z1	2' x 4' ceiling tiles	40,000	SF	Throughout 1936 Building	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan



# Chicago Public Schools

**School** Goudy School  
**Address** 5120 N Winthrop Avenue

**Unit** 23371  
Chicago, IL, 60640

**Building ID** 3590  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
Z2	2' x 4' ceiling tiles	5,000	SF	1st, 2nd, 3rd Floor Corridors; Rooms 313, 312, 213, 212, 113, and 112 - 1954 Addition	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Review Date	5/20/2016
Manager Planner Name	Jigar Shah

HA Number	Management Comments
07	

# Chicago Public Schools

**School** Goudy School  
**Address** 5120 N Winthrop Avenue

**Unit** 23371  
Chicago, IL, 60640

**Building ID** 3590  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

100-07342	1/19/2017
Manager IDPH License No/Expiration	

HA Number	Management Comments
08	
10	Repair Damaged ACM ASAP
11	
20	
22	
24	
25	
26	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
41A	
42	
42A	
43	
43A	
44	
44A	
45	

# Chicago Public Schools

**School**    Goudy School  
**Address**    5120 N Winthrop Avenue

**Unit**    23371  
Chicago, IL, 60640

**Building ID**    3590  
**Region**    01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)**    GSG Consultants, Inc.  
855 W. Adams St., Ste. 200  
Phone:    (312) 733-6262                      Fax:    (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
45A	
46	
47	
48	
48A	
49	
49A	
50	
51	
52	
A	
B	
C	
D	
E	
F	
G	
H	
I	
J	
M	
N	
O	
P	
Q	
R	
S	

# Chicago Public Schools

**School**    Goudy School  
**Address**    5120 N Winthrop Avenue

**Unit**    23371  
Chicago, IL, 60640

**Building ID**    3590  
**Region**    01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)**    GSG Consultants, Inc.  
855 W. Adams St., Ste. 200  
Phone:    (312) 733-6262                      Fax:    (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
T	
U	
V	
W	
X	
Y	
Y1	
Z	
Z1	
Z2	

# Chicago Public Schools

GSG Consultants, Inc.

## 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07		
MATERIAL DESCRIPTION:	Mudded Joint Packing on Fiber Glass Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler Room, & Switch Room Storage - 1936**

MATERIAL QUANTITY: **75**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	07		
MATERIAL DESCRIPTION:	Mudded Joint Packing on Fiber Glass Insulation		
MATERIAL LOCATION:	Boiler Room, & Switch Room Storage - 1936		
MATERIAL QUANTITY:	75	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **Mudded Joint Compound on Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON: **Delamination**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler Room, Air Tunnel #4, & Unexcavated Areas - 1936**

MATERIAL QUANTITY: **55** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	Mudded Joint Compound on Cardboard Pipe Insulation		
MATERIAL LOCATION:	Boiler Room, Air Tunnel #4, & Unexcavated Areas - 1936		
MATERIAL QUANTITY:	55	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	1 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:	Delamination		
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Air Tunnel, Boiler, Pump , & Fan Rooms, Unex. Areas, NW Fan Rooms, Boiler Closet - 1936		
MATERIAL QUANTITY:	950	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:	5 LF Damage in Air Tunnel		

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
MATERIAL LOCATION:	Air Tunnel, Boiler, Pump , & Fan Rooms, Unex. Areas, NW Fan Rooms, Boiler Closet - 1936		
MATERIAL QUANTITY:	950	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	5	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Repair Damaged ACM ASAP

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room, Air Tunnel #4, & Unexcavated Areas - 1936		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
MATERIAL LOCATION:	Boiler Room, Air Tunnel #4, & Unexcavated Areas - 1936		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Boiler Room, Pump Room, Air Tunnel - 1936		
MATERIAL QUANTITY:	50	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	20		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
MATERIAL LOCATION:	Boiler Room, Pump Room, Air Tunnel - 1936		
MATERIAL QUANTITY:	50	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	Aircell Duct Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Un-Excavated Crawl Area 1936**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	22		
MATERIAL DESCRIPTION:	Aircell Duct Insulation		
MATERIAL LOCATION:	Un-Excavated Crawl Area 1936		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	Mudded Joint Packing on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Air Tunnel, Boiler, Pump , & Fan Rooms, Unex. Areas, SE & NW Fan Rooms, Boiler Closet - 1936**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	24		
MATERIAL DESCRIPTION:	Mudded Joint Packing on Aircell Pipe Insulation		
MATERIAL LOCATION:	Air Tunnel, Boiler, Pump , & Fan Rooms, Unex. Areas, SE & NW Fan Rooms, Boiler Closet - 1936		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Repair**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement - 1954		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	25		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
MATERIAL LOCATION:	Basement - 1954		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Unexcavated Areas - 1954		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	26		
MATERIAL DESCRIPTION:	Cardboard Pipe Insulation		
MATERIAL LOCATION:	Unexcavated Areas - 1954		
MATERIAL QUANTITY:	1000	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	Mudded Joint Packing on Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridor and unexcavated crawl space - 1954		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	31		
MATERIAL DESCRIPTION:	Mudded Joint Packing on Aircell Pipe Insulation		
MATERIAL LOCATION:	Corridor and unexcavated crawl space - 1954		
MATERIAL QUANTITY:	300	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with potential for significant damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler Room, Pump Room & Tunnel - 1936**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	32		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
MATERIAL LOCATION:	Boiler Room, Pump Room & Tunnel - 1936		
MATERIAL QUANTITY:	50	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Unexcavated Areas - 1954		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	33		
MATERIAL DESCRIPTION:	Mag Block Pipe Insulation		
MATERIAL LOCATION:	Unexcavated Areas - 1954		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Unexcavated Areas - 1954		
MATERIAL QUANTITY:	25	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	34		
MATERIAL DESCRIPTION:	MJP E/F/V on Mag Block Pipe Insulation		
MATERIAL LOCATION:	Unexcavated Areas - 1954		
MATERIAL QUANTITY:	25	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Unexcavated Areas - 1954		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	35		
MATERIAL DESCRIPTION:	MJP E/F/V on Cardboard Pipe Insulation		
MATERIAL LOCATION:	Unexcavated Areas - 1954		
MATERIAL QUANTITY:	20	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Stairwells - 1936 Bldg		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	36		
MATERIAL DESCRIPTION:	Terrazzo		
MATERIAL LOCATION:	Stairwells - 1936 Bldg		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	Carpet mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Library (321) - 2003 Addition		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

GSG Consultants, Inc.  
**2016 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	37		
MATERIAL DESCRIPTION:	Carpet mastic		
MATERIAL LOCATION:	Library (321) - 2003 Addition		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **Terazo**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Stairwells; 1st, 2nd, and 3rd floor corridors; boys, girls, and faculty toilets all floors - 2003 Addition**

MATERIAL QUANTITY: **5800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	38		
MATERIAL DESCRIPTION:	Terazo		
MATERIAL LOCATION:	Stairwells; 1st, 2nd, and 3rd floor corridors; boys, girls, and faculty toilets all floors - 2003 Addition		
MATERIAL QUANTITY:	5800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **05/20/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	Drywall system		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd, and 3rd floor boys and girls toilets; Rms 314, 316, 214 and 218 - 2003 Addition		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	39		
MATERIAL DESCRIPTION:	Drywall system		
MATERIAL LOCATION:	1st, 2nd, and 3rd floor boys and girls toilets; Rms 314, 316, 214 and 218 - 2003 Addition		
MATERIAL QUANTITY:	2500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**  
MATERIAL DESCRIPTION: **2' X 4' ceiling tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 2003 Addition**  
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
**2016 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	40		
MATERIAL DESCRIPTION:	2' X 4' ceiling tile		
MATERIAL LOCATION:	Throughout 2003 Addition		
MATERIAL QUANTITY:	10000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	41		
MATERIAL DESCRIPTION:	12" X 12" off-white with tan streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rms 314, 316, 214, 216, 218, 225, 116, 114, and 125 - 2003 Addition		
MATERIAL QUANTITY:	3600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	41		
MATERIAL DESCRIPTION:	12" X 12" off-white with tan streaks VFT		
MATERIAL LOCATION:	Rms 314, 316, 214, 216, 218, 225, 116, 114, and 125 - 2003 Addition		
MATERIAL QUANTITY:	3600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41A**  
MATERIAL DESCRIPTION: **12" X 12" off-white with tan streaks, mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rms 314, 316, 214, 216, 218, 225, 116, 114, and 125 - 2003 Addition**  
MATERIAL QUANTITY: **3600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	41A		
MATERIAL DESCRIPTION:	12" X 12" off-white with tan streaks, mastic		
MATERIAL LOCATION:	Rms 314, 316, 214, 216, 218, 225, 116, 114, and 125 - 2003 Addition		
MATERIAL QUANTITY:	3600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **12" X 12" beige with white-and-tan streaks, VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Rms 323, 314, 316, 214, 216, 218, 225, 223, 116, 114, and 125 - 2003 Addition**  
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	42		
MATERIAL DESCRIPTION:	12" X 12" beige with white-and-tan streaks, VFT		
MATERIAL LOCATION:	Rms 323, 314, 316, 214, 216, 218, 225, 223, 116, 114, and 125 - 2003 Addition		
MATERIAL QUANTITY:	4500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	42A		
MATERIAL DESCRIPTION:	12" X 12" beige with white-and-tan streaks, Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rms 323, 314, 316, 214, 216, 218, 225, 223, 116, 114, and 125 - 2003 Addition		
MATERIAL QUANTITY:	4500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	42A		
MATERIAL DESCRIPTION:	12" X 12" beige with white-and-tan streaks, Mastic		
MATERIAL LOCATION:	Rms 323, 314, 316, 214, 216, 218, 225, 223, 116, 114, and 125 - 2003 Addition		
MATERIAL QUANTITY:	4500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	12" x 12" blue/green- streaked VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Rms 318, 314, 316, Storage 315, 214, 216, 218, 225, 116, 114, 125, 121F, 121E (Women), 121D (Men), and 121B**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	43		
MATERIAL DESCRIPTION:	12" x 12" blue/green- streaked VFT		
MATERIAL LOCATION:	Rms 318, 314, 316, Storage 315, 214, 216, 218, 225, 116, 114, 125, 121F, 121E (Women), 121D (Men), and 121B		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **05/20/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	43A		
MATERIAL DESCRIPTION:	12" X 12" blue/green-streaked, Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rms 318, 314, 316, Storage 315, 214, 216, 218, 225, 116, 114, 125, 121F, 121E (Women), 121D (Men), and 121B**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	43A		
MATERIAL DESCRIPTION:	12" X 12" blue/green-streaked, Mastic		
MATERIAL LOCATION:	Rms 318, 314, 316, Storage 315, 214, 216, 218, 225, 116, 114, 125, 121F, 121E (Women), 121D (Men), and 121B		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: **05/20/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	12" X 12" yellow streaked VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Multipurpose - 2003 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	44		
MATERIAL DESCRIPTION:	12" X 12" yellow streaked VFT		
MATERIAL LOCATION:	Multipurpose - 2003 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	44A		
MATERIAL DESCRIPTION:	12" X 12" yellow streaked mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Multipurpose - 2003 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	44A		
MATERIAL DESCRIPTION:	12" X 12" yellow streaked mastic		
MATERIAL LOCATION:	Multipurpose - 2003 Addition		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	12" x 12" white with blue-and-black specks, VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Multipurpose, Serving Room 217A, Elevator		
MATERIAL QUANTITY:	5800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	45		
MATERIAL DESCRIPTION:	12" x 12" white with blue-and-black specks, VFT		
MATERIAL LOCATION:	Multipurpose, Serving Room 217A, Elevator		
MATERIAL QUANTITY:	5800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	45A		
MATERIAL DESCRIPTION:	12" x 12" white with blue-and-black specks, mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Multipurpose, Serving Room 217A, Elevator		
MATERIAL QUANTITY:	5800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	45A		
MATERIAL DESCRIPTION:	12" x 12" white with blue-and-black specks, mastic		
MATERIAL LOCATION:	Multipurpose, Serving Room 217A, Elevator		
MATERIAL QUANTITY:	5800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	2'X 4' smooth ceiling tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen, Serving Room, Women's Toilet 121 E, Men's Toilet 121 D, Dishwasher Room 127**

MATERIAL QUANTITY: **2600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	46		
MATERIAL DESCRIPTION:	2'X 4' smooth ceiling tile		
MATERIAL LOCATION:	Kitchen, Serving Room, Women's Toilet 121 E, Men's Toilet 121 D, Dishwasher Room 127		
MATERIAL QUANTITY:	2600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **Spray-on fire proofing**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 2003 Addition**  
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	47		
MATERIAL DESCRIPTION:	Spray-on fire proofing		
MATERIAL LOCATION:	Throughout 2003 Addition		
MATERIAL QUANTITY:	10000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	9" X 9" tan VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Room 110 Storage Closet & Wardrobe - 1936 Bldg		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	48		
MATERIAL DESCRIPTION:	9" X 9" tan VFT		
MATERIAL LOCATION:	Room 110 Storage Closet & Wardrobe - 1936 Bldg		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	48A		
MATERIAL DESCRIPTION:	9' X 9" tan, mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 110 Storage Closet & Wardrobe - 1936 Bldg		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	48A		
MATERIAL DESCRIPTION:	9' X 9" tan, mastic		
MATERIAL LOCATION:	Room 110 Storage Closet & Wardrobe - 1936 Bldg		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:

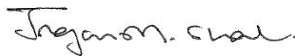

Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	1' X 1' ceiling tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Assembly Hall, 1936 bldg		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	49		
MATERIAL DESCRIPTION:	1' X 1' ceiling tile		
MATERIAL LOCATION:	Assembly Hall, 1936 bldg		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	49A		
MATERIAL DESCRIPTION:	1' X 1' ceiling tile, mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Assembly Hall, 1936 bldg		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	49A		
MATERIAL DESCRIPTION:	1' X 1' ceiling tile, mastic		
MATERIAL LOCATION:	Assembly Hall, 1936 bldg		
MATERIAL QUANTITY:	3000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	Decorative plaster		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Assembly Hall - 1936 Bldg		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	50		
MATERIAL DESCRIPTION:	Decorative plaster		
MATERIAL LOCATION:	Assembly Hall - 1936 Bldg		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **Tectum wall panels**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gym- 1936 Bldg**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	51		
MATERIAL DESCRIPTION:	Tectum wall panels		
MATERIAL LOCATION:	Gym- 1936 Bldg		
MATERIAL QUANTITY:	2000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	A		
MATERIAL DESCRIPTION:	12"x12" White w/ Tan Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Rooms 112, 113 - 1954		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	A		
MATERIAL DESCRIPTION:	12"x12" White w/ Tan Vinyl Floor Tile		
MATERIAL LOCATION:	Rooms 112, 113 - 1954		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**  
MATERIAL DESCRIPTION: **9"x9" Brown Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Room 110 Storage Closet and Wardrobe - 1936 Bldg**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
**2016 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	B		
MATERIAL DESCRIPTION:	9"x9" Brown Vinyl Floor Tile		
MATERIAL LOCATION:	Room 110 Storage Closet and Wardrobe - 1936 Bldg		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	C	
MATERIAL DESCRIPTION:	Tan Linoleum - REMOVED	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Room 111 (Kitchen) - 1936

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA: C

MATERIAL DESCRIPTION: Tan Linoleum - REMOVED

MATERIAL LOCATION: Room 111 (Kitchen) - 1936

MATERIAL QUANTITY:	MATERIAL UNITS:
DAMAGE QUANTITY:	DAMAGE UNITS:


---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:

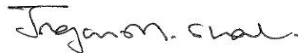

Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **12"x12" White w/ Tan Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 112, 113 - 1954**

MATERIAL QUANTITY: **1600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	D		
MATERIAL DESCRIPTION:	12"x12" White w/ Tan Vinyl Floor Tile Mastic		
MATERIAL LOCATION:	Rooms 112, 113 - 1954		
MATERIAL QUANTITY:	1600	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	E		
MATERIAL DESCRIPTION:	12"x12" Tan Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors and Main Office - 1936		
MATERIAL QUANTITY:	5950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	E		
MATERIAL DESCRIPTION:	12"x12" Tan Vinyl Floor Tile Mastic		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors and Main Office - 1936		
MATERIAL QUANTITY:	5950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	F		
MATERIAL DESCRIPTION:	9"x9" Brown Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Room 110 Storage Closet and Wardrobe - 1936 Bldg		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	F		
MATERIAL DESCRIPTION:	9"x9" Brown Vinyl Floor Tile Mastic		
MATERIAL LOCATION:	Room 110 Storage Closet and Wardrobe - 1936 Bldg		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Tan Linoleum Mastic - REMOVED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 111 - 1936**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **Tan Linoleum Mastic - REMOVED**

MATERIAL LOCATION: **Room 111 - 1936**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: **05/20/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	H		
MATERIAL DESCRIPTION:	12"x12" Tan Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors and Main Office - 1936		
MATERIAL QUANTITY:	5950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	H		
MATERIAL DESCRIPTION:	12"x12" Tan Vinyl Floor Tile		
MATERIAL LOCATION:	1st, 2nd, & 3rd Floor Corridors and Main Office - 1936		
MATERIAL QUANTITY:	5950	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **Green Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Assembly Hall - 1936**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	I		
MATERIAL DESCRIPTION:	Green Linoleum		
MATERIAL LOCATION:	Assembly Hall - 1936		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	J	
MATERIAL DESCRIPTION:	Green Linoleum Mastic	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Assembly Hall - 1936

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	J		
MATERIAL DESCRIPTION:	Green Linoleum Mastic		
MATERIAL LOCATION:	Assembly Hall - 1936		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	M		
MATERIAL DESCRIPTION:	9"x9" Red Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Engineer's Office, Basement Janitors Closet(Boiler Room Closet) - 1936		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	M		
MATERIAL DESCRIPTION:	9"x9" Red Vinyl Floor Tile		
MATERIAL LOCATION:	Engineer's Office, Basement Janitors Closet(Boiler Room Closet) - 1936		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	N		
MATERIAL DESCRIPTION:	9"x9" Red Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Engineer's Office, Basement Janitors Closet(Boiler Room Closet) - 1936		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	N		
MATERIAL DESCRIPTION:	9"x9" Red Vinyl Floor Tile Mastic		
MATERIAL LOCATION:	Engineer's Office, Basement Janitors Closet(Boiler Room Closet) - 1936		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	O		
MATERIAL DESCRIPTION:	Brown Linoleum		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	No ACBM	FRIABLE:	

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st Floor Storage (closet next to Auditorium) - 1936

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA: **O**

MATERIAL DESCRIPTION: **Brown Linoleum**

MATERIAL LOCATION: **1st Floor Storage (closet next to Auditorium) - 1936**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/20/2016**



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	P	
MATERIAL DESCRIPTION:	Brown Linoleum Mastic	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	No ACBM	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st Floor Storage (closet next to Auditorium) - 1936

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	P		
MATERIAL DESCRIPTION:	Brown Linoleum Mastic		
MATERIAL LOCATION:	1st Floor Storage (closet next to Auditorium) - 1936		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Q		
MATERIAL DESCRIPTION:	9"x9" Grey w/ White & Pink Streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	Office Supply Store Room - 1936		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	Q		
MATERIAL DESCRIPTION:	9"x9" Grey w/ White & Pink Streaks VFT		
MATERIAL LOCATION:	Office Supply Store Room - 1936		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **R**  
MATERIAL DESCRIPTION: **9"x9" Grey w/ White & Pink Streaks VFTMastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Office Supply Store Room - 1936**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	R		
MATERIAL DESCRIPTION:	9"x9" Grey w/ White & Pink Streaks VFTMastic		
MATERIAL LOCATION:	Office Supply Store Room - 1936		
MATERIAL QUANTITY:	250	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	S	
MATERIAL DESCRIPTION:	9"x9" Pink Vinyl Floor Tile	ABATED
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Abated	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st Floor Vault - 1954 (New Connection Corridor to 2003-2004 Annex)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	S		
MATERIAL DESCRIPTION:	9"x9" Pink Vinyl Floor Tile	ABATED	
MATERIAL LOCATION:	1st Floor Vault - 1954 (New Connection Corridor to 2003-2004 Annex)		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	T		
MATERIAL DESCRIPTION:	9"x9" Pink Vinyl Floor Tile Mastic - ABATED		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: 1st Floor Vault - 1954 (New Connection Corridor to 2003-2004 Annex)

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	T		
MATERIAL DESCRIPTION:	9"x9" Pink Vinyl Floor Tile Mastic - ABATED		
MATERIAL LOCATION:	1st Floor Vault - 1954 (New Connection Corridor to 2003-2004 Annex)		
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	U	
MATERIAL DESCRIPTION:	12"x12" White Textured Vinyl Floor Tile	NOT OBSERVED
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage	
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:	Follow O&M Plan	
ASBESTOS TYPE:	Assumed	FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Vault - 1954 NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **NOT OBSERVED**

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA: U

MATERIAL DESCRIPTION: 12"x12" White Textured Vinyl Floor Tile NOT OBSERVED

MATERIAL LOCATION: 1st Floor Vault - 1954 NOT OBSERVED

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	V		
MATERIAL DESCRIPTION:	12"x12" White Textured Vinyl Floor Tile Mastic	NOT OBSERVED	
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor Vault - 1954 NOT OBSERVED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **NOT OBSERVED**

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	V		
MATERIAL DESCRIPTION:	12"x12" White Textured Vinyl Floor Tile Mastic	NOT OBSERVED	
MATERIAL LOCATION:	1st Floor Vault - 1954	NOT OBSERVED	
MATERIAL QUANTITY:		MATERIAL UNITS:	
DAMAGE QUANTITY:		DAMAGE UNITS:	

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **W**  
MATERIAL DESCRIPTION: **12"x12" Tan VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **2nd, & 3rd Floor Corridors & Room 13; Room 212; 312, 313 - 1954**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS: **Room 212 Possible under Carpet**

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
**2016 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	W		
MATERIAL DESCRIPTION:	12"x12" Tan VFT		
MATERIAL LOCATION:	2nd, & 3rd Floor Corridors & Room 13; Room 212; 312, 313 - 1954		
MATERIAL QUANTITY:	3500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **X**  
MATERIAL DESCRIPTION: **12"x12" Tan VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd, & 3rd Floor Corridors & Rooms 212 & 213, 312, 313 - 1954**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	X		
MATERIAL DESCRIPTION:	12"x12" Tan VFT Mastic		
MATERIAL LOCATION:	2nd, & 3rd Floor Corridors & Rooms 212 & 213, 312, 313 - 1954		
MATERIAL QUANTITY:	3500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Y		
MATERIAL DESCRIPTION:	12x12 inch White w/beige streaks VFT		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd, 3rd Floor former vaulted area (corridors) - 1954 addition		
MATERIAL QUANTITY:	575	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	Y		
MATERIAL DESCRIPTION:	12x12 inch White w/beige streaks VFT		
MATERIAL LOCATION:	1st, 2nd, 3rd Floor former vaulted area (corridors) - 1954 addition		
MATERIAL QUANTITY:	575	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Y1**  
MATERIAL DESCRIPTION: **12x12 inch White w/beige streaks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st, 2nd, 3rd Floor former vaulted area (corridors) - 1954 addition**  
MATERIAL QUANTITY: **575** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	Y1		
MATERIAL DESCRIPTION:	12x12 inch White w/beige streaks VFT Mastic		
MATERIAL LOCATION:	1st, 2nd, 3rd Floor former vaulted area (corridors) - 1954 addition		
MATERIAL QUANTITY:	575	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Z		
MATERIAL DESCRIPTION:	Carpet Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Office		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	Z		
MATERIAL DESCRIPTION:	Carpet Mastic		
MATERIAL LOCATION:	Main Office		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	David Avila		
SCHOOL NAME:	Goudy School	INSPECTION DATE:	3/29/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	Z1		
MATERIAL DESCRIPTION:	2' x 4' ceiling tiles		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout 1936 Building		
MATERIAL QUANTITY:	40000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature:



Date: 03/29/2016

# Chicago Public Schools

GSG Consultants, Inc.  
**2016 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	Z1		
MATERIAL DESCRIPTION:	2' x 4' ceiling tiles		
MATERIAL LOCATION:	Throughout 1936 Building		
MATERIAL QUANTITY:	40000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Z2**  
MATERIAL DESCRIPTION: **2' x 4' ceiling tiles**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors; Rooms 313, 312, 213, 212, 113, and 112 - 1954 Addition**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23371	BUILDING ID:	3590
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Jigar Shah		
SCHOOL NAME:	Goudy School	REVIEW DATE:	5/20/2016		
ADDRESS:	5120 N Winthrop Avenue	IDPH LICENSE NO:	100-11093		

---

HOMOGENEOUS AREA:	Z2		
MATERIAL DESCRIPTION:	2' x 4' ceiling tiles		
MATERIAL LOCATION:	1st, 2nd, 3rd Floor Corridors; Rooms 313, 312, 213, 212, 113, and 112 - 1954 Addition		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:



Date: 05/20/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Goudy School** INSPECTION DATE: **3/29/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Carpet Mastic**  
MATERIAL LOCATION: **Room 212**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC** FRIABLE: **No**  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW** CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: DAMAGE REASON:  
DAMAGE QUANTITY: **0** DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/29/2016**

# Chicago Public Schools

**GSG Consultants, Inc.**  
**2016 AHERA REINSPECTION**

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23371** BUILDING ID: **3590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Goudy School** REVIEW DATE: **5/20/2016**  
ADDRESS: **5120 N Winthrop Avenue** IDPH LICENSE NO: **100-11093**

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Carpet Mastic**  
MATERIAL LOCATION: **Room 212**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_



Date: **05/20/2016**

# APPENDIX B

## Inspector and Management Planner Licenses

---

# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

DAVID AVILA

This is to certify that \_\_\_\_\_  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 02/13/2016 \_\_\_\_\_ with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



02/13/2016

Course Dates:

02/13/2017

Expires:

1602BIR08

Certificate Number:

Phone: 312-491-0081

Director of Training


Nicholas J. Peneff

Doctor of Public Health

FORM # A-010B



2016

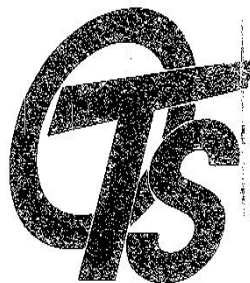

**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

# **Asbestos Management Planner Refresher**

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**


has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016

Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270320

  
Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • [www.dph.illinois.gov](http://www.dph.illinois.gov)

4/20/2016

**JIGAR M SHAH**  
855 W ADAMS ST, SUITE 200  
CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

**COPY OF THE ASBESTOS PROFESSIONAL LICENSE**

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
	<b>ID NUMBER</b> 100 - 07342	<b>ISSUED</b> 4/20/2016	INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/19/2017 2/2/2017 1/27/2017 2/26/2017
<b>JIGAR M SHAH</b> 855 W ADAMS ST, SUITE 200 CHICAGO, IL 60607 Environmental Health			 <b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**

*Nationally Accredited by PHAB*

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	CODE	KEY
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed