

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-389X
SCHOOL NAME: Zapata Branch
ADDRESS OF SCHOOL: 2725 Kolin
CITY: Chicago, IL, 60623

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **4/11/2013**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 6/6/2016 ENROLLMENT 829
IDPH INSPECTOR LICENSE NUMBER: 100-00249
IDPH LICENSED INSPECTOR NAME (Please Print): John Feely
IDPH MP LICENSE NUMBER: 100-03613
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



6/6/2016

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Zapata Branch

2725 Kolin
Chicago, IL, 60623

Unit: 23611
Building ID: 3821

IDPH ID Number: 14-016-2990-389X

REPORT DATE:

Monday, June 06, 2016

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW

April 15, 2016

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 23611 Region: 04 IDPH ID: 14-016-2990-389X

School: Zapata Branch Building ID: 3821

Address: 2725 Kolin

Chicago, IL, 60623

Building Contact: Coates, Thomas

Contact Phone: 773-633-7496

Current Building Owners: Chicago Public Schools

Review Date: 06/06/2016

Inspector: John Feely

Inspector IDPH License: 100-00249

Management Planner: Daniel Juneau

Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: April 15, 2016

RE: Zapata Branch, Unit 23611
2725 Kolin
Chicago, IL, 60623

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Zapata Branch , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Zapata Branch, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Zapata Branch
Address: 2725 Kolin
IDPH ID: 14-016-2990-389X
Contact: Coates, Thomas

Unit: 23611
Chicago, IL, 60623
Building ID: 3821
Phone: 773-633-7496

Region: 04

2. Description of Facility

Original Construction:
Total Square Footage: 23318
Current Occupancy: 829

Additional Construction:
No of Floors:

3. LEA Designated Person

Contact: Robert Christlieb
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603

Phone: (773) 553-3197

4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900

Fax: (312) 782-5145

5. Inspector

Inspector Name: John Feely


Inspector IDPH license # 100-00249

Signature:
Date: 4/15/2016

6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613

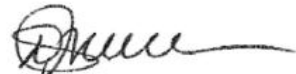Signature: 
Date: 06/06/2016

7. Review Date: 06/06/2016

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 6/6/2016

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Zapata Branch. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3821:

003-G	12"x12" Wood Patterned Floor Tile
007-F	12"x12" Beige w/Orng & Brn Strks Floor Tile Mastic
007-G	12"x12" Wood Patterned Floor Tile Mastic

B. The following new homogenous areas have been identified for Building 3821:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

001	2'x4' Lay In Ceiling Panels
002-A	9"x9" Lt. Brown w/Brn & White Floor Tile
002-B	9"x9" Med. Brown w/Brn & White Floor Tile
002-C	9"x9" Green w/Brown & White Floor Tile
002-D	9"x9" Red Floor Tile
002-E	9"x9" Green w/White Specks Floor Tile
002-F	9"x9" Gray w/White & Pink Specks Floor Tile
002-G	9"x9" Pink w/Gray & White Specks Floor Tile
002-H	9"x9" Aqua w/White & Black Streaks Floor Tile
003-A	12"x12" Beige & Brown Mix Floor Tile
003-B	12"x12" White w/Gray Specks Floor Tile
003-C	12"x12" Green Mix Floor Tile
003-D	12"x12" Orange Mix Floor Tile
003-E	12"x12" Green w/White Streaks Floor Tile
003-F	12"x12" Beige w/Orange & Brown Streaks Floor Tile
003-G	12"x12" Wood Patterned Floor Tile
003-H	12"x12" Pink Mix Floor Tile
003-I	12"x12" Gray Mix Floor Tile
003-J	12"x12" Dark Gray Mix Floor Tile
006-A	9"x9" Lt. Brown w/Brn & White Floor Tile Mastic
006-B	9"x9" Med. Brown w/Brn & White Floor Tile Mastic
006-C	9"x9" Green w/Brown & White Floor Tile Mastic
006-D	9"x9" Red Floor Tile Mastic
006-E	9"x9" Green w/White Specks Floor Tile Mastic
006-F	9"x9" Gray w/White & Pink Specks Floor Tile Mastic
006-G	9"x9" Pink w/Gray & White Specks Floor Tile Mastic
006-H	9"x9" Aqua w/White & Black Strks Floor Tile Mastic
007-A	12"x12" Beige & Brown Mix Floor Tile Mastic
007-B	12"x12" White w/Gray Specks Floor Tile Mastic
007-C	12"x12" Green Mix Floor Tile Mastic
007-D	12"x12" Orange Mix Floor Tile Mastic
007-E	12"x12" Green w/White Streaks Floor Tile Mastic
007-F	12"x12" Beige w/Orng & Brn Strks Floor Tile Mastic
007-G	12"x12" Wood Patterned Floor Tile Mastic
007-H	12"x12" Pink Mix Floor Tile Mastic
007-I	12"x12" Gray Mix Floor Tile Mastic

007-J	12"x12" Dark Gray Mix Floor Tile Mastic
009	Acoustical Wall Plaster
010	Acoustical Ceiling Plaster
011	Paper Beneath 9"x9" Floor Tile
012	Drywall
013	Drywall Compound
014	4" Black Vinyl Baseboard
015	4" Black Vinyl Baseboard Adhesive
016	4" Brown Vinyl Baseboard
017	4" Brown Vinyl Baseboard Adhesive
018	2'x4' Lay In Ceiling Panels
019	Chalk Board Adhesive
020	Pipe Joint Insulation on Aircell Insulated Piping
021	Gray Carpet Adhesive
022	Brown Vinyl Stair Treads
023	Brown Vinyl Stair Tread Adhesive
024	Brown Vinyl Stair Treads
025	Brown Vinyl Stair Tread Adhesive
026	Mastic Associated with Hardwood Flooring
027	Insulation in Fire Doors
028	Sink Undercoating
029	1' x 1' Pinhole Ceiling Tile
30	Tan w/Brown Terrazzo

The following areas were deemed to be inaccessible:

005	Aircell Pipe Insulation
006-A	9"x9" Lt. Brown w/Brn & White Floor Tile Mastic
006-B	9"x9" Med. Brown w/Brn & White Floor Tile Mastic
006-C	9"x9" Green w/Brown & White Floor Tile Mastic
006-D	9"x9" Red Floor Tile Mastic
006-E	9"x9" Green w/White Specks Floor Tile Mastic
006-F	9"x9" Gray w/White & Pink Specks Floor Tile Mastic
006-G	9"x9" Pink w/Gray & White Specks Floor Tile Mastic
006-H	9"x9" Aqua w/White & Black Strks Floor Tile Mastic
007-A	12"x12" Beige & Brown Mix Floor Tile Mastic
007-B	12"x12" White w/Gray Specks Floor Tile Mastic
007-C	12"x12" Green Mix Floor Tile Mastic
007-D	12"x12" Orange Mix Floor Tile Mastic
007-E	12"x12" Green w/White Streaks Floor Tile Mastic
007-F	12"x12" Beige w/Orng & Brn Strks Floor Tile Mastic

007-G	12"x12" Wood Patterned Floor Tile Mastic
007-H	12"x12" Pink Mix Floor Tile Mastic
007-I	12"x12" Gray Mix Floor Tile Mastic
007-J	12"x12" Dark Gray Mix Floor Tile Mastic
011	Paper Beneath 9"x9" Floor Tile
015	4" Black Vinyl Baseboard Adhesive
017	4" Brown Vinyl Baseboard Adhesive
019	Chalk Board Adhesive
020	Pipe Joint Insulation on Aircell Insulated Piping
021	Gray Carpet Adhesive
023	Brown Vinyl Stair Tread Adhesive
025	Brown Vinyl Stair Tread Adhesive
026	Mastic Associated with Hardwood Flooring
027	Insulation in Fire Doors
029	1' x 1' Pinhole Ceiling Tile

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by John Feely, IDPH License # 100-00249. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Zapata Branch Building 3821 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Zapata Branch Unit 23611 Building ID 3821

Address 2725 Kolin Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
001	2'x4' Lay In Ceiling Panels	1,876	SF	Basement	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
002-A	9"x9" Lt. Brown w/Brn & White Floor Tile	1,876	SF	Lunchroom, Lunchroom Manager's Office and Custodial Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
002-B	9"x9" Med. Brown w/Brn & White Floor Tile	1,700	SF	Lunchroom, Kitchen, Frezer Room, Corridor Behind Stage, Kitchen Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
002-C	9"x9" Green w/Brown & White Floor Tile	1,300	SF	Lunchroom & 1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
002-D	9"x9" Red Floor Tile	25	SF	First Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
002-E	9"x9" Green w/White Specks Floor Tile	2,000	SF	First & Second Floor Corridors, CCD	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
002-F	9"x9" Gray w/White & Pink Specks Floor Tile	900	SF	Classrooms 401 & 403	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
002-G	9"x9" Pink w/Gray & White Specks Floor Tile	900	SF	Classrooms 401 & 403	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
002-H	9"x9" Aqua w/White & Black Streaks Floor Tile	900	SF	Classroom 402	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
003-A	12"x12" Beige & Brown Mix Floor Tile	300	SF	Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
003-B	12"x12" White w/Gray Specks Floor Tile	50	SF	Custodian's Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
003-C	12"x12" Green Mix Floor Tile	450	SF	Classrooms 404 & 405	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
003-D	12"x12" Orange Mix Floor Tile	450	SF	Classrooms 404 & 405	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
003-E	12"x12" Green w/White Streaks Floor Tile	450	SF	Teacher's Lounge	ASSUMED	MISC	N	LOC	3		No	ACBM with the potential for damage	5	LOW
003-F	12"x12" Beige w/Orange & Brown Streaks Floor Tile			Teacher's Washroom	ASSUMED	MISC								
003-G	12"x12" Wood Patterned Floor Tile	80	SF	Teacher's Washroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
003-H	12"x12" Pink Mix Floor Tile	2,700	SF	Classrooms 501, 502, 503, 504, 505, 506	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
003-I	12"x12" Gray Mix Floor Tile	2,700	SF	Classrooms 501,	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Zapata Branch Unit 23611 Building ID 3821

Address 2725 Kolin Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				502, 503, 504, 505, 506								potential for damage		
003-J	12"x12" Dark Gray Mix Floor Tile	100	SF	Corridor to Basement Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
004	Cementitious Pipe Joint Insulation			Inspector did not observe	CHR	TSI		None						Low
005	Aircell Pipe Insulation	200	LF	Basement	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
006-A	9"x9" Lt. Brown w/Brn & White Floor Tile Mastic	1,876	SF	Lunchroom, Lunchroom Manager's Office and Custodial Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
006-B	9"x9" Med. Brown w/Brn & White Floor Tile Mastic	1,700	SF	Lunchroom, Kitchen, Freezer Room, Corridor Behind Stage, Kitchen Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
006-C	9"x9" Green w/Brown & White Floor Tile Mastic	1,300	SF	Lunchroom & 1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
006-D	9"x9" Red Floor Tile Mastic	25	SF	First Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
006-E	9"x9" Green w/White Specks Floor Tile Mastic	2,000	SF	First & Second Floor Corridors, CCD	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
006-F	9"x9" Gray w/White & Pink Specks Floor Tile Mastic	900	SF	Classrooms 401 & 403	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
006-G	9"x9" Pink w/Gray & White Specks Floor Tile Mastic	900	SF	Classrooms 401 & 403	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
006-H	9"x9" Aqua w/White & Black Strks Floor Tile Mastic	900	SF	Classroom 402	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
007-A	12"x12" Beige & Brown Mix Floor Tile Mastic	300	SF	Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
007-B	12"x12" White w/Gray Specks Floor Tile Mastic	50	SF	Custodian's Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
007-C	12"x12" Green Mix Floor Tile Mastic	450	SF	Classrooms 404 & 405	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
007-D	12"x12" Orange Mix Floor Tile Mastic	450	SF	Classrooms 404 & 405	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
007-E	12"x12" Green w/White Streaks Floor Tile Mastic	450	SF	Teacher's Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
007-F	12"x12" Beige w/Orng & Brn Strks Floor	10	SF	Teacher's Washroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the		LOW

Chicago Public Schools

School Zapata Branch Unit 23611 Building ID 3821

Address 2725 Kolin Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Tile Mastic											potential for damage		
007-G	12"x12" Wood Patterned Floor Tile Mastic	80	SF	Teacher's Washroom	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
007-H	12"x12" Pink Mix Floor Tile Mastic	2,700	SF	Classrooms 501, 502, 503, 504, 505, 506	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
007-I	12"x12" Gray Mix Floor Tile Mastic	2,700	SF	Classrooms 501, 502, 503, 504, 505, 506	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
007-J	12"x12" Dark Gray Mix Floor Tile Mastic	100	SF	Corridor to Basement Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
008	Hard Plaster on Walls & Ceilings			Throughout Facility	NO_ACBM	SURFACE								
009	Acoustical Wall Plaster	5,000	SF	Lunchroom	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
010	Acoustical Ceiling Plaster	80	SF	Main Entrance	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
011	Paper Beneath 9"x9" Floor Tile	3,960	SF	Corridors & Classrooms 401 & 403	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
012	Drywall	980	SF	lunchroom Manager's Office and Custodian Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
013	Drywall Compound	980	SF	lunchroom Manager's Office and Custodian Storage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
014	4" Black Vinyl Baseboard	15	LF	First Floor Corridor and Janitor's Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
015	4" Black Vinyl Baseboard Adhesive	15	LF	First Floor Corridor and Janitor's Closet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
016	4" Brown Vinyl Baseboard	1,500	LF	All Classrooms, Corridors, Office and Basement	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
017	4" Brown Vinyl Baseboard Adhesive	1,500	LF	All Classrooms, Corridors, Office and Basement	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
018	2'x4' Lay In Ceiling Panels	576	SF	Lunchroom Managers Office and Custodial Storage	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
019	Chalk Board Adhesive	900	SF	All Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Zapata Branch Unit 23611 Building ID 3821

Address 2725 Kolin Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
020	Pipe Joint Insulation on Aircell Insulated Piping	30	SF	Basement	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
021	Gray Carpet Adhesive	800	SF	Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
022	Brown Vinyl Stair Treads	384	SF	East & West Stairs	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
023	Brown Vinyl Stair Tread Adhesive	384	SF	East & West Stairs	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
024	Brown Vinyl Stair Treads	96	SF	Stage Stairs	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
025	Brown Vinyl Stair Tread Adhesive	96	SF	Stage Stairs	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
026	Mastic Associated with Hardwood Flooring	500	SF	Stage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
027	Insulation in Fire Doors	140	SF	Entrances	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
028	Sink Undercoating	8	SF	Teacher's Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
029	1' x 1' Pinhole Ceiling Tile	100	SF	Main Entrance	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
30	Tan w/Brown Terrazzo	1,200	SF	Stairs and Landings (front stairwell)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Zapata Branch Unit 23611 Building ID 3821

Address 2725 Kolin Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date **4/15/2016**

Inspector Name **John Feely**

100-00249

5/15/2016

Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
001	
002-A	
002-B	
002-C	
002-D	
002-E	
002-F	
002-G	
002-H	
003-A	
003-B	
003-C	
003-D	
003-E	Damage located in the teacher's lounge
003-F	Not observed 2016
003-G	
003-H	
003-I	
003-J	
004	Not observed 2016
005	
006-A	
006-B	
006-C	

Chicago Public Schools

School Zapata Branch Unit 23611 Building ID 3821

Address 2725 Kolin Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
006-D	
006-E	
006-F	
006-G	
006-H	
007-A	
007-B	
007-C	
007-D	
007-E	
007-F	
007-G	
007-H	
007-I	
007-J	
008	
009	
010	
011	
012	
013	
014	
015	
016	
017	
018	
019	
020	
021	

Chicago Public Schools

School Zapata Branch **Unit** 23611 **Building ID** 3821

Address 2725 Kolin **Region** 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
022	
023	
024	
025	
026	
027	
028	
029	
30	

Table II

Management Planner's Review

Chicago Public Schools

School Zapata Branch

Unit 23611

Building ID 3821

Address 2725 Kolin

Chicago, IL, 60623

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
001	2'x4' Lay In Ceiling Panels	1,876	SF	Basement	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
002-A	9"x9" Lt. Brown w/Brn & White Floor Tile	1,876	SF	Lunchroom, Lunchroom Manager's Office and Custodial Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
002-B	9"x9" Med. Brown w/Brn & White Floor Tile	1,700	SF	Lunchroom, Kitchen, Frezer Room, Corridor Behind Stage, Kitchen Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
002-C	9"x9" Green w/Brown & White Floor Tile	1,300	SF	Lunchroom & 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
002-D	9"x9" Red Floor Tile	25	SF	First Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
002-E	9"x9" Green w/White Specks Floor Tile	2,000	SF	First & Second Floor Corridors, CCD	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
002-F	9"x9" Gray w/White & Pink Specks Floor Tile	900	SF	Classrooms 401 & 403	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
002-G	9"x9" Pink w/Gray & White Specks Floor Tile	900	SF	Classrooms 401 & 403	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
002-H	9"x9" Aqua w/White & Black Streaks Floor Tile	900	SF	Classroom 402	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
003-A	12"x12" Beige & Brown Mix Floor Tile	300	SF	Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
003-B	12"x12" White w/Gray Specks Floor Tile	50	SF	Custodian's Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
003-C	12"x12" Green Mix Floor Tile	450	SF	Classrooms 404 & 405	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
003-D	12"x12" Orange Mix Floor Tile	450	SF	Classrooms 404 & 405	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
003-E	12"x12" Green w/White Streaks Floor Tile	450	SF	Teacher's Lounge	Assumed	MISC	No	3	SF	6 ACBM with the potential for damage	Repair
003-F	12"x12" Beige w/Orange & Brown Streaks Floor Tile			Teacher's Washroom	Assumed	MISC					
003-G	12"x12" Wood Patterned Floor Tile	80	SF	Teacher's Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
003-H	12"x12" Pink Mix Floor Tile	2,700	SF	Classrooms 501, 502, 503, 504, 505, 506	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
003-I	12"x12" Gray Mix Floor Tile	2,700	SF	Classrooms 501, 502, 503, 504, 505, 506	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
003-J	12"x12" Dark Gray Mix Floor Tile	100	SF	Corridor to Basement Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
004	Cementitious Pipe Joint Insulation			Inspector did not observe	Chrysotile	TSI					
005	Aircell Pipe Insulation	200	LF	Basement	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
006-A	9"x9" Lt. Brown w/Brn & White Floor Tile Mastic	1,876	SF	Lunchroom, Lunchroom Manager's Office and Custodial Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
006-B	9"x9" Med. Brown w/Brn & White Floor Tile Mastic	1,700	SF	Lunchroom, Kitchen, Freezer Room, Corridor Behind Stage, Kitchen Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
006-C	9"x9" Green w/Brown & White Floor Tile Mastic	1,300	SF	Lunchroom & 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
006-D	9"x9" Red Floor Tile Mastic	25	SF	First Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Zapata Branch

Unit 23611

Building ID 3821

Address 2725 Kolin

Chicago, IL, 60623

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
006-E	9"x9" Green w/White Specks Floor Tile Mastic	2,000	SF	First & Second Floor Corridors, CCD	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
006-F	9"x9" Gray w/White & Pink Specks Floor Tile Mastic	900	SF	Classrooms 401 & 403	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
006-G	9"x9" Pink w/Gray & White Specks Floor Tile Mastic	900	SF	Classrooms 401 & 403	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
006-H	9"x9" Aqua w/White & Black Strks Floor Tile Mastic	900	SF	Classroom 402	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007-A	12"x12" Beige & Brown Mix Floor Tile Mastic	300	SF	Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007-B	12"x12" White w/Gray Specks Floor Tile Mastic	50	SF	Custodian's Closet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007-C	12"x12" Green Mix Floor Tile Mastic	450	SF	Classrooms 404 & 405	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007-D	12"x12" Orange Mix Floor Tile Mastic	450	SF	Classrooms 404 & 405	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007-E	12"x12" Green w/White Streaks Floor Tile Mastic	450	SF	Teacher's Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007-F	12"x12" Beige w/Orng & Brn Strks Floor Tile Mastic	10	SF	Teacher's Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007-G	12"x12" Wood Patterned Floor Tile Mastic	80	SF	Teacher's Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007-H	12"x12" Pink Mix Floor Tile Mastic	2,700	SF	Classrooms 501, 502, 503, 504, 505, 506	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007-I	12"x12" Gray Mix Floor Tile Mastic	2,700	SF	Classrooms 501, 502, 503, 504, 505, 506	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
007-J	12"x12" Dark Gray Mix Floor Tile Mastic	100	SF	Corridor to Basement Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
008	Hard Plaster on Walls & Ceilings			Throughout Facility	No ACBM	SURFACE					
009	Acoustical Wall Plaster	5,000	SF	Lunchroom	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
010	Acoustical Ceiling Plaster	80	SF	Main Entrance	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
011	Paper Beneath 9"x9" Floor Tile	3,960	SF	Corridors & Classrooms 401 & 403	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
012	Drywall	980	SF	lunchroom Manager's Office and Custodian Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
013	Drywall Compound	980	SF	lunchroom Manager's Office and Custodian Storage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
014	4" Black Vinyl Baseboard	15	LF	First Floor Corridor and Janitor's Closet	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
015	4" Black Vinyl Baseboard Adhesive	15	LF	First Floor Corridor and Janitor's Closet	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
016	4" Brown Vinyl Baseboard	1,500	LF	All Classrooms, Corridors, Office and Basement	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
017	4" Brown Vinyl Baseboard Adhesive	1,500	LF	All Classrooms, Corridors, Office and Basement	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
018	2'x4' Lay In Ceiling Panels	576	SF	Lunchroom Managers Office and Custodial Storage	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

Chicago Public Schools

School Zapata Branch

Unit 23611

Building ID 3821

Address 2725 Kolin

Chicago, IL, 60623

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
019	Chalk Board Adhesive	900	SF	All Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
020	Pipe Joint Insulation on Aircell Insulated Piping	30	SF	Basement	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
021	Gray Carpet Adhesive	800	SF	Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
022	Brown Vinyl Stair Treads	384	SF	East & West Stairs	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
023	Brown Vinyl Stair Tread Adhesive	384	SF	East & West Stairs	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
024	Brown Vinyl Stair Treads	96	SF	Stage Stairs	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
025	Brown Vinyl Stair Tread Adhesive	96	SF	Stage Stairs	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
026	Mastic Associated with Hardwood Flooring	500	SF	Stage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
027	Insulation in Fire Doors	140	SF	Entrances	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
028	Sink Undercoating	8	SF	Teacher's Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
029	1' x 1' Pinhole Ceiling Tile	100	SF	Main Entrance	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
30	Tan w/Brown Terrazzo	1,200	SF	Stairs and Landings (front stairwell)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Zapata Branch

Unit 23611

Building ID 3821

Address 2725 Kolin

Chicago, IL, 60623

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	6/6/2016
Manager Planner Name	Daniel Juneau
100-03613	5/15/2016
Manager IDPH License No/Expiration	

HA Number	Management Comments
001	
002-A	
002-B	
002-C	
002-D	
002-E	
002-F	
002-G	
002-H	
003-A	
003-B	
003-C	
003-D	
003-E	Repair as needed then follow O&M plan.
003-F	If identified, implement O&M
003-G	
003-H	
003-I	
003-J	
004	If identified, implement O&M
005	
006-A	

Chicago Public Schools

School Zapata Branch

Unit 23611

Building ID 3821

Address 2725 Kolin

Chicago, IL, 60623

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
006-B	
006-C	
006-D	
006-E	
006-F	
006-G	
006-H	
007-A	
007-B	
007-C	
007-D	
007-E	
007-F	
007-G	
007-H	
007-I	
007-J	
008	
009	
010	
011	
012	
013	
014	
015	
016	
017	

Chicago Public Schools

School Zapata Branch

Unit 23611

Building ID 3821

Address 2725 Kolin

Chicago, IL, 60623

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
018	
019	
020	
021	
022	
023	
024	
025	
026	
027	
028	
029	
30	

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	001		
MATERIAL DESCRIPTION:	2'x4' Lay In Ceiling Panels		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement		
MATERIAL QUANTITY:	1876	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		


HOMOGENEOUS AREA:	001		
MATERIAL DESCRIPTION:	2'x4' Lay In Ceiling Panels		
MATERIAL LOCATION:	Basement		
MATERIAL QUANTITY:	1876	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	002-A		
MATERIAL DESCRIPTION:	9"x9" Lt. Brown w/Brn & White Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom, Lunchroom Manager's Office and Custodial Storage		
MATERIAL QUANTITY:	1876	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	002-A		
MATERIAL DESCRIPTION:	9"x9" Lt. Brown w/Brn & White Floor Tile		
MATERIAL LOCATION:	Lunchroom, Lunchroom Manager's Office and Custodial Storage		
MATERIAL QUANTITY:	1876	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

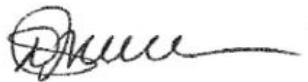

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	002-B		
MATERIAL DESCRIPTION:	9"x9" Med. Brown w/Brn & White Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom, Kitchen, Frezer Room, Corridor Behind Stage, Kitchen Storage		
MATERIAL QUANTITY:	1700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **002-B**

MATERIAL DESCRIPTION: **9"x9" Med. Brown w/Brn & White Floor Tile**

MATERIAL LOCATION: **Lunchroom, Kitchen, Freezer Room, Corridor Behind Stage, Kitchen Storage**

MATERIAL QUANTITY: **1700**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

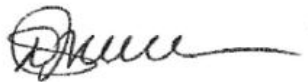

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	002-C		
MATERIAL DESCRIPTION:	9"x9" Green w/Brown & White Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunchroom & 1st Floor Corridor**

MATERIAL QUANTITY: **1300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 002-C

MATERIAL DESCRIPTION: 9"x9" Green w/Brown & White Floor Tile

MATERIAL LOCATION: Lunchroom & 1st Floor Corridor

MATERIAL QUANTITY: 1300

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

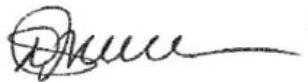

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	002-D		
MATERIAL DESCRIPTION:	9"x9" Red Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	First Floor Corridor		
MATERIAL QUANTITY:	25	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **002-D**

MATERIAL DESCRIPTION: **9"x9" Red Floor Tile**

MATERIAL LOCATION: **First Floor Corridor**

MATERIAL QUANTITY: **25**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	002-E		
MATERIAL DESCRIPTION:	9"x9" Green w/White Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First & Second Floor Corridors, CCD**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 002-E

MATERIAL DESCRIPTION: 9"x9" Green w/White Specks Floor Tile

MATERIAL LOCATION: First & Second Floor Corridors, CCD

MATERIAL QUANTITY: 2000

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

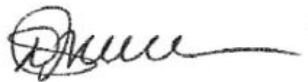

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	002-F		
MATERIAL DESCRIPTION:	9"x9" Gray w/White & Pink Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Classrooms 401 & 403		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **002-F**

MATERIAL DESCRIPTION: **9"x9" Gray w/White & Pink Specks Floor Tile**

MATERIAL LOCATION: **Classrooms 401 & 403**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

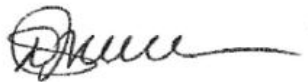

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	002-G		
MATERIAL DESCRIPTION:	9"x9" Pink w/Gray & White Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms 401 & 403**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 002-G

MATERIAL DESCRIPTION: 9"x9" Pink w/Gray & White Specks Floor Tile

MATERIAL LOCATION: Classrooms 401 & 403

MATERIAL QUANTITY: 900

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

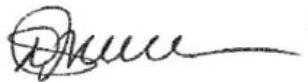

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	002-H		
MATERIAL DESCRIPTION:	9"x9" Aqua w/White & Black Streaks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classroom 402**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 002-H

MATERIAL DESCRIPTION: 9"x9" Aqua w/White & Black Streaks Floor Tile

MATERIAL LOCATION: Classroom 402

MATERIAL QUANTITY: 900

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	003-A		
MATERIAL DESCRIPTION:	12"x12" Beige & Brown Mix Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Office**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 003-A

MATERIAL DESCRIPTION: 12"x12" Beige & Brown Mix Floor Tile

MATERIAL LOCATION: Office

MATERIAL QUANTITY: 300

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

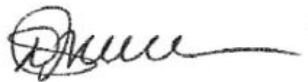

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	003-B		
MATERIAL DESCRIPTION:	12"x12" White w/Gray Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Custodian's Closet**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 003-B

MATERIAL DESCRIPTION: 12"x12" White w/Gray Specks Floor Tile

MATERIAL LOCATION: Custodian's Closet

MATERIAL QUANTITY: 50

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

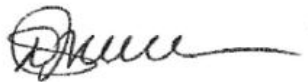

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	003-C		
MATERIAL DESCRIPTION:	12"x12" Green Mix Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Classrooms 404 & 405		
MATERIAL QUANTITY:	450	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **003-C**

MATERIAL DESCRIPTION: **12"x12" Green Mix Floor Tile**

MATERIAL LOCATION: **Classrooms 404 & 405**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

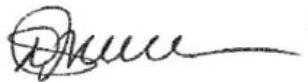

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	003-D		
MATERIAL DESCRIPTION:	12"x12" Orange Mix Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Classrooms 404 & 405		
MATERIAL QUANTITY:	450	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 003-D

MATERIAL DESCRIPTION: 12"x12" Orange Mix Floor Tile

MATERIAL LOCATION: Classrooms 404 & 405

MATERIAL QUANTITY: 450

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	003-E		
MATERIAL DESCRIPTION:	12"x12" Green w/White Streaks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 Damaged or significantly damaged friable misc. ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Repair		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:	Physical Damage		
DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Teacher's Lounge		
MATERIAL QUANTITY:	450	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:	Damage located in the teacher's lounge		

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 003-E

MATERIAL DESCRIPTION: 12"x12" Green w/White Streaks Floor Tile

MATERIAL LOCATION: Teacher's Lounge

MATERIAL QUANTITY: 450

MATERIAL UNITS: SF

DAMAGE QUANTITY: 3

DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Repair

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____

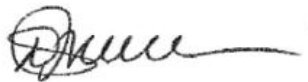

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	003-F	
MATERIAL DESCRIPTION:	12"x12" Beige w/Orange & Brown Streaks Floor Tile	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Teacher's Washroom

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Not observed 2016

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **003-F**

MATERIAL DESCRIPTION: **12"x12" Beige w/Orange & Brown Streaks Floor Tile**

MATERIAL LOCATION: **Teacher's Washroom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified, implement O&M

Management Planner's Signature: _____



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	003-G		
MATERIAL DESCRIPTION:	12"x12" Wood Patterned Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teacher's Washroom**

MATERIAL QUANTITY: **80**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **003-G**

MATERIAL DESCRIPTION: **12"x12" Wood Patterned Floor Tile**

MATERIAL LOCATION: **Teacher's Washroom**

MATERIAL QUANTITY: **80**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

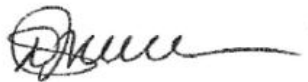

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	003-H		
MATERIAL DESCRIPTION:	12"x12" Pink Mix Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Classrooms 501, 502, 503, 504, 505, 506		
MATERIAL QUANTITY:	2700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	003-H		
MATERIAL DESCRIPTION:	12"x12" Pink Mix Floor Tile		
MATERIAL LOCATION:	Classrooms 501, 502, 503, 504, 505, 506		
MATERIAL QUANTITY:	2700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

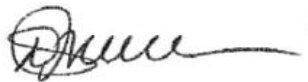

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	003-I		
MATERIAL DESCRIPTION:	12"x12" Gray Mix Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Classrooms 501, 502, 503, 504, 505, 506		
MATERIAL QUANTITY:	2700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 003-I

MATERIAL DESCRIPTION: 12"x12" Gray Mix Floor Tile

MATERIAL LOCATION: Classrooms 501, 502, 503, 504, 505, 506

MATERIAL QUANTITY: 2700

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

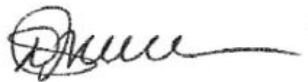

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	003-J		
MATERIAL DESCRIPTION:	12"x12" Dark Gray Mix Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Corridor to Basement Washroom**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 003-J

MATERIAL DESCRIPTION: 12"x12" Dark Gray Mix Floor Tile

MATERIAL LOCATION: Corridor to Basement Washroom

MATERIAL QUANTITY: 100

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	004	
MATERIAL DESCRIPTION:	Cementitious Pipe Joint Insulation	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Chrysotile	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: Low

MATERIAL LOCATION: Inspector did not observe

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: Not observed 2016

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **004**

MATERIAL DESCRIPTION: **Cementitious Pipe Joint Insulation**

MATERIAL LOCATION: **Inspector did not observe**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified, implement O&M

Management Planner's Signature: _____



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	005		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	005		
MATERIAL DESCRIPTION:	Aircell Pipe Insulation		
MATERIAL LOCATION:	Basement		
MATERIAL QUANTITY:	200	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

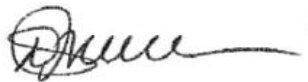

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	006-A		
MATERIAL DESCRIPTION:	9"x9" Lt. Brown w/Brn & White Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom, Lunchroom Manager's Office and Custodial Storage		
MATERIAL QUANTITY:	1876	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **006-A**

MATERIAL DESCRIPTION: **9"x9" Lt. Brown w/Brn & White Floor Tile Mastic**

MATERIAL LOCATION: **Lunchroom, Lunchroom Manager's Office and Custodial Storage**

MATERIAL QUANTITY:	1876	MATERIAL UNITS:	SF
--------------------	-------------	-----------------	-----------

DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
------------------	----------	---------------	-----------


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

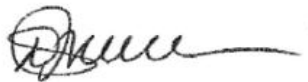

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	006-B		
MATERIAL DESCRIPTION:	9"x9" Med. Brown w/Brn & White Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom, Kitchen, Freezer Room, Corridor Behind Stage, Kitchen Storage		
MATERIAL QUANTITY:	1700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	006-B				
MATERIAL DESCRIPTION:	9"x9" Med. Brown w/Brn & White Floor Tile Mastic				
MATERIAL LOCATION:	Lunchroom, Kitchen, Freezer Room, Corridor Behind Stage, Kitchen Storage				
MATERIAL QUANTITY:	1700	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

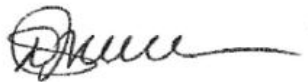

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	006-C		
MATERIAL DESCRIPTION:	9"x9" Green w/Brown & White Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Lunchroom & 1st Floor Corridor**

MATERIAL QUANTITY: **1300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **006-C**

MATERIAL DESCRIPTION: **9"x9" Green w/Brown & White Floor Tile Mastic**

MATERIAL LOCATION: **Lunchroom & 1st Floor Corridor**

MATERIAL QUANTITY: **1300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	006-D		
MATERIAL DESCRIPTION:	9"x9" Red Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First Floor Corridor**

MATERIAL QUANTITY: **25**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **006-D**

MATERIAL DESCRIPTION: **9"x9" Red Floor Tile Mastic**

MATERIAL LOCATION: **First Floor Corridor**

MATERIAL QUANTITY: **25**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	006-E		
MATERIAL DESCRIPTION:	9"x9" Green w/White Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **First & Second Floor Corridors, CCD**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **006-E**

MATERIAL DESCRIPTION: **9"x9" Green w/White Specks Floor Tile Mastic**

MATERIAL LOCATION: **First & Second Floor Corridors, CCD**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

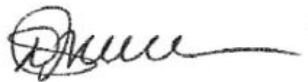

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	006-F		
MATERIAL DESCRIPTION:	9"x9" Gray w/White & Pink Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms 401 & 403**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 006-F

MATERIAL DESCRIPTION: 9"x9" Gray w/White & Pink Specks Floor Tile Mastic

MATERIAL LOCATION: Classrooms 401 & 403

MATERIAL QUANTITY: 900

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

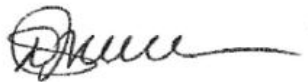

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	006-G		
MATERIAL DESCRIPTION:	9"x9" Pink w/Gray & White Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms 401 & 403**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **006-G**

MATERIAL DESCRIPTION: **9"x9" Pink w/Gray & White Specks Floor Tile Mastic**

MATERIAL LOCATION: **Classrooms 401 & 403**

MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
--------------------	------------	-----------------	-----------

DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
------------------	----------	---------------	-----------

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	006-H		
MATERIAL DESCRIPTION:	9"x9" Aqua w/White & Black Strks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classroom 402**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **006-H**

MATERIAL DESCRIPTION: **9"x9" Aqua w/White & Black Strks Floor Tile Mastic**

MATERIAL LOCATION: **Classroom 402**

MATERIAL QUANTITY: **900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	007-A		
MATERIAL DESCRIPTION:	12"x12" Beige & Brown Mix Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Office**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **007-A**

MATERIAL DESCRIPTION: **12"x12" Beige & Brown Mix Floor Tile Mastic**

MATERIAL LOCATION: **Office**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

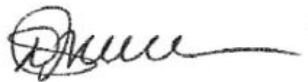

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	007-B		
MATERIAL DESCRIPTION:	12"x12" White w/Gray Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Custodian's Closet**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **007-B**

MATERIAL DESCRIPTION: **12"x12" White w/Gray Specks Floor Tile Mastic**

MATERIAL LOCATION: **Custodian's Closet**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

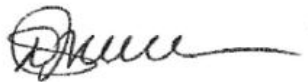

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	007-C		
MATERIAL DESCRIPTION:	12"x12" Green Mix Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms 404 & 405**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **007-C**

MATERIAL DESCRIPTION: **12"x12" Green Mix Floor Tile Mastic**

MATERIAL LOCATION: **Classrooms 404 & 405**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

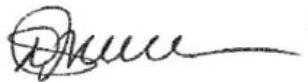

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	007-D		
MATERIAL DESCRIPTION:	12"x12" Orange Mix Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Classrooms 404 & 405**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 007-D

MATERIAL DESCRIPTION: 12"x12" Orange Mix Floor Tile Mastic

MATERIAL LOCATION: Classrooms 404 & 405

MATERIAL QUANTITY: 450

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	007-E		
MATERIAL DESCRIPTION:	12"x12" Green w/White Streaks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teacher's Lounge**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **007-E**

MATERIAL DESCRIPTION: **12"x12" Green w/White Streaks Floor Tile Mastic**

MATERIAL LOCATION: **Teacher's Lounge**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

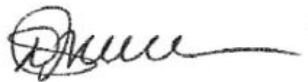

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	007-F		
MATERIAL DESCRIPTION:	12"x12" Beige w/Orng & Brn Strks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teacher's Washroom**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **007-F**

MATERIAL DESCRIPTION: **12"x12" Beige w/Orng & Brn Strks Floor Tile Mastic**

MATERIAL LOCATION: **Teacher's Washroom**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	007-G		
MATERIAL DESCRIPTION:	12"x12" Wood Patterned Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teacher's Washroom**

MATERIAL QUANTITY: **80**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **007-G**

MATERIAL DESCRIPTION: **12"x12" Wood Patterned Floor Tile Mastic**

MATERIAL LOCATION: **Teacher's Washroom**

MATERIAL QUANTITY: **80**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**


DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

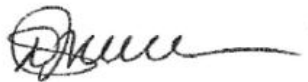

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	007-H		
MATERIAL DESCRIPTION:	12"x12" Pink Mix Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Classrooms 501, 502, 503, 504, 505, 506		
MATERIAL QUANTITY:	2700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 007-H

MATERIAL DESCRIPTION: 12"x12" Pink Mix Floor Tile Mastic

MATERIAL LOCATION: Classrooms 501, 502, 503, 504, 505, 506

MATERIAL QUANTITY: 2700

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	007-I		
MATERIAL DESCRIPTION:	12"x12" Gray Mix Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Classrooms 501, 502, 503, 504, 505, 506		
MATERIAL QUANTITY:	2700	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **007-I**

MATERIAL DESCRIPTION: **12"x12" Gray Mix Floor Tile Mastic**

MATERIAL LOCATION: **Classrooms 501, 502, 503, 504, 505, 506**

MATERIAL QUANTITY: **2700**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

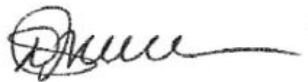

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	007-J		
MATERIAL DESCRIPTION:	12"x12" Dark Gray Mix Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridor to Basement Washroom		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **007-J**

MATERIAL DESCRIPTION: **12"x12" Dark Gray Mix Floor Tile Mastic**

MATERIAL LOCATION: **Corridor to Basement Washroom**

MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
--------------------	------------	-----------------	-----------

DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
------------------	----------	---------------	-----------


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

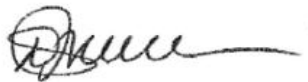

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	008	
MATERIAL DESCRIPTION:	Hard Plaster on Walls & Ceilings	
HISTORICAL AHERA DAMAGE CATEGORY	Significantly damaged friable surfacing ACBM	
HISTORICAL DAMAGE REASON:	Deterioration Physical Damage Water	
HISTORICAL RESPONSE ACTION:	Follow O&M Plan	
ASBESTOS TYPE:	No ACBM	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Throughout Facility

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 008

MATERIAL DESCRIPTION: Hard Plaster on Walls & Ceilings

MATERIAL LOCATION: Throughout Facility

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	009		
MATERIAL DESCRIPTION:	Acoustical Wall Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	009		
MATERIAL DESCRIPTION:	Acoustical Wall Plaster		
MATERIAL LOCATION:	Lunchroom		
MATERIAL QUANTITY:	5000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

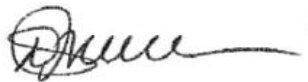

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	010		
MATERIAL DESCRIPTION:	Acoustical Ceiling Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Entrance		
MATERIAL QUANTITY:	80	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **010**

MATERIAL DESCRIPTION: **Acoustical Ceiling Plaster**

MATERIAL LOCATION: **Main Entrance**

MATERIAL QUANTITY: **80**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	011		
MATERIAL DESCRIPTION:	Paper Beneath 9"x9" Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Corridors & Classrooms 401 & 403		
MATERIAL QUANTITY:	3960	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	011				
MATERIAL DESCRIPTION:	Paper Beneath 9"x9" Floor Tile				
MATERIAL LOCATION:	Corridors & Classrooms 401 & 403				
MATERIAL QUANTITY:	3960	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

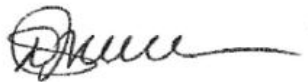

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	012		
MATERIAL DESCRIPTION:	Drywall		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	lunchroom Manager's Office and Custodian Storage		
MATERIAL QUANTITY:	980	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	012		
MATERIAL DESCRIPTION:	Drywall		
MATERIAL LOCATION:	lunchroom Manager's Office and Custodian Storage		
MATERIAL QUANTITY:	980	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	013		
MATERIAL DESCRIPTION:	Drywall Compound		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **lunchroom Manager's Office and Custodian Storage**

MATERIAL QUANTITY: **980**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	013		
MATERIAL DESCRIPTION:	Drywall Compound		
MATERIAL LOCATION:	lunchroom Manager's Office and Custodian Storage		
MATERIAL QUANTITY:	980	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

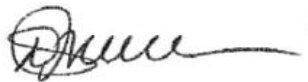

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	014		
MATERIAL DESCRIPTION:	4" Black Vinyl Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	First Floor Corridor and Janitor's Closet		
MATERIAL QUANTITY:	15	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	014				
MATERIAL DESCRIPTION:	4" Black Vinyl Baseboard				
MATERIAL LOCATION:	First Floor Corridor and Janitor's Closet				
MATERIAL QUANTITY:	15	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

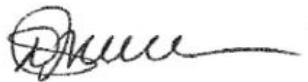

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	015		
MATERIAL DESCRIPTION:	4" Black Vinyl Baseboard Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	First Floor Corridor and Janitor's Closet		
MATERIAL QUANTITY:	15	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	015		
MATERIAL DESCRIPTION:	4" Black Vinyl Baseboard Adhesive		
MATERIAL LOCATION:	First Floor Corridor and Janitor's Closet		
MATERIAL QUANTITY:	15	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

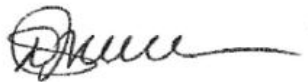

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	016		
MATERIAL DESCRIPTION:	4" Brown Vinyl Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	All Classrooms, Corridors, Office and Basement		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	016		
MATERIAL DESCRIPTION:	4" Brown Vinyl Baseboard		
MATERIAL LOCATION:	All Classrooms, Corridors, Office and Basement		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	017		
MATERIAL DESCRIPTION:	4" Brown Vinyl Baseboard Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	All Classrooms, Corridors, Office and Basement		
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	LF
DAMAGE QUANTITY:		DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	017				
MATERIAL DESCRIPTION:	4" Brown Vinyl Baseboard Adhesive				
MATERIAL LOCATION:	All Classrooms, Corridors, Office and Basement				
MATERIAL QUANTITY:	1500	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF		


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	018		
MATERIAL DESCRIPTION:	2'x4' Lay In Ceiling Panels		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom Managers Office and Custodial Storage		
MATERIAL QUANTITY:	576	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	018		
MATERIAL DESCRIPTION:	2'x4' Lay In Ceiling Panels		
MATERIAL LOCATION:	Lunchroom Managers Office and Custodial Storage		
MATERIAL QUANTITY:	576	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

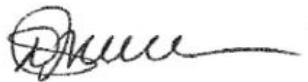

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	019		
MATERIAL DESCRIPTION:	Chalk Board Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	All Classrooms		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	019		
MATERIAL DESCRIPTION:	Chalk Board Adhesive		
MATERIAL LOCATION:	All Classrooms		
MATERIAL QUANTITY:	900	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

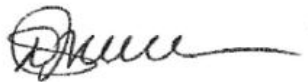

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	020		
MATERIAL DESCRIPTION:	Pipe Joint Insulation on Aircell Insulated Piping		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Basement		
MATERIAL QUANTITY:	30	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **020**

MATERIAL DESCRIPTION: **Pipe Joint Insulation on Aircell Insulated Piping**

MATERIAL LOCATION: **Basement**

MATERIAL QUANTITY: **30**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

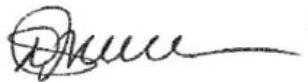

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	021		
MATERIAL DESCRIPTION:	Gray Carpet Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Office		
MATERIAL QUANTITY:	800	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 021

MATERIAL DESCRIPTION: Gray Carpet Adhesive

MATERIAL LOCATION: Office

MATERIAL QUANTITY: 800

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	022		
MATERIAL DESCRIPTION:	Brown Vinyl Stair Treads		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **East & West Stairs**

MATERIAL QUANTITY: **384**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	022		
MATERIAL DESCRIPTION:	Brown Vinyl Stair Treads		
MATERIAL LOCATION:	East & West Stairs		
MATERIAL QUANTITY:	384	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	023		
MATERIAL DESCRIPTION:	Brown Vinyl Stair Tread Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **East & West Stairs**

MATERIAL QUANTITY: **384**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	023		
MATERIAL DESCRIPTION:	Brown Vinyl Stair Tread Adhesive		
MATERIAL LOCATION:	East & West Stairs		
MATERIAL QUANTITY:	384	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	024		
MATERIAL DESCRIPTION:	Brown Vinyl Stair Treads		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stage Stairs		
MATERIAL QUANTITY:	96	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	024		
MATERIAL DESCRIPTION:	Brown Vinyl Stair Treads		
MATERIAL LOCATION:	Stage Stairs		
MATERIAL QUANTITY:	96	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	025		
MATERIAL DESCRIPTION:	Brown Vinyl Stair Tread Adhesive		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Stage Stairs**

MATERIAL QUANTITY: **96**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	025		
MATERIAL DESCRIPTION:	Brown Vinyl Stair Tread Adhesive		
MATERIAL LOCATION:	Stage Stairs		
MATERIAL QUANTITY:	96	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:



Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	026		
MATERIAL DESCRIPTION:	Mastic Associated with Hardwood Flooring		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Stage**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	026				
MATERIAL DESCRIPTION:	Mastic Associated with Hardwood Flooring				
MATERIAL LOCATION:	Stage				
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

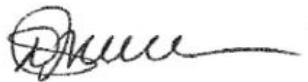

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	027		
MATERIAL DESCRIPTION:	Insulation in Fire Doors		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Entrances		
MATERIAL QUANTITY:	140	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: **027**

MATERIAL DESCRIPTION: **Insulation in Fire Doors**

MATERIAL LOCATION: **Entrances**

MATERIAL QUANTITY: **140**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	028		
MATERIAL DESCRIPTION:	Sink Undercoating		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teacher's Lounge**

MATERIAL QUANTITY: **8**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA:	028		
MATERIAL DESCRIPTION:	Sink Undercoating		
MATERIAL LOCATION:	Teacher's Lounge		
MATERIAL QUANTITY:	8	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

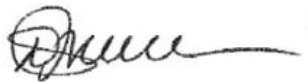

Date: **06/06/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	029		
MATERIAL DESCRIPTION:	1' x 1' Pinhole Ceiling Tile		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Main Entrance		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 029

MATERIAL DESCRIPTION: 1' x 1' Pinhole Ceiling Tile

MATERIAL LOCATION: Main Entrance

MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
--------------------	-----	-----------------	----

DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
------------------	---	---------------	----


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

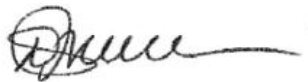

Date: 06/06/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	John Feely		
SCHOOL NAME:	Zapata Branch	INSPECTION DATE:	4/15/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	30		
MATERIAL DESCRIPTION:	Tan w/Brown Terrazzo		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stairs and Landings (front stairwell)		
MATERIAL QUANTITY:	1200	MATERIAL UNITS:	SF
DAMAGE QUANTITY:		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 04/15/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	23611	BUILDING ID:	3821
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Daniel Juneau		
SCHOOL NAME:	Zapata Branch	REVIEW DATE:	6/6/2016		
ADDRESS:	2725 Kolin	IDPH LICENSE NO:	100-00249		

HOMOGENEOUS AREA: 30

MATERIAL DESCRIPTION: Tan w/Brown Terrazzo

MATERIAL LOCATION: Stairs and Landings (front stairwell)

MATERIAL QUANTITY: 1200

MATERIAL UNITS: SF

DAMAGE QUANTITY: 0

DAMAGE UNITS: SF


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:

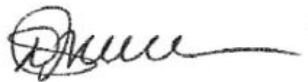

Date: 06/06/2016


Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses



ASBESTOS INSPECTOR
 Issued By
STATE OF WISCONSIN
 Dept. of Health Services
 John Charles Feely
 9513 Lawton Ave
 Oak Lawn IL 60453-2990

Alt-369	Exp: 07/11/2016	250 lbs	5' 11"
Training due by: 07/11/2016		02/13/1963	Male

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
IDPH
 ASBESTOS
 PROFESSIONAL
 LICENSE

ID NUMBER
 100 - 00249

ISSUED
 3/2/2015

EXPIRES
 05/15/2016

JOHN C FEELY
 9513 SOUTH LAWTON AVENUE
 OAK LAWN, IL 60453

Environmental Health

2016



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

→ Fax

Occupational Training & Supply, Inc. certifies that

John Feely


has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 1/6/2016

Exam Date: 1/6/2016

Expiration Date: 1/6/2017

Certificate Number: BIR1601060019

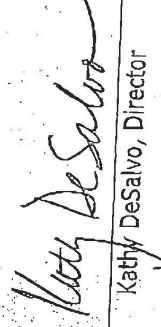
Kathy DeSalvo, Director

7084225061

02/04/2016 12:40 PM

2016



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Daniel Juneau


has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/6/2016

Exam Date: 1/6/2016

Expiration Date: 1/6/2017


Certificate Number: MPR1601060038



Kathy DeSalvo, Director


Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional

 **ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER	ISSUED	EXPIRES
100 - 03613	3/16/2015	05/15/2016

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016



Environmental Health

ENDORSEMENTS	TC EXPIRES
INSPECTOR	12/2/2015
MANAGEMENT PLANNER	1/20/2016
PROJECT MANAGER	12/11/2015
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Daniel Juneau


has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024163


Kathy DeSalvo, Director

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed