

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2356
SCHOOL NAME: ASPIRA - Mirta Ramirez @ Moos School
ADDRESS OF SCHOOL: 1711 N. California
CITY: Chicago, IL, 60647

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/25/2013**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 6/21/2016 ENROLLMENT 492
IDPH INSPECTOR LICENSE NUMBER: 100-05183
IDPH LICENSED INSPECTOR NAME (Please Print): Delores Fitzpatrick
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



6/21/2016

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

ASPIRA - Mirta Ramirez @ Moos School

1711 N. California
Chicago, IL, 60647

Unit: 24551
Building ID: 4870

IDPH ID Number: 14-016-2990-2356

REPORT DATE:

Tuesday, June 21, 2016

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone (312) 733-6262

Fax (312) 733-5612

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

April 5, 2016

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

GSG Consultants, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1,2,6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 24551 Region: 02 IDPH ID: 14-016-2990-2356

School: ASPIRA - Mirta Ramirez @ Moos School Building ID: 4870

Address: 1711 N. California
Chicago, IL, 60647

Building Contact: Cox, James Contact Phone: 773-537-8574

Current Building Owners: Chicago Public Schools

Review Date: 06/20/2016

Inspector: Delores Fitzpatrick Inspector IDPH License: 100-05183
Management Planner: Jigar Shah Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 733-6262

Sincerely,
GSG Consultants, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: April 05, 2016

RE: ASPIRA - Mirta Ramirez @ Moos School, Unit 24551
1711 N. California
Chicago, IL, 60647

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at ASPIRA - Mirta Ramirez @ Moos School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at ASPIRA - Mirta Ramirez @ Moos School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: ASPIRA - Mirta Ramirez @ Moos School
Address: 1711 N. California
IDPH ID: 14-016-2990-2356
Contact: Cox, James

Unit: 24551
Chicago, IL, 60647
Building ID: 4870
Phone: 773-537-8574

Region: 02

2. Description of Facility

Original Construction: 1896
Total Square Footage: 82022
Current Occupancy: 492

Additional Construction: 2003
No of Floors: 2

3. LEA Designated Person

Contact: Robert Christlieb
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603

Phone: (773) 553-3197

4. Managing Environmental Consultant

MEC: GSG Consultants, Inc.
Contact: Arturo Saenz
Address 855 W. Adams St., Ste. 200
Phone: (312) 733-6262

Fax: (312) 733-5612

5. Inspector

Inspector Name: Delores Fitzpatrick

Inspector IDPH license # 100-05183

Signature:
Date: 4/5/2016




6. Management Planner

Management Planner Name: Jigar Shah

Management Planner IDPH license # 100-07342

Signature:
Date: 06/20/2016

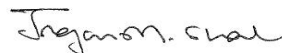

7. Review Date: 06/20/2016

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 6/21/2016

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

GSG Consultants, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the ASPIRA - Mirta Ramirez @ Moos School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4870:

- | | |
|----|--|
| 04 | Aircell Duct Insulation (NOT OBSERVED) |
| 07 | 9"x9" Beige VFT Mastic (ABATED) |

B. The following new homogenous areas have been identified for Building 4870:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

08	12"x12" Black VFT
09	12"x12" Black VFT Mastic
10	Green Linoleum
11	Green Linoleum Mastic
12	Hard Plaster
14	12"x12" Tan w/ Brown Streaks VFT
15	12"x12" Tan w/ Brown Streaks VFT Mastic
17	12"x12" Green w/ White Streaks VFT Mastic
18	12"x12" Brown w/ Brown & White Streaks VFT
19	12"x12" Brown w/ Brown & White Streaks VFT Mastic
22	12"x12" Blue/Gray VFT
23	12"x12" Blue/Gray VFT Mastic
26	12"x12" Tan/Beige VFT
30	12x12 Black Floor Tile
31	12x12 Black Floor Tile Mastic
32	2 x 4 White Ceiling Tile
A001	12 x 12 White VFT
A002	12 x 12 White Mastic
A003	Terrazzo - White w/ Black
A004	Terrazzo - Burgundy with Black
A005	2 x 4 White CT - Sculpted
A006	2 x 4 White C.T. - Smooth
A007	Purple with Multi Colored Speck Carpet Mastic
A008	Drywall
A009	Drywall System Compound
A010	Vinyl Baseboard #1
A011	Vinyl Baseboard Mastic
A012	White Spray on Sink Undercoat
A013	Linoleum - Light Blue
A013M	Linoleum Lt. Blue- Mastic
A014	Vinyl Baseboard#2
A015	Vinyl Baseboard Mastic
A016	Gray Spray on Fire Proofing on Beams
A017	Red Spray on Fireproof Material

The following areas were deemed to be inaccessible:

31	12x12 Black Floor Tile Mastic
A017	Red Spray on Fireproof Material

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Delores Fitzpatrick, IDPH License # 100-05183. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The ASPIRA - Mirta Ramirez @ Moos School Building 4870 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School ASPIRA - Mirta Ramirez @ Moos School Unit 24551 Building ID 4870

Address 1711 N. California Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
04	Aircell Duct Insulation (NOT OBSERVED)	100	SF	East Side Basement Vestibule - Bldg 1893	CHR	TSI	Y	NONE	0		Yes	ACBM with the potential for damage	3	MODERATE
06	9"x9" Beige VFT (ABATED)	130	SF	Engineer's Old Office - Bldg 1893	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
07	9"x9" Beige VFT Mastic (ABATED)			Engineer's Office & Room 004 Bldg 1893	ABATED	MISC					Yes			
08	12"x12" Black VFT	2,400	SF	Basement Hallway, Storage Room East of 006, 001 Bldg 1893	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
09	12"x12" Black VFT Mastic	2,400	SF	Basement Hallway, Storage Room East of 006, 001 Bldg 1893	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	Green Linoleum	800	SF	Room 100 Bldg 1893	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
11	Green Linoleum Mastic	800	SF	Room 100 Bldg 1893	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	Hard Plaster	200,000	SF	Throughout; Base 1st, 2nd, 3rd Floor Bldg 1893	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		HIGH
13	Boiler Jacket	500	SF	Boiler #1 & #2; Bldg 1893	CHR	TSI	Y	NONE	0		No	ACBM with potential for significant damage		MODERATE
14	12"x12" Tan w/ Brown Streaks VFT	1,800	SF	Cafeteria, 001, 006, 204 -Bldg 1893	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	12"x12" Tan w/ Brown Streaks VFT Mastic	1,800	SF	Cafeteria, 001, 006, 204 -Bldg 1893	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	12"x12" Green w/ White Streaks VFT	2,300	SF	Rooms 001, 010, 012 (Engineer's Office) engineer's 2nd office & Vestibule To Storeroom Next To Room 006 - Bldg 1893	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
17	12"x12" Green w/ White Streaks VFT Mastic	2,300	SF	Rooms 001, 010, 012 (Engineer's Office) engineer's 2nd office & Vestibule To Storeroom Next To Room 006 - Bldg 1893	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School ASPIRA - Mirta Ramirez @ Moos School Unit 24551 Building ID 4870

Address 1711 N. California Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
18	12"x12" Brown w/ Brown & White Streaks VFT	2,000	SF	Basement Teachers Lunchroom, 001, Assembly Hall - 1893 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12"x12" Brown w/ Brown & White Streaks VFT Mastic	2,000	SF	Basement Teachers Lunchroom, 001, Assembly Hall - 1893 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	9"x9" Brown VFT	750	SF	Room 002 Bldg 1893	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
21	9"x9" Brown VFT Mastic	750	SF	Room 002 -Bldg 1893	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
22	12"x12" Blue/Gray VFT	600	SF	1st, 2nd, & 3rd Floor Teacher Toilets	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	12"x12" Blue/Gray VFT Mastic	600	SF	1st, 2nd, & 3rd Floor Teacher Toilets Bldg 1893	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12"x12" Off White VFT			Removed - Hardwood Floors & Terrazzo Tile - Bldg 1893	ABATED	MISC		NONE						LOW
25	12"x12" Off White VFT Mastic			Removed	ABATED	MISC					No			LOW
26	12"x12" Tan/Beige VFT	900	SF	Room 102 - Bldg 1893	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage	5	MODERATE
27	12"x12" Tan/Beige VFT Mastic	900	SF	Room 102 - Bldg 1893	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	MJP E/F/V on Fiberglass Pipe Insulation (ABATED)			Room 012 Bldg 1893	ABATED	TSI								
29	Aircell Pipe Insulation			Room 012 (Engineer's Office) Bldg 1893	ABATED	TSI								
30	12x12 Black Floor Tile	1,400	SF	1st, 2nd, 3rd Floor North Hallway Entrance to New Building - Bldg 1893	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	12x12 Black Floor Tile Mastic	1,400	SF	1st, 2nd, 3rd Floor North Hallway Entrance to New Building - Bldg 1893	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	2 x 4 White Ceiling Tile	1,100	SF	1st Flr Main Office; 2nd Flr Rm. 204	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
A001	12 x 12 White VFT	21,600	SF	1st, 2nd, 3rd Floor	ASSUMED	MISC	N	NONE	0			ACBM with the		LOW

Chicago Public Schools

School ASPIRA - Mirta Ramirez @ Moos School Unit 24551 Building ID 4870

Address 1711 N. California Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Classrooms -2010 Bldg								potential for damage		
A002	12 x 12 White Mastic	21,600	SF	1st, 2nd, 3rd Floor Classrooms -2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A003	Terrazzo - White w/ Black	5,500	SF	Throughout Corridors, Stairwells. 1st, 2nd, 3rd Floors -2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A004	Terrazzo - Burgundy with Black	5,500	SF	Throughout Corridors, Stairwells. 1st, 2nd, 3rd Floors -2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A005	2 x 4 White CT - Sculpted	5,500	SF	Throughout Classrooms & Offices 1st, 2nd, 3rd Floor -2010 Bldg	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
A006	2 x 4 White C.T. - Smooth	5,500	SF	Throughout Corridors. 1st, 2nd, 3rd Floors -2010 Bldg	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
A007	Purple with Multi Colored Speck Carpet Mastic	5,000	SF	Resource Center Offices -2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A008	Drywall	12,000	SF	Throughout 1st, 2nd, 3rd Floors -2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A009	Drywall System Compound	4,200	SF	Throughout 1st, 2nd, 3rd Floors -2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A010	Vinyl Baseboard #1	6,500	SF	Classrooms 1st, 2nd, 3rd Floors -2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A011	Vinyl Baseboard Mastic	6,500	SF	Classrooms 1st, 2nd, 3rd Floors -2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A012	White Spray on Sink Undercoat	5	SF	#111- A -2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A013	Linoleum - Light Blue	4,200	SF	1st Floor All Purpose Room - 2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A013M	Linoleum Lt. Blue- Mastic	4,200	SF	1st Floor All Purpose Room -	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW

Chicago Public Schools

School ASPIRA - Mirta Ramirez @ Moos School Unit 24551 Building ID 4870

Address 1711 N. California Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				2010 Bldg										
A014	Vinyl Baseboard#2	1,000	SF	1st Floor All Purpose Room & Kitchen -2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A015	Vinyl Baseboard Mastic	1,000	SF	1st Floor - All Purpose Room & Kitchen -2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A016	Gray Spray on Fire Proofing on Beams	150	SF	2nd Floor Mechanical Room - 2010 Bldg	ASSUMED	MISC	Y	NONE	0			ACBM with the potential for damage		LOW
A017	Red Spray on Fireproof Material	150	SF	2nd Floor Mechanical Room on Beams & Walls - 2010 Bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW

Chicago Public Schools

School ASPIRA - Mirta Ramirez @ Moos School Unit 24551 Building ID 4870
Address 1711 N. California Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 4/5/2016
Inspector Name <u>Delores Fitzpatrick</u>
100-05183 2/13/2017
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
04	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	

Chicago Public Schools

School ASPIRA - Mirta Ramirez @ Moos School Unit 24551 Building ID 4870

Address 1711 N. California Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
29	
30	
31	
32	
A001	
A002	
A003	
A004	
A005	
A006	
A007	
A008	
A009	
A010	
A011	
A012	
A013	
A013M	
A014	
A015	
A016	
A017	

Table II

Management Planner's Review

Chicago Public Schools

School ASPIRA - Mirta Ramirez @
Moos School

Unit 24551

Building ID 4870

Address 1711 N. California

Chicago, IL, 60647

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
04	Aircell Duct Insulation (NOT OBSERVED)	100	SF	East Side Basement Vestibule - Bldg 1893	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	9"x9" Beige VFT (ABATED)	130	SF	Engineer's Old Office - Bldg 1893	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	9"x9" Beige VFT Mastic (ABATED)			Engineer's Office & Room 004 Bldg 1893	Abated	MISC					
08	12"x12" Black VFT	2,400	SF	Basement Hallway, Storage Room East of 006, 001 Bldg 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	12"x12" Black VFT Mastic	2,400	SF	Basement Hallway, Storage Room East of 006, 001 Bldg 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	Green Linoleum	800	SF	Room 100 Bldg 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	Green Linoleum Mastic	800	SF	Room 100 Bldg 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	Hard Plaster	200,000	SF	Throughout; Base 1st, 2nd, 3rd Floor Bldg 1893	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	Boiler Jacket	500	SF	Boiler #1 & #2; Bldg 1893	Chrysotile	TSI	Yes	0	SF	5 ACBM with potential for significant damage	Follow O&M Plan
14	12"x12" Tan w/ Brown Streaks VFT	1,800	SF	Cafeteria, 001, 006, 204 -Bldg 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12"x12" Tan w/ Brown Streaks VFT Mastic	1,800	SF	Cafeteria, 001, 006, 204 -Bldg 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	12"x12" Green w/ White Streaks VFT	2,300	SF	Rooms 001, 010, 012 (Engineer's Office) engineer's 2nd office & Vestibule To Storeroom Next To Room 006 - Bldg 1893	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	12"x12" Green w/ White Streaks VFT Mastic	2,300	SF	Rooms 001, 010, 012 (Engineer's Office) engineer's 2nd office & Vestibule To Storeroom Next To Room 006 - Bldg 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12"x12" Brown w/ Brown & White Streaks VFT	2,000	SF	Basement Teachers Lunchroom, 001, Assembly Hall -1893 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12"x12" Brown w/ Brown & White Streaks VFT Mastic	2,000	SF	Basement Teachers Lunchroom, 001, Assembly Hall -1893 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	9"x9" Brown VFT	750	SF	Room 002 Bldg 1893	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	9"x9" Brown VFT Mastic	750	SF	Room 002 -Bldg 1893	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12"x12" Blue/Gray VFT	600	SF	1st, 2nd, & 3rd Floor Teacher Toliets	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12"x12" Blue/Gray VFT Mastic	600	SF	1st, 2nd, & 3rd Floor Teacher Toliets Bldg 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12"x12" Off White VFT			Removed - Hardwood Floors &	Abated	MISC					

Chicago Public Schools

School ASPIRA - Mirta Ramirez @
Moos School

Unit 24551

Building ID 4870

Address 1711 N. California

Chicago, IL, 60647

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Terrazzo Tile - Bldg 1893							
25	12"x12" Off White VFT Mastic			Removed	Abated	MISC					
26	12"x12" Tan/Beige VFT	900	SF	Room 102 - Bldg 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12"x12" Tan/Beige VFT Mastic	900	SF	Room 102 - Bldg 1893	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	MJP E/F/V on Fiberglass Pipe Insulation (ABATED)			Room 012 Bldg 1893	Abated	TSI					
29	Aircell Pipe Insulation			Room 012 (Engineer's Office) Bldg 1893	Abated	TSI					
30	12x12 Black Floor Tile	1,400	SF	1st, 2nd, 3rd Floor North Hallway Entrance to New Building - Bldg 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12x12 Black Floor Tile Mastic	1,400	SF	1st, 2nd, 3rd Floor North Hallway Entrance to New Building - Bldg 1893	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	2 x 4 White Ceiling Tile	1,100	SF	1st Flr Main Office; 2nd Flr Rm. 204	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A001	12 x 12 White VFT	21,600	SF	1st, 2nd, 3rd Floor Classrooms -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A002	12 x 12 White Mastic	21,600	SF	1st, 2nd, 3rd Floor Classrooms -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A003	Terrazzo - White w/ Black	5,500	SF	Throughout Corridors, Stairwells. 1st, 2nd, 3rd Floors -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A004	Terrazzo - Burgundy with Black	5,500	SF	Throughout Corridors, Stairwells. 1st, 2nd, 3rd Floors -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A005	2 x 4 White CT - Sculpted	5,500	SF	Throughout Classrooms & Offices 1st, 2nd, 3rd Floor -2010 Bldg	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A006	2 x 4 White C.T. - Smooth	5,500	SF	Throughout Corridors. 1st, 2nd, 3rd Floors -2010 Bldg	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A007	Purple with Multi Colored Speck Carpet Mastic	5,000	SF	Resource Center Offices -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A008	Drywall	12,000	SF	Throughout 1st, 2nd, 3rd Floors -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A009	Drywall System Compound	4,200	SF	Throughout 1st, 2nd, 3rd Floors -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A010	Vinyl Baseboard #1	6,500	SF	Classrooms 1st, 2nd, 3rd Floors -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A011	Vinyl Baseboard Mastic	6,500	SF	Classrooms 1st, 2nd, 3rd Floors -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A012	White Spray on Sink Undercoat	5	SF	#111- A -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A013	Linoleum - Light Blue	4,200	SF	1st Floor All Purpose Room -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School ASPIRA - Mirta Ramirez @
Moos School

Unit 24551

Building ID 4870

Address 1711 N. California

Chicago, IL, 60647

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
A013M	Linoleum Lt. Blue- Mastic	4,200	SF	1st Floor All Purpose Room -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A014	Vinyl Baseboard#2	1,000	SF	1st Floor All Purpose Room & Kitchen -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A015	Vinyl Baseboard Mastic	1,000	SF	1st Floor - All Purpose Room & Kitchen -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A016	Gray Spray on Fire Proofing on Beams	150	SF	2nd Floor Mechanical Room -2010 Bldg	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A017	Red Spray on Fireproof Material	150	SF	2nd Floor Mechanical Room on Beams & Walls -2010 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School ASPIRA - Mirta Ramirez @
Moos School

Unit 24551

Building ID 4870

Address 1711 N. California

Chicago, IL, 60647

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

Review Date	6/20/2016
Manager Planner Name	Jigar Shah
100-07342	1/19/2017
Manager IDPH License No/Expiration	

HA Number	Management Comments
04	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	

Chicago Public Schools

School ASPIRA - Mirta Ramirez @
Moos School

Unit 24551

Building ID 4870

Address 1711 N. California

Chicago, IL, 60647

Region 02

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
30	
31	
32	
A001	
A002	
A003	
A004	
A005	
A006	
A007	
A008	
A009	
A010	
A011	
A012	
A013	
A013M	
A014	
A015	
A016	
A017	

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **Aircell Duct Insulation (NOT OBSERVED)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Deterioration
Delamination**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration
Delamination**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **East Side Basement Vestibule - Bldg 1893**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: **04/05/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **Aircell Duct Insulation (NOT OBSERVED)**
MATERIAL LOCATION: **East Side Basement Vestibule - Bldg 1893**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **9"x9" Beige VFT (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Engineer's Old Office - Bldg 1893**

MATERIAL QUANTITY: **130** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **9"x9" Beige VFT (ABATED)**
MATERIAL LOCATION: **Engineer's Old Office - Bldg 1893**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **9"x9" Beige VFT Mastic (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineer's Office & Room 004 Bldg 1893**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/05/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **9"x9" Beige VFT Mastic (ABATED)**
MATERIAL LOCATION: **Engineer's Office & Room 004 Bldg 1893**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **12"x12" Black VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Basement Hallway, Storage Room East of 006, 001 Bldg 1893**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **12"x12" Black VFT**
MATERIAL LOCATION: **Basement Hallway, Storage Room East of 006, 001 Bldg 1893**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **12"x12" Black VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Hallway, Storage Room East of 006, 001 Bldg 1893**

MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **12"x12" Black VFT Mastic**
MATERIAL LOCATION: **Basement Hallway, Storage Room East of 006, 001 Bldg 1893**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Green Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Room 100 Bldg 1893**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Green Linoleum**
MATERIAL LOCATION: **Room 100 Bldg 1893**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Green Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 100 Bldg 1893**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Green Linoleum Mastic**
MATERIAL LOCATION: **Room 100 Bldg 1893**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Hard Plaster**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**
MATERIAL LOCATION: **Throughout; Base 1st, 2nd, 3rd Floor Bldg 1893**
MATERIAL QUANTITY: **200000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Hard Plaster**
MATERIAL LOCATION: **Throughout; Base 1st, 2nd, 3rd Floor Bldg 1893**
MATERIAL QUANTITY: **200000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Boiler Jacket**
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Boiler #1 & #2; Bldg 1893**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Boiler Jacket**
MATERIAL LOCATION: **Boiler #1 & #2; Bldg 1893**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Cafeteria, 001, 006, 204 -Bldg 1893**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT**
MATERIAL LOCATION: **Cafeteria, 001, 006, 204 -Bldg 1893**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Cafeteria, 001, 006, 204 -Bldg 1893**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT Mastic**
MATERIAL LOCATION: **Cafeteria, 001, 006, 204 -Bldg 1893**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Green w/ White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Rooms 001, 010, 012 (Engineer's Office) engineer's 2nd office & Vestibule To Storeroom Next To Room 006 - Bldg 1893**

MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12"x12" Green w/ White Streaks VFT**
MATERIAL LOCATION: **Rooms 001, 010, 012 (Engineer's Office) engineer's 2nd office & Vestibule To Storeroom Next To Room 006 - Bldg 1893**
MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 24551 BUIDLING ID: 4870
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Delores Fitzpatrick
SCHOOL NAME: ASPIRA - Mirta Ramirez @ Moos School INSPECTION DATE: 4/5/2016
ADDRESS: 1711 N. California IDPH LICENSE NO: 100-05183

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 17
MATERIAL DESCRIPTION: 12"x12" Green w/ White Streaks VFT Mastic
HISTORICAL AHERA DAMAGE CATEGORY 6 ACBM with the potential for damage
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: Follow O&M Plan
ASBESTOS TYPE: Assumed FRIABLE: No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 001, 010, 012 (Engineer's Office) engineer's 2nd office & Vestibule To Storeroom Next To Room 006 - Bldg 1893**

MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12"x12" Green w/ White Streaks VFT Mastic**
MATERIAL LOCATION: **Rooms 001, 010, 012 (Engineer's Office) engineer's 2nd office & Vestibule To Storeroom Next To Room 006 - Bldg 1893**
MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Brown & White Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Basement Teachers Lunchroom, 001, Assembly Hall -1893 Bldg**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Brown & White Streaks VFT**
MATERIAL LOCATION: **Basement Teachers Lunchroom, 001, Assembly Hall -1893 Bldg**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Brown & White Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Basement Teachers Lunchroom, 001, Assembly Hall -1893 Bldg**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12"x12" Brown w/ Brown & White Streaks VFT Mastic**
MATERIAL LOCATION: **Basement Teachers Lunchroom, 001, Assembly Hall -1893 Bldg**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **9"x9" Brown VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Room 002 Bldg 1893**

MATERIAL QUANTITY: **750**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **9"x9" Brown VFT**
MATERIAL LOCATION: **Room 002 Bldg 1893**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **9"x9" Brown VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Room 002 -Bldg 1893**

MATERIAL QUANTITY: **750**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **9"x9" Brown VFT Mastic**
MATERIAL LOCATION: **Room 002 -Bldg 1893**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12"x12" Blue/Gray VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Teacher Toliets**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12"x12" Blue/Gray VFT**
MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Teacher Toilets**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12"x12" Blue/Gray VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Teacher Toliets Bldg 1893**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **12"x12" Blue/Gray VFT Mastic**
MATERIAL LOCATION: **1st, 2nd, & 3rd Floor Teacher Toilets Bldg 1893**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12"x12" Off White VFT**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Removed - Hardwood Floors & Terrazzo Tile - Bldg 1893**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/05/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12"x12" Off White VFT**
MATERIAL LOCATION: **Removed - Hardwood Floors & Terrazzo Tile - Bldg 1893**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" Off White VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Removed**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/05/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12"x12" Off White VFT Mastic**
MATERIAL LOCATION: **Removed**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12"x12" Tan/Beige VFT**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Room 102 - Bldg 1893**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12"x12" Tan/Beige VFT**
MATERIAL LOCATION: **Room 102 - Bldg 1893**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12"x12" Tan/Beige VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 102 - Bldg 1893**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **12"x12" Tan/Beige VFT Mastic**
MATERIAL LOCATION: **Room 102 - Bldg 1893**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 012 Bldg 1893**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/05/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipe Insulation (ABATED)**
MATERIAL LOCATION: **Room 012 Bldg 1893**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY: **Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 012 (Engineer's Office) Bldg 1893**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/05/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Room 012 (Engineer's Office) Bldg 1893**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12x12 Black Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor North Hallway Entrance to New Building - Bldg 1893**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12x12 Black Floor Tile**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor North Hallway Entrance to New Building - Bldg 1893**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12x12 Black Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor North Hallway Entrance to New Building - Bldg 1893**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **12x12 Black Floor Tile Mastic**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor North Hallway Entrance to New Building - Bldg 1893**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **2 x 4 White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Flr Main Office; 2nd Flr Rm. 204**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **2 x 4 White Ceiling Tile**
MATERIAL LOCATION: **1st Flr Main Office; 2nd Flr Rm. 204**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A001**
MATERIAL DESCRIPTION: **12 x 12 White VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Classrooms -2010 Bldg**
MATERIAL QUANTITY: **21600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A001**
MATERIAL DESCRIPTION: **12 x 12 White VFT**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Classrooms -2010 Bldg**
MATERIAL QUANTITY: **21600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A002**
MATERIAL DESCRIPTION: **12 x 12 White Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Classrooms -2010 Bldg**
MATERIAL QUANTITY: **21600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A002**
MATERIAL DESCRIPTION: **12 x 12 White Mastic**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Classrooms -2010 Bldg**
MATERIAL QUANTITY: **21600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A003**
MATERIAL DESCRIPTION: **Terrazzo - White w/ Black**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Corridors, Stairwells. 1st, 2nd, 3rd Floors -2010 Bldg**

MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/05/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A003**
MATERIAL DESCRIPTION: **Terrazzo - White w/ Black**
MATERIAL LOCATION: **Throughout Corridors, Stairwells. 1st, 2nd, 3rd Floors -2010 Bldg**
MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A004**
MATERIAL DESCRIPTION: **Terrazzo - Burgundy with Black**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Corridors, Stairwells. 1st, 2nd, 3rd Floors -2010 Bldg**

MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A004**
MATERIAL DESCRIPTION: **Terrazzo - Burgundy with Black**
MATERIAL LOCATION: **Throughout Corridors, Stairwells. 1st, 2nd, 3rd Floors -2010 Bldg**
MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A005**
MATERIAL DESCRIPTION: **2 x 4 White CT - Sculpted**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout Classrooms & Offices 1st, 2nd, 3rd Floor -2010 Bldg**

MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A005**
MATERIAL DESCRIPTION: **2 x 4 White CT - Sculpted**
MATERIAL LOCATION: **Throughout Classrooms & Offices 1st, 2nd, 3rd Floor -2010 Bldg**
MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A006**
MATERIAL DESCRIPTION: **2 x 4 White C.T. - Smooth**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Corridors. 1st, 2nd, 3rd Floors -2010 Bldg**
MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A006**
MATERIAL DESCRIPTION: **2 x 4 White C.T. - Smooth**
MATERIAL LOCATION: **Throughout Corridors. 1st, 2nd, 3rd Floors -2010 Bldg**
MATERIAL QUANTITY: **5500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A007**
MATERIAL DESCRIPTION: **Purple with Multi Colored Speck Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Resource Center Offices -2010 Bldg**

MATERIAL QUANTITY: **5000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/05/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A007**
MATERIAL DESCRIPTION: **Purple with Multi Colored Speck Carpet Mastic**
MATERIAL LOCATION: **Resource Center Offices -2010 Bldg**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A008**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1st, 2nd, 3rd Floors -2010 Bldg**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A008**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout 1st, 2nd, 3rd Floors -2010 Bldg**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A009**
MATERIAL DESCRIPTION: **Drywall System Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout 1st, 2nd, 3rd Floors -2010 Bldg**

MATERIAL QUANTITY: **4200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/05/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A009**
MATERIAL DESCRIPTION: **Drywall System Compound**
MATERIAL LOCATION: **Throughout 1st, 2nd, 3rd Floors -2010 Bldg**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A010**
MATERIAL DESCRIPTION: **Vinyl Baseboard #1**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms 1st, 2nd, 3rd Floors -2010 Bldg**
MATERIAL QUANTITY: **6500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A010**
MATERIAL DESCRIPTION: **Vinyl Baseboard #1**
MATERIAL LOCATION: **Classrooms 1st, 2nd, 3rd Floors -2010 Bldg**
MATERIAL QUANTITY: **6500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A011**
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Classrooms 1st, 2nd, 3rd Floors -2010 Bldg**
MATERIAL QUANTITY: **6500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A011**
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Classrooms 1st, 2nd, 3rd Floors -2010 Bldg**
MATERIAL QUANTITY: **6500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A012**
MATERIAL DESCRIPTION: **White Spray on Sink Undercoat**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **#111- A -2010 Bldg**

MATERIAL QUANTITY: **5**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A012**
MATERIAL DESCRIPTION: **White Spray on Sink Undercoat**
MATERIAL LOCATION: **#111- A -2010 Bldg**
MATERIAL QUANTITY: **5** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A013**
MATERIAL DESCRIPTION: **Linoleum - Light Blue**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor All Purpose Room -2010 Bldg**

MATERIAL QUANTITY: **4200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUILDING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A013**
MATERIAL DESCRIPTION: **Linoleum - Light Blue**
MATERIAL LOCATION: **1st Floor All Purpose Room -2010 Bldg**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A013M**
MATERIAL DESCRIPTION: **Linoleum Lt. Blue- Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Floor All Purpose Room -2010 Bldg**

MATERIAL QUANTITY: **4200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A013M**
MATERIAL DESCRIPTION: **Linoleum Lt. Blue- Mastic**
MATERIAL LOCATION: **1st Floor All Purpose Room -2010 Bldg**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A014**
MATERIAL DESCRIPTION: **Vinyl Baseboard#2**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor All Purpose Room & Kitchen -2010 Bldg**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A014**
MATERIAL DESCRIPTION: **Vinyl Baseboard#2**
MATERIAL LOCATION: **1st Floor All Purpose Room & Kitchen -2010 Bldg**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A015**
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor - All Purpose Room & Kitchen -2010 Bldg**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A015**
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**
MATERIAL LOCATION: **1st Floor - All Purpose Room & Kitchen -2010 Bldg**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A016**
MATERIAL DESCRIPTION: **Gray Spray on Fire Proofing on Beams**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Mechanical Room -2010 Bldg**

MATERIAL QUANTITY: **150**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A016**
MATERIAL DESCRIPTION: **Gray Spray on Fire Proofing on Beams**
MATERIAL LOCATION: **2nd Floor Mechanical Room -2010 Bldg**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Delores Fitzpatrick**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** INSPECTION DATE: **4/5/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A017**
MATERIAL DESCRIPTION: **Red Spray on Fireproof Material**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd Floor Mechanical Room on Beams & Walls -2010 Bldg**

MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____



Date: 04/05/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24551** BUIDLING ID: **4870**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **ASPIRA - Mirta Ramirez @ Moos School** REVIEW DATE: **6/20/2016**
ADDRESS: **1711 N. California** IDPH LICENSE NO: **100-05183**

HOMOGENEOUS AREA: **A017**
MATERIAL DESCRIPTION: **Red Spray on Fireproof Material**
MATERIAL LOCATION: **2nd Floor Mechanical Room on Beams & Walls -2010 Bldg**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **06/20/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that DELORES FITZPATRICK
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 02/16/2013 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



N. Kennedy

02/16/2013

Course Dates: _____

02/16/2014

Expires: _____

1302BIR20

Certificate Number: _____

Phone Number: (312) 491-4081

Director of Training
Nicholas J. Penell
Doctor of Public Health

FORM # A-010



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov



4/20/2016

DELORES FITZPATRICK
855 WEST ADAMS, SUITE 200
CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 05183

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE


Front of License			Back of License	
 ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
ID NUMBER TC0 - 05183	ISSUED 4/20/2016	EXPIRES 05/15/2017	INSPECTOR	2/13/2017
DELORES FITZPATRICK 855 WEST ADAMS, SUITE 200 CHICAGO, IL 60607 Environmental Health			PROJECT MANAGER AIR SAMPLING PROFESSIONAL	2/6/2017
			Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health. This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

2016

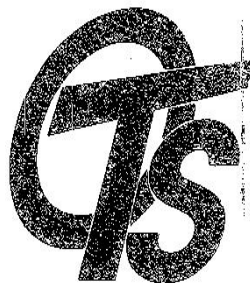

OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016

Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270320


Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

4/20/2016

JIGAR M SHAH
 855 W ADAMS ST, SUITE 200
 CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

		ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 109 - 07342	ISSUED 4/20/2016	EXPIRES 05/15/2017		INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/19/2017 2/2/2017 1/27/2017 2/26/2017
JIGAR M SHAH 855 W ADAMS ST, SUITE 200 CHICAGO, IL 60607 Environmental Health		Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.			

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
 EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed