

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2357  
SCHOOL NAME: Morrill School  
ADDRESS OF SCHOOL: 6011 S. Rockwell  
CITY: Chicago, IL, 60629

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/20/2013**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 4/18/2016 ENROLLMENT 744  
IDPH INSPECTOR LICENSE NUMBER: 100-04208  
IDPH LICENSED INSPECTOR NAME (Please Print): James Lehnhardt  
IDPH MP LICENSE NUMBER: 100-19466  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



4/18/2016

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Morrill School**

6011 S. Rockwell  
Chicago, IL, 60629

Unit: 24571  
Building ID: 4880

IDPH ID Number: 14-016-2990-2357

**REPORT DATE:**

Monday, April 18, 2016

**Prepared for:**

**Chicago Public Schools**  
**125 S. Clark Street**  
**Chicago, IL 60603**

**Prepared by:**

**Carnow, Conibear and Associates**

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

March 23, 2016

Mr. R. Kent Cook  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 24571                      Region: 05                      IDPH ID: 14-016-2990-2357

School: Morrill School                      Building ID: 4880

Address: 6011 S. Rockwell  
Chicago, IL, 60629

Building Contact: Baffoe, Kevin                      Contact Phone: 773-531-3582

Current Building Owners: Chicago Public Schools

Review Date: 04/18/2016

Inspector: James Lehnhardt

Inspector IDPH License: 100-04208

Management Planner: Evan Christian

Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,  
Carnow, Conibear and Associates

Evan Christian  
100-19466

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: March 23, 2016

RE: Morrill School, Unit 24571  
6011 S. Rockwell  
Chicago, IL, 60629

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Morrill School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Morrill School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Morrill School  
Address: 6011 S. Rockwell  
IDPH ID: 14-016-2990-2357  
Contact: Baffoe, Kevin

Unit: 24571  
Chicago, IL, 60629  
Building ID: 4880  
Phone: 773-531-3582

Region: 05

### 2. Description of Facility

Original Construction:  
Total Square Footage:  
Current Occupancy: 744

Additional Construction:  
No of Floors:

### 3. LEA Designated Person

Contact: Robert Christlieb  
Address: 125 South Clark Street, 17th Floor  
Chicago, IL 60603

Phone: (773) 553-3197

### 4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates  
Contact: Dan Juneau  
Address 600 West Van Buren St., Ste 500  
Phone: (312) 762-2900

Fax: (312) 782-5145

### 5. Inspector

Inspector Name: James Lehnhardt

Inspector IDPH license # 100-04208

Signature:  
Date: 3/23/2016

### 6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466

Signature:  
Date: 04/18/2016

### 7. Review Date: 04/18/2016

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 4/18/2016

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Morrill School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4880:

16	12x12 Tan/Cream VFT
19	Foilwrap over duct insulation
30	2x4 textured ceiling tile
E	Cardboard Insulation
F	Cardboard Joint compound
J	cementious mud on valves

B. The following new homogenous areas have been identified for Building 4880:



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

06	Decorative Plaster
12	12x12 peach and cream flr tile Mastic
14	2' x 4' acoustic ceiling tile
15	Wall Accents Acoustic Tile
16	12x12 Tan/Cream VFT
17	12x12 Tan/cream VFT mastic
18	White boiler gasket
19	Foilwrap over duct insulation
20	Purple carpet mastic
21	12x12 blue on blue floor tile
21M	Mastic for HA 21
22	12x12 ft off white w/specks
22M	Mastic for HA 22
23	12x12 ft red w/red streaks
23M	Mastic for HA 23
24	12x12 ft green w/green specs
24M	Mastic for HA 24
25	12x12 ft white w/blue and gray
25M	Mastic for HA 25
26	carpet mastic
27	baseboard mastic
28	pinhole tile 2x4 ceiling
29	drywall
30	2x4 textured ceiling tile
AA	12"x12" Floor Tile White w/ Tan
AA1	12"x12" Floor Tile White w/ Tan Mastic
E	Cardboard Insulation
FT-1	12x12 flr tile, white w/blue pink and yellow fleck
FT-3	12x12 flr tile, Black w/white flecks
FT-7	9x9 flr. Tile Black and Dark Maroon checked
FTM-1	Mastic 12x12 white w/blue,pink, yellow flecks
FTM-3	Mastic beneath black 12x12
FTM-7	Mastic beneath 9x9 black and dark maroon VFT
J	cementious mud on valves
K	Aircell Pipe Insulation

The following areas were deemed to be inaccessible:

12	12x12 peach and cream flr tile Mastic
14	2' x 4' acoustic ceiling tile

17	12x12 Tan/cream VFT mastic
20	Purple carpet mastic
21M	Mastic for HA 21
22M	Mastic for HA 22
23M	Mastic for HA 23
24M	Mastic for HA 24
25M	Mastic for HA 25
26	carpet mastic
27	baseboard mastic
AA1	12"x12" Floor Tile White w/ Tan Mastic
FTM-2	Mastic 12x12 dark brown w/multicolored flecks
FTM-3	Mastic beneath black 12x12
FTM-4	Mastic 9x9 green and cream checked (covered)
FTM-5	Mastic beneath 9x20 flooring
FTM-6	Mastic 12x12 tan and cream VFT
FTM-7	Mastic beneath 9x9 black and dark maroon VFT

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by James Lehnhardt, IDPH License # 100-04208. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Morrill School Building 4880 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Morrill School Unit 24571 Building ID 4880

Address 6011 S. Rockwell Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
02	12x12 peach and cream floor tile	2,400	SF	3rd floor corridor	CHR	MISC	N	DIST	30		No	ACBM with the potential for damage	3	LOW
03	Dark green Linoleum- ABATED			Rm 106, old library	ABATED	MISC								
06	Decorative Plaster	5,000	SF	Auditorium	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
10	Air cell debris	200	LF	Unexcavated Tunnel Area	CHR	TSI	Y	LOC	1		No	Damaged or significantly damaged friable thermal system insulating ACBM	10	LOW
11	9x9 brown and tan flr tile mastic			1st,2nd flr corridors	ABATED	MISC								
12	12x12 peach and cream flr tile Mastic	2,400	SF	3rd flr corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	Linoleum mastic			Rm 106- old library	ABATED	MISC								
14	2' x 4' acoustic ceiling tile	40,000	SF	1st, 2nd and 3rd fl classrooms and corridors	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
15	Wall Accents Acoustic Tile	500	SF	Auditorium	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
16	12x12 Tan/Cream VFT	1,500	SF	Rm 111, 106 and 201	ASSUMED	MISC	N	DIST	20		Yes	ACBM with the potential for damage	3	LOW
17	12x12 Tan/cream VFT mastic	1,500	SF	Rm 101, 106, 201	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	White boiler gasket	50	SF	Boiler room (on boiler)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	Foilwrap over duct insulation	500	LF	Boiler room - Boiler duct work	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
20	Purple carpet mastic	1,500	SF	Main office, Storage, Rm 107	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12x12 blue on blue floor tile	1,900	SF	cafeteria lunch room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21M	Mastic for HA 21	1,900	SF	cafeteria, lunch room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	12x12 ft off white w/specks	320	SF	kitchen office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22M	Mastic for HA 22	320	SF	kitchen office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	12x12 ft red w/red streaks	450	SF	room 117	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23M	Mastic for HA 23	450	SF	rm 117	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12x12 ft green w/green specs	450	SF	room 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

# Chicago Public Schools

School Morrill School Unit 24571 Building ID 4880

Address 6011 S. Rockwell Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												potential for damage		
24M	Mastic for HA 24	450	SF	rm 116	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	12x12 ft white w/blue and gray	5,050	SF	room 119, 2nd fl hall, 1st fl hall, rm 220, 216, elevator	ASSUMED	MISC	N	DIST	10		No	ACBM with the potential for damage	3	LOW
25M	Mastic for HA 25	5,050	SF	1st and 2nd floor rooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	carpet mastic	2,860	SF	rm 217 & 219, library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	baseboard mastic	980	SF	rms 116, 117, 119, 2nd floor, kitchen, lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	pinhole tile 2x4 ceiling	2,100	SF	floor room and 1st & 2nd	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	drywall	12,500	SF	annex, 1st & 2nd floor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	2x4 textured ceiling tile	4,000	SF	annex (S), 1st & 2nd floor	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
7	Packing material around pipes	25	SF	tunnels	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
AA	12"x12" Floor Tile White w/ Tan	6,000	SF	1st and 2nd Floor Corridors and Room 103	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
AA1	12"x12" Floor Tile White w/ Tan Mastic	6,000	SF	1st and 2nd Floor Corridors and Room 103	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
C	Air cell			Tunnel	ABATED	MISC								
D	Aircell Pipe Joint Insulation			Tunnels	ABATED	TSI		None						Low
E	Cardboard Insulation	500	LF	Boiler Room	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
F	Cardboard Joint compound	40	SF	Boiler Room, unexcavated tunnel	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
FT-1	12x12 flr tile, white w/blue pink and yellow fleck	1,900	SF	Rm 101,214,214B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-2	12x12 flr tile- Dark Brown w/multi colored flecks	750	SF	Rm 103	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-3	12x12 flr tile, Black w/white flecks	45	SF	1st flr. Hall- Patch	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-4	9x9 green and cream FT (covered with	300	SF	principals office and	CHR	MISC	N	NONE	0		No	ACBM with the		LOW

# Chicago Public Schools

School Morrill School Unit 24571 Building ID 4880

Address 6011 S. Rockwell Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	carpet)			storage								potential for damage		
FT-5	9x20 black flooring	1,000	SF	1st and 2nd fl halls border	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-6	12x12 flr. Tile Cream w/tan	750	SF	Rm 111/106 (Not observed), Rm 201	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-7	9x9 flr. Tile Black and Dark Maroon checked	300	SF	Gym office	ASSUMED	MISC	N	LOC	15		No	ACBM with the potential for damage	3	LOW
FTM-1	Mastic 12x12 white w/blue,pink, yellow flecks	1,900	SF	Rm 101,214,214B	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-2	Mastic 12x12 dark brown w/multicolored flecks	750	SF	Rm 103 Main office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-3	Mastic beneath black 12x12	45	SF	1st flr Hall patch	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-4	Mastic 9x9 green and cream checked (covered)	300	SF	Principals office, storage	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-5	Mastic beneath 9x20 flooring	1,000	SF	1st and 2nd hall	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-6	Mastic 12x12 tan and cream VFT	1,800	SF	Rm 106,111,201	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-7	Mastic beneath 9x9 black and dark maroon VFT	300	SF	Gym office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
G	Mag Block-Boiler			Boiler Rm	ABATED	MISC								
I	9x9 brown and tan floor tile			1st, 2nd flr corridors	ABATED	TSI		None						Low
J	cementitious mud on valves	10	LF	(N) base fan room	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
K	Aircell Pipe Insulation	350	LF	(W) tunnel unexcavated	ASSUMED	TSI	Y	DIST	10		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	LOW

# Chicago Public Schools

School Morrill School Unit 24571 Building ID 4880

Address 6011 S. Rockwell Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>3/23/2016</b>
Inspector Name <b>James Lehnhardt</b>
<b>100-04208</b> <b>5/15/2016</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
02	Damage located in 3rd Floor Corridor
03	
06	
10	
11	
12	
13	
14	
15	
16	Damage is located in Room 106, 111, and 201
17	
18	
19	
20	
21	
21M	
22	
22M	
23	
23M	
24	
24M	
25	Damage is located in the 1st and 2nd Floor Hallways
25M	



# Chicago Public Schools

School Morrill School Unit 24571 Building ID 4880

Address 6011 S. Rockwell Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
26	
27	
28	
29	
30	
7	
AA	
AA1	
C	
D	
E	
F	
FT-1	
FT-2	
FT-3	
FT-4	
FT-5	
FT-6	
FT-7	Damage is located in the Gym Office
FTM-1	
FTM-2	
FTM-3	
FTM-4	
FTM-5	
FTM-6	
FTM-7	
G	
I	
J	

# Chicago Public Schools

School Morrill School Unit 24571 Building ID 4880

Address 6011 S. Rockwell Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
K	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

School Morrill School  
Address 6011 S. Rockwell

Unit 24571  
Chicago, IL, 60629

Building ID 4880  
Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
02	12x12 peach and cream floor tile	2,400	SF	3rd floor corridor	Chrysotile	MISC	No	30	SF	6 ACBM with the potential for damage	Repair
03	Dark green Linoleum- ABATED			Rm 106, old library	Abated	MISC					
06	Decorative Plaster	5,000	SF	Auditorium	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
10	Air cell debris	200	LF	Unexcavated Tunnel Area	Chrysotile	TSI	Yes	1	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
11	9x9 brown and tan flr tile mastic			1st,2nd flr corridors	Abated	MISC					
12	12x12 peach and cream flr tile Mastic	2,400	SF	3rd flr corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	Linoleum mastic			Rm 106- old library	Abated	MISC					
14	2' x 4' acoustic ceiling tile	40,000	SF	1st, 2nd and 3rd fl classrooms and corridors	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
15	Wall Accents Acoustic Tile	500	SF	Auditorium	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
16	12x12 Tan/Cream VFT	1,500	SF	Rm 111, 106 and 201	Assumed	MISC	No	20	SF	6 ACBM with the potential for damage	Repair
17	12x12 Tan/cream VFT mastic	1,500	SF	Rm 101, 106, 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	White boiler gasket	50	SF	Boiler room (on boiler)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	Foilwrap over duct insulation	500	LF	Boiler room - Boiler duct work	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
20	Purple carpet mastic	1,500	SF	Main office, Storage, Rm 107	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12x12 blue on blue floor tile	1,900	SF	cafeteria lunch room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21M	Mastic for HA 21	1,900	SF	cafeteria, lunch room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	12x12 ft off white w/specks	320	SF	kitchen office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22M	Mastic for HA 22	320	SF	kitchen office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	12x12 ft red w/red streaks	450	SF	room 117	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23M	Mastic for HA 23	450	SF	rm 117	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12x12 ft green w/green specs	450	SF	room 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24M	Mastic for HA 24	450	SF	rm 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	12x12 ft white w/blue and gray	5,050	SF	room 119, 2nd fl hall, 1st fl hall, rm 220, 216, elevator	Assumed	MISC	No	10	SF	6 ACBM with the potential for damage	Repair
25M	Mastic for HA 25	5,050	SF	1st and 2nd floor rooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	carpet mastic	2,860	SF	rm 217 & 219, library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	baseboard mastic	980	SF	rms 116, 117, 119, 2nd floor, kitchen, lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	pinhole tile 2x4 ceiling	2,100	SF	floor room and 1st & 2nd	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	drywall	12,500	SF	annex, 1st & 2nd floor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

School Morrill School  
Address 6011 S. Rockwell

Unit 24571  
Chicago, IL, 60629

Building ID 4880  
Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
30	2x4 textured ceiling tile	4,000	SF	annex (S), 1st & 2nd floor	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
7	Packing material around pipes	25	SF	tunnels	Chrysotile	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
AA	12"x12" Floor Tile White w/ Tan	6,000	SF	1st and 2nd Floor Corridors and Room 103	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
AA1	12"x12" Floor Tile White w/ Tan Mastic	6,000	SF	1st and 2nd Floor Corridors and Room 103	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C	Air cell			Tunnel	Abated	MISC					
D	Aircell Pipe Joint Insulation			Tunnels	Abated	TSI					
E	Cardboard Insulation	500	LF	Boiler Room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
F	Cardboard Joint compound	40	SF	Boiler Room, unexcavated tunnel	Chrysotile	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
FT-1	12x12 flr tile, white w/blue pink and yellow fleck	1,900	SF	Rm 101,214,214B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-2	12x12 flr tile- Dark Brown w/multi colored flecks	750	SF	Rm 103	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-3	12x12 flr tile, Black w/white flecks	45	SF	1st flr. Hall- Patch	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-4	9x9 green and cream FT (covered with carpet)	300	SF	principals office and storage	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-5	9x20 black flooring	1,000	SF	1st and 2nd fl halls border	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-6	12x12 flr. Tile Cream w/tan	750	SF	Rm 111/106 (Not observed), Rm 201	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-7	9x9 flr. Tile Black and Dark Maroon checked	300	SF	Gym office	Assumed	MISC	No	15	SF	6 ACBM with the potential for damage	Repair
FTM-1	Mastic 12x12 white w/blue,pink, yellow flecks	1,900	SF	Rm 101,214,214B	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-2	Mastic 12x12 dark brown w/multicolored flecks	750	SF	Rm 103 Main office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-3	Mastic beneath black 12x12	45	SF	1st flr Hall patch	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-4	Mastic 9x9 green and cream checked (covered)	300	SF	Principals office, storage	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-5	Mastic beneath 9x20 flooring	1,000	SF	1st and 2nd hall	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-6	Mastic 12x12 tan and cream VFT	1,800	SF	Rm 106,111,201	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-7	Mastic beneath 9x9 black and dark maroon VFT	300	SF	Gym office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	Mag Block-Boiler			Boiler Rm	Abated	MISC					
I	9x9 brown and tan floor tile			1st, 2nd flr corridors	Abated	TSI					
J	cementious mud on valves	10	LF	(N) base fan room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
K	Aircell Pipe Insulation	350	LF	(W) tunnel unexcavated	Assumed	TSI	Yes	10	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair

# Chicago Public Schools

**School** Morrill School  
**Address** 6011 S. Rockwell

**Unit** 24571  
 Chicago, IL, 60629

**Building ID** 4880  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

***Management Planner's Comments Summarized at the End of the Report***

Review Date	4/18/2016
Manager Planner Name	Evan Christian
100-19466	5/15/2016
Manager IDPH License No/Expiration	

HA Number	Management Comments
02	Repair as needed then follow O&M procedures.
03	If identified follow O&M procedure.
06	
10	Repair as needed then follow O&M procedures.
11	If identified follow O&M procedure.
12	
13	If identified follow O&M procedure.

# Chicago Public Schools

**School** Morrill School  
**Address** 6011 S. Rockwell

**Unit** 24571  
 Chicago, IL, 60629

**Building ID** 4880  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
14	
15	
16	Repair as needed then follow O&M procedures.
17	
18	
19	
20	
21	
21M	
22	
22M	
23	
23M	
24	
24M	
25	Repair as needed then follow O&M procedures.
25M	
26	
27	
28	
29	
30	
7	
AA	
AA1	
C	If identified follow O&M procedure.
D	If identified follow O&M procedure.

# Chicago Public Schools

**School** Morrill School  
**Address** 6011 S. Rockwell

**Unit** 24571  
 Chicago, IL, 60629

**Building ID** 4880  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
E	
F	
FT-1	
FT-2	
FT-3	
FT-4	
FT-5	
FT-6	
FT-7	Repair as needed then follow O&M procedures.
FTM-1	
FTM-2	
FTM-3	
FTM-4	
FTM-5	
FTM-6	
FTM-7	
G	If identified follow O&M procedure.
I	If identified follow O&M procedure.
J	
K	Patch and repair as needed then follow O&M procedures.



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**  
MATERIAL DESCRIPTION: **12x12 peach and cream floor tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration  
Water**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **3rd floor corridor**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **SF**  
COMMENTS: **Damage located in 3rd Floor Corridor**

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **02**  
MATERIAL DESCRIPTION: **12x12 peach and cream floor tile**  
MATERIAL LOCATION: **3rd floor corridor**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### **Follow O&M Plan**

Comments:

Repair as needed then follow O&M procedures.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**  
MATERIAL DESCRIPTION: **Dark green Linoleum- ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rm 106, old library**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: **03/23/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **03**

MATERIAL DESCRIPTION: **Dark green Linoleum- ABATED**

MATERIAL LOCATION: **Rm 106, old library**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M procedure.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

## Carnow, Conibear and Associates 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **24571**    BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School**    INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell**    IDPH LICENSE NO: **100-04208**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **Decorative Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **5000**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **Decorative Plaster**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Air cell debris**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACM**  
HISTORICAL DAMAGE REASON: **Air Erosion/Flow**  
HISTORICAL RESPONSE ACTION: **Remove**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON: **Water Deterioration**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Unexcavated Tunnel Area**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **200** DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Air cell debris**  
MATERIAL LOCATION: **Unexcavated Tunnel Area**  
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **1** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Remove**

Comments:

Repair as needed then follow O&M procedures.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **9x9 brown and tan flr tile mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st,2nd flr corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: **03/23/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **9x9 brown and tan flr tile mastic**

MATERIAL LOCATION: **1st,2nd flr corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M procedure.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **12x12 peach and cream flr tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **3rd flr corridor**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **12x12 peach and cream flr tile Mastic**  
MATERIAL LOCATION: **3rd flr corridor**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **Linoleum mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rm 106- old library**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **03/23/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Linoleum mastic**

MATERIAL LOCATION: **Rm 106- old library**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M procedure.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **2' x 4' acoustic ceiling tile**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st, 2nd and 3rd fl classrooms and corridors**  
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **2' x 4' acoustic ceiling tile**  
MATERIAL LOCATION: **1st, 2nd and 3rd fl classrooms and corridors**  
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **Wall Accents Acoustic Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Wall Accents Acoustic Tile**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **12x12 Tan/Cream VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rm 111, 106 and 201**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **1500** DAMAGE UNITS: **SF**  
COMMENTS: **Damage is located in Room 106, 111, and 201**

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **12x12 Tan/Cream VFT**  
MATERIAL LOCATION: **Rm 111, 106 and 201**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **20** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### **Follow O&M Plan**

Comments:

Repair as needed then follow O&M procedures.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **12x12 Tan/cream VFT mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rm 101, 106, 201**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **12x12 Tan/cream VFT mastic**  
MATERIAL LOCATION: **Rm 101, 106, 201**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **24571**    BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School**    INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell**    IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **White boiler gasket**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler room (on boiler)**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **White boiler gasket**

MATERIAL LOCATION: **Boiler room (on boiler)**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Foilwrap over duct insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler room - Boiler duct work**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Foilwrap over duct insulation**  
MATERIAL LOCATION: **Boiler room - Boiler duct work**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Purple carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main office, Storage, Rm 107**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Purple carpet mastic**  
MATERIAL LOCATION: **Main office, Storage, Rm 107**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **12x12 blue on blue floor tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **cafeteria lunch room**

MATERIAL QUANTITY: **1900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **12x12 blue on blue floor tile**  
MATERIAL LOCATION: **cafeteria lunch room**  
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21M**  
MATERIAL DESCRIPTION: **Mastic for HA 21**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **cafeteria, lunch room**  
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **21M**  
MATERIAL DESCRIPTION: **Mastic for HA 21**  
MATERIAL LOCATION: **cafeteria, lunch room**  
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **12x12 ft off white w/specks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **kitchen office**

MATERIAL QUANTITY: **320**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **12x12 ft off white w/specks**

MATERIAL LOCATION: **kitchen office**

MATERIAL QUANTITY: **320**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22M**  
MATERIAL DESCRIPTION: **Mastic for HA 22**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **kitchen office**

MATERIAL QUANTITY: **320**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **22M**

MATERIAL DESCRIPTION: **Mastic for HA 22**

MATERIAL LOCATION: **kitchen office**

MATERIAL QUANTITY: **320**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **12x12 ft red w/red streaks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **room 117**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **12x12 ft red w/red streaks**

MATERIAL LOCATION: **room 117**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23M**  
MATERIAL DESCRIPTION: **Mastic for HA 23**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **rm 117**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **23M**

MATERIAL DESCRIPTION: **Mastic for HA 23**

MATERIAL LOCATION: **rm 117**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **24571**    BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School**    INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell**    IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **12x12 ft green w/green specs**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **room 116**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **12x12 ft green w/green specs**

MATERIAL LOCATION: **room 116**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24M**  
MATERIAL DESCRIPTION: **Mastic for HA 24**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **rm 116**  
MATERIAL QUANTITY: **450** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **24M**

MATERIAL DESCRIPTION: **Mastic for HA 24**

MATERIAL LOCATION: **rm 116**

MATERIAL QUANTITY: **450**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **12x12 ft white w/blue and gray**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON: **Deterioration**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **room 119, 2nd fl hall, 1st fl hall, rm 220, 216, elevator**  
MATERIAL QUANTITY: **5050** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **5050** DAMAGE UNITS: **SF**  
COMMENTS: **Damage is located in the 1st and 2nd Floor Hallways**

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **12x12 ft white w/blue and gray**  
MATERIAL LOCATION: **room 119, 2nd fl hall, 1st fl hall, rm 220, 216, elevator**  
MATERIAL QUANTITY: **5050** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **10** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Repair as needed then follow O&M procedures.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25M**  
MATERIAL DESCRIPTION: **Mastic for HA 25**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st and 2nd floor rooms**  
MATERIAL QUANTITY: **5050** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **25M**  
MATERIAL DESCRIPTION: **Mastic for HA 25**  
MATERIAL LOCATION: **1st and 2nd floor rooms**  
MATERIAL QUANTITY: **5050** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **carpet mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **rm 217 & 219, library**

MATERIAL QUANTITY: **2860**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **carpet mastic**  
MATERIAL LOCATION: **rm 217 & 219, library**  
MATERIAL QUANTITY: **2860** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

## Carnow, Conibear and Associates 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **baseboard mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **rms 116, 117, 119, 2nd floor, kitchen, lunchroom**

MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **baseboard mastic**  
MATERIAL LOCATION: **rms 116, 117, 119, 2nd floor, kitchen, lunchroom**  
MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **pinhole tile 2x4 ceiling**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **floor room and 1st & 2nd**

MATERIAL QUANTITY: **2100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **pinhole tile 2x4 ceiling**  
MATERIAL LOCATION: **floor room and 1st & 2nd**  
MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

## Carnow, Conibear and Associates 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **drywall**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **annex, 1st & 2nd floor**  
MATERIAL QUANTITY: **12500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **drywall**  
MATERIAL LOCATION: **annex, 1st & 2nd floor**  
MATERIAL QUANTITY: **12500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **2x4 textured ceiling tile**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **annex (S), 1st & 2nd floor**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **2x4 textured ceiling tile**  
MATERIAL LOCATION: **annex (S), 1st & 2nd floor**  
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**  
MATERIAL DESCRIPTION: **Packing material around pipes**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **tunnels**  
MATERIAL QUANTITY: **25** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **7**

MATERIAL DESCRIPTION: **Packing material around pipes**

MATERIAL LOCATION: **tunnels**

MATERIAL QUANTITY: **25**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **AA**  
MATERIAL DESCRIPTION: **12"x12" Floor Tile White w/ Tan**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st and 2nd Floor Corridors and Room 103**  
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **AA**  
MATERIAL DESCRIPTION: **12"x12" Floor Tile White w/ Tan**  
MATERIAL LOCATION: **1st and 2nd Floor Corridors and Room 103**  
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **AA1**  
MATERIAL DESCRIPTION: **12"x12" Floor Tile White w/ Tan Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st and 2nd Floor Corridors and Room 103**

MATERIAL QUANTITY: **6000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **AA1**  
MATERIAL DESCRIPTION: **12"x12" Floor Tile White w/ Tan Mastic**  
MATERIAL LOCATION: **1st and 2nd Floor Corridors and Room 103**  
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Air cell**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Tunnel**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **03/23/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **C**

MATERIAL DESCRIPTION: **Air cell**

MATERIAL LOCATION: **Tunnel**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M procedure.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Aircell Pipe Joint Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Tunnels**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **03/23/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **Aircell Pipe Joint Insulation**

MATERIAL LOCATION: **Tunnels**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M procedure.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

## Carnow, Conibear and Associates 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Cardboard Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Cardboard Insulation**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Cardboard Joint compound**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room, unexcavated tunnel**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Cardboard Joint compound**  
MATERIAL LOCATION: **Boiler Room, unexcavated tunnel**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-1**  
MATERIAL DESCRIPTION: **12x12 flr tile, white w/blue pink and yellow fleck**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rm 101,214,214B**  
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FT-1**

MATERIAL DESCRIPTION: **12x12 flr tile, white w/blue pink and yellow fleck**

MATERIAL LOCATION: **Rm 101,214,214B**

MATERIAL QUANTITY: **1900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

## Carnow, Conibear and Associates 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-2**  
MATERIAL DESCRIPTION: **12x12 flr tile- Dark Brown w/multi colored flecks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rm 103**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FT-2**  
MATERIAL DESCRIPTION: **12x12 flr tile- Dark Brown w/multi colored flecks**  
MATERIAL LOCATION: **Rm 103**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **24571**    BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School**    INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell**    IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-3**  
MATERIAL DESCRIPTION: **12x12 flr tile, Black w/white flecks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st flr. Hall- Patch**  
MATERIAL QUANTITY: **45**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FT-3**

MATERIAL DESCRIPTION: **12x12 flr tile, Black w/white flecks**

MATERIAL LOCATION: **1st flr. Hall- Patch**

MATERIAL QUANTITY: **45**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-4**  
MATERIAL DESCRIPTION: **9x9 green and cream FT (covered with carpet)**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **principals office and storage**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FT-4**

MATERIAL DESCRIPTION: **9x9 green and cream FT (covered with carpet)**

MATERIAL LOCATION: **principals office and storage**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-5**  
MATERIAL DESCRIPTION: **9x20 black flooring**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st and 2nd fl halls border**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FT-5**  
MATERIAL DESCRIPTION: **9x20 black flooring**  
MATERIAL LOCATION: **1st and 2nd fl halls border**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

## Carnow, Conibear and Associates 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-6**  
MATERIAL DESCRIPTION: **12x12 flr. Tile Cream w/tan**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rm 111/106 (Not observed), Rm 201**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FT-6**  
MATERIAL DESCRIPTION: **12x12 flr. Tile Cream w/tan**  
MATERIAL LOCATION: **Rm 111/106 (Not observed), Rm 201**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-7**  
MATERIAL DESCRIPTION: **9x9 flr. Tile Black and Dark Maroon checked**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gym office**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **SF**  
COMMENTS: **Damage is located in the Gym Office**

Inspector's Signature: \_\_\_\_\_ Date: **03/23/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FT-7**

MATERIAL DESCRIPTION: **9x9 flr. Tile Black and Dark Maroon checked**

MATERIAL LOCATION: **Gym office**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **15**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Repair as needed then follow O&M procedures.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-1**  
MATERIAL DESCRIPTION: **Mastic 12x12 white w/blue,pink, yellow flecks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rm 101,214,214B**

MATERIAL QUANTITY: **1900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FTM-1**

MATERIAL DESCRIPTION: **Mastic 12x12 white w/blue,pink, yellow flecks**

MATERIAL LOCATION: **Rm 101,214,214B**

MATERIAL QUANTITY: **1900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

## Carnow, Conibear and Associates 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-2**  
MATERIAL DESCRIPTION: **Mastic 12x12 dark brown w/multicolored flecks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rm 103 Main office**  
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FTM-2**

MATERIAL DESCRIPTION: **Mastic 12x12 dark brown w/multicolored flecks**

MATERIAL LOCATION: **Rm 103 Main office**

MATERIAL QUANTITY: **750**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-3**  
MATERIAL DESCRIPTION: **Mastic beneath black 12x12**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st flr Hall patch**  
MATERIAL QUANTITY: **45** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FTM-3**

MATERIAL DESCRIPTION: **Mastic beneath black 12x12**

MATERIAL LOCATION: **1st flr Hall patch**

MATERIAL QUANTITY: **45**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-4**  
MATERIAL DESCRIPTION: **Mastic 9x9 green and cream checked (covered)**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Principals office, storage**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FTM-4**

MATERIAL DESCRIPTION: **Mastic 9x9 green and cream checked (covered)**

MATERIAL LOCATION: **Principals office, storage**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-5**  
MATERIAL DESCRIPTION: **Mastic beneath 9x20 flooring**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st and 2nd hall**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FTM-5**

MATERIAL DESCRIPTION: **Mastic beneath 9x20 flooring**

MATERIAL LOCATION: **1st and 2nd hall**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-6**  
MATERIAL DESCRIPTION: **Mastic 12x12 tan and cream VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rm 106,111,201**

MATERIAL QUANTITY: **1800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FTM-6**  
MATERIAL DESCRIPTION: **Mastic 12x12 tan and cream VFT**  
MATERIAL LOCATION: **Rm 106,111,201**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-7**  
MATERIAL DESCRIPTION: **Mastic beneath 9x9 black and dark maroon VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Gym office**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **FTM-7**

MATERIAL DESCRIPTION: **Mastic beneath 9x9 black and dark maroon VFT**

MATERIAL LOCATION: **Gym office**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Mag Block-Boiler**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Rm**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **03/23/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUILDING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **Mag Block-Boiler**

MATERIAL LOCATION: **Boiler Rm**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M procedure.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **9x9 brown and tan floor tile**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **1st, 2nd flr corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **03/23/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **9x9 brown and tan floor tile**

MATERIAL LOCATION: **1st, 2nd flr corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M procedure.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **cementious mud on valves**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **(N) base fan room**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **J**

MATERIAL DESCRIPTION: **cementious mud on valves**

MATERIAL LOCATION: **(N) base fan room**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**  
SCHOOL NAME: **Morrill School** INSPECTION DATE: **3/23/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON: **Deterioration**  
HISTORICAL RESPONSE ACTION: **Repair**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Deterioration**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **(W) tunnel unexcavated**  
MATERIAL QUANTITY: **350** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY:  DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 03/23/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **24571** BUIDLING ID: **4880**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**  
SCHOOL NAME: **Morrill School** REVIEW DATE: **4/18/2016**  
ADDRESS: **6011 S. Rockwell** IDPH LICENSE NO: **100-04208**

---

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **(W) tunnel unexcavated**  
MATERIAL QUANTITY: **350** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **10** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

### Repair

Comments:

Patch and repair as needed then follow O&M procedures.

Management Planner's Signature: \_\_\_\_\_ Date: **04/18/2016**

# **Chicago Public Schools**

**Carnow, Conibear and Associates**

***2016 AHERA REINSPECTION***

# APPENDIX B

## Inspector and Management Planner Licenses

---

**James Lehnhardt**  
Illinois Licensed Asbestos Inspector, Project Manager, and  
Air Sampling Professional



**ASBESTOS  
PROFESSIONAL  
LICENSE**

**ID NUMBER**                      **ISSUED**                      **EXPIRES**  
**100 - 04208**                      **3/16/2015**                      **05/15/2016**

**JAMES D LEHNHARDT**  
15301 KILPATRICK AVE, APT.  
OAK FOREST, IL 60452  
Environmental Health



**ENDORSEMENTS**

**TC EXPIRES**

INSPECTOR

12/2/2015

PROJECT MANAGER  
AIR SAMPLING PROFESSIONAL

12/11/2015

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

**CARNOW  
CONIBEAR**

2015



**OCCUPATIONAL TRAINING & SUPPLY, INC.**  
7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**James Lehnhardt**


has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016


Certificate Number: BIR1512024165

  
Kathy DeSalvo, Director



# Evan Christian

Illinois Licensed Project Manager, and Air Sampling Professional

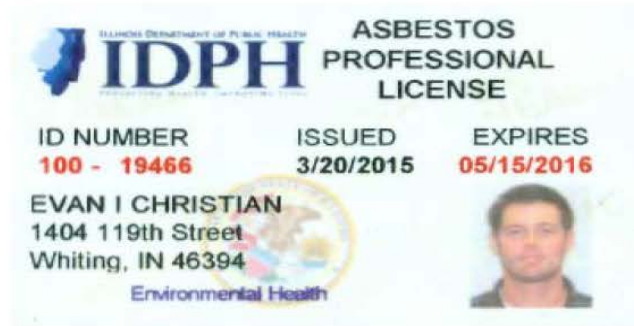

ENDORSEMENTS	TC EXPIRES
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	12/12/2015
<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

**CARNOW  
CONIBEAR**

2015



# OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

## Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Evan Christian**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024159

  
Katy DeSalvo, Director

**Reliable**  
**Environmental**  
**Solutions, Inc.** **RES**

*This is to certify that* **Evan Christian**

*has on January 28 & 29, 2016, in Springfield, Illinois,  
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

**Asbestos Management Planner Initial Training**

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)  
and passed the associated examination with a score of 70% or higher*

Course Date: January 28 & 29, 2016

Examination Date: January 29, 2016

Expiration Date: January 29, 2017

Certificate Number: MP/0103

*William S. Williams*

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ [www.ReliableEnv.com](http://www.ReliableEnv.com)

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed