

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2421  
SCHOOL NAME: Reilly School  
ADDRESS OF SCHOOL: 3650 W School Street  
CITY: Chicago, IL, 60618

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **4/22/2013**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 5/6/2016 ENROLLMENT 990  
IDPH INSPECTOR LICENSE NUMBER: 100-11093  
IDPH LICENSED INSPECTOR NAME (Please Print): David Avila  
IDPH MP LICENSE NUMBER: 100-07342  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



5/6/2016

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

---

---

---

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Reilly School**

3650 W School Street  
Chicago, IL, 60618

Unit: 25101  
Building ID: 5590

IDPH ID Number: 14-016-2990-2421

**REPORT DATE:**

Friday, May 06, 2016

**Prepared for:**

**Chicago Public Schools**  
**125 S. Clark Street**  
**Chicago, IL 60603**

**Prepared by:**

**GSG Consultants, Inc.**

855 W. Adams St., Ste. 200

Phone (312) 733-6262

Fax (312) 733-5612

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**



## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: March 31, 2016

RE: Reilly School, Unit 25101  
3650 W School Street  
Chicago, IL, 60618

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Reilly School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Reilly School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Reilly School  
Address: 3650 W School Street  
IDPH ID: 14-016-2990-2421  
Contact:

Unit: 25101  
Chicago, IL, 60618  
Building ID: 5590  
Phone:

Region: 01

### 2. Description of Facility

Original Construction:  
Total Square Footage:  
Current Occupancy: 990

Additional Construction:  
No of Floors:

### 3. LEA Designated Person

Contact: Robert Christlieb  
Address: 125 South Clark Street, 17th Floor  
Chicago, IL 60603

Phone: (773) 553-3197

### 4. Managing Environmental Consultant


MEC: GSG Consultants, Inc.  
Contact: Arturo Saenz  
Address 855 W. Adams St., Ste. 200  
Phone: (312) 733-6262

Fax: (312) 733-5612

### 5. Inspector

Inspector Name: David Avila


Inspector IDPH license # 100-11093

Signature:   
Date: 3/31/2016

### 6. Management Planner

Management Planner Name: Jigar Shah


Management Planner IDPH license # 100-07342

Signature:   
Date: 05/05/2016

### 7. Review Date: 05/05/2016

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 5/6/2016

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

GSG Consultants, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Reilly School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 5590:

B. The following new homogenous areas have been identified for Building 5590:



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01	Hard Coat Plaster
02	Burlap Canvas
06	12"x12" Off White w/ Brown Streaks VFT
07	Brown Linoleum
10	Green Linoleum
14	Brown Linoleum Mastic
15	12"x12" Melon w/ White Streaks VFT Mastic
17	Green Linoleum Mastic
18	12"x12" Tan w/ Brown Streaks VFT
27	12"x12" White w/ Gray Specks VFT
28	12"x12" White w/ Gray Specks VFT Mastic
29	12"x12" Sky Blue w/ Blue Specks VFT
30	12"x12" Sky Blue w/ Blue Specks VFT Mastic
31	12" x 12" Light Blue VFT
32	12" x 12" Light Blue VFT Mastic
33	12" x 12" Red w/ White Specks VFT
34	12" x 12" Red w/ White Specks VFT Mastic
35	12" x 12" Solid Blue VFT
36	12" x 12" Solid Blue VFT Mastic
37	12" x 12" Light Green VFT
38	12" x 12" Light Green VFT Mastic
39	12" x 12" Solid Green VFT
40	12" x 12" Solid Green VFT Mastic
41	12" X 12" Maroon VFT
42	12" X 12" Maroon VFT Mastic
43	Red Linoleum
44	2' x 2' Ceiling Tile
45	2' x 4' CeilingTile
46	Drywall
47	Drywall Joint Compound
48	Baseboard
49	Baseboard Mastic
50	Carpet Mastic
51	Duct Sealant
52	Spray-on Fireproofing
53	Tectum
54	9 x 9 inch Dark Brown w/White Streaks VFT
54 A	9 x 9 inch Dark Brown w/White Streaks VFT Mastic
55	12"x12" Light Blue w/specks VFT
55 A	12"x12" Light Blue w/specks VFT Mastic
56	Decorative Plaster
57	Fire Doors



### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Reilly School Building 5590 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Reilly School Unit 25101 Building ID 5590

Address 3650 W School Street Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Hard Coat Plaster	60,000	SF	Throughout - 1914	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
02	Burlap Canvas	100	SF	1st, 2nd & 3rd Floor Corridors - 1914	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
04	9"x9" Gray w/ Pink & White Streaks VFT	930	SF	Science Lab, Rooms 300 & 326 - 1914	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05	9"x9" Tan VFT	1,300	SF	Room 203, 312 - 1914	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
06	12"x12" Off White w/ Brown Streaks VFT	1,000	SF	1st Floor Corridor - 1914	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07	Brown Linoleum	900	SF	Room 103 - 1914	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08	12"x12" Melon w/ White Streaks VFT	1,400	SF	Library - 1914	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	Green Linoleum	2,000	SF	Assembly Hall & Stage - 1914	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	9"x9" Gray w/ Pink & White Streaks VFT Mastic	930	SF	Science Lab, Rooms 300 & 326 - 1914	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	9"x9" Tan VFT Mastic	1,300	SF	Room 203, 312 - 1914	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	12"x12" Off White w/ Brown Streaks VFT Mastic	555	SF	old Main Off.(also Str. Rm., Closet & Toilet), Princ. Off. - 1914--	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	Brown Linoleum Mastic	900	SF	Room 103 - 1914	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	12"x12" Melon w/ White Streaks VFT Mastic	1,400	SF	Library - 1914	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	Green Linoleum Mastic	2,000	SF	Assembly Hall and Stage - 1914	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	12"x12" Tan w/ Brown Streaks VFT	2,000	SF	Rooms 102, Corridor by 102, 105, 310 -1914 Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12"x12" Tan w/ Brown Streaks VFT Mastic	2,000	SF	Rooms 102, Corridor by 102, 105, 310 -1914 Bldg	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	12"x12" Beige w/ White Streaks VFT	1,030	SF	Teacher's Lounge (311), 311 Toilet, Room 211, 211 Toilet, 105 - 1914	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12"x12" Beige w/ White Streaks VFT Mastic	1,030	SF	Teacher's Lounge (311), 311 Toilet,	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Reilly School Unit 25101 Building ID 5590

Address 3650 W School Street Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Room 211, 211 Toilet, 105 - 1914										
22	9"x9" Beige w/ White Streaks VFT	1,300	SF	Rooms 203 & 300 - 1914	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	9"x9" Beige w/ White Streaks VFT Mastic	1,300	SF	Rooms 203 & 300 - 1914	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	9"x9" White w/ Brown Specks VFT	10	SF	Room 300 - 1914	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	9"x9" White w/ Brown Specks VFT Mastic	10	SF	Room 300 - 1914	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	12"x12" White w/ Gray Specks VFT	400	SF	Room 212 - 1914	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	12"x12" White w/ Gray Specks VFT Mastic	400	SF	Room 212 - 1914	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	12"x12" Sky Blue w/ Blue Specks VFT	20	SF	Room 212 - 1914	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	12"x12" Sky Blue w/ Blue Specks VFT Mastic	20	SF	Room 212 - 1914	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	12" x 12" Light Blue VFT	1,000	SF	Throughout 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	12" x 12" Light Blue VFT Mastic	1,000	SF	Throughout 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	12" x 12" Red w/ White Specks VFT	300	SF	Throughout 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	12" x 12" Red w/ White Specks VFT Mastic	300	SF	Throughout 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	12" x 12" Solid Blue VFT	300	SF	Throughout 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	12" x 12" Solid Blue VFT Mastic	300	SF	Throughout 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	12" x 12" Light Green VFT	1,000	SF	Room 112/113 Vest., 2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridor - 1995	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12" x 12" Light Green VFT Mastic	1,000	SF	Room 112/113 Vest., 2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridor - 1995	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Reilly School Unit 25101 Building ID 5590

Address 3650 W School Street Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
39	12" x 12" Solid Green VFT	300	SF	2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridors - 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	12" x 12" Solid Green VFT Mastic	300	SF	2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridors - 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	12" X 12" Maroon VFT	300	SF	2nd Floor Foyer & Corridor, 1st Floor Main and East Corridors - 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12" X 12" Maroon VFT Mastic	300	SF	2nd Floor Foyer & Corridor, 1st Floor Main and East Corridors - 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	Red Linoleum	100	SF	East and West Stairwells - 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	2' x 2' Ceiling Tile	600	SF	Bsmt Eng Office & Toilet, 1st Fl Teachers Lounge Cor, 1st Fl Office Cor, Kitch Lock Rm & Bath - 1995	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
45	2' x 4' CeilingTile	5,000	SF	Throughout 1995 Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
46	Drywall	10,000	SF	Throughout 1995 Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
47	Drywall Joint Compound	1,000	SF	Throughout 1995 Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
48	Baseboard	800	LF	Throughout 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	Baseboard Mastic	800	SF	Throughout 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
50	Carpet Mastic	1,000	SF	1st Fl Teach Lounge, Main	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Reilly School Unit 25101 Building ID 5590

Address 3650 W School Street Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Office & Cor, Asst Princ & Princ Offices, Couns Off, Conf Rm - 1995 Annex										
51	Duct Sealant	100	LF	Mechanical Room 1995 Annex	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
52	Spray-on Fireproofing	400	SF	Throughout 1995 Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
53	Tectum	100	SF	Breezway, 2nd Floor Foyer - 1995 Annex	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
54	9 x 9 inch Dark Brown w/White Streaks VFT	700	SF	Room 108-1914 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54 A	9 x 9 inch Dark Brown w/White Streaks VFT Mastic	700	SF	Room 108-1914 Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	12"x12" Light Blue w/specks VFT	400	SF	Room 311 & toilet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55 A	12"x12" Light Blue w/specks VFT Mastic	400	SF	Room 311 & toilet	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	Decorative Plaster	3,000	SF	Auditorium	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
57	Fire Doors	17	EA	Assembly hall, Stage, Balcony and Projector Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A	Boiler Insulation Mag Block - NOT OBSERVED	0	SF	Boiler Room - 1914-- NOT OBSERVED	CHR	TSI		NONE	0			ACBM with the potential for damage		LOW
B	Tank Insulation Mag Block	10	SF	Boiler Room - 1914	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
C	Cardboard Pipe Insulation	300	LF	Pump, Boiler & Engine Rooms, 1st Floor East & West Corridors, & Room 105 Toilet - 1914	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
D	MJP E/F/V on Cardboard Pipe Insulation	19	LF	Pump, Boiler & Engine Rooms, 1st Floor East & West Corridors, & Room 105 Toilet - 1914	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
E	Mag Block Pipe Insulation	12	LF	Valve Room Facing Catwalk - 1914	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
G	MJP E/F/V on Fiberglass Pipes	112	LF	1st & 2nd Floor Girl's Toilets, 1st Floor Vestibule, 2nd	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW



# Chicago Public Schools

School Reilly School Unit 25101 Building ID 5590

Address 3650 W School Street Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

---

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Floor Boy's Toilet, & Women's Toilet - 1914										
H	Boiler Gasket(s) on New Boiler	20	LF	Boiler Room	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Reilly School Unit 25101 Building ID 5590

Address 3650 W School Street Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>3/31/2016</b>
Inspector Name <b>David Avila</b>
<b>100-11093</b> <b>5/15/2017</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
04	
05	
06	
07	
08	
10	
11	
12	
13	Only Observed in Office Vault
14	
15	
17	
18	
19	
20	Not observe in Teachers Lounge (311)
21	Not observe in Teachers Lounge (311)
22	
24	
25	
26	
27	
28	

# Chicago Public Schools

School Reilly School Unit 25101 Building ID 5590

Address 3650 W School Street Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
54 A	
55	
55 A	

# Chicago Public Schools

School Reilly School Unit 25101 Building ID 5590

Address 3650 W School Street Region 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
56	
57	
A	
B	
C	
D	
E	
G	
H	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Reilly School  
**Address** 3650 W School Street

**Unit** 25101  
Chicago, IL, 60618

**Building ID** 5590  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Hard Coat Plaster	60,000	SF	Throughout - 1914	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02	Burlap Canvas	100	SF	1st, 2nd & 3rd Floor Corridors - 1914	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	9"x9" Gray w/ Pink & White Streaks VFT	930	SF	Science Lab, Rooms 300 & 326 - 1914	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	9"x9" Tan VFT	1,300	SF	Room 203, 312 - 1914	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	12"x12" Off White w/ Brown Streaks VFT	1,000	SF	1st Floor Corridor - 1914	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	Brown Linoleum	900	SF	Room 103 - 1914	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	12"x12" Melon w/ White Streaks VFT	1,400	SF	Library - 1914	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	Green Linoleum	2,000	SF	Assembly Hall & Stage - 1914	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	9"x9" Gray w/ Pink & White Streaks VFT Mastic	930	SF	Science Lab, Rooms 300 & 326 - 1914	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	9"x9" Tan VFT Mastic	1,300	SF	Room 203, 312 - 1914	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	12"x12" Off White w/ Brown Streaks VFT Mastic	555	SF	old Main Off.(also Str. Rm., Closet & Toilet), Princ. Off. - 1914--	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	Brown Linoleum Mastic	900	SF	Room 103 - 1914	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12"x12" Melon w/ White Streaks VFT Mastic	1,400	SF	Library - 1914	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	Green Linoleum Mastic	2,000	SF	Assembly Hall and Stage - 1914	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12"x12" Tan w/ Brown Streaks VFT	2,000	SF	Rooms 102, Corridor by 102, 105, 310 -1914 Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12"x12" Tan w/ Brown Streaks VFT Mastic	2,000	SF	Rooms 102, Corridor by 102, 105, 310 -1914 Bldg	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12"x12" Beige w/ White Streaks VFT	1,030	SF	Teacher's Lounge (311), 311 Toilet, Room 211, 211 Toilet, 105 - 1914	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	12"x12" Beige w/ White Streaks VFT Mastic	1,030	SF	Teacher's Lounge (311), 311 Toilet, Room 211, 211 Toilet, 105 - 1914	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	9"x9" Beige w/ White Streaks VFT	1,300	SF	Rooms 203 & 300 - 1914	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	9"x9" Beige w/ White Streaks VFT Mastic	1,300	SF	Rooms 203 & 300 - 1914	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	9"x9" White w/ Brown Specks VFT	10	SF	Room 300 - 1914	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	9"x9" White w/ Brown Specks VFT Mastic	10	SF	Room 300 - 1914	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	12"x12" White w/ Gray Specks VFT	400	SF	Room 212 - 1914	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	12"x12" White w/ Gray Specks VFT Mastic	400	SF	Room 212 - 1914	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	12"x12" Sky Blue w/ Blue Specks VFT	20	SF	Room 212 - 1914	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	12"x12" Sky Blue w/ Blue Specks VFT Mastic	20	SF	Room 212 - 1914	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12" x 12" Light Blue VFT	1,000	SF	Throughout 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12" x 12" Light Blue VFT Mastic	1,000	SF	Throughout 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Reilly School  
**Address** 3650 W School Street

**Unit** 25101  
Chicago, IL, 60618

**Building ID** 5590  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
33	12" x 12" Red w/ White Specks VFT	300	SF	Throughout 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12" x 12" Red w/ White Specks VFT Mastic	300	SF	Throughout 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12" x 12" Solid Blue VFT	300	SF	Throughout 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12" x 12" Solid Blue VFT Mastic	300	SF	Throughout 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	12" x 12" Light Green VFT	1,000	SF	Room 112/113 Vest., 2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridor - 1995	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12" x 12" Light Green VFT Mastic	1,000	SF	Room 112/113 Vest., 2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridor - 1995	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12" x 12" Solid Green VFT	300	SF	2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridors - 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	12" x 12" Solid Green VFT Mastic	300	SF	2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridors - 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	12" X 12" Maroon VFT	300	SF	2nd Floor Foyer & Corridor, 1st Floor Main and East Corridors - 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12" X 12" Maroon VFT Mastic	300	SF	2nd Floor Foyer & Corridor, 1st Floor Main and East Corridors - 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	Red Linoleum	100	SF	East and West Stairwells - 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44	2' x 2' Ceiling Tile	600	SF	Bsmt Eng Office & Toilet, 1st Fl Teachers Lounge Cor, 1st Fl Office Cor, Kitch Lock Rm & Bath - 1995	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45	2' x 4' CeilingTile	5,000	SF	Throughout 1995 Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	Drywall	10,000	SF	Throughout 1995 Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	Drywall Joint Compound	1,000	SF	Throughout 1995 Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	Baseboard	800	LF	Throughout 1995 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
49	Baseboard Mastic	800	SF	Throughout 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	Carpet Mastic	1,000	SF	1st Fl Teach Lounge, Main Office & Cor, Asst Princ & Princ Offices, Couns Off, Conf Rm - 1995 Annex	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	Duct Sealant	100	LF	Mechanical Room 1995 Annex	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
52	Spray-on Fireproofing	400	SF	Throughout 1995 Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	Tectum	100	SF	Breezway, 2nd Floor Foyer - 1995 Annex	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Reilly School  
**Address** 3650 W School Street

**Unit** 25101  
Chicago, IL, 60618

**Building ID** 5590  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
54	9 x 9 inch Dark Brown w/White Streaks VFT	700	SF	Room 108-1914 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54 A	9 x 9 inch Dark Brown w/White Streaks VFT Mastic	700	SF	Room 108-1914 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	12"x12" Light Blue w/specks VFT	400	SF	Room 311 & toilet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55 A	12"x12" Light Blue w/specks VFT Mastic	400	SF	Room 311 & toilet	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	Decorative Plaster	3,000	SF	Auditorium	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	Fire Doors	17	EA	Assembly hall, Stage, Balcony and Projector Room	Assumed	MISC	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
A	Boiler Insulation Mag Block - NOT OBSERVED	0	SF	Boiler Room - 1914-- NOT OBSERVED	Chrysotile	TSI		0	SF	6 ACBM with the potential for damage	
B	Tank Insulation Mag Block	10	SF	Boiler Room - 1914	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C	Cardboard Pipe Insulation	300	LF	Pump, Boiler & Engine Rooms, 1st Floor East & West Corridors, & Room 105 Toilet - 1914	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
D	MJP E/F/V on Cardboard Pipe Insulation	19	LF	Pump, Boiler & Engine Rooms, 1st Floor East & West Corridors, & Room 105 Toilet - 1914	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
E	Mag Block Pipe Insulation	12	LF	Valve Room Facing Catwalk - 1914	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
G	MJP E/F/V on Fiberglass Pipes	112	LF	1st & 2nd Floor Girl's Toilets, 1st Floor Vestibule, 2nd Floor Boy's Toilet, & Women's Toilet - 1914	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
H	Boiler Gasket(s) on New Boiler	20	LF	Boiler Room	Assumed	MISC	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan



# Chicago Public Schools

**School** Reilly School  
**Address** 3650 W School Street

**Unit** 25101  
 Chicago, IL, 60618

**Building ID** 5590  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.  
 855 W. Adams St., Ste. 200  
 Phone: (312) 733-6262

Fax: (312) 733-5612

*Management Planner's Comments Summarized at the End of the Report*

Review Date	5/5/2016
Manager Planner Name	Jigar Shah
100-07342	1/19/2017
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
04	
05	
06	
07	
08	
10	
11	
12	
13	
14	
15	
17	
18	
19	
20	
21	

# Chicago Public Schools

**School** Reilly School  
**Address** 3650 W School Street

**Unit** 25101  
 Chicago, IL, 60618

**Building ID** 5590  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262                      Fax: (312) 733-5612

*Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
22	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	

# Chicago Public Schools

**School** Reilly School  
**Address** 3650 W School Street

**Unit** 25101  
Chicago, IL, 60618

**Building ID** 5590  
**Region** 01

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
50	
51	
52	
53	
54	
54 A	
55	
55 A	
56	
57	
A	
B	
C	
D	
E	
G	
H	

# Chicago Public Schools

GSG Consultants, Inc.

## 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**  
MATERIAL DESCRIPTION: **Hard Coat Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Throughout - 1914**

MATERIAL QUANTITY: **60000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **01**  
MATERIAL DESCRIPTION: **Hard Coat Plaster**  
MATERIAL LOCATION: **Throughout - 1914**  
MATERIAL QUANTITY: **60000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**  
MATERIAL DESCRIPTION: **Burlap Canvas**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Corridors - 1914**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **02**  
MATERIAL DESCRIPTION: **Burlap Canvas**  
MATERIAL LOCATION: **1st, 2nd & 3rd Floor Corridors - 1914**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**  
MATERIAL DESCRIPTION: **9"x9" Gray w/ Pink & White Streaks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Science Lab, Rooms 300 & 326 - 1914**  
MATERIAL QUANTITY: **930** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **04**  
MATERIAL DESCRIPTION: **9"x9" Gray w/ Pink & White Streaks VFT**  
MATERIAL LOCATION: **Science Lab, Rooms 300 & 326 - 1914**  
MATERIAL QUANTITY: **930** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**  
MATERIAL DESCRIPTION: **9"x9" Tan VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 203, 312 - 1914**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **05**  
MATERIAL DESCRIPTION: **9"x9" Tan VFT**  
MATERIAL LOCATION: **Room 203, 312 - 1914**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **12"x12" Off White w/ Brown Streaks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st Floor Corridor - 1914**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **12"x12" Off White w/ Brown Streaks VFT**  
MATERIAL LOCATION: **1st Floor Corridor - 1914**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/05/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**  
MATERIAL DESCRIPTION: **Brown Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 103 - 1914**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **07**  
MATERIAL DESCRIPTION: **Brown Linoleum**  
MATERIAL LOCATION: **Room 103 - 1914**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **12"x12" Melon w/ White Streaks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Library - 1914**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **12"x12" Melon w/ White Streaks VFT**  
MATERIAL LOCATION: **Library - 1914**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Green Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Assembly Hall & Stage - 1914**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Green Linoleum**  
MATERIAL LOCATION: **Assembly Hall & Stage - 1914**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **9"x9" Gray w/ Pink & White Streaks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Science Lab, Rooms 300 & 326 - 1914**  
MATERIAL QUANTITY: **930** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **9"x9" Gray w/ Pink & White Streaks VFT Mastic**  
MATERIAL LOCATION: **Science Lab, Rooms 300 & 326 - 1914**  
MATERIAL QUANTITY: **930** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **9"x9" Tan VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 203, 312 - 1914**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **9"x9" Tan VFT Mastic**  
MATERIAL LOCATION: **Room 203, 312 - 1914**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools    UNIT NUMBER: 25101    BUILDING ID: 5590  
CITY/STATE: Chicago, Illinois    AHERA INSPECTOR: David Avila  
SCHOOL NAME: Reilly School    INSPECTION DATE: 3/31/2016  
ADDRESS: 3650 W School Street    IDPH LICENSE NO: 100-11093

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 13  
MATERIAL DESCRIPTION: 12"x12" Off White w/ Brown Streaks VFT Mastic  
HISTORICAL AHERA DAMAGE CATEGORY: 6 ACBM with the potential for damage  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: Follow O&M Plan  
ASBESTOS TYPE: Chrysotile    FRIABLE: No

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **old Main Off.(also Str. Rm., Closet & Toilet), Princ. Off. - 1914--**

MATERIAL QUANTITY: **555**    MATERIAL UNITS: **SF**

DAMAGE QUANTITY:    DAMAGE UNITS: **SF**

COMMENTS: **Only Observed in Office Vault**

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **12"x12" Off White w/ Brown Streaks VFT Mastic**  
MATERIAL LOCATION: **old Main Off.(also Str. Rm., Closet & Toilet), Princ. Off. - 1914--**  
MATERIAL QUANTITY: **555** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **Brown Linoleum Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 103 - 1914**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **Brown Linoleum Mastic**  
MATERIAL LOCATION: **Room 103 - 1914**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **12"x12" Melon w/ White Streaks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Library - 1914**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **12"x12" Melon w/ White Streaks VFT Mastic**  
MATERIAL LOCATION: **Library - 1914**  
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Green Linoleum Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Assembly Hall and Stage - 1914**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Green Linoleum Mastic**  
MATERIAL LOCATION: **Assembly Hall and Stage - 1914**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 102, Corridor by 102, 105, 310  
-1914 Bldg**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**



# Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT**  
MATERIAL LOCATION: **Rooms 102, Corridor by 102, 105, 310  
-1914 Bldg**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 102, Corridor by 102, 105, 310  
-1914 Bldg**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **12"x12" Tan w/ Brown Streaks VFT Mastic**  
MATERIAL LOCATION: **Rooms 102, Corridor by 102, 105, 310  
-1914 Bldg**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

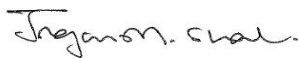

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **12"x12" Beige w/ White Streaks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Teacher's Lounge (311), 311 Toilet, Room 211, 211 Toilet, 105 - 1914**  
MATERIAL QUANTITY: **1030** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS: **Not observe in Teachers Lounge (311)**

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **12"x12" Beige w/ White Streaks VFT**  
MATERIAL LOCATION: **Teacher's Lounge (311), 311 Toilet, Room 211, 211 Toilet, 105 - 1914**  
MATERIAL QUANTITY: **1030** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **12"x12" Beige w/ White Streaks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Teacher's Lounge (311), 311 Toilet, Room 211, 211 Toilet, 105 - 1914**  
MATERIAL QUANTITY: **1030** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS: **Not observe in Teachers Lounge (311)**

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **12"x12" Beige w/ White Streaks VFT Mastic**  
MATERIAL LOCATION: **Teacher's Lounge (311), 311 Toilet, Room 211, 211 Toilet, 105 - 1914**  
MATERIAL QUANTITY: **1030** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **9"x9" Beige w/ White Streaks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 203 & 300 - 1914**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **9"x9" Beige w/ White Streaks VFT**  
MATERIAL LOCATION: **Rooms 203 & 300 - 1914**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **9"x9" Beige w/ White Streaks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 203 & 300 - 1914**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **9"x9" Beige w/ White Streaks VFT Mastic**  
MATERIAL LOCATION: **Rooms 203 & 300 - 1914**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **9"x9" White w/ Brown Specks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 300 - 1914**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **9"x9" White w/ Brown Specks VFT**  
MATERIAL LOCATION: **Room 300 - 1914**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **9"x9" White w/ Brown Specks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 300 - 1914**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **9"x9" White w/ Brown Specks VFT Mastic**  
MATERIAL LOCATION: **Room 300 - 1914**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **12'x12" White w/ Gray Specks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 212 - 1914**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **12'x12" White w/ Gray Specks VFT**  
MATERIAL LOCATION: **Room 212 - 1914**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **12'x12" White w/ Gray Specks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 212 - 1914**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **12'x12" White w/ Gray Specks VFT Mastic**  
MATERIAL LOCATION: **Room 212 - 1914**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **12"x12" Sky Blue w/ Blue Specks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 212 - 1914**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **12"x12" Sky Blue w/ Blue Specks VFT**  
MATERIAL LOCATION: **Room 212 - 1914**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **12"x12" Sky Blue w/ Blue Specks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 212 - 1914**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **12"x12" Sky Blue w/ Blue Specks VFT Mastic**  
MATERIAL LOCATION: **Room 212 - 1914**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue VFT**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12" x 12" Light Blue VFT Mastic**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12" x 12" Red w/ White Specks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12" x 12" Red w/ White Specks VFT**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12" x 12" Red w/ White Specks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12" x 12" Red w/ White Specks VFT Mastic**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **12" x 12" Solid Blue VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **12" x 12" Solid Blue VFT**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12" x 12" Solid Blue VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12" x 12" Solid Blue VFT Mastic**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **12" x 12" Light Green VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 112/113 Vest., 2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridor - 1995**

MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **12" x 12" Light Green VFT**  
MATERIAL LOCATION: **Room 112/113 Vest., 2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridor - 1995**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **12" x 12" Light Green VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 112/113 Vest., 2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridor - 1995**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **12" x 12" Light Green VFT Mastic**  
MATERIAL LOCATION: **Room 112/113 Vest., 2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridor - 1995**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **12" x 12" Solid Green VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd FI Foyer & Corridor, Lunchroom, Breezway, 1st FI Main & East Corridors - 1995 Annex**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **12" x 12" Solid Green VFT**  
MATERIAL LOCATION: **2nd Fl Foyer & Corridor, Lunchroom, Breezway, 1st Fl Main & East Corridors - 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**  
MATERIAL DESCRIPTION: **12" x 12" Solid Green VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **2nd FI Foyer & Corridor, Lunchroom, Breezway, 1st FI Main & East Corridors - 1995 Annex**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **40**  
MATERIAL DESCRIPTION: **12" x 12" Solid Green VFT Mastic**  
MATERIAL LOCATION: **2nd FI Foyer & Corridor, Lunchroom, Breezway, 1st FI Main & East Corridors - 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **12" X 12" Maroon VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd Floor Foyer & Corridor, 1st Floor Main and East Corridors - 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **12" X 12" Maroon VFT**  
MATERIAL LOCATION: **2nd Floor Foyer & Corridor, 1st Floor Main and East Corridors - 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **12" X 12" Maroon VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd Floor Foyer & Corridor, 1st Floor Main and East Corridors - 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **12" X 12" Maroon VFT Mastic**  
MATERIAL LOCATION: **2nd Floor Foyer & Corridor, 1st Floor Main and East Corridors - 1995 Annex**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **Red Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **East and West Stairwells - 1995 Annex**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **Red Linoleum**  
MATERIAL LOCATION: **East and West Stairwells - 1995 Annex**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**  
MATERIAL DESCRIPTION: **2' x 2' Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Bsmt Eng Office & Toilet, 1st FI Teachers Lounge Cor, 1st FI Office Cor, Kitch Lock Rm & Bath - 1995**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **44**  
MATERIAL DESCRIPTION: **2' x 2' Ceiling Tile**  
MATERIAL LOCATION: **Bsmt Eng Office & Toilet, 1st FI Teachers Lounge Cor, 1st FI Office Cor, Kitch Lock Rm & Bath - 1995**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **2' x 4' CeilingTile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **2' x 4' CeilingTile**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **Drywall**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **Drywall**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **Drywall Joint Compound**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **Drywall Joint Compound**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **Baseboard**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**  
MATERIAL DESCRIPTION: **Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **49**  
MATERIAL DESCRIPTION: **Baseboard Mastic**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st Fl Teach Lounge, Main Office & Cor, Asst Princ & Princ Offices, Couns Off, Conf Rm - 1995 Annex**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **Carpet Mastic**  
MATERIAL LOCATION: **1st Fl Teach Lounge, Main Office & Cor, Asst Princ & Princ Offices, Couns Off, Conf Rm - 1995 Annex**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

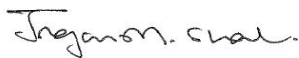

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **Duct Sealant**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Mechanical Room 1995 Annex**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **Duct Sealant**  
MATERIAL LOCATION: **Mechanical Room 1995 Annex**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar M. Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Spray-on Fireproofing**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Spray-on Fireproofing**  
MATERIAL LOCATION: **Throughout 1995 Annex**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**  
MATERIAL DESCRIPTION: **Tectum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Breezway, 2nd Floor Foyer - 1995 Annex**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **53**  
MATERIAL DESCRIPTION: **Tectum**  
MATERIAL LOCATION: **Breezway, 2nd Floor Foyer - 1995 Annex**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **9 x 9 inch Dark Brown w/White Streaks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 108-1914 Building**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **9 x 9 inch Dark Brown w/White Streaks VFT**  
MATERIAL LOCATION: **Room 108-1914 Building**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54 A**  
MATERIAL DESCRIPTION: **9 x 9 inch Dark Brown w/White Streaks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 108-1914 Building**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **54 A**  
MATERIAL DESCRIPTION: **9 x 9 inch Dark Brown w/White Streaks VFT Mastic**  
MATERIAL LOCATION: **Room 108-1914 Building**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **12"x12" Light Blue w/specks VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 311 & toilet**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **12"x12" Light Blue w/specks VFT**  
MATERIAL LOCATION: **Room 311 & toilet**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55 A**  
MATERIAL DESCRIPTION: **12"x12" Light Blue w/specks VFT Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 311 & toilet**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **55 A**  
MATERIAL DESCRIPTION: **12"x12" Light Blue w/specks VFT Mastic**  
MATERIAL LOCATION: **Room 311 & toilet**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **Decorative Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **Decorative Plaster**  
MATERIAL LOCATION: **Auditorium**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **Fire Doors**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Assembly hall, Stage, Balcony and Projector Room**

MATERIAL QUANTITY: **17** MATERIAL UNITS: **EA**

DAMAGE QUANTITY: DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **Fire Doors**  
MATERIAL LOCATION: **Assembly hall, Stage, Balcony and Projector Room**  
MATERIAL QUANTITY: **17** MATERIAL UNITS: **EA**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**  
MATERIAL DESCRIPTION: **Boiler Insulation Mag Block - NOT OBSERVED**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Boiler Room - 1914-- NOT OBSERVED**

MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **A**  
MATERIAL DESCRIPTION: **Boiler Insulation Mag Block - NOT OBSERVED**  
MATERIAL LOCATION: **Boiler Room - 1914-- NOT OBSERVED**  
MATERIAL QUANTITY: **0** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 05/05/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**  
MATERIAL DESCRIPTION: **Tank Insulation Mag Block**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room - 1914**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **B**  
MATERIAL DESCRIPTION: **Tank Insulation Mag Block**  
MATERIAL LOCATION: **Boiler Room - 1914**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Pump, Boiler & Engine Rooms, 1st Floor East & West Corridors, & Room 105 Toilet - 1914**

MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Pump, Boiler & Engine Rooms, 1st Floor East & West Corridors, & Room 105 Toilet - 1914**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Pump, Boiler & Engine Rooms, 1st Floor East & West Corridors, & Room 105 Toilet - 1914**

MATERIAL QUANTITY: **19** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **MJP E/F/V on Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Pump, Boiler & Engine Rooms, 1st Floor East & West Corridors, & Room 105 Toilet - 1914**  
MATERIAL QUANTITY: **19** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Valve Room Facing Catwalk - 1914**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUILDING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**  
MATERIAL LOCATION: **Valve Room Facing Catwalk - 1914**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipes**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st & 2nd Floor Girl's Toilets, 1st Floor Vestibule, 2nd Floor Boy's Toilet, & Women's Toilet - 1914**

MATERIAL QUANTITY: **112** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **03/31/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **MJP E/F/V on Fiberglass Pipes**  
MATERIAL LOCATION: **1st & 2nd Floor Girl's Toilets, 1st Floor Vestibule, 2nd Floor Boy's Toilet, & Women's Toilet - 1914**  
MATERIAL QUANTITY: **112** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **David Avila**  
SCHOOL NAME: **Reilly School** INSPECTION DATE: **3/31/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Boiler Gasket(s) on New Boiler**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/31/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25101** BUIDLING ID: **5590**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Reilly School** REVIEW DATE: **5/5/2016**  
ADDRESS: **3650 W School Street** IDPH LICENSE NO: **100-11093**

---

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Boiler Gasket(s) on New Boiler**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature:  Date: **05/05/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
*2016 AHERA REINSPECTION*



# APPENDIX B

## Inspector and Management Planner Licenses

---

# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that DAVID AVILA  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 02/13/2016 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

02/13/2016

Course Dates:

02/13/2017

Expires:

1602BTR08

Certificate Number:




Director of Training  
Nicholas J. Peneff  
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

2016

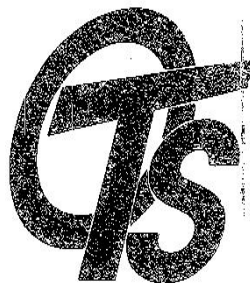

**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016

Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270320

  
Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • [www.dph.illinois.gov](http://www.dph.illinois.gov)

4/20/2016

**JIGAR M SHAH**  
 855 W ADAMS ST, SUITE 200  
 CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

**COPY OF THE ASBESTOS PROFESSIONAL LICENSE**

Front of License

Back of License

		<b>ASBESTOS          PROFESSIONAL          LICENSE</b>		<b>ENDORSEMENTS</b>	<b>TC EXPIRES</b>
<b>ID NUMBER</b> 109 - 07342	<b>ISSUED</b> 4/20/2016	<b>EXPIRES</b> 05/15/2017		INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/19/2017 2/2/2017 1/27/2017 2/26/2017
<b>JIGAR M SHAH</b> 855 W ADAMS ST, SUITE 200 CHICAGO, IL 60607 Environmental Health				<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
 EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**  
*Nationally Accredited by PHAB*

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed