

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2442
SCHOOL NAME: Schmid School
ADDRESS OF SCHOOL: 9755 S Greenwood
CITY: Chicago, IL, 60628

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 2/4/2013

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 5/6/2016 ENROLLMENT 205
IDPH INSPECTOR LICENSE NUMBER: 100-02950
IDPH LICENSED INSPECTOR NAME (Please Print): Keith Clough
IDPH MP LICENSE NUMBER: 100-07342
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



5/6/2016

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Schmid School

9755 S Greenwood
Chicago, IL, 60628

Unit: 25391
Building ID: 5950

IDPH ID Number: 14-016-2990-2442

REPORT DATE:

Friday, May 06, 2016

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone (312) 733-6262

Fax (312) 733-5612

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

February 22, 2016

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

GSG Consultants, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1,2,6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 25391 Region: 06 IDPH ID: 14-016-2990-2442

School: Schmid School Building ID: 5950

Address: 9755 S Greenwood
Chicago, IL, 60628

Building Contact: Rice, Michael Contact Phone: 773-535-6235

Current Building Owners: Chicago Public Schools

Review Date: 05/04/2016

Inspector: Keith Clough Inspector IDPH License: 100-02950
Management Planner: Jigar Shah Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 733-6262

Sincerely,
GSG Consultants, Inc.



Jigar Shah
100-07342

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: February 22, 2016

RE: Schmid School, Unit 25391
9755 S Greenwood
Chicago, IL, 60628

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Schmid School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Schmid School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Schmid School Unit: 25391 Region: 06
Address: 9755 S Greenwood Chicago, IL, 60628
IDPH ID: 14-016-2990-2442 Building ID: 5950
Contact: Rice, Michael Phone: 773-535-6235

2. Description of Facility

Original Construction: 1971 Additional Construction: 1946
Total Square Footage: No of Floors:
Current Occupancy: 205

3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603

4. Managing Environmental Consultant

MEC: GSG Consultants, Inc.
Contact: Arturo Saenz
Address 855 W. Adams St., Ste. 200
Phone: (312) 733-6262 Fax: (312) 733-5612

5. Inspector

Inspector Name: Keith Clough


Inspector IDPH license # 100-02950

Signature:
Date: 2/22/2016

6. Management Planner

Management Planner Name: Jigar Shah

Management Planner IDPH license # 100-07342


Signature:
Date: 05/04/2016

7. Review Date: 05/04/2016

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 5/6/2016

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

GSG Consultants, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Schmid School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 5950:

B. The following new homogenous areas have been identified for Building 5950:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

03	12x12 rust w/white specks floor tile
03A	12x12 brown w/white specks floor tile
03B	12x12 cream floor tile
05	12x12 rust w/white specks floor tile mastic
07	drywall
08	dark brown vinyl base board
08A	beige vinyl baseboard
09	dark brown vinyl baseboard mastic
09A	beige vinyl baseboard mastic
10	2x4 ceiling tile
11	purple carpet mastic
12	Carpet mastic NOT OBSERVED
13	orange/brown carpet mastic NOT FOUND
14	Red carpet mastic - NOT OBSERVED
15	9"X 9" Dark Brown Floor Tile
16	9"X 9" Dark Floor Tile MASTIC
17	12"X 12" Beige w/gray specks Floor Tile
18	12"X 12" Beige w/gray specks Floor Tile MASTIC
19	Beige Flooring Mastic
20	Gray Flooring Mastic
21	Yellow, Brown and Beige Ceramic Tile Grout
22	Yellow, Brown and Beige Ceramic Tile Adhesive
23	Grey and Black Speckled Terrazzo
24	12 x 12 Blue Floor Tile
24M	12 x 12 Blue Floor Tile Mastic
25	Beige and Tan Ceramic Tile Grout
26	Beige and Tan Ceramic Tile Grout
27	Gray Baseboard
27A	Gray Baseboard Adhesive
28	Red Ceramic Tile Grout
29	Red Ceramic Tile Adhesive
30	12 x 12 White with Blue and Red Speckles Floor Tile
30M	12 x 12 White with Blue and Red Speckles Floor Tile Mastic
31	Beige Flooring
32	Gray Flooring
33	12" X 12" white with blue specks VFT
34	12" X 12' white with blue specks, Mastic
35	12" x 12" cream with tan specks VFT
36	12" X 12" cream with tan specks, Mastic
37	Fire Doors

The following areas were deemed to be inaccessible:

05	12x12 rust w/white specks floor tile mastic
05A	12x12 brown w/white specks floor tile mastic
05B	12x12 cream floor tile mastic
06	9x9 light brown w/specks floor tile mastic
09	dark brown vinyl baseboard mastic
09A	beige vinyl baseboard mastic
11	purple carpet mastic
12	Carpet mastic NOT OBSERVED
13	orange/brown carpet mastic NOT FOUND
15	9"X 9" Dark Brown Floor Tile
16	9"X 9" Dark Floor Tile MASTIC
17	12"X 12" Beige w/gray specks Floor Tile
18	12"X 12" Beige w/gray specks Floor Tile MASTIC
19	Beige Flooring Mastic
20	Gray Flooring Mastic
22	Yellow, Brown and Beige Ceramic Tile Adhesive
24M	12 x 12 Blue Floor Tile Mastic
26	Beige and Tan Ceramic Tile Grout
27A	Gray Baseboard Adhesive
29	Red Ceramic Tile Adhesive
30M	12 x 12 White with Blue and Red Speckles Floor Tile Mastic
32	Gray Flooring
37	Fire Doors

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Keith Clough, IDPH License # 100-02950. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Schmid School Building 5950 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Schmid School Unit 25391 Building ID 5950

Address 9755 S Greenwood Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
03	12x12 rust w/white specks floor tile	2,804	SF	1st floor corridor (ANNEX BLDG)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
03A	12x12 brown w/white specks floor tile	5,198	SF	All classrooms (except 406,404) and 1/2 main office. (ANNEX BLDG)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
03B	12x12 cream floor tile	5,198	SF	all classrooms (except 406),and 1/2 main office, main building eng office, washroom (ANNEX BLDG)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
04	9x9 light brown w/specks floor tile	4,000	SF	gym/lunchroom, kitchen,eng office,store room (ANNEX BLDG)	CHR	MISC	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
05	12x12 rust w/white specks floor tile mastic	2,804	SF	1st floor corridors (ANNEX BLDG)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05A	12x12 brown w/white specks floor tile mastic	5,198	SF	All classrooms (except 406,404) and 1/2 main office (ANNEX BLDG)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05B	12x12 cream floor tile mastic	5,198	SF	All classrooms (except 406,404) and 1/2 main office (ANNEX BLDG)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
06	9x9 light brown w/specks floor tile mastic	4,000	SF	gym/lunchroom, kitchen,eng office,store room (ANNEX BLDG)	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07	drywall	36,000	SF	throughout building - covered with metal (ANNEX BLDG)	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
08	dark brown vinyl base board	145	LF	engineers office/washroom, store room, main office washroom (ANNEX BLDG)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08A	beige vinyl baseboard	86	LF	principals office, store room in main office (ANNEX BLDG)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09	dark brown vinyl baseboard mastic	145	LF	engineers office/washroom, store room, main	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Schmid School Unit 25391 Building ID 5950

Address 9755 S Greenwood Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				office washroom (ANNEX BLDG)										
09A	beige vinyl baseboard mastic	86	LF	principal's office, store rooms in main office (ANNEX BLDG)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	2x4 ceiling tile	18,000	SF	throughout buildings Engineer office/washroom (ANNEX BLDG)	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
11	purple carpet mastic	2,222	SF	room 411, library, detention room 404, Room 403 (ANNEX BLDG)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	Carpet mastic NOT OBSERVED	395	SF	main office, principals office, main office store rooms (ANNEX BLDG)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	orange/brown carpet mastic NOT FOUND	340	SF	room 403 - (ANNEX BLDG)	ASSUMED	MISC	N				No			
14	Red carpet mastic - NOT OBSERVED	350	SF	Main office (ANNEX BLDG)	ASSUMED	MISC	N				No			
15	9"X 9" Dark Brown Floor Tile	100	SF	Engineer's Office Storage Room (Main Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	9"X 9" Dark Floor Tile MASTIC	100	SF	Engineer's Office Storage Room (Main Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	12"X 12" Beige w/gray specks Floor Tile	300	SF	Engineer's Office & Toilet, 1st Floor Wardrobe Room (Main Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
18	12"X 12" Beige w/gray specks Floor Tile MASTIC	300	SF	Engineer's Office & Toilet, 1st Floor Wardrobe Room (Main Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	Beige Flooring Mastic	1,100	SF	1st Floor Corridor, Asst. Prin Office (Rm 101) Main Bldg	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	Gray Flooring Mastic	1,100	SF	1st Floor Corridor (Main Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	Yellow, Brown and Beige Ceramic Tile Grout	1,684	SF	1st and 2nd Floor Boys and Girls	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Schmid School Unit 25391 Building ID 5950

Address 9755 S Greenwood Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Restrooms, Teacher's Lounge Toilet, NE and SE Vestibules (Main Bldg)										
22	Yellow, Brown and Beige Ceramic Tile Adhesive	1,684	SF	1st and 2nd Floor Boys and Girls Restrooms, Teacher's Lounge Toilet, NE and SE Vestibules (Main Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	Grey and Black Speckled Terrazzo	2,176	SF	1st and 2nd Floor Stairwells	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12 x 12 Blue Floor Tile	2,936	SF	2nd Floor Corridor, Teachers Lounge (Main Bldg) and Main Office, Kitchen (ANNEX)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
24M	12 x 12 Blue Floor Tile Mastic	2,936	SF	2nd Floor Corridor, Teachers Lounge (Main Bldg) and Main Office, Kitchen (ANNEX)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	Beige and Tan Ceramic Tile Grout	960	SF	Boys and Girls Restrooms, Teacher's Toilets (ANNEX)	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
26	Beige and Tan Ceramic Tile Grout	960	SF	Boys and Girls Restrooms, Teacher's Toilets (ANNEX)	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
27	Gray Baseboard	136	LF	E-W Corridor (Annex Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27A	Gray Baseboard Adhesive	136	LF	E-W Corridor (Annex Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	Red Ceramic Tile Grout	120	SF	North and South Entrances (Annex Bldg)	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
29	Red Ceramic Tile Adhesive	120	SF	North and South Entrances (Annex Bldg)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	12 x 12 White with Blue and Red Speckles Floor Tile	416	SF	Annex Bldg Main Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
30M	12 x 12 White with Blue and Red Speckles	416	SF	Annex Bldg Main	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Schmid School Unit 25391 Building ID 5950

Address 9755 S Greenwood Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Floor Tile Mastic			Office								potential for damage		
31	Beige Flooring	1,100	SF	1st Floor Corridor, Assit. Principal's Office (Room 101)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
32	Gray Flooring	1,100	SF	1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
33	12" X 12" white with blue specks VFT	530	SF	2nd floor corridor, main bldg; 2nd floor Teachers Lounge , main bldg.	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		MODERATE
34	12" X 12' white with blue specks, Mastic	530	SF	2nd floor corridor, main bldg; 2nd floor Teachers Lounge , main bldg	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
35	12" x 12" cream with tan specks VFT	100	SF	Rm 102/ principas office stage room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
36	12" X 12" cream with tan specks, Mastic	100	SF	Rm 102/ principas office stage room	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
37	Fire Doors	80	SF	2nd Floor Corridor	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW

Chicago Public Schools

School Schmid School Unit 25391 Building ID 5950

Address 9755 S Greenwood Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 2/22/2016
Inspector Name Keith Clough
100-02950 5/15/2017
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
03	
03A	
03B	
04	
05	
05A	
05B	
06	
07	
08	
08A	
09	
09A	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	

Chicago Public Schools

School Schmid School Unit 25391 Building ID 5950

Address 9755 S Greenwood Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
21	
22	
23	
24	
24M	
25	
26	
27	
27A	
28	
29	
30	
30M	
31	
32	
33	
34	
35	
36	
37	

Table II

Management Planner's Review

Chicago Public Schools

School Schmid School
Address 9755 S Greenwood

Unit 25391
Chicago, IL, 60628

Building ID 5950
Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
03	12x12 rust w/white specks floor tile	2,804	SF	1st floor corridor (ANNEX BLDG)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03A	12x12 brown w/white specks floor tile	5,198	SF	All classrooms (except 406,404) and 1/2 main office. (ANNEX BLDG)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03B	12x12 cream floor tile	5,198	SF	all classrooms (except 406),and 1/2 main office, main building eng office, washroom (ANNEX BLDG)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	9x9 light brown w/specks floor tile	4,000	SF	gym/lunchroom, kitchen,eng office,store room (ANNEX BLDG)	Chrysotile	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	12x12 rust w/white specks floor tile mastic	2,804	SF	1st floor corridors (ANNEX BLDG)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05A	12x12 brown w/white specks floor tile mastic	5,198	SF	All classrooms (except 406,404) and 1/2 main office (ANNEX BLDG)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05B	12x12 cream floor tile mastic	5,198	SF	All classrooms (except 406,404) and 1/2 main office (ANNEX BLDG)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	9x9 light brown w/specks floor tile mastic	4,000	SF	gym/lunchroom, kitchen,eng office,store room (ANNEX BLDG)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	drywall	36,000	SF	throughout building - covered with metal (ANNEX BLDG)	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	dark brown vinyl base board	145	LF	engineers office/washroom, store room, main office washroom (ANNEX BLDG)	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
08A	beige vinyl baseboard	86	LF	principals office, store room in main office (ANNEX BLDG)	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
09	dark brown vinyl baseboard mastic	145	LF	engineers office/washroom, store room, main office washroom (ANNEX BLDG)	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
09A	beige vinyl baseboard mastic	86	LF	principal's office, store rooms in main office (ANNEX BLDG)	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
10	2x4 ceiling tile	18,000	SF	throughout buildings Engineer office/washroom (ANNEX BLDG)	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	purple carpet mastic	2,222	SF	room 411, library, detention room 404, Room 403 (ANNEX BLDG)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	Carpet mastic NOT OBSERVED	395	SF	main office, principals office, main office store rooms (ANNEX BLDG)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	
13	orange/brown carpet mastic NOT FOUND	340	SF	room 403 - (ANNEX BLDG)	Assumed	MISC	No		SF		
14	Red carpet mastic - NOT OBSERVED	350	SF	Main office (ANNEX BLDG)	Assumed	MISC	No		SF		
15	9"X 9" Dark Brown Floor Tile	100	SF	Engineer's Office Storage Room (Main Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	9"X 9" Dark Floor Tile MASTIC	100	SF	Engineer's Office Storage Room (Main	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Schmid School
Address 9755 S Greenwood

Unit 25391
Chicago, IL, 60628

Building ID 5950
Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Bldg)							
17	12"X 12" Beige w/gray specks Floor Tile	300	SF	Engineer's Office & Toilet, 1st Floor Wardrobe Room (Main Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	12"X 12" Beige w/gray specks Floor Tile MASTIC	300	SF	Engineer's Office & Toilet, 1st Floor Wardrobe Room (Main Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	Beige Flooring Mastic	1,100	SF	1st Floor Corridor, Asst. Prin Office (Rm 101) Main Bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	Gray Flooring Mastic	1,100	SF	1st Floor Corridor (Main Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Yellow, Brown and Beige Ceramic Tile Grout	1,684	SF	1st and 2nd Floor Boys and Girls Restrooms, Teacher's Lounge Toilet, NE and SE Vestibules (Main Bldg)	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	Yellow, Brown and Beige Ceramic Tile Adhesive	1,684	SF	1st and 2nd Floor Boys and Girls Restrooms, Teacher's Lounge Toilet, NE and SE Vestibules (Main Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	Grey and Black Speckled Terrazzo	2,176	SF	1st and 2nd Floor Stairwells	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12 x 12 Blue Floor Tile	2,936	SF	2nd Floor Corridor, Teachers Lounge (Main Bldg) and Main Office, Kitchen (ANNEX)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24M	12 x 12 Blue Floor Tile Mastic	2,936	SF	2nd Floor Corridor, Teachers Lounge (Main Bldg) and Main Office, Kitchen (ANNEX)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Beige and Tan Ceramic Tile Grout	960	SF	Boys and Girls Restrooms, Teacher's Toilets (ANNEX)	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	Beige and Tan Ceramic Tile Grout	960	SF	Boys and Girls Restrooms, Teacher's Toilets (ANNEX)	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	Gray Baseboard	136	LF	E-W Corridor (Annex Bldg)	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
27A	Gray Baseboard Adhesive	136	LF	E-W Corridor (Annex Bldg)	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
28	Red Ceramic Tile Grout	120	SF	North and South Entrances (Annex Bldg)	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	Red Ceramic Tile Adhesive	120	SF	North and South Entrances (Annex Bldg)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	12 x 12 White with Blue and Red Speckles Floor Tile	416	SF	Annex Bldg Main Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30M	12 x 12 White with Blue and Red Speckles Floor Tile Mastic	416	SF	Annex Bldg Main Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	Beige Flooring	1,100	SF	1st Floor Corridor, Assit. Principal's	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Schmid School
Address 9755 S Greenwood

Unit 25391
 Chicago, IL, 60628

Building ID 5950
Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Office (Room 101)							
32	Gray Flooring	1,100	SF	1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12" X 12" white with blue specks VFT	530	SF	2nd floor corridor, main bldg; 2nd floor Teachers Lounge , main bldg.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12" X 12" white with blue specks, Mastic	530	SF	2nd floor corridor, main bldg; 2nd floor Teachers Lounge , main bldg	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12" x 12" cream with tan specks VFT	100	SF	Rm 102/ principas office stage room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12" X 12" cream with tan specks, Mastic	100	SF	Rm 102/ principas office stage room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Fire Doors	80	SF	2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Schmid School
Address 9755 S Greenwood

Unit 25391
 Chicago, IL, 60628

Building ID 5950
Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

Review Date	5/4/2016
Manager Planner Name	Jigar Shah
100-07342	1/19/2017
Manager IDPH License No/Expiration	

HA Number	Management Comments
03	
03A	
03B	
04	
05	
05A	
05B	
06	
07	
08	
08A	
09	
09A	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	

Chicago Public Schools

School Schmid School
Address 9755 S Greenwood

Unit 25391
Chicago, IL, 60628

Building ID 5950
Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
23	
24	
24M	
25	
26	
27	
27A	
28	
29	
30	
30M	
31	
32	
33	
34	
35	
36	
37	

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **12x12 rust w/white specks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st floor corridor (ANNEX BLDG)**
MATERIAL QUANTITY: **2804** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **12x12 rust w/white specks floor tile**
MATERIAL LOCATION: **1st floor corridor (ANNEX BLDG)**
MATERIAL QUANTITY: **2804** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03A**
MATERIAL DESCRIPTION: **12x12 brown w/white specks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **All classrooms (except 406,404) and 1/2 main office. (ANNEX BLDG)**
MATERIAL QUANTITY: **5198** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **03A**
MATERIAL DESCRIPTION: **12x12 brown w/white specks floor tile**
MATERIAL LOCATION: **All classrooms (except 406,404) and 1/2 main office. (ANNEX BLDG)**
MATERIAL QUANTITY: **5198** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03B**
MATERIAL DESCRIPTION: **12x12 cream floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **all classrooms (except 406),and 1/2 main office, main building eng office, washroom (ANNEX BLDG)**

MATERIAL QUANTITY: **5198**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **03B**
MATERIAL DESCRIPTION: **12x12 cream floor tile**
MATERIAL LOCATION: **all classrooms (except 406),and 1/2 main office, main building eng office, washroom (ANNEX BLDG)**
MATERIAL QUANTITY: **5198** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

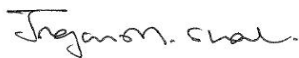

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **9x9 light brown w/specks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **gym/lunchroom, kitchen,eng office,store room (ANNEX BLDG)**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUILDING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **9x9 light brown w/specks floor tile**
MATERIAL LOCATION: **gym/lunchroom, kitchen,eng office,store room (ANNEX BLDG)**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **12x12 rust w/white specks floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st floor corridors (ANNEX BLDG)**

MATERIAL QUANTITY: **2804**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **12x12 rust w/white specks floor tile mastic**
MATERIAL LOCATION: **1st floor corridors (ANNEX BLDG)**
MATERIAL QUANTITY: **2804** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05A**
MATERIAL DESCRIPTION: **12x12 brown w/white specks floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All classrooms (except 406,404) and 1/2 main office (ANNEX BLDG)**
MATERIAL QUANTITY: **5198** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **05A**
MATERIAL DESCRIPTION: **12x12 brown w/white specks floor tile mastic**
MATERIAL LOCATION: **All classrooms (except 406,404) and 1/2 main office (ANNEX BLDG)**
MATERIAL QUANTITY: **5198** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05B**
MATERIAL DESCRIPTION: **12x12 cream floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **All classrooms (except 406,404) and 1/2 main office (ANNEX BLDG)**
MATERIAL QUANTITY: **5198** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUILDING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **05B**
MATERIAL DESCRIPTION: **12x12 cream floor tile mastic**
MATERIAL LOCATION: **All classrooms (except 406,404) and 1/2 main office (ANNEX BLDG)**
MATERIAL QUANTITY: **5198** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **9x9 light brown w/specks floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **gym/lunchroom, kitchen,eng office,store room (ANNEX BLDG)**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **9x9 light brown w/specks floor tile mastic**
MATERIAL LOCATION: **gym/lunchroom, kitchen,eng office,store room (ANNEX BLDG)**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **throughout building - covered with metal (ANNEX BLDG)**
MATERIAL QUANTITY: **36000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **drywall**
MATERIAL LOCATION: **throughout building - covered with metal (ANNEX BLDG)**
MATERIAL QUANTITY: **36000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **dark brown vinyl base board**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **engineers office/washroom, store room, main office washroom (ANNEX BLDG)**
MATERIAL QUANTITY: **145** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **dark brown vinyl base board**
MATERIAL LOCATION: **engineers office/washroom, store room, main office washroom (ANNEX BLDG)**
MATERIAL QUANTITY: **145** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08A**
MATERIAL DESCRIPTION: **beige vinyl baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **principals office, store room in main office (ANNEX BLDG)**
MATERIAL QUANTITY: **86** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**
COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **08A**
MATERIAL DESCRIPTION: **beige vinyl baseboard**
MATERIAL LOCATION: **principals office, store room in main office (ANNEX BLDG)**
MATERIAL QUANTITY: **86** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **dark brown vinyl baseboard mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **engineers office/washroom, store room, main office washroom (ANNEX BLDG)**
MATERIAL QUANTITY: **145** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **dark brown vinyl baseboard mastic**
MATERIAL LOCATION: **engineers office/washroom, store room, main office washroom (ANNEX BLDG)**
MATERIAL QUANTITY: **145** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09A**
MATERIAL DESCRIPTION: **beige vinyl baseboard mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **principal's office, store rooms in main office (ANNEX BLDG)**
MATERIAL QUANTITY: **86** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **09A**
MATERIAL DESCRIPTION: **beige vinyl baseboard mastic**
MATERIAL LOCATION: **principal's office, store rooms in main office (ANNEX BLDG)**
MATERIAL QUANTITY: **86** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **2x4 ceiling tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **throughout buildings Engineer office/washroom (ANNEX BLDG)**
MATERIAL QUANTITY: **18000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **2x4 ceiling tile**
MATERIAL LOCATION: **throughout buildings Engineer office/washroom (ANNEX BLDG)**
MATERIAL QUANTITY: **18000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **purple carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **room 411, library, detention room 404, Room 403 (ANNEX BLDG)**
MATERIAL QUANTITY: **2222** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUILDING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **purple carpet mastic**
MATERIAL LOCATION: **room 411, library, detention room 404, Room 403 (ANNEX BLDG)**
MATERIAL QUANTITY: **2222** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Carpet mastic NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **main office, principals office, main office store rooms (ANNEX BLDG)**
MATERIAL QUANTITY: **395** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Carpet mastic NOT OBSERVED**
MATERIAL LOCATION: **main office, principals office, main office store rooms (ANNEX BLDG)**
MATERIAL QUANTITY: **395** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **orange/brown carpet mastic NOT FOUND**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 403 - (ANNEX BLDG)**

MATERIAL QUANTITY: **340**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **orange/brown carpet mastic NOT FOUND**
MATERIAL LOCATION: **room 403 - (ANNEX BLDG)**
MATERIAL QUANTITY: **340** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Red carpet mastic - NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main office (ANNEX BLDG)**

MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Red carpet mastic - NOT OBSERVED**
MATERIAL LOCATION: **Main office (ANNEX BLDG)**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **9"X 9" Dark Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office Storage Room (Main Bldg)**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUILDING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **9"X 9" Dark Brown Floor Tile**
MATERIAL LOCATION: **Engineer's Office Storage Room (Main Bldg)**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **9"X 9" Dark Floor Tile MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Offiice Storage Room (Main Bldg)**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **9"X 9" Dark Floor Tile MASTIC**
MATERIAL LOCATION: **Engineer's Ofiice Storage Room (Main Bldg)**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12"X 12" Beige w/gray specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Engineer's Office & Toilet, 1st Floor Wardrobe Room (Main Bldg)**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12"X 12" Beige w/gray specks Floor Tile**
MATERIAL LOCATION: **Engineer's Office & Toilet, 1st Floor Wardrobe Room (Main Bldg)**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"X 12" Beige w/gray specks Floor Tile MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office & Toilet, 1st Floor Wardrobe Room (Main Bldg)**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUILDING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12"X 12" Beige w/gray specks Floor Tile MASTIC**
MATERIAL LOCATION: **Engineer's Office & Toilet, 1st Floor Wardrobe Room (Main Bldg)**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Beige Flooring Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Corridor, Asst. Prin Office (Rm 101) Main Bldg**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Beige Flooring Mastic**
MATERIAL LOCATION: **1st Floor Corridor, Asst. Prin Office (Rm 101) Main Bldg**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Gray Flooring Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Corridor (Main Bldg)**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Gray Flooring Mastic**
MATERIAL LOCATION: **1st Floor Corridor (Main Bldg)**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Yellow, Brown and Beige Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st and 2nd Floor Boys and Girls Restrooms, Teacher's Lounge Toilet, NE and SE Vestibules (Main Bldg)**

MATERIAL QUANTITY: **1684** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Yellow, Brown and Beige Ceramic Tile Grout**
MATERIAL LOCATION: **1st and 2nd Floor Boys and Girls Restrooms, Teacher's Lounge Toilet, NE and SE Vestibules (Main Bldg)**
MATERIAL QUANTITY: **1684** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Yellow, Brown and Beige Ceramic Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st and 2nd Floor Boys and Girls Restrooms, Teacher's Lounge Toilet, NE and SE Vestibules (Main Bldg)**

MATERIAL QUANTITY: **1684** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Yellow, Brown and Beige Ceramic Tile Adhesive**
MATERIAL LOCATION: **1st and 2nd Floor Boys and Girls Restrooms, Teacher's Lounge Toilet, NE and SE Vestibules (Main Bldg)**
MATERIAL QUANTITY: **1684** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Grey and Black Speckled Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st and 2nd Floor Stairwells**
MATERIAL QUANTITY: **2176** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Grey and Black Speckled Terrazzo**
MATERIAL LOCATION: **1st and 2nd Floor Stairwells**
MATERIAL QUANTITY: **2176** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12 x 12 Blue Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **2nd Floor Corridor, Teachers Lounge (Main Bldg) and Main Office, Kitchen (ANNEX)**
MATERIAL QUANTITY: **2936** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **12 x 12 Blue Floor Tile**
MATERIAL LOCATION: **2nd Floor Corridor, Teachers Lounge (Main Bldg) and Main Office, Kitchen (ANNEX)**
MATERIAL QUANTITY: **2936** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature:  Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24M**
MATERIAL DESCRIPTION: **12 x 12 Blue Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Corridor, Teachers Lounge (Main Bldg) and Main Office, Kitchen (ANNEX)**
MATERIAL QUANTITY: **2936** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUILDING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **24M**
MATERIAL DESCRIPTION: **12 x 12 Blue Floor Tile Mastic**
MATERIAL LOCATION: **2nd Floor Corridor, Teachers Lounge (Main Bldg) and Main Office, Kitchen (ANNEX)**
MATERIAL QUANTITY: **2936** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Beige and Tan Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boys and Girls Restrooms, Teacher's Toilets (ANNEX)**
MATERIAL QUANTITY: **960** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Beige and Tan Ceramic Tile Grout**
MATERIAL LOCATION: **Boys and Girls Restrooms, Teacher's Toilets (ANNEX)**
MATERIAL QUANTITY: **960** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Beige and Tan Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boys and Girls Restrooms, Teacher's Toilets (ANNEX)**
MATERIAL QUANTITY: **960** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Beige and Tan Ceramic Tile Grout**
MATERIAL LOCATION: **Boys and Girls Restrooms, Teacher's Toilets (ANNEX)**
MATERIAL QUANTITY: **960** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Gray Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **E-W Corridor (Annex Bldg)**
MATERIAL QUANTITY: **136** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Gray Baseboard**
MATERIAL LOCATION: **E-W Corridor (Annex Bldg)**
MATERIAL QUANTITY: **136** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27A**
MATERIAL DESCRIPTION: **Gray Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **E-W Corridor (Annex Bldg)**
MATERIAL QUANTITY: **136** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **27A**
MATERIAL DESCRIPTION: **Gray Baseboard Adhesive**
MATERIAL LOCATION: **E-W Corridor (Annex Bldg)**
MATERIAL QUANTITY: **136** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Red Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **North and South Entrances (Annex Bldg)**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Red Ceramic Tile Grout**
MATERIAL LOCATION: **North and South Entrances (Annex Bldg)**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Red Ceramic Tile Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **North and South Entrances (Annex Bldg)**

MATERIAL QUANTITY: **120**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Red Ceramic Tile Adhesive**
MATERIAL LOCATION: **North and South Entrances (Annex Bldg)**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12 x 12 White with Blue and Red Speckles Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Annex Bldg Main Office**

MATERIAL QUANTITY: **416**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **12 x 12 White with Blue and Red Speckles Floor Tile**
MATERIAL LOCATION: **Annex Bldg Main Office**
MATERIAL QUANTITY: **416** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30M**
MATERIAL DESCRIPTION: **12 x 12 White with Blue and Red Speckles Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Bldg Main Office**

MATERIAL QUANTITY: **416**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUILDING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **30M**
MATERIAL DESCRIPTION: **12 x 12 White with Blue and Red Speckles Floor Tile Mastic**
MATERIAL LOCATION: **Annex Bldg Main Office**
MATERIAL QUANTITY: **416** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Beige Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st Floor Corridor, Assit. Principal's Office (Room 101)**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUILDING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Beige Flooring**
MATERIAL LOCATION: **1st Floor Corridor, Assit. Principal's Office (Room 101)**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Gray Flooring**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Gray Flooring**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12" X 12" white with blue specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **2nd floor corridor, main bldg; 2nd floor Teachers Lounge , main bldg.**
MATERIAL QUANTITY: **530** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **12" X 12" white with blue specks VFT**
MATERIAL LOCATION: **2nd floor corridor, main bldg; 2nd floor Teachers Lounge , main bldg.**
MATERIAL QUANTITY: **530** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12" X 12' white with blue specks, Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd floor corridor, main bldg; 2nd floor Teachers Lounge , main bldg**
MATERIAL QUANTITY: **530** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12" X 12' white with blue specks, Mastic**
MATERIAL LOCATION: **2nd floor corridor, main bldg; 2nd floor Teachers Lounge , main bldg**
MATERIAL QUANTITY: **530** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12" x 12" cream with tan specks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Rm 102/ principas office stage room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **12" x 12" cream with tan specks VFT**
MATERIAL LOCATION: **Rm 102/ principas office stage room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12" X 12" cream with tan specks, Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 102/ principas office stage room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc. 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUILDING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12" X 12" cream with tan specks, Mastic**
MATERIAL LOCATION: **Rm 102/ principas office stage room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Keith Clough**
SCHOOL NAME: **Schmid School** INSPECTION DATE: **2/22/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Fire Doors**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Corridor**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/22/2016

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **25391** BUIDLING ID: **5950**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**
SCHOOL NAME: **Schmid School** REVIEW DATE: **5/4/2016**
ADDRESS: **9755 S Greenwood** IDPH LICENSE NO: **100-02950**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Fire Doors**
MATERIAL LOCATION: **2nd Floor Corridor**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

Jigar Shah

Date: **05/04/2016**

Chicago Public Schools

GSG Consultants, Inc.
2016 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

1/27/2016

KEITH CLOUGH
524 HOMELAND RD
MATTESON, IL 60443

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 02950

Enclosed is your Asbestos Professional License that expires 05/15/2017

CERTIFICATE EXPIRATION DATE

INSPECTOR 3/23/2016

PROJECT MANAGER 4/30/2016
AIR SAMPLING PROFESSIONAL

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is:

<http://www.dph.illinois.gov/topics-services/environmental-health-protection/asbestos>



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 02950

ISSUED
1/27/2016

EXPIRES
05/15/2017

KEITH CLOUGH
524 HOMELAND RD
MATTESON, IL 60443

Environmental Health



LIVES

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that KEITH CLOUGH
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 03/21/2016 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.



03/21/2016

Course Dates:

3/21/2017

Expires:

1603BIR03

Certificate Number:

Nicholas J. Peneff

Director of Training


Nicholas J. Peneff

Director of Public Health

Phone: 312-491-0081

FORM # A-010B

2016

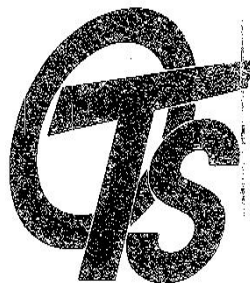

OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Jigar Shah

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016

Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270320


Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

4/20/2016

JIGAR M SHAH
 855 W ADAMS ST, SUITE 200
 CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

		ASBESTOS PROFESSIONAL LICENSE		ENDORSEMENTS	TC EXPIRES
ID NUMBER 109 - 07342	ISSUED 4/20/2016	EXPIRES 05/15/2017		INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/19/2017 2/2/2017 1/27/2017 2/26/2017
JIGAR M SHAH 855 W ADAMS ST, SUITE 200 CHICAGO, IL 60607 Environmental Health		Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.			

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
 EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed