

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2055  
SCHOOL NAME: Altgeld School & Annex  
ADDRESS OF SCHOOL: 1340 W. 71st St./7007 S. Loomis Blvd (outdated:  
1426 W. 71st St.)  
CITY: Chicago, IL, 60636

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/13/2013**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 4/21/2016 ENROLLMENT 484  
IDPH INSPECTOR LICENSE NUMBER: 100-10882  
IDPH LICENSED INSPECTOR NAME (Please Print): Beinville Brooks  
IDPH MP LICENSE NUMBER: 100-03613  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau  
  
DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



4/21/2016

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_  
School has been closed. Date closed: \_\_\_\_\_  
School building has been demolished. Date: \_\_\_\_\_  
School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

---

---

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Altgeld School & Annex**

1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)  
Chicago, IL, 60636

Unit: 25811  
Building ID: 2050 & 8708

IDPH ID Number: 14-016-2990-2055

**REPORT DATE:**

Thursday, April 21, 2016

**Prepared for:**

**Chicago Public Schools**  
**125 S. Clark Street**  
**Chicago, IL 60603**

**Prepared by:**

**Carnow, Conibear and Associates**

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

March 15, 2016

Mr. R. Kent Cook  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 22051                      Region: 05                      IDPH ID: 14-016-2990-2055

School: Altgeld School & Annex                      Building ID: 2050 & 8708

Address: 1340 W. 71st St./7007 S. Loomis Blvd  
(outdated: 1426 W. 71st St.)

Chicago, IL, 60636

Building Contact:                      Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 04/21/2016

Inspector: Beinville Brooks

Inspector IDPH License: 100-10882

Management Planner: Daniel Juneau

Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,  
Carnow, Conibear and Associates



Daniel Juneau  
100-03613

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: March 15, 2016

RE: Altgeld School & Annex, Unit 25811  
1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)  
Chicago, IL, 60636

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Altgeld School & Annex , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Altgeld School & Annex, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Altgeld School & Annex Unit: 22051 Region: 05  
Address: 1340 W. 71st St./7007 S. Chicago, IL, 60636  
Loomis Blvd (outdated: 1426 W. 71st St.)  
IDPH ID: 14-016-2990-2055 Building ID: 2050 & 8708  
Contact: Phone:

### 2. Description of Facility

Original Construction: Additional Construction:  
Total Square Footage: No of Floors:  
Current Occupancy: 484

### 3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197  
Address: 125 South Clark Street, 17th Floor  
Chicago, IL 60603


### 4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates  
Contact: Dan Juneau  
Address 600 West Van Buren St., Ste 500  
Phone: (312) 762-2900 Fax: (312) 782-5145

### 5. Inspector

Inspector Name: Beinville Brooks


Inspector IDPH license # 100-10882

  
Signature:  
Date: 3/15/2016

### 6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613

  
Signature:  
Date: 04/21/2016

### 7. Review Date: 04/21/2016

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 4/21/2016

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Altgeld School & Annex. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 2050 & 8708:

03	Hard Coat Plaster
07	2'x4' Wormy Patterned Lay In Ceiling Panels
08	2'x4' Perferated Lay In Ceiling Panels
10	Ceiling Plaster
11	Troweled On Ceiling Plaster
19	Insulation Inside of Vault Door
20	Insulation Inside of Fire Rated Doors
20A	Insulation Inside of Fire Rated Doors
26	2'x4' Lay In Ceiling Panels

B. The following new homogenous areas have been identified for Building 2050 & 8708:



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01A	12"x 12" Dark Tan Floor Tile
01B	12" x 12" off white VFT
01C	12"x 12" Tan Speckled Floor Tile
03	Hard Coat Plaster
04	Burlap on Walls
04A	Burlap Wall Covering
05A	Green Linoleum - Removed floor contains wood
05AA	Mastic Beneath Green Linoleum - Wood floors only
05BB	Mastic Beneath Tan Linoleum - Wood floors only
06	1'x1' Ceiling Tile
06A	1'x1' Ceiling Tile Adhesive
07	2'x4' Wormy Patterned Lay In Ceiling Panels
08	2'x4' Perferated Lay In Ceiling Panels
09	Spray On Fireproofing
12	Cardboard Pipe Insulation
13	Sink Undercoat
14	Sink Undercoat
15	Ceramic Tile Floor Tile Grout
16	Ceramic Floor Tile Adhesive
17	Ceramic Floor Tile Grout
18	Ceramic Floor Tile Adhesive
19	Insulation Inside of Vault Door
20	Insulation Inside of Fire Rated Doors
20A	Insulation Inside of Fire Rated Doors
21	Chalkboards
22	Chalkboard Adhesive
23	Chalkboards
24	Chalkboard Adhesive
25	Terrazzo
26	2'x4' Lay In Ceiling Panels
27	Linoleum on Shelves
28	Linoleum Adhesive on Shelves
A-1	12"x12" Cream w/Beige Spots Floor Tile
A-2	12"x12" Cream w/Beige Spots Floor Tile Mastic
B-1	12" x 12" Cream w/Beige Spots Floor Tile
B-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic
C-1	12" x 12" Cream w/Beige Spots Floor Tile
C-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic
CM-1	Tan Carpet Mastic
CM-2	Green Carpet Mastic
CM-3	Blue Carpet Adhesive
D	Pipe Joint Insulation on Cardboard Insulated Piping

D-1	12" x 12" Cream w/Beige Spots Floor Tile
D-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic
E-1	12x12 Cream w/Beige Spots Floor Tile (114) Removed Engineer's Room; 9x9 Floor Tile Library
E-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1
F-1	12" x 12" Cream w/Beige Spots Floor Tile
F-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic
G	Mag Block Pipe Insulation
G-1	12" x 12" Cream w/Beige Spots Floor Tile
G-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic
H	Pipe Fitting Insulation on Mag Block Insulated Piping
K	12"x12" Brown and White Floor Tile
K2	12"x12" Brown and White Floor Tile Mastic

The following areas were deemed to be inaccessible:

02A1	9"x 9" Tan Speckled Floor Tile
B-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic
C-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic
D-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic
E-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1
F	Pipe Fitting Insulation on Aircell Insulated Piping
FT-1	9 "x 9" black VFT
FTM-1	Mastic
G-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic
K2	12"x12" Brown and White Floor Tile Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Beinville Brooks, IDPH License # 100-10882. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Altgeld School & Annex Building 2050 & 8708 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---



# Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708

Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Engineer's Office and Washroom										
02AA-1	9"x9" Tan Speckled Floor Tile			Engineers Office, Library and Library Office	CHR	MISC								
02B	9"x9" Tan w/Streaks Floor Tile			Annex building Principal's Office and Classrooms 124, 223, 220, 229	CHR	MISC								
02BB	9"x9" Tan w/Streaks Floor Tile Mastic			Annex building Principal's Office and Classrooms 124, 223, 220, and 229	CHR	MISC								
02C	9"x9" Off-White Floor Tile; Walk-in freezer had 9x9 removed inadvertently, now 12x12 freezer			Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125	CHR	MISC								
02CC	9"x9" Off-White Floor Tile Mastic			Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125	CHR	MISC								
02D	9"x9" Olive Green Floor Tile			Annex building Throughout 1st and 2nd Floor Corridors	CHR	MISC								
02DD	9"x9" Olive Green Floor Tile			Annex building- throughout 1st and 2nd Floor Corridors	CHR	MISC								
02E	9"x9" Off-White w/Specks Floor Tile			Annex Building- Throughout 1st and 2nd Floor Corridors	CHR	MISC								
02EE	9"x9" Off-White Floor Tile Mastic			Annex building- Throughout 1st and 2nd Floor Corridors	CHR	MISC								
03	Hard Coat Plaster	120,000	SF	Throughout Main Building	ASSUMED	SURFACE	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
04	Burlap on Walls	500	SF	Library, Third Floor Teacher's Room, and Classrooms: 101, 104, 203, 206, 301, 302, 303, 305.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708

Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				306, 307, 308, and 309										
04A	Burlap Wall Covering	100	SF	Annex Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05A	Green Linoleum - Removed floor contains wood			Room 101- Main Building	ASSUMED	MISC								
05AA	Mastic Beneath Green Linoleum - Wood floors only			Room 101- Main Building	ASSUMED	MISC								
05B	Tan Linoleum only wood floors			Main Building Room 203 and Storage	CHR	MISC								
05BB	Mastic Beneath Tan Linoleum - Wood floors only			Room 203 and Main Building Storage Room	ASSUMED	MISC								
06	1'x1' Ceiling Tile	900	SF	Main Building Room 202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
06A	1'x1' Ceiling Tile Adhesive	900	SF	Main Building Room 202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07	2'x4' Wormy Patterned Lay In Ceiling Panels	12	SF	Main Building Lunchroom	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
08	2'x4' Perforated Lay In Ceiling Panels	525	SF	Main Building Kitchen	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
09	Spray On Fireproofing			Throughout Annex	ASSUMED	SURFACE								
10	Ceiling Plaster	300	SF	Annex Washrooms	CHR	SURFACE	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
11	Troweled On Ceiling Plaster	1,200	SF	Throughout Annex Mechanical Areas and Janitor Closets	CHR	SURFACE	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
12	Cardboard Pipe Insulation	410	LF	Main Building Basement	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
13	Sink Undercoat	3	SF	Main Building Library Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	Sink Undercoat	9	SF	Annex Classrooms 120, 124, and 125	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	Ceramic Tile Floor Tile Grout	900	SF	Main Building: Girl's and Boy's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	Ceramic Floor Tile Adhesive	900	SF	Main Building: Girl's and Boy's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708

Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
17	Ceramic Floor Tile Grout	600	SF	Annex Building: Girl's and Boy's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	Ceramic Floor Tile Adhesive	600	SF	Annex Building: Girl's and Boy's Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	Insulation Inside of Vault Door	56	SF	Annex: Main Office and Second Floor Corridor	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
20	Insulation Inside of Fire Rated Doors	102	SF	Annex Entrances and Speech Room	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
20A	Insulation Inside of Fire Rated Doors	204	SF	Main Building Entrances	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
21	Chalkboards	2,500	SF	Main Building Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	Chalkboard Adhesive	2,500	SF	Main Building Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	Chalkboards	1,500	SF	Annex Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	Chalkboard Adhesive	1,500	SF	Annex Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	Terrazzo	600	SF	Annex Stairways and Foyer	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	2'x4' Lay In Ceiling Panels	25,000	SF	Annex Classrooms, Corridors and Offices	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
27	Linoleum on Shelves	1,650	SF	Annex Classrooms and Assistant Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	Linoleum Adhesive on Shelves	1,650	SF	Annex Classrooms and Assistant Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A-1	12"x12" Cream w/Beige Spots Floor Tile	4,705	SF	Annex Building Principal's Office and Classrooms 124, 223, 220, and 229	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A-2	12"x12" Cream w/Beige Spots Floor Tile Mastic	4,705	SF	Annex Building Principal's Office and Classrooms 124, 223, 220, and 229	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
B-1	12" x 12" Cream w/Beige Spots Floor Tile	6,040	SF	ANNEX Rooms 227, 230, 126, 123,	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW



# Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708

Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				226, 221, Office, Store Room, Vault, Boiler Room, and Restroom										
B-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic	6,040	SF	ANNEX Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
C-1	12" x 12" Cream w/Beige Spots Floor Tile	1,872	SF	ANNEX Building Throughout 1st and 2nd Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
C-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic	1,872	SF	ANNEX Building Throughout 1st and 2nd Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
CM-1	Tan Carpet Mastic	500	SF	Principal's office and Adjustment Center- Main building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
CM-2	Green Carpet Mastic			Room 202- Main building	ASSUMED	MISC								
CM-3	Blue Carpet Adhesive			Main Building Classrooms 201 and 202	ASSUMED	MISC								
D	Pipe Joint Insulation on Cardboard Insulated Piping	50	SF	Main Building Basement	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
D-1	12" x 12" Cream w/Beige Spots Floor Tile	1,320	SF	Annex Building Room 120	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
D-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic	1,320	SF	Annex Building Room 120	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
E	Aircell Pipe Insulation	20	LF	Boiler Room in Main Building	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
E-1	12x12 Cream w/Beige Spots Floor Tile (114) Removed Engineer's Room; 9x9 Floor Tile Library	1,500	SF	Engineers Office and Main Building Library 9x9 Fl Tile - Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
E-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1	1,500	SF	Engineers Office and Main Building Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
F	Pipe Fitting Insulation on Aircell Insulated Piping	3	FITTING	Boiler Room- Main building	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable		LOW

# Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708

Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												suspect ACBM		
F-1	12" x 12" Cream w/Beige Spots Floor Tile	1,872	SF	Annex Building Throughout 1st and 2nd Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
F-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic	1,872	SF	Annex Building Throughout 1st and 2nd Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-1	9 "x 9" black VFT	250	SF	Under carpet in principal's and adjoining office-Main building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-2	9"x9" Tan Floor Tile	250	SF	Under Carpet in Principal's and Adjoining Office-Main building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-1	Mastic	250	SF	Under Carpet in Principal's and Adjoining Office-Main building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-2	Mastic	250	SF	Under carpet in Principal's and Adjoining Office-Main building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
G	Mag Block Pipe Insulation	5	LF	Boiler Room- Main building	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
G-1	12" x 12" Cream w/Beige Spots Floor Tile	2,845	SF	Annex Building Lunchroom and Restroom, Office Restroom, Teachers Restroom, and Room125	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
G-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic	2,845	SF	Annex Building Lunchroom and Restroom, Office Restroom, Teachers Restroom, and Room125	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
H	Pipe Fitting Insulation on Mag Block Insulated Piping			Main Building Boiler Room	ASSUMED	TSI								Low
J	Mag block ins. on boiler			Boiler room- Main building	CHR	TSI		None						
K	12"x12" Brown and White Floor Tile	520	SF	Main Office, Restroom, Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

**School** Altgeld School & Annex **Unit** 22051 **Building ID** 2050 & 8708

**Address** 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
K2	12"x12" Brown and White Floor Tile Mastic	520	SF	Main Office, Restroom, Main Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Altgeld School & Annex Unit 22051 Building ID 2050 & 8708

Address 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>3/15/2016</b>
Inspector Name <b>Beinville Brooks</b>
<b>100-10882</b> <b>5/15/2017</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
01A	
01AA	
01B	
01BB	
01C	
01CC	
01D	
01DD	
02A	Not observed 2016
02A1	
02AA	Not observed 2016
02AA-1	Not observed 2016
02B	Not observed 2016
02BB	Not observed 2016
02C	Not observed 2016
02CC	Not observed 2016
02D	Not observed 2016
02DD	Not observed 2016
02E	Not observed 2016
02EE	Not observed 2016
03	
04	
04A	
05A	Not observed 2016

# Chicago Public Schools

**School** Altgeld School & Annex **Unit** 22051 **Building ID** 2050 & 8708

**Address** 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
05AA	Not observed 2016
05B	Not observed 2016
05BB	Not observed 2016
06	
06A	
07	
08	
09	Not observed 2016
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
20A	
21	
22	
23	
24	
25	
26	
27	
28	
A-1	

# Chicago Public Schools

**School** Altgeld School & Annex **Unit** 22051 **Building ID** 2050 & 8708

**Address** 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
A-2	
B-1	
B-2	
C-1	
C-2	
CM-1	
CM-2	Not observed 2016
CM-3	Not observed 2016
D	
D-1	
D-2	
E	
E-1	
E-2	
F	
F-1	
F-2	
FT-1	
FT-2	
FTM-1	
FTM-2	
G	
G-1	
G-2	
H	Not observed 2016
J	Not observed 2016
K	
K2	

# Chicago Public Schools

**School** Altgeld School & Annex **Unit** 22051 **Building ID** 2050 & 8708

**Address** 1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.) **Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

*Inspector's Comments are Summarized at the End of the Report*

---

**Table II**

**Management Planner's Review**

---



# Chicago Public Schools

**School** Altgeld School & Annex

**Unit** 22051

**Building ID** 2050 & 8708

1340 W. 71st St./7007 S. Loomis

**Address** Blvd (outdated: 1426 W. 71st St.)

Chicago, IL, 60636

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01A	12"x 12" Dark Tan Floor Tile	225	SF	Main Office, Restroom, Closet- Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01AA	12"x 12" Dark Tan Floor Tile Mastic	225	SF	Main Office, Restroom and Closet- Main Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01B	12" x 12" off white VFT	225	SF	Main office, restroom and closet- main building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01BB	12"x 12" Off- White Floor Tile Mastic	225	SF	Main Office, Restroom and Closet- Main Building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01C	12"x 12" Tan Speckled Floor Tile	240	SF	Main building-Entry to Girls/Boys Restroom 1st Floor; 1st Floor and 2nd Floor Teachers' Restrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01CC	12"x 12" Tan Speckled Floor Tile Mastic	240	SF	Main building- Entry to Girls/Boys restroom 1st Floor; 1st Floor and 2nd Floor Teachers' Restrooms	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01D	12"x 12" tan streaked VFT	1,320	SF	Annex building room 120	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01DD	12"x 12" Tan Streaked Floor Tile Mastic	1,320	SF	Annex building room 120	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02A	9"x9" Gray w/White Streaks Floor Tile			ANNEX- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom	Chrysotile	MISC					
02A1	9"x 9" Tan Speckled Floor Tile	1,500	SF	Main Building Library (carpeted) and Library Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02AA	9"x9" Gray w/White Streaks Floor Tile Mastic			ANNEX- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom	Chrysotile	MISC					
02AA-1	9"x9 " Tan Speckled Floor Tile			Engineers Office, Library and Library Office	Chrysotile	MISC					
02B	9"x9" Tan w/Streaks Floor Tile			Annex building Principal's Office and Classrooms 124, 223, 220, 229	Chrysotile	MISC					
02BB	9"x9" Tan w/Streaks Floor Tile Mastic			Annex building Principal's Office and Classrooms 124, 223, 220, and 229	Chrysotile	MISC					
02C	9"x9" Off-White Floor Tile; Walk-in freezer had 9x9 removed inadvertently, now 12x12 freezer			Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125	Chrysotile	MISC					

# Chicago Public Schools

**School** Altgeld School & Annex

**Unit** 22051

**Building ID** 2050 & 8708

1340 W. 71st St./7007 S. Loomis

**Address** Blvd (outdated: 1426 W. 71st St.)

Chicago, IL, 60636

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
02CC	9"x9" Off-White Floor Tile Mastic			Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125	Chrysotile	MISC					
02D	9"x9 " Olive Green Floor Tile			Annex building Throughout 1st and 2nd Floor Corridors	Chrysotile	MISC					
02DD	9"x9" Olive Green Floor Tile			Annex building- throughout 1st and 2nd Floor Corridors	Chrysotile	MISC					
02E	9"x9" Off-White w/Specks Floor Tile			Annex Building- Throughout 1st and 2nd Floor Corridors	Chrysotile	MISC					
02EE	9"x9" Off-White Floor Tile Mastic			Annex building- Throughout 1st and 2nd Floor Corridors	Chrysotile	MISC					
03	Hard Coat Plaster	120,000	SF	Throughout Main Building	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
04	Burlap on Walls	500	SF	Library, Third Floor Teacher's Room, and Classrooms: 101, 104, 203, 206, 301, 302, 303, 305, 306, 307, 308, and 309	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04A	Burlap Wall Covering	100	SF	Annex Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05A	Green Linoleum - Removed floor contains wood			Room 101- Main Building	Assumed	MISC					
05AA	Mastic Beneath Green Linoleum - Wood floors only			Room 101- Main Building	Assumed	MISC					
05B	Tan Linoleum only wood floors			Main Building Room 203 and Storage	Chrysotile	MISC					
05BB	Mastic Beneath Tan Linoleum - Wood floors only			Room 203 and Main Building Storage Room	Assumed	MISC					
06	1'x1' Ceiling Tile	900	SF	Main Building Room 202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06A	1'x1' Ceiling Tile Adhesive	900	SF	Main Building Room 202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	2'x4' Wormy Patterned Lay In Ceiling Panels	12	SF	Main Building Lunchroom	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
08	2'x4' Perferated Lay In Ceiling Panels	525	SF	Main Building Kitchen	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
09	Spray On Fireproofing			Throughout Annex	Assumed	SURFACE					
10	Ceiling Plaster	300	SF	Annex Washrooms	Chrysotile	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
11	Troweled On Ceiling Plaster	1,200	SF	Throughout Annex Mechanical Areas and Janitor Closets	Chrysotile	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
12	Cardboard Pipe Insulation	410	LF	Main Building Basement	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable	Follow O&M Plan

# Chicago Public Schools

**School** Altgeld School & Annex

**Unit** 22051

**Building ID** 2050 & 8708

1340 W. 71st St./7007 S. Loomis

**Address** Blvd (outdated: 1426 W. 71st St.)

Chicago, IL, 60636

**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
										suspect ACBM	
13	Sink Undercoat	3	SF	Main Building Library Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	Sink Undercoat	9	SF	Annex Classrooms 120, 124, and 125	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	Ceramic Tile Floor Tile Grout	900	SF	Main Building: Girl's and Boy's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	Ceramic Floor Tile Adhesive	900	SF	Main Building: Girl's and Boy's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	Ceramic Floor Tile Grout	600	SF	Annex Building: Girl's and Boy's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	Ceramic Floor Tile Adhesive	600	SF	Annex Building: Girl's and Boy's Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	Insulation Inside of Vault Door	56	SF	Annex: Main Office and Second Floor Corridor	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
20	Insulation Inside of Fire Rated Doors	102	SF	Annex Entrances and Speech Room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
20A	Insulation Inside of Fire Rated Doors	204	SF	Main Building Entrances	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
21	Chalkboards	2,500	SF	Main Building Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	Chalkboard Adhesive	2,500	SF	Main Building Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	Chalkboards	1,500	SF	Annex Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	Chalkboard Adhesive	1,500	SF	Annex Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Terrazzo	600	SF	Annex Stairways and Foyer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	2'x4' Lay In Ceiling Panels	25,000	SF	Annex Classrooms, Corridors and Offices	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
27	Linoleum on Shelves	1,650	SF	Annex Classrooms and Assistant Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	Linoleum Adhesive on Shelves	1,650	SF	Annex Classrooms and Assistant Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A-1	12"x12" Cream w/Beige Spots Floor Tile	4,705	SF	Annex Building Principal's Office and Classrooms 124, 223, 220, and 229	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A-2	12"x12" Cream w/Beige Spots Floor Tile Mastic	4,705	SF	Annex Building Principal's Office and Classrooms 124, 223, 220, and 229	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
B-1	12" x 12" Cream w/Beige Spots Floor Tile	6,040	SF	ANNEX Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

School Altgeld School & Annex

Unit 22051

Building ID 2050 & 8708

1340 W. 71st St./7007 S. Loomis

Address Blvd (outdated: 1426 W. 71st St.)

Chicago, IL, 60636

Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
B-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic	6,040	SF	ANNEX Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C-1	12" x 12" Cream w/Beige Spots Floor Tile	1,872	SF	ANNEX Building Throughout 1st and 2nd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic	1,872	SF	ANNEX Building Throughout 1st and 2nd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CM-1	Tan Carpet Mastic	500	SF	Principal's office and Adjustment Center- Main building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CM-2	Green Carpet Mastic			Room 202- Main building	Assumed	MISC					
CM-3	Blue Carpet Adhesive			Main Building Classrooms 201 and 202	Assumed	MISC					
D	Pipe Joint Insulation on Cardboard Insulated Piping	50	SF	Main Building Basement	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
D-1	12" x 12" Cream w/Beige Spots Floor Tile	1,320	SF	Annex Building Room 120	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
D-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic	1,320	SF	Annex Building Room 120	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
E	Aircell Pipe Insulation	20	LF	Boiler Room in Main Building	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
E-1	12x12 Cream w/Beige Spots Floor Tile (114) Removed Engineer's Room; 9x9 Floor Tile Library	1,500	SF	Engineers Office and Main Building Library 9x9 FI Tile - Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
E-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1	1,500	SF	Engineers Office and Main Building Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
F	Pipe Fitting Insulation on Aircell Insulated Piping	3	FITTING	Boiler Room- Main building	Chrysotile	TSI	Yes	0	FITTING	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
F-1	12" x 12" Cream w/Beige Spots Floor Tile	1,872	SF	Annex Building Throughout 1st and 2nd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
F-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic	1,872	SF	Annex Building Throughout 1st and 2nd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-1	9 "x 9" black VFT	250	SF	Under carpet in principal's and adjoining office- Main building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-2	9"x9" Tan Floor Tile	250	SF	Under Carpet in Principal's and Adjoining Office- Main building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-1	Mastic	250	SF	Under Carpet in Principal's and Adjoining Office- Main building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-2	Mastic	250	SF	Under carpet in Principal's and Adjoining Office- Main building	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Altgeld School & Annex  
 1340 W. 71st St./7007 S. Loomis  
**Address** Blvd (outdated: 1426 W. 71st St.)

**Unit** 22051  
 Chicago, IL, 60636

**Building ID** 2050 & 8708  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
G	Mag Block Pipe Insulation	5	LF	Boiler Room- Main building	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
G-1	12" x 12" Cream w/Beige Spots Floor Tile	2,845	SF	Annex Building Lunchroom and Restroom, Office Restroom, Teachers Restroom, and Room125	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G-2	12" x 12" Cream w/Beige Spots Floor Tile Mastic	2,845	SF	Annex Building Lunchroom and Restroom, Office Restroom, Teachers Restroom, and Room125	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
H	Pipe Fitting Insulation on Mag Block Insulated Piping			Main Building Boiler Room	Assumed	TSI					
J	Mag block ins. on boiler			Boiler room- Main building	Chrysotile	TSI					
K	12"x12" Brown and White Floor Tile	520	SF	Main Office, Restroom, Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
K2	12"x12" Brown and White Floor Tile Mastic	520	SF	Main Office, Restroom, Main Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Altgeld School & Annex  
 1340 W. 71st St./7007 S. Loomis  
**Address** Blvd (outdated: 1426 W. 71st St.)

**Unit** 22051  
 Chicago, IL, 60636

**Building ID** 2050 & 8708  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### Management Planner's Comments Summarized at the End of the Report

Review Date	4/21/2016
Manager Planner Name	Daniel Juneau
100-03613	5/15/2016
Manager IDPH License No/Expiration	

HA Number	Management Comments
01A	
01AA	
01B	
01BB	
01C	
01CC	
01D	
01DD	
02A	If identified, implement O&M
02A1	
02AA	If identified, implement O&M
02AA-1	If identified, implement O&M
02B	If identified, implement O&M
02BB	If identified, implement O&M
02C	If identified, implement O&M
02CC	If identified, implement O&M
02D	If identified, implement O&M
02DD	If identified, implement O&M
02E	If identified, implement O&M
02EE	If identified, implement O&M
03	

# Chicago Public Schools

**School** Altgeld School & Annex  
 1340 W. 71st St./7007 S. Loomis  
**Address** Blvd (outdated: 1426 W. 71st St.)

**Unit** 22051  
 Chicago, IL, 60636

**Building ID** 2050 & 8708  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
04	
04A	
05A	If identified, implement O&M
05AA	If identified, implement O&M
05B	If identified, implement O&M
05BB	If identified, implement O&M
06	
06A	
07	
08	
09	If identified, implement O&M
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
20A	
21	
22	
23	

# Chicago Public Schools

**School** Altgeld School & Annex  
 1340 W. 71st St./7007 S. Loomis  
**Address** Blvd (outdated: 1426 W. 71st St.)

**Unit** 22051  
 Chicago, IL, 60636

**Building ID** 2050 & 8708  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
24	
25	
26	
27	
28	
A-1	
A-2	
B-1	
B-2	
C-1	
C-2	
CM-1	
CM-2	If identified, implement O&M
CM-3	If identified, implement O&M
D	
D-1	
D-2	
E	
E-1	
E-2	
F	
F-1	
F-2	
FT-1	
FT-2	
FTM-1	



# Chicago Public Schools

**School** Altgeld School & Annex  
 1340 W. 71st St./7007 S. Loomis  
**Address** Blvd (outdated: 1426 W. 71st St.)

**Unit** 22051  
 Chicago, IL, 60636

**Building ID** 2050 & 8708  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** Carnow, Conibear and Associates  
 600 West Van Buren St., Ste 500  
 Phone: (312) 762-2900 Fax: (312) 782-5145

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
FTM-2	
G	
G-1	
G-2	
H	If identified, implement O&M
J	If identified, implement O&M
K	
K2	

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01A**  
MATERIAL DESCRIPTION: **12"x 12" Dark Tan Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Office, Restroom, Closet- Main Building**  
MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **01A**  
MATERIAL DESCRIPTION: **12"x 12" Dark Tan Floor Tile**  
MATERIAL LOCATION: **Main Office, Restroom, Closet- Main Building**  
MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

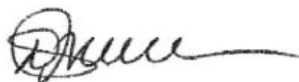

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01AA**  
MATERIAL DESCRIPTION: **12"x 12" Dark Tan Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Office, Restroom and Closet- Main Building**

MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **01AA**  
MATERIAL DESCRIPTION: **12"x 12" Dark Tan Floor Tile Mastic**  
MATERIAL LOCATION: **Main Office, Restroom and Closet- Main Building**  
MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01B**  
MATERIAL DESCRIPTION: **12" x 12" off white VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main office, restroom and closet- main building**  
MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **01B**  
MATERIAL DESCRIPTION: **12" x 12" off white VFT**  
MATERIAL LOCATION: **Main office, restroom and closet- main building**  
MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

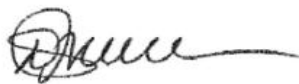

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01BB**  
MATERIAL DESCRIPTION: **12"x 12" Off- White Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Main Office, Restroom and Closet- Main Building**

MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **01BB**  
MATERIAL DESCRIPTION: **12"x 12" Off- White Floor Tile Mastic**  
MATERIAL LOCATION: **Main Office, Restroom and Closet- Main Building**  
MATERIAL QUANTITY: **225** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

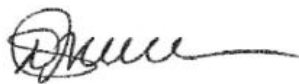

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01C**  
MATERIAL DESCRIPTION: **12"x 12" Tan Specklled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Main building-Entry to Girls/Boys Restroom 1st Floor; 1st Floor and 2nd Floor Teachers' Restrooms**

MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **01C**  
MATERIAL DESCRIPTION: **12"x 12" Tan Specklled Floor Tile**  
MATERIAL LOCATION: **Main building-Entry to Girls/Boys Restroom 1st Floor; 1st Floor and 2nd Floor Teachers' Restrooms**  
MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01CC**  
MATERIAL DESCRIPTION: **12"x 12" Tan Speckled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Main building- Entry to Girls/Boys restroom 1st Floor; 1st Floor and 2nd Floor Teachers' Restrooms**

MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **01CC**  
MATERIAL DESCRIPTION: **12"x 12" Tan Speckled Floor Tile Mastic**  
MATERIAL LOCATION: **Main building- Entry to Girls/Boys restroom 1st Floor; 1st Floor and 2nd Floor Teachers' Restrooms**  
MATERIAL QUANTITY: **240** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

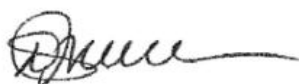

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01D**  
MATERIAL DESCRIPTION: **12"x 12" tan streaked VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Annex building room 120**  
MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **01D**  
MATERIAL DESCRIPTION: **12"x 12" tan streaked VFT**  
MATERIAL LOCATION: **Annex building room 120**  
MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

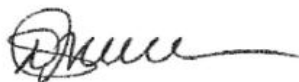

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01DD**  
MATERIAL DESCRIPTION: **12"x 12" Tan Streaked Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Annex building room 120**  
MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **01DD**  
MATERIAL DESCRIPTION: **12"x 12" Tan Streaked Floor Tile Mastic**  
MATERIAL LOCATION: **Annex building room 120**  
MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

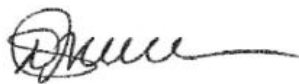

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02A**  
MATERIAL DESCRIPTION: **9"x9" Gray w/White Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **ANNEX- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature:



Date: **03/15/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02A**  
MATERIAL DESCRIPTION: **9"x9" Gray w/White Streaks Floor Tile**  
MATERIAL LOCATION: **ANNEX- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

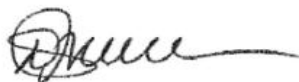

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02A1**  
MATERIAL DESCRIPTION: **9"x 9" Tan Speckled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building Library (carpeted) and Library Office**

MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02A1**  
MATERIAL DESCRIPTION: **9"x 9" Tan Speckled Floor Tile**  
MATERIAL LOCATION: **Main Building Library (carpeted) and Library Office**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02AA**  
MATERIAL DESCRIPTION: **9"x9" Gray w/White Streaks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **ANNEX- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature:



Date: **03/15/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02AA**  
MATERIAL DESCRIPTION: **9"x9" Gray w/White Streaks Floor Tile Mastic**  
MATERIAL LOCATION: **ANNEX- Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, Engineer's Office and Washroom**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

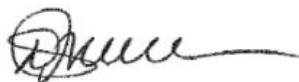

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02AA-1**  
MATERIAL DESCRIPTION: **9"x9 " Tan Speckled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineers Office, Library and Library Office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02AA-1**  
MATERIAL DESCRIPTION: **9"x9 " Tan Speckled Floor Tile**  
MATERIAL LOCATION: **Engineers Office, Library and Library Office**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

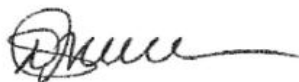

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02B**  
MATERIAL DESCRIPTION: **9"x9" Tan w/Streaks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex building Principal's Office and Classrooms 124, 223, 220, 229**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02B**  
MATERIAL DESCRIPTION: **9"x9" Tan w/Streaks Floor Tile**  
MATERIAL LOCATION: **Annex building Principal's Office and Classrooms 124, 223, 220, 229**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

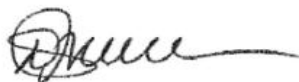

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02BB**  
MATERIAL DESCRIPTION: **9"x9" Tan w/Streaks Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Annex building Principal's Office and Classrooms 124, 223, 220, and 229**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02BB**  
MATERIAL DESCRIPTION: **9"x9" Tan w/Streaks Floor Tile Mastic**  
MATERIAL LOCATION: **Annex building Principal's Office and Classrooms 124, 223, 220, and 229**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

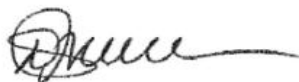

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02C**  
MATERIAL DESCRIPTION: **9"x9" Off-White Floor Tile; Walk-in freezer had 9x9 removed inadvertently, now 12x12 freezer**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: **03/15/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02C**  
MATERIAL DESCRIPTION: **9"x9" Off-White Floor Tile; Walk-in freezer had 9x9 removed inadvertently, now 12x12 freezer**  
MATERIAL LOCATION: **Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

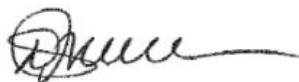

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02CC**  
MATERIAL DESCRIPTION: **9"x9" Off-White Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature:



Date: **03/15/2016**



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02CC**  
MATERIAL DESCRIPTION: **9"x9" Off-White Floor Tile Mastic**  
MATERIAL LOCATION: **Annex Building- Lunchroom and Restroom, Office Restroom, Teacher Restroom, and Room 125**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

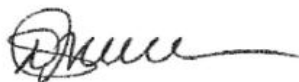

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02D**  
MATERIAL DESCRIPTION: **9"x9 " Olive Green Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Annex building Throughout 1st and 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02D**  
MATERIAL DESCRIPTION: **9"x9 " Olive Green Floor Tile**  
MATERIAL LOCATION: **Annex building Throughout 1st and 2nd Floor Corridors**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

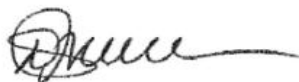

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02DD**  
MATERIAL DESCRIPTION: **9"x9" Olive Green Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Annex building- throughout 1st and 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02DD**  
MATERIAL DESCRIPTION: **9"x9" Olive Green Floor Tile**  
MATERIAL LOCATION: **Annex building- throughout 1st and 2nd Floor Corridors**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

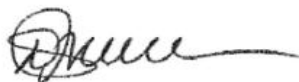

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02E**  
MATERIAL DESCRIPTION: **9"x9" Off-White w/Specks Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Annex Building- Throughout 1st and 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02E**  
MATERIAL DESCRIPTION: **9"x9" Off-White w/Specks Floor Tile**  
MATERIAL LOCATION: **Annex Building- Throughout 1st and 2nd Floor Corridors**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

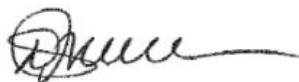

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02EE**  
MATERIAL DESCRIPTION: **9"x9" Off-White Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Annex building- Throughout 1st and 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **02EE**  
MATERIAL DESCRIPTION: **9"x9" Off-White Floor Tile Mastic**  
MATERIAL LOCATION: **Annex building- Throughout 1st and 2nd Floor Corridors**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

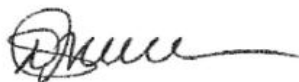

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**  
MATERIAL DESCRIPTION: **Hard Coat Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **120000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

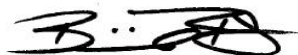

Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **03**  
MATERIAL DESCRIPTION: **Hard Coat Plaster**  
MATERIAL LOCATION: **Throughout Main Building**  
MATERIAL QUANTITY: **120000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

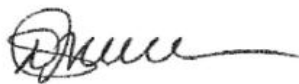

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**  
MATERIAL DESCRIPTION: **Burlap on Walls**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Library, Third Floor Teacher's Room, and Classrooms: 101, 104, 203, 206, 301, 302, 303, 305, 306, 307, 308, and 309**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **04**  
MATERIAL DESCRIPTION: **Burlap on Walls**  
MATERIAL LOCATION: **Library, Third Floor Teacher's Room, and Classrooms: 101, 104, 203, 206, 301, 302, 303, 305, 306, 307, 308, and 309**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04A**  
MATERIAL DESCRIPTION: **Burlap Wall Covering**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Office**

MATERIAL QUANTITY: **100**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **04A**  
MATERIAL DESCRIPTION: **Burlap Wall Covering**  
MATERIAL LOCATION: **Annex Office**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

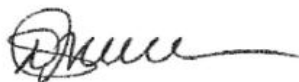

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05A**  
MATERIAL DESCRIPTION: **Green Linoleum - Removed floor contains wood**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 101- Main Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **05A**  
MATERIAL DESCRIPTION: **Green Linoleum - Removed floor contains wood**  
MATERIAL LOCATION: **Room 101- Main Building**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

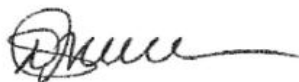

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05AA**  
MATERIAL DESCRIPTION: **Mastic Beneath Green Linoleum - Wood floors only**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 101- Main Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **05AA**  
MATERIAL DESCRIPTION: **Mastic Beneath Green Linoleum - Wood floors only**  
MATERIAL LOCATION: **Room 101- Main Building**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05B**  
MATERIAL DESCRIPTION: **Tan Linoleum only wood floors**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Building Room 203 and Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature:



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **05B**  
MATERIAL DESCRIPTION: **Tan Linoleum only wood floors**  
MATERIAL LOCATION: **Main Building Room 203 and Storage**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

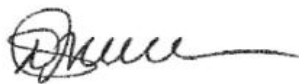

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05BB**  
MATERIAL DESCRIPTION: **Mastic Beneath Tan Linoleum - Wood floors only**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 203 and Main Building Storage Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **05BB**  
MATERIAL DESCRIPTION: **Mastic Beneath Tan Linoleum - Wood floors only**  
MATERIAL LOCATION: **Room 203 and Main Building Storage Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

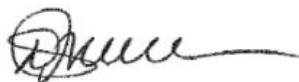

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **1'x1' Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building Room 202**

MATERIAL QUANTITY: **900**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

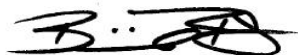

Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **1'x1' Ceiling Tile**  
MATERIAL LOCATION: **Main Building Room 202**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

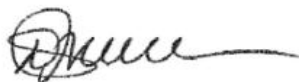

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **1'x1' Ceiling Tile Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Building Room 202**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

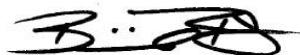

Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **1'x1' Ceiling Tile Adhesive**  
MATERIAL LOCATION: **Main Building Room 202**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

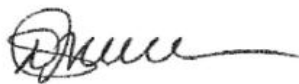

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: Chicago Public Schools UNIT NUMBER: 22051 BUIDLING ID: 2050 & 8708  
CITY/STATE: Chicago, Illinois AHERA INSPECTOR: Beinville Brooks  
SCHOOL NAME: Altgeld School & Annex INSPECTION DATE: 3/15/2016  
ADDRESS: 1340 W. 71st St./7007 S. Loomis Blvd IDPH LICENSE NO: 100-10882  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: 07  
MATERIAL DESCRIPTION: 2'x4' Wormy Patterned Lay In Ceiling Panels  
HISTORICAL AHERA DAMAGE CATEGORY 7 ACBM with the potential for damage  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: Follow O&M Plan  
ASBESTOS TYPE: Assumed FRIABLE: Yes

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 7. Any remaining friable ACBM or friable suspect ACBM

DAMAGE REASON:

DISTURBANCE POTENTIAL: LOW  
MATERIAL LOCATION: Main Building Lunchroom  
MATERIAL QUANTITY: 12 MATERIAL UNITS: SF  
DAMAGE QUANTITY: DAMAGE UNITS: SF  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **07**  
MATERIAL DESCRIPTION: **2'x4' Wormy Patterned Lay In Ceiling Panels**  
MATERIAL LOCATION: **Main Building Lunchroom**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **2'x4' Perferated Lay In Ceiling Panels**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Building Kitchen**  
MATERIAL QUANTITY: **525** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **2'x4' Perferated Lay In Ceiling Panels**  
MATERIAL LOCATION: **Main Building Kitchen**  
MATERIAL QUANTITY: **525** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

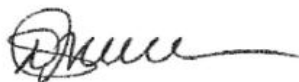

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **Spray On Fireproofing**  
HISTORICAL AHERA DAMAGE CATEGORY **Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Annex**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **09**  
MATERIAL DESCRIPTION: **Spray On Fireproofing**  
MATERIAL LOCATION: **Throughout Annex**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

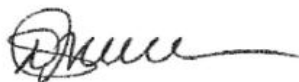

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Ceiling Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Annex Washrooms**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

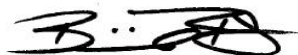

Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Ceiling Plaster**  
MATERIAL LOCATION: **Annex Washrooms**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

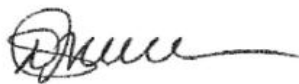

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **Troweled On Ceiling Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Annex Mechanical Areas and Janitor Closets**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **Troweled On Ceiling Plaster**  
MATERIAL LOCATION: **Throughout Annex Mechanical Areas and Janitor Closets**  
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Building Basement**  
MATERIAL QUANTITY: **410** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Main Building Basement**  
MATERIAL QUANTITY: **410** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

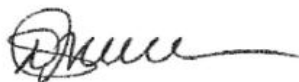

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **Sink Undercoat**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building Library Office**

MATERIAL QUANTITY: **3**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

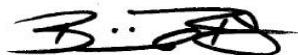

Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **Sink Undercoat**  
MATERIAL LOCATION: **Main Building Library Office**  
MATERIAL QUANTITY: **3** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

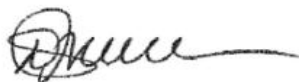

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **Sink Undercoat**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Classrooms 120, 124, and 125**

MATERIAL QUANTITY: **9**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **Sink Undercoat**  
MATERIAL LOCATION: **Annex Classrooms 120, 124, and 125**  
MATERIAL QUANTITY: **9** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

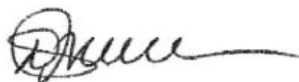

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **Ceramic Tile Floor Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building: Girl's and Boy's Washrooms**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **Ceramic Tile Floor Tile Grout**  
MATERIAL LOCATION: **Main Building: Girl's and Boy's Washrooms**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Ceramic Floor Tile Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Main Building: Girl's and Boy's Washrooms**

MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

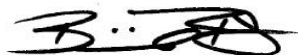

Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Ceramic Floor Tile Adhesive**  
MATERIAL LOCATION: **Main Building: Girl's and Boy's Washrooms**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

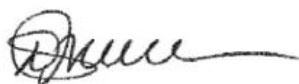

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Ceramic Floor Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Annex Building: Girl's and Boy's Washrooms**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Ceramic Floor Tile Grout**  
MATERIAL LOCATION: **Annex Building: Girl's and Boy's Washrooms**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

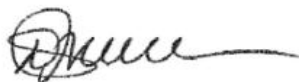

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Ceramic Floor Tile Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building: Girl's and Boy's Washrooms**

MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Ceramic Floor Tile Adhesive**  
MATERIAL LOCATION: **Annex Building: Girl's and Boy's Washrooms**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

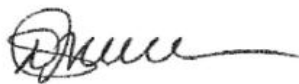

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Insulation Inside of Vault Door**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Annex: Main Office and Second Floor Corridor**  
MATERIAL QUANTITY: **56** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Insulation Inside of Vault Door**  
MATERIAL LOCATION: **Annex: Main Office and Second Floor Corridor**  
MATERIAL QUANTITY: **56** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

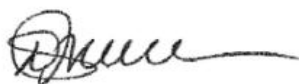

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Insulation Inside of Fire Rated Doors**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Annex Entrances and Speech Room**  
MATERIAL QUANTITY: **102** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Insulation Inside of Fire Rated Doors**  
MATERIAL LOCATION: **Annex Entrances and Speech Room**  
MATERIAL QUANTITY: **102** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

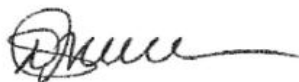

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20A**  
MATERIAL DESCRIPTION: **Insulation Inside of Fire Rated Doors**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Building Entrances**  
MATERIAL QUANTITY: **204** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **20A**  
MATERIAL DESCRIPTION: **Insulation Inside of Fire Rated Doors**  
MATERIAL LOCATION: **Main Building Entrances**  
MATERIAL QUANTITY: **204** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

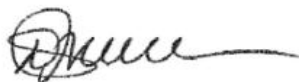

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Chalkboards**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building Classrooms**

MATERIAL QUANTITY: **2500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Chalkboards**  
MATERIAL LOCATION: **Main Building Classrooms**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

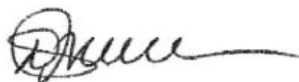

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **Chalkboard Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Building Classrooms**

MATERIAL QUANTITY: **2500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **Chalkboard Adhesive**  
MATERIAL LOCATION: **Main Building Classrooms**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **Chalkboards**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Classrooms**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **Chalkboards**  
MATERIAL LOCATION: **Annex Classrooms**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

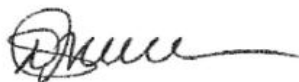

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Chalkboard Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Annex Classrooms**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Chalkboard Adhesive**  
MATERIAL LOCATION: **Annex Classrooms**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

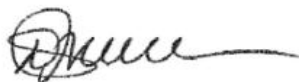

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Terrazzo**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Stairways and Foyer**

MATERIAL QUANTITY: **600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Terrazzo**  
MATERIAL LOCATION: **Annex Stairways and Foyer**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **2'x4' Lay In Ceiling Panels**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Annex Classrooms, Corridors and Offices**  
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **2'x4' Lay In Ceiling Panels**  
MATERIAL LOCATION: **Annex Classrooms, Corridors and Offices**  
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **Linoleum on Shelves**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Annex Classrooms and Assistant Principal's Office**  
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

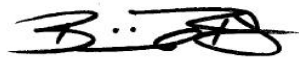

Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **Linoleum on Shelves**  
MATERIAL LOCATION: **Annex Classrooms and Assistant Principal's Office**  
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

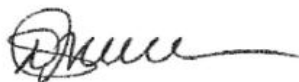

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **Linoleum Adhesive on Shelves**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Classrooms and Assistant Principal's Office**

MATERIAL QUANTITY: **1650**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **Linoleum Adhesive on Shelves**  
MATERIAL LOCATION: **Annex Classrooms and Assistant Principal's Office**  
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

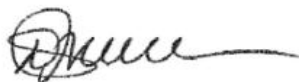

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A-1**  
MATERIAL DESCRIPTION: **12"x12" Cream w/Beige Spots Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Annex Building Principal's Office and Classrooms 124, 223, 220, and 229**  
MATERIAL QUANTITY: **4705** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

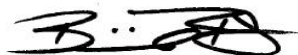

Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **A-1**  
MATERIAL DESCRIPTION: **12"x12" Cream w/Beige Spots Floor Tile**  
MATERIAL LOCATION: **Annex Building Principal's Office and Classrooms 124, 223, 220, and 229**  
MATERIAL QUANTITY: **4705** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

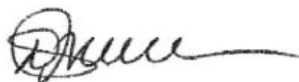

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A-2**  
MATERIAL DESCRIPTION: **12"x12" Cream w/Beige Spots Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Annex Building Principal's Office and Classrooms 124, 223, 220, and 229**

MATERIAL QUANTITY: **4705** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

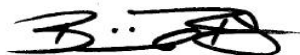

Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **A-2**  
MATERIAL DESCRIPTION: **12"x12" Cream w/Beige Spots Floor Tile Mastic**  
MATERIAL LOCATION: **Annex Building Principal's Office and Classrooms 124, 223, 220, and 229**  
MATERIAL QUANTITY: **4705** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

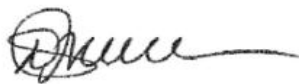

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B-1**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **ANNEX Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom**

MATERIAL QUANTITY: **6040** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **B-1**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile**  
MATERIAL LOCATION: **ANNEX Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom**  
MATERIAL QUANTITY: **6040** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

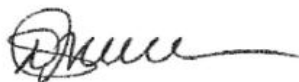

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **ANNEX Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom**

MATERIAL QUANTITY: **6040**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **B-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic**  
MATERIAL LOCATION: **ANNEX Rooms 227, 230, 126, 123, 226, 221, Office, Store Room, Vault, Boiler Room, and Restroom**  
MATERIAL QUANTITY: **6040** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

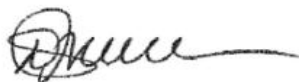

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C-1**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **ANNEX Building Throughout 1st and 2nd Floor Corridors**

MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **C-1**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile**  
MATERIAL LOCATION: **ANNEX Building Throughout 1st and 2nd Floor Corridors**  
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

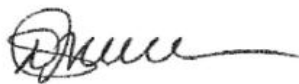

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **ANNEX Building Throughout 1st and 2nd Floor Corridors**  
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **C-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic**  
MATERIAL LOCATION: **ANNEX Building Throughout 1st and 2nd Floor Corridors**  
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

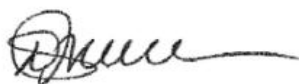

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-1**  
MATERIAL DESCRIPTION: **Tan Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Principal's office and Adjustment Center- Main building**

MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

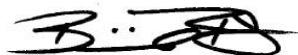

Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **CM-1**  
MATERIAL DESCRIPTION: **Tan Carpet Mastic**  
MATERIAL LOCATION: **Principal's office and Adjustment Center- Main building**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

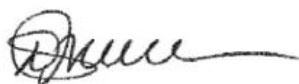

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-2**  
MATERIAL DESCRIPTION: **Green Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:


MATERIAL LOCATION: **Room 202- Main building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature:



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **CM-2**  
MATERIAL DESCRIPTION: **Green Carpet Mastic**  
MATERIAL LOCATION: **Room 202- Main building**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

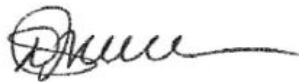

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-3**  
MATERIAL DESCRIPTION: **Blue Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Building Classrooms 201 and 202**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **CM-3**  
MATERIAL DESCRIPTION: **Blue Carpet Adhesive**  
MATERIAL LOCATION: **Main Building Classrooms 201 and 202**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

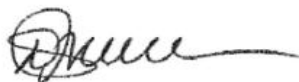

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Pipe Joint Insulation on Cardboard Insulated Piping**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Building Basement**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Pipe Joint Insulation on Cardboard Insulated Piping**  
MATERIAL LOCATION: **Main Building Basement**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

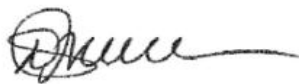

Date: **04/21/2016**

# Chicago Public Schools

## Carnow, Conibear and Associates 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D-1**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Annex Building Room 120**  
MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

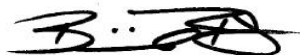

Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **D-1**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile**  
MATERIAL LOCATION: **Annex Building Room 120**  
MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

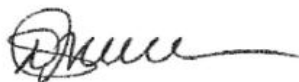

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building Room 120**

MATERIAL QUANTITY: **1320**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

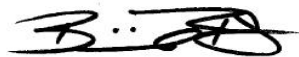

Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **D-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic**  
MATERIAL LOCATION: **Annex Building Room 120**  
MATERIAL QUANTITY: **1320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

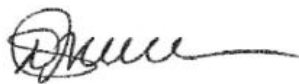

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room in Main Building**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_

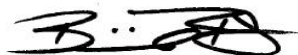

Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **Boiler Room in Main Building**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

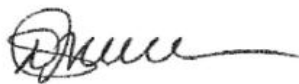

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E-1**  
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile (114) Removed Engineer's Room; 9x9 Floor Tile Library**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Engineers Office and Main Building Library 9x9 FI Tile - Library**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **E-1**  
MATERIAL DESCRIPTION: **12x12 Cream w/Beige Spots Floor Tile (114) Removed Engineer's Room; 9x9 Floor Tile Library**  
MATERIAL LOCATION: **Engineers Office and Main Building Library 9x9 FI Tile - Library**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Engineers Office and Main Building Library**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **E-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic (114) Library 9x9 Lodr @ 02A1**  
MATERIAL LOCATION: **Engineers Office and Main Building Library**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

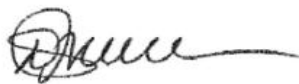

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Pipe Fitting Insulation on Aircell Insulated Piping**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room- Main building**  
MATERIAL QUANTITY: **3** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Pipe Fitting Insulation on Aircell Insulated Piping**  
MATERIAL LOCATION: **Boiler Room- Main building**  
MATERIAL QUANTITY: **3** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

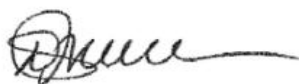

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F-1**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Annex Building Throughout 1st and 2nd Floor Corridors**

MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **F-1**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile**  
MATERIAL LOCATION: **Annex Building Throughout 1st and 2nd Floor Corridors**  
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

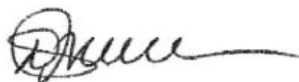

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Annex Building Throughout 1st and 2nd Floor Corridors**  
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **F-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic**  
MATERIAL LOCATION: **Annex Building Throughout 1st and 2nd Floor Corridors**  
MATERIAL QUANTITY: **1872** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

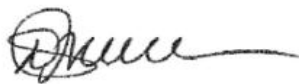

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-1**  
MATERIAL DESCRIPTION: **9 "x 9" black VFT**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT


This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Under carpet in principal's and adjoining office- Main building**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **FT-1**  
MATERIAL DESCRIPTION: **9 "x 9" black VFT**  
MATERIAL LOCATION: **Under carpet in principal's and adjoining office- Main building**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

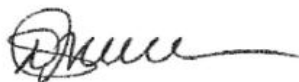

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-2**  
MATERIAL DESCRIPTION: **9"x9" Tan Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Under Carpet in Principal's and Adjoining Office- Main building**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **FT-2**  
MATERIAL DESCRIPTION: **9"x9" Tan Floor Tile**  
MATERIAL LOCATION: **Under Carpet in Principal's and Adjoining Office- Main building**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

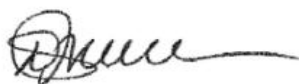

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-1**  
MATERIAL DESCRIPTION: **Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Under Carpet in Principal's and Adjoining Office- Main building**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **FTM-1**  
MATERIAL DESCRIPTION: **Mastic**  
MATERIAL LOCATION: **Under Carpet in Principal's and Adjoining Office- Main building**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

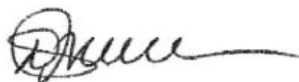

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-2**  
MATERIAL DESCRIPTION: **Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**


MATERIAL LOCATION: **Under carpet in Principal's and Adjoining Office- Main building**

MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

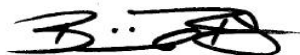

Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **FTM-2**  
MATERIAL DESCRIPTION: **Mastic**  
MATERIAL LOCATION: **Under carpet in Principal's and Adjoining Office- Main building**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

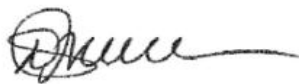

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
**(outdated: 1426 W. 71st St.)**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room- Main building**  
MATERIAL QUANTITY: **5** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**  
MATERIAL LOCATION: **Boiler Room- Main building**  
MATERIAL QUANTITY: **5** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

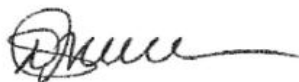

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G-1**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building Lunchroom and Restroom, Office Restroom, Teachers Restroom, and Room125**

MATERIAL QUANTITY: **2845** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **G-1**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile**  
MATERIAL LOCATION: **Annex Building Lunchroom and Restroom, Office Restroom, Teachers Restroom, and Room125**  
MATERIAL QUANTITY: **2845** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

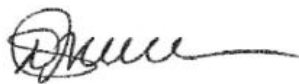

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Annex Building Lunchroom and Restroom, Office Restroom, Teachers Restroom, and Room125**

MATERIAL QUANTITY: **2845** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **G-2**  
MATERIAL DESCRIPTION: **12" x 12" Cream w/Beige Spots Floor Tile Mastic**  
MATERIAL LOCATION: **Annex Building Lunchroom and Restroom, Office Restroom, Teachers Restroom, and Room125**  
MATERIAL QUANTITY: **2845** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

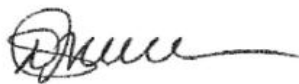

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Pipe Fitting Insulation on Mag Block Insulated Piping**  
HISTORICAL AHERA DAMAGE CATEGORY: **Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Main Building Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature:



Date: **03/15/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Pipe Fitting Insulation on Mag Block Insulated Piping**  
MATERIAL LOCATION: **Main Building Boiler Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

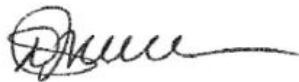

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **Mag block ins. on boiler**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room- Main building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUILDING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **Mag block ins. on boiler**  
MATERIAL LOCATION: **Boiler room- Main building**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified, implement O&M

Management Planner's Signature: \_\_\_\_\_

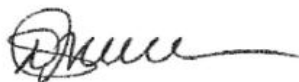

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **12"x12" Brown and White Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Office, Restroom, Main Building**

MATERIAL QUANTITY: **520**


MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016



# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **12"x12" Brown and White Floor Tile**  
MATERIAL LOCATION: **Main Office, Restroom, Main Building**  
MATERIAL QUANTITY: **520** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

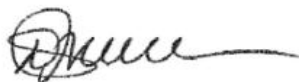

Date: **04/21/2016**

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Beinville Brooks**  
SCHOOL NAME: **Altgeld School & Annex** INSPECTION DATE: **3/15/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd** IDPH LICENSE NO: **100-10882**  
(outdated: 1426 W. 71st St.)

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K2**  
MATERIAL DESCRIPTION: **12"x12" Brown and White Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Office, Restroom, Main Building**

MATERIAL QUANTITY: **520**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 03/15/2016

# Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22051** BUIDLING ID: **2050 & 8708**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**  
SCHOOL NAME: **Altgeld School & Annex** REVIEW DATE: **4/21/2016**  
ADDRESS: **1340 W. 71st St./7007 S. Loomis Blvd (outdated: 1426 W. 71st St.)** IDPH LICENSE NO: **100-10882**

---

HOMOGENEOUS AREA: **K2**  
MATERIAL DESCRIPTION: **12"x12" Brown and White Floor Tile Mastic**  
MATERIAL LOCATION: **Main Office, Restroom, Main Building**  
MATERIAL QUANTITY: **520** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

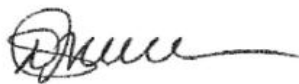

Date: **04/21/2016**

# **Chicago Public Schools**

**Carnow, Conibear and Associates**

***2016 AHERA REINSPECTION***

# APPENDIX B

## Inspector and Management Planner Licenses

---



**ASBESTOS  
PROFESSIONAL  
LICENSE**

ID NUMBER                      ISSUED                      EXPIRES  
**100 - 10882**                      **3/11/2015**                      **05/15/2016**

BEINVILLE S BROOKS  
PO BOX 1373  
CALUMET, IL 60409

Environmental Health



**ENDORSEMENTS**

SUPERVISOR/WORKER  
INSPECTOR

**TC EXPIRES**

1/30/2016  
2/14/2016

PROJECT MANAGER  
AIR SAMPLING PROFESSIONAL

1/30/2016

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health

This license is valid only when accompanied by a valid  
training course certificate.

# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that BENVILLE BROOKS  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 01/06/2016 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

01/06/2016  
Course Dates:  
01/06/2017  
Expires:  
1601BIR01  
Certificate Number:



*M. Deery*

Director of Training  
Nicholas J. Penell  
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

2016



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Daniel Juneau**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/6/2016

Exam Date: 1/6/2016

Expiration Date: 1/6/2017

Certificate Number: MPR1601060038

  
\_\_\_\_\_  
Kathy DeSalvo, Director



# Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,  
Project Manager, and Air Sampling Professional



## ASBESTOS PROFESSIONAL LICENSE

ID NUMBER  
**100 - 03613**

ISSUED  
**3/16/2015**

EXPIRES  
**05/15/2016**

DANIEL J JUNEAU  
1408 OAKWOOD AVENUE  
DES PLAINES, IL 60016

Environmental Health



### ENDORSEMENTS

### TC EXPIRES

INSPECTOR

12/2/2015

MANAGEMENT PLANNER

1/20/2016

PROJECT MANAGER

12/11/2015

AIR SAMPLING PROFESSIONAL

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health

This license is valid only when accompanied by a valid  
training course certificate.

**CARNOW  
CONIBEAR**

2015



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Daniel Juneau**


has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024163

  
Kathy DeSalvo, Director

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed