

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2213  
SCHOOL NAME: Gallistel Language Academy  
ADDRESS OF SCHOOL: 10347 S. Ewing  
CITY: Chicago, IL, 60617

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/19/2013**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 8/11/2016 ENROLLMENT 892  
IDPH INSPECTOR LICENSE NUMBER: 100-19039  
IDPH LICENSED INSPECTOR NAME (Please Print): Wayne Gardner  
IDPH MP LICENSE NUMBER: 100-07342  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Jigar Shah

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



8/11/2016

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

---

---

---

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Gallistel Language Academy**

10347 S. Ewing  
Chicago, IL, 60617

Unit: 29091  
Building ID: 3490

IDPH ID Number: 14-016-2990-2213

**REPORT DATE:**

Thursday, August 11, 2016

**Prepared for:**

**Chicago Public Schools  
125 S. Clark Street  
Chicago, IL 60603**

**Prepared by:**

**GSG Consultants, Inc.**

855 W. Adams St., Ste. 200

Phone (312) 733-6262

Fax (312) 733-5612

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

April 12, 2016

Mr. R. Kent Cook  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

GSG Consultants, Inc., Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 1,2,6 Elementary Schools. Please update your records with the following information.

School District: 299                      Unit: 29091                      Region: 06                      IDPH ID: 14-016-2990-2213

School: Gallistel Language Academy                      Building ID: 3490

Address: 10347 S. Ewing

Chicago, IL, 60617

Building Contact: Guerrero, Ruben

Contact Phone: 7735356544

Current Building Owners: Chicago Public Schools

Review Date: 08/04/2016

Inspector: Wayne Gardner

Inspector IDPH License: 100-19039

Management Planner: Jigar Shah

Management Planner IDPH License: 100-07342

If you have any questions or comments, please contact us at (312) 733-6262

Sincerely,  
GSG Consultants, Inc.



Jigar Shah  
100-07342

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: April 12, 2016

RE: Gallistel Language Academy, Unit 29091  
10347 S. Ewing  
Chicago, IL, 60617

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Gallistel Language Academy , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Gallistel Language Academy, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Gallistel Language Academy  
Address: 10347 S. Ewing  
IDPH ID: 14-016-2990-2213  
Contact: Guerrero, Ruben

Unit: 29091  
Chicago, IL, 60617  
Building ID: 3490  
Phone: 7735356544

Region: 06

### 2. Description of Facility

Original Construction: 1913  
Total Square Footage: 25960  
Current Occupancy: 892

Additional Construction: 1910,1897  
No of Floors: 2

### 3. LEA Designated Person

Contact: Robert Christlieb  
Address: 125 South Clark Street, 17th Floor  
Chicago, IL 60603

Phone: (773) 553-3197

### 4. Managing Environmental Consultant


MEC: GSG Consultants, Inc.  
Contact: Arturo Saenz  
Address 855 W. Adams St., Ste. 200  
Phone: (312) 733-6262

Fax: (312) 733-5612

### 5. Inspector

Inspector Name: Wayne Gardner


Inspector IDPH license # 100-19039

Signature:   
Date: 4/12/2016

### 6. Management Planner

Management Planner Name: Jigar Shah


Management Planner IDPH license # 100-07342

Signature:   
Date: 08/04/2016

### 7. Review Date: 08/04/2016

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 8/11/2016

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

GSG Consultants, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Gallistel Language Academy. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3490:

- |   |                           |
|---|---------------------------|
| I | Cardboard Pipe Insulation |
| N | Aircell Pipe Insulation   |

B. The following new homogenous areas have been identified for Building 3490:



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01	Plaster
07B	Green Linoleum
08	Insulation in Hatch Door to the Attic
12B	12"x12" Taupe Floor Tile Mastic
12C	12"x12" Cream Floor Tile Mastic
14B	9"x9" Green Floor Tile Mastic
14C	9"X9" Gray Floor Tile Mastic
15B	Green Linoleum Mastic
16	Brown Vinyl Baseboard
17	Dark Gray Vinyl Baseboard
18	Brown Vinyl Baseboard Mastic
19	Dark Gray Vinyl Baseboard Mastic
20	Drywall
21	Drywall
22	Drywall Compound
23	Drywall Compound
24	Interior Window Glazing
25	Interior Window Caulking
26	Gray Vinyl Baseboard
27	Gray Vinyl Baseboard mastic
28	Interior Window Glazing
30	Drywall
31	Drywall Compound
32	Textured Acoustical Ceiling Tiles
33	12"x12" Pink Floor Tile
34	12"x12" Pink Floor Tile Mastic
35	Off White Vinyl Baseboard
36	White Vinyl Baseboard Mastic
37	2'x4' Fissure Ceiling Tile
45	12x12 white w/specs Floor Tile
45A	12x12 white w/specks floor tile mastic
46	Crème linoleum sheet flooring
47	2' x 2' acoustical ceiling tile
48	2 x 4 Smooth Ceiling Tile
49	Blue Ceramic Tile Grout
50	Blue Ceramic Tile Adhesive
51	Red Ceramic Tile Grout
52	Red Ceramic Tile Adhesive
53	Brown Carpet Adhesive
54	Beige Carpet Adhesive
55	12 x 12 Black with White Specs Vinyl Floor Tile
55M	12 x 12 Black with White Specs Vinyl Floor Tile

	Mastic
56	Purple Carpet Adhesive
57	Red Carpet Adhesive
58	Brown Ceramic Tile Grout
59	Brown Ceramic Tile Adhesive
60	Brown Mosaic Ceramic Tile Grout
61	Brown Mosaic Ceramic Tile Adhesive
62	12 x 12 Light Blue Floor Tile
62M	12 x 12 Light Blue Floor Tile Mastic
63	Brown Carpet Mastic
64	Multi-Colored Carpet Mastic

The following areas were deemed to be inaccessible:

08	Insulation in Hatch Door to the Attic
11A	12"x12" Taupe Floor Tile Mastic
12A	12"x12" Light Brown Floor Tile Mastic
12B	12"x12" Taupe Floor Tile Mastic
12C	12"x12" Cream Floor Tile Mastic
13A	9"x9" Tan Speckled Floor Tile Mastic
14B	9"x9" Green Floor Tile Mastic
14C	9"x9" Gray Floor Tile Mastic
14D	9"x9" Tan Speckled Floor Tile Mastic
15B	Green Linoleum Mastic
18	Brown Vinyl Baseboard Mastic
19	Dark Gray Vinyl Baseboard Mastic
27	Gray Vinyl Baseboard mastic
34	12"x12" Pink Floor Tile Mastic
36	White Vinyl Baseboard Mastic
47	2' x 2' acoustical ceiling tile
50	Blue Ceramic Tile Adhesive
53	Brown Carpet Adhesive
54	Beige Carpet Adhesive
55M	12 x 12 Black with White Specs Vinyl Floor Tile Mastic
56	Purple Carpet Adhesive
57	Red Carpet Adhesive
59	Brown Ceramic Tile Adhesive
61	Brown Mosaic Ceramic Tile Adhesive
62M	12 x 12 Light Blue Floor Tile Mastic
63	Brown Carpet Mastic
A	Boiler Insulation
D	Aircell Elbow Insulation
G	Aircell Pipe Insulation
H	Magblock Pipe Insulation
I	Cardboard Pipe Insulation

J	Magblock Elbow Insulation
O	Magblock Pipe Insulation
Q	Magblock Elbow Insulation

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Wayne Gardner , IDPH License # 100-19039. The Management Plan was updated by Jigar Shah, IDPH License # 100-07342. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Gallistel Language Academy Building 3490 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Gallistel Language Academy Unit 29091 Building ID 3490

Address 10347 S. Ewing Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	Plaster	30,000	SF	Throughout Building	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
05A	12"x12" Taupe Floor Tile	2,160	SF	1897 Building 1st Corridor, Room 109, Teacher's Lounge and Teacher's Washroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
05B	12"x12" Cream Floor Tile	2,160	SF	1897 Building 1st Corridor, Room 109, Teacher's Lounge and Teacher's Washroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
05C	12"x12" Light Brown Floor Tile	1,040	SF	1897 Building: Lounge, Storage, Room 104, and Band Room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
05D	12"x12" Beige Floor Tile w/ White Streaks (NOT OBSERVED)			1897 Building: Engineer's Office, Office and Washroom NOT OBSERVED		MISC								
06A	9"x9" Beige Floor Tile (NOT OBSERVED)			1897 Building: Room 306 NOT OBSERVED		MISC								
06B	9"x9" Green Floor Tile	90	SF	1897 Building: Room 304 Wardrobe	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
06C	9"x9" Gray Floor Tile	90	SF	1897 Building: Room 304 Wardrobe	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
06D	9"x9" Tan Floor Tile w/ Specks	780	SF	1897 Building: Room 108	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
07A	Brown Linoleum (NOT OBSERVED)			1897 Building: Asst. Principal's Office NOT OBSERVED		MISC								
07B	Green Linoleum	980	SF	1897 Building: Room 205 (under carpet)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
08	Insulation in Hatch Door to the Attic	2	SF	1909 Addition	ASSUMED	TSI	N	NONE	0		No	ACBM with the potential for damage		LOW
09A	12"x12" Light Brown Floor Tile	900	SF	1909 Addition: Room 303 and Wardrobe	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
09B	12"x12" Taupe Floor Tile	952	SF	1909 Addition: 1st Floor Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
09C	12"x12" Cream Floor Tile	752	SF	1909 Addition: 1st	CHR	MISC	N	NONE	0		No	ACBM with the		MODERATE



# Chicago Public Schools

School Gallistel Language Academy Unit 29091 Building ID 3490

Address 10347 S. Ewing Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	OBSERVED)			Principal's Office NOT OBSERVED										
15B	Green Linoleum Mastic	980	SF	1897 Building: Room 205 (covered)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	Brown Vinyl Baseboard	264	LF	1897 Building: Room 104	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	Dark Gray Vinyl Baseboard	188	LF	1897 Building: Engineer's Office & Bathroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18	Brown Vinyl Baseboard Mastic	264	LF	1897 Building: Room 104	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	Dark Gray Vinyl Baseboard Mastic	188	LF	1897 Building: Engineer's Office and Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	Drywall	656	SF	1897 Building: 1st Floor Room 104	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
21	Drywall	52	SF	1897 Building: Basement Engineer's Office; Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
22	Drywall Compound	56	SF	1897 Building: 1st Floor Room 104	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	Drywall Compound	10	SF	1897 Building: Basement, Engineer's Office and Washroom	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
24	Interior Window Glazing	86	LF	1897 Building: Basement Light Court	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	Interior Window Caulking	16	LF	1897 Building: Basement Light Court	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	Gray Vinyl Baseboard	106	LF	1909 Addition: Basement Band Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	Gray Vinyl Baseboard mastic	106	LF	1909 Addition: Basement Band Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	Interior Window Glazing	660	LF	1909 Addition: Room 102	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	Interior window caulking	16	LF	1909 add- 1st floor Room 102	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	Drywall	320	SF	1909 Addition: Basement Band room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE



# Chicago Public Schools

School Gallistel Language Academy Unit 29091 Building ID 3490

Address 10347 S. Ewing Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
31	Drywall Compound	40	SF	1909 Addition: Basement Band Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	Textured Acoustical Ceiling Tiles	1,300	SF	1909 Addition: Basement Band room	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
33	12"x12" Pink Floor Tile	2,460	SF	Throughout red trailer	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
34	12"x12" Pink Floor Tile Mastic	2,460	SF	Throughout red trailer	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	Off White Vinyl Baseboard	3,000	LF	Throughout mobile unit	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	White Vinyl Baseboard Mastic	3,000	LF	Throughout mobile unit	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	2'x4' Fissure Ceiling Tile	7,520	SF	1892 and 1909 Buildings	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	12"x12" Red Floor Tile (FIELD HOUSE DEMOLISHED 2004)			Field House: Entry (FIELD HOUSE DEMOLISHED 2004)		MISC								
39	12"x12" Red Floor Tile Mastic (FIELD HOUSE DEMOLISHED 2004)			Field House: DEMOLISHED		MISC								
40	9"x9" Tan Speckled Floor Tile (FIELD HOUSE DEMOLISHED 2004)			Field House: DEMOLISHED		MISC								
41	9"x9" Tan Speckled Floor Tile Mastic (FIELD HOUSE DEMOLISHED 2004)			Field House: Entry DEMOLISHED		MISC								
42	Interior Window Glazing	606	LF	1909 Addition: 2nd Floor Rooms	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	Interior Window Caulking	94	LF	1909 Addition: Rooms 200, 202	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44	Interior Window Glazing	36	LF	1909 Addition: 3rd Floor Room 302	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45	12x12 white w/specs Floor Tile	5,600	SF	Throughout Mobile Unit	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
45A	12x12 white w/specs floor tile mastic	5,600	SF	Throughout Mobile Unit	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46	Crème linoleum sheet flooring	600	SF	Boys/Girls Restroom in mobile unit	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
47	2' x 2' acoustical ceiling tile	5,600	SF	Throughout mobile unit	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
48	2 x 4 Smooth Ceiling Tile	2,312	SF	2nd and 3rd Floor Boys and Girls Restrooms, and	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Gallistel Language Academy Unit 29091 Building ID 3490

Address 10347 S. Ewing Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Room 310, Unisex Toilet 210A										
49	Blue Ceramic Tile Grout	784	SF	3rd Floor Boys Restroom	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
50	Blue Ceramic Tile Adhesive	784	SF	3rd Floor Boys Restroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
51	Red Ceramic Tile Grout	672	SF	3rd Floor Girls Restroom	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
52	Red Ceramic Tile Adhesive	672	SF	3rd Floor Girls Restroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
53	Brown Carpet Adhesive	700	SF	Room 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
54	Beige Carpet Adhesive	644	SF	Room 306	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	12 x 12 Black with White Specs Vinyl Floor Tile	1,010	SF	3rd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
55M	12 x 12 Black with White Specs Vinyl Floor Tile Mastic	1,010	SF	3rd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
56	Purple Carpet Adhesive	408	SF	1st Floor Clerks Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
57	Red Carpet Adhesive	390	SF	1st Floor Adjustment Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
58	Brown Ceramic Tile Grout	84	SF	Basement Band Room Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
59	Brown Ceramic Tile Adhesive	84	SF	Basement Band Room Washroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
60	Brown Mosaic Ceramic Tile Grout	598	SF	Basement Boys and Girls Washrooms	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
61	Brown Mosaic Ceramic Tile Adhesive	598	SF	Basement Boys and Girls Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
62	12 x 12 Light Blue Floor Tile	1,674	SF	Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
62M	12 x 12 Light Blue Floor Tile Mastic	1,674	SF	Kitchen	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	Brown Carpet Mastic	400	SF	Room 205-1897 Building	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
64	Multi-Colored Carpet Mastic	500	SF	Main Office-Principals Office	ASSUMED	MISC	N	NONE	0			ACBM with the potential for damage		LOW
A	Boiler Insulation	625	LF	1897 Boiler Room	AMO	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
C	Fiberglass Joint Compound	90	FITTING	Throughout the 1897 Building	AMO	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
D	Aircell Elbow Insulation	44	FITTING	Throughout Basement of 1897	AMO	TSI	Y	NONE	0		No	ACBM with the potential for damage		HIGH

# Chicago Public Schools

School Gallistel Language Academy Unit 29091 Building ID 3490

Address 10347 S. Ewing Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Building										
G	Aircell Pipe Insulation	250	LF	Throughout Basement of 1897 Building/Air Chamber	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		HIGH
H	Magblock Pipe Insulation	125	LF	Throughout Basement of 1897 Building/Air Chamber	AMO	TSI	Y	NONE	0		No	ACBM with the potential for damage		MODERATE
I	Cardboard Pipe Insulation	120	LF	Boiler Room, Boys' Basement Restroom, 1st Floor Restroom, of 1897 Building	CHR	TSI	Y	LOC	5		Yes	Damaged or significantly damaged friable thermal system insulating ACBM	5	HIGH
J	Magblock Elbow Insulation	50	LF	Throughout Basement Air Chambers of 1897 Building	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
K	Cardboard Elbow Insulation (ABATED)			Boiler Room, Boys Restroom, 1st Floor Restroom of 1897 Building	ABATED	TSI								
M	Aircell Elbow Insulation (ABATED)			Basement Air Chamber, Girls Restroom and Playroom, Engine Room	ABATED	TSI								
N	Aircell Pipe Insulation	120	LF	1909 Addition: Basement Air Chamber, Girls Restroom, Girls Playroom	CHR	TSI	Y	LOC	4		Yes	Damaged or significantly damaged friable thermal system insulating ACBM	5	LOW
O	Magblock Pipe Insulation	125	LF	1909 Addition: Basement, Engine Room, and Corridor	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
P	Cardboard Pipe Insulation (ABATED)			1909 Addition: Girls Restroom, and Music Room Closet	ABATED	TSI								
Q	Magblock Elbow Insulation	50	SF	1909 Addition: Basement, Engine Room, Corridor, Girls Restroom, 2nd and 3rd Floor Toilets	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
R	Cardboard Elbow Insulation	20	LF	1909 Addition: Engine Room, Girls	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW



# Chicago Public Schools

School Gallistel Language Academy Unit 29091 Building ID 3490  
Address 10347 S. Ewing Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>4/12/2016</b>
Inspector Name <b><u>Wayne Gardner</u></b>
<b>100-19039</b> <b>2/13/2017</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
01	
05A	
05B	
05C	
05D	
06A	
06B	
06C	
06D	
07A	
07B	
08	
09A	
09B	
09C	
10A	
11A	
11B	
11C	
11D	
12A	
12B	
12C	
13A	

# Chicago Public Schools

School Gallistel Language Academy Unit 29091 Building ID 3490

Address 10347 S. Ewing Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
13G	
14A	
14B	
14C	
14D	
15A	
15B	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	

# Chicago Public Schools

School Gallistel Language Academy Unit 29091 Building ID 3490

Address 10347 S. Ewing Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
38	
39	
40	
41	
42	
43	
44	
45	
45A	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
55M	
56	
57	
58	
59	
60	
61	
62	
62M	
63	

# Chicago Public Schools

School Gallistel Language Academy Unit 29091 Building ID 3490

Address 10347 S. Ewing Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262 Fax: (312) 733-5612

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
64	
A	
C	
D	
G	
H	
I	
J	
K	
M	
N	
O	
P	
Q	
R	
S	
T	
U	
V	



**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

School Gallistel Language Academy

Unit 29091

Building ID 3490

Address 10347 S. Ewing

Chicago, IL, 60617

Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	Plaster	30,000	SF	Throughout Building	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05A	12"x12" Taupe Floor Tile	2,160	SF	1897 Building 1st Corridor, Room 109, Teacher's Lounge and Teacher's Washroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05B	12"x12" Cream Floor Tile	2,160	SF	1897 Building 1st Corridor, Room 109, Teacher's Lounge and Teacher's Washroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05C	12"x12" Light Brown Floor Tile	1,040	SF	1897 Building: Lounge, Storage, Room 104, and Band Room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05D	12"x12" Beige Floor Tile w/ White Streaks (NOT OBSERVED)			1897 Building: Engineer's Office, Office and Washroom NOT OBSERVED		MISC					
06A	9"x9" Beige Floor Tile (NOT OBSERVED)			1897 Building: Room 306 NOT OBSERVED		MISC					
06B	9"x9" Green Floor Tile	90	SF	1897 Building: Room 304 Wardrobe	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06C	9"x9" Gray Floor Tile	90	SF	1897 Building: Room 304 Wardrobe	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06D	9"x9" Tan Floor Tile w/ Specks	780	SF	1897 Building: Room 108	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07A	Brown Linoleum (NOT OBSERVED)			1897 Building: Asst. Principal's Office NOT OBSERVED		MISC					
07B	Green Linoleum	980	SF	1897 Building: Room 205 (under carpet)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	Insulation in Hatch Door to the Attic	2	SF	1909 Addition	Assumed	TSI	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09A	12"x12" Light Brown Floor Tile	900	SF	1909 Addition: Room 303 and Wardrobe	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09B	12"x12" Taupe Floor Tile	952	SF	1909 Addition: 1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09C	12"x12" Cream Floor Tile	752	SF	1909 Addition: 1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10A	9"x9" Tan Speckled Floor Tile	980	SF	1909 Addition: Principal's Office, 1st Floor Main Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11A	12"x12" Taupe Floor Tile Mastic	2,160	SF	1897 Building: 1st Corridor, teacher's Lounge, and Room 109	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11B	12"x12" Cream Floor Tile Mastic	2,160	SF	1897 Building: 1st Floor Corridor, Room 109 and Teacher's Washroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11C	12"x12" Light Brown Floor Tile Mastic	1,040	SF	1897 Building: Lunch Room, Storage Room., Room 104, and Band Room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11D	12"x12" Beige w/White Streaks Floor Tile Mastic (NOT OBSERVED)			1897 Building: Engineer's Office, Office, and Washroom NOT		MISC					

# Chicago Public Schools

**School** Gallistel Language Academy

**Unit** 29091

**Building ID** 3490

**Address** 10347 S. Ewing

Chicago, IL, 60617

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				OBSERVED							
12A	12"x12" Light Brown Floor Tile Mastic	900	SF	1909 rm 303 & wardrobe	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12B	12"x12" Taupe Floor Tile Mastic	952	SF	1909 Addition: 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12C	12"x12" Cream Floor Tile Mastic	752	SF	1909 Addition: 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13A	9"x9" Tan Speckled Floor Tile Mastic	980	SF	1909 Addition: Principal's Office, 1st Floor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13G	9 x 9 Cream with Black Streaks (NOT OBSERVED)			Room 021, 013, 012 NOT OBSERVED		MISC					
14A	9"x9" Beige Floor Tile Mastic (NOT OBSERVED)			1897 Building: Room 306 NOT OBSERVED		MISC					
14B	9"x9" Green Floor Tile Mastic	90	SF	1897 Building: Room 304 Wardrobe	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14C	9"x9" Gray Floor Tile Mastic	90	SF	1897 Building: Room 304 Wardrobe	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14D	9"x9" Tan Speckled Floor Tile Mastic	780	SF	1897 Building: Room 108	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15A	Brown Linoleum Mastic (NOT OBSERVED)			1897 Building: Asst. Principal's Office NOT OBSERVED		MISC					
15B	Green Linoleum Mastic	980	SF	1897 Building: Room 205 (covered)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	Brown Vinyl Baseboard	264	LF	1897 Building: Room 104	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
17	Dark Gray Vinyl Baseboard	188	LF	1897 Building: Engineer's Office & Bathroom	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
18	Brown Vinyl Baseboard Mastic	264	LF	1897 Building: Room 104	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
19	Dark Gray Vinyl Baseboard Mastic	188	LF	1897 Building: Engineer's Office and Washroom	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
20	Drywall	656	SF	1897 Building: 1st Floor Room 104	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Drywall	52	SF	1897 Building: Basement Engineer's Office; Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22	Drywall Compound	56	SF	1897 Building: 1st Floor Room 104	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	Drywall Compound	10	SF	1897 Building: Basement, Engineer's Office and Washroom	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	Interior Window Glazing	86	LF	1897 Building: Basement Light Court	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
25	Interior Window Caulking	16	LF	1897 Building: Basement Light Court	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
26	Gray Vinyl Baseboard	106	LF	1909 Addition: Basement Band Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
27	Gray Vinyl Baseboard mastic	106	LF	1909 Addition: Basement Band Room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
28	Interior Window Glazing	660	LF	1909 Addition: Room 102	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
29	Interior window caulking	16	LF	1909 add- 1st floor Room 102	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
30	Drywall	320	SF	1909 Addition: Basement Band room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

School Gallistel Language Academy

Unit 29091

Building ID 3490

Address 10347 S. Ewing

Chicago, IL, 60617

Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
31	Drywall Compound	40	SF	1909 Addition: Basement Band Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	Textured Acoustical Ceiling Tiles	1,300	SF	1909 Addition: Basement Band room	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12"x12" Pink Floor Tile	2,460	SF	Throughout red trailer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	12"x12" Pink Floor Tile Mastic	2,460	SF	Throughout red trailer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	Off White Vinyl Baseboard	3,000	LF	Throughout mobile unit	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
36	White Vinyl Baseboard Mastic	3,000	LF	Throughout mobile unit	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
37	2'x4' Fissure Ceiling Tile	7,520	SF	1892 and 1909 Buildings	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	12"x12" Red Floor Tile (FIELD HOUSE DEMOLISHED 2004)			Field House: Entry (FIELD HOUSE DEMOLISHED 2004)		MISC					
39	12"x12" Red Floor Tile Mastic (FIELD HOUSE DEMOLISHED 2004)			Field House: DEMOLISHED		MISC					
40	9"x9" Tan Specked Floor Tile (FIELD HOUSE DEMOLISHED 2004)			Field House: DEMOLISHED		MISC					
41	9"x9" Tan Specked Floor Tile Mastic (FIELD HOUSE DEMOLISHED 2004)			Field House: Entry DEMOLISHED		MISC					
42	Interior Window Glazing	606	LF	1909 Addition: 2nd Floor Rooms	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
43	Interior Window Caulking	94	LF	1909 Addition: Rooms 200, 202	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
44	Interior Window Glazing	36	LF	1909 Addition: 3rd Floor Room 302	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
45	12x12 white w/specs Floor Tile	5,600	SF	Throughout Mobile Unit	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45A	12x12 white w/specs floor tile mastic	5,600	SF	Throughout Mobile Unit	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46	Crème linoleum sheet flooring	600	SF	Boys/Girls Restroom in mobile unit	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47	2' x 2' acoustical ceiling tile	5,600	SF	Throughout mobile unit	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	2 x 4 Smooth Ceiling Tile	2,312	SF	2nd and 3rd Floor Boys and Girls Restrooms, and Room 310, Unisex Toilet 210A	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	Blue Ceramic Tile Grout	784	SF	3rd Floor Boys Restroom	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
50	Blue Ceramic Tile Adhesive	784	SF	3rd Floor Boys Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
51	Red Ceramic Tile Grout	672	SF	3rd Floor Girls Restroom	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
52	Red Ceramic Tile Adhesive	672	SF	3rd Floor Girls Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
53	Brown Carpet Adhesive	700	SF	Room 304	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
54	Beige Carpet Adhesive	644	SF	Room 306	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	12 x 12 Black with White Specs Vinyl Floor Tile	1,010	SF	3rd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55M	12 x 12 Black with White Specs Vinyl Floor Tile Mastic	1,010	SF	3rd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

School Gallistel Language Academy  
Address 10347 S. Ewing

Unit 29091  
Chicago, IL, 60617

Building ID 3490  
Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
56	Purple Carpet Adhesive	408	SF	1st Floor Clerks Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	Red Carpet Adhesive	390	SF	1st Floor Adjustment Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
58	Brown Ceramic Tile Grout	84	SF	Basement Band Room Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
59	Brown Ceramic Tile Adhesive	84	SF	Basement Band Room Washroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
60	Brown Mosaic Ceramic Tile Grout	598	SF	Basement Boys and Girls Washrooms	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	Brown Mosaic Ceramic Tile Adhesive	598	SF	Basement Boys and Girls Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	12 x 12 Light Blue Floor Tile	1,674	SF	Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62M	12 x 12 Light Blue Floor Tile Mastic	1,674	SF	Kitchen	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63	Brown Carpet Mastic	400	SF	Room 205-1897 Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64	Multi-Colored Carpet Mastic	500	SF	Main Office- Principals Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Boiler Insulation	625	LF	1897 Boiler Room	Amosite	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
C	Fiberglass Joint Compound	90	FITTING	Throughout the 1897 Building	Amosite	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
D	Aircell Elbow Insulation	44	FITTING	Throughout Basement of 1897 Building	Amosite	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
G	Aircell Pipe Insulation	250	LF	Throughout Basement of 1897 Building/Air Chamber	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
H	Magblock Pipe Insulation	125	LF	Throughout Basement of 1897 Building/Air Chamber	Amosite	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
I	Cardboard Pipe Insulation	120	LF	Boiler Room, Boys' Basement Restroom, 1st Floor Restroom, of 1897 Building	Chrysotile	TSI	Yes	5	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
J	Magblock Elbow Insulation	50	LF	Throughout Basement Air Chambers of 1897 Building	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
K	Cardboard Elbow Insulation (ABATED)			Boiler Room, Boys Restroom, 1st Floor Restroom of 1897 Building	Abated	TSI					
M	Aircell Elbow Insulation (ABATED)			Basement Air Chamber, Girls Restroom and Playroom, Engine Room	Abated	TSI					
N	Aircell Pipe Insulation	120	LF	1909 Addition: Basement Air Chamber, Girls Restroom, Girls Playroom	Chrysotile	TSI	Yes	4	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
O	Magblock Pipe Insulation	125	LF	1909 Addition: Basement, Engine Room, and Corridor	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
P	Cardboard Pipe Insulation (ABATED)			1909 Addition: Girls Restroom, and Music Room Closet	Abated	TSI					
Q	Magblock Elbow Insulation	50	SF	1909 Addition: Basement, Engine Room, Corridor, Girls Restroom, 2nd and 3rd Floor Toilets	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

**School** Gallistel Language Academy

**Unit** 29091

**Building ID** 3490

**Address** 10347 S. Ewing

Chicago, IL, 60617

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
R	Cardboard Elbow Insulation	20	LF	1909 Addition: Engine Room, Girls Restroom	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
S	Aircell Pipe Insulation DEMOLISHED			Field House- DEMOLISHED 2004		TSI					
T	Aircell Pipe Elbow Insulation DEMOLISHED			Field House: DEMOLISHED IN 2004		TSI					
U	Cardboard Pipe Insulation DEMOLISHED 2004			Field House: N. Room, Utility Room - DEMOLISHED 2004		TSI					
V	Cardboard Pipe Elbow Insulation DEMOLISHED			Field House: DEMOLISHED IN 2004		TSI					

# Chicago Public Schools

**School** Gallistel Language Academy

**Unit** 29091

**Building ID** 3490

**Address** 10347 S. Ewing

Chicago, IL, 60617

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

Review Date	8/4/2016
Manager Planner Name	Jigar Shah
100-07342	1/19/2017
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
05A	
05B	
05C	
05D	
06A	
06B	
06C	
06D	
07A	
07B	
08	
09A	
09B	
09C	
10A	
11A	
11B	
11C	
11D	
12A	
12B	
12C	
13A	
13G	

# Chicago Public Schools

**School** Gallistel Language Academy

**Unit** 29091

**Building ID** 3490

**Address** 10347 S. Ewing

Chicago, IL, 60617

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
14A	
14B	
14C	
14D	
15A	
15B	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	



# Chicago Public Schools

**School** Gallistel Language Academy

**Unit** 29091

**Building ID** 3490

**Address** 10347 S. Ewing

Chicago, IL, 60617

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

*Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
45A	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
55M	
56	
57	
58	
59	

# Chicago Public Schools

**School** Gallistel Language Academy

**Unit** 29091

**Building ID** 3490

**Address** 10347 S. Ewing

Chicago, IL, 60617

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
60	
61	
62	
62M	
63	
64	
A	
C	
D	
G	
H	
I	Repair Damaged ACM ASAP
J	
K	
M	
N	Repair Damaged ACM
O	
P	
Q	
R	
S	
T	
U	
V	

# Chicago Public Schools

**School** Gallistel Language Academy

**Unit** 29091

**Building ID** 3490

**Address** 10347 S. Ewing

Chicago, IL, 60617

**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** GSG Consultants, Inc.

855 W. Adams St., Ste. 200

Phone: (312) 733-6262

Fax: (312) 733-5612

*Management Planner's Comments Summarized at the End of the Report*

# Chicago Public Schools

GSG Consultants, Inc.

## 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**  
MATERIAL DESCRIPTION: **Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Building**  
MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **01**  
MATERIAL DESCRIPTION: **Plaster**  
MATERIAL LOCATION: **Throughout Building**  
MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05A**  
MATERIAL DESCRIPTION: **12"x12" Taupe Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **1897 Building 1st Corridor, Room 109, Teacher's Lounge and Teacher's Washroom**

MATERIAL QUANTITY: **2160** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **05A**  
MATERIAL DESCRIPTION: **12"x12" Taupe Floor Tile**  
MATERIAL LOCATION: **1897 Building 1st Corridor, Room 109, Teacher's Lounge and Teacher's Washroom**  
MATERIAL QUANTITY: **2160** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05B**  
MATERIAL DESCRIPTION: **12"x12" Cream Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **1897 Building 1st Corridor, Room 109, Teacher's Lounge and Teacher's Washroom**

MATERIAL QUANTITY: **2160** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **05B**  
MATERIAL DESCRIPTION: **12"x12" Cream Floor Tile**  
MATERIAL LOCATION: **1897 Building 1st Corridor, Room 109, Teacher's Lounge and Teacher's Washroom**  
MATERIAL QUANTITY: **2160** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05C**  
MATERIAL DESCRIPTION: **12"x12" Light Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1897 Building: Lounge, Storage, Room 104, and Band Room**  
MATERIAL QUANTITY: **1040** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **05C**  
MATERIAL DESCRIPTION: **12"x12" Light Brown Floor Tile**  
MATERIAL LOCATION: **1897 Building: Lounge, Storage, Room 104, and Band Room**  
MATERIAL QUANTITY: **1040** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05D**  
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile w/ White Streaks (NOT OBSERVED)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1897 Building: Engineer's Office, Office and Washroom NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **05D**  
MATERIAL DESCRIPTION: **12"x12" Beige Floor Tile w/ White Streaks (NOT OBSERVED)**  
MATERIAL LOCATION: **1897 Building: Engineer's Office, Office and Washroom NOT OBSERVED**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **9"x9" Beige Floor Tile (NOT OBSERVED)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1897 Building: Room 306 NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **06A**  
MATERIAL DESCRIPTION: **9"x9" Beige Floor Tile (NOT OBSERVED)**  
MATERIAL LOCATION: **1897 Building: Room 306 NOT OBSERVED**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

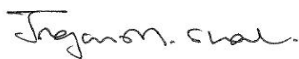

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06B**  
MATERIAL DESCRIPTION: **9"x9" Green Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1897 Building: Room 304 Wardrobe**  
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **06B**  
MATERIAL DESCRIPTION: **9"x9" Green Floor Tile**  
MATERIAL LOCATION: **1897 Building: Room 304 Wardrobe**  
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06C**  
MATERIAL DESCRIPTION: **9"x9" Gray Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1897 Building: Room 304 Wardrobe**  
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **06C**  
MATERIAL DESCRIPTION: **9"x9" Gray Floor Tile**  
MATERIAL LOCATION: **1897 Building: Room 304 Wardrobe**  
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06D**  
MATERIAL DESCRIPTION: **9"x9" Tan Floor Tile w/ Specks**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1897 Building: Room 108**  
MATERIAL QUANTITY: **780** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **06D**  
MATERIAL DESCRIPTION: **9"x9" Tan Floor Tile w/ Specks**  
MATERIAL LOCATION: **1897 Building: Room 108**  
MATERIAL QUANTITY: **780** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **Brown Linoleum (NOT OBSERVED)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1897 Building: Asst. Principal's Office NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **Brown Linoleum (NOT OBSERVED)**  
MATERIAL LOCATION: **1897 Building: Asst. Principal's Office NOT OBSERVED**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07B**  
MATERIAL DESCRIPTION: **Green Linoleum**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1897 Building: Room 205 (under carpet)**  
MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **07B**  
MATERIAL DESCRIPTION: **Green Linoleum**  
MATERIAL LOCATION: **1897 Building: Room 205 (under carpet)**  
MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **Insulation in Hatch Door to the Attic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition**  
MATERIAL QUANTITY: **2** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **Insulation in Hatch Door to the Attic**  
MATERIAL LOCATION: **1909 Addition**  
MATERIAL QUANTITY: **2** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09A**  
MATERIAL DESCRIPTION: **12"x12" Light Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1909 Addition: Room 303 and Wardrobe**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **09A**  
MATERIAL DESCRIPTION: **12"x12" Light Brown Floor Tile**  
MATERIAL LOCATION: **1909 Addition: Room 303 and Wardrobe**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09B**  
MATERIAL DESCRIPTION: **12"x12" Taupe Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1909 Addition: 1st Floor Corridor**  
MATERIAL QUANTITY: **952** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **09B**  
MATERIAL DESCRIPTION: **12"x12" Taupe Floor Tile**  
MATERIAL LOCATION: **1909 Addition: 1st Floor Corridor**  
MATERIAL QUANTITY: **952** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09C**  
MATERIAL DESCRIPTION: **12"x12" Cream Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1909 Addition: 1st Floor Corridor**  
MATERIAL QUANTITY: **752** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **09C**  
MATERIAL DESCRIPTION: **12"x12" Cream Floor Tile**  
MATERIAL LOCATION: **1909 Addition: 1st Floor Corridor**  
MATERIAL QUANTITY: **752** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10A**  
MATERIAL DESCRIPTION: **9"x9" Tan Speckled Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1909 Addition: Principal's Office, 1st Floor Main Office**  
MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **10A**  
MATERIAL DESCRIPTION: **9"x9" Tan Speckled Floor Tile**  
MATERIAL LOCATION: **1909 Addition: Principal's Office, 1st Floor Main Office**  
MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11A**  
MATERIAL DESCRIPTION: **12"x12" Taupe Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: 1st Corridor, teacher's Lounge, and Room 109**  
MATERIAL QUANTITY: **2160** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **11A**  
MATERIAL DESCRIPTION: **12"x12" Taupe Floor Tile Mastic**  
MATERIAL LOCATION: **1897 Building: 1st Corridor, teacher's Lounge, and Room 109**  
MATERIAL QUANTITY: **2160** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11B**  
MATERIAL DESCRIPTION: **12"x12" Cream Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: 1st Floor Corridor, Room 109 and Teacher's Washroom**  
MATERIAL QUANTITY: **2160** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **11B**  
MATERIAL DESCRIPTION: **12"x12" Cream Floor Tile Mastic**  
MATERIAL LOCATION: **1897 Building: 1st Floor Corridor, Room 109 and Teacher's Washroom**  
MATERIAL QUANTITY: **2160** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11C**  
MATERIAL DESCRIPTION: **12"x12" Light Brown Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Lunch Room, Storage Room., Room 104, and Band Room**  
MATERIAL QUANTITY: **1040** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **11C**  
MATERIAL DESCRIPTION: **12"x12" Light Brown Floor Tile Mastic**  
MATERIAL LOCATION: **1897 Building: Lunch Room, Storage Room., Room 104, and Band Room**  
MATERIAL QUANTITY: **1040** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11D**  
MATERIAL DESCRIPTION: **12"x12" Beige w/White Streaks Floor Tile Mastic (NOT OBSERVED)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1897 Building: Engineer's Office, Office, and Washroom NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **11D**  
MATERIAL DESCRIPTION: **12"x12" Beige w/White Streaks Floor Tile Mastic (NOT OBSERVED)**  
MATERIAL LOCATION: **1897 Building: Engineer's Office, Office, and Washroom NOT OBSERVED**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12A**  
MATERIAL DESCRIPTION: **12"x12" Light Brown Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 rm 303 & wardrobe**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **12A**  
MATERIAL DESCRIPTION: **12"x12" Light Brown Floor Tile Mastic**  
MATERIAL LOCATION: **1909 rm 303 & wardrobe**  
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12B**  
MATERIAL DESCRIPTION: **12"x12" Taupe Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: 1st Floor Corridor**  
MATERIAL QUANTITY: **952** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **12B**  
MATERIAL DESCRIPTION: **12"x12" Taupe Floor Tile Mastic**  
MATERIAL LOCATION: **1909 Addition: 1st Floor Corridor**  
MATERIAL QUANTITY: **952** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12C**  
MATERIAL DESCRIPTION: **12"x12" Cream Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: 1st Floor Corridor**  
MATERIAL QUANTITY: **752** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **12C**  
MATERIAL DESCRIPTION: **12"x12" Cream Floor Tile Mastic**  
MATERIAL LOCATION: **1909 Addition: 1st Floor Corridor**  
MATERIAL QUANTITY: **752** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13A**  
MATERIAL DESCRIPTION: **9"x9" Tan Speckled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: Principal's Office, 1st Floor**  
MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **13A**  
MATERIAL DESCRIPTION: **9"x9" Tan Speckled Floor Tile Mastic**  
MATERIAL LOCATION: **1909 Addition: Principal's Office, 1st Floor**  
MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13G**  
MATERIAL DESCRIPTION: **9 x 9 Cream with Black Streaks (NOT OBSERVED)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 021, 013, 012 NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **13G**  
MATERIAL DESCRIPTION: **9 x 9 Cream with Black Streaks (NOT OBSERVED)**  
MATERIAL LOCATION: **Room 021, 013, 012 NOT OBSERVED**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14A**  
MATERIAL DESCRIPTION: **9"x9" Beige Floor Tile Mastic (NOT OBSERVED)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1897 Building: Room 306 NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **14A**  
MATERIAL DESCRIPTION: **9"x9" Beige Floor Tile Mastic (NOT OBSERVED)**  
MATERIAL LOCATION: **1897 Building: Room 306 NOT OBSERVED**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

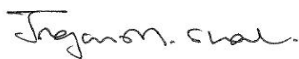

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14B**  
MATERIAL DESCRIPTION: **9"x9" Green Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Room 304 Wardrobe**  
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **14B**  
MATERIAL DESCRIPTION: **9"x9" Green Floor Tile Mastic**  
MATERIAL LOCATION: **1897 Building: Room 304 Wardrobe**  
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

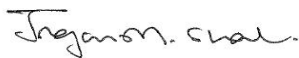

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14C**  
MATERIAL DESCRIPTION: **9"X9" Gray Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Room 304 Wardrobe**  
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **14C**  
MATERIAL DESCRIPTION: **9"X9" Gray Floor Tile Mastic**  
MATERIAL LOCATION: **1897 Building: Room 304 Wardrobe**  
MATERIAL QUANTITY: **90** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14D**  
MATERIAL DESCRIPTION: **9"x9" Tan Speckled Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Room 108**  
MATERIAL QUANTITY: **780** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **14D**  
MATERIAL DESCRIPTION: **9"x9" Tan Speckled Floor Tile Mastic**  
MATERIAL LOCATION: **1897 Building: Room 108**  
MATERIAL QUANTITY: **780** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15A**  
MATERIAL DESCRIPTION: **Brown Linoleum Mastic (NOT OBSERVED)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1897 Building: Asst. Principal's Office NOT OBSERVED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **15A**  
MATERIAL DESCRIPTION: **Brown Linoleum Mastic (NOT OBSERVED)**  
MATERIAL LOCATION: **1897 Building: Asst. Principal's Office NOT OBSERVED**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15B**  
MATERIAL DESCRIPTION: **Green Linoleum Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Room 205 (covered)**  
MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **15B**  
MATERIAL DESCRIPTION: **Green Linoleum Mastic**  
MATERIAL LOCATION: **1897 Building: Room 205 (covered)**  
MATERIAL QUANTITY: **980** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_

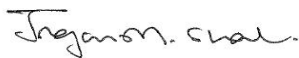

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Brown Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Room 104**  
MATERIAL QUANTITY: **264** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Brown Vinyl Baseboard**  
MATERIAL LOCATION: **1897 Building: Room 104**  
MATERIAL QUANTITY: **264** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Dark Gray Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Engineer's Office & Bathroom**  
MATERIAL QUANTITY: **188** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Dark Gray Vinyl Baseboard**  
MATERIAL LOCATION: **1897 Building: Engineer's Office & Bathroom**  
MATERIAL QUANTITY: **188** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Brown Vinyl Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Room 104**  
MATERIAL QUANTITY: **264** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Brown Vinyl Baseboard Mastic**  
MATERIAL LOCATION: **1897 Building: Room 104**  
MATERIAL QUANTITY: **264** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Dark Gray Vinyl Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Engineer's Office and Washroom**  
MATERIAL QUANTITY: **188** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Dark Gray Vinyl Baseboard Mastic**  
MATERIAL LOCATION: **1897 Building: Engineer's Office and Washroom**  
MATERIAL QUANTITY: **188** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Drywall**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1897 Building: 1st Floor Room 104**  
MATERIAL QUANTITY: **656** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Drywall**  
MATERIAL LOCATION: **1897 Building: 1st Floor Room 104**  
MATERIAL QUANTITY: **656** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Drywall**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1897 Building: Basement Engineer's Office; Washroom**  
MATERIAL QUANTITY: **52** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Drywall**  
MATERIAL LOCATION: **1897 Building: Basement Engineer's Office; Washroom**  
MATERIAL QUANTITY: **52** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **Drywall Compound**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: 1st Floor Room 104**  
MATERIAL QUANTITY: **56** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **Drywall Compound**  
MATERIAL LOCATION: **1897 Building: 1st Floor Room 104**  
MATERIAL QUANTITY: **56** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **Drywall Compound**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Basement, Engineer's Office and Washroom**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **Drywall Compound**  
MATERIAL LOCATION: **1897 Building: Basement, Engineer's Office and Washroom**  
MATERIAL QUANTITY: **10** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Interior Window Glazing**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Basement Light Court**  
MATERIAL QUANTITY: **86** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Interior Window Glazing**  
MATERIAL LOCATION: **1897 Building: Basement Light Court**  
MATERIAL QUANTITY: **86** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Interior Window Caulking**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Building: Basement Light Court**  
MATERIAL QUANTITY: **16** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Interior Window Caulking**  
MATERIAL LOCATION: **1897 Building: Basement Light Court**  
MATERIAL QUANTITY: **16** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: Basement Band Room**  
MATERIAL QUANTITY: **106** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard**  
MATERIAL LOCATION: **1909 Addition: Basement Band Room**  
MATERIAL QUANTITY: **106** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: Basement Band Room**  
MATERIAL QUANTITY: **106** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: **04/12/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **Gray Vinyl Baseboard mastic**  
MATERIAL LOCATION: **1909 Addition: Basement Band Room**  
MATERIAL QUANTITY: **106** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **Interior Window Glazing**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: Room 102**  
MATERIAL QUANTITY: **660** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **Interior Window Glazing**  
MATERIAL LOCATION: **1909 Addition: Room 102**  
MATERIAL QUANTITY: **660** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **Interior window caulking**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 add- 1st floor Room 102**  
MATERIAL QUANTITY: **16** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **Interior window caulking**  
MATERIAL LOCATION: **1909 add- 1st floor Room 102**  
MATERIAL QUANTITY: **16** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **Drywall**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1909 Addition: Basement Band room**  
MATERIAL QUANTITY: **320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **Drywall**  
MATERIAL LOCATION: **1909 Addition: Basement Band room**  
MATERIAL QUANTITY: **320** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **Drywall Compound**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: Basement Band Room**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **Drywall Compound**  
MATERIAL LOCATION: **1909 Addition: Basement Band Room**  
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **Textured Acoustical Ceiling Tiles**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: Basement Band room**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **Textured Acoustical Ceiling Tiles**  
MATERIAL LOCATION: **1909 Addition: Basement Band room**  
MATERIAL QUANTITY: **1300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12"x12" Pink Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout red trailer**

MATERIAL QUANTITY: **2460**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12"x12" Pink Floor Tile**  
MATERIAL LOCATION: **Throughout red trailer**  
MATERIAL QUANTITY: **2460** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12"x12" Pink Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout red trailer**  
MATERIAL QUANTITY: **2460** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12"x12" Pink Floor Tile Mastic**  
MATERIAL LOCATION: **Throughout red trailer**  
MATERIAL QUANTITY: **2460** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **Off White Vinyl Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout mobile unit**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **Off White Vinyl Baseboard**  
MATERIAL LOCATION: **Throughout mobile unit**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **White Vinyl Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout mobile unit**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **White Vinyl Baseboard Mastic**  
MATERIAL LOCATION: **Throughout mobile unit**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **2'x4' Fissure Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1892 and 1909 Buildings**  
MATERIAL QUANTITY: **7520** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **2'x4' Fissure Ceiling Tile**  
MATERIAL LOCATION: **1892 and 1909 Buildings**  
MATERIAL QUANTITY: **7520** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **12"x12" Red Floor Tile (FIELD HOUSE DEMOLISHED 2004)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Field House: Entry (FIELD HOUSE DEMOLISHED 2004)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **12"x12" Red Floor Tile (FIELD HOUSE DEMOLISHED 2004)**  
MATERIAL LOCATION: **Field House: Entry (FIELD HOUSE DEMOLISHED 2004)**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **12"x12" Red Floor Tile Mastic (FIELD HOUSE DEMOLISHED 2004)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Field House: DEMOLISHED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **12"x12" Red Floor Tile Mastic (FIELD HOUSE DEMOLISHED 2004)**  
MATERIAL LOCATION: **Field House: DEMOLISHED**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**  
MATERIAL DESCRIPTION: **9"x9" Tan Specked Floor Tile (FIELD HOUSE DEMOLISHED 2004)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Field House: DEMOLISHED**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **40**  
MATERIAL DESCRIPTION: **9"x9" Tan Specked Floor Tile (FIELD HOUSE DEMOLISHED 2004)**  
MATERIAL LOCATION: **Field House: DEMOLISHED**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **9"x9" Tan Specked Floor Tile Mastic (FIELD HOUSE DEMOLISHED 2004)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Field House: Entry DEMOLISHED**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **41**  
MATERIAL DESCRIPTION: **9"x9" Tan Specked Floor Tile Mastic (FIELD HOUSE DEMOLISHED 2004)**  
MATERIAL LOCATION: **Field House: Entry DEMOLISHED**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **Interior Window Glazing**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: 2nd Floor Rooms**  
MATERIAL QUANTITY: **606** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **42**  
MATERIAL DESCRIPTION: **Interior Window Glazing**  
MATERIAL LOCATION: **1909 Addition: 2nd Floor Rooms**  
MATERIAL QUANTITY: **606** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **Interior Window Caulking**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: Rooms 200, 202**  
MATERIAL QUANTITY: **94** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **43**  
MATERIAL DESCRIPTION: **Interior Window Caulking**  
MATERIAL LOCATION: **1909 Addition: Rooms 200, 202**  
MATERIAL QUANTITY: **94** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**  
MATERIAL DESCRIPTION: **Interior Window Glazing**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: 3rd Floor Room 302**  
MATERIAL QUANTITY: **36** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **44**  
MATERIAL DESCRIPTION: **Interior Window Glazing**  
MATERIAL LOCATION: **1909 Addition: 3rd Floor Room 302**  
MATERIAL QUANTITY: **36** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **12x12 white w/specs Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout Mobile Unit**

MATERIAL QUANTITY: **5600**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **45**  
MATERIAL DESCRIPTION: **12x12 white w/specs Floor Tile**  
MATERIAL LOCATION: **Throughout Mobile Unit**  
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45A**  
MATERIAL DESCRIPTION: **12x12 white w/specks floor tile mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Mobile Unit**  
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **45A**  
MATERIAL DESCRIPTION: **12x12 white w/specks floor tile mastic**  
MATERIAL LOCATION: **Throughout Mobile Unit**  
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **Crème linoleum sheet flooring**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Boys/Girls Restroom in mobile unit**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **46**  
MATERIAL DESCRIPTION: **Crème linoleum sheet flooring**  
MATERIAL LOCATION: **Boys/Girls Restroom in mobile unit**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **2' x 2' acoustical ceiling tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout mobile unit**  
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **47**  
MATERIAL DESCRIPTION: **2' x 2' acoustical ceiling tile**  
MATERIAL LOCATION: **Throughout mobile unit**  
MATERIAL QUANTITY: **5600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **2 x 4 Smooth Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd and 3rd Floor Boys and Girls Restrooms, and Room 310, Unisex Toilet 210A**  
MATERIAL QUANTITY: **2312** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **48**  
MATERIAL DESCRIPTION: **2 x 4 Smooth Ceiling Tile**  
MATERIAL LOCATION: **2nd and 3rd Floor Boys and Girls Restrooms, and Room 310, Unisex Toilet 210A**  
MATERIAL QUANTITY: **2312** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**  
MATERIAL DESCRIPTION: **Blue Ceramic Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **3rd Floor Boys Restroom**  
MATERIAL QUANTITY: **784** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **49**  
MATERIAL DESCRIPTION: **Blue Ceramic Tile Grout**  
MATERIAL LOCATION: **3rd Floor Boys Restroom**  
MATERIAL QUANTITY: **784** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **Blue Ceramic Tile Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **3rd Floor Boys Restroom**  
MATERIAL QUANTITY: **784** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **50**  
MATERIAL DESCRIPTION: **Blue Ceramic Tile Adhesive**  
MATERIAL LOCATION: **3rd Floor Boys Restroom**  
MATERIAL QUANTITY: **784** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **Red Ceramic Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **3rd Floor Girls Restroom**  
MATERIAL QUANTITY: **672** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.

2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **51**  
MATERIAL DESCRIPTION: **Red Ceramic Tile Grout**  
MATERIAL LOCATION: **3rd Floor Girls Restroom**  
MATERIAL QUANTITY: **672** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Red Ceramic Tile Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **3rd Floor Girls Restroom**  
MATERIAL QUANTITY: **672** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **52**  
MATERIAL DESCRIPTION: **Red Ceramic Tile Adhesive**  
MATERIAL LOCATION: **3rd Floor Girls Restroom**  
MATERIAL QUANTITY: **672** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**  
MATERIAL DESCRIPTION: **Brown Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 304**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **53**  
MATERIAL DESCRIPTION: **Brown Carpet Adhesive**  
MATERIAL LOCATION: **Room 304**  
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 08/04/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **Beige Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 306**  
MATERIAL QUANTITY: **644** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **54**  
MATERIAL DESCRIPTION: **Beige Carpet Adhesive**  
MATERIAL LOCATION: **Room 306**  
MATERIAL QUANTITY: **644** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **12 x 12 Black with White Specs Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **3rd Floor Corridor**  
MATERIAL QUANTITY: **1010** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **55**  
MATERIAL DESCRIPTION: **12 x 12 Black with White Specs Vinyl Floor Tile**  
MATERIAL LOCATION: **3rd Floor Corridor**  
MATERIAL QUANTITY: **1010** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55M**  
MATERIAL DESCRIPTION: **12 x 12 Black with White Specs Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **3rd Floor Corridor**  
MATERIAL QUANTITY: **1010** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **55M**  
MATERIAL DESCRIPTION: **12 x 12 Black with White Specs Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **3rd Floor Corridor**  
MATERIAL QUANTITY: **1010** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **Purple Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st Floor Clerks Office**  
MATERIAL QUANTITY: **408** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **56**  
MATERIAL DESCRIPTION: **Purple Carpet Adhesive**  
MATERIAL LOCATION: **1st Floor Clerks Office**  
MATERIAL QUANTITY: **408** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **Red Carpet Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1st Floor Adjustment Room**  
MATERIAL QUANTITY: **390** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **57**  
MATERIAL DESCRIPTION: **Red Carpet Adhesive**  
MATERIAL LOCATION: **1st Floor Adjustment Room**  
MATERIAL QUANTITY: **390** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**  
MATERIAL DESCRIPTION: **Brown Ceramic Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement Band Room Washroom**  
MATERIAL QUANTITY: **84** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **58**  
MATERIAL DESCRIPTION: **Brown Ceramic Tile Grout**  
MATERIAL LOCATION: **Basement Band Room Washroom**  
MATERIAL QUANTITY: **84** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**  
MATERIAL DESCRIPTION: **Brown Ceramic Tile Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Band Room Washroom**

MATERIAL QUANTITY: **84**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **59**  
MATERIAL DESCRIPTION: **Brown Ceramic Tile Adhesive**  
MATERIAL LOCATION: **Basement Band Room Washroom**  
MATERIAL QUANTITY: **84** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: 08/04/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**  
MATERIAL DESCRIPTION: **Brown Mosaic Ceramic Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Basement Boys and Girls Washrooms**  
MATERIAL QUANTITY: **598** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **60**  
MATERIAL DESCRIPTION: **Brown Mosaic Ceramic Tile Grout**  
MATERIAL LOCATION: **Basement Boys and Girls Washrooms**  
MATERIAL QUANTITY: **598** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **Brown Mosaic Ceramic Tile Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Basement Boys and Girls Washrooms**

MATERIAL QUANTITY: **598**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **61**  
MATERIAL DESCRIPTION: **Brown Mosaic Ceramic Tile Adhesive**  
MATERIAL LOCATION: **Basement Boys and Girls Washrooms**  
MATERIAL QUANTITY: **598** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**  
MATERIAL DESCRIPTION: **12 x 12 Light Blue Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Kitchen**  
MATERIAL QUANTITY: **1674** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **62**  
MATERIAL DESCRIPTION: **12 x 12 Light Blue Floor Tile**  
MATERIAL LOCATION: **Kitchen**  
MATERIAL QUANTITY: **1674** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62M**  
MATERIAL DESCRIPTION: **12 x 12 Light Blue Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Kitchen**  
MATERIAL QUANTITY: **1674** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **62M**  
MATERIAL DESCRIPTION: **12 x 12 Light Blue Floor Tile Mastic**  
MATERIAL LOCATION: **Kitchen**  
MATERIAL QUANTITY: **1674** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**  
MATERIAL DESCRIPTION: **Brown Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 205-1897 Building**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **63**  
MATERIAL DESCRIPTION: **Brown Carpet Mastic**  
MATERIAL LOCATION: **Room 205-1897 Building**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**  
MATERIAL DESCRIPTION: **Multi-Colored Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Office- Principals Office**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **64**  
MATERIAL DESCRIPTION: **Multi-Colored Carpet Mastic**  
MATERIAL LOCATION: **Main Office- Principals Office**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**  
MATERIAL DESCRIPTION: **Boiler Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1897 Boiler Room**  
MATERIAL QUANTITY: **625** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **A**  
MATERIAL DESCRIPTION: **Boiler Insulation**  
MATERIAL LOCATION: **1897 Boiler Room**  
MATERIAL QUANTITY: **625** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Fiberglass Joint Compound**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **Throughout the 1897 Building**

MATERIAL QUANTITY: **90**

MATERIAL UNITS: **FITTING**

DAMAGE QUANTITY:

DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Fiberglass Joint Compound**  
MATERIAL LOCATION: **Throughout the 1897 Building**  
MATERIAL QUANTITY: **90** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Aircell Elbow Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**  
MATERIAL LOCATION: **Throughout Basement of 1897 Building**  
MATERIAL QUANTITY: **44** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Aircell Elbow Insulation**  
MATERIAL LOCATION: **Throughout Basement of 1897 Building**  
MATERIAL QUANTITY: **44** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **HIGH**  
MATERIAL LOCATION: **Throughout Basement of 1897 Building/Air Chamber**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: **04/12/2016**



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **Throughout Basement of 1897 Building/Air Chamber**  
MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Magblock Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Throughout Basement of 1897 Building/Air Chamber**  
MATERIAL QUANTITY: **125** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Magblock Pipe Insulation**  
MATERIAL LOCATION: **Throughout Basement of 1897 Building/Air Chamber**  
MATERIAL QUANTITY: **125** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACM**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **HIGH**  
MATERIAL LOCATION: **Boiler Room, Boys' Basement Restroom, 1st Floor Restroom, of 1897 Building**  
MATERIAL QUANTITY: **120** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
MATERIAL LOCATION: **Boiler Room, Boys' Basement Restroom, 1st Floor Restroom, of 1897 Building**  
MATERIAL QUANTITY: **120** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **5** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Repair Damaged ACM ASAP

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **Magblock Elbow Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Basement Air Chambers of 1897 Building**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **Magblock Elbow Insulation**  
MATERIAL LOCATION: **Throughout Basement Air Chambers of 1897 Building**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Cardboard Elbow Insulation (ABATED)**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room, Boys Restroom, 1st Floor Restroom of 1897 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Cardboard Elbow Insulation (ABATED)**  
MATERIAL LOCATION: **Boiler Room, Boys Restroom, 1st Floor Restroom of 1897 Building**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **Aircell Elbow Insulation (ABATED)**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement Air Chamber, Girls Restroom and Playroom, Engine Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **Aircell Elbow Insulation (ABATED)**  
MATERIAL LOCATION: **Basement Air Chamber, Girls Restroom and Playroom, Engine Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 Damaged or significantly damaged friable thermal system insulating ACBM**  
HISTORICAL DAMAGE REASON: **Physical Damage**  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: Basement Air Chamber, Girls Restroom, Girls Playroom**  
MATERIAL QUANTITY: **120** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **N**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **1909 Addition: Basement Air Chamber, Girls Restroom, Girls Playroom**  
MATERIAL QUANTITY: **120** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **4** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Repair Damaged ACM

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**  
MATERIAL DESCRIPTION: **Magblock Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: Basement, Engine Room, and Corridor**  
MATERIAL QUANTITY: **125** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **0**  
MATERIAL DESCRIPTION: **Magblock Pipe Insulation**  
MATERIAL LOCATION: **1909 Addition: Basement, Engine Room, and Corridor**  
MATERIAL QUANTITY: **125** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation (ABATED)**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1909 Addition: Girls Restroom, and Music Room Closet**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **P**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation (ABATED)**  
MATERIAL LOCATION: **1909 Addition: Girls Restroom, and Music Room Closet**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q**  
MATERIAL DESCRIPTION: **Magblock Elbow Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1909 Addition: Basement, Engine Room, Corridor, Girls Restroom, 2nd and 3rd Floor Toilets**

MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **Q**  
MATERIAL DESCRIPTION: **Magblock Elbow Insulation**  
MATERIAL LOCATION: **1909 Addition: Basement, Engine Room, Corridor, Girls Restroom, 2nd and 3rd Floor Toilets**  
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **R**  
MATERIAL DESCRIPTION: **Cardboard Elbow Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1909 Addition: Engine Room, Girls Restroom**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_



Date: 04/12/2016

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **R**  
MATERIAL DESCRIPTION: **Cardboard Elbow Insulation**  
MATERIAL LOCATION: **1909 Addition: Engine Room, Girls Restroom**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_



Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **S**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation DEMOLISHED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Field House- DEMOLISHED 2004**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **S**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation DEMOLISHED**  
MATERIAL LOCATION: **Field House- DEMOLISHED 2004**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **T**  
MATERIAL DESCRIPTION: **Aircell Pipe Elbow Insulation DEMOLISHED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:  
DISTURBANCE POTENTIAL:  
MATERIAL LOCATION: **Field House: DEMOLISHED IN 2004**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:  
COMMENTS:

Inspector's Signature:



Date: **04/12/2016**



# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **T**  
MATERIAL DESCRIPTION: **Aircell Pipe Elbow Insulation DEMOLISHED**  
MATERIAL LOCATION: **Field House: DEMOLISHED IN 2004**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **U**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation DEMOLISHED 2004**  
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:  
DISTURBANCE POTENTIAL:  
MATERIAL LOCATION: **Field House: N. Room, Utility Room - DEMOLISHED 2004**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:  
COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUILDING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **U**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation DEMOLISHED 2004**  
MATERIAL LOCATION: **Field House: N. Room, Utility Room - DEMOLISHED 2004**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
2016 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Wayne Gardner**  
SCHOOL NAME: **Gallistel Language Academy** INSPECTION DATE: **4/12/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **V**  
MATERIAL DESCRIPTION: **Cardboard Pipe Elbow Insulation DEMOLISHED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:  
DISTURBANCE POTENTIAL:  
MATERIAL LOCATION: **Field House: DEMOLISHED IN 2004**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:  
COMMENTS:

Inspector's Signature:



Date: **04/12/2016**

# Chicago Public Schools

## GSG Consultants, Inc. 2016 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **29091** BUIDLING ID: **3490**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Jigar Shah**  
SCHOOL NAME: **Gallistel Language Academy** REVIEW DATE: **8/4/2016**  
ADDRESS: **10347 S. Ewing** IDPH LICENSE NO: **100-19039**

---

HOMOGENEOUS AREA: **V**  
MATERIAL DESCRIPTION: **Cardboard Pipe Elbow Insulation DEMOLISHED**  
MATERIAL LOCATION: **Field House: DEMOLISHED IN 2004**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_

*Jigar Shah*

Date: **08/04/2016**

# Chicago Public Schools

GSG Consultants, Inc.  
*2016 AHERA REINSPECTION*

# APPENDIX B

## Inspector and Management Planner Licenses

---



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

4/20/2016

**DELORES FITZPATRICK**  
855 WEST ADAMS, SUITE 200  
CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 05183

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

**COPY OF THE ASBESTOS PROFESSIONAL LICENSE**

Front of License

Back of License

		<b>ASBESTOS PROFESSIONAL LICENSE</b>		<b>ENDORSEMENTS</b>	<b>TC EXPIRES</b>
<b>ID NUMBER</b> 00 - 05183	<b>ISSUED</b> 4/20/2016	<b>EXPIRES</b> 05/15/2017		INSPECTOR	2/13/2017
<b>DELORES FITZPATRICK</b> 855 WEST ADAMS, SUITE 200 CHICAGO, IL 60607 Environmental Health				PROJECT MANAGER AIR SAMPLING PROFESSIONAL	2/6/2017
				<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**  
*Nationally Accredited by PHA/E*



# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that WAYNE GARDNER  
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the  
examination on 02/13/2016 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

02/13/2016

Course Dates:

02/13/2017

Expires:

1602BIR14

Certificate Number:




A handwritten signature in black ink, appearing to read "N. Peneff".

Director of Training  
Nicholas J. Peneff  
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

2016

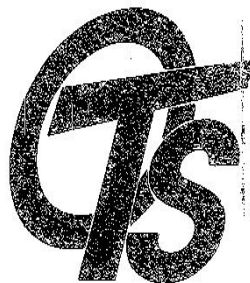

**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Jigar Shah**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016

Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270320

  
Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.idph.illinois.gov

4/20/2016

**JIGAR M SHAH**  
855 W ADAMS ST, SUITE 200  
CHICAGO, IL 60607

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 07342

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

**COPY OF THE ASBESTOS PROFESSIONAL LICENSE**

Front of License

Back of License

		<b>ASBESTOS PROFESSIONAL LICENSE</b>		<b>ENDORSEMENTS</b>	<b>TC EXPIRES</b>
<b>ID NUMBER</b> 109 - 07342	<b>ISSUED</b> 4/20/2016	<b>EXPIRES</b> 05/15/2017		INSPECTOR PROJECT DESIGNER MANAGEMENT PLANNER PROJECT MANAGER AIR SAMPLING PROFESSIONAL	1/19/2017 2/2/2017 1/27/2017 2/26/2017
<b>JIGAR M SHAH</b> 855 W ADAMS ST, SUITE 200 CHICAGO, IL 60607 Environmental Health				<b>Alteration of this license shall result in legal action</b> This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: [dph.illinois.gov/topics-services/environmental-health-protection/asbestos](http://dph.illinois.gov/topics-services/environmental-health-protection/asbestos)  
EMAIL Address: [dph.asbestos@illinois.gov](mailto:dph.asbestos@illinois.gov)

**PROTECTING HEALTH, IMPROVING LIVES**  
*Nationally Accredited by PHAB*

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed