

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0015
SCHOOL NAME: Gage Park High School
ADDRESS OF SCHOOL: 5630 S. Rockwell
CITY: Chicago, IL, 60629

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/25/2013**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/4/2016 ENROLLMENT 290
IDPH INSPECTOR LICENSE NUMBER: 100-08864
IDPH LICENSED INSPECTOR NAME (Please Print): Robert DeBord
IDPH MP LICENSE NUMBER: 100-19466
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



4/4/2016

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Gage Park High School

5630 S. Rockwell
Chicago, IL, 60629

Unit: 46141
Building ID: 1340

IDPH ID Number: 14-016-2990-0015

REPORT DATE:

Monday, April 04, 2016

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

March 7, 2016

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 46141 Region: 04 IDPH ID: 14-016-2990-0015

School: Gage Park High School Building ID: 1340

Address: 5630 S. Rockwell

Chicago, IL, 60629

Building Contact: Parma, Denis

Contact Phone: 773-671-2777

Current Building Owners: Chicago Public Schools

Review Date: 04/04/2016

Inspector: Robert DeBord

Inspector IDPH License: 100-08864

Management Planner: Evan Christian

Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates

Evan Christian
100-19466

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 07, 2016

RE: Gage Park High School, Unit 46141
5630 S. Rockwell
Chicago, IL, 60629

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Gage Park High School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Gage Park High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Gage Park High School Unit: 46141 Region: 04
Address: 5630 S. Rockwell Chicago, IL, 60629
IDPH ID: 14-016-2990-0015 Building ID: 1340
Contact: Parma, Denis Phone: 773-671-2777

2. Description of Facility

Original Construction: Additional Construction:
Total Square Footage: 1440 No of Floors:
Current Occupancy: 290

3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603

4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Robert DeBord

Inspector IDPH license # 100-08864

Signature:
Date: 3/7/2016

6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466

Signature:
Date: 04/04/2016

7. Review Date: 04/04/2016

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 4/4/2016

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Gage Park High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1340:

25C	12x12 flesh w/tan & white specks floor tile
26C	12x12 flesh w/tan & white flr tile mastic
34	12" x 12" Beige w/ Dark Beige Spots Floor Tile
35	Mastic Associated w/ 12" x 12" Beige w/ Dark Beige Spots Floor Tile
36	12" x 12" Dark Beige w/ White Specks Floor Tile
37	Mastic Associated w/ 12" x 12" Dark Beige w/ White Specks Floor Tile
A(46)	air cell pipe insulation
D	mag block on heat excahnger

J	Aircell hard joints
M	2x4 ACT
X	2'x2' S. ACT-WHITE

B. The following new homogenous areas have been identified for Building 1340:

- 34 12" x 12" Beige w/ Dark Beige Spots Floor Tile
- 35 Mastic Associated w/ 12" x 12" Beige w/ Dark
Beige Spots Floor Tile
- 36 12" x 12" Dark Beige w/ White Specks Floor Tile
- 37 Mastic Associated w/ 12" x 12" Dark Beige w/
White Specks Floor Tile

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

25	12x12 light green w/dark green specks floor tile
25A	12x12 rose specked floor tile
25B	12x12 black w/white specks floor tile
25C	12x12 flesh w/tan & white specks floor tile
26	12x12 lt green w/dk green specks floor tile mastic
26A	12x12 rose specked floor tile mastic
26B	12x12 black w/white specks floor tile mastic
28/08	9x18 black floor tile mastic
28/10	9x9 rose w/white streaks floor tile mastic
28/24	12x12 white w/brown spots floor tile mastic
33	pink & tweed green carpet mastic
33A	12x12 burgandy tweed carpet mastic
33B	pea green carpet mastic
33C	gold carpet mastic
34	12" x 12" Beige w/ Dark Beige Spots Floor Tile
35	Mastic Associated w/ 12" x 12" Beige w/ Dark Beige Spots Floor Tile
36	12" x 12" Dark Beige w/ White Specks Floor Tile
37	Mastic Associated w/ 12" x 12" Dark Beige w/ White Specks Floor Tile
E	FG hard joints
F	white 12x12 VFT
G	mastic for white 12x12 VFT
H	Gray carpet mastic
I	Air cell pipe insulation
J	Aircell hard joints
K	1x1 ACT
L	1x1 act mastic
M	2x4 ACT
N	12"x12" VFT WHITE W/ BEIGE SPECS
N-1	12"x12" VFT WHITE W/ BEIGE SPECKS-MASTIC
O	12X12 VFT white w/ tan specks
O-1	12X12 VFT WHITE W/ TAN SPECKS- MASTIC
P	12x12 VFT dark red w/ red specks
P-1	12X12 VFT DARK RED W/ RED SPECKS-MASTIC
Q	12x12 TAN W/ BROWN SPECS VFT
Q-1	12x12 TAN W/ BROWN SPEC VFT-MASTIC
R	12x12 BROWN W/ WHITE SPECS VFT
R/S-1	MASTIC FOR 12x12 TILE (HA 'R' & 'S')
S	12x12 WHITE W/ BEIGE SPECS VFT

T	12x12 DARK RED VFT
T/U-1	MASTIC FOR 12x12 VFT (HA 'T' & 'U')
U	12x12 WHITE W/ GRAY STREAKS
V	12x12 BROWN W/ WHITE SPECS VFT
V-1	MASTIC FOR 12x12 BROWN W/ WHITE SPECS VFT
W	12x12 VFT WHITE W/ BROWN SPECS
W-1	12x12 VFT WHITE W/ BROWN SPECS-MASTIC
X	2'x2' S. ACT-WHITE
Y	DRYWALL

The following areas were deemed to be inaccessible:

26	12x12 lt green w/dk green specks floor tile mastic
26C	12x12 flesh w/tan & white flr tile mastic
27/16	9x9 light tan w/brown & white streaks floor tile-
28/17	9x9 red w/white streaks floor tile mastic
28/18	9x9 drk brwn w/white & gold streak flr tile mastic
28/19	12X12 white w/brown streaks
28/22	9x9 gray green floor tile mastic
28/24	12x12 white w/brown spots floor tile mastic
35	Mastic Associated w/ 12" x 12" Beige w/ Dark Beige Spots Floor Tile
37	Mastic Associated w/ 12" x 12" Dark Beige w/ White Specks Floor Tile
E	FG hard joints
FTM-1	12x12 beige vft mastic
FTM-2	12x12 w/white streak and burgandy parameter mastic
I	Air cell pipe insulation
K	1x1 ACT
L	1x1 act mastic
N-1	12"x12" VFT WHITE W/ BEIGE SPECKS-MASTIC
O-1	12X12 VFT WHITE W/ TAN SPECKS- MASTIC
P-1	12X12 VFT DARK RED W/ RED SPECKS-MASTIC
Q-1	12x12 TAN W/ BROWN SPEC VFT-MASTIC
R/S-1	MASTIC FOR 12x12 TILE (HA 'R' & 'S')
T/U-1	MASTIC FOR 12x12 VFT (HA 'T' & 'U')
V-1	MASTIC FOR 12x12 BROWN W/ WHITE SPECS VFT
W-1	12x12 VFT WHITE W/ BROWN SPECS-MASTIC

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Robert DeBord, IDPH License # 100-08864. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Gage Park High School Building 1340 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Gage Park High School Unit 46141 Building ID 1340

Address 5630 S. Rockwell Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
25	12x12 light green w/dark green specks floor tile	400	SF	room 128	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25A	12x12 rose specked floor tile	200	SF	main office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25B	12x12 black w/white specks floor tile	350	SF	room 216, auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25C	12x12 flesh w/tan & white specks floor tile	1,125	SF	room 221	ASSUMED	MISC	N	LOC	12		Yes	ACBM with the potential for damage	5	LOW
26	12x12 lt green w/dk green specks floor tile mastic	400	SF	room 128	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26A	12x12 rose specked floor tile mastic			main office	ASSUMED	MISC								
26B	12x12 black w/white specks floor tile mastic			room 216, auditorium	ASSUMED	MISC								
26C	12x12 flesh w/tan & white flr tile mastic	1,120	SF	room 221	CHR	MISC	N	LOC	12		Yes	ACBM with the potential for damage	5	LOW
27/06	9x9 black floor tile			1st, 2nd & 3rd floor corridors	CHR	MISC								
27/07	9x9 maroon floor tile			1st, 2nd & 3rd floor corridors, Auditorium.	CHR	MISC								
27/08	9x18 black floor tile			2nd & 3rd floor corridors	CHR	MISC								
27/09	9x9 black w/white streaks floor tile			engineer's locker room, patched areas	CHR	MISC								
27/10	9x9 rose w/white streak floor tile			engineers office corridor	CHR	MISC								
27/14	9x9 chocolate brown w/ white streak floor tile			1st,2nd, 3rd floor corridors-abated	CHR	MISC								
27/16	9x9 light tan w/brown & white streaks floor tile-	523	SF	room 121-material removed.	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27/17	9x9 red w/white streaks floor tile	325	SF	POLICE OFFICE, engineer's office, engineer's locker room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27/18	9x9 dark brown w/white and gold streaks floor tile	259	SF	corridor outside engineer's office, POLICE OFFICE	CHR	MISC	N	NONE	0		No	ACBM with potential for significant damage		LOW
27/19	9x9 olive floor tile w/white streaks			engineer's office	CHR	MISC								
27/22	9x9 black & white floor tile	265	SF	girls' coaches office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27/23	9x9 black and white floor tile	96	SF	girls exam room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27/24	12x12 white w/brown spots floor tile	1,825	SF	rooms 216, 217a, 225, 305, 222	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Gage Park High School Unit 46141 Building ID 1340

Address 5630 S. Rockwell Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
33B	pea green carpet mastic			room 216	ASSUMED	MISC								
33C	gold carpet mastic			room 113	ASSUMED	MISC								
34	12" x 12" Beige w/ Dark Beige Spots Floor Tile	1,120	SF	Room 307	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
35	Mastic Associated w/ 12" x 12" Beige w/ Dark Beige Spots Floor Tile	1,120	SF	Room 307	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
36	12" x 12" Dark Beige w/ White Specks Floor Tile	1,650	SF	Driver's ED Trailer	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
37	Mastic Associated w/ 12" x 12" Dark Beige w/ White Specks Floor Tile	1,650	SF	Driver's ED Trailer	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
A(46)	air cell pipe insulation	250	LF	basement	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
AA	DRYWALL (Trailer Demolished 2011)			ALL WALLS AND CEILINGS IN 2 CLASSROOMS TRAILER ON NORTH SIDE OF SCHOOL	ABATED	MISC								
B(45)	aircell hard joints-abated.			boiler room, basement, rest rooms	ABATED	TSI								
D	mag block on heat exchanger	120	LF	basement pool chemical room	AMO	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
E	FG hard joints	195	LF	basement unexcavated area, boiler room, mechanical room	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
F	white 12x12 VFT	720	SF	Room 221	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-1	12x12 beige vft	3,700	SF	Rm 216, 221, 222, 217A, 225, 307, teacher's lounge, Principal's office, rm 123, Asst. Principal's office, parm, 113, 125	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FT-2	12x12 w/white streak and burgundy 12x12 parameter	9,400	SF	1st, 2nd & 3rd fl. Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
FTM-1	12x12 beige vft mastic	3,700	SF	Rm 216, 221, 222, 217A, 225, 307, teacher's lounge, principal's office,	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Gage Park High School Unit 46141 Building ID 1340

Address 5630 S. Rockwell Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				asst. principal's office, rm 123, parm, 113, 125										
FTM-2	12x12 w/white streak and burgundy parameter mastic	9,400	SF	1st, 2nd & 3rd fl corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
G	mastic for white 12x12 VFT	720	SF	room 221	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
H	Gray carpet mastic			Room 125	ASSUMED	MISC								
I	Air cell pipe insulation	250	LF	basement.	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
J	Aircell hard joints	35	LF	boiler room, basement, rest rooms	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
K	1x1 ACT	20,000	SF	1st, 2nd, 3rd floor corridors and lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
L	1x1 act mastic	20,000	SF	1st, 2nd, 3rd floor corridors and lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
M	2x4 ACT	15,000	SF	all classrooms on 1st, 2nd and 3rd	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
N	12"x12" VFT WHITE W/ BEIGE SPECS	1,500	SF	ROOM 121 & 125	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
N-1	12"x12" VFT WHITE W/ BEIGE SPECKS- MASTIC	1,600	SF	ROOMS 121 & 125	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
O	12X12 VFT white w/ tan specks	23,500	SF	1st, 2nd, 3rd floor hallways, auditorium, eng's office, Rm 126, 117, 124, girls & boys dean's office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
O-1	12X12 VFT WHITE W/ TAN SPECKS- MASTIC	23,500	SF	1st, 2nd, 3rd floor hallways, auditorium, eng's office, Rm 126, 117, 124, girls & boys dean's office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
P	12x12 VFT dark red w/ red specks	4,000	SF	perimeter of 1st, 2nd and 3rd floor hallways, & auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
P-1	12X12 VFT DARK RED W/ RED SPECKS-MASTIC	4,000	SF	PERIMETER OF 1ST, 2ND & 3RD FLOOR	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Gage Park High School Unit 46141 Building ID 1340

Address 5630 S. Rockwell Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				HALLWAYS										
Q	12x12 TAN W/ BROWN SPECS VFT	650	SF	ROOM 222	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
Q-1	12x12 TAN W/ BROWN SPEC VFT-MASTIC	650	SF	ROOM 222	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
R	12x12 BROWN W/ WHITE SPECS VFT	700	SF	ROOM 305 & 303	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
R/S-1	MASTIC FOR 12x12 TILE (HA 'R' & 'S')	1,400	SF	ROOM 305 & 303	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
S	12x12 WHITE W/ BEIGE SPECS VFT	700	SF	ROOM 305 & 303	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
T	12x12 DARK RED VFT	2,950	SF	LUNCHROOM, ROOMS 330, 332	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
T/U-1	MASTIC FOR 12x12 VFT (HA 'T' & 'U')	5,900	SF	LUNCHROOM, ROOMS 330, 332	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
U	12x12 WHITE W/ GRAY STREAKS	2,950	SF	LUNCHROOM, ROOMS 330, 332	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
V	12x12 BROWN W/ WHITE SPECS VFT	790	SF	ROOM 115	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
V-1	MASTIC FOR 12x12 BROWN W/ WHITE SPECS VFT	790	SF	ROOM 115	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
W	12x12 VFT WHITE W/ BROWN SPECS	7,830	SF	ROOMS 990, 991,992, 993,994,995,996,997 & HALLWAYS,MEN, WOMEN,BOY & GIRL TOILETS (ALL IN W. TRAILER)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
W-1	12x12 VFT WHITE W/ BROWN SPECS-MASTIC	7,830	SF	ROOMS 990, 991,992, 993,994,995,996,997 & HALLWAYS,MEN, WOMEN,BOY & GIRL TOILETS (ALL IN W. TRAILER)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
X	2'x2' S. ACT-WHITE	7,830	SF	ALL CEILING OF WEST TRAILER	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
Y	DRYWALL	19,100	SF	ALL WALLS AND ABOVE S. ACT IN	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Gage Park High School Unit 46141 Building ID 1340

Address 5630 S. Rockwell Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 3/7/2016
Inspector Name Robert DeBord
100-08864 5/15/2016
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
25	
25A	
25B	
25C	Damage is located in Room 221
26	
26A	Not observed 2016
26B	Not observed 2016
26C	Damage is located in Room 221
27/06	Not observed 2016
27/07	Not observed 2016
27/08	Not observed 2016
27/09	Not observed 2016
27/10	Not observed 2016
27/14	Not observed 2016
27/16	
27/17	
27/18	
27/19	Not observed 2016
27/22	
27/23	
27/24	
27/27	Not observed 2016
27/28	Not observed 2016
28/06	Not observed 2016

Chicago Public Schools

School Gage Park High School Unit 46141 Building ID 1340

Address 5630 S. Rockwell Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
28/07	Not observed 2016
28/08	Not observed 2016
28/09	
28/10	Not observed 2016
28/14	Not observed 2016
28/17	
28/18	
28/19	
28/22	
28/24	
28/27	Not observed 2016
28/28	Not observed 2016
29	
30	
33	Not observed 2016
33A	Not observed 2016
33B	Not observed 2016
33C	Not observed 2016
34	
35	
36	
37	
A(46)	
AA	
B(45)	
D	
E	
F	
FT-1	

Chicago Public Schools

School Gage Park High School Unit 46141 Building ID 1340

Address 5630 S. Rockwell Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
FT-2	
FTM-1	
FTM-2	
G	
H	Not observed 2016
I	
J	
K	
L	
M	
N	
N-1	
O	
O-1	
P	
P-1	
Q	
Q-1	
R	
R/S-1	
S	
T	
T/U-1	
U	
V	
V-1	
W	
W-1	
X	

Chicago Public Schools

School Gage Park High School Unit 46141 Building ID 1340

Address 5630 S. Rockwell Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
Y	
Z	
Z-1	

Table II

Management Planner's Review

Chicago Public Schools

School Gage Park High School

Unit 46141

Building ID 1340

Address 5630 S. Rockwell

Chicago, IL, 60629

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
25	12x12 light green w/dark green specks floor tile	400	SF	room 128	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25A	12x12 rose specked floor tile	200	SF	main office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25B	12x12 black w/white specks floor tile	350	SF	room 216, auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25C	12x12 flesh w/tan & white specks floor tile	1,125	SF	room 221	Assumed	MISC	No	12	SF	6 ACBM with the potential for damage	Repair
26	12x12 lt green w/dk green specks floor tile mastic	400	SF	room 128	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26A	12x12 rose specked floor tile mastic			main office	Assumed	MISC					Follow O&M Plan
26B	12x12 black w/white specks floor tile mastic			room 216, auditorium	Assumed	MISC					Follow O&M Plan
26C	12x12 flesh w/tan & white flr tile mastic	1,120	SF	room 221	Chrysotile	MISC	No	12	SF	6 ACBM with the potential for damage	Repair
27/06	9x9 black floor tile			1st, 2nd & 3rd floor corridors	Chrysotile	MISC					Follow O&M Plan
27/07	9x9 maroon floor tile			1st, 2nd & 3rd floor corridors, Auditorium.	Chrysotile	MISC					Follow O&M Plan
27/08	9x18 black floor tile			2nd & 3rd floor corridors	Chrysotile	MISC					Follow O&M Plan
27/09	9x9 black w/white streaks floor tile			engineer's locker room, patched areas	Chrysotile	MISC					Follow O&M Plan
27/10	9x9 rose w/white streak floor tile			engineers office corridor	Chrysotile	MISC					Follow O&M Plan
27/14	9x9 chocolate brown w/ white streak floor tile			1st,2nd, 3rd floor corridors-abated	Chrysotile	MISC					Follow O&M Plan
27/16	9x9 light tan w/brown & white streaks floor tile-	523	SF	room 121-material removed.	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27/17	9x9 red w/white streaks floor tile	325	SF	POLICE OFFICE, engineer's office, engineer's locker room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27/18	9x9 dark brown w/white and gold streaks floor tile	259	SF	corridor outside engineer's office, POLICE OFFICE	Chrysotile	MISC	No	0	SF	5 ACBM with potential for significant damage	Follow O&M Plan
27/19	9x9 olive floor tile w/white streaks			engineer's office	Chrysotile	MISC					Follow O&M Plan
27/22	9x9 black & white floor tile	265	SF	girls' coaches office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27/23	9x9 black and white floor tile	96	SF	girls exam room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27/24	12x12 white w/brown spots floor tile	1,825	SF	rooms 216, 217a, 225, 305, 222 (TEACHER'S LOUNGE)	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27/27	9x9 tan leopard floor tile			room 302	Chrysotile	MISC					Follow O&M Plan
27/28	9x9 brown leopard floor tile			room 307	Chrysotile	MISC					Follow O&M Plan
28/06	9x9 black floor tile mastic, with HA 27/6			1st, 2nd & 3rd floor corridors	Chrysotile	MISC					Follow O&M Plan
28/07	9x9 maroon floor tile mastic, with HA 27/7			1st, 2nd & 3rd floor corridors, auditorium.	Chrysotile	MISC					Follow O&M Plan
28/08	9x18 black floor tile mastic			1st, 2nd & 3rd floor corridors	Assumed	MISC					Follow O&M Plan
28/09	9x9 chocolate brown w/white streaks floor tile mastic	300	SF	engineer's locker room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28/10	9x9 rose w/white streaks floor tile mastic			1st & 2nd,3rd floor corridors, patched areas	Assumed	MISC					Follow O&M Plan

Chicago Public Schools

School Gage Park High School
Address 5630 S. Rockwell

Unit 46141
 Chicago, IL, 60629

Building ID 1340
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
28/14	9x9 chocolate brown w/white streak flr tile mastic			1st,2nd,3rd floor corridors	Chrysotile	MISC					Follow O&M Plan
28/17	9x9 red w/white streaks floor tile mastic	325	SF	Police office, engineer's office, engineer's locker room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28/18	9x9 drk brwn w/white & gold streak flr tile mastic	259	SF	corridor outside engineer's office, police office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28/19	12X12 white w/brown streaks	134	SF	engineer's office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28/22	9x9 gray green floor tile mastic	248	SF	girls' coaches office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28/24	12x12 white w/brown spots floor tile mastic	1,825	SF	rooms 216, 225, 305	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28/27	9x9 tan leopard floor tile mastic			room 307	Chrysotile	MISC					Follow O&M Plan
28/28	9x9 brown leopard floor tile mastic			room 307	Chrysotile	MISC					Follow O&M Plan
29	transite table tops	200	SF	rm 321, 322, 317, 213, 215, 217, 217a	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	transite lab hood	20	SF	room 317	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	pink & tweed green carpet mastic			rm 124, 125, 128, assistant principal's office	Assumed	MISC					Follow O&M Plan
33A	12x12 burgandy tweed carpet mastic			rm 120,126, 123, 117, 222, principal's office, PARM, assembly hall,	Assumed	MISC					Follow O&M Plan
33B	pea green carpet mastic			room 216	Assumed	MISC					Follow O&M Plan
33C	gold carpet mastic			room 113	Assumed	MISC					Follow O&M Plan
34	12" x 12" Beige w/ Dark Beige Spots Floor Tile	1,120	SF	Room 307	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	Mastic Associated w/ 12" x 12" Beige w/ Dark Beige Spots Floor Tile	1,120	SF	Room 307	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12" x 12" Dark Beige w/ White Specks Floor Tile	1,650	SF	Driver's ED Trailer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Mastic Associated w/ 12" x 12" Dark Beige w/ White Specks Floor Tile	1,650	SF	Driver's ED Trailer	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A(46)	air cell pipe insulation	250	LF	basement	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
AA	DRYWALL (Trailer Demolished 2011)			ALL WALLS AND CEILINGS IN 2 CLASSROOMS TRAILER ON NORTH SIDE OF SCHOOL	Abated	MISC					
B(45)	aircell hard joints-abated.			boiler room, basement, rest rooms	Abated	TSI					
D	mag block on heat excahnger	120	LF	basement pool chemical room	Amosite	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
E	FG hard joints	195	LF	basement unexcavated area, boiler room, mechanical room	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
F	white 12x12 VFT	720	SF	Room 221	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FT-1	12x12 beige vft	3,700	SF	Rm 216, 221, 222, 217A, 225, 307,	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Gage Park High School

Unit 46141

Building ID 1340

Address 5630 S. Rockwell

Chicago, IL, 60629

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				teacher's lounge, Principal's office, rm 123, Asst. Principal's office, parm, 113, 125							
FT-2	12x12 w/white streak and burgundy 12x12 parameter	9,400	SF	1st, 2nd & 3rd fl. Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-1	12x12 beige vft mastic	3,700	SF	Rm 216, 221, 222, 217A, 225, 307, teacher's lounge, principal's office, asst. principal's office, rm 123, parm, 113, 125	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
FTM-2	12x12 w/white streak and burgundy parameter mastic	9,400	SF	1st, 2nd & 3rd fl corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
G	mastic for white 12x12 VFT	720	SF	room 221	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
H	Gray carpet mastic			Room 125	Assumed	MISC					Follow O&M Plan
I	Air cell pipe insulation	250	LF	basement.	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
J	Aircell hard joints	35	LF	boiler room, basement, rest rooms	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
K	1x1 ACT	20,000	SF	1st, 2nd, 3rd floor corriors and lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
L	1x1 act mastic	20,000	SF	1st, 2nd, 3rd floor corriors and lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
M	2x4 ACT	15,000	SF	all classrooms on 1st,2nd and 3rd	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
N	12"x12" VFT WHITE W/ BEIGE SPECS	1,500	SF	ROOM 121 & 125	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
N-1	12"x12" VFT WHITE W/ BEIGE SPECKS- MASTIC	1,600	SF	ROOMS 121 & 125	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
O	12X12 VFT white w/ tan specks	23,500	SF	1st,2nd,3rd floor hallways,auditorium,eng's office,Rm 126,117,124, girls & boys dean's office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
O-1	12X12 VFT WHITE W/ TAN SPECKS- MASTIC	23,500	SF	1st,2nd,3rd floor hallways,auditorium,eng's office,Rm 126,117,124, girls & boys dean's office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
P	12x12 VFT dark red w/ red specks	4,000	SF	perimeter of 1st, 2nd and 3rd floor hallways, & auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
P-1	12X12 VFT DARK RED W/ RED SPECKS-MASTIC	4,000	SF	PERIMETER OF 1ST, 2ND & 3RD FLOOR HALLWAYS	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Q	12x12 TAN W/ BROWN SPECS VFT	650	SF	ROOM 222	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Gage Park High School

Unit 46141

Building ID 1340

Address 5630 S. Rockwell

Chicago, IL, 60629

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
Q-1	12x12 TAN W/ BROWN SPEC VFT-MASTIC	650	SF	ROOM 222	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
R	12x12 BROWN W/ WHITE SPECS VFT	700	SF	ROOM 305 & 303	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
R/S-1	MASTIC FOR 12x12 TILE (HA 'R' & 'S')	1,400	SF	ROOM 305 & 303	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
S	12x12 WHITE W/ BEIGE SPECS VFT	700	SF	ROOM 305 & 303	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
T	12x12 DARK RED VFT	2,950	SF	LUNCHROOM, ROOMS 330, 332	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
T/U-1	MASTIC FOR 12x12 VFT (HA 'T' & 'U')	5,900	SF	LUNCHROOM, ROOMS 330, 332	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
U	12x12 WHITE W/ GRAY STREAKS	2,950	SF	LUNCHROOM, ROOMS 330, 332	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
V	12x12 BROWN W/ WHITE SPECS VFT	790	SF	ROOM 115	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
V-1	MASTIC FOR 12x12 BROWN W/ WHITE SPECS VFT	790	SF	ROOM 115	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
W	12x12 VFT WHITE W/ BROWN SPECS	7,830	SF	ROOMS 990, 991,992, 993,994,995,996,997 & HALLWAYS,MEN,WOMEN,BOY & GIRL TOILETS (ALL IN W. TRAILER)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
W-1	12x12 VFT WHITE W/ BROWN SPECS-MASTIC	7,830	SF	ROOMS 990, 991,992, 993,994,995,996,997 & HALLWAYS,MEN,WOMEN,BOY & GIRL TOILETS (ALL IN W. TRAILER)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
X	2'x2' S. ACT-WHITE	7,830	SF	ALL CEILING OF WEST TRAILER	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
Y	DRYWALL	19,100	SF	ALL WALLS AND ABOVE S. ACT IN WEST TRAILER	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
Z	12x12 VFT WHITE W/ TAN SPECS (Building Demolished 2011)			2 CLASSROOM TRAILER ON NORTH SIDE OF SCHOOL BLDG	Abated	MISC					
Z-1	12x12 VFT WHITE W/ TAN SPECS-MASTIC (Building Demolished 2011)			2 CLASSROOM TRAILER ON NORTH SIDE OF SCHOOL BLDG	Abated	MISC					

Chicago Public Schools

School Gage Park High School
Address 5630 S. Rockwell

Unit 46141
 Chicago, IL, 60629

Building ID 1340
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	4/4/2016
Manager Planner Name	Evan Christian
100-19466	5/15/2016
Manager IDPH License No/Expiration	

HA Number	Management Comments
25	
25A	
25B	
25C	Repair as needed then follow O&M plan.
26	
26A	If identified follow O&M plan.
26B	If identified follow O&M plan.
26C	Repair as needed then follow O&M plan.
27/06	If identified follow O&M plan.
27/07	If identified follow O&M plan.
27/08	If identified follow O&M plan.
27/09	If identified follow O&M plan.
27/10	If identified follow O&M plan.

Chicago Public Schools

School Gage Park High School

Unit 46141

Building ID 1340

Address 5630 S. Rockwell

Chicago, IL, 60629

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
27/14	If identified follow O&M plan.
27/16	
27/17	
27/18	
27/19	If identified follow O&M plan.
27/22	
27/23	
27/24	
27/27	If identified follow O&M plan.
27/28	If identified follow O&M plan.
28/06	If identified follow O&M plan.
28/07	If identified follow O&M plan.
28/08	If identified follow O&M plan.
28/09	
28/10	If identified follow O&M plan.
28/14	If identified follow O&M plan.
28/17	
28/18	
28/19	
28/22	
28/24	
28/27	If identified follow O&M plan.
28/28	If identified follow O&M plan.
29	
30	
33	If identified follow O&M plan.
33A	If identified follow O&M plan.

Chicago Public Schools

School Gage Park High School
Address 5630 S. Rockwell

Unit 46141
 Chicago, IL, 60629

Building ID 1340
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
33B	If identified follow O&M plan.
33C	If identified follow O&M plan.
34	
35	
36	
37	
A(46)	
AA	If identified follow O&M plan.
B(45)	If identified follow O&M plan.
D	
E	
F	
FT-1	
FT-2	
FTM-1	
FTM-2	
G	
H	If identified follow O&M plan.
I	
J	
K	
L	
M	
N	
N-1	
O	
O-1	

Chicago Public Schools

School Gage Park High School
Address 5630 S. Rockwell

Unit 46141
 Chicago, IL, 60629

Building ID 1340
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
P	
P-1	
Q	
Q-1	
R	
R/S-1	
S	
T	
T/U-1	
U	
V	
V-1	
W	
W-1	
X	
Y	
Z	If identified follow O&M plan.
Z-1	If identified follow O&M plan.

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **12x12 light green w/dark green specks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **room 128**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **12x12 light green w/dark green specks floor tile**

MATERIAL LOCATION: **room 128**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25A**
MATERIAL DESCRIPTION: **12x12 rose specked floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **main office**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **25A**
MATERIAL DESCRIPTION: **12x12 rose specked floor tile**
MATERIAL LOCATION: **main office**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25B**
MATERIAL DESCRIPTION: **12x12 black w/white specks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **room 216, auditorium**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **25B**
MATERIAL DESCRIPTION: **12x12 black w/white specks floor tile**
MATERIAL LOCATION: **room 216, auditorium**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25C**
MATERIAL DESCRIPTION: **12x12 flesh w/tan & white specks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **room 221**
MATERIAL QUANTITY: **1125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in Room 221**

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **25C**
MATERIAL DESCRIPTION: **12x12 flesh w/tan & white specks floor tile**
MATERIAL LOCATION: **room 221**
MATERIAL QUANTITY: **1125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **12** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **12x12 lt green w/dk green specks floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **room 128**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **12x12 lt green w/dk green specks floor tile mastic**

MATERIAL LOCATION: **room 128**

MATERIAL QUANTITY: **400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26A**
MATERIAL DESCRIPTION: **12x12 rose specked floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **main office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **26A**

MATERIAL DESCRIPTION: **12x12 rose specked floor tile mastic**

MATERIAL LOCATION: **main office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26B**
MATERIAL DESCRIPTION: **12x12 black w/white specks floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 216, auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **26B**

MATERIAL DESCRIPTION: **12x12 black w/white specks floor tile mastic**

MATERIAL LOCATION: **room 216, auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26C**
MATERIAL DESCRIPTION: **12x12 flesh w/tan & white flr tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **room 221**
MATERIAL QUANTITY: **1120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in Room 221**

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **26C**
MATERIAL DESCRIPTION: **12x12 flesh w/tan & white flr tile mastic**
MATERIAL LOCATION: **room 221**
MATERIAL QUANTITY: **1120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **12** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/06**
MATERIAL DESCRIPTION: **9x9 black floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd & 3rd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/06**

MATERIAL DESCRIPTION: **9x9 black floor tile**

MATERIAL LOCATION: **1st, 2nd & 3rd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/07**
MATERIAL DESCRIPTION: **9x9 maroon floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd & 3rd floor corridors, Auditorium.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/07**

MATERIAL DESCRIPTION: **9x9 maroon floor tile**

MATERIAL LOCATION: **1st, 2nd & 3rd floor corridors, Auditorium.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/08**
MATERIAL DESCRIPTION: **9x18 black floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd & 3rd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/08**

MATERIAL DESCRIPTION: **9x18 black floor tile**

MATERIAL LOCATION: **2nd & 3rd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/09**
MATERIAL DESCRIPTION: **9x9 black w/white streaks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **engineer's locker room, patched areas**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/09**

MATERIAL DESCRIPTION: **9x9 black w/white streaks floor tile**

MATERIAL LOCATION: **engineer's locker room, patched areas**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/10**
MATERIAL DESCRIPTION: **9x9 rose w/white streak floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **engineers office corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/10**

MATERIAL DESCRIPTION: **9x9 rose w/white streak floor tile**

MATERIAL LOCATION: **engineers office corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/14**
MATERIAL DESCRIPTION: **9x9 chocolate brown w/ white streak floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st,2nd, 3rd floor corridors-abated**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/14**

MATERIAL DESCRIPTION: **9x9 chocolate brown w/ white streak floor tile**

MATERIAL LOCATION: **1st,2nd, 3rd floor corridors-abated**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/16**
MATERIAL DESCRIPTION: **9x9 light tan w/brown & white streaks floor tile-**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **room 121-material removed.**

MATERIAL QUANTITY: **523**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/16**

MATERIAL DESCRIPTION: **9x9 light tan w/brown & white streaks floor tile-**

MATERIAL LOCATION: **room 121-material removed.**

MATERIAL QUANTITY: **523**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/17**
MATERIAL DESCRIPTION: **9x9 red w/white streaks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **POLICE OFFICE, engineer's office, engineer's locker room**

MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/17**

MATERIAL DESCRIPTION: **9x9 red w/white streaks floor tile**

MATERIAL LOCATION: **POLICE OFFICE, engineer's office, engineer's locker room**

MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/18**
MATERIAL DESCRIPTION: **9x9 dark brown w/white and gold streaks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **5 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **5. ACBM with potential for significant damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **corridor outside engineer's office, POLICE OFFICE**

MATERIAL QUANTITY: **259** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/18**
MATERIAL DESCRIPTION: **9x9 dark brown w/white and gold streaks floor tile**
MATERIAL LOCATION: **corridor outside engineer's office, POLICE OFFICE**
MATERIAL QUANTITY: **259** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/19**
MATERIAL DESCRIPTION: **9x9 olive floor tile w/white streaks**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **engineer's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/19**

MATERIAL DESCRIPTION: **9x9 olive floor tile w/white streaks**

MATERIAL LOCATION: **engineer's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/22**
MATERIAL DESCRIPTION: **9x9 black & white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **girls' coaches office**

MATERIAL QUANTITY: **265**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/22**

MATERIAL DESCRIPTION: **9x9 black & white floor tile**

MATERIAL LOCATION: **girls' coaches office**

MATERIAL QUANTITY: **265**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/23**
MATERIAL DESCRIPTION: **9x9 black and white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **girls exam room**

MATERIAL QUANTITY: **96**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/23**

MATERIAL DESCRIPTION: **9x9 black and white floor tile**

MATERIAL LOCATION: **girls exam room**

MATERIAL QUANTITY: **96**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/24**
MATERIAL DESCRIPTION: **12x12 white w/brown spots floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **rooms 216, 217a, 225, 305, 222 (TEACHER'S LOUNGE)**

MATERIAL QUANTITY: **1825** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/24**
MATERIAL DESCRIPTION: **12x12 white w/brown spots floor tile**
MATERIAL LOCATION: **rooms 216, 217a, 225, 305, 222 (TEACHER'S LOUNGE)**
MATERIAL QUANTITY: **1825** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/27**
MATERIAL DESCRIPTION: **9x9 tan leopard floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 302**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/27**

MATERIAL DESCRIPTION: **9x9 tan leopard floor tile**

MATERIAL LOCATION: **room 302**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27/28**
MATERIAL DESCRIPTION: **9x9 brown leopard floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 307**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **27/28**

MATERIAL DESCRIPTION: **9x9 brown leopard floor tile**

MATERIAL LOCATION: **room 307**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/06**
MATERIAL DESCRIPTION: **9x9 black floor tile mastic, with HA 27/6**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd & 3rd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/06**

MATERIAL DESCRIPTION: **9x9 black floor tile mastic, with HA 27/6**

MATERIAL LOCATION: **1st, 2nd & 3rd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/07**
MATERIAL DESCRIPTION: **9x9 maroon floor tile mastic, with HA 27/7**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd & 3rd floor corridors,auditorium.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/07**

MATERIAL DESCRIPTION: **9x9 maroon floor tile mastic, with HA 2777**

MATERIAL LOCATION: **1st, 2nd & 3rd floor corridors, auditorium.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/08**
MATERIAL DESCRIPTION: **9x18 black floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd & 3rd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/08**

MATERIAL DESCRIPTION: **9x18 black floor tile mastic**

MATERIAL LOCATION: **1st, 2nd & 3rd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/09**
MATERIAL DESCRIPTION: **9x9 chocolate brown w/white streaks floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **engineer's locker room**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/09**

MATERIAL DESCRIPTION: **9x9 chocolate brown w/white streaks floor tile mastic**

MATERIAL LOCATION: **engineer's locker room**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/10**
MATERIAL DESCRIPTION: **9x9 rose w/white streaks floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st & 2nd,3rd floor corridors, patched areas**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/10**

MATERIAL DESCRIPTION: **9x9 rose w/white streaks floor tile mastic**

MATERIAL LOCATION: **1st & 2nd,3rd floor corridors, patched areas**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/14**
MATERIAL DESCRIPTION: **9x9 chocolate brown w/white streak flr tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st,2nd,3rd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/14**

MATERIAL DESCRIPTION: **9x9 chocolate brown w/white streak flr tile mastic**

MATERIAL LOCATION: **1st,2nd,3rd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/17**
MATERIAL DESCRIPTION: **9x9 red w/white streaks floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Police office, engineer's office, engineer's locker room**

MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/17**

MATERIAL DESCRIPTION: **9x9 red w/white streaks floor tile mastic**

MATERIAL LOCATION: **Police office. engineer's office, engineer's locker room**

MATERIAL QUANTITY: **325** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/18**
MATERIAL DESCRIPTION: **9x9 drk brwn w/white & gold streak flr tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Delamination**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **corridor outside engineer's office, police office**

MATERIAL QUANTITY: **259** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **259** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/18**
MATERIAL DESCRIPTION: **9x9 drk brwn w/white & gold streak flr tile mastic**
MATERIAL LOCATION: **corridor outside engineer's office, police office**
MATERIAL QUANTITY: **259** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/19**
MATERIAL DESCRIPTION: **12X12 white w/brown streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **engineer's office**

MATERIAL QUANTITY: **134**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/19**

MATERIAL DESCRIPTION: **12X12 white w/brown streaks**

MATERIAL LOCATION: **engineer's office**

MATERIAL QUANTITY: **134**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/22**
MATERIAL DESCRIPTION: **9x9 gray green floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **girls' coaches office**

MATERIAL QUANTITY: **248**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/22**

MATERIAL DESCRIPTION: **9x9 gray green floor tile mastic**

MATERIAL LOCATION: **girls' coaches office**

MATERIAL QUANTITY: **248**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUILDING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/24**
MATERIAL DESCRIPTION: **12x12 white w/brown spots floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **rooms 216, 225, 305**

MATERIAL QUANTITY: **1825**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/24**

MATERIAL DESCRIPTION: **12x12 white w/brown spots floor tile mastic**

MATERIAL LOCATION: **rooms 216, 225, 305**

MATERIAL QUANTITY: **1825**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/27**
MATERIAL DESCRIPTION: **9x9 tan leopard floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 307**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUILDING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/27**

MATERIAL DESCRIPTION: **9x9 tan leopard floor tile mastic**

MATERIAL LOCATION: **room 307**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28/28**
MATERIAL DESCRIPTION: **9x9 brown leopard floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 307**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **28/28**

MATERIAL DESCRIPTION: **9x9 brown leopard floor tile mastic**

MATERIAL LOCATION: **room 307**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **transite table tops**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **rm 321, 322, 317, 213, 215, 217, 217a**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **transite table tops**

MATERIAL LOCATION: **rm 321, 322, 317, 213, 215, 217, 217a**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **transite lab hood**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **room 317**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **transite lab hood**

MATERIAL LOCATION: **room 317**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **pink & tweed green carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **rm 124, 125, 128, assistant principal's office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **33**

MATERIAL DESCRIPTION: **pink & tweed green carpet mastic**

MATERIAL LOCATION: **rm 124, 125, 128, assistant principal's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates
2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33A**
MATERIAL DESCRIPTION: **12x12 burgandy tweed carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **rm 120,126, 123, 117, 222, principal's office, PARM, assembly hall,**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **33A**
MATERIAL DESCRIPTION: **12x12 burgandy tweed carpet mastic**
MATERIAL LOCATION: **rm 120,126, 123, 117, 222, principal's office, PARM, assembly hall,**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33B**
MATERIAL DESCRIPTION: **pea green carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 216**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **33B**

MATERIAL DESCRIPTION: **pea green carpet mastic**

MATERIAL LOCATION: **room 216**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33C**
MATERIAL DESCRIPTION: **gold carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **room 113**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **33C**

MATERIAL DESCRIPTION: **gold carpet mastic**

MATERIAL LOCATION: **room 113**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A(46)**
MATERIAL DESCRIPTION: **air cell pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **basement**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **A(46)**
MATERIAL DESCRIPTION: **air cell pipe insulation**
MATERIAL LOCATION: **basement**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **AA**
MATERIAL DESCRIPTION: **DRYWALL (Trailer Demolished 2011)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **ALL WALLS AND CEILINGS IN 2 CLASSROOMS TRAILER ON NORTH SIDE OF SCHOOL**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **AA**
MATERIAL DESCRIPTION: **DRYWALL (Trailer Demolished 2011)**
MATERIAL LOCATION: **ALL WALLS AND CEILINGS IN 2 CLASSROOMS TRAILER ON NORTH SIDE OF SCHOOL**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B(45)**
MATERIAL DESCRIPTION: **aircell hard joints-abated.**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **boiler room, basement, rest rooms**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **B(45)**

MATERIAL DESCRIPTION: **aircell hard joints-abated.**

MATERIAL LOCATION: **boiler room, basement, rest rooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **mag block on heat excahnger**
HISTORICAL AHERA DAMAGE CATEGORY **7 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Remove**
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **basement pool chemical room**

MATERIAL QUANTITY: **120**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **mag block on heat excahnger**
MATERIAL LOCATION: **basement pool chemical room**
MATERIAL QUANTITY: **120** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **FG hard joints**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **basement unexcavated area, boiler room, mechanical room**
MATERIAL QUANTITY: **195** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **E**

MATERIAL DESCRIPTION: **FG hard joints**

MATERIAL LOCATION: **basement unexcavated area, boiler room, mechanical room**

MATERIAL QUANTITY: **195** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **white 12x12 VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 221**
MATERIAL QUANTITY: **720** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **white 12x12 VFT**
MATERIAL LOCATION: **Room 221**
MATERIAL QUANTITY: **720** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-1**
MATERIAL DESCRIPTION: **12x12 beige vft**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rm 216, 221, 222, 217A, 225, 307, teacher's lounge, Principal's office, rm 123, Asst. Principal's office, parm, 113, 125**

MATERIAL QUANTITY: **3700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **FT-1**
MATERIAL DESCRIPTION: **12x12 beige vft**
MATERIAL LOCATION: **Rm 216, 221, 222, 217A, 225, 307, teacher's lounge, Principal's office, rm 123, Asst. Principal's office, parm, 113, 125**
MATERIAL QUANTITY: **3700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUILDING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-2**
MATERIAL DESCRIPTION: **12x12 w/white streak and burgundy 12x12 parameter**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st, 2nd & 3rd fl. Corridors**

MATERIAL QUANTITY: **9400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **FT-2**
MATERIAL DESCRIPTION: **12x12 w/white streak and burgundy 12x12 parameter**
MATERIAL LOCATION: **1st, 2nd & 3rd fl. Corridors**
MATERIAL QUANTITY: **9400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-1**
MATERIAL DESCRIPTION: **12x12 beige vft mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rm 216, 221, 222, 217A, 225, 307, teacher's lounge, principal's office, asst. principal's office, rm 123, parm, 113, 125**

MATERIAL QUANTITY: **3700** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **FTM-1**
MATERIAL DESCRIPTION: **12x12 beige vft mastic**
MATERIAL LOCATION: **Rm 216, 221, 222, 217A, 225, 307, teacher's lounge, principal's office, asst. principal's office, rm 123, parm, 113, 125**
MATERIAL QUANTITY: **3700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-2**
MATERIAL DESCRIPTION: **12x12 w/white streak and burgundy parameter mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st, 2nd & 3rd fl corridors**

MATERIAL QUANTITY: **9400**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **FTM-2**
MATERIAL DESCRIPTION: **12x12 w/white streak and burgundy parameter mastic**
MATERIAL LOCATION: **1st, 2nd & 3rd fl corridors**
MATERIAL QUANTITY: **9400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **mastic for white 12x12 VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **room 221**

MATERIAL QUANTITY: **720**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **mastic for white 12x12 VFT**
MATERIAL LOCATION: **room 221**
MATERIAL QUANTITY: **720** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Gray carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 125**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **H**

MATERIAL DESCRIPTION: **Gray carpet mastic**

MATERIAL LOCATION: **Room 125**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Air cell pipe insulation**
HISTORICAL AHERA DAMAGE CATEGORY: **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **basement.**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **Air cell pipe insulation**

MATERIAL LOCATION: **basement.**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Aircell hard joints**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **boiler room, basement, rest rooms**
MATERIAL QUANTITY: **35** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Aircell hard joints**
MATERIAL LOCATION: **boiler room, basement, rest rooms**
MATERIAL QUANTITY: **35** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **1x1 ACT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st, 2nd, 3rd floor corriors and lunchroom**

MATERIAL QUANTITY: **20000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **1x1 ACT**
MATERIAL LOCATION: **1st, 2nd, 3rd floor corriors and lunchroom**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **1x1 act mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st, 2nd, 3rd floor corriors and lunchroom**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **1x1 act mastic**
MATERIAL LOCATION: **1st, 2nd, 3rd floor corriors and lunchroom**
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **2x4 ACT**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **all classrooms on 1st,2nd and 3rd**

MATERIAL QUANTITY: **15000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **2x4 ACT**
MATERIAL LOCATION: **all classrooms on 1st,2nd and 3rd**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **12"x12" VFT WHITE W/ BEIGE SPECS**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **ROOM 121 & 125**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **N**

MATERIAL DESCRIPTION: **12"x12" VFT WHITE W/ BEIGE SPECS**

MATERIAL LOCATION: **ROOM 121 & 125**

MATERIAL QUANTITY: **1500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N-1**
MATERIAL DESCRIPTION: **12"x12" VFT WHITE W/ BEIGE SPECKS- MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **ROOMS 121 & 125**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **N-1**
MATERIAL DESCRIPTION: **12"x12" VFT WHITE W/ BEIGE SPECKS- MASTIC**
MATERIAL LOCATION: **ROOMS 121 & 125**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**
MATERIAL DESCRIPTION: **12X12 VFT white w/ tan specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st,2nd,3rd floor hallways,auditorium,eng's office,Rm 126,117,124, girls & boys dean's office**

MATERIAL QUANTITY: **23500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **0**

MATERIAL DESCRIPTION: **12X12 VFT white w/ tan specks**

MATERIAL LOCATION: **1st,2nd,3rd floor hallways,auditorium,eng's office,Rm 126,117,124, girls & boys dean's office**

MATERIAL QUANTITY: **23500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **O-1**
MATERIAL DESCRIPTION: **12X12 VFT WHITE W/ TAN SPECKS- MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st,2nd,3rd floor hallways,auditorium,eng's office,Rm 126,117,124, girls & boys dean's office**

MATERIAL QUANTITY: **23500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **O-1**
MATERIAL DESCRIPTION: **12X12 VFT WHITE W/ TAN SPECKS- MASTIC**
MATERIAL LOCATION: **1st,2nd,3rd floor hallways,auditorium,eng's office,Rm 126,117,124, girls & boys dean's office**
MATERIAL QUANTITY: **23500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P**
MATERIAL DESCRIPTION: **12x12 VFT dark red w/ red specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **perimeter of 1st, 2nd and 3rd floor hallways, & auditorium**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **P**
MATERIAL DESCRIPTION: **12x12 VFT dark red w/ red specks**
MATERIAL LOCATION: **perimeter of 1st, 2nd and 3rd floor hallways, & auditorium**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P-1**
MATERIAL DESCRIPTION: **12X12 VFT DARK RED W/ RED SPECKS-MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **PERIMETER OF 1ST, 2ND & 3RD FLOOR HALLWAYS**

MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **P-1**
MATERIAL DESCRIPTION: **12X12 VFT DARK RED W/ RED SPECKS-MASTIC**
MATERIAL LOCATION: **PERIMETER OF 1ST, 2ND & 3RD FLOOR HALLWAYS**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q**
MATERIAL DESCRIPTION: **12x12 TAN W/ BROWN SPECS VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **ROOM 222**

MATERIAL QUANTITY: **650**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **Q**
MATERIAL DESCRIPTION: **12x12 TAN W/ BROWN SPECS VFT**
MATERIAL LOCATION: **ROOM 222**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q-1**
MATERIAL DESCRIPTION: **12x12 TAN W/ BROWN SPEC VFT-MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **ROOM 222**

MATERIAL QUANTITY: **650**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **Q-1**
MATERIAL DESCRIPTION: **12x12 TAN W/ BROWN SPEC VFT-MASTIC**
MATERIAL LOCATION: **ROOM 222**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **R**
MATERIAL DESCRIPTION: **12x12 BROWN W/ WHITE SPECS VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **ROOM 305 & 303**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **R**
MATERIAL DESCRIPTION: **12x12 BROWN W/ WHITE SPECS VFT**
MATERIAL LOCATION: **ROOM 305 & 303**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **R/S-1**
MATERIAL DESCRIPTION: **MASTIC FOR 12x12 TILE (HA 'R' & 'S')**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **ROOM 305 & 303**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **R/S-1**
MATERIAL DESCRIPTION: **MASTIC FOR 12x12 TILE (HA 'R' & 'S')**
MATERIAL LOCATION: **ROOM 305 & 303**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **S**
MATERIAL DESCRIPTION: **12x12 WHITE W/ BEIGE SPECS VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **ROOM 305 & 303**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **S**
MATERIAL DESCRIPTION: **12x12 WHITE W/ BEIGE SPECS VFT**
MATERIAL LOCATION: **ROOM 305 & 303**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **T**
MATERIAL DESCRIPTION: **12x12 DARK RED VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **LUNCHROOM, ROOMS 330, 332**
MATERIAL QUANTITY: **2950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **T**
MATERIAL DESCRIPTION: **12x12 DARK RED VFT**
MATERIAL LOCATION: **LUNCHROOM, ROOMS 330, 332**
MATERIAL QUANTITY: **2950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **T/U-1**
MATERIAL DESCRIPTION: **MASTIC FOR 12x12 VFT (HA 'T' & 'U')**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **LUNCHROOM, ROOMS 330, 332**
MATERIAL QUANTITY: **5900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **T/U-1**
MATERIAL DESCRIPTION: **MASTIC FOR 12x12 VFT (HA 'T' & 'U')**
MATERIAL LOCATION: **LUNCHROOM, ROOMS 330, 332**
MATERIAL QUANTITY: **5900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **U**
MATERIAL DESCRIPTION: **12x12 WHITE W/ GRAY STREAKS**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **LUNCHROOM, ROOMS 330, 332**
MATERIAL QUANTITY: **2950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **U**
MATERIAL DESCRIPTION: **12x12 WHITE W/ GRAY STREAKS**
MATERIAL LOCATION: **LUNCHROOM, ROOMS 330, 332**
MATERIAL QUANTITY: **2950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **V**
MATERIAL DESCRIPTION: **12x12 BROWN W/ WHITE SPECS VFT**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **ROOM 115**
MATERIAL QUANTITY: **790** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **V**
MATERIAL DESCRIPTION: **12x12 BROWN W/ WHITE SPECS VFT**
MATERIAL LOCATION: **ROOM 115**
MATERIAL QUANTITY: **790** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **V-1**
MATERIAL DESCRIPTION: **MASTIC FOR 12x12 BROWN W/ WHITE SPECS VFT**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **ROOM 115**

MATERIAL QUANTITY: **790**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **V-1**
MATERIAL DESCRIPTION: **MASTIC FOR 12x12 BROWN W/ WHITE SPECS VFT**
MATERIAL LOCATION: **ROOM 115**
MATERIAL QUANTITY: **790** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **W**
MATERIAL DESCRIPTION: **12x12 VFT WHITE W/ BROWN SPECS**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **ROOMS 990, 991,992, 993,994,995,996,997 & HALLWAYS,MEN,WOMEN,BOY & GIRL TOILETS (ALL IN W. TRAILER)**

MATERIAL QUANTITY: **7830** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **W**
MATERIAL DESCRIPTION: **12x12 VFT WHITE W/ BROWN SPECS**
MATERIAL LOCATION: **ROOMS 990, 991,992, 993,994,995,996,997 & HALLWAYS,MEN,WOMEN,BOY & GIRL TOILETS (ALL IN W. TRAILER)**
MATERIAL QUANTITY: **7830** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **W-1**
MATERIAL DESCRIPTION: **12x12 VFT WHITE W/ BROWN SPECS-MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **ROOMS 990, 991,992, 993,994,995,996,997 & HALLWAYS,MEN,WOMEN,BOY & GIRL TOILETS (ALL IN W. TRAILER)**

MATERIAL QUANTITY: **7830** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **W-1**
MATERIAL DESCRIPTION: **12x12 VFT WHITE W/ BROWN SPECS-MASTIC**
MATERIAL LOCATION: **ROOMS 990, 991,992, 993,994,995,996,997 & HALLWAYS,MEN,WOMEN,BOY & GIRL TOILETS (ALL IN W. TRAILER)**
MATERIAL QUANTITY: **7830** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **X**
MATERIAL DESCRIPTION: **2'x2' S. ACT-WHITE**
HISTORICAL AHERA DAMAGE CATEGORY **7 Damaged or significantly damaged friable misc. ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **ALL CEILING OF WEST TRAILER**
MATERIAL QUANTITY: **7830** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **X**
MATERIAL DESCRIPTION: **2'x2' S. ACT-WHITE**
MATERIAL LOCATION: **ALL CEILING OF WEST TRAILER**
MATERIAL QUANTITY: **7830** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Y**
MATERIAL DESCRIPTION: **DRYWALL**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **ALL WALLS AND ABOVE S. ACT IN WEST TRAILER**
MATERIAL QUANTITY: **19100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **Y**
MATERIAL DESCRIPTION: **DRYWALL**
MATERIAL LOCATION: **ALL WALLS AND ABOVE S. ACT IN WEST TRAILER**
MATERIAL QUANTITY: **19100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Z**
MATERIAL DESCRIPTION: **12x12 VFT WHITE W/ TAN SPECS (Building Demolished 2011)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2 CLASSROOM TRAILER ON NORTH SIDE OF SCHOOL BLDG**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **Z**

MATERIAL DESCRIPTION: **12x12 VFT WHITE W/ TAN SPECS (Building Demolished 2011)**

MATERIAL LOCATION: **2 CLASSROOM TRAILER ON NORTH SIDE OF SCHOOL BLDG**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUILDING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Z-1**
MATERIAL DESCRIPTION: **12x12 VFT WHITE W/ TAN SPECS-MASTIC (Building Demolished 2011)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2 CLASSROOM TRAILER ON NORTH SIDE OF SCHOOL BLDG**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **Z-1**
MATERIAL DESCRIPTION: **12x12 VFT WHITE W/ TAN SPECS-MASTIC (Building Demolished 2011)**
MATERIAL LOCATION: **2 CLASSROOM TRAILER ON NORTH SIDE OF SCHOOL BLDG**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified follow O&M plan.

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUILDING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Beige w/ Dark Beige Spots Floor Tile**
MATERIAL LOCATION: **Room 307**
MATERIAL QUANTITY: **1120** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUILDING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Beige w/ Dark Beige Spots Floor Tile**

MATERIAL LOCATION: **Room 307**

MATERIAL QUANTITY: **1120** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUIDLING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12" x 12" Dark Beige w/ White Specks Floor Tile**
MATERIAL LOCATION: **Driver's ED Trailer**
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 03/07/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUILDING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **12" x 12" Dark Beige w/ White Specks Floor Tile**
MATERIAL LOCATION: **Driver's ED Trailer**
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUILDING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Dark Beige w/ White Specks Floor Tile**

MATERIAL LOCATION: **Driver's ED Trailer**

MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUILDING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Dark Beige w/ White Specks Floor Tile**
MATERIAL LOCATION: **Driver's ED Trailer**
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **04/04/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUILDING ID: **1340**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Robert DeBord**
SCHOOL NAME: **Gage Park High School** INSPECTION DATE: **3/7/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Dark Beige Spots Floor Tile**
MATERIAL LOCATION: **Room 307**
MATERIAL QUANTITY: **1120** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **03/07/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46141** BUILDING ID: **1340**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Gage Park High School** REVIEW DATE: **4/4/2016**
ADDRESS: **5630 S. Rockwell** IDPH LICENSE NO: **100-08864**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **12" x 12" Beige w/ Dark Beige Spots Floor Tile**
MATERIAL LOCATION: **Room 307**
MATERIAL QUANTITY: **1120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **04/04/2016**

APPENDIX B

Inspector and Management Planner Licenses

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Robert DeBord


has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015


Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024160



Kathy DeSalvo, Director


Robert De Bord
Illinois Licensed Asbestos Inspector, Project Manager, and
Air Sampling Professional

 **ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER: **100 - 08864** ISSUED: **5/27/2015** EXPIRES: **05/15/2016**

ROBERT W DE BORD
301 MIAMI ST
PARK FOREST, IL 60466




Environmental Health


ENDORSEMENTS	TC EXPIRES
INSPECTOR	2/13/2016
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	2/12/2016

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

Evan Christian

Illinois Licensed Project Manager, and Air Sampling Professional

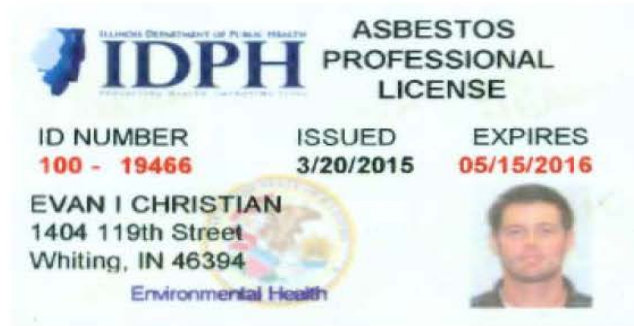

ENDORSEMENTS	TC EXPIRES
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	12/12/2015
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

**CARNOW
CONIBEAR**

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024159


Katy DeSalvo, Director

Reliable
Environmental
Solutions, Inc. **RES**

This is to certify that **Evan Christian**

*has on January 28 & 29, 2016, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Initial Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: January 28 & 29, 2016

Examination Date: January 29, 2016

Expiration Date: January 29, 2017

Certificate Number: MP/0103

William S. Williams

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ www.ReliableEnv.com

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed