

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0022
SCHOOL NAME: Kelly High School
ADDRESS OF SCHOOL: 4136 S. California
CITY: Chicago, IL, 60632

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/19/2013**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 4/9/2016 ENROLLMENT 1965
IDPH INSPECTOR LICENSE NUMBER: 100-19466
IDPH LICENSED INSPECTOR NAME (Please Print): Evan Christian
IDPH MP LICENSE NUMBER: 100-03613
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



4/9/2016

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Kelly High School

4136 S. California
Chicago, IL, 60632

Unit: 46181
Building ID: 1400

IDPH ID Number: 14-016-2990-0022

REPORT DATE:

Saturday, April 09, 2016

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

February 25, 2016

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 46181 Region: 04 IDPH ID: 14-016-2990-0022

School: Kelly High School Building ID: 1400

Address: 4136 S. California
Chicago, IL, 60632

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 04/09/2016

Inspector: Evan Christian Inspector IDPH License: 100-19466
Management Planner: Daniel Juneau Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: February 25, 2016

RE: Kelly High School, Unit 46181
4136 S. California
Chicago, IL, 60632

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Kelly High School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Kelly High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Kelly High School
Address: 4136 S. California
IDPH ID: 14-016-2990-0022
Contact:

Unit: 46181
Chicago, IL, 60632
Building ID: 1400
Phone:

Region: 04

2. Description of Facility

Original Construction:
Total Square Footage:
Current Occupancy: 1965

Additional Construction:
No of Floors:

3. LEA Designated Person

Contact: Robert Christlieb
Address: 125 South Clark Street, 17th Floor
Chicago, IL 60603

Phone: (773) 553-3197

4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Dan Juneau
Address 600 West Van Buren St., Ste 500
Phone: (312) 762-2900

Fax: (312) 782-5145

5. Inspector

Inspector Name: Evan Christian

Inspector IDPH license # 100-19466

Signature:
Date: 2/25/2016

6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613

Signature: 
Date: 04/09/2016

7. Review Date: 04/09/2016

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 4/9/2016

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Kelly High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1400:

1	2' x 4' Ceiling Tile w/Lengthwise Fissures
107	Spray-on fireproofing
140	Acoustical Plaster on Walls
141	Drywall
142	Off-White Spray-on Fireproofing
143	Tan, Gray, and Green Terrazzo
144	2' x 2' Ceiling Tile w/ Gouges and Holes
145	12" x 12" Beige w/ light Brown and Green Spots Floor Tile
146	Mastic Associated w/ 12" x 12" Beige w/ light Brown and Green Spots Floor Tile

147	12" x 12" Light Brown Floor Tile Accent
148	Mastic Associated w/ 12" x 12" Light Brown Floor Tile Accent
149	12" x 12" Green Floor Tile Accent
150	Mastic Associated w/ 12" x 12" Green Floor Tile Accent
151	12" x 12" Blue Mottled Floor Tile
152	Mastic Associated w/ 12" x 12" Blue Mottled Floor Tile
153	Black Marble Pattern Sheet Flooring
154	Mastic Associated w/ Black Marble Sheet Flooring
155	Textured Acoustical Plaster
3	2x4 Ceiling tile pinhole w/ random dots
39	Smooth hard plaster
5	2x4 ceiling tile w/ random fissures
50	Water tank jacket insulation
6	2x4 Ceiling tile w/ fissures parallel to width

B. The following new homogenous areas have been identified for Building 1400:

140	Acoustical Plaster on Walls
141	Drywall
142	Off-White Spray-on Fireproofing
143	Tan, Gray, and Green Terrazzo
144	2' x 2' Ceiling Tile w/ Gouges and Holes
145	12" x 12" Beige w/ light Brown and Green Spots Floor Tile
146	Mastic Associated w/ 12" x 12" Beige w/ light Brown and Green Spots Floor Tile
147	12" x 12" Light Brown Floor Tile Accent
148	Mastic Associated w/ 12" x 12" Light Brown Floor Tile Accent
149	12" x 12" Green Floor Tile Accent
150	Mastic Associated w/ 12" x 12" Green Floor Tile Accent
151	12" x 12" Blue Mottled Floor Tile
152	Mastic Associated w/ 12" x 12" Blue Mottled Floor Tile
153	Black Marble Pattern Sheet Flooring
154	Mastic Associated w/ Black Marble Sheet Flooring
155	Textured Acoustical Plaster

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

1	2' x 4' Ceiling Tile w/Lengthwise Fissures
10	6'x12" Pegboard ceiling tile
100	Roof flashing (NON AHERA)
106	Wood enclosed door insulation
107	Spray-on fireproofing
108	9x9 brown FT w/green, brown, yellow speck
109	9x9 brown FT w/green, brown, yellow speck mastic
110	12" x 12" Brown Floor Tile
111	12" x 12" Brown Floor Tile Mastic
112	12" x 12" Beige Floor Tile
113	12" x 12" Beige Floor Tile Mastic
114	12" x 12" Gray Floor Tile
115	12" x 12" Gray Floor Tile Mastic
130	12" x 12" White VFT with green streaks
130M	12" x 12" White VFT with green streaks Mastic
131	12" x 12" Light Blue Floor Tile
131M	Mastic associated with 12" x 12" Light Blue FT
132	12" x 12" Light Green Floor Tile
133	12" x 12" Green Floor Tile
134	Mastic associated with HA 132 & HA 133
135	12" x 12" Dark Green Floor Tile
135M	Mastic associated with 12" x 12" Dark Green FT
136	Lab Benches & Tabletops
137	12"x 12" Blue Floor Tile
137M	Mastic associated with 12" x 12" Blue Floor Tile
138	12"x 12" Tan Checkered Pattern Floor Tile
138M	Mastic associated with 12" x 12" Tan multicolored Floor Tile
139	12" x 12" Tan Mottled Floor Tile
139M	Mastic associated with 12" x 12" Tan Mottled Floor Tile
140	Acoustical Plaster on Walls
141	Drywall
142	Off-White Spray-on Fireproofing
143	Tan, Gray, and Green Terrazzo
144	2' x 2' Ceiling Tile w/ Gouges and Holes
145	12" x 12" Beige w/ light Brown and Green Spots Floor Tile
146	Mastic Associated w/ 12" x 12" Beige w/ light Brown and Green Spots Floor Tile
147	12" x 12" Light Brown Floor Tile Accent
148	Mastic Associated w/ 12" x 12" Light Brown Floor

	Tile Accent
149	12" x 12" Green Floor Tile Accent
150	Mastic Associated w/ 12" x 12" Green Floor Tile Accent
151	12" x 12" Blue Mottled Floor Tile
152	Mastic Associated w/ 12" x 12" Blue Mottled Floor Tile
153	Black Marble Pattern Sheet Flooring
154	Mastic Associated w/ Black Marble Sheet Flooring
155	Textured Acoustical Plaster
23	1x1 White floor tile w/ tan streaks
23A	1x1 White floor tile w/ tan streaks mastic
24	1x1 Gray floor tile w/ tan and white streaks
24A	1x1 Gray floor tile w/ tan & white streaks mastic
28	1x1 Black floor tile
3	2x4 Ceiling tile pinhole w/ random dots
39	Smooth hard plaster
4	1x1 Peg hole ceiling tile
5	2x4 ceiling tile w/ random fissures
50	Water tank jacket insulation
51	Boiler door gasket
53	Kiln fire brick
56	Incinerator fire brick mortar
6	2x4 Ceiling tile w/ fissures parallel to width
68	Boiler mortar
7	1x1 Rough white ceiling tile
72	12x12 VFT beige w/ white, brown & tan specks
73	12x12 VFT beige w/ white, bwn & tan specks, mastic
74	Black Vinyl baseboard
75	Black vinyl baseboard mastic (beige)
76	12x12 VFT cream w/ beige specks
77	Mastic (black) 12x12 VFT cream w/ beige specks
78	12x12 VFT (Beige w/ white & beige specks)
8	2x2 Rough white ceiling tile
81	Vinyl baseboard dark brown
82	Light beige mastic vinyl baseboard (dark brown)
83	12x12 VFT green w/ green specks
84	Black mastic 12x12 VFT green w/ green specks
85	12x12 VFT gray flecks w/ grey specks
86	Mastic 12x12 VFT gray flacks w/ gray specks
87	12x12 VFT beige w/ multicolors-wht, yel, rust, bge
89	12x12 VFT green w/ dark green & white streaks
9	1x1 White ceiling tile w/ fissures
91	12x12 VFT Cream w/ beige specks
93	VFT molding tan w/ white & brown specks
99	Roof (NON AHERA)

The following areas were deemed to be inaccessible:

106	Wood enclosed door insulation
109	9x9 brown FT w/green, brown, yellow speck mastic
111	12" x 12" Brown Floor Tile Mastic
113	12" x 12" Beige Floor Tile Mastic
115	12" x 12" Gray Floor Tile Mastic
130M	12" x 12" White VFT with green streaks Mastic
131M	Mastic associated with 12" x 12" Light Blue FT
134	Mastic associated with HA 132 & HA 133
135M	Mastic associated with 12" x 12" Dark Green FT
137M	Mastic associated with 12" x 12" Blue Floor Tile
139M	Mastic associated with 12" x 12" Tan Mottled Floor Tile
146	Mastic Associated w/ 12" x 12" Beige w/ light Brown and Green Spots Floor Tile
148	Mastic Associated w/ 12" x 12" Light Brown Floor Tile Accent
150	Mastic Associated w/ 12" x 12" Green Floor Tile Accent
152	Mastic Associated w/ 12" x 12" Blue Mottled Floor Tile
154	Mastic Associated w/ Black Marble Sheet Flooring
15A	Mastic 9x9 sand colored FT w/ wh & bwn streaks
22A	9x9 Dark brown FT w/ white & red streaks mastic
23A	1x1 White floor tile w/ tan streaks mastic
24A	1x1 Gray floor tile w/ tan & white streaks mastic
28A	1x1 Black floor tile mastic
69	9x9 VAT (Brown w/ white specks) Mastic black
71	Black VAT molding mastic
73	12x12 VFT beige w/ white, bwn & tan specks, mastic
75	Black vinyl baseboard mastic (beige)
78	12x12 VFT (Beige w/ white & beige specks)
79	Tan Mastic 12x12 VFT beige w/ white & beige specks
80	Blk mastic 12x12 VFT beige w/ white & beige specks
82	Light beige mastic vinyl baseboard (dark brown)
84	Black mastic 12x12 VFT green w/ green specks
86	Mastic 12x12 VFT gray flacks w/ gray specks
87	12x12 VFT beige w/ multicolors-wht, yel, rust, bge
88	Black mastic 12x12 VFT beige w/ multicolors
90	Beige mastic 12x12 VFT green w/ white & green strk
94	Black mastic VFT molding

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Evan Christian, IDPH License # 100-19466. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Kelly High School Building 1400 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Kelly High School Unit 46181 Building ID 1400

Address 4136 S. California Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
1	2' x 4' Ceiling Tile w/Lengthwise Fissures	2,400	SF	Rooms 110, 113, and 214	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
10	6x12" Pegboard ceiling tile			Auditorium	ASSUMED	MISC								
100	Roof flashing (NON AHERA)			Roof exterior	ASSUMED	MISC								
105	Electrical wire insulation			Auditorium area	INACCESSIBLE	TSI								
106	Wood enclosed door insulation	200	SF	Throughout building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
107	Spray-on fireproofing	2,000	SF	Attic	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
108	9x9 brown FT w/green, brown, yellow speck	200	SF	319	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
109	9x9 brown FT w/green, brown, yellow speck mastic	200	SF	319	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
110	12" x 12" Brown Floor Tile	1,900	SF	Room 303, 111, 211	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
111	12" x 12" Brown Floor Tile Mastic	1,900	SF	Room 303, 11, 211	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
112	12" x 12" Beige Floor Tile	1,900	SF	Room 218, 111, 211	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
113	12" x 12" Beige Floor Tile Mastic	250	SF	Room 218	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
114	12" x 12" Gray Floor Tile	250	SF	Room 118	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
115	12" x 12" Gray Floor Tile Mastic	250	SF	Room 118	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
130	12" x 12" White VFT with green streaks	28,000	SF	1, 2, 3 hallways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
130M	12" x 12" White VFT with green streaks Mastic	28,000	SF	1, 2, 3 hallways	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
131	12" x 12" Light Blue Floor Tile	250	SF	Room 118	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
131M	Mastic associated with 12" x 12" Light Blue FT	250	SF	Room 118	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
132	12" x 12" Light Green Floor Tile	925	SF	Room 114 & 106	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
133	12" x 12" Green Floor Tile	475	SF	Room 114 & 106	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
134	Mastic associated with HA 132 & HA 133	1,400	SF	Room 114 & 106	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
135	12" x 12" Dark Green Floor Tile	4,250	SF	Main Office, 3rd Floor Cafeteria	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Kelly High School Unit 46181 Building ID 1400

Address 4136 S. California Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
135M	Mastic associated with 12" x 12" Dark Green FT	4,750	SF	Main Office & 3rd Floor Cafeteria	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
136	Lab Benches & Tabletops	2,000	SF	Room 207, 301, 302, 303, 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
137	12"x 12" Blue Floor Tile	1,650	SF	Engineers Office, Teacher's Lounge, Rooms 106 and 108	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
137M	Mastic associated with 12" x 12" Blue Floor Tile	1,650	SF	Engineers Office, Teacher's Lounge, Rooms 106 and 108	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
138	12" x 12" Tan Checkered Pattern Floor Tile	800	SF	Room 202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
138M	Mastic associated with 12" x 12" Tan multicolored Floor Tile	800	SF	Room 202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
139	12" x 12" Tan Mottled Floor Tile	1,550	SF	Rooms 111, 111B, 217, 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
139M	Mastic associated with 12" x 12" Tan Mottled Floor Tile	1,550	SF	Rooms 111, 111B, 217, 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
140	Acoustical Plaster on Walls	3,000	SF	Auditorium (New Building)	ASSUMED	SURFACE	N	NONE	0		Yes	ACBM with the potential for damage		LOW
141	Drywall	150,000	SF	Various Locations throughout New Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
142	Off-White Spray-on Fireproofing	80,000	SF	Support Beams Throughout (New Building)	ASSUMED	SURFACE	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
143	Tan, Gray, and Green Terrazzo	15,000	SF	1st, 2nd, 3rd Floor Corridors and Stairwells (New Building)	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
144	2' x 2' Ceiling Tile w/ Gouges and Holes	25,000	SF	Throughout New Building	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
145	12" x 12" Beige w/ light Brown and Green Spots Floor Tile	30,000	SF	All Classrooms in New Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
146	Mastic Associated w/ 12" x 12" Beige w/ light Brown and Green Spots Floor Tile	30,000	SF	All Classrooms in New Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
147	12" x 12" Light Brown Floor Tile Accent	5,000	SF	All Classrooms in New Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
148	Mastic Associated w/ 12" x 12" Light Brown Floor Tile Accent	5,000	SF	All Classrooms in New Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
149	12" x 12" Green Floor Tile Accent	5,000	SF	All Classrooms in New Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
15	9x9 Sand colored FT w/ white & brown	4,000	SF	Rooms 301, 302,	CHR	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Kelly High School Unit 46181 Building ID 1400

Address 4136 S. California Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	streaks			303, 304, & 207								potential for damage		
150	Mastic Associated w/ 12" x 12" Green Floor Tile Accent	5,000	SF	All Classrooms in New Building	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
151	12" x 12" Blue Mottled Floor Tile	5,000	SF	Rooms 251, 253, 255, 259, 261 (New Building)	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
152	Mastic Associated w/ 12" x 12" Blue Mottled Floor Tile	5,000	SF	Rooms 251, 253, 255, 259, 261 (New Building)	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
153	Black Marble Pattern Sheet Flooring	2,000	SF	TV Studio Room 351 (New Building)	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
154	Mastic Associated w/ Black Marble Sheet Flooring	2,000	SF	TV Studio Room 351 (New Building)	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
155	Textured Acoustical Plaster	1,500	SF	Library (New Building)	ASSUMED	SURFACE	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
15A	Mastic 9x9 sand colored FT w/ wh & bwn streaks	4,000	SF	Room 301, 302, 303, 304, & 207	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19	1x1 White floor tile w/ gray streaks			1st, 2nd, 3rd flr. Hall	ABATED	MISC								
19A	1x1 White floor tile w/ gray streaks mastic			1st, 2nd, and 3rd floor corridors	ABATED	MISC								
20	1x1 White mottled floor tile			Throughout building	ABATED	MISC								
20A	1x1 White mottled floor tile mastic			Throughout school	ABATED	MISC								
21	1x1 White floor tile w/ green marks			Throughout school	ABATED	MISC								
21A	1x1 White floor tile w/ green marks mastic			2nd, 3rd flr corridors	ABATED	MISC								
22	9x9 Dark brown FT w/ white & red streaks			main office, 218, 118	CHR	MISC								
22A	9x9 Dark brown FT w/ white & red streaks mastic	200	SF	Main office, 218, 118	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	1x1 White floor tile w/ tan streaks	1,600	SF	111, 211	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23A	1x1 White floor tile w/ tan streaks mastic	1,600	SF	111, 211	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	1x1 Gray floor tile w/ tan and white streaks	3,100	SF	111, 211, Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24A	1x1 Gray floor tile w/ tan & white streaks mastic	3,100	SF	111, 211, Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	1x1 Black floor tile	8,000	SF	auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28A	1x1 Black floor tile mastic	8,000	SF	Auditorium	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
3	2x4 Ceiling tile pinhole w/ random dots	8,800	SF	3rd floor kitchen, Auditorium	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Kelly High School Unit 46181 Building ID 1400

Address 4136 S. California Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
64	Interior window caulk (brown)			Throughout the school	ABATED	MISC								
65	Clay brick tile			Basement between tempering coils, S wall near fan unit, next to reheat #7, fresh air intake #4	NO_ACBM	MISC								
66	Clay brick tile mortar			Basement between tempering coils, S wall near fan unit, next to reheat #7, fresh air intake #4	NO_ACBM	MISC								
67	Terrazzo flooring			1st floor SE corner vest., main entrance vest., NW corner vest.	NO_ACBM	MISC								
68	Boiler mortar	100	SF	Boiler room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
69	9x9 VAT (Brown w/ white specks) Mastic black	200	SF	Main office, vaults, copy room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
7	1x1 Rough white ceiling tile			Library	ASSUMED	MISC								
70	Brown VAT molding	10	LF	Main office vaults	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
71	Black VAT molding mastic	10	LF	Main office vaults	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
72	12x12 VFT beige w/ white, brown & tan specks	800	SF	Room 303	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
73	12x12 VFT beige w/ white, bwn & tan specks, mastic	800	SF	Room 303	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
74	Black Vinyl baseboard	224	LF	Rooms 303 and 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
75	Black vinyl baseboard mastic (beige)	224	LF	Rooms 303 and 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
76	12x12 VFT cream w/ beige specks	224	LF	Room 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
77	Mastic (black) 12x12 VFT cream w/ beige specks	800	SF	Room 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
78	12x12 VFT (Beige w/ white & beige specks)	2,000	SF	Room 203	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
79	Tan Mastic 12x12 VFT beige w/ white & beige specks	2,000	SF	Room 203	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
8	2x2 Rough white ceiling tile			Room 113	ASSUMED	MISC								
80	Blk mastic 12x12 VFT beige w/ white & beige specks	2,000	SF	Room 203	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Kelly High School Unit 46181 Building ID 1400

Address 4136 S. California Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date <u>2/25/2016</u>
Inspector Name <u>Evan Christian</u>
<u>100-19466</u> <u>5/15/2016</u>
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
1	
10	Not observed 2016
100	
105	Not observed 2016 - Inaccessible area
106	
107	
108	
109	
110	
111	
112	
113	
114	
115	
130	
130M	
131	
131M	
132	
133	
134	
135	
135M	
136	

Chicago Public Schools

School Kelly High School Unit 46181 Building ID 1400

Address 4136 S. California Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
137	
137M	
138	
138M	
139	
139M	
140	
141	
142	
143	
144	
145	
146	
147	
148	
149	
15	
150	
151	
152	
153	
154	
155	
15A	
19	
19A	
20	
20A	
21	

Chicago Public Schools

School Kelly High School Unit 46181 Building ID 1400

Address 4136 S. California Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
21A	
22	Not observed 2016
22A	
23	
23A	
24	
24A	
28	
28A	
3	
39	
4	Not observed 2016
5	
50	
51	
53	
56	
57	
58	
59	
6	
60	
61	
62	
63	
64	
65	
66	
67	

Chicago Public Schools

School Kelly High School Unit 46181 Building ID 1400

Address 4136 S. California Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
68	
69	
7	Not observed 2016
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	
8	Not observed 2016
80	
81	
82	
83	
84	
85	
86	
87	
88	
89	
9	
90	
91	Not observed 2016
92	Not observed 2016
93	Not observed 2016

Chicago Public Schools

School Kelly High School Unit 46181 Building ID 1400

Address 4136 S. California Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
94	
95	
96	
97	
98	
99	

Table II

Management Planner's Review

Chicago Public Schools

School Kelly High School

Unit 46181

Building ID 1400

Address 4136 S. California

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
1	2' x 4' Ceiling Tile w/Lengthwise Fissures	2,400	SF	Rooms 110, 113, and 214	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
10	6'x12" Pegboard ceiling tile			Auditorium	Assumed	MISC					
100	Roof flashing (NON AHERA)			Roof exterior	Assumed	MISC					
105	Electrical wire insulation			Auditorium area	Inaccessibl e	TSI					
106	Wood enclosed door insulation	200	SF	Throughout building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
107	Spray-on fireproofing	2,000	SF	Attic	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
108	9x9 brown FT w/green, brown, yellow speck	200	SF	319	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
109	9x9 brown FT w/green, brown, yellow speck mastic	200	SF	319	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
110	12" x 12" Brown Floor Tile	1,900	SF	Room 303, 111, 211	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
111	12" x 12" Brown Floor Tile Mastic	1,900	SF	Room 303, 11, 211	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
112	12" x 12" Beige Floor Tile	1,900	SF	Room 218, 111, 211	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
113	12" x 12" Beige Floor Tile Mastic	250	SF	Room 218	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
114	12" x 12" Gray Floor Tile	250	SF	Room 118	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
115	12" x 12" Gray Floor Tile Mastic	250	SF	Room 118	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
130	12" x 12" White VFT with green streaks	28,000	SF	1, 2, 3 hallways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
130M	12" x 12" White VFT with green streaks Mastic	28,000	SF	1, 2, 3 hallways	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
131	12" x 12" Light Blue Floor Tile	250	SF	Room 118	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
131M	Mastic associated with 12" x 12" Light Blue FT	250	SF	Room 118	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
132	12" x 12" Light Green Floor Tile	925	SF	Room 114 & 106	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
133	12" x 12" Green Floor Tile	475	SF	Room 114 & 106	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
134	Mastic associated with HA 132 & HA 133	1,400	SF	Room 114 & 106	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
135	12" x 12" Dark Green Floor Tile	4,250	SF	Main Office, 3rd Floor Cafeteria	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
135M	Mastic associated with 12" x 12" Dark Green FT	4,750	SF	Main Office & 3rd Floor Cafeteria	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
136	Lab Benches & Tabletops	2,000	SF	Room 207, 301, 302, 303, 304	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
137	12"x 12" Blue Floor Tile	1,650	SF	Engineers Office, Teacher's Lounge, Rooms 106 and 108	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
137M	Mastic associated with 12" x 12" Blue Floor Tile	1,650	SF	Engineers Office, Teacher's Lounge, Rooms 106 and 108	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
138	12"x 12" Tan Checkered Pattern Floor Tile	800	SF	Room 202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
138M	Mastic associated with 12" x 12" Tan multicolored Floor Tile	800	SF	Room 202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
139	12" x 12" Tan Mottled Floor Tile	1,550	SF	Rooms 111, 111B, 217, 304	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Kelly High School
Address 4136 S. California

Unit 46181
 Chicago, IL, 60632

Building ID 1400
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
139M	Mastic associated with 12" x 12" Tan Mottled Floor Tile	1,550	SF	Rooms 111, 111B, 217, 304	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
140	Acoustical Plaster on Walls	3,000	SF	Auditorium (New Building)	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
141	Drywall	150,000	SF	Various Locations throughout New Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
142	Off-White Spray-on Fireproofing	80,000	SF	Support Beams Throughout (New Building)	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
143	Tan, Gray, and Green Terrazzo	15,000	SF	1st, 2nd, 3rd Floor Corridors and Stairwells (New Building)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
144	2' x 2' Ceiling Tile w/ Gouges and Holes	25,000	SF	Throughout New Building	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
145	12" x 12" Beige w/ light Brown and Green Spots Floor Tile	30,000	SF	All Classrooms in New Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
146	Mastic Associated w/ 12" x 12" Beige w/ light Brown and Green Spots Floor Tile	30,000	SF	All Classrooms in New Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
147	12" x 12" Light Brown Floor Tile Accent	5,000	SF	All Classrooms in New Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
148	Mastic Associated w/ 12" x 12" Light Brown Floor Tile Accent	5,000	SF	All Classrooms in New Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
149	12" x 12" Green Floor Tile Accent	5,000	SF	All Classrooms in New Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	9x9 Sand colored FT w/ white & brown streaks	4,000	SF	Rooms 301, 302, 303, 304, & 207	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
150	Mastic Associated w/ 12" x 12" Green Floor Tile Accent	5,000	SF	All Classrooms in New Building	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
151	12" x 12" Blue Mottled Floor Tile	5,000	SF	Rooms 251, 253, 255, 259, 261 (New Building)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
152	Mastic Associated w/ 12" x 12" Blue Mottled Floor Tile	5,000	SF	Rooms 251, 253, 255, 259, 261 (New Building)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
153	Black Marble Pattern Sheet Flooring	2,000	SF	TV Studio Room 351 (New Building)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
154	Mastic Associated w/ Black Marble Sheet Flooring	2,000	SF	TV Studio Room 351 (New Building)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
155	Textured Acoustical Plaster	1,500	SF	Library (New Building)	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
15A	Mastic 9x9 sand colored FT w/ wh & bwn streaks	4,000	SF	Room 301, 302, 303, 304, & 207	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	1x1 White floor tile w/ gray streaks			1st, 2nd, 3rd flr. Hall	Abated	MISC					
19A	1x1 White floor tile w/ gray streaks mastic			1st, 2nd, and 3rd floor corridors	Abated	MISC					
20	1x1 White mottled floor tile			Throughout building	Abated	MISC					
20A	1x1 White mottled floor tile mastic			Throughout school	Abated	MISC					
21	1x1 White floor tile w/ green marks			Throughout school	Abated	MISC					

Chicago Public Schools

School Kelly High School
Address 4136 S. California

Unit 46181
Chicago, IL, 60632

Building ID 1400
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
21A	1x1 White floor tile w/ green marks mastic			2nd, 3rd flr corridors	Abated	MISC					
22	9x9 Dark brown FT w/ white & red streaks			main office, 218, 118	Chrysotile	MISC					
22A	9x9 Dark brown FT w/ white & red streaks mastic	200	SF	Main office, 218, 118	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	1x1 White floor tile w/ tan streaks	1,600	SF	111, 211	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23A	1x1 White floor tile w/ tan streaks mastic	1,600	SF	111, 211	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	1x1 Gray floor tile w/ tan and white streaks	3,100	SF	111, 211, Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24A	1x1 Gray floor tile w/ tan & white streaks mastic	3,100	SF	111, 211, Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	1x1 Black floor tile	8,000	SF	auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28A	1x1 Black floor tile mastic	8,000	SF	Auditorium	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
3	2x4 Ceiling tile pinhole w/ random dots	8,800	SF	3rd floor kitchen, Auditorium	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
39	Smooth hard plaster	200,000	SF	Throughout building	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
4	1x1 Peg hole ceiling tile			3rd floor kitchen, lunch room, and room 314	Assumed	MISC					
5	2x4 ceiling tile w/ random fissures	2,500	SF	3rd floor dishwasher room, 3rd floor lunch room , room 314	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
50	Water tank jacket insulation	150	SF	Boiler room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
51	Boiler door gasket	50	LF	Boiler room	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
53	Kiln fire brick	200	SF	Throughout school	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
56	Incinerator fire brick mortar	50	SF	Boiler room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
57	Glazed brick			3rd floor girl's toilet NW corner, 2nd floor NW stairway, 1st floor corridor NE corner	No ACBM	MISC					
58	Glazed brick mortar			3rd floor girl's toilet NW corner, 2nd floor NW stairway, 1st floor corridor NE corner	No ACBM	MISC					
59	Cinderblock			1st floor men's toilet SE corner, Boiler room	No ACBM	MISC					
6	2x4 Ceiling tile w/ fissures parallel to width	28,000	SF	3rd floor north south hall, Room 309, 2nd floor north wing wall	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
60	Cinder block mortar			1st floor men's toilet SE corner, Boiler room	No ACBM	MISC					
61	Drywall			Basement weight room, drama room , locker room	No ACBM	MISC					

Chicago Public Schools

School Kelly High School
Address 4136 S. California

Unit 46181
Chicago, IL, 60632

Building ID 1400
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
62	Masonry brick			Boiler room	No ACBM	MISC					
63	Masonry brick mortar			Boiler room	No ACBM	MISC					
64	Interior window caulk (brown)			Throughout the school	Abated	MISC					
65	Clay brick tile			Basement between tempering coils, S wall near fan unit, next to reheat #7, fresh air intake #4	No ACBM	MISC					
66	Clay brick tile mortar			Basement between tempering coils, S wall near fan unit, next to reheat #7, fresh air intake #4	No ACBM	MISC					
67	Terrazzo flooring			1st floor SE corner vest., main entrance vest., NW corner vest.	No ACBM	MISC					
68	Boiler mortar	100	SF	Boiler room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
69	9x9 VAT (Brown w/ white specks) Mastic black	200	SF	Main office, vaults, copy room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
7	1x1 Rough white ceiling tile			Library	Assumed	MISC					
70	Brown VAT molding	10	LF	Main office vaults	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
71	Black VAT molding mastic	10	LF	Main office vaults	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
72	12x12 VFT beige w/ white, brown & tan specks	800	SF	Room 303	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
73	12x12 VFT beige w/ white, bwn & tan specks, mastic	800	SF	Room 303	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
74	Black Vinyl baseboard	224	LF	Rooms 303 and 304	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
75	Black vinyl baseboard mastic (beige)	224	LF	Rooms 303 and 304	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
76	12x12 VFT cream w/ beige specks	224	LF	Room 304	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
77	Mastic (black) 12x12 VFT cream w/ beige specks	800	SF	Room 304	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
78	12x12 VFT (Beige w/ white & beige specks)	2,000	SF	Room 203	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
79	Tan Mastic 12x12 VFT beige w/ white & beige specks	2,000	SF	Room 203	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8	2x2 Rough white ceiling tile			Room 113	Assumed	MISC					
80	Blk mastic 12x12 VFT beige w/ white & beige specks	2,000	SF	Room 203	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
81	Vinyl baseboard dark brown	100	LF	Room 203	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
82	Light beige mastic vinyl baseboard (dark brown)	100	LF	Room 203	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
83	12x12 VFT green w/ green specks	6,000	SF	221, gym, 109, 108	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
84	Black mastic 12x12 VFT green w/ green specks	6,000	SF	gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
85	12x12 VFT gray flecks w/ grey specks	760	SF	Room 320	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
86	Mastic 12x12 VFT gray flacks w/ gray specks	760	SF	Room 203	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Kelly High School
Address 4136 S. California

Unit 46181
 Chicago, IL, 60632

Building ID 1400
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
87	12x12 VFT beige w/ multicolors-wht, yel, rust, bge	760	SF	Room 201	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
88	Black mastic 12x12 VFT beige w/ multicolors	3,000	SF	Room 201	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
89	12x12 VFT green w/ dark green & white streaks	950	SF	Room 110, 1st floor corridor main entrance,	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
9	1x1 White ceiling tile w/ fissures	768	SF	Room 125	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
90	Beige mastic 12x12 VFT green w/ white & green strk	2,000	SF	1st floor corridor main entrance, Rm 110	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
91	12x12 VFT Cream w/ beige specks			Engineer office	Assumed	MISC					
92	Black mastic 12x12 VFT crème w/ beige streaks			Engineer's office	Chrysotile	MISC					
93	VFT molding tan w/ white & brown specks			Engineer's office	Assumed	MISC					
94	Black mastic VFT molding	20	LF	Engineer's office	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
95	Exterior Brick - Non AHERA			Exterior of building	No ACBM	MISC					
96	Exterior Brick Mortar - Non AHERA			Exterior of building	No ACBM	MISC					
97	Exterior window caulk (Non AHERA)			Exterior of building	Chrysotile	MISC					
98	Exterior door caulk (Non AHERA)			Surrounding exterior	Chrysotile	MISC					
99	Roof (NON AHERA)			Roof exterior	Assumed	MISC					

Chicago Public Schools

School Kelly High School
Address 4136 S. California

Unit 46181
 Chicago, IL, 60632

Building ID 1400
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	4/9/2016
Manager Planner Name	Daniel Juneau
100-03613	5/15/2016
Manager IDPH License No/Expiration	

HA Number	Management Comments
1	
10	If identified, implement O&M
100	
105	If identified, implement O&M
106	
107	
108	
109	
110	
111	
112	
113	
114	
115	
130	
130M	
131	
131M	
132	
133	
134	
135	

Chicago Public Schools

School Kelly High School

Unit 46181

Building ID 1400

Address 4136 S. California

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
135M	
136	
137	
137M	
138	
138M	
139	
139M	
140	
141	
142	
143	
144	
145	
146	
147	
148	
149	
15	
150	
151	
152	
153	
154	
155	
15A	
19	

Chicago Public Schools

School Kelly High School

Unit 46181

Building ID 1400

Address 4136 S. California

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
19A	
20	
20A	
21	
21A	
22	If identified, implement O&M
22A	
23	
23A	
24	
24A	
28	
28A	
3	
39	
4	If identified, implement O&M
5	
50	
51	
53	
56	
57	
58	
59	
6	
60	
61	

Chicago Public Schools

School Kelly High School
Address 4136 S. California

Unit 46181
 Chicago, IL, 60632

Building ID 1400
Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
62	
63	
64	
65	
66	
67	
68	
69	
7	If identified, implement O&M
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	
8	If identified, implement O&M
80	
81	
82	
83	
84	
85	
86	

Chicago Public Schools

School Kelly High School

Unit 46181

Building ID 1400

Address 4136 S. California

Chicago, IL, 60632

Region 04

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
87	
88	
89	
9	
90	
91	If identified, implement O&M
92	If identified, implement O&M
93	If identified, implement O&M
94	
95	
96	
97	
98	
99	

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **2' x 4' Ceiling Tile w/Lengthwise Fissures**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 110, 113, and 214**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **1**
MATERIAL DESCRIPTION: **2' x 4' Ceiling Tile w/Lengthwise Fissures**
MATERIAL LOCATION: **Rooms 110, 113, and 214**
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **6'x12" Pegboard ceiling tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **6'x12" Pegboard ceiling tile**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified, implement O&M

Management Planner's Signature: _____

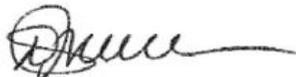

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **100**
MATERIAL DESCRIPTION: **Roof flashing (NON AHERA)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **100**
MATERIAL DESCRIPTION: **Roof flashing (NON AHERA)**
MATERIAL LOCATION: **Roof exterior**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **Electrical wire insulation**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Inaccessible** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Auditorium area**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016 - Inaccessible area**

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **105**
MATERIAL DESCRIPTION: **Electrical wire insulation**
MATERIAL LOCATION: **Auditorium area**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified, implement O&M

Management Planner's Signature: _____

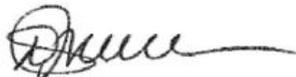

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **Wood enclosed door insulation**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout building**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **106**
MATERIAL DESCRIPTION: **Wood enclosed door insulation**
MATERIAL LOCATION: **Throughout building**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

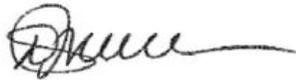

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **107**
MATERIAL DESCRIPTION: **Spray-on fireproofing**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Attic**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **107**
MATERIAL DESCRIPTION: **Spray-on fireproofing**
MATERIAL LOCATION: **Attic**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **108**
MATERIAL DESCRIPTION: **9x9 brown FT w/green, brown, yellow speck**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **319**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **108**
MATERIAL DESCRIPTION: **9x9 brown FT w/green, brown, yellow speck**
MATERIAL LOCATION: **319**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **109**
MATERIAL DESCRIPTION: **9x9 brown FT w/green, brown, yellow speck mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **319**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **109**
MATERIAL DESCRIPTION: **9x9 brown FT w/green, brown, yellow speck mastic**
MATERIAL LOCATION: **319**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **110**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 303, 111, 211**
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **110**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile**
MATERIAL LOCATION: **Room 303, 111, 211**
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **111**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 303, 11, 211**

MATERIAL QUANTITY: **1900**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **111**
MATERIAL DESCRIPTION: **12" x 12" Brown Floor Tile Mastic**
MATERIAL LOCATION: **Room 303, 11, 211**
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **112**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 218, 111, 211**
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **112**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile**
MATERIAL LOCATION: **Room 218, 111, 211**
MATERIAL QUANTITY: **1900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

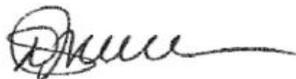

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **113**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 218**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **113**
MATERIAL DESCRIPTION: **12" x 12" Beige Floor Tile Mastic**
MATERIAL LOCATION: **Room 218**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

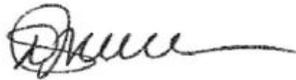

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **114**
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 118**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **114**
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile**
MATERIAL LOCATION: **Room 118**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

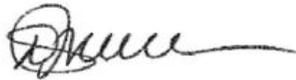

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **115**
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 118**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **115**
MATERIAL DESCRIPTION: **12" x 12" Gray Floor Tile Mastic**
MATERIAL LOCATION: **Room 118**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **130**
MATERIAL DESCRIPTION: **12" x 12" White VFT with green streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1, 2, 3 hallways**
MATERIAL QUANTITY: **28000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **130**
MATERIAL DESCRIPTION: **12" x 12" White VFT with green streaks**
MATERIAL LOCATION: **1, 2, 3 hallways**
MATERIAL QUANTITY: **28000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **130M**
MATERIAL DESCRIPTION: **12" x 12" White VFT with green streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1, 2, 3 hallways**

MATERIAL QUANTITY: **28000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **130M**
MATERIAL DESCRIPTION: **12" x 12" White VFT with green streaks Mastic**
MATERIAL LOCATION: **1, 2, 3 hallways**
MATERIAL QUANTITY: **28000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **131**
MATERIAL DESCRIPTION: **12" x 12" Light Blue Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 118**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **131**
MATERIAL DESCRIPTION: **12" x 12" Light Blue Floor Tile**
MATERIAL LOCATION: **Room 118**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **131M**
MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Light Blue FT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 118**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **131M**

MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Light Blue FT**

MATERIAL LOCATION: **Room 118**

MATERIAL QUANTITY: **250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

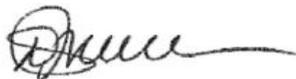

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **132**
MATERIAL DESCRIPTION: **12" x 12" Light Green Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 114 & 106**
MATERIAL QUANTITY: **925** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **132**
MATERIAL DESCRIPTION: **12" x 12" Light Green Floor Tile**
MATERIAL LOCATION: **Room 114 & 106**
MATERIAL QUANTITY: **925** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **133**
MATERIAL DESCRIPTION: **12" x 12" Green Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 114 & 106**
MATERIAL QUANTITY: **475** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **133**
MATERIAL DESCRIPTION: **12" x 12" Green Floor Tile**
MATERIAL LOCATION: **Room 114 & 106**
MATERIAL QUANTITY: **475** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

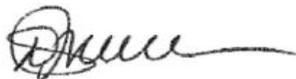

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **134**
MATERIAL DESCRIPTION: **Mastic associated with HA 132 & HA 133**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 114 & 106**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **134**
MATERIAL DESCRIPTION: **Mastic associated with HA 132 & HA 133**
MATERIAL LOCATION: **Room 114 & 106**
MATERIAL QUANTITY: **1400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **135**
MATERIAL DESCRIPTION: **12" x 12" Dark Green Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Office, 3rd Floor Cafeteria**

MATERIAL QUANTITY: **4250**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **135**
MATERIAL DESCRIPTION: **12" x 12" Dark Green Floor Tile**
MATERIAL LOCATION: **Main Office, 3rd Floor Cafeteria**
MATERIAL QUANTITY: **4250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **135M**
MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Dark Green FT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Office & 3rd Floor Cafeteria**

MATERIAL QUANTITY: **4750**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **135M**
MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Dark Green FT**
MATERIAL LOCATION: **Main Office & 3rd Floor Cafeteria**
MATERIAL QUANTITY: **4750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **136**
MATERIAL DESCRIPTION: **Lab Benches & Tabletops**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 207, 301, 302, 303, 304**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **136**
MATERIAL DESCRIPTION: **Lab Benches & Tabletops**
MATERIAL LOCATION: **Room 207, 301, 302, 303, 304**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **137**
MATERIAL DESCRIPTION: **12"x 12" Blue Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Engineers Office, Teacher's Lounge, Rooms 106 and 108**

MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **137**
MATERIAL DESCRIPTION: **12"x 12" Blue Floor Tile**
MATERIAL LOCATION: **Engineers Office, Teacher's Lounge, Rooms 106 and 108**
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **137M**
MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Blue Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Engineers Office, Teacher's Lounge, Rooms 106 and 108**

MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **137M**
MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Blue Floor Tile**
MATERIAL LOCATION: **Engineers Office, Teacher's Lounge, Rooms 106 and 108**
MATERIAL QUANTITY: **1650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

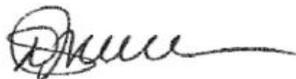

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **138**
MATERIAL DESCRIPTION: **12"x 12" Tan Checkered Pattern Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 202**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **138**
MATERIAL DESCRIPTION: **12"x 12" Tan Checkered Pattern Floor Tile**
MATERIAL LOCATION: **Room 202**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

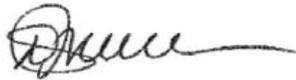

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **138M**
MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Tan multicolored Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 202**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **138M**
MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Tan multicolored Floor Tile**
MATERIAL LOCATION: **Room 202**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

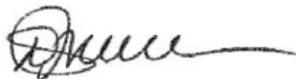

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **139**
MATERIAL DESCRIPTION: **12" x 12" Tan Mottled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 111, 111B, 217, 304**

MATERIAL QUANTITY: **1550**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **139**
MATERIAL DESCRIPTION: **12" x 12" Tan Mottled Floor Tile**
MATERIAL LOCATION: **Rooms 111, 111B, 217, 304**
MATERIAL QUANTITY: **1550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **139M**
MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Tan Mottled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 111, 111B, 217, 304**

MATERIAL QUANTITY: **1550**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **139M**
MATERIAL DESCRIPTION: **Mastic associated with 12" x 12" Tan Mottled Floor Tile**
MATERIAL LOCATION: **Rooms 111, 111B, 217, 304**
MATERIAL QUANTITY: **1550** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

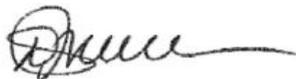

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **9x9 Sand colored FT w/ white & brown streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 301, 302, 303, 304, & 207**

MATERIAL QUANTITY: **4000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **9x9 Sand colored FT w/ white & brown streaks**
MATERIAL LOCATION: **Rooms 301, 302, 303, 304, & 207**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15A**
MATERIAL DESCRIPTION: **Mastic 9x9 sand colored FT w/ wh & bwn streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 301, 302, 303, 304, & 207**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **15A**
MATERIAL DESCRIPTION: **Mastic 9x9 sand colored FT w/ wh & bwn streaks**
MATERIAL LOCATION: **Room 301, 302, 303, 304, & 207**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

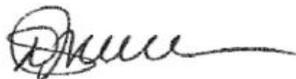

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **1x1 White floor tile w/ gray streaks**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd, 3rd flr. Hall**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **1x1 White floor tile w/ gray streaks**

MATERIAL LOCATION: **1st, 2nd, 3rd flr. Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19A**
MATERIAL DESCRIPTION: **1x1 White floor tile w/ gray streaks mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st, 2nd, and 3rd floor corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**


HOMOGENEOUS AREA: **19A**
MATERIAL DESCRIPTION: **1x1 White floor tile w/ gray streaks mastic**
MATERIAL LOCATION: **1st, 2nd, and 3rd floor corridors**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

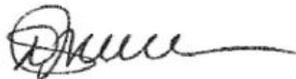

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **1x1 White mottled floor tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **1x1 White mottled floor tile**

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20A**
MATERIAL DESCRIPTION: **1x1 White mottled floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout school**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **20A**

MATERIAL DESCRIPTION: **1x1 White mottled floor tile mastic**

MATERIAL LOCATION: **Throughout school**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **1x1 White floor tile w/ green marks**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout school**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **1x1 White floor tile w/ green marks**

MATERIAL LOCATION: **Throughout school**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21A**
MATERIAL DESCRIPTION: **1x1 White floor tile w/ green marks mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2nd, 3rd flr corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **21A**

MATERIAL DESCRIPTION: **1x1 White floor tile w/ green marks mastic**

MATERIAL LOCATION: **2nd, 3rd flr corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **9x9 Dark brown FT w/ white & red streaks**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **main office, 218, 118**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **9x9 Dark brown FT w/ white & red streaks**

MATERIAL LOCATION: **main office, 218, 118**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified, implement O&M

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22A**
MATERIAL DESCRIPTION: **9x9 Dark brown FT w/ white & red streaks mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main office, 218, 118**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **22A**
MATERIAL DESCRIPTION: **9x9 Dark brown FT w/ white & red streaks mastic**
MATERIAL LOCATION: **Main office, 218, 118**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

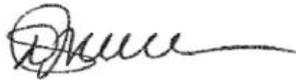

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **1x1 White floor tile w/ tan streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **111, 211**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **1x1 White floor tile w/ tan streaks**
MATERIAL LOCATION: **111, 211**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23A**
MATERIAL DESCRIPTION: **1x1 White floor tile w/ tan streaks mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **111, 211**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **23A**
MATERIAL DESCRIPTION: **1x1 White floor tile w/ tan streaks mastic**
MATERIAL LOCATION: **111, 211**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **1x1 Gray floor tile w/ tan and white streaks**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **111, 211, Library**
MATERIAL QUANTITY: **3100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **1x1 Gray floor tile w/ tan and white streaks**
MATERIAL LOCATION: **111, 211, Library**
MATERIAL QUANTITY: **3100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

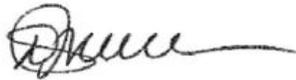

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24A**
MATERIAL DESCRIPTION: **1x1 Gray floor tile w/ tan & white streaks mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **111, 211, Library**
MATERIAL QUANTITY: **3100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **24A**
MATERIAL DESCRIPTION: **1x1 Gray floor tile w/ tan & white streaks mastic**
MATERIAL LOCATION: **111, 211, Library**
MATERIAL QUANTITY: **3100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **1x1 Black floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **auditorium**

MATERIAL QUANTITY: **8000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **1x1 Black floor tile**
MATERIAL LOCATION: **auditorium**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28A**
MATERIAL DESCRIPTION: **1x1 Black floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **8000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **28A**
MATERIAL DESCRIPTION: **1x1 Black floor tile mastic**
MATERIAL LOCATION: **Auditorium**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **2x4 Ceiling tile pinhole w/ random dots**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd floor kitchen, Auditorium**
MATERIAL QUANTITY: **8800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **3**
MATERIAL DESCRIPTION: **2x4 Ceiling tile pinhole w/ random dots**
MATERIAL LOCATION: **3rd floor kitchen, Auditorium**
MATERIAL QUANTITY: **8800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Smooth hard plaster**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout building**
MATERIAL QUANTITY: **200000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Smooth hard plaster**
MATERIAL LOCATION: **Throughout building**
MATERIAL QUANTITY: **200000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **4**
MATERIAL DESCRIPTION: **1x1 Peg hole ceiling tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd floor kitchen, lunch room, and room 314**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **4**

MATERIAL DESCRIPTION: **1x1 Peg hole ceiling tile**

MATERIAL LOCATION: **3rd floor kitchen, lunch room, and room 314**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified, implement O&M

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **2x4 ceiling tile w/ random fissures**
HISTORICAL AHERA DAMAGE CATEGORY: **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd floor dishwasher room, 3rd floor lunch room , room 314**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **5**
MATERIAL DESCRIPTION: **2x4 ceiling tile w/ random fissures**
MATERIAL LOCATION: **3rd floor dishwasher room, 3rd floor lunch room , room 314**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **Water tank jacket insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler room**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **50**

MATERIAL DESCRIPTION: **Water tank jacket insulation**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY: **150**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

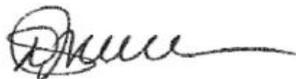

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Boiler door gasket**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler room**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Boiler door gasket**
MATERIAL LOCATION: **Boiler room**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **Kiln fire brick**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout school**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **Kiln fire brick**
MATERIAL LOCATION: **Throughout school**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **Incinerator fire brick mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler room**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **56**

MATERIAL DESCRIPTION: **Incinerator fire brick mortar**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **Glazed brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd floor girl's toilet NW corner, 2nd floor NW stairway, 1st floor corridor NE corner**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**


HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **Glazed brick**
MATERIAL LOCATION: **3rd floor girl's toilet NW corner, 2nd floor NW stairway, 1st floor corridor NE corner**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

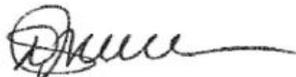

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **Glazed brick mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd floor girl's toilet NW corner, 2nd floor NW stairway, 1st floor corridor NE corner**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **Glazed brick mortar**
MATERIAL LOCATION: **3rd floor girl's toilet NW corner, 2nd floor NW stairway, 1st floor corridor NE corner**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **Cinderblock**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st floor men's toilet SE corner, Boiler room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **59**

MATERIAL DESCRIPTION: **Cinderblock**

MATERIAL LOCATION: **1st floor men's toilet SE corner, Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **2x4 Ceiling tile w/ fissures parallel to width**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd floor north south hall, Room 309, 2nd floor north wing wall**
MATERIAL QUANTITY: **28000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **6**
MATERIAL DESCRIPTION: **2x4 Ceiling tile w/ fissures parallel to width**
MATERIAL LOCATION: **3rd floor north south hall, Room 309, 2nd floor north wing wall**
MATERIAL QUANTITY: **28000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **Cinder block mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st floor men's toilet SE corner, Boiler room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **60**

MATERIAL DESCRIPTION: **Cinder block mortar**

MATERIAL LOCATION: **1st floor men's toilet SE corner, Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

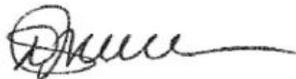

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement weight room, drama room , locker room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **61**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Basement weight room, drama room , locker room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

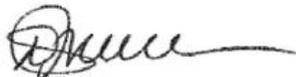

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Masonry brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **62**

MATERIAL DESCRIPTION: **Masonry brick**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

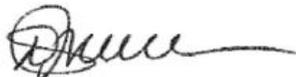

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **Masonry brick mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **63**

MATERIAL DESCRIPTION: **Masonry brick mortar**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

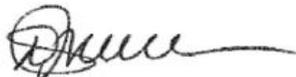

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **Interior window caulk (brown)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout the school**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **64**

MATERIAL DESCRIPTION: **Interior window caulk (brown)**

MATERIAL LOCATION: **Throughout the school**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **Clay brick tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement between tempering coils, S wall near fan unit, next to reheat #7, fresh air intake #4**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**


HOMOGENEOUS AREA: **65**
MATERIAL DESCRIPTION: **Clay brick tile**
MATERIAL LOCATION: **Basement between tempering coils, S wall near fan unit, next to reheat #7, fresh air intake #4**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

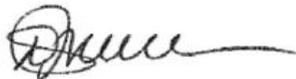

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **Clay brick tile mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Basement between tempering coils, S wall near fan unit, next to reheat #7, fresh air intake #4**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**


HOMOGENEOUS AREA: **66**
MATERIAL DESCRIPTION: **Clay brick tile mortar**
MATERIAL LOCATION: **Basement between tempering coils, S wall near fan unit, next to reheat #7, fresh air intake #4**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

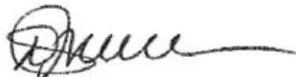

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **67**
MATERIAL DESCRIPTION: **Terrazzo flooring**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st floor SE corner vest., main entrance vest., NW corner vest.**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **67**

MATERIAL DESCRIPTION: **Terrazzo flooring**

MATERIAL LOCATION: **1st floor SE corner vest., main entrance vest., NW corner vest.**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **Boiler mortar**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **68**
MATERIAL DESCRIPTION: **Boiler mortar**
MATERIAL LOCATION: **Boiler room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **69**
MATERIAL DESCRIPTION: **9x9 VAT (Brown w/ white specks) Mastic black**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main office, vaults, copy room**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **69**

MATERIAL DESCRIPTION: **9x9 VAT (Brown w/ white specks) Mastic black**

MATERIAL LOCATION: **Main office, vaults, copy room**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **7**
MATERIAL DESCRIPTION: **1x1 Rough white ceiling tile**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Library**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **7**

MATERIAL DESCRIPTION: **1x1 Rough white ceiling tile**

MATERIAL LOCATION: **Library**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified, implement O&M

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **70**
MATERIAL DESCRIPTION: **Brown VAT molding**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main office vaults**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **70**

MATERIAL DESCRIPTION: **Brown VAT molding**

MATERIAL LOCATION: **Main office vaults**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **71**
MATERIAL DESCRIPTION: **Black VAT molding mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main office vaults**
MATERIAL QUANTITY: **10** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **71**

MATERIAL DESCRIPTION: **Black VAT molding mastic**

MATERIAL LOCATION: **Main office vaults**

MATERIAL QUANTITY: **10**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **12x12 VFT beige w/ white, brown & tan specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 303**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **72**
MATERIAL DESCRIPTION: **12x12 VFT beige w/ white, brown & tan specks**
MATERIAL LOCATION: **Room 303**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **12x12 VFT beige w/ white, bwn & tan specks, mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 303**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **73**
MATERIAL DESCRIPTION: **12x12 VFT beige w/ white, bwn & tan specks, mastic**
MATERIAL LOCATION: **Room 303**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **74**
MATERIAL DESCRIPTION: **Black Vinyl baseboard**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 303 and 304**
MATERIAL QUANTITY: **224** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **74**
MATERIAL DESCRIPTION: **Black Vinyl baseboard**
MATERIAL LOCATION: **Rooms 303 and 304**
MATERIAL QUANTITY: **224** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **75**
MATERIAL DESCRIPTION: **Black vinyl baseboard mastic (beige)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 303 and 304**
MATERIAL QUANTITY: **224** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **75**
MATERIAL DESCRIPTION: **Black vinyl baseboard mastic (beige)**
MATERIAL LOCATION: **Rooms 303 and 304**
MATERIAL QUANTITY: **224** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **12x12 VFT cream w/ beige specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 304**

MATERIAL QUANTITY: **224**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **12x12 VFT cream w/ beige specks**
MATERIAL LOCATION: **Room 304**
MATERIAL QUANTITY: **224** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **Mastic (black) 12x12 VFT cream w/ beige specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 304**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **77**

MATERIAL DESCRIPTION: **Mastic (black) 12x12 VFT cream w/ beige specks**

MATERIAL LOCATION: **Room 304**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **12x12 VFT (Beige w/ white & beige specks)**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 203**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **12x12 VFT (Beige w/ white & beige specks)**
MATERIAL LOCATION: **Room 203**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

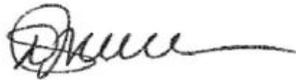

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **Tan Mastic 12x12 VFT beige w/ white & beige specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 203**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **79**
MATERIAL DESCRIPTION: **Tan Mastic 12x12 VFT beige w/ white & beige specks**
MATERIAL LOCATION: **Room 203**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

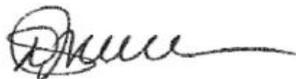

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8**
MATERIAL DESCRIPTION: **2x2 Rough white ceiling tile**
HISTORICAL AHERA DAMAGE CATEGORY: **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 113**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **8**

MATERIAL DESCRIPTION: **2x2 Rough white ceiling tile**

MATERIAL LOCATION: **Room 113**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

If identified, implement O&M

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **Blk mastic 12x12 VFT beige w/ white & beige specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 203**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **Blk mastic 12x12 VFT beige w/ white & beige specks**
MATERIAL LOCATION: **Room 203**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **81**
MATERIAL DESCRIPTION: **Vinyl baseboard dark brown**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 203**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **81**

MATERIAL DESCRIPTION: **Vinyl baseboard dark brown**

MATERIAL LOCATION: **Room 203**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **82**
MATERIAL DESCRIPTION: **Light beige mastic vinyl baseboard (dark brown)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 203**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **82**

MATERIAL DESCRIPTION: **Light beige mastic vinyl baseboard (dark brown)**

MATERIAL LOCATION: **Room 203**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **83**
MATERIAL DESCRIPTION: **12x12 VFT green w/ green specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **221, gym, 109 ,108**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **83**
MATERIAL DESCRIPTION: **12x12 VFT green w/ green specks**
MATERIAL LOCATION: **221, gym, 109 ,108**
MATERIAL QUANTITY: **6000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **84**
MATERIAL DESCRIPTION: **Black mastic 12x12 VFT green w/ green specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **gym**

MATERIAL QUANTITY: **6000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **84**

MATERIAL DESCRIPTION: **Black mastic 12x12 VFT green w/ green specks**

MATERIAL LOCATION: **gym**

MATERIAL QUANTITY: **6000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

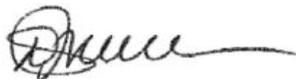

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **85**
MATERIAL DESCRIPTION: **12x12 VFT gray flecks w/ grey specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 320**

MATERIAL QUANTITY: **760**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **85**
MATERIAL DESCRIPTION: **12x12 VFT gray flecks w/ grey specks**
MATERIAL LOCATION: **Room 320**
MATERIAL QUANTITY: **760** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **86**
MATERIAL DESCRIPTION: **Mastic 12x12 VFT gray flacks w/ gray specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 203**

MATERIAL QUANTITY: **760**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **86**
MATERIAL DESCRIPTION: **Mastic 12x12 VFT gray flacks w/ gray specks**
MATERIAL LOCATION: **Room 203**
MATERIAL QUANTITY: **760** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **87**
MATERIAL DESCRIPTION: **12x12 VFT beige w/ multicolors-wht, yel, rust, bge**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 201**
MATERIAL QUANTITY: **760** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **87**

MATERIAL DESCRIPTION: **12x12 VFT beige w/ multicolors-wht, yel, rust, bge**

MATERIAL LOCATION: **Room 201**

MATERIAL QUANTITY: **760**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

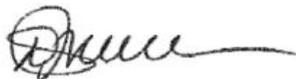

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **88**
MATERIAL DESCRIPTION: **Black mastic 12x12 VFT beige w/ multicolors**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 201**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **88**
MATERIAL DESCRIPTION: **Black mastic 12x12 VFT beige w/ multicolors**
MATERIAL LOCATION: **Room 201**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

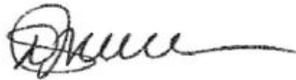

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **89**
MATERIAL DESCRIPTION: **12x12 VFT green w/ dark green & white streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 110, 1st floor corridor main entrance,**

MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **89**
MATERIAL DESCRIPTION: **12x12 VFT green w/ dark green & white streaks**
MATERIAL LOCATION: **Room 110, 1st floor corridor main entrance,**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

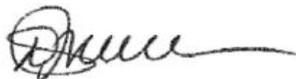

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **1x1 White ceiling tile w/ fissures**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 125**
MATERIAL QUANTITY: **768** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **9**
MATERIAL DESCRIPTION: **1x1 White ceiling tile w/ fissures**
MATERIAL LOCATION: **Room 125**
MATERIAL QUANTITY: **768** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **90**
MATERIAL DESCRIPTION: **Beige mastic 12x12 VFT green w/ white & green strk**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st floor corridor main entrance, Rm 110**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **90**
MATERIAL DESCRIPTION: **Beige mastic 12x12 VFT green w/ white & green strk**
MATERIAL LOCATION: **1st floor corridor main entrance, Rm 110**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **91**
MATERIAL DESCRIPTION: **12x12 VFT Cream w/ beige specks**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineer office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **91**

MATERIAL DESCRIPTION: **12x12 VFT Cream w/ beige specks**

MATERIAL LOCATION: **Engineer office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified, implement O&M

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **92**
MATERIAL DESCRIPTION: **Black mastic 12x12 VFT crème w/ beige streaks**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **92**

MATERIAL DESCRIPTION: **Black mastic 12x12 VFT crème w/ beige streaks**

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified, implement O&M

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **93**
MATERIAL DESCRIPTION: **VFT molding tan w/ white & brown specks**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **93**

MATERIAL DESCRIPTION: **VFT molding tan w/ white & brown specks**

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified, implement O&M

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **94**
MATERIAL DESCRIPTION: **Black mastic VFT molding**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY:

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **94**

MATERIAL DESCRIPTION: **Black mastic VFT molding**

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY: **20**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

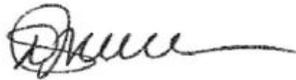

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **95**
MATERIAL DESCRIPTION: **Exterior Brick - Non AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **95**

MATERIAL DESCRIPTION: **Exterior Brick - Non AHERA**

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **96**
MATERIAL DESCRIPTION: **Exterior Brick Mortar - Non AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **96**

MATERIAL DESCRIPTION: **Exterior Brick Mortar - Non AHERA**

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **97**
MATERIAL DESCRIPTION: **Exterior window caulk (Non AHERA)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **97**

MATERIAL DESCRIPTION: **Exterior window caulk (Non AHERA)**

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **98**
MATERIAL DESCRIPTION: **Exterior door caulk (Non AHERA)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Surrounding exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **98**

MATERIAL DESCRIPTION: **Exterior door caulk (Non AHERA)**

MATERIAL LOCATION: **Surrounding exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **99**
MATERIAL DESCRIPTION: **Roof (NON AHERA)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Roof exterior**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUIDLING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **99**

MATERIAL DESCRIPTION: **Roof (NON AHERA)**

MATERIAL LOCATION: **Roof exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

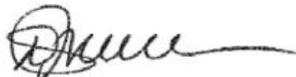

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **144**
MATERIAL DESCRIPTION: **2' x 2' Ceiling Tile w/ Gouges and Holes**
MATERIAL LOCATION: **Throughout New Building**
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **Yes**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
ACCESSIBILITY: **Barely Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **144**
MATERIAL DESCRIPTION: **2' x 2' Ceiling Tile w/ Gouges and Holes**
MATERIAL LOCATION: **Throughout New Building**
MATERIAL QUANTITY: **25000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **147**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Floor Tile Accent**
MATERIAL LOCATION: **All Classrooms in New Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **147**

MATERIAL DESCRIPTION: **12" x 12" Light Brown Floor Tile Accent**

MATERIAL LOCATION: **All Classrooms in New Building**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **153**
MATERIAL DESCRIPTION: **Black Marble Pattern Sheet Flooring**
MATERIAL LOCATION: **TV Studio Room 351 (New Building)**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **02/25/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**


HOMOGENEOUS AREA: **153**
MATERIAL DESCRIPTION: **Black Marble Pattern Sheet Flooring**
MATERIAL LOCATION: **TV Studio Room 351 (New Building)**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

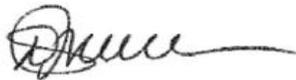

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**


HOMOGENEOUS AREA: **155**
MATERIAL DESCRIPTION: **Textured Acoustical Plaster**
MATERIAL LOCATION: **Library (New Building)**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

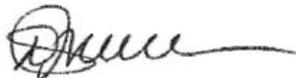

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **151**
MATERIAL DESCRIPTION: **12" x 12" Blue Mottled Floor Tile**
MATERIAL LOCATION: **Rooms 251, 253, 255, 259, 261 (New Building)**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Management Planner Review Form


LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **151**
MATERIAL DESCRIPTION: **12" x 12" Blue Mottled Floor Tile**
MATERIAL LOCATION: **Rooms 251, 253, 255, 259, 261 (New Building)**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

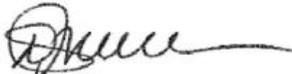Management Planner's Signature:  _____ Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **143**
MATERIAL DESCRIPTION: **Tan, Gray, and Green Terrazzo**
MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors and Stairwells (New Building)**
MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **143**

MATERIAL DESCRIPTION: **Tan, Gray, and Green Terrazzo**

MATERIAL LOCATION: **1st, 2nd, 3rd Floor Corridors and Stairwells (New Building)**

MATERIAL QUANTITY: **15000** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

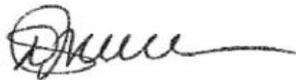

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **148**

MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Light Brown Floor Tile Accent**

MATERIAL LOCATION: **All Classrooms in New Building**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**


HOMOGENEOUS AREA: **148**
MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Light Brown Floor Tile Accent**
MATERIAL LOCATION: **All Classrooms in New Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

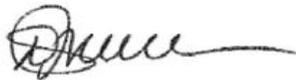

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **154**

MATERIAL DESCRIPTION: **Mastic Associated w/ Black Marble Sheet Flooring**

MATERIAL LOCATION: **TV Studio Room 351 (New Building)**

MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **149**
MATERIAL DESCRIPTION: **12" x 12" Green Floor Tile Accent**
MATERIAL LOCATION: **All Classrooms in New Building**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **149**

MATERIAL DESCRIPTION: **12" x 12" Green Floor Tile Accent**

MATERIAL LOCATION: **All Classrooms in New Building**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

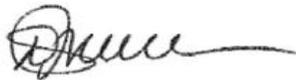

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **140**
MATERIAL DESCRIPTION: **Acoustical Plaster on Walls**
MATERIAL LOCATION: **Auditorium (New Building)**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **SURFACE** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **140**

MATERIAL DESCRIPTION: **Acoustical Plaster on Walls**

MATERIAL LOCATION: **Auditorium (New Building)**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

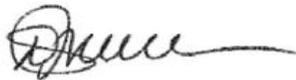

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **145**
MATERIAL DESCRIPTION: **12" x 12" Beige w/ light Brown and Green Spots Floor Tile**
MATERIAL LOCATION: **All Classrooms in New Building**
MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **145**

MATERIAL DESCRIPTION: **12" x 12" Beige w/ light Brown and Green Spots Floor Tile**

MATERIAL LOCATION: **All Classrooms in New Building**

MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

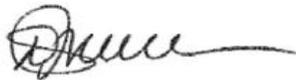

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **150**

MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Green Floor Tile Accent**

MATERIAL LOCATION: **All Classrooms in New Building**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____



Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **152**

MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Blue Mottled Floor Tile**

MATERIAL LOCATION: **Rooms 251, 253, 255, 259, 261 (New Building)**

MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC** FRIABLE: **No**

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW** CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE REASON:
DAMAGE REASON:

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**


HOMOGENEOUS AREA: **152**
MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Blue Mottled Floor Tile**
MATERIAL LOCATION: **Rooms 251, 253, 255, 259, 261 (New Building)**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

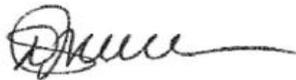

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **141**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Various Locations throughout New Building**
MATERIAL QUANTITY: **150000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Management Planner Review Form


LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **141**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Various Locations throughout New Building**
MATERIAL QUANTITY: **150000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

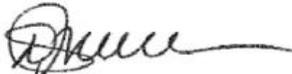Management Planner's Signature:  _____ Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Management Planner Review Form


LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **142**
MATERIAL DESCRIPTION: **Off-White Spray-on Fireproofing**
MATERIAL LOCATION: **Support Beams Throughout (New Building)**
MATERIAL QUANTITY: **80000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

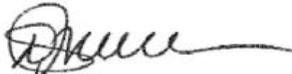Management Planner's Signature:  _____ Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Evan Christian**
SCHOOL NAME: **Kelly High School** INSPECTION DATE: **2/25/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **146**
MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Beige w/ light Brown and Green Spots Floor Tile**
MATERIAL LOCATION: **All Classrooms in New Building**
MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE: **No**
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: 02/25/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46181** BUILDING ID: **1400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Kelly High School** REVIEW DATE: **4/9/2016**
ADDRESS: **4136 S. California** IDPH LICENSE NO: **100-19466**

HOMOGENEOUS AREA: **146**

MATERIAL DESCRIPTION: **Mastic Associated w/ 12" x 12" Beige w/ light Brown and Green Spots Floor Tile**

MATERIAL LOCATION: **All Classrooms in New Building**

MATERIAL QUANTITY: **30000** MATERIAL UNITS: **SF**


DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____

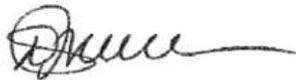

Date: **04/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates


2016 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

Evan Christian

Illinois Licensed Project Manager, and Air Sampling Professional

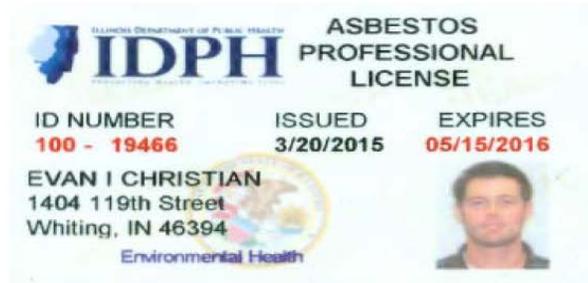

ENDORSEMENTS	TC EXPIRES
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	12/12/2015
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

**CARNOW
CONIBEAR**

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.
7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024159


Katy DeSalvo, Director

Reliable
Environmental
Solutions, Inc. **RES**

This is to certify that **Evan Christian**

*has on January 28 & 29, 2016, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Initial Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: January 28 & 29, 2016

Examination Date: January 29, 2016

Expiration Date: January 29, 2017

Certificate Number: MP/0103

William S. Williams

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ www.ReliableEnv.com

2016



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Daniel Juneau

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/6/2016

Exam Date: 1/6/2016

Expiration Date: 1/6/2017

Certificate Number: MPR1601060038



Kathy DeSalvo, Director

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional

 **ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER 100 - 03613	ISSUED 3/16/2015	EXPIRES 05/15/2016
--	-----------------------------------	-------------------------------------

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016
Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR	12/2/2015
MANAGEMENT PLANNER	1/20/2016
PROJECT MANAGER	12/11/2015
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Daniel Juneau

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024163


Kathy DeSalvo, Director

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed