

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-0020
SCHOOL NAME: Hubbard High School
ADDRESS OF SCHOOL: 6200 S. Hamlin
CITY: Chicago, IL, 60629

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/14/2013**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 5/10/2016 ENROLLMENT 1745
IDPH INSPECTOR LICENSE NUMBER: 100-04208
IDPH LICENSED INSPECTOR NAME (Please Print): James Lehnhardt
IDPH MP LICENSE NUMBER: 100-03613
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Daniel Juneau

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



5/10/2016

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Hubbard High School

6200 S. Hamlin
Chicago, IL, 60629

Unit: 46341
Building ID: 1670

IDPH ID Number: 14-016-2990-0020

REPORT DATE:

Tuesday, May 10, 2016

Prepared for:

Chicago Public Schools
125 S. Clark Street
Chicago, IL 60603

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

March 9, 2016

Mr. R. Kent Cook
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2016 Three-Year Reinspections

Dear Mr. Cook:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3,4,5 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 46341 Region: 05 IDPH ID: 14-016-2990-0020

School: Hubbard High School Building ID: 1670

Address: 6200 S. Hamlin

Chicago, IL, 60629

Building Contact: Moore, Tony

Contact Phone: 312-434-0781

Current Building Owners: Chicago Public Schools

Review Date: 05/10/2016

Inspector: James Lehnhardt


Inspector IDPH License: 100-04208

Management Planner: Daniel Juneau

Management Planner IDPH License: 100-03613

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates



Daniel Juneau
100-03613

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: March 09, 2016

RE: Hubbard High School, Unit 46341
6200 S. Hamlin
Chicago, IL, 60629

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2016 asbestos three year re-inspection has been completed at Hubbard High School , following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Hubbard High School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School:	Hubbard High School	Unit:	46341	Region:	05
Address:	6200 S. Hamlin		Chicago, IL, 60629		
IDPH ID:	14-016-2990-0020		Building ID:	1670	
Contact:	Moore, Tony		Phone:	312-434-0781	

2. Description of Facility

Original Construction:	1965	Additional Construction:	1929,1974
Total Square Footage:	73900	No of Floors:	3
Current Occupancy:	1745		

3. LEA Designated Person

Contact:	Robert Christlieb	Phone:	(773) 553-3197
Address:	125 South Clark Street, 17th Floor Chicago, IL 60603		

4. Managing Environmental Consultant

MEC:	Carnow, Conibear and Associates		
Contact:	Dan Juneau		
Address:	600 West Van Buren St., Ste 500		
Phone:	(312) 762-2900	Fax:	(312) 782-5145

5. Inspector

Inspector Name: James Lehnhardt


Inspector IDPH license # 100-04208

Signature:
Date: 3/9/2016

6. Management Planner

Management Planner Name: Daniel Juneau

Management Planner IDPH license # 100-03613

Signature: 
Date: 05/10/2016

7. Review Date: 05/10/2016

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature: 

Date: 5/10/2016

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Hubbard High School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.92 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 1670:

- | | |
|----|-------------------------|
| 02 | canvas over water tanks |
| 03 | boiler gaskets |
| 04 | foil over ductwork |

B. The following new homogenous areas have been identified for Building 1670:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

02	canvas over water tanks
04	foil over ductwork
41A-1	12x12 off white w/brown specks
41A-2	12x12 gray w/speckles
43A-1	12x12 off white w/brown specks mastic
43A-2	12x12 gray w/speckles mastic
44A-1A	12x12 brown VFT
44A-1B	12x12 tan VFT
44A-2	12x12 offwhite w/speckles
44A-3	12x12 gray VFT
45A-1A	12x12 brown VFT mastic
45A-1B	12x12 tan VFT mastic
45A-2	12x12 offwhite w/speckles mastic
45A-3	12x12 gray VFT matic
46A	12x12 brown VFT
48	9x9 black & red checkerboard VFT
49	9x9 VFT (not observed)
50	9x9 peach w/ rust streaks VFT
51	Peach w/ rust streaks VFT Mastic
52	2 x 4 ACT
53	1x1 ACT
54	1x1 ACT Mastic
55	spray on acoustical ceiling
56	2x2 ceiling tile
57	9x9 green and cream checkered VFT
58	9x9 green and cream checkered VFT mastic
59	2x4 ACT
60	12x12 Blue VAT
61	12x12 Blue VFT mastic
62	Cream Linoleum
63	Cream Linoleum Mastic
64	Lab tabletops
75	12" x 12" Green VFT with white streaks
76	12" x 12" off white with gray specks
77	Hard Packed Fittings on fiberglass insulated pipes
78	12" x 12" White VFT with blue streaks
CM-2	blue carpet mastic
CM-3	rust carpet mastic
CM-4	purple & tan carpet mastic

The following areas were deemed to be inaccessible:

03	boiler gaskets
04	foil over ductwork
42A-1	9x9 tan w/rust streaks mastic
45A-1B	12x12 tan VFT mastic
45A-2	12x12 offwhite w/speckles mastic
45A-3	12x12 gray VFT matic
47A	12x12 brown VFT mastic
51	Peach w/ rust streaks VFT Mastic
54	1x1 ACT Mastic
55	spray on acoustical ceiling
56	2x2 ceiling tile
58	9x9 green and cream checkered VFT mastic
63	Cream Linoleum Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by James Lehnhardt, IDPH License # 100-04208. The Management Plan was updated by Daniel Juneau, IDPH License # 100-03613. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard Ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Hubbard High School Building 1670 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Hubbard High School Unit 46341 Building ID 1670

Address 6200 S. Hamlin Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01	fiberglass pipe wrap			boiler room, basement, rm. 207	NOT_TESTED	TSI		None						
02	canvas over water tanks	200	SF	boiler rm., basement	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
03	boiler gaskets	25	LF	boiler room	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
04	foil over ductwork	1,000	LF	basement	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
40A-1	9x9 tan w/rust streaks	3,140	SF	rm 116E,116W,115,113	CHR	MISC	N	DIST	4		No	ACBM with the potential for damage	5	LOW
41A-1	12x12 off white w/brown specks	41,000	SF	throughout classrooms, 2nd fl., 3rd. Fl.,nurses office, 2nd & 3rd fl. East corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41A-2	12x12 gray w/speckles	10,355	SF	1st,2nd,3rd flr. Corridors,lunchrm	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42A-1	9x9 tan w/rust streaks mastic	3,140	SF	rm 116E,116W,115,113,114	CHR	MISC	N	DIST	4		No	ACBM with the potential for damage	5	LOW
43A-1	12x12 off white w/brown specks mastic	41,000	SF	throughout classrooms on flrs 1,2,3 and east corridor on flrs 1,2,3, also in nurses office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43A-2	12x12 gray w/speckles mastic	10,355	SF	corridors on flrs 1,2,3 and lunchrm	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44A-1A	12x12 brown VFT	3,025	SF	rms.:310,307,305,302	ASSUMED	MISC	N	DIST	15		No	ACBM with the potential for damage	5	LOW
44A-1B	12x12 tan VFT	3,025	SF	rms.:310,307,305,302	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
44A-2	12x12 offwhite w/speckles	10,000	SF	rms: 200,202,201,203,203A,204,205,207,E&W corridors,throughout 1st flr	ASSUMED	MISC	N	DIST	25		No	ACBM with the potential for damage	5	LOW
44A-3	12x12 gray VFT	650	SF	girls gym office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45A-1A	12x12 brown VFT mastic	3,025	SF	rms.:310,307,305,302	ASSUMED	MISC	N	DIST	15		No	ACBM with the	5	LOW

Chicago Public Schools

School Hubbard High School Unit 46341 Building ID 1670

Address 6200 S. Hamlin Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				2								potential for damage		
45A-1B	12x12 tan VFT mastic	3,025	SF	rms.:310,307,305,302	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
45A-2	12x12 offwhite w/speckles mastic	10,000	SF	rms: 200,202,201,203,203A,204,205,207,E&W corridors,throughout 1st flr	ASSUMED	MISC	N	DIST	25		No	ACBM with the potential for damage	5	LOW
45A-3	12x12 gray VFT matic	650	SF	girls gym office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
46A	12x12 brown VFT	5,285	SF	corridor,west lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
47A	12x12 brown VFT mastic	5,285	SF	corridor,westlunchroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
48	9x9 black & red checkerboard VFT	300	SF	1929 BLDG basement storage rm.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
49	9x9 VFT (not observed)			1929 building	ASSUMED	MISC		None						
50	9x9 peach w/ rust streaks VFT	500	SF	Rm. 117	ASSUMED	MISC	N	LOC	2		No	ACBM with the potential for damage	5	LOW
51	Peach w/ rust streaks VFT Mastic	500	SF	Rm. 117	ASSUMED	MISC	N	LOC	2		No	ACBM with the potential for damage	5	LOW
52	2 x 4 ACT	6,300	SF	W. Corr., W. Lunchrm, Tchrs Lunchrm, Library, Rms. 120,210E,210W,311-320,324-327, 3rd. Fl NW&SW Corr	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
53	1x1 ACT	500	SF	E. Lunchrm, 3rd fl. Girls gym corridor, rms. 208, 209, 213, 219, 220	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
54	1x1 ACT Mastic	500	SF	E. Lunchrm,3rd fl. Girls gym corridor, rms. 208,209,213,219,220	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
55	spray on acoustical ceiling	850	SF	nurses office, rms. 111-113,115-117,211-212,214-217,223,225,226	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
56	2x2 ceiling tile	7,500	SF	west gym	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable		LOW

Chicago Public Schools

School Hubbard High School Unit 46341 Building ID 1670

Address 6200 S. Hamlin Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
												ACBM or friable suspect ACBM		
57	9x9 green and cream checkered VFT	5,000	SF	East lunchroom	ASSUMED	MISC	N	DIST	5		No	ACBM with the potential for damage	5	LOW
58	9x9 green and cream checkered VFT mastic	5,000	SF	east lunchroom	ASSUMED	MISC	N	DIST	5		No	ACBM with the potential for damage	5	LOW
59	2x4 ACT			stockpiled in basement corridor	ASSUMED	MISC		None						Low
60	12x12 Blue VAT	500	SF	Teachers Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
61	12x12 Blue VFT mastic	500	SF	Teachers lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
62	Cream Linoleum	500	SF	Rm 210E, 210W	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
63	Cream Linoleum Mastic	500	SF	Rm. 210 E, 210W	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
64	Lab tabletops	1,200	SF	rms. 210E, 210W,303,305,307,310	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
75	12" x 12" Green VFT with white streaks	2,000	SF	Auditorium	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
76	12" x 12" off white with gray specks	300	SF	Main Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
77	Hard Packed Fittings on fiberglass insulated pipes	200	LF	Rms 205 - 207, Athletic Building Mech. Rms (East and West), North and South Crawl Space	ASSUMED	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
78	12" x 12" White VFT with blue streaks	300	SF	209	ASSUMED	MISC	N	LOC	9		No	ACBM with the potential for damage	5	LOW
CM-1	gray carpet mastic	2,475	SF	rm 108,teachers lounge, library	CHR	MISC	N	DIST	15		No	ACBM with the potential for damage	5	LOW
CM-2	blue carpet mastic	1,520	SF	rm 100, 225, 227	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
CM-3	rust carpet mastic	735	SF	counselors office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
CM-4	purple & tan carpet mastic	1,440	SF	office, principals office, asst principals office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Hubbard High School Unit 46341 Building ID 1670

Address 6200 S. Hamlin Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 3/9/2016
Inspector Name James Lehnhardt
100-04208 5/15/2016
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
03	
04	
40A-1	Damage is located in Rooms 113 and 116
41A-1	
41A-2	
42A-1	Damage is located in Room 113 and 116
43A-1	
43A-2	
44A-1A	Damage is located in Rooms 307 and 310
44A-1B	
44A-2	Damage is located in Rooms 202, 205, and 207
44A-3	
45A-1A	Damage is located in Rooms 307 and 310
45A-1B	
45A-2	Damage is located in Rooms 202, 205, and 207
45A-3	
46A	
47A	
48	
49	Not observed 2016
50	Damage is located in Room 117
51	Damage is located in Room 117

Chicago Public Schools

School Hubbard High School Unit 46341 Building ID 1670

Address 6200 S. Hamlin Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
52	
53	
54	
55	
56	
57	Damage is located in the East Lunchroom
58	Damage is located in the East Lunchroom
59	Not observed 2016
60	
61	
62	
63	
64	
75	
76	
77	
78	Damage is located in Room 209
CM-1	Light carpet shredding
CM-2	
CM-3	
CM-4	

Table II

Management Planner's Review

Chicago Public Schools

School Hubbard High School

Unit 46341

Building ID 1670

Address 6200 S. Hamlin

Chicago, IL, 60629

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	fiberglass pipe wrap			boiler room, basement, rm. 207	Not Tested						
02	canvas over water tanks	200	SF	boiler rm., basement	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
03	boiler gaskets	25	LF	boiler room	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
04	foil over ductwork	1,000	LF	basement	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
40A-1	9x9 tan w/rust streaks	3,140	SF	rm 116E,116W,115,113	Chrysotile	MISC	No	4	SF	6 ACBM with the potential for damage	Repair
41A-1	12x12 off white w/brown specks	41,000	SF	throughout classrooms, 2nd fl., 3rd. Fl.,nurses office, 2nd & 3rd fl. East corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41A-2	12x12 gray w/speckles	10,355	SF	1st,2nd,3rd flr. Corridors,lunchrm	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42A-1	9x9 tan w/rust streaks mastic	3,140	SF	rm 116E,116W,115,113, 114	Chrysotile	MISC	No	4	SF	6 ACBM with the potential for damage	Repair
43A-1	12x12 off white w/brown specks mastic	41,000	SF	throughout classrooms on flrs 1,2,3 and east corridor on flrs 1,2,3, also in nurses office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43A-2	12x12 gray w/speckles mastic	10,355	SF	corridors on flrs 1,2,3 and lunchrm	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44A-1A	12x12 brown VFT	3,025	SF	rms.:310,307,305,302	Assumed	MISC	No	15	SF	6 ACBM with the potential for damage	Repair
44A-1B	12x12 tan VFT	3,025	SF	rms.:310,307,305,302	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
44A-2	12x12 offwhite w/speckles	10,000	SF	rms: 200,202,201,203,203A,204,205,207,E& W corridors,throughout 1st flr	Assumed	MISC	No	25	SF	6 ACBM with the potential for damage	Repair
44A-3	12x12 gray VFT	650	SF	girls gym office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45A-1A	12x12 brown VFT mastic	3,025	SF	rms.:310,307,305,302	Assumed	MISC	No	15	SF	6 ACBM with the potential for damage	Repair
45A-1B	12x12 tan VFT mastic	3,025	SF	rms.:310,307,305,302	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
45A-2	12x12 offwhite w/speckles mastic	10,000	SF	rms: 200,202,201,203,203A,204,205,207,E& W corridors,throughout 1st flr	Assumed	MISC	No	25	SF	6 ACBM with the potential for damage	Repair
45A-3	12x12 gray VFT matic	650	SF	girls gym office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
46A	12x12 brown VFT	5,285	SF	corridor,west lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
47A	12x12 brown VFT mastic	5,285	SF	corridor,westlunchroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
48	9x9 black & red checkerboard VFT	300	SF	1929 BLDG basement storage rm.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
49	9x9 VFT (not observed)			1929 building	Assumed	MISC					
50	9x9 peach w/ rust streaks VFT	500	SF	Rm. 117	Assumed	MISC	No	2	SF	6 ACBM with the potential for damage	Repair
51	Peach w/ rust streaks VFT Mastic	500	SF	Rm. 117	Assumed	MISC	No	2	SF	6 ACBM with the potential for damage	Repair
52	2 x 4 ACT	6,300	SF	W. Corr., W. Lunchrm, Tchrs Lunchrm,	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable	Follow O&M Plan

Chicago Public Schools

School Hubbard High School

Unit 46341

Building ID 1670

Address 6200 S. Hamlin

Chicago, IL, 60629

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Num	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				Library, Rms. 120,210E,210W,311-320,324-327, 3rd. Fl NW&SW Corr						suspect ACBM	
53	1x1 ACT	500	SF	E. Lunchrm, 3rd fl. Girls gym corridor, rms. 208, 209, 213, 219, 220	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
54	1x1 ACT Mastic	500	SF	E. Lunchrm,3rd fl. Girls gym corridor, rms. 208,209,213,219,220	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
55	spray on acoustical ceiling	850	SF	nurses office, rms. 111-113,115-117,211-212,214-217,223,225,226	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
56	2x2 ceiling tile	7,500	SF	west gym	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
57	9x9 green and cream checkered VFT	5,000	SF	East lunchroom	Assumed	MISC	No	5	SF	6 ACBM with the potential for damage	Repair
58	9x9 green and cream checkered VFT mastic	5,000	SF	east lunchroom	Assumed	MISC	No	5	SF	6 ACBM with the potential for damage	Repair
59	2x4 ACT			stockpiled in basement corridor	Assumed	MISC					
60	12x12 Blue VAT	500	SF	Teachers Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
61	12x12 Blue VFT mastic	500	SF	Teachers lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
62	Cream Linoleum	500	SF	Rm 210E, 210W	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
63	Cream Linoleum Mastic	500	SF	Rm. 210 E, 210W	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
64	Lab tabletops	1,200	SF	rms. 210E, 210W,303,305,307,310	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
75	12" x 12" Green VFT with white streaks	2,000	SF	Auditorium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
76	12" x 12" off white with gray specks	300	SF	Main Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
77	Hard Packed Fittings on fiberglass insulated pipes	200	LF	Rms 205 - 207, Athletic Building Mech. Rms (East and West), North and South Crawl Space	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
78	12" x 12" White VFT with blue streaks	300	SF	209	Assumed	MISC	No	9	SF	6 ACBM with the potential for damage	Repair
CM-1	gray carpet mastic	2,475	SF	rm 108,teachers lounge, library	Chrysotile	MISC	No	15	SF	6 ACBM with the potential for damage	Repair
CM-2	blue carpet mastic	1,520	SF	rm 100, 225, 227	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CM-3	rust carpet mastic	735	SF	counselors office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CM-4	purple & tan carpet mastic	1,440	SF	office, principals office, asst principals office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Hubbard High School
Address 6200 S. Hamlin

Unit 46341
 Chicago, IL, 60629

Building ID 1670
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	5/10/2016
Manager Planner Name	Daniel Juneau
100-03613	5/15/2016
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	
04	
40A-1	Repair as needed then follow O&M plan.
41A-1	
41A-2	
42A-1	Repair as needed then follow O&M plan.
43A-1	
43A-2	
44A-1A	Repair as needed then follow O&M plan.

Chicago Public Schools

School Hubbard High School
Address 6200 S. Hamlin

Unit 46341
 Chicago, IL, 60629

Building ID 1670
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
44A-1B	
44A-2	Repair as needed then follow O&M plan.
44A-3	
45A-1A	Repair as needed then follow O&M plan.
45A-1B	
45A-2	Repair as needed then follow O&M plan.
45A-3	
46A	
47A	
48	
49	If identified, implement O&M
50	Repair as needed then follow O&M plan.
51	Repair as needed then follow O&M plan.
52	
53	
54	
55	
56	
57	Repair as needed then follow O&M plan.
58	Repair as needed then follow O&M plan.
59	If identified, implement O&M
60	
61	
62	
63	
64	
75	

Chicago Public Schools

School Hubbard High School

Unit 46341

Building ID 1670

Address 6200 S. Hamlin

Chicago, IL, 60629

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
76	
77	
78	Repair as needed then follow O&M plan.
CM-1	Repair as needed then follow O&M plan.
CM-2	
CM-3	
CM-4	

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **fiberglass pipe wrap**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Not Tested** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **boiler room, basement, rm. 207**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **01**

MATERIAL DESCRIPTION: **fiberglass pipe wrap**

MATERIAL LOCATION: **boiler room, basement, rm. 207**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:


DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____

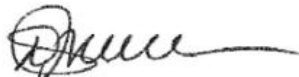

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **canvas over water tanks**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **boiler rm., basement**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **canvas over water tanks**
MATERIAL LOCATION: **boiler rm., basement**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **boiler gaskets**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **boiler room**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **boiler gaskets**
MATERIAL LOCATION: **boiler room**
MATERIAL QUANTITY: **25** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

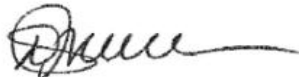

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **foil over ductwork**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **basement**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **04**

MATERIAL DESCRIPTION: **foil over ductwork**

MATERIAL LOCATION: **basement**

MATERIAL QUANTITY: **1000**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40A-1**
MATERIAL DESCRIPTION: **9x9 tan w/rust streaks**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rm 116E,116W,115,113**
MATERIAL QUANTITY: **3140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in Rooms 113 and 116**

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **40A-1**
MATERIAL DESCRIPTION: **9x9 tan w/rust streaks**
MATERIAL LOCATION: **rm 116E,116W,115,113**
MATERIAL QUANTITY: **3140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **4** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41A-1**
MATERIAL DESCRIPTION: **12x12 off white w/brown specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **throughout classrooms, 2nd fl., 3rd. Fl.,nurses office, 2nd & 3rd fl. East corridors**

MATERIAL QUANTITY: **41000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **41A-1**
MATERIAL DESCRIPTION: **12x12 off white w/brown specks**
MATERIAL LOCATION: **throughout classrooms, 2nd fl., 3rd. Fl.,nurses office, 2nd & 3rd fl. East corridors**
MATERIAL QUANTITY: **41000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41A-2**
MATERIAL DESCRIPTION: **12x12 gray w/speckles**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st,2nd,3rd flr. Corridors,lunchrm**

MATERIAL QUANTITY: **10355**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **41A-2**
MATERIAL DESCRIPTION: **12x12 gray w/speckles**
MATERIAL LOCATION: **1st,2nd,3rd flr. Corridors,lunchrm**
MATERIAL QUANTITY: **10355** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

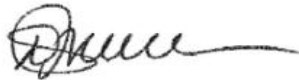

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42A-1**
MATERIAL DESCRIPTION: **9x9 tan w/rust streaks mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rm 116E,116W,115,113, 114**
MATERIAL QUANTITY: **3140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in Room 113 and 116**

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **42A-1**
MATERIAL DESCRIPTION: **9x9 tan w/rust streaks mastic**
MATERIAL LOCATION: **rm 116E,116W,115,113, 114**
MATERIAL QUANTITY: **3140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **4** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43A-1**
MATERIAL DESCRIPTION: **12x12 off white w/brown specks mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **throughout classrooms on flrs 1,2,3 and east corridor on flrs 1,2,3, also in nurses office**

MATERIAL QUANTITY: **41000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **43A-1**
MATERIAL DESCRIPTION: **12x12 off white w/brown specks mastic**
MATERIAL LOCATION: **throughout classrooms on flrs 1,2,3 and east corridor on flrs 1,2,3, also in nurses office**
MATERIAL QUANTITY: **41000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43A-2**
MATERIAL DESCRIPTION: **12x12 gray w/speckles mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **corridors on flrs 1,2,3 and lunchrm**

MATERIAL QUANTITY: **10355**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **43A-2**
MATERIAL DESCRIPTION: **12x12 gray w/speckles mastic**
MATERIAL LOCATION: **corridors on flrs 1,2,3 and lunchrm**
MATERIAL QUANTITY: **10355** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44A-1A**
MATERIAL DESCRIPTION: **12x12 brown VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rms.:310,307,305,302**
MATERIAL QUANTITY: **3025** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in Rooms 307 and 310**

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **44A-1A**
MATERIAL DESCRIPTION: **12x12 brown VFT**
MATERIAL LOCATION: **rms.:310,307,305,302**
MATERIAL QUANTITY: **3025** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **15** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44A-1B**
MATERIAL DESCRIPTION: **12x12 tan VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **rms.:310,307,305,302**

MATERIAL QUANTITY: **3025**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **44A-1B**
MATERIAL DESCRIPTION: **12x12 tan VFT**
MATERIAL LOCATION: **rms.:310,307,305,302**
MATERIAL QUANTITY: **3025** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44A-2**
MATERIAL DESCRIPTION: **12x12 offwhite w/speckles**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage
Delamination**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage
Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rms: 200,202,201,203,203A,204,205,207,E&W corridors,throughout 1st flr**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in Rooms 202, 205, and 207**

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **44A-2**
MATERIAL DESCRIPTION: **12x12 offwhite w/speckles**
MATERIAL LOCATION: **rms: 200,202,201,203,203A,204,205,207,E&W corridors,throughout 1st flr**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **25** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44A-3**
MATERIAL DESCRIPTION: **12x12 gray VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **girls gym office**

MATERIAL QUANTITY: **650**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **44A-3**

MATERIAL DESCRIPTION: **12x12 gray VFT**

MATERIAL LOCATION: **girls gym office**

MATERIAL QUANTITY: **650**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

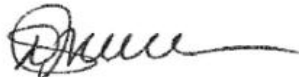

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45A-1A**
MATERIAL DESCRIPTION: **12x12 brown VFT mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rms.:310,307,305,302**
MATERIAL QUANTITY: **3025** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in Rooms 307 and 310**

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **45A-1A**
MATERIAL DESCRIPTION: **12x12 brown VFT mastic**
MATERIAL LOCATION: **rms.:310,307,305,302**
MATERIAL QUANTITY: **3025** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **15** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45A-1B**
MATERIAL DESCRIPTION: **12x12 tan VFT mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **rms.:310,307,305,302**

MATERIAL QUANTITY: **3025**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **45A-1B**
MATERIAL DESCRIPTION: **12x12 tan VFT mastic**
MATERIAL LOCATION: **rms.:310,307,305,302**
MATERIAL QUANTITY: **3025** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45A-2**
MATERIAL DESCRIPTION: **12x12 offwhite w/speckles mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage
Delamination**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage
Delamination**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rms: 200,202,201,203,203A,204,205,207,E&W corridors,throughout 1st flr**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in Rooms 202, 205, and 207**

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **45A-2**
MATERIAL DESCRIPTION: **12x12 offwhite w/speckles mastic**
MATERIAL LOCATION: **rms: 200,202,201,203,203A,204,205,207,E&W corridors,throughout 1st flr**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **25** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45A-3**
MATERIAL DESCRIPTION: **12x12 gray VFT matic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **girls gym office**

MATERIAL QUANTITY: **650**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **45A-3**
MATERIAL DESCRIPTION: **12x12 gray VFT matic**
MATERIAL LOCATION: **girls gym office**
MATERIAL QUANTITY: **650** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

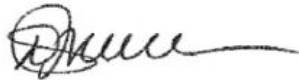

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **46A**
MATERIAL DESCRIPTION: **12x12 brown VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **corridor,west lunchroom**
MATERIAL QUANTITY: **5285** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **46A**
MATERIAL DESCRIPTION: **12x12 brown VFT**
MATERIAL LOCATION: **corridor,west lunchroom**
MATERIAL QUANTITY: **5285** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

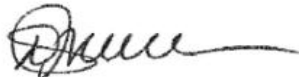

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **47A**
MATERIAL DESCRIPTION: **12x12 brown VFT mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **corridor,westlunchroom**

MATERIAL QUANTITY: **5285**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **47A**
MATERIAL DESCRIPTION: **12x12 brown VFT mastic**
MATERIAL LOCATION: **corridor,westlunchroom**
MATERIAL QUANTITY: **5285** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

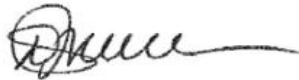

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **9x9 black & red checkerboard VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1929 BLDG basement storage rm.**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **48**
MATERIAL DESCRIPTION: **9x9 black & red checkerboard VFT**
MATERIAL LOCATION: **1929 BLDG basement storage rm.**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUILDING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **49**
MATERIAL DESCRIPTION: **9x9 VFT (not observed)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1929 building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____

Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **49**

MATERIAL DESCRIPTION: **9x9 VFT (not observed)**

MATERIAL LOCATION: **1929 building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified, implement O&M

Management Planner's Signature: _____

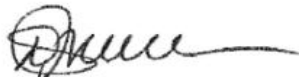

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **9x9 peach w/ rust streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm. 117**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **500** DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in Room 117**

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **9x9 peach w/ rust streaks VFT**
MATERIAL LOCATION: **Rm. 117**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **2** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____

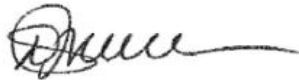

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUILDING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Peach w/ rust streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm. 117**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in Room 117**

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **51**
MATERIAL DESCRIPTION: **Peach w/ rust streaks VFT Mastic**
MATERIAL LOCATION: **Rm. 117**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **2** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____

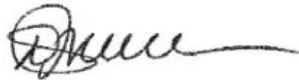

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **2 x 4 ACT**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **W. Corr., W. Lunchrm, Tchrs Lunchrm, Library, Rms. 120,210E,210W,311-320,324-327, 3rd. FI NW&SW Corr**

MATERIAL QUANTITY: **6300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **52**
MATERIAL DESCRIPTION: **2 x 4 ACT**
MATERIAL LOCATION: **W. Corr., W. Lunchrm, Tchrs Lunchrm, Library, Rms. 120,210E,210W,311-320,324-327, 3rd. FI NW&SW Corr**
MATERIAL QUANTITY: **6300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

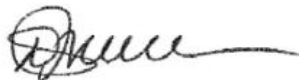

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **1x1 ACT**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **E. Lunchrm, 3rd fl. Girls gym corridor, rms. 208, 209, 213, 219, 220**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **53**
MATERIAL DESCRIPTION: **1x1 ACT**
MATERIAL LOCATION: **E. Lunchrm, 3rd fl. Girls gym corridor, rms. 208, 209, 213, 219, 220**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **1x1 ACT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **E. Lunchrm,3rd fl. Girls gym corridor, rms. 208,209,213,219,220**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **54**
MATERIAL DESCRIPTION: **1x1 ACT Mastic**
MATERIAL LOCATION: **E. Lunchrm,3rd fl. Girls gym corridor, rms. 208,209,213,219,220**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates 2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **spray on acoustical ceiling**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **nurses office, rms. 111-113,115-117,211-212,214-217,223,225,226**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **55**
MATERIAL DESCRIPTION: **spray on acoustical ceiling**
MATERIAL LOCATION: **nurses office, rms. 111-113,115-117,211-212,214-217,223,225,226**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **56**
MATERIAL DESCRIPTION: **2x2 ceiling tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **west gym**

MATERIAL QUANTITY: **7500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **56**

MATERIAL DESCRIPTION: **2x2 ceiling tile**

MATERIAL LOCATION: **west gym**

MATERIAL QUANTITY: **7500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **9x9 green and cream checkered VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **East lunchroom**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **5000** DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in the East Lunchroom**

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **57**
MATERIAL DESCRIPTION: **9x9 green and cream checkered VFT**
MATERIAL LOCATION: **East lunchroom**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **5** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____

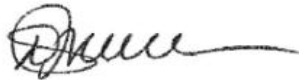

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **9x9 green and cream checkered VFT mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **east lunchroom**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in the East Lunchroom**

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUILDING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **58**
MATERIAL DESCRIPTION: **9x9 green and cream checkered VFT mastic**
MATERIAL LOCATION: **east lunchroom**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **5** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.


The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **59**
MATERIAL DESCRIPTION: **2x4 ACT**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **stockpiled in basement corridor**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed 2016**

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **59**

MATERIAL DESCRIPTION: **2x4 ACT**

MATERIAL LOCATION: **stockpiled in basement corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

If identified, implement O&M

Management Planner's Signature: _____

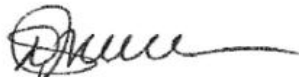

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **12x12 Blue VAT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Teachers Lunchroom**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **60**
MATERIAL DESCRIPTION: **12x12 Blue VAT**
MATERIAL LOCATION: **Teachers Lunchroom**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **12x12 Blue VFT mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Teachers lunchroom**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **61**
MATERIAL DESCRIPTION: **12x12 Blue VFT mastic**
MATERIAL LOCATION: **Teachers lunchroom**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Cream Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 210E, 210W**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Cream Linoleum**
MATERIAL LOCATION: **Rm 210E, 210W**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

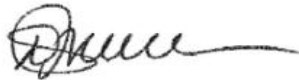

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **Cream Linoleum Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm. 210 E, 210W**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **63**
MATERIAL DESCRIPTION: **Cream Linoleum Mastic**
MATERIAL LOCATION: **Rm. 210 E, 210W**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **Lab tabletops**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rms. 210E, 210W,303,305,307,310**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **64**
MATERIAL DESCRIPTION: **Lab tabletops**
MATERIAL LOCATION: **rms. 210E, 210W,303,305,307,310**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **75**
MATERIAL DESCRIPTION: **12" x 12" Green VFT with white streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Auditorium**

MATERIAL QUANTITY: **2000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **75**
MATERIAL DESCRIPTION: **12" x 12" Green VFT with white streaks**
MATERIAL LOCATION: **Auditorium**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

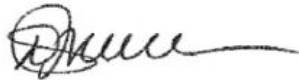

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **12" x 12" off white with gray specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Main Office**

MATERIAL QUANTITY: **300**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **76**
MATERIAL DESCRIPTION: **12" x 12" off white with gray specks**
MATERIAL LOCATION: **Main Office**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____

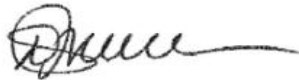

Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **Hard Packed Fittings on fiberglass insulated pipes**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rms 205 - 207, Athletic Building Mech. Rms (East and West), North and South Crawl Space**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**

DAMAGE QUANTITY: DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **77**
MATERIAL DESCRIPTION: **Hard Packed Fittings on fiberglass insulated pipes**
MATERIAL LOCATION: **Rms 205 - 207, Athletic Building Mech. Rms (East and West), North and South Crawl Space**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **12" x 12" White VFT with blue streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **209**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **300** DAMAGE UNITS: **SF**
COMMENTS: **Damage is located in Room 209**

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **78**
MATERIAL DESCRIPTION: **12" x 12" White VFT with blue streaks**
MATERIAL LOCATION: **209**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **9** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-1**
MATERIAL DESCRIPTION: **gray carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **rm 108,teachers lounge, library**
MATERIAL QUANTITY: **2475** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: DAMAGE UNITS: **SF**
COMMENTS: **Light carpet shredding**

Inspector's Signature: _____ Date: **03/09/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **CM-1**
MATERIAL DESCRIPTION: **gray carpet mastic**
MATERIAL LOCATION: **rm 108,teachers lounge, library**
MATERIAL QUANTITY: **2475** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **15** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Repair as needed then follow O&M plan.

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-2**
MATERIAL DESCRIPTION: **blue carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **rm 100, 225, 227**

MATERIAL QUANTITY: **1520**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **CM-2**
MATERIAL DESCRIPTION: **blue carpet mastic**
MATERIAL LOCATION: **rm 100, 225, 227**
MATERIAL QUANTITY: **1520** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**


In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-3**
MATERIAL DESCRIPTION: **rust carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **counselors office**

MATERIAL QUANTITY: **735**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **CM-3**

MATERIAL DESCRIPTION: **rust carpet mastic**

MATERIAL LOCATION: **counselors office**

MATERIAL QUANTITY: **735**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **James Lehnhardt**
SCHOOL NAME: **Hubbard High School** INSPECTION DATE: **3/9/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-4**
MATERIAL DESCRIPTION: **purple & tan carpet mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage
Deterioration**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was reinspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **office, principals office, asst principals office**

MATERIAL QUANTITY: **1440**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY:

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 03/09/2016

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **46341** BUIDLING ID: **1670**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Daniel Juneau**
SCHOOL NAME: **Hubbard High School** REVIEW DATE: **5/10/2016**
ADDRESS: **6200 S. Hamlin** IDPH LICENSE NO: **100-04208**

HOMOGENEOUS AREA: **CM-4**
MATERIAL DESCRIPTION: **purple & tan carpet mastic**
MATERIAL LOCATION: **office, principals office, asst principals office**
MATERIAL QUANTITY: **1440** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____



Date: **05/10/2016**

Chicago Public Schools

Carnow, Conibear and Associates

2016 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

James Lehnhardt
Illinois Licensed Asbestos Inspector, Project Manager, and
Air Sampling Professional



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER **ISSUED** **EXPIRES**
100 - 04208 **3/16/2015** **05/15/2016**

JAMES D LEHNHARDT
15301 KILPATRICK AVE, APT.
OAK FOREST, IL 60452
Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/2/2015

PROJECT MANAGER
AIR SAMPLING PROFESSIONAL

12/11/2015

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

James Lehnhardt


has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024165


Kathy DeSalvo, Director

2016



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Daniel Juneau

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/6/2016

Exam Date: 1/6/2016

Expiration Date: 1/6/2017

Certificate Number: MPR1601060038



Kathy DeSalvo, Director

Daniel Juneau

Illinois Licensed Asbestos Inspector, Management Planner,
Project Manager, and Air Sampling Professional



ASBESTOS PROFESSIONAL LICENSE

ID NUMBER ISSUED EXPIRES
100 - 03613 **3/16/2015** **05/15/2016**

DANIEL J JUNEAU
1408 OAKWOOD AVENUE
DES PLAINES, IL 60016

Environmental Health



ENDORSEMENTS

TC EXPIRES

INSPECTOR	12/2/2015
MANAGEMENT PLANNER	1/20/2016
PROJECT MANAGER	12/11/2015
AIR SAMPLING PROFESSIONAL	

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

**CARNOW
CONIBEAR**

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Daniel Juneau


has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024163


Kathy DeSalvo, Director

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed