

ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2068
SCHOOL NAME: Barton School
ADDRESS OF SCHOOL: 7650 S. Wolcott
CITY: Chicago, IL, 60620

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/23/2016**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 355
IDPH INSPECTOR LICENSE NUMBER: 100-07839
IDPH LICENSED INSPECTOR NAME(Please Print): Lisa Laney
IDPH MP LICENSE NUMBER: 100-00440
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Shawn Brown

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Barton School

7650 S. Wolcott
Chicago, IL, 60620

Unit: 22151
Building ID: 2170

IDPH ID Number: 14-016-2990-2068

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

TEM Environmental, Inc.

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

August 30, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 22151 Region: 05 IDPH ID:14-016-2990-2068

School: Barton School Building ID: 2170

Address: 7650 S. Wolcott
Chicago, IL, 60620

Building Contact: Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 09/27/2019

Inspector: Lisa Laney Inspector IDPH License: 100-07839
Management Planner: Shawn Brown Management Planner IDPH License: 100-00440

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,
TEM Environmental, Inc.

Shawn Brown
100-00440

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: August 30, 2019

RE: Barton School, Unit 22151
7650 S. Wolcott
Chicago, IL, 60620

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Barton School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Barton School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Barton School
Address: 7650 S. Wolcott
IDPH ID: 14-016-2990-2068
Contact:

Unit: 22151
Chicago, IL, 60620
Building ID: 2170
Phone:

Region: 05

2. Description of Facility

Original Construction: 1928
Total Square Footage: 53503
Current Occupancy: 355

Additional Construction: 1973
No of Floors: 3

3. LEA Designated Person

Contact: Robert Christlieb
Address: 42 West Madison Street
Chicago, IL 60602

Phone: (773) 553-3197

4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Glendale Heights, IL, 60139
Phone: 630-790-0880

Fax: 630-790-0882

5. Inspector

Inspector Name: Lisa Laney

Inspector IDPH license # 100-07839

Signature:
Date: 8/30/2019

6. Management Planner

Management Planner Name: Shawn Brown

Management Planner IDPH license # 100-00440

Signature:
Date: 09/27/2019

7. Review Date:09/27/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

B. The following new homogenous areas have been identified for Building 2170:

- 24 Red Sheet Flooring
- 24A Red Sheet Flooring Mastic

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

09A	12 x 12 Tan Speckled Floor Tile
10A-2	12 x 12 White Speckled Floor Tile
11A-1	12x12 Off-White Speckled Floor Tile
16A(2)	9x9 Pink Floor Tile Mastic
16A-1	9x9 Brown Floor Tile w/Streaks Mastic
17A-2	12x12 White Speckled Floor Tile Mastic
20	12x12 Gray w/Blue Spots Floor Tile
21	12x12 Gray w/Blue Spots Floor Tile Mastic
22A	9x9 Beige & Orange Combination Floor tile
22B	9x9 Beige & Orange Combination Floor Tile Mastic
23	Maroon Terrazzo
24	Red Sheet Flooring
24A	Red Sheet Flooring Mastic
AA	2' X 4' Ceiling Tile
BB-1	Gray Baseboard
BB-2	Black Baseboard
BBM-1	Gray Baseboard Mastic
BBM-2	Black Baseboard Mastic
CM-1	Rose Carpet Mastic
CM-2	Green Carpet Mastic
CM-3	Purple Carpet Mastic
CM-4	Rose Carpet Mastic

The following areas were deemed to be inaccessible:

16A(2)	9x9 Pink Floor Tile Mastic
16A-1	9x9 Brown Floor Tile w/Streaks Mastic
17A	12x12 Light Tan Floor Tile Mastic
17A-1	12x12 Burgundy Floor Tile Mastic
17A-2	12x12 White Speckled Floor Tile Mastic
18A	12x12 Tan Speckled Floor Tile Mastic
21	12x12 Gray w/Blue Spots Floor Tile Mastic
22B	9x9 Beige & Orange Combination Floor Tile Mastic
24	Red Sheet Flooring
24A	Red Sheet Flooring Mastic
BBM-1	Gray Baseboard Mastic
BBM-2	Black Baseboard Mastic
CM-1	Rose Carpet Mastic
CM-2	Green Carpet Mastic
CM-3	Purple Carpet Mastic

CM-4	Rose Carpet Mastic
D	Cardboard Pipe Insulation
H	Aircell Fittings
I	Cardboard Fittings

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Lisa Laney, IDPH License # 100-07839. The Management Plan was updated by Shawn Brown, IDPH License # 100-00440. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Barton School Building 2170 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Barton School Unit 22151 Building ID 2170

Address 7650 S. Wolcott Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
04A	12 x 12 Light Tan Floor Tile	8,120	SF	1927 Building- 1st, 2nd & 3rd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05A-1	12"x12" Burgundy Floor Tile	630	SF	1927 Building- Assembly Hall	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
05B	12x12 Black Floor Tile ABATED			1927 Building- Assembly Hall	ABATED									
07A	9x9 Dark Green Floor Tile ABATED			1927 Building- 2nd Floor Teachers' Lounge	ABATED									
07B	9x9 Light Green Floor Tile ABATED			1927 Building- 2nd Floor Teachers' Lounge	ABATED									
08A	9 x 9 Brown w/Specks Floor Tile	720	SF	1927 Building- Room 110	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09A	12 x 12 Tan Speckled Floor Tile	7,200	SF	1973 Building- Lunchroom, 1st and 2nd Floor Corridors, Kitchen Storage Room, Off & Locker Room, Serving Area Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10A-2	12 x 12 White Speckled Floor Tile	1,450	SF	1927 Building- Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11A-1	12x12 Off-White Speckled Floor Tile	12,000	SF	1973 Building- Throughout All Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16A	9 x 9 Dark Green Floor Tile Mastic ABATED			1927 Building- 2nd Floor Teachers' Lounge	ABATED									
16A(2)	9x9 Pink Floor Tile Mastic	720	SF	1927 Building- Room 110	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16A-1	9x9 Brown Floor Tile w/Streaks Mastic	1,100	SF	1927 Building- Room 101	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16B	9 x 9 Light Green Floor Tile Mastic ABATED			1927 Building- 2nd Floor Teachers' Lounge	ABATED									
17A	12x12 Light Tan Floor Tile Mastic	8,120	SF	1927 Building- 1st, 2nd & 3rd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17A-1	12x12 Burgundy Floor Tile Mastic	630	SF	1927 Building- Assembly Hall	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17A-2	12x12 White Speckled Floor Tile Mastic	1,450	SF	1927 Building- Library	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Barton School Unit 22151 Building ID 2170

Address 7650 S. Wolcott Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
17B	12x12 Black Floor Tile Mastic ABATED			1927 Building-Assembly Hall	ABATED									
18A	12x12 Tan Speckled Floor Tile Mastic	7,200	SF	1973 Building- 1st, 2nd & 3rd Floor Corridor, Lunchroom, Kitchen Storage Room and Office, Locker Room, Serving Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
18A-1	Off-White Speckled Floor Tile	12,000	SF	1973 Building-Throughout All Classrooms	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
19A-1	9x9 Brown Floor Tile w/Streaks	1,100	SF	1927 Building-Room 101	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	12x12 Gray w/Blue Spots Floor Tile	750	SF	Room 202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	12x12 Gray w/Blue Spots Floor Tile Mastic	750	SF	Room 202	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22A	9x9 Beige & Orange Combination Floor tile	500	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22B	9x9 Beige & Orange Combination Floor Tile Mastic	500	SF	Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
23	Maroon Terrazzo	8,000	SF	Stairways, Corridor Perimeters	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	Red Sheet Flooring	200	SF	Engineer/Custodial Storage Room (Under Carpet)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24A	Red Sheet Flooring Mastic	200	SF	Engineer's Office & Custodial Store Rm.	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
A	Boiler Insulation ABATED			1927 Building-Boiler Room	ABATED									
AA	2' X 4' Ceiling Tile	19,000	SF	Throughout 1973 Building	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
B	Aircell Pipe Insulation	250	LF	Tunnels, Boiler Room, and Unexcavated Areas	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
BB-1	Gray Baseboard	62	LF	1927 Building-Room 208	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
BB-2	Black Baseboard	1,750	LF	1973 Building-Throughout School	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
BBM-1	Gray Baseboard Mastic	62	LF	1927 Building-Room 208	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Barton School Unit 22151 Building ID 2170

Address 7650 S. Wolcott Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
BBM-2	Black Baseboard Mastic	1,750	LF	1973 Building- Throughout School	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
C	Aircell Duct Wrap			Unexcavated Area		TSI								
CM-1	Rose Carpet Mastic	2,000	SF	1927 Building- Room 102, Adjustment Office, Principal's Office, and Main Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
CM-2	Green Carpet Mastic	810	SF	1927 Building- Assembly Hall	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
CM-3	Purple Carpet Mastic	720	SF	1927 Building- Room 208	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
CM-4	Rose Carpet Mastic	285	SF	1973 Building- Teachers' Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
D	Cardboard Pipe Insulation	250	LF	Boiler Room and Engineering Rooms	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
H	Aircell Fittings	50	LF	Engineering Rooms	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
I	Cardboard Fittings	50	FITTING	Engineering Rooms	CHR	TSI	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Barton School Unit 22151 Building ID 2170

Address 7650 S. Wolcott Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 8/30/2019
Inspector Name <u>Lisa Laney</u>
100-07839 5/15/2020
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
04A	
05A-1	
05B	
07A	
07B	
08A	
09A	
10A-2	
11A-1	
16A	
16A(2)	
16A-1	
16B	
17A	
17A-1	
17A-2	
17B	
18A	
18A-1	
19A-1	
20	
21	
22A	

Chicago Public Schools

School Barton School Unit 22151 Building ID 2170

Address 7650 S. Wolcott Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
22B	
23	
24	
24A	
A	
AA	
B	Partial Abatement 2018
BB-1	
BB-2	
BBM-1	
BBM-2	
C	Abated 2018
CM-1	
CM-2	
CM-3	
CM-4	
D	Partial Abatement 2018
H	Partial Abatement 2018
I	Partial Abatement 2018

Table II

Management Planner's Review

Chicago Public Schools

School Barton School
Address 7650 S. Wolcott

Unit 22151
Chicago, IL, 60620

Building ID 2170
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
04A	12 x 12 Light Tan Floor Tile	8,120	SF	1927 Building- 1st, 2nd & 3rd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05A-1	12"x12" Burgundy Floor Tile	630	SF	1927 Building- Assembly Hall	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05B	12x12 Black Floor Tile ABATED			1927 Building- Assembly Hall	Abated						
07A	9x9 Dark Green Floor Tile ABATED			1927 Building- 2nd Floor Teachers' Lounge	Abated						
07B	9x9 Light Green Floor Tile ABATED			1927 Building- 2nd Floor Teachers' Lounge	Abated						
08A	9 x 9 Brown w/Specks Floor Tile	720	SF	1927 Building- Room 110	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09A	12 x 12 Tan Speckled Floor Tile	7,200	SF	1973 Building- Lunchroom, 1st and 2nd Floor Corridors, Kitchen Storage Room, Off & Locker Room, Serving Area Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10A-2	12 x 12 White Speckled Floor Tile	1,450	SF	1927 Building- Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11A-1	12x12 Off-White Speckled Floor Tile	12,000	SF	1973 Building- Throughout All Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16A	9 x 9 Dark Green Floor Tile Mastic ABATED			1927 Building- 2nd Floor Teachers' Lounge	Abated						
16A(2)	9x9 Pink Floor Tile Mastic	720	SF	1927 Building- Room 110	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16A-1	9x9 Brown Floor Tile w/Streaks Mastic	1,100	SF	1927 Building- Room 101	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16B	9 x 9 Light Green Floor Tile Mastic ABATED			1927 Building- 2nd Floor Teachers' Lounge	Abated						
17A	12x12 Light Tan Floor Tile Mastic	8,120	SF	1927 Building- 1st, 2nd & 3rd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17A-1	12x12 Burgundy Floor Tile Mastic	630	SF	1927 Building- Assembly Hall	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17A-2	12x12 White Speckled Floor Tile Mastic	1,450	SF	1927 Building- Library	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17B	12x12 Black Floor Tile Mastic ABATED			1927 Building- Assembly Hall	Abated						
18A	12x12 Tan Speckled Floor Tile Mastic	7,200	SF	1973 Building- 1st, 2nd & 3rd Floor Corridor, Lunchroom, Kitchen Storage Room and Office, Locker Room, Serving Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18A-1	Off-White Speckled Floor Tile	12,000	SF	1973 Building- Throughout All Classrooms	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19A-1	9x9 Brown Floor Tile w/Streaks	1,100	SF	1927 Building- Room 101	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	12x12 Gray w/Blue Spots Floor Tile	750	SF	Room 202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Barton School
Address 7650 S. Wolcott

Unit 22151
Chicago, IL, 60620

Building ID 2170
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
21	12x12 Gray w/Blue Spots Floor Tile Mastic	750	SF	Room 202	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22A	9x9 Beige & Orange Combination Floor tile	500	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
22B	9x9 Beige & Orange Combination Floor Tile Mastic	500	SF	Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
23	Maroon Terrazzo	8,000	SF	Stairways, Corridor Perimeters	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	Red Sheet Flooring	200	SF	Engineer/Custodial Storage Room (Under Carpet)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24A	Red Sheet Flooring Mastic	200	SF	Engineer's Office & Custodial Store Rm.	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Boiler Insulation ABATED			1927 Building- Boiler Room	Abated						
AA	2' X 4' Ceiling Tile	19,000	SF	Throughout 1973 Building	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
B	Aircell Pipe Insulation	250	LF	Tunnels, Boiler Room, and Unexcavated Areas	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
BB-1	Gray Baseboard	62	LF	1927 Building- Room 208	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
BB-2	Black Baseboard	1,750	LF	1973 Building- Throughout School	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
BBM-1	Gray Baseboard Mastic	62	LF	1927 Building- Room 208	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
BBM-2	Black Baseboard Mastic	1,750	LF	1973 Building- Throughout School	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
C	Aircell Duct Wrap			Unexcavated Area		TSI					
CM-1	Rose Carpet Mastic	2,000	SF	1927 Building- Room 102, Adjustment Office, Principal's Office, and Main Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CM-2	Green Carpet Mastic	810	SF	1927 Building- Assembly Hall	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CM-3	Purple Carpet Mastic	720	SF	1927 Building- Room 208	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
CM-4	Rose Carpet Mastic	285	SF	1973 Building- Teachers' Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
D	Cardboard Pipe Insulation	250	LF	Boiler Room and Engineering Rooms	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
H	Aircell Fittings	50	LF	Engineering Rooms	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
I	Cardboard Fittings	50	FITTING	Engineering Rooms	Chrysotile	TSI	Yes	0	FITTING	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

Chicago Public Schools

School Barton School
Address 7650 S. Wolcott

Unit 22151
 Chicago, IL, 60620

Building ID 2170
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Review Date	09/27/2019
Manager Planner Name	Shawn Brown
100-00440	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
04A	
05A-1	
05B	
07A	
07B	
08A	
09A	
10A-2	

Chicago Public Schools

School Barton School
Address 7650 S. Wolcott

Unit 22151
 Chicago, IL, 60620

Building ID 2170
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
11A-1	
16A	
16A(2)	
16A-1	
16B	
17A	
17A-1	
17A-2	
17B	
18A	
18A-1	
19A-1	
20	
21	
22A	
22B	
23	
24	
24A	
A	
AA	
B	
BB-1	
BB-2	
BBM-1	
BBM-2	

Chicago Public Schools

School Barton School
Address 7650 S. Wolcott

Unit 22151
Chicago, IL, 60620

Building ID 2170
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
C	
CM-1	
CM-2	
CM-3	
CM-4	
D	
H	
I	

Chicago Public Schools

TEM Environmental, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04A**
MATERIAL DESCRIPTION: **12 x 12 Light Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- 1st, 2nd & 3rd Floor Corridors**
MATERIAL QUANTITY: **8120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **04A**
MATERIAL DESCRIPTION: **12 x 12 Light Tan Floor Tile**
MATERIAL LOCATION: **1927 Building- 1st, 2nd & 3rd Floor Corridors**
MATERIAL QUANTITY: **8120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05A-1**
MATERIAL DESCRIPTION: **12"x12" Burgundy Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Assembly Hall**
MATERIAL QUANTITY: **630** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **05A-1**
MATERIAL DESCRIPTION: **12"x12" Burgundy Floor Tile**
MATERIAL LOCATION: **1927 Building- Assembly Hall**
MATERIAL QUANTITY: **630** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05B**
MATERIAL DESCRIPTION: **12x12 Black Floor Tile ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1927 Building- Assembly Hall**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **05B**
MATERIAL DESCRIPTION: **12x12 Black Floor Tile ABATED**
MATERIAL LOCATION: **1927 Building- Assembly Hall**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07A**
MATERIAL DESCRIPTION: **9x9 Dark Green Floor Tile ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1927 Building- 2nd Floor Teachers' Lounge**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **07A**
MATERIAL DESCRIPTION: **9x9 Dark Green Floor Tile ABATED**
MATERIAL LOCATION: **1927 Building- 2nd Floor Teachers' Lounge**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07B**
MATERIAL DESCRIPTION: **9x9 Light Green Floor Tile ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1927 Building- 2nd Floor Teachers' Lounge**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **07B**
MATERIAL DESCRIPTION: **9x9 Light Green Floor Tile ABATED**
MATERIAL LOCATION: **1927 Building- 2nd Floor Teachers' Lounge**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08A**
MATERIAL DESCRIPTION: **9 x 9 Brown w/Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Room 110**
MATERIAL QUANTITY: **720** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **08A**
MATERIAL DESCRIPTION: **9 x 9 Brown w/Specks Floor Tile**
MATERIAL LOCATION: **1927 Building- Room 110**
MATERIAL QUANTITY: **720** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09A**
MATERIAL DESCRIPTION: **12 x 12 Tan Speckled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1973 Building- Lunchroom, 1st and 2nd Floor Corridors, Kitchen Storage Room, Off & Locker Room, Serving Area Office**

MATERIAL QUANTITY: **7200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **09A**
MATERIAL DESCRIPTION: **12 x 12 Tan Speckled Floor Tile**
MATERIAL LOCATION: **1973 Building- Lunchroom, 1st and 2nd Floor Corridors, Kitchen Storage Room, Off & Locker Room, Serving Area Office**
MATERIAL QUANTITY: **7200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10A-2**
MATERIAL DESCRIPTION: **12 x 12 White Speckled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Library**
MATERIAL QUANTITY: **1450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **10A-2**
MATERIAL DESCRIPTION: **12 x 12 White Speckled Floor Tile**
MATERIAL LOCATION: **1927 Building- Library**
MATERIAL QUANTITY: **1450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11A-1**
MATERIAL DESCRIPTION: **12x12 Off-White Speckled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1973 Building- Throughout All Classrooms**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **11A-1**
MATERIAL DESCRIPTION: **12x12 Off-White Speckled Floor Tile**
MATERIAL LOCATION: **1973 Building- Throughout All Classrooms**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **9 x 9 Dark Green Floor Tile Mastic ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1927 Building- 2nd Floor Teachers' Lounge**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **16A**
MATERIAL DESCRIPTION: **9 x 9 Dark Green Floor Tile Mastic ABATED**
MATERIAL LOCATION: **1927 Building- 2nd Floor Teachers' Lounge**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16A(2)**
MATERIAL DESCRIPTION: **9x9 Pink Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Room 110**
MATERIAL QUANTITY: **720** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **16A(2)**
MATERIAL DESCRIPTION: **9x9 Pink Floor Tile Mastic**
MATERIAL LOCATION: **1927 Building- Room 110**
MATERIAL QUANTITY: **720** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16A-1**
MATERIAL DESCRIPTION: **9x9 Brown Floor Tile w/Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Room 101**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **16A-1**
MATERIAL DESCRIPTION: **9x9 Brown Floor Tile w/Streaks Mastic**
MATERIAL LOCATION: **1927 Building- Room 101**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16B**
MATERIAL DESCRIPTION: **9 x 9 Light Green Floor Tile Mastic ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1927 Building- 2nd Floor Teachers' Lounge**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **16B**
MATERIAL DESCRIPTION: **9 x 9 Light Green Floor Tile Mastic ABATED**
MATERIAL LOCATION: **1927 Building- 2nd Floor Teachers' Lounge**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17A**
MATERIAL DESCRIPTION: **12x12 Light Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- 1st, 2nd & 3rd Floor Corridors**
MATERIAL QUANTITY: **8120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **17A**
MATERIAL DESCRIPTION: **12x12 Light Tan Floor Tile Mastic**
MATERIAL LOCATION: **1927 Building- 1st, 2nd & 3rd Floor Corridors**
MATERIAL QUANTITY: **8120** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17A-1**
MATERIAL DESCRIPTION: **12x12 Burgundy Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Assembly Hall**
MATERIAL QUANTITY: **630** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **17A-1**
MATERIAL DESCRIPTION: **12x12 Burgundy Floor Tile Mastic**
MATERIAL LOCATION: **1927 Building- Assembly Hall**
MATERIAL QUANTITY: **630** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17A-2**
MATERIAL DESCRIPTION: **12x12 White Speckled Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Library**
MATERIAL QUANTITY: **1450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **17A-2**
MATERIAL DESCRIPTION: **12x12 White Speckled Floor Tile Mastic**
MATERIAL LOCATION: **1927 Building- Library**
MATERIAL QUANTITY: **1450** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17B**
MATERIAL DESCRIPTION: **12x12 Black Floor Tile Mastic ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1927 Building- Assembly Hall**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **17B**
MATERIAL DESCRIPTION: **12x12 Black Floor Tile Mastic ABATED**
MATERIAL LOCATION: **1927 Building- Assembly Hall**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18A**
MATERIAL DESCRIPTION: **12x12 Tan Speckled Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1973 Building- 1st, 2nd & 3rd Floor Corridor, Lunchroom, Kitchen Storage Room and Office, Locker Room, Serving Office**

MATERIAL QUANTITY: **7200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **18A**
MATERIAL DESCRIPTION: **12x12 Tan Speckled Floor Tile Mastic**
MATERIAL LOCATION: **1973 Building- 1st, 2nd & 3rd Floor Corridor, Lunchroom, Kitchen Storage Room and Office, Locker Room, Serving Office**
MATERIAL QUANTITY: **7200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18A-1**
MATERIAL DESCRIPTION: **Off-White Speckled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1973 Building- Throughout All Classrooms**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **18A-1**
MATERIAL DESCRIPTION: **Off-White Speckled Floor Tile**
MATERIAL LOCATION: **1973 Building- Throughout All Classrooms**
MATERIAL QUANTITY: **12000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19A-1**
MATERIAL DESCRIPTION: **9x9 Brown Floor Tile w/Streaks**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Room 101**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **19A-1**
MATERIAL DESCRIPTION: **9x9 Brown Floor Tile w/Streaks**
MATERIAL LOCATION: **1927 Building- Room 101**
MATERIAL QUANTITY: **1100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12x12 Gray w/Blue Spots Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 202**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **12x12 Gray w/Blue Spots Floor Tile**
MATERIAL LOCATION: **Room 202**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12x12 Gray w/Blue Spots Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 202**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12x12 Gray w/Blue Spots Floor Tile Mastic**
MATERIAL LOCATION: **Room 202**
MATERIAL QUANTITY: **750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22A**
MATERIAL DESCRIPTION: **9x9 Beige & Orange Combination Floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **22A**
MATERIAL DESCRIPTION: **9x9 Beige & Orange Combination Floor tile**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22B**
MATERIAL DESCRIPTION: **9x9 Beige & Orange Combination Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **22B**
MATERIAL DESCRIPTION: **9x9 Beige & Orange Combination Floor Tile Mastic**
MATERIAL LOCATION: **Engineer's Office**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Maroon Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Stairways, Corridor Perimeters**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Maroon Terrazzo**
MATERIAL LOCATION: **Stairways, Corridor Perimeters**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Boiler Insulation ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1927 Building- Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **A**

MATERIAL DESCRIPTION: **Boiler Insulation ABATED**

MATERIAL LOCATION: **1927 Building- Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **AA**
MATERIAL DESCRIPTION: **2' X 4' Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout 1973 Building**
MATERIAL QUANTITY: **19000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **AA**
MATERIAL DESCRIPTION: **2' X 4' Ceiling Tile**
MATERIAL LOCATION: **Throughout 1973 Building**
MATERIAL QUANTITY: **19000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY: **7 Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Tunnels, Boiler Room, and Unexcavated Areas**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**
COMMENTS: **Partial Abatement 2018**

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Tunnels, Boiler Room, and Unexcavated Areas**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **BB-1**
MATERIAL DESCRIPTION: **Gray Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Room 208**
MATERIAL QUANTITY: **62** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **BB-1**
MATERIAL DESCRIPTION: **Gray Baseboard**
MATERIAL LOCATION: **1927 Building- Room 208**
MATERIAL QUANTITY: **62** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **BB-2**
MATERIAL DESCRIPTION: **Black Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1973 Building- Throughout School**
MATERIAL QUANTITY: **1750** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **BB-2**
MATERIAL DESCRIPTION: **Black Baseboard**
MATERIAL LOCATION: **1973 Building- Throughout School**
MATERIAL QUANTITY: **1750** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **BBM-1**
MATERIAL DESCRIPTION: **Gray Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Room 208**
MATERIAL QUANTITY: **62** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **BBM-1**
MATERIAL DESCRIPTION: **Gray Baseboard Mastic**
MATERIAL LOCATION: **1927 Building- Room 208**
MATERIAL QUANTITY: **62** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **BBM-2**
MATERIAL DESCRIPTION: **Black Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1973 Building- Throughout School**
MATERIAL QUANTITY: **1750** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **BBM-2**
MATERIAL DESCRIPTION: **Black Baseboard Mastic**
MATERIAL LOCATION: **1973 Building- Throughout School**
MATERIAL QUANTITY: **1750** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Aircell Duct Wrap**
HISTORICAL AHERA DAMAGE CATEGORY **Damaged or significantly damaged friable thermal system insulating ACBM**
HISTORICAL DAMAGE REASON: **Deterioration Water**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Unexcavated Area**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Abated 2018**

Inspector's Signature: _____

Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Aircell Duct Wrap**
MATERIAL LOCATION: **Unexcavated Area**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-1**
MATERIAL DESCRIPTION: **Rose Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Room 102, Adjustment Office, Principal's Office, and Main Office**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **CM-1**
MATERIAL DESCRIPTION: **Rose Carpet Mastic**
MATERIAL LOCATION: **1927 Building- Room 102, Adjustment Office, Principal's Office, and Main Office**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-2**
MATERIAL DESCRIPTION: **Green Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Assembly Hall**
MATERIAL QUANTITY: **810** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **CM-2**
MATERIAL DESCRIPTION: **Green Carpet Mastic**
MATERIAL LOCATION: **1927 Building- Assembly Hall**
MATERIAL QUANTITY: **810** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-3**
MATERIAL DESCRIPTION: **Purple Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1927 Building- Room 208**
MATERIAL QUANTITY: **720** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **CM-3**
MATERIAL DESCRIPTION: **Purple Carpet Mastic**
MATERIAL LOCATION: **1927 Building- Room 208**
MATERIAL QUANTITY: **720** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **CM-4**
MATERIAL DESCRIPTION: **Rose Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1973 Building- Teachers' Lounge**
MATERIAL QUANTITY: **285** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **CM-4**
MATERIAL DESCRIPTION: **Rose Carpet Mastic**
MATERIAL LOCATION: **1973 Building- Teachers' Lounge**
MATERIAL QUANTITY: **285** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room and Engineering Rooms**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**
COMMENTS: **Partial Abatement 2018**

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**
MATERIAL LOCATION: **Boiler Room and Engineering Rooms**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Aircell Fittings**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineering Rooms**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**
COMMENTS: **Partial Abatement 2018**

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Aircell Fittings**
MATERIAL LOCATION: **Engineering Rooms**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Cardboard Fittings**
HISTORICAL AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Engineering Rooms**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**
COMMENTS: **Partial Abatement 2018**

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUIDLING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Cardboard Fittings**
MATERIAL LOCATION: **Engineering Rooms**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **FITTING**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Lisa Laney**
SCHOOL NAME: **Barton School** INSPECTION DATE: **8/30/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **24A**
MATERIAL DESCRIPTION: **Red Sheet Flooring Mastic**
MATERIAL LOCATION: **Engineer's Office & Custodial Store Rm.**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22151** BUILDING ID: **2170**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Shawn Brown**
SCHOOL NAME: **Barton School** REVIEW DATE: **9/27/2019**
ADDRESS: **7650 S. Wolcott** IDPH LICENSE NO: **100-07839**

HOMOGENEOUS AREA: **24A**

MATERIAL DESCRIPTION: **Red Sheet Flooring Mastic**

MATERIAL LOCATION: **Engineer's Office & Custodial Store Rm.**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **09/27/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	22151	BUILDING ID:	2170
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Shawn Brown		
SCHOOL NAME:	Barton School	REVIEW DATE:	9/27/2019		
ADDRESS:	7650 S. Wolcott	IDPH LICENSE NO:	100-07839		
HOMOGENEOUS AREA:	24				
MATERIAL DESCRIPTION:	Red Sheet Flooring				
MATERIAL LOCATION:	Engineer/Custodial Storage Room (Under Carpet)				
MATERIAL QUANTITY:	200	MATERIAL UNITS:		SF	
DAMAGE QUANTITY:	0	DAMAGE UNITS:		SF	

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **09/27/2019**

APPENDIX B

Inspector and Management Planner Licenses

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Lisa Laney


has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 4/5/2019

Exam Date: 4/5/2019

Expiration Date: 4/5/2020

Certificate Number: BIR1904051198

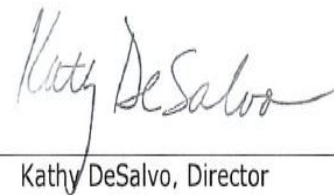

Kathy DeSalvo, Director

Miss Nancy

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that SHAWN L. BROWN
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 03/18/2019 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903BIR03

Certificate Number:



PUBLIC HEALTH & SAFETY Inc.

Environmental and Occupational Services
37 S. Ashland Ave., Chicago, IL 60607

www.public-health-safety.com

Office: 312-491-0081
Fax: 312-421-2901

Director of Training

Nicholas J. Penelf

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

CERTIFICATE OF ACHIEVEMENT

ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that SHAWN L. BROWN
has completed the Asbestos Management Planner Refresher course and passed the examination
on 03/18/2019 with a minimum score of 70% or better. Training was in accordance with U.S.
E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools: Model
Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

03/18/2019

Course Dates:

03/18/2020

Expires:

1903MPR01

Certificate Number:



PUBLIC HEALTH & SAFETY inc.

Environmental and Occupational Services
371 S. Ashland Ave., Chicago, IL 60607

www.public-health-safety.com

Office: 312-491-0081
Fax: 312-421-2501

Director of Training

Nicholas J. Peneff

Doctor of Public Health


Phone: 312-491-0081

FORM # A-011

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

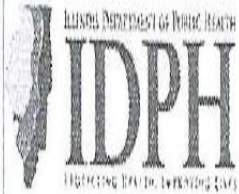

**ASBESTOS
PROFESSIONAL
LICENSE**

ENDORSEMENTS

TC EXPIRES

INSPECTOR

3/19/2019

ID NUMBER	ISSUED	EXPIRES
100 - 02950	3/6/2019	05/15/2020

PROJECT MANAGER

4/9/2019

AIR SAMPLING PROFESSIONAL

KEITH CLOUGH
524 HOMELAND RD
MATTESON, IL 60443



Environmental Health

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed