

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2201  
SCHOOL NAME: Fermi School  
ADDRESS OF SCHOOL: 1415 E. 70th St.  
CITY: Chicago, IL, 60637

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 2/24/2016

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** *(Please type or print)*

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 329  
IDPH INSPECTOR LICENSE NUMBER: 100-09786  
IDPH LICENSED INSPECTOR NAME(Please Print): John Fenn  
IDPH MP LICENSE NUMBER: 100-01784  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Steven Geneser

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

---

---

---

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Fermi School**

1415 E. 70th St.  
Chicago, IL, 60637

Unit: 22251  
Building ID: 3320

IDPH ID Number: 14-016-2990-2201

**REPORT DATE:**

Tuesday, October 01, 2019

**Prepared for:**

**Chicago Public Schools  
42 West Madison Street  
Chicago, IL 60602**

**Prepared by:**

**TEM Environmental, Inc.**

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

August 19, 2019

Mr. Glen E. Garner  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299          Unit: 23191          Region: 05          IDPH ID:14-016-2990-2201

School: Fermi School          Building ID: 3320

Address: 1415 E. 70th St.

Chicago, IL, 60637

Building Contact: Palmer, Marcus

Contact Phone:312 446-3266

Current Building Owners: Chicago Public Schools

Review Date: 09/16/2019

Inspector: John Fenn

Inspector IDPH License: 100-09786

Management Planner: Steven Geneser

Management Planner IDPH License: 100-01784

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,  
TEM Environmental, Inc.

Steven Geneser  
100-01784

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: August 19, 2019

RE: Fermi School, Unit 22251  
1415 E. 70th St.  
Chicago, IL, 60637

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Fermi School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Fermi School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Fermi School Unit: 23191 Region: 05  
Address: 1415 E. 70th St. Chicago, IL, 60637  
IDPH ID: 14-016-2990-2201 Building ID: 3320  
Contact: Palmer, Marcus Phone: 312 446-3266

### 2. Description of Facility

Original Construction: 1959 Additional Construction:  
Total Square Footage: 76945 No of Floors: 2  
Current Occupancy: 329

### 3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197  
Address: 42 West Madison Street  
Chicago, IL 60602

### 4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.  
Contact: Steven Geneser  
Address 174 N. Brandon Drive  
Glendale Heights, IL, 60139  
Phone: 630-790-0880 Fax: 630-790-0882

### 5. Inspector

Inspector Name: John Fenn

Inspector IDPH license # 100-09786

Signature:  
Date: 8/19/2019

### 6. Management Planner

Management Planner Name: Steven Geneser

Management Planner IDPH license # 100-01784

Signature:  
Date: 09/16/2019

### 7. Review Date: 09/16/2019

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Fermi School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 3320:

|      |   |
|------|---|
| 04A  | 9x9 Dark Brown Floor Tile                 |
| 07A  | 9x9 Dark Brown Floor Tile Mastic          |
| 100  | 12" X 12" White w/Grey Floor Tile         |
| 100A | 12" X 12" White w/Grey Floor Tile Mastic  |
| 101  | 12" X 12" Cream w/Grey Floor Tile         |
| 101A | 12" X 12" Cream w/Grey Floor Tile Mastic  |
| 102  | 12" X 12" Brown w/White Floor Tile        |
| 102A | 12" X 12" Brown w/White Floor Tile Mastic |
| 103  | 12"X12" Grey w/White Floor Tile           |

|      |  |
|------|--|
| 103A | 12"X12" Grey w/White Floor Tile Mastic |
| 104  | 1"X1" Ceramic Tile Mastic              |
| 105  | Marker Board Mastic                    |



B. The following new homogenous areas have been identified for Building 3320:

|      |   |
|------|---|
| 100  | 12" X 12" White w/Grey Floor Tile         |
| 100A | 12" X 12" White w/Grey Floor Tile Mastic  |
| 101  | 12" X 12" Cream w/Grey Floor Tile         |
| 101A | 12" X 12" Cream w/Grey Floor Tile Mastic  |
| 102  | 12" X 12" Brown w/White Floor Tile        |
| 102A | 12" X 12" Brown w/White Floor Tile Mastic |
| 103  | 12"X12" Grey w/White Floor Tile           |
| 103A | 12"X12" Grey w/White Floor Tile Mastic    |
| 104  | 1"X1" Ceramic Tile Mastic                 |
| 105  | Marker Board Mastic                       |

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

|       |   |
|-------|---|
| 04D   | Blue Carpet Mastic                        |
| 04E   | Carpet Mastic                             |
| 05A   | 12x12 Cream Floor Tile                    |
| 100   | 12" X 12" White w/Grey Floor Tile         |
| 100A  | 12" X 12" White w/Grey Floor Tile Mastic  |
| 101   | 12" X 12" Cream w/Grey Floor Tile         |
| 101A  | 12" X 12" Cream w/Grey Floor Tile Mastic  |
| 102   | 12" X 12" Brown w/White Floor Tile        |
| 102A  | 12" X 12" Brown w/White Floor Tile Mastic |
| 103   | 12"X12" Grey w/White Floor Tile           |
| 103A  | 12"X12" Grey w/White Floor Tile Mastic    |
| 104   | 1"X1" Ceramic Tile Mastic                 |
| 105   | Marker Board Mastic                       |
| FT-1  | 12x12 Beige Floor Tile                    |
| FTM-1 | 12x12 Beige Floor Tile Mastic             |

The following areas were deemed to be inaccessible:

|       |  |
|-------|--|
| 08A   | 12x12 Cream Floor Tile Mastic          |
| 11A   | 9x9 Dark Brown Floor Tile Mastic       |
| 14    | 1x1 Ceiling Tile Mastic                |
| A     | Mag Block Boiler Insulation            |
| B     | Mag Block Water Tank                   |
| C     | Mag Block Condensation Tank Insulation |
| D     | Mag Block Expansion Tank Insulation    |
| E     | Mag Block Heat Exchanges Insulation    |
| F     | Mag Block Breeching                    |
| FTM-1 | 12x12 Beige Floor Tile Mastic          |
| G     | Preform Pipe Insulation                |
| H     | Aircell Pipe Fittings                  |
| I     | Fiberglass Fittings                    |
| J     | Aircell Lagging                        |
| K     | Cardboard Lag                          |
| L     | Cardboard Runs                         |
| M     | Fitting on Preform                     |
| N     | Fittings on Fiberglass Runs            |
| O     | Boiler Door Insulation                 |
| P     | Boiler Gasket                          |

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by John Fenn, IDPH License # 100-09786. The Management Plan was updated by Steven Geneser, IDPH License # 100-01784. Inspector and Management Planner Licenses are included in Appendix B.

### III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

|                  |           |
|------------------|-----------|
| Abatement Dates: | 7/11/2019 |
|                  | 7/11/2019 |
|                  | 7/11/2019 |
|                  | 9/18/2019 |
|                  | 9/18/2019 |
|                  | 9/18/2019 |

### V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### VI. CONCLUSIONS

The Fermi School Building 3320 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Fermi School Unit 23191 Building ID 3320

Address 1415 E. 70th St. Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

| HA No | Material Description                     | Material Quantity | Material Units | Material Location  | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category                    | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
| 04A   | 9x9 Dark Brown Floor Tile                | 2,000             | SF             | 1959 Building- Assistant Principal's Office, Storeroom, West Hallway, 2nd Floor Lounge, Engineer's Office                              | CHR           | MISC              | N       | NONE        | 0               |              | Yes                           | ACBM with the potential for damage |               | LOW                   |
| 04B   | 9x9 Light Brown Floor Tile               | 3,000             | SF             | 1959 Building- Kitchen, Lunchroom, Locker Room   | CHR           | MISC              | N       | NONE        | 0               |              | No                            | ACBM with the potential for damage |               | LOW                   |
| 04C   | 9x9 Brown Floor Tile                     | 20,000            | SF             | 1959 Building- Main/Principal's Office, Rooms 101-108, 110 & Adjacent Corridor, Rooms 200-208 & Adjacent Corridor, 2nd Floor Book Room | CHR           | MISC              | N       | NONE        | 0               |              | No                            | ACBM with the potential for damage |               | LOW                   |
| 04D   | Blue Carpet Mastic                       | 350               | SF             | 1959 Building- Assistant Principal's Office  | ASSUMED       | MISC              | N       | NONE        | 0               |              | No                            | ACBM with the potential for damage |               | LOW                   |
| 04E   | Carpet Mastic                            | 400               | SF             | 1959 Building- Main/Principal's Office, Room 215   | ASSUMED       | MISC              | N       | NONE        | 0               |              | No                            | ACBM with the potential for damage |               | LOW                   |
| 05    | 12x12 Brown Floor Tile                   | 2,400             | SF             | 1959 Building- Lunchroom   | CHR           | MISC              | N       | NONE        | 0               |              | No                            | ACBM with the potential for damage |               | LOW                   |
| 05A   | 12x12 Cream Floor Tile                   | 100               | SF             | 1959 Building- Dishwashing Room  | ASSUMED       | MISC              | N       | NONE        | 0               |              | No                            | ACBM with the potential for damage |               | LOW                   |
| 06    | Lab Tables                               | 63                | SF             | Room 223   | CHR           | MISC              | N       | NONE        | 0               |              | No                            | ACBM with the potential for damage |               | LOW                   |
| 07A   | 9x9 Dark Brown Floor Tile Mastic         | 2,000             | SF             | 1959 Building- Assistant Principal's Office, Storeroom, West Hallway, 2nd Floor Lounge, Engineer's Office                              | CHR           | MISC              | N       | NONE        | 0               |              | Yes                           | ACBM with the potential for damage |               | LOW                   |
| 07B   | 9x9 Light Brown Floor Tile Mastic ABATED |                   |                | 1959 Building- Kitchen, Lunchroom, Locker Room   | ABATED        | MISC              |         |             |                 |              |                               |                                    |               |                       |
| 07C   | 9x9 Brown Floor Tile Mastic ABATED       |                   |                | 1959 Building- Main/Principal's Office, Rooms 101-108, 110 & Adjacent Corridor, Rooms  | ABATED        | MISC              |         | None        |                 |              |                               |                                    |               | Low                   |

# Chicago Public Schools

School Fermi School Unit 23191 Building ID 3320

Address 1415 E. 70th St. Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

| HA No | Material Description                     | Material Quantity | Material Units | Material Location  | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category                    | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|------------------------------------|---------------|-----------------------|
|       |  |                   |                | 200-208 & Adjacent Corridor, 2nd Floor Book Room   |               |                   |         |             |                 |              |                               |                                    |               |                       |
| 08    | 12x12 Brown Floor Tile Mastic - No ACBM  |                   |                | 1959 Building- Lunchroom   | NO_ACBM       | MISC              |         |             |                 |              |                               |                                    |               |                       |
| 08A   | 12x12 Cream Floor Tile Mastic            | 100               | SF             | 1959 Building- Dishwashing Room  | CHR           | MISC              | N       | NONE        | 0               |              | No                            | ACBM with the potential for damage |               | LOW                   |
| 09A   | 9x9 Dark Brown Floor Tile                | 24,800            | SF             | 1966 Building- All Classrooms, except Room 111, Teachers' Lounge   | CHR           | MISC              | N       | NONE        | 0               |              | No                            | ACBM with the potential for damage |               | LOW                   |
| 09B   | 9x9 Light Brown Floor Tile ABATED        |                   |                | 1966 Building- All Corridors   | ABATED        | MISC              |         | Unknown     |                 |              |                               |                                    |               | Low                   |
| 09C   | 9x9 Cream Floor Tile ABATED              |                   |                | 1966 Building- Room 111  | ABATED        | MISC              |         |             |                 |              |                               |                                    |               |                       |
| 10    | Light Brown Baseboard - No ACBM          |                   |                | 1959 Building- Classrooms and Office Area  | NO_ACBM       | MISC              |         |             |                 |              |                               |                                    |               |                       |
| 100   | 12" X 12" White w/Grey Floor Tile        | 15,000            | SF             | 2nd Floor Hallway North, 1st Floor Hallway East & North, Rooms 201, 202, 203, 204, 205, 206, & 208, Stairways, Rooms 111, 112, 127, Lunchroom                | ASSUMED       | MISC              | N       | NONE        | 0               |              | Yes                           | ACBM with the potential for damage |               | LOW                   |
| 100A  | 12" X 12" White w/Grey Floor Tile Mastic | 15,000            | SF             | 2nd Floor Hallway North, Rooms 201, 202, 203, 204, 205, 206, 208; 1st Floor Hallway East & North, Stairways, Rooms 111, 112, & 127, Lunchroom                | ASSUMED       | MISC              | N       | NONE        | 0               |              | Yes                           | ACBM with the potential for damage |               | LOW                   |
| 101   | 12" X 12" Cream w/Grey Floor Tile        | 15,000            | SF             | 2nd Floor Hallway West & South and SE, Rooms 216, 219, 220, 221, 222, 224, 233; 1st Floor South & West Hallway; Rooms 114 - 122, 124 - 125, Faculty Lounge 1 | ASSUMED       | MISC              | N       | NONE        | 0               |              | Yes                           | ACBM with the potential for damage |               | LOW                   |
| 101A  | 12" X 12" Cream w/Grey Floor Tile Mastic | 15,000            | SF             | 2nd Floor Hallway  | ASSUMED       | MISC              | N       | NONE        | 0               |              | Yes                           | ACBM with the                      |               | LOW                   |





# Chicago Public Schools

School Fermi School Unit 23191 Building ID 3320

Address 1415 E. 70th St. Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

| HA No | Material Description                   | Material Quantity | Material Units | Material Location  | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category  | Damage Reason | Disturbance Potential |
|-------|--|-------------------|----------------|--|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|--|---------------|-----------------------|
|       |  |                   |                | Throughout:<br>Classrooms,<br>Teachers Lounge,<br>Bathrooms,<br>Hallways |               |                   |         |             |                 |              |                               |  |               |                       |
| 16    | Lab Table Mastic - No ACBM             |                   |                | 1966 Building-<br>Room 223   | NO_ACBM       | MISC              |         |             |                 |              |                               |  |               |                       |
| 17    | Brown Baseboard - No ACBM              |                   |                | 1966 Building- 1st<br>& 2nd Floor<br>Classrooms                          | NO_ACBM       | MISC              |         |             |                 |              |                               |  |               |                       |
| 18    | Brown Baseboard Mastic                 |                   |                | 1966 Building- 1st<br>& 2nd Floor<br>Classrooms                          | NO_ACBM       | MISC              |         | None        |                 |              |                               |  |               |                       |
| 19    | Drywall - No ACBM                      |                   |                | 1959 Building-<br>Above 1x1 Ceiling<br>Panels                            | NO_ACBM       | MISC              |         |             |                 |              |                               |  |               |                       |
| 20    | Drywall - No ACBM                      |                   |                | 1966 Building-<br>Above 1x1 Ceiling<br>Panels                            | NO_ACBM       | MISC              |         |             |                 |              |                               |  |               |                       |
| 21    | Interior Window Glazing ABATED         |                   |                | Throughout 1959<br>Building  | ABATED        | MISC              |         | None        |                 |              |                               |  |               | Low                   |
| 22    | Window Glazing ABATED                  |                   |                | Throughout 1966<br>Building  | ABATED        | MISC              |         | None        |                 |              |                               |  |               |                       |
| 23    | Black Baseboard - No ACBM              |                   |                | Room 223   | NO_ACBM       | MISC              |         |             |                 |              |                               |  |               |                       |
| 24    | Black Baseboard Mastic ABATED          |                   |                | Room 223   | ABATED        | MISC              |         |             |                 |              |                               |  |               |                       |
| 25    | Stairwell Tread ABATED                 |                   |                | 1959 Building-<br>Stairwells   | ABATED        | MISC              |         | None        |                 |              |                               |  |               |                       |
| 26    | Stairwell Tread Mastic - No ACBM       |                   |                | 1959 Building-<br>Stairwells   | NO_ACBM       | MISC              |         |             |                 |              |                               |  |               |                       |
| A     | Mag Block Boiler Insulation            | 1,500             | SF             | Boiler Room  | AMO           | TSI               | Y       | NONE        | 0               |              | No                            | Any remaining friable<br>ACBM or friable<br>suspect ACBM |               | LOW                   |
| B     | Mag Block Water Tank                   | 100               | SF             | Boiler Room  | CHR           | TSI               | Y       | NONE        | 0               |              | No                            | Any remaining friable<br>ACBM or friable<br>suspect ACBM |               | LOW                   |
| C     | Mag Block Condensation Tank Insulation | 60                | SF             | Boiler Room  | AMO           | TSI               | Y       | NONE        | 0               |              | No                            | Any remaining friable<br>ACBM or friable<br>suspect ACBM |               | MODERATE              |
| D     | Mag Block Expansion Tank Insulation    | 75                | SF             | Boiler Room  | AMO           | TSI               | Y       | NONE        | 0               |              | No                            | Any remaining friable<br>ACBM or friable<br>suspect ACBM |               | MODERATE              |
| E     | Mag Block Heat Exchanges Insulation    | 14                | SF             | Boiler Room  | AMO           | TSI               | Y       | NONE        | 0               |              | No                            | Any remaining friable<br>ACBM or friable<br>suspect ACBM |               | MODERATE              |

# Chicago Public Schools

School Fermi School Unit 23191 Building ID 3320

Address 1415 E. 70th St. Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

| HA No | Material Description          | Material Quantity | Material Units | Material Location   | Asbestos Type | Material Category | Friable | Damage Type | Damage Quantity | Damage Units | Change in Assessment Category | Damage Category                                  | Damage Reason | Disturbance Potential |
|-------|-------------------------------|-------------------|----------------|---|---------------|-------------------|---------|-------------|-----------------|--------------|-------------------------------|--|---------------|-----------------------|
| F     | Mag Block Breeching           | 300               | SF             | Boiler Room   | AMO           | TSI               | Y       | NONE        | 0               |              | No                            | Any remaining friable ACM or friable suspect ACM |               | LOW                   |
| FT-1  | 12x12 Beige Floor Tile        | 31,000            | SF             | All Classrooms 1st & 2nd Floor, (except 207, 215, 218, 220), Main Office, All Corridors on 1st and 2nd Floors   | ASSUMED       | MISC              | N       | NONE        | 0               |              | No                            | ACBM with the potential for damage               |               | LOW                   |
| FTM-1 | 12x12 Beige Floor Tile Mastic | 31,000            | SF             | All Classrooms 1st and 2nd Floors (except 207, 215, 218, 220), Main Office, All Corridors on 1st and 2nd Floors | ASSUMED       | MISC              | N       | NONE        | 0               |              | No                            | ACBM with the potential for damage               |               | LOW                   |
| G     | Preform Pipe Insulation       | 190               | SF             | Mechanical Area   | AMO           | TSI               | Y       | NONE        | 0               |              | No                            | Any remaining friable ACM or friable suspect ACM |               | MODERATE              |
| H     | Aircell Pipe Fittings         | 65                | LF             | 1959 Building- Girls & Boys Toilet Room Pipe Chase, 1st Floor Above Ceiling in Corridor & Crawlspace            | CHR           | TSI               | Y       | NONE        | 0               |              | No                            | Any remaining friable ACM or friable suspect ACM |               | LOW                   |
| I     | Fiberglass Fittings           | 80                | LF             | 1959 Building- Basement Crawlspace  | CHR           | TSI               | Y       | NONE        | 0               |              | No                            | Any remaining friable ACM or friable suspect ACM |               | LOW                   |
| J     | Aircell Lagging               | 60                | LF             | 1959 Building- Pipe Chase, 1st & 2nd Floor Toilet Rooms, Janitor's Closet, 1st Floor Corridor Above Ceiling     | CHR           | TSI               | Y       | NONE        | 0               |              | No                            | Any remaining friable ACM or friable suspect ACM |               | LOW                   |
| K     | Cardboard Lag                 | 15                | LF             | 1959 Building- 1st & 2nd Floor Boys and Girls Restroom Pipe Chase   | CHR           | TSI               | Y       | NONE        | 0               |              | No                            | Any remaining friable ACM or friable suspect ACM |               | LOW                   |
| L     | Cardboard Runs                | 12                | FITTING        | 1959 Building- 1st and 2nd Floor Pipe Chase Boys and Girls Toilet Pipe Chase                                    | CHR           | TSI               | Y       | UNKNO WN    | 0               |              | No                            | Any remaining friable ACM or friable suspect ACM |               | LOW                   |
| M     | Fitting on Preform            | 18                | LF             | 1959 Building- Boiler Room  | CHR           | TSI               | Y       | UNKNO WN    | 0               |              | No                            | Any remaining friable ACM or friable             |               | LOW                   |



# Chicago Public Schools

School Fermi School Unit 23191 Building ID 3320

Address 1415 E. 70th St. Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

|   |
|---|
| Reinspection Date <b>8/19/2019</b>                |
| Inspector Name <b>John Fenn</b>                   |
| <b>100-09786</b> <b>5/15/2020</b>                 |
| Inspector's IDPH License Number / Expiration Date |

### Inspector's Comments

| HA Number: | Inspector Comments:                            |
|------------|--|
| 04A        |  |
| 04B        | Not Observed 2019                              |
| 04C        | Not Observed 2019. Partially Covered by Carpet |
| 04D        |  |
| 04E        |  |
| 05         | Not observed 2019                              |
| 05A        | Not Observed 2019                              |
| 06         |  |
| 07A        |  |
| 07B        | Not Observed 2019                              |
| 07C        | Not Observed 2019                              |
| 08         |  |
| 08A        | Not observed 2019                              |
| 09A        | Not observed 2019                              |
| 09B        |  |
| 09C        |  |
| 10         | Not Observed 2019                              |
| 100        |  |
| 100A       |  |
| 101        |  |
| 101A       |  |
| 102        |  |
| 102A       |  |

# Chicago Public Schools

School Fermi School Unit 23191 Building ID 3320

Address 1415 E. 70th St. Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

| HA Number: | Inspector Comments: |
|------------|---------------------|
| 103        |                     |
| 103A       |                     |
| 104        |                     |
| 105        |                     |
| 11A        | Not observed 2019   |
| 11B        |                     |
| 11C        |                     |
| 12         |                     |
| 13         |                     |
| 14         |                     |
| 15         |                     |
| 16         |                     |
| 17         |                     |
| 18         |                     |
| 19         |                     |
| 20         |                     |
| 21         |                     |
| 22         |                     |
| 23         |                     |
| 24         |                     |
| 25         |                     |
| 26         |                     |
| A          |                     |
| B          |                     |
| C          |                     |
| D          |                     |
| E          |                     |
| F          |                     |
| FT-1       | Not Observed 2019   |

# Chicago Public Schools

School Fermi School Unit 23191 Building ID 3320

Address 1415 E. 70th St. Region 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

| HA Number: | Inspector Comments: |
|------------|---------------------|
| FTM-1      | Not Observed 2019   |
| G          |                     |
| H          |                     |
| I          |                     |
| J          |                     |
| K          |                     |
| L          |                     |
| M          |                     |
| N          |                     |
| O          |                     |
| P          |                     |
| Q          |                     |

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Fermi School  
**Address** 1415 E. 70th St.

**Unit** 23191  
Chicago, IL, 60637

**Building ID** 3320  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

| HA Number | Material Description                     | Material Quantity | Material Units | Material Location  | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category                      | Response        |
|-----------|--|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|--------------------------------------|-----------------|
| 04A       | 9x9 Dark Brown Floor Tile                | 2,000             | SF             | 1959 Building- Assistant Principal's Office, Storeroom, West Hallway, 2nd Floor Lounge, Engineer's Office                              | Chrysotile    | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |
| 04B       | 9x9 Light Brown Floor Tile               | 3,000             | SF             | 1959 Building- Kitchen, Lunchroom, Locker Room   | Chrysotile    | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |
| 04C       | 9x9 Brown Floor Tile                     | 20,000            | SF             | 1959 Building- Main/Principal's Office, Rooms 101-108, 110 & Adjacent Corridor, Rooms 200-208 & Adjacent Corridor, 2nd Floor Book Room | Chrysotile    | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |
| 04D       | Blue Carpet Mastic                       | 350               | SF             | 1959 Building- Assistant Principal's Office  | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |
| 04E       | Carpet Mastic                            | 400               | SF             | 1959 Building- Main/Principal's Office, Room 215   | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |
| 05        | 12x12 Brown Floor Tile                   | 2,400             | SF             | 1959 Building- Lunchroom   | Chrysotile    | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |
| 05A       | 12x12 Cream Floor Tile                   | 100               | SF             | 1959 Building- Dishwashing Room  | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |
| 06        | Lab Tables                               | 63                | SF             | Room 223   | Chrysotile    | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |
| 07A       | 9x9 Dark Brown Floor Tile Mastic         | 2,000             | SF             | 1959 Building- Assistant Principal's Office, Storeroom, West Hallway, 2nd Floor Lounge, Engineer's Office                              | Chrysotile    | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |
| 07B       | 9x9 Light Brown Floor Tile Mastic ABATED |                   |                | 1959 Building- Kitchen, Lunchroom, Locker Room   | Abated        | MISC              |         |                 |              |                                      |                 |
| 07C       | 9x9 Brown Floor Tile Mastic ABATED       |                   |                | 1959 Building- Main/Principal's Office, Rooms 101-108, 110 & Adjacent Corridor, Rooms 200-208 & Adjacent Corridor, 2nd Floor Book Room | Abated        | MISC              |         |                 |              |                                      |                 |
| 08        | 12x12 Brown Floor Tile Mastic - No ACBM  |                   |                | 1959 Building- Lunchroom   | No ACBM       | MISC              |         |                 |              |                                      |                 |
| 08A       | 12x12 Cream Floor Tile Mastic            | 100               | SF             | 1959 Building- Dishwashing Room  | Chrysotile    | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |
| 09A       | 9x9 Dark Brown Floor Tile                | 24,800            | SF             | 1966 Building- All Classrooms, except Room 111, Teachers' Lounge   | Chrysotile    | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |
| 09B       | 9x9 Light Brown Floor Tile ABATED        |                   |                | 1966 Building- All Corridors   | Abated        | MISC              |         |                 |              |                                      |                 |
| 09C       | 9x9 Cream Floor Tile ABATED              |                   |                | 1966 Building- Room 111  | Abated        | MISC              |         |                 |              |                                      |                 |
| 10        | Light Brown Baseboard - No ACBM          |                   |                | 1959 Building- Classrooms and Office Area  | No ACBM       | MISC              |         |                 |              |                                      |                 |
| 100       | 12" X 12" White w/Grey Floor Tile        | 15,000            | SF             | 2nd Floor Hallway North, 1st Floor Hallway East & North, Rooms 201, 202,   | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage | Follow O&M Plan |



# Chicago Public Schools

**School** Fermi School  
**Address** 1415 E. 70th St.

**Unit** 23191  
Chicago, IL, 60637

**Building ID** 3320  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

| HA Number | Material Description                      | Material Quantity | Material Units | Material Location  | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category                                      | Response        |
|-----------|---|-------------------|----------------|--|---------------|-------------------|---------|-----------------|--------------|--|-----------------|
|           |   |                   |                | 203, 204, 205, 206, & 208, Stairways, Rooms 111, 112, 127, Lunchroom   |               |                   |         |                 |              |  |                 |
| 100A      | 12" X 12" White w/Grey Floor Tile Mastic  | 15,000            | SF             | 2nd Floor Hallway North, Rooms 201, 202, 203, 204, 205, 206, 208; 1st Floor Hallway East & North, Stairways, Rooms 111, 112, & 127, Lunchroom                | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |
| 101       | 12" X 12" Cream w/Grey Floor Tile         | 15,000            | SF             | 2nd Floor Hallway West & South and SE, Rooms 216, 219, 220, 221, 222, 224, 233; 1st Floor South & West Hallway; Rooms 114 - 122, 124 - 125, Faculty Lounge 1 | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |
| 101A      | 12" X 12" Cream w/Grey Floor Tile Mastic  | 15,000            | SF             | 2nd Floor Hallway West & South & SE, Room 216, Rooms 219 - 224,; 1st Floor South & West Hallway, Rooms 114 - 122, Room 124 - 125, Faculty Lounge             | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |
| 102       | 12" X 12" Brown w/White Floor Tile        | 2,000             | SF             | Rooms 207 & 208  | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |
| 102A      | 12" X 12" Brown w/White Floor Tile Mastic | 2,000             | SF             | Rooms 207 & 208  | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |
| 103       | 12"X12" Grey w/White Floor Tile           | 7,000             | SF             | Rooms 101 - 108, 110   | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |
| 103A      | 12"X12" Grey w/White Floor Tile Mastic    | 7,000             | SF             | Rooms 101 - 108, 110   | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |
| 104       | 1"X1" Ceramic Tile Mastic                 | 3,000             | SF             | Bathrooms and Water Fountain Walls   | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |
| 105       | Marker Board Mastic                       | 1,000             | SF             | Throughout Building  | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |
| 11A       | 9x9 Dark Brown Floor Tile Mastic          | 24,800            | SF             | 1959 Building- Classrooms and Office Area  | Chrysotile    | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |
| 11B       | 9x9 Light Brown Floor Tile Mastic ABATED  |                   |                | 1966 Building- Corridors   | Abated        | MISC              |         |                 |              |  |                 |
| 11C       | 9x9 Cream Floor Tile Mastic ABATED        |                   |                | 1966 Building- Room 111  | Abated        | MISC              |         |                 |              |  |                 |
| 12        | Light Brown Baseboard Mastic - No ACBM    |                   |                | 1959 Building- Classrooms and Office Area  | No ACBM       | MISC              |         |                 |              |  |                 |
| 13        | 1x1 Ceiling Tile - No ACBM                |                   |                | 1966 Building- Throughout: Classrooms, Teachers' Lounge, Bathrooms, Hallways   | No ACBM       | MISC              |         |                 |              |  |                 |
| 14        | 1x1 Ceiling Tile Mastic                   | 29,400            | SF             | 1966 Building- Throughout: Classrooms, Teachers Lounge, Bathrooms, Hallways  | Chrysotile    | MISC              | Yes     | 0               | SF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| 15        | 1x1 Ceiling Tile Mastic - No ACBM         |                   |                | 1966 Building- Throughout: Classrooms, Teachers Lounge,  | No ACBM       | MISC              |         |                 |              |  |                 |

# Chicago Public Schools

**School** Fermi School  
**Address** 1415 E. 70th St.

**Unit** 23191  
Chicago, IL, 60637

**Building ID** 3320  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

| HA Number | Material Description                   | Material Quantity | Material Units | Material Location   | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category                                      | Response        |
|-----------|--|-------------------|----------------|---|---------------|-------------------|---------|-----------------|--------------|--|-----------------|
|           |  |                   |                | Bathrooms, Hallways   |               |                   |         |                 |              |  |                 |
| 16        | Lab Table Mastic - No ACBM             |                   |                | 1966 Building- Room 223   | No ACBM       | MISC              |         |                 |              |  |                 |
| 17        | Brown Baseboard - No ACBM              |                   |                | 1966 Building- 1st & 2nd Floor Classrooms   | No ACBM       | MISC              |         |                 |              |  |                 |
| 18        | Brown Baseboard Mastic                 |                   |                | 1966 Building- 1st & 2nd Floor Classrooms   | No ACBM       | MISC              |         |                 |              |  |                 |
| 19        | Drywall - No ACBM                      |                   |                | 1959 Building- Above 1x1 Ceiling Panels   | No ACBM       | MISC              |         |                 |              |  |                 |
| 20        | Drywall - No ACBM                      |                   |                | 1966 Building- Above 1x1 Ceiling Panels   | No ACBM       | MISC              |         |                 |              |  |                 |
| 21        | Interior Window Glazing ABATED         |                   |                | Throughout 1959 Building  | Abated        | MISC              |         |                 |              |  |                 |
| 22        | Window Glazing ABATED                  |                   |                | Throughout 1966 Building  | Abated        | MISC              |         |                 |              |  |                 |
| 23        | Black Baseboard - No ACBM              |                   |                | Room 223  | No ACBM       | MISC              |         |                 |              |  |                 |
| 24        | Black Baseboard Mastic ABATED          |                   |                | Room 223  | Abated        | MISC              |         |                 |              |  |                 |
| 25        | Stairwell Tread ABATED                 |                   |                | 1959 Building- Stairwells   | Abated        | MISC              |         |                 |              |  |                 |
| 26        | Stairwell Tread Mastic - No ACBM       |                   |                | 1959 Building- Stairwells   | No ACBM       | MISC              |         |                 |              |  |                 |
| A         | Mag Block Boiler Insulation            | 1,500             | SF             | Boiler Room   | Amosite       | TSI               | Yes     | 0               | SF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| B         | Mag Block Water Tank                   | 100               | SF             | Boiler Room   | Chrysotile    | TSI               | Yes     | 0               | SF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| C         | Mag Block Condensation Tank Insulation | 60                | SF             | Boiler Room   | Amosite       | TSI               | Yes     | 0               | SF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| D         | Mag Block Expansion Tank Insulation    | 75                | SF             | Boiler Room   | Amosite       | TSI               | Yes     | 0               | SF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| E         | Mag Block Heat Exchanges Insulation    | 14                | SF             | Boiler Room   | Amosite       | TSI               | Yes     | 0               | SF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| F         | Mag Block Breeching                    | 300               | SF             | Boiler Room   | Amosite       | TSI               | Yes     | 0               | SF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| FT-1      | 12x12 Beige Floor Tile                 | 31,000            | SF             | All Classrooms 1st & 2nd Floor, (except 207, 215, 218, 220), Main Office, All Corridors on 1st and 2nd Floors   | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |
| FTM-1     | 12x12 Beige Floor Tile Mastic          | 31,000            | SF             | All Classrooms 1st and 2nd Floors (except 207, 215, 218, 220), Main Office, All Corridors on 1st and 2nd Floors | Assumed       | MISC              | No      | 0               | SF           | 6 ACBM with the potential for damage                 | Follow O&M Plan |

# Chicago Public Schools

**School** Fermi School  
**Address** 1415 E. 70th St.

**Unit** 23191  
Chicago, IL, 60637

**Building ID** 3320  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

| HA Number | Material Description               | Material Quantity | Material Units | Material Location   | Asbestos Type | Material Category | Friable | Damage Quantity | Damage Units | Damage Category                                      | Response        |
|-----------|------------------------------------|-------------------|----------------|---|---------------|-------------------|---------|-----------------|--------------|--|-----------------|
| G         | Preform Pipe Insulation            | 190               | SF             | Mechanical Area   | Amosite       | TSI               | Yes     | 0               | SF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| H         | Aircell Pipe Fittings              | 65                | LF             | 1959 Building- Girls & Boys Toilet Room Pipe Chase, 1st Floor Above Ceiling in Corridor & Crawlspace        | Chrysotile    | TSI               | Yes     | 0               | LF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| I         | Fiberglass Fittings                | 80                | LF             | 1959 Building- Basement Crawlspace  | Chrysotile    | TSI               | Yes     | 0               | LF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| J         | Aircell Lagging                    | 60                | LF             | 1959 Building- Pipe Chase, 1st & 2nd Floor Toilet Rooms, Janitor's Closet, 1st Floor Corridor Above Ceiling | Chrysotile    | TSI               | Yes     | 0               | LF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| K         | Cardboard Lag                      | 15                | LF             | 1959 Building- 1st & 2nd Floor Boys and Girls Restroom Pipe Chase   | Chrysotile    | TSI               | Yes     | 0               | LF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| L         | Cardboard Runs                     | 12                | FITTING        | 1959 Building- 1st and 2nd Floor Pipe Chase Boys and Girls Toilet Pipe Chase                                | Chrysotile    | TSI               | Yes     | 0               | FITTING      | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| M         | Fitting on Preform                 | 18                | LF             | 1959 Building- Boiler Room  | Chrysotile    | TSI               | Yes     | 0               | LF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| N         | Fittings on Fiberglass Runs        | 105               | LF             | 1966 Building- Teachers Lunchroom Above Ceiling, Crawlspace, Pipe Chase Boys and Girls                      | Actinolite    | TSI               | Yes     | 0               | LF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| O         | Boiler Door Insulation             | 12                | SF             | Boiler Room   | Chrysotile    | TSI               | Yes     | 0               | SF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| P         | Boiler Gasket                      | 12                | LF             | Boiler Room   | Chrysotile    | TSI               | Yes     | 0               | LF           | 7 Any remaining friable ACBM or friable suspect ACBM | Follow O&M Plan |
| Q         | Vibration Dampener Cloth - No ACBM |                   |                | Boiler Room   | No ACBM       | MISC              |         |                 |              |  |                 |

# Chicago Public Schools

**School** Fermi School  
**Address** 1415 E. 70th St.

**Unit** 23191  
 Chicago, IL, 60637

**Building ID** 3320  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.  
 174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Management Planner's Comments Summarized at the End of the Report*

|                                    |                |
|------------------------------------|----------------|
| Review Date                        | 09/16/2019     |
| Manager Planner Name               | Steven Geneser |
| 100-01784                          | 5/15/2020      |
| Manager IDPH License No/Expiration |                |

| HA Number | Management Comments |
|-----------|---------------------|
| 04A       |                     |
| 04B       |                     |
| 04C       |                     |
| 04D       |                     |
| 04E       |                     |
| 05        |                     |
| 05A       |                     |
| 06        |                     |
| 07A       |                     |
| 07B       |                     |
| 07C       |                     |
| 08        |                     |
| 08A       |                     |

# Chicago Public Schools

**School** Fermi School  
**Address** 1415 E. 70th St.

**Unit** 23191  
 Chicago, IL, 60637

**Building ID** 3320  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

| HA Number | Management Comments |
|-----------|---------------------|
| 09A       |                     |
| 09B       |                     |
| 09C       |                     |
| 10        |                     |
| 100       |                     |
| 100A      |                     |
| 101       |                     |
| 101A      |                     |
| 102       |                     |
| 102A      |                     |
| 103       |                     |
| 103A      |                     |
| 104       |                     |
| 105       |                     |
| 11A       |                     |
| 11B       |                     |
| 11C       |                     |
| 12        |                     |
| 13        |                     |
| 14        |                     |
| 15        |                     |
| 16        |                     |
| 17        |                     |
| 18        |                     |
| 19        |                     |
| 20        |                     |

# Chicago Public Schools

**School** Fermi School  
**Address** 1415 E. 70th St.

**Unit** 23191  
 Chicago, IL, 60637

**Building ID** 3320  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

| HA Number | Management Comments |
|-----------|---------------------|
| 21        |                     |
| 22        |                     |
| 23        |                     |
| 24        |                     |
| 25        |                     |
| 26        |                     |
| A         |                     |
| B         |                     |
| C         |                     |
| D         |                     |
| E         |                     |
| F         |                     |
| FT-1      |                     |
| FTM-1     |                     |
| G         |                     |
| H         |                     |
| I         |                     |
| J         |                     |
| K         |                     |
| L         |                     |
| M         |                     |
| N         |                     |
| O         |                     |
| P         |                     |
| Q         |                     |

# Chicago Public Schools

**School** Fermi School  
**Address** 1415 E. 70th St.

**Unit** 23191  
Chicago, IL, 60637

**Building ID** 3320  
**Region** 05

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

***Management Planner's Comments Summarized at the End of the Report***

# Chicago Public Schools

TEM Environmental, Inc.

## 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1959 Building- Assistant Principal's Office, Storeroom, West Hallway, 2nd Floor Lounge, Engineer's Office**

MATERIAL QUANTITY: **2000**    MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **04A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile**  
MATERIAL LOCATION: **1959 Building- Assistant Principal's Office, Storeroom, West Hallway, 2nd Floor Lounge, Engineer's Office**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04B**  
MATERIAL DESCRIPTION: **9x9 Light Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- Kitchen, Lunchroom, Locker Room**  
MATERIAL QUANTITY: **3000**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**  
COMMENTS: **Not Observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **04B**  
MATERIAL DESCRIPTION: **9x9 Light Brown Floor Tile**  
MATERIAL LOCATION: **1959 Building- Kitchen, Lunchroom, Locker Room**  
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04C**  
MATERIAL DESCRIPTION: **9x9 Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1959 Building- Main/Principal's Office, Rooms 101-108, 110 & Adjacent Corridor, Rooms 200-208 & Adjacent Corridor, 2nd Floor Book Room**

MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Not Observed 2019. Partially Covered by Carpet**

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **04C**  
MATERIAL DESCRIPTION: **9x9 Brown Floor Tile**  
MATERIAL LOCATION: **1959 Building- Main/Principal's Office, Rooms 101-108, 110 & Adjacent Corridor, Rooms 200-208 & Adjacent Corridor, 2nd Floor Book Room**  
MATERIAL QUANTITY: **20000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04D**  
MATERIAL DESCRIPTION: **Blue Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- Assistant Principal's Office**  
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **04D**  
MATERIAL DESCRIPTION: **Blue Carpet Mastic**  
MATERIAL LOCATION: **1959 Building- Assistant Principal's Office**  
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04E**  
MATERIAL DESCRIPTION: **Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- Main/Principal's Office, Room 215**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **04E**  
MATERIAL DESCRIPTION: **Carpet Mastic**  
MATERIAL LOCATION: **1959 Building- Main/Principal's Office, Room 215**  
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**  
MATERIAL DESCRIPTION: **12x12 Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- Lunchroom**  
MATERIAL QUANTITY: **2400**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**  
COMMENTS: **Not observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **05**  
MATERIAL DESCRIPTION: **12x12 Brown Floor Tile**  
MATERIAL LOCATION: **1959 Building- Lunchroom**  
MATERIAL QUANTITY: **2400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05A**  
MATERIAL DESCRIPTION: **12x12 Cream Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- Dishwashing Room**  
MATERIAL QUANTITY: **100**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**  
COMMENTS: **Not Observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **05A**  
MATERIAL DESCRIPTION: **12x12 Cream Floor Tile**  
MATERIAL LOCATION: **1959 Building- Dishwashing Room**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **Lab Tables**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 223**  
MATERIAL QUANTITY: **63** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **Lab Tables**  
MATERIAL LOCATION: **Room 223**  
MATERIAL QUANTITY: **63** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Chrysotile**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- Assistant Principal's Office, Storeroom, West Hallway, 2nd Floor Lounge, Engineer's Office**

MATERIAL QUANTITY: **2000**    MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile Mastic**  
MATERIAL LOCATION: **1959 Building- Assistant Principal's Office, Storeroom, West Hallway, 2nd Floor Lounge, Engineer's Office**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07B**  
MATERIAL DESCRIPTION: **9x9 Light Brown Floor Tile Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1959 Building- Kitchen, Lunchroom, Locker Room**

MATERIAL QUANTITY:    MATERIAL UNITS:

DAMAGE QUANTITY:    DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **07B**  
MATERIAL DESCRIPTION: **9x9 Light Brown Floor Tile Mastic ABATED**  
MATERIAL LOCATION: **1959 Building- Kitchen, Lunchroom, Locker Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07C**  
MATERIAL DESCRIPTION: **9x9 Brown Floor Tile Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **1959 Building- Main/Principal's Office, Rooms 101-108, 110 & Adjacent Corridor, Rooms 200-208 & Adjacent Corridor, 2nd Floor Book Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **07C**  
MATERIAL DESCRIPTION: **9x9 Brown Floor Tile Mastic ABATED**  
MATERIAL LOCATION: **1959 Building- Main/Principal's Office, Rooms 101-108, 110 & Adjacent Corridor, Rooms 200-208 & Adjacent Corridor, 2nd Floor Book Room**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**  
MATERIAL DESCRIPTION: **12x12 Brown Floor Tile Mastic - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1959 Building- Lunchroom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **08**

MATERIAL DESCRIPTION: **12x12 Brown Floor Tile Mastic - No ACBM**

MATERIAL LOCATION: **1959 Building- Lunchroom**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08A**  
MATERIAL DESCRIPTION: **12x12 Cream Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- Dishwashing Room**  
MATERIAL QUANTITY: **100**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**  
COMMENTS: **Not observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **08A**  
MATERIAL DESCRIPTION: **12x12 Cream Floor Tile Mastic**  
MATERIAL LOCATION: **1959 Building- Dishwashing Room**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1966 Building- All Classrooms, except Room 111, Teachers' Lounge**  
MATERIAL QUANTITY: **24800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS: **Not observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **09A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile**  
MATERIAL LOCATION: **1966 Building- All Classrooms, except Room 111, Teachers' Lounge**  
MATERIAL QUANTITY: **24800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09B**  
MATERIAL DESCRIPTION: **9x9 Light Brown Floor Tile ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **1966 Building- All Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **09B**  
MATERIAL DESCRIPTION: **9x9 Light Brown Floor Tile ABATED**  
MATERIAL LOCATION: **1966 Building- All Corridors**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09C**  
MATERIAL DESCRIPTION: **9x9 Cream Floor Tile ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1966 Building- Room 111**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **09C**

MATERIAL DESCRIPTION: **9x9 Cream Floor Tile ABATED**

MATERIAL LOCATION: **1966 Building- Room 111**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **Light Brown Baseboard - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1959 Building- Classrooms and Office Area**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **Light Brown Baseboard - No ACBM**

MATERIAL LOCATION: **1959 Building- Classrooms and Office Area**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- Classrooms and Office Area**  
MATERIAL QUANTITY: **24800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS: **Not observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **11A**  
MATERIAL DESCRIPTION: **9x9 Dark Brown Floor Tile Mastic**  
MATERIAL LOCATION: **1959 Building- Classrooms and Office Area**  
MATERIAL QUANTITY: **24800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11B**  
MATERIAL DESCRIPTION: **9x9 Light Brown Floor Tile Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1966 Building- Corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **11B**  
MATERIAL DESCRIPTION: **9x9 Light Brown Floor Tile Mastic ABATED**  
MATERIAL LOCATION: **1966 Building- Corridors**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11C**  
MATERIAL DESCRIPTION: **9x9 Cream Floor Tile Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1966 Building- Room 111**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **11C**  
MATERIAL DESCRIPTION: **9x9 Cream Floor Tile Mastic ABATED**  
MATERIAL LOCATION: **1966 Building- Room 111**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **Light Brown Baseboard Mastic - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1959 Building- Classrooms and Office Area**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **Light Brown Baseboard Mastic - No ACBM**  
MATERIAL LOCATION: **1959 Building- Classrooms and Office Area**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **1x1 Ceiling Tile - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1966 Building- Throughout: Classrooms, Teachers' Lounge, Bathrooms, Hallways**

MATERIAL QUANTITY:    MATERIAL UNITS:

DAMAGE QUANTITY:    DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **1x1 Ceiling Tile - No ACBM**  
MATERIAL LOCATION: **1966 Building- Throughout: Classrooms, Teachers' Lounge, Bathrooms, Hallways**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **1x1 Ceiling Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1966 Building- Throughout: Classrooms, Teachers Lounge, Bathrooms, Hallways**  
MATERIAL QUANTITY: **29400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **1x1 Ceiling Tile Mastic**  
MATERIAL LOCATION: **1966 Building- Throughout: Classrooms, Teachers Lounge, Bathrooms, Hallways**  
MATERIAL QUANTITY: **29400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **1x1 Ceiling Tile Mastic - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1966 Building- Throughout: Classrooms, Teachers Lounge, Bathrooms, Hallways**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **1x1 Ceiling Tile Mastic - No ACBM**

MATERIAL LOCATION: **1966 Building- Throughout: Classrooms, Teachers Lounge, Bathrooms, Hallways**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Lab Table Mastic - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1966 Building- Room 223**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Lab Table Mastic - No ACBM**

MATERIAL LOCATION: **1966 Building- Room 223**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Brown Baseboard - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1966 Building- 1st & 2nd Floor Classrooms**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **Brown Baseboard - No ACBM**

MATERIAL LOCATION: **1966 Building- 1st & 2nd Floor Classrooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Brown Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1966 Building- 1st & 2nd Floor Classrooms**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **Brown Baseboard Mastic**

MATERIAL LOCATION: **1966 Building- 1st & 2nd Floor Classrooms**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **Drywall - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1959 Building- Above 1x1 Ceiling Panels**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Drywall - No ACBM**

MATERIAL LOCATION: **1959 Building- Above 1x1 Ceiling Panels**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Drywall - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1966 Building- Above 1x1 Ceiling Panels**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/19/2019



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Drywall - No ACBM**

MATERIAL LOCATION: **1966 Building- Above 1x1 Ceiling Panels**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Interior Window Glazing ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Throughout 1959 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **Interior Window Glazing ABATED**

MATERIAL LOCATION: **Throughout 1959 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **Window Glazing ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout 1966 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **Window Glazing ABATED**

MATERIAL LOCATION: **Throughout 1966 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **Black Baseboard - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 223**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **Black Baseboard - No ACBM**

MATERIAL LOCATION: **Room 223**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **Black Baseboard Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 223**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: **08/19/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **Black Baseboard Mastic ABATED**

MATERIAL LOCATION: **Room 223**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Stairwell Tread ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1959 Building- Stairwells**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **Stairwell Tread ABATED**

MATERIAL LOCATION: **1959 Building- Stairwells**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **Stairwell Tread Mastic - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1959 Building- Stairwells**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **Stairwell Tread Mastic - No ACBM**

MATERIAL LOCATION: **1959 Building- Stairwells**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**  
MATERIAL DESCRIPTION: **Mag Block Boiler Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **A**  
MATERIAL DESCRIPTION: **Mag Block Boiler Insulation**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**  
MATERIAL DESCRIPTION: **Mag Block Water Tank**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **B**  
MATERIAL DESCRIPTION: **Mag Block Water Tank**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Mag Block Condensation Tank Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Mag Block Condensation Tank Insulation**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **60** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Mag Block Expansion Tank Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **75** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Mag Block Expansion Tank Insulation**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **75** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Mag Block Heat Exchanges Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **14** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Mag Block Heat Exchanges Insulation**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **14** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Mag Block Breaching**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Mag Block Breeching**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FT-1**  
MATERIAL DESCRIPTION: **12x12 Beige Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **All Classrooms 1st & 2nd Floor, (except 207, 215, 218, 220), Main Office, All Corridors on 1st and 2nd Floors**

MATERIAL QUANTITY: **31000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS: **Not Observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **FT-1**  
MATERIAL DESCRIPTION: **12x12 Beige Floor Tile**  
MATERIAL LOCATION: **All Classrooms 1st & 2nd Floor, (except 207, 215, 218, 220), Main Office, All Corridors on 1st and 2nd Floors**  
MATERIAL QUANTITY: **31000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **FTM-1**  
MATERIAL DESCRIPTION: **12x12 Beige Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **All Classrooms 1st and 2nd Floors (except 207, 215, 218, 220), Main Office, All Corridors on 1st and 2nd Floors**  
MATERIAL QUANTITY: **31000**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**  
COMMENTS: **Not Observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **FTM-1**  
MATERIAL DESCRIPTION: **12x12 Beige Floor Tile Mastic**  
MATERIAL LOCATION: **All Classrooms 1st and 2nd Floors (except 207, 215, 218, 220), Main Office, All Corridors on 1st and 2nd Floors**  
MATERIAL QUANTITY: **31000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Preform Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Amosite** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Mechanical Area**  
MATERIAL QUANTITY: **190** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Preform Pipe Insulation**  
MATERIAL LOCATION: **Mechanical Area**  
MATERIAL QUANTITY: **190** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Aircell Pipe Fittings**  
HISTORICAL AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile**    FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- Girls & Boys Toilet Room Pipe Chase, 1st Floor Above Ceiling in Corridor & Crawlspace**

MATERIAL QUANTITY: **65**    MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**    DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Aircell Pipe Fittings**  
MATERIAL LOCATION: **1959 Building- Girls & Boys Toilet Room Pipe Chase, 1st Floor Above Ceiling in Corridor & Crawlspace**  
MATERIAL QUANTITY: **65** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **Fiberglass Fittings**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- Basement Crawlspace**  
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **Fiberglass Fittings**  
MATERIAL LOCATION: **1959 Building- Basement Crawlspace**  
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **Aircell Lagging**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1959 Building- Pipe Chase, 1st & 2nd Floor Toilet Rooms, Janitor's Closet, 1st Floor Corridor Above Ceiling**

MATERIAL QUANTITY: **60**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/19/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **J**  
MATERIAL DESCRIPTION: **Aircell Lagging**  
MATERIAL LOCATION: **1959 Building- Pipe Chase, 1st & 2nd Floor Toilet Rooms, Janitor's Closet, 1st Floor Corridor Above Ceiling**  
MATERIAL QUANTITY: **60** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Cardboard Lag**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- 1st & 2nd Floor Boys and Girls Restroom Pipe Chase**  
MATERIAL QUANTITY: **15** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Cardboard Lag**  
MATERIAL LOCATION: **1959 Building- 1st & 2nd Floor Boys and Girls Restroom Pipe Chase**  
MATERIAL QUANTITY: **15** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**  
MATERIAL DESCRIPTION: **Cardboard Runs**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- 1st and 2nd Floor Pipe Chase Boys and Girls Toilet Pipe Chase**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **L**  
MATERIAL DESCRIPTION: **Cardboard Runs**  
MATERIAL LOCATION: **1959 Building- 1st and 2nd Floor Pipe Chase Boys and Girls Toilet Pipe Chase**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **Fitting on Preform**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1959 Building- Boiler Room**  
MATERIAL QUANTITY: **18** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **Fitting on Preform**  
MATERIAL LOCATION: **1959 Building- Boiler Room**  
MATERIAL QUANTITY: **18** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**  
MATERIAL DESCRIPTION: **Fittings on Fiberglass Runs**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Actinolite** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1966 Building- Teachers Lunchroom Above Ceiling, Crawlspace, Pipe Chase Boys and Girls**  
MATERIAL QUANTITY: **105** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **N**  
MATERIAL DESCRIPTION: **Fittings on Fiberglass Runs**  
MATERIAL LOCATION: **1966 Building- Teachers Lunchroom Above Ceiling, Crawlspace, Pipe Chase Boys and Girls**  
MATERIAL QUANTITY: **105** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**  
MATERIAL DESCRIPTION: **Boiler Door Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **0**  
MATERIAL DESCRIPTION: **Boiler Door Insulation**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P**  
MATERIAL DESCRIPTION: **Boiler Gasket**  
HISTORICAL AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile**    FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **12**    MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **P**  
MATERIAL DESCRIPTION: **Boiler Gasket**  
MATERIAL LOCATION: **Boiler Room**  
MATERIAL QUANTITY: **12** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School** INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q**  
MATERIAL DESCRIPTION: **Vibration Dampener Cloth - No ACBM**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23191** BUIDLING ID: **3320**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School** REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.** IDPH LICENSE NO: **100-09786**

---

HOMOGENEOUS AREA: **Q**

MATERIAL DESCRIPTION: **Vibration Dampener Cloth - No ACBM**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
*2019 AHERA REINSPECTION*

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **102A**  
MATERIAL DESCRIPTION: **12" X 12" Brown w/White Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 207 & 208**  
MATERIAL QUANTITY: **2000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School**      REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

HOMOGENEOUS AREA: **102A**  
MATERIAL DESCRIPTION: **12" X 12" Brown w/White Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 207 & 208**  
MATERIAL QUANTITY: **2000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **103A**  
MATERIAL DESCRIPTION: **12"X12" Grey w/White Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 101 - 108, 110**  
MATERIAL QUANTITY: **7000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School**      REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

HOMOGENEOUS AREA: **103A**  
MATERIAL DESCRIPTION: **12"X12" Grey w/White Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 101 - 108, 110**  
MATERIAL QUANTITY: **7000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **104**  
MATERIAL DESCRIPTION: **1"X1" Ceramic Tile Mastic**  
MATERIAL LOCATION: **Bathrooms and Water Fountain Walls**  
MATERIAL QUANTITY: **3000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School**      REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

HOMOGENEOUS AREA: **104**  
MATERIAL DESCRIPTION: **1"X1" Ceramic Tile Mastic**  
MATERIAL LOCATION: **Bathrooms and Water Fountain Walls**  
MATERIAL QUANTITY: **3000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**      INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **100A**

MATERIAL DESCRIPTION: **12" X 12" White w/Grey Floor Tile Mastic**

MATERIAL LOCATION: **2nd Floor Hallway North, Rooms 201, 202, 203, 204, 205, 206, 208; 1st Floor Hallway East & North, Stairways, Rooms 111, 112, & 127, Lunchroom**

MATERIAL QUANTITY: **15000**      MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC**      FRIABLE:

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW**      CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE REASON:

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School**      REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

HOMOGENEOUS AREA: **100A**  
MATERIAL DESCRIPTION: **12" X 12" White w/Grey Floor Tile Mastic**  
MATERIAL LOCATION: **2nd Floor Hallway North, Rooms 201, 202, 203, 204, 205, 206, 208; 1st Floor Hallway East & North, Stairways, Rooms 111, 112, & 127, Lunchroom**  
MATERIAL QUANTITY: **15000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**      INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **101A**

MATERIAL DESCRIPTION: **12" X 12" Cream w/Grey Floor Tile Mastic**

MATERIAL LOCATION: **2nd Floor Hallway West & South & SE, Room 216, Rooms 219 - 224,; 1st Floor South & West Hallway, Rooms 114 - 122, Room 124 - 125, Faculty Lounge**

MATERIAL QUANTITY: **15000**      MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC**      FRIABLE:

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW**      CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE REASON:

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School**      REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

HOMOGENEOUS AREA: **101A**

MATERIAL DESCRIPTION: **12" X 12" Cream w/Grey Floor Tile Mastic**

MATERIAL LOCATION: **2nd Floor Hallway West & South & SE, Room 216, Rooms 219 - 224,; 1st Floor South & West Hallway, Rooms 114 - 122, Room 124 - 125, Faculty Lounge**

MATERIAL QUANTITY: **15000**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **103**  
MATERIAL DESCRIPTION: **12"X12" Grey w/White Floor Tile**  
MATERIAL LOCATION: **Rooms 101 - 108, 110**  
MATERIAL QUANTITY: **7000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School**      REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

HOMOGENEOUS AREA: **103**  
MATERIAL DESCRIPTION: **12"X12" Grey w/White Floor Tile**  
MATERIAL LOCATION: **Rooms 101 - 108, 110**  
MATERIAL QUANTITY: **7000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**      INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **101**

MATERIAL DESCRIPTION: **12" X 12" Cream w/Grey Floor Tile**

MATERIAL LOCATION: **2nd Floor Hallway West & South and SE, Rooms 216, 219, 220, 221, 222, 224, 233; 1st Floor South & West Hallway; Rooms 114 - 122, 124 - 125, Faculty Lounge 1**

MATERIAL QUANTITY: **15000**      MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC**      FRIABLE:

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW**      CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE REASON:

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School**      REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

HOMOGENEOUS AREA: **101**

MATERIAL DESCRIPTION: **12" X 12" Cream w/Grey Floor Tile**

MATERIAL LOCATION: **2nd Floor Hallway West & South and SE, Rooms 216, 219, 220, 221, 222, 224, 233; 1st Floor South & West Hallway; Rooms 114 - 122, 124 - 125, Faculty Lounge 1**

MATERIAL QUANTITY: **15000**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **102**  
MATERIAL DESCRIPTION: **12" X 12" Brown w/White Floor Tile**  
MATERIAL LOCATION: **Rooms 207 & 208**  
MATERIAL QUANTITY: **2000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School**      REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

HOMOGENEOUS AREA: **102**  
MATERIAL DESCRIPTION: **12" X 12" Brown w/White Floor Tile**  
MATERIAL LOCATION: **Rooms 207 & 208**  
MATERIAL QUANTITY: **2000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23191**    BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**    INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**    IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **105**  
MATERIAL DESCRIPTION: **Marker Board Mastic**  
MATERIAL LOCATION: **Throughout Building**  
MATERIAL QUANTITY: **1000**    MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**    FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/19/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School**      REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

HOMOGENEOUS AREA: **105**  
MATERIAL DESCRIPTION: **Marker Board Mastic**  
MATERIAL LOCATION: **Throughout Building**  
MATERIAL QUANTITY: **1000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **John Fenn**  
SCHOOL NAME: **Fermi School**      INSPECTION DATE: **8/19/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **100**  
MATERIAL DESCRIPTION: **12" X 12" White w/Grey Floor Tile**  
MATERIAL LOCATION: **2nd Floor Hallway North, 1st Floor Hallway East & North, Rooms 201, 202, 203, 204, 205, 206, & 208, Stairways, Rooms 111, 112, 127, Lunchroom**  
MATERIAL QUANTITY: **15000**      MATERIAL UNITS: **SF**  
MATERIAL CATEGORY: **MISC**      FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **SF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/19/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23191**      BUILDING ID: **3320**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Steven Geneser**  
SCHOOL NAME: **Fermi School**      REVIEW DATE: **9/16/2019**  
ADDRESS: **1415 E. 70th St.**      IDPH LICENSE NO: **100-09786**

HOMOGENEOUS AREA: **100**

MATERIAL DESCRIPTION: **12" X 12" White w/Grey Floor Tile**

MATERIAL LOCATION: **2nd Floor Hallway North, 1st Floor Hallway East & North, Rooms 201, 202, 203, 204, 205, 206, & 208, Stairways, Rooms 111, 112, 127, Lunchroom**

MATERIAL QUANTITY: **15000**      MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/16/2019**



# APPENDIX B

## Inspector and Management Planner Licenses

---

2019



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ [www.otssafety.com](http://www.otssafety.com)

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**John Fenn**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/19/2019

Exam Date: 3/19/2019

Expiration Date: 3/19/2020

Certificate Number: BIR1903191011

---

Kathy DeSalvo, Director

2019



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**John Fenn**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 3/19/2019

Exam Date: 3/19/2019

Expiration Date: 3/19/2020

Certificate Number: MPR1903191035

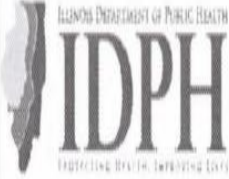


A handwritten signature in black ink that reads 'Kathy DeSalvo'. The signature is written in a cursive style and is positioned above a horizontal line.

Kathy DeSalvo, Director

# COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

|   |  |  |   |
|---|--|--|---|
|  <p>ILLINOIS DEPARTMENT OF PUBLIC HEALTH<br/><b>IDPH</b><br/>PROTECTING HEALTH. IMPROVING LIVES.</p> | <b>ASBESTOS<br/>PROFESSIONAL<br/>LICENSE</b>                                       | <b>ENDORSEMENTS</b>  | <b>TC EXPIRES</b>   |
| <b>ID NUMBER</b><br>100 - 09786   | <b>ISSUED</b><br>4/11/2019   | <b>EXPIRES</b><br>05/15/2020   | INSPECTOR<br>3/19/2020  |
| <b>JOHN H FENN</b><br>2829 N TROY ST<br>CHICAGO, IL 60618<br>Environmental Health   |  |  | MANAGEMENT PLANNER<br>3/19/2020<br>PROJECT MANAGER<br>3/18/2020<br>AIR SAMPLING PROFESSIONAL  |
|   |  |  | <b>Alteration of this license shall result in legal action</b><br>This license issued under authority of the State of Illinois<br>Department of Public Health<br>This license is valid only when accompanied by a valid<br>training course certificate. |

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

|                          | <b>CODE</b> | <b>KEY</b>                             |
|--------------------------|-------------|--|
| <b>MATERIAL</b>          |             |  |
|                          | ACBM        | Asbestos Containing Building Materials |
| <b>MATERIAL CATEGORY</b> |             |  |
|                          | MISC        | Miscellaneous                          |
|                          | SURF        | Surfacing                              |
|                          | TSI         | Thermal System Insulation              |
| <b>MATERIAL UNITS</b>    |             |  |
|                          | LF          | Linear Feet                            |
|                          | SF          | Square Feet                            |
|                          | CF          | Cubic Feet                             |
| <b>DAMAGE TYPE</b>       |             |  |
|                          | Loc         | Localized                              |
|                          | Dist        | Distributed                            |