

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2097
SCHOOL NAME: Brown School
ADDRESS OF SCHOOL: 54 N. Hermitage
CITY: Chicago, IL, 60612

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 2/23/2016

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 215
IDPH INSPECTOR LICENSE NUMBER: 100-08696
IDPH LICENSED INSPECTOR NAME(Please Print): Ciniata Hester
IDPH MP LICENSE NUMBER: 100-19466
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Brown School

54 N. Hermitage
Chicago, IL, 60612

Unit: 22351
Building ID: 2400

IDPH ID Number: 14-016-2990-2097

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Chicago, Il, 60607

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: May 02, 2019

RE: Brown School, Unit 22351
54 N. Hermitage
Chicago, IL, 60612

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Brown School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Brown School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Brown School
Address: 54 N. Hermitage
IDPH ID: 14-016-2990-2097
Contact: Mong, Mba

Unit: 22351
Chicago, IL, 60612
Building ID: 2400
Phone: 312 735 3379

Region: 03

2. Description of Facility

Original Construction: 1957
Total Square Footage: 13630
Current Occupancy: 215

Additional Construction: 1956
No of Floors: 2

3. LEA Designated Person

Contact: Robert Christlieb
Address: 42 West Madison Street
Chicago, IL 60602

Phone: (773) 553-3197

4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Doug McCormick
Address 600 West Van Buren St., Ste 500
Chicago, IL, 60607
Phone: (312) 762-2900

Fax: (312) 782-5145

5. Inspector

Inspector Name: Ciniata Hester

Inspector IDPH license # 100-08696

Signature:
Date: 5/2/2019

6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466

Signature:
Date: 05/29/2019

7. Review Date:05/29/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Brown School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 2400:

004	Ceiling Tile (1' x 1')
010	9"x9" Black Floor Tile
067	Dark Gray Carpet Mastic
069	Insulation Inside of Fire Doors
076	12" x 12" White Floor Tile
101	12" x 12" Tan Floor Tile Mastic
18C	12" x 12" Red Floor Tile
18D	12" x 12" Dark Red Floor Tile
18E	Mastic Associated with HA's 18A, 18B, 18C, 18D, and 98

91	9"x9" Blue/Tan Floor Tile
91M	9"x(9" Blue/Tan Floor Tile Mastic
93	Black Sink Undercoat
97	2' X 4' Ceiling Tile Pinhole
C	Transite Hanger Insulation
E	Aircell Pipe Insulation
F	Hard Joint Compound off Aircell Pipe Insulation
G	Paperwrap Pipe Insulation
H	Hard Joint Compound off Paperwrap Pipe Insulation
K	Vault Door Insulation
O	Hard Joint Elbow

B. The following new homogenous areas have been identified for Building 2400:

018A	12" x 12" Cobalt Blue Floor Tile
018B	12" x 12" Light Blue Floor Tile
100	12" x 12" Tan Floor Tile
101	12" x 12" Tan Floor Tile Mastic
18C	12" x 12" Red Floor Tile
18D	12" x 12" Dark Red Floor Tile
18E	Mastic Associated with HA's 18A, 18B, 18C, 18D, and 98
98	12" x 12" White Floor Tile

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

005A	12"x12" Brown Floor Tile
011	Tan Linoleum
018A	12" x 12" Cobalt Blue Floor Tile
018B	12" x 12" Light Blue Floor Tile
029	12"x12" Multi-Beige Floor Tile
031	12"x12" White Floor Tile w/Black & Gray Streaks
033	12"x12" Off-White Floor Tile w/Brown Specks
037	12"x12" Gray Floor Tile w/White Streaks
041	12"x12" Off-White Floor Tile w/Brown Streaks
066	Ceramic Tile Grout
067	Dark Gray Carpet Mastic
069	Insulation Inside of Fire Doors
070	Roofing Material - Non AHERA
071	Roof Flashing - Non AHERA
072	12" x 12" Dark Aqua Floor Tile
074	12" x 12" Light Aqua Floor Tile
076	12" x 12" White Floor Tile
078	Blue Carpet Mastic
079	Brown Carpet Mastic
086	12" x 12" Tan w/Red Streaks VFT
087	12" x 12" Tan w/Red Streaks VFT Mastic
088	Blue Carpet Mastic
089	Chalkboard/Posterboard Adhesive
090	Chalkboard/Posterboard Adhesive
100	12" x 12" Tan Floor Tile
101	12" x 12" Tan Floor Tile Mastic
18C	12" x 12" Red Floor Tile
18D	12" x 12" Dark Red Floor Tile
18E	Mastic Associated with HA's 18A, 18B, 18C, 18D, and 98
91	9"x9" Blue/Tan Floor Tile
91M	9"x(9" Blue/Tan Floor Tile Mastic
92	Carpet Mastic
93	Black Sink Undercoat
94	Drywall Joint Compound
95	Drywall
96	2' X 4' Ceiling Tile Pinhole and Fissure
97	2' X 4' Ceiling Tile Pinhole
98	12" x 12" White Floor Tile
C	Transite Hanger Insulation
K	Vault Door Insulation
O	Hard Joint Elbow

The following areas were deemed to be inaccessible:

030	12"x12" Multi-Beige Floor Tile Mastic
067	Dark Gray Carpet Mastic
101	12" x 12" Tan Floor Tile Mastic
18E	Mastic Associated with HA's 18A, 18B, 18C, 18D, and 98
91M	9"x(9" Blue/Tan Floor Tile Mastic
O	Hard Joint Elbow

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Ciniata Hester, IDPH License # 100-08696. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Brown School Building 2400 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. A timely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Brown School Unit 22351 Building ID 2400

Address 54 N. Hermitage Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
001	Plaster			Throughout the 1955 building	NO_ACBM	SURFACE								
002	1'x1' Random Dot Ceiling Tile			Throughout Building	NO_ACBM	MISC								
003	1'x1' Fissured Ceiling Tile			Throughout Building	NO_ACBM	MISC								
004	Ceiling Tile (1' x 1')	2,000	SF	Kitchen	CHR	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
005A	12"x12" Brown Floor Tile	4,500	SF	1st Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
005B	12"x12" White Floor Tile	2,000	SF	1st Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
006	12"x12" Red VFT			No longer present	ABATED	MISC								
007	9"x9" Green Floor Tile	200	SF	Gym Hall	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
008	12"x12" Blue Floor Tile w/ White Streaks	3,000	SF	100, 108, & 222	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
009	12"x12" Tan VFT	9,800	SF	Rooms 209, 210, 220, 105 and 1st Floor Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
010	9"x9" Black Floor Tile	50	SF	Custodial Closet on First Floor	CHR	MISC	N	LOC	100		Yes	ACBM with the potential for damage	5	LOW
011	Tan Linoleum			Rooms 103 - No room 103 (in 2013)	ASSUMED	MISC								Low
012	12"x12" White Floor Tile w/Green Flecks	4,200	SF	Rooms 205, 211, 231, 225, 226, 227, 228, 230 & 231	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
013	12"x12" White VFT w/Red & Black Flecks	5,000	SF	Rooms 104, 125, 126, 128, 130, 202, 206, 214, 216, 224	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
014	9"x9" Tan Floor Tile	4,000	SF	2nd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
015	12"x12" Brown Floor Tile Mastic			Kitchen, Cafeteria & 1st Floor Corridors	CHR	MISC								
016	12"x12" White Floor Tile Mastic			Kitchen & Cafeteria	CHR	MISC								
017	12"x12" Blue Floor Tile w/ White Streaks Mastic	3,000	SF	Rooms 100, 108 and 222	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
018	12"x12" Tan Floor Tile Mastic	9,800	SF	Rooms 209, 210, 220, 105, 203 & 1st Floor Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
018A	12" x 12" Cobalt Blue Floor Tile	200	SF	Classrooms 220, 222, 226, 228, and 230	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Brown School Unit 22351 Building ID 2400

Address 54 N. Hermitage Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
018B	12" x 12" Light Blue Floor Tile	200	SF	Classrooms 220,222,226,228 and 230	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
019	9"x9" Black Floor Tile Mastic	50	SF	Custodial Closet on 1st Floor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
020	12"x12" White Floor Tile w/Green Flecks Mastic	4,200	SF	Rooms 205, 211, 231, 225, 226, 227, 228, 230 & 231	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
021	12"x12" White Floor Tile w/Red &Blk Flecks Mastic	8,000	SF	Rooms 104, 125,126, 128, 130, 202, 206, 214, 216, & 224	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
022	9"x9" Tan Floor Tile Mastic	4,000	SF	2nd Floor Corridors	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
023	Floor Tile Beneath 12"x12" Floor Tile - Abated			Kitchen	ABATED	MISC								
024	HA 23 Floor Tile Mastic - Abated			Kitchen	ABATED	MISC								
025	Tile Beneath HA23 Tiles - Abated			Kitchen	ABATED	MISC								
026	HA 25 Floor Tile Mastic - Abated			Kitchen	ABATED	MISC								
027	12"x12" White Floor Tile w/Black Flecks	1,600	SF	Rooms 200 & 223	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
028	12"x12" White Floor Tile w/Black Flecks Mastic	1,600	SF	Rooms 200 & 223	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
029	12"x12" Multi-Beige Floor Tile	1,800	SF	Rooms 216 and 124	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
030	12"x12" Multi-Beige Floor Tile Mastic	300	SF	Rooms 124 and 216	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
031	12"x12" White Floor Tile w/Black & Gray Streaks	900	SF	Material not observed in Room 216	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
032	12"x12" White Floor Tile w/Blk & Gray Strks Mastic			Room 216	NO_ACBM	MISC								
033	12"x12" Off-White Floor Tile w/Brown Specks	7,200	SF	Rooms 105, 106,109, 110, 112, 116, 120, 123 & 205	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
034	12"x12" Off-White Floor Tile w/Brn Specks - Mastic			Rooms 105, 106,109, 110, 112, 116, 120, 123 & 205	NO_ACBM	MISC								
035	12"x12" Tan Floor Tile	800	SF	Room 205	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
036	12"x12" Tan Floor Tile Mastic	800	SF	Room 205	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
037	12"x12" Gray Floor Tile w/White Streaks	800	SF	Room 122	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Brown School Unit 22351 Building ID 2400

Address 54 N. Hermitage Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
061	Exterior Brick Mortar			The 1955 Building	NO_ACBM	MISC								
062	Exterior Brick			The 1957 Building	NO_ACBM	MISC								
063	Exterior Brick Mortar			The 1957 Building	NO_ACBM	MISC								
064	1'x1' Replacement Ceiling Tile			Gym	NO_ACBM	MISC								
065	1'x1' Fissured Ceiling Tile Adhesive (Tile Removed)			Gym	ABATED	MISC								
065A	9"x9" Green Floor Tile w/White Streaks Mastic	200	SF	Gym Hall	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
066	Ceramic Tile Grout	1,000	SF	Throughout the 1955 Building Washrooms, Entrances & Engineer's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
067	Dark Gray Carpet Mastic	600	SF	Office (102)	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
068	Exterior Door Caulk - Non AHERA			Exterior of Building	CHR	MISC								
069	Insulation Inside of Fire Doors	100	SF	Entrances/Exits and Boiler Room	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
070	Roofing Material - Non AHERA			Exterior	ASSUMED	MISC								
071	Roof Flashing - Non AHERA			Exterior	ASSUMED	MISC								
072	12" x 12" Dark Aqua Floor Tile	2,000	SF	Cafeteria, Kitchen and Teacher's Lunch Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
073	12" x 12" Dark Aqua Floor Tile Mastic	2,000	SF	Cafeteria, Kitchen, & Teacher's Lunchroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
074	12" x 12" Light Aqua Floor Tile	2,000	SF	Cafeteria, Kitchen, & Teacher's Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
075	12" x 12" Light Aqua Floor Tile Mastic	2,000	SF	Cafeteria, Kitchen, & Teacher's Lunchroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
076	12" x 12" White Floor Tile	1,350	SF	127, 131, and MDF Room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
077	12" x 12" White Floor Tile Mastic			127, 131, and MDF Room	NO_ACBM	MISC								
078	Blue Carpet Mastic	800	SF	226	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
079	Brown Carpet Mastic	744	SF	206	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
080	12" x 12" Dark Brown Floor Tile with White Streaks	50	SF	As Patches in Rooms 124, 130, & 202	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Brown School Unit 22351 Building ID 2400

Address 54 N. Hermitage Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
081	12" x 12" Dark Brown VFT w/ White Streaks Mastic	50	SF	As Patches in Rooms 124, 130, & 202	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
082	Linoleum on Counters			205	NO_ACBM	MISC								
083	Linoleum Adhesive on Counters			205	NO_ACBM	MISC								
084	Gray Carpet Mastic			212	NO_ACBM	MISC								
085	Mastic on Wall	5	SF	205	TRE	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
086	12" x 12" Tan w/Red Streaks VFT	800	SF	Room 120	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
087	12" x 12" Tan w/Red Streaks VFT Mastic	800	SF	Room 120	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
088	Blue Carpet Mastic	800	SF	Rooms 225, and 226	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
089	Chalkboard/Posterboard Adhesive	4,000	SF	1955 Building (E) - Throughout All Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
090	Chalkboard/Posterboard Adhesive	1,200	SF	1957 Building West Wing - Throughout All Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
100	12" x 12" Tan Floor Tile	100	SF	Mdf Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
101	12" x 12" Tan Floor Tile Mastic	100	SF	Mdf room	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
18C	12" x 12" Red Floor Tile	200	SF	Room 223,225,231,212 and 206	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
18D	12" x 12" Dark Red Floor Tile	200	SF	Room 223,225,231,212 and 206	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
18E	Mastic Associated with HA's 18A, 18B, 18C, 18D, and 98	3,000	SF	Rooms 206,212,220,222,223,225, 226,228,230, and 231	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
91	9"x9" Blue/Tan Floor Tile	170	SF	Gymnasium	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
91M	9"x(9" Blue/Tan Floor Tile Mastic	170	SF	Gymnasium	ASSUMED	MISC	N	NONE	0		Yes	ACBM with the potential for damage		LOW
92	Carpet Mastic	2,500	SF	Main Office, 210, 212, 228, and Office Area 21	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
93	Black Sink Undercoat	95	SF	Room 100, 106, 110, 112, 114, 116, 120, 122, 124, 126, 128,	ASSUMED	SURFACE	Y	NONE	0		Yes	ACBM with the potential for damage		LOW

Chicago Public Schools

School Brown School Unit 22351 Building ID 2400

Address 54 N. Hermitage Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
J	Mag Block Elbows			Boiler room - removed in 1996	ABATED	MISC								
K	Vault Door Insulation	20	SF	Main Office room 102	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
L	Tank Insulation			Boiler room	NO_ACBM	TSI								
M	Tank Insulation Wrap			Boiler Room	NO_ACBM	TSI								
N	Fiberglass Pipe Insulation Wrap			Boiler Room	NO_ACBM	TSI								
O	Hard Joint Elbow	5	LF	Kitchen Mgr. Office	ASSUMED	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Brown School Unit 22351 Building ID 2400

Address 54 N. Hermitage Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 5/2/2019
Inspector Name Ciniata Hester
100-08696 5/15/2020
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
001	
002	
003	
004	
005A	
005B	
006	
007	
008	
009	
010	Damage in custodial closet on 1st and 2nd floor
011	Not observed
012	
013	Not observed in Room 206
014	
015	Not observed
016	Not observed
017	
018	
018A	
018B	
019	
020	

Chicago Public Schools

School Brown School Unit 22351 Building ID 2400

Address 54 N. Hermitage Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
021	
022	
023	
024	
025	
026	
027	
028	
029	
030	
031	
032	
033	
034	
035	
036	
037	
038	
039	
040	
041	
042	
043	
044	
045	
046	
047	
048	
049	

Chicago Public Schools

School Brown School Unit 22351 Building ID 2400

Address 54 N. Hermitage Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
050	
051	
052	
053	
054	
055	
056	
057	
058	
059	
060	
061	
062	
063	
064	
065	
065A	
066	
067	
068	
069	
070	
071	
072	
073	
074	
075	
076	Not observed
077	

Chicago Public Schools

School Brown School Unit 22351 Building ID 2400

Address 54 N. Hermitage Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
078	Not observed
079	Not observed
080	Rubber material in room 130
081	
082	
083	
084	
085	Not observed
086	
087	
088	
089	
090	
100	
101	
18C	
18D	
18E	
91	
91M	
92	
93	
94	
95	
96	
97	
98	
A	
B	

Chicago Public Schools

School Brown School Unit 22351 Building ID 2400

Address 54 N. Hermitage Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
C	
D	
E	
F	
G	Not observed in Room 116 and 124
H	Not observed in Room 104, 106, 116, 120, and 124
I	
J	
K	No entry
L	
M	
N	
O	Not observed

Table II

Management Planner's Review

Chicago Public Schools

School Brown School
Address 54 N. Hermitage

Unit 22351
Chicago, IL, 60612

Building ID 2400
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
001	Plaster			Throughout the 1955 building	No ACBM	SURFACE					
002	1'x1' Random Dot Ceiling Tile			Throughout Building	No ACBM	MISC					
003	1'x1' Fissured Ceiling Tile			Throughout Building	No ACBM	MISC					
004	Ceiling Tile (1' x 1')	2,000	SF	Kitchen	Chrysotile	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
005A	12"x12" Brown Floor Tile	4,500	SF	1st Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
005B	12"x12" White Floor Tile	2,000	SF	1st Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
006	12"x12" Red VFT			No longer present	Abated	MISC					
007	9"x9" Green Floor Tile	200	SF	Gym Hall	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
008	12"x12" Blue Floor Tile w/ White Streaks	3,000	SF	100, 108, & 222	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
009	12"x12" Tan VFT	9,800	SF	Rooms 209, 210, 220, 105 and 1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
010	9"x9" Black Floor Tile	50	SF	Custodial Closet on First Floor	Chrysotile	MISC	No	100	SF	6 ACBM with the potential for damage	Remove
011	Tan Linoleum			Rooms 103 - No room 103 (in 2013)	Assumed	MISC					Follow O&M Plan
012	12"x12" White Floor Tile w/Green Flecks	4,200	SF	Rooms 205, 211, 231, 225, 226, 227, 228, 230 & 231	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
013	12"x12" White VFT w/Red & Black Flecks	5,000	SF	Rooms 104, 125, 126, 128, 130, 202, 206, 214, 216, 224	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
014	9"x9" Tan Floor Tile	4,000	SF	2nd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
015	12"x12" Brown Floor Tile Mastic			Kitchen, Cafeteria & 1st Floor Corridors	Chrysotile	MISC					Follow O&M Plan
016	12"x12" White Floor Tile Mastic			Kitchen & Cafeteria	Chrysotile	MISC					Follow O&M Plan
017	12"x12" Blue Floor Tile w/ White Streaks Mastic	3,000	SF	Rooms 100, 108 and 222	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
018	12"x12" Tan Floor Tile Mastic	9,800	SF	Rooms 209, 210, 220, 105, 203 & 1st Floor Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
018A	12" x 12" Cobalt Blue Floor Tile	200	SF	Classrooms 220, 222, 226, 228, and 230	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
018B	12" x 12" Light Blue Floor Tile	200	SF	Classrooms 220,222,226,228 and 230	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
019	9"x9" Black Floor Tile Mastic	50	SF	Custodial Closet on 1st Floor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
020	12"x12" White Floor Tile w/Green Flecks Mastic	4,200	SF	Rooms 205, 211, 231, 225, 226, 227, 228, 230 & 231	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
021	12"x12" White Floor Tile w/Red &Blk Flecks Mastic	8,000	SF	Rooms 104, 125,126, 128, 130, 202, 206, 214, 216, & 224	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
022	9"x9" Tan Floor Tile Mastic	4,000	SF	2nd Floor Corridors	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
023	Floor Tile Beneath 12"x12" Floor Tile - Abated			Kitchen	Abated	MISC					

Chicago Public Schools

School Brown School
Address 54 N. Hermitage

Unit 22351
Chicago, IL, 60612

Building ID 2400
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
024	HA 23 Floor Tile Mastic - Abated			Kitchen	Abated	MISC					
025	Tile Beneath HA23 Tiles - Abated			Kitchen	Abated	MISC					
026	HA 25 Floor Tile Mastic - Abated			Kitchen	Abated	MISC					
027	12"x12" White Floor Tile w/Black Flecks	1,600	SF	Rooms 200 & 223	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
028	12"x12" White Floor Tile w/Black Flecks Mastic	1,600	SF	Rooms 200 & 223	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
029	12"x12" Multi-Beige Floor Tile	1,800	SF	Rooms 216 and 124	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
030	12"x12" Multi-Beige Floor Tile Mastic	300	SF	Rooms 124 and 216	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
031	12"x12" White Floor Tile w/Black & Gray Streaks	900	SF	Material not observed in Room 216	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
032	12"x12" White Floor Tile w/Blk & Gray Strks Mastic			Room 216	No ACBM	MISC					
033	12"x12" Off-White Floor Tile w/Brown Specks	7,200	SF	Rooms 105, 106,109, 110, 112, 116, 120, 123 & 205	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
034	12"x12" Off-White Floor Tile w/Brn Specks - Mastic			Rooms 105, 106,109, 110, 112, 116, 120, 123 & 205	No ACBM	MISC					
035	12"x12" Tan Floor Tile	800	SF	Room 205	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
036	12"x12" Tan Floor Tile Mastic	800	SF	Room 205	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
037	12"x12" Gray Floor Tile w/White Streaks	800	SF	Room 122	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
038	12"x12" Gray Floor Tile w/White Streaks Mastic	800	SF	Room 122	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
039	12"x12" White Floor Tile w/Red & Brown Flecks	1,600	SF	Rooms 208 & 211	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
040	12"x12" White FT w/Red & Brown Flecks Mastic	1,600	SF	Rooms 208 & 211	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
041	12"x12" Off-White Floor Tile w/Brown Streaks	3,000	SF	Rooms 109, 110 & 116	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
042	12"x12" Off-White Floor Tile w/Brn Strks Mastic	3,000	SF	Rooms 109, 110 & 116	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
043	12"x12" Gray Floor Tile w/Black Flecks	1,500	SF	Room 114, 124	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
044	12"x12" Gray Floor Tile w/Black Flecks Mastic	1,500	SF	Rooms 114 and 124	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
045	Cinder Block			Throughout Building	No ACBM	MISC					
046	Cinder Block Mortar			Throughout Building	No ACBM	MISC					
047	Finished Brick Mortar			Throughout Building	No ACBM	MISC					
048	Non Skid Strips			Throughout Building Stairways	No ACBM	MISC					
049	4" Black Baseboard			Throughout the 1955 Building Corridors & Classrooms	No ACBM	MISC					
050	4" Black Baseboard Mastic			Throughout the 1955 Building Corridors & Classrooms	No ACBM	MISC					
051	Terrazzo			Throughout the 1955 Building Stairways	No ACBM	MISC					

Chicago Public Schools

School Brown School
Address 54 N. Hermitage

Unit 22351
Chicago, IL, 60612

Building ID 2400
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
052	4" Black Baseboard			Throughout the 1957 Building	No ACBM	MISC					
053	4" Black Baseboard Mastic			Throughout the 1957 Building	No ACBM	MISC					
054	Terrazzo Wall Panel			Engineer's Office	No ACBM	MISC					
055	Terrazzo Basin			Engineer's Office	No ACBM	MISC					
056	Finished Brick Mortar			Throughout Building	No ACBM	MISC					
057	Drywall			Room 209, 223, 226, 230, and 228	No ACBM	MISC					
058	Terrazzo			Throughout the 1957 Building Stairways	No ACBM	MISC					
059	Vibration Absorbers			1st Floor Fan Room	No ACBM	MISC					
060	Exterior Brick			The 1955 Building	No ACBM	MISC					
061	Exterior Brick Mortar			The 1955 Building	No ACBM	MISC					
062	Exterior Brick			The 1957 Building	No ACBM	MISC					
063	Exterior Brick Mortar			The 1957 Building	No ACBM	MISC					
064	1'x1' Replacement Ceiling Tile			Gym	No ACBM	MISC					
065	1'x1' Fissured Ceiling Tile Adhesive (Tile Removed)			Gym	Abated	MISC					
065A	9"x9" Green Floor Tile w/White Streaks Mastic	200	SF	Gym Hall	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
066	Ceramic Tile Grout	1,000	SF	Throughout the 1955 Building Washrooms, Entrances & Engineer's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
067	Dark Gray Carpet Mastic	600	SF	Office (102)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
068	Exterior Door Caulk - Non AHERA			Exterior of Building	Chrysotile	MISC					Follow O&M Plan
069	Insulation Inside of Fire Doors	100	SF	Entrances/Exits and Boiler Room	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
070	Roofing Material - Non AHERA			Exterior	Assumed	MISC					Follow O&M Plan
071	Roof Flashing - Non AHERA			Exterior	Assumed	MISC					Follow O&M Plan
072	12" x 12" Dark Aqua Floor Tile	2,000	SF	Cafeteria, Kitchen and Teacher's Lunch Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
073	12" x 12" Dark Aqua Floor Tile Mastic	2,000	SF	Cafeteria, Kitchen, & Teacher's Lunchroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
074	12" x 12" Light Aqua Floor Tile	2,000	SF	Cafeteria, Kitchen, & Teacher's Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
075	12" x 12" Light Aqua Floor Tile Mastic	2,000	SF	Cafeteria, Kitchen, & Teacher's Lunchroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Brown School
Address 54 N. Hermitage

Unit 22351
Chicago, IL, 60612

Building ID 2400
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
076	12" x 12" White Floor Tile	1,350	SF	127, 131, and MDF Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
077	12" x 12" White Floor Tile Mastic			127, 131, and MDF Room	No ACBM	MISC					
078	Blue Carpet Mastic	800	SF	226	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
079	Brown Carpet Mastic	744	SF	206	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
080	12" x 12" Dark Brown Floor Tile with White Streaks	50	SF	As Patches in Rooms 124, 130, & 202	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
081	12" x 12" Dark Brown VFT w/ White Streaks Mastic	50	SF	As Patches in Rooms 124, 130, & 202	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
082	Linoleum on Counters			205	No ACBM	MISC					Follow O&M Plan
083	Linoleum Adhesive on Counters			205	No ACBM	MISC					Follow O&M Plan
084	Gray Carpet Mastic			212	No ACBM	MISC					
085	Mastic on Wall	5	SF	205	Tremolite	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
086	12" x 12" Tan w/Red Streaks VFT	800	SF	Room 120	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
087	12" x 12" Tan w/Red Streaks VFT Mastic	800	SF	Room 120	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
088	Blue Carpet Mastic	800	SF	Rooms 225, and 226	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
089	Chalkboard/Posterboard Adhesive	4,000	SF	1955 Building (E) - Throughout All Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
090	Chalkboard/Posterboard Adhesive	1,200	SF	1957 Building West Wing - Throughout All Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
100	12" x 12" Tan Floor Tile	100	SF	Mdf Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
101	12" x 12" Tan Floor Tile Mastic	100	SF	Mdf room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18C	12" x 12" Red Floor Tile	200	SF	Room 223,225,231,212 and 206	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18D	12" x 12" Dark Red Floor Tile	200	SF	Room 223,225,231,212 and 206	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18E	Mastic Associated with HA's 18A, 18B, 18C, 18D, and 98	3,000	SF	Rooms 206,212,220,222,223,225, 226,228,230, and 231	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
91	9"x9" Blue/Tan Floor Tile	170	SF	Gymnasium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
91M	9"x(9" Blue/Tan Floor Tile Mastic	170	SF	Gymnasium	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
92	Carpet Mastic	2,500	SF	Main Office, 210, 212, 228, and Office Area 21	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
93	Black Sink Undercoat	95	SF	Room 100, 106, 110, 112, 114, 116, 120, 122, 124, 126, 128, 130, 131, 127, 109, 125, 123, 200, 216	Assumed	SURFACE	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
94	Drywall Joint Compound	200	LF	Rooms 223, 226, 230, 228	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
95	Drywall	900	SF	Rooms 223, 226, 230, 228	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Brown School
Address 54 N. Hermitage

Unit 22351
Chicago, IL, 60612

Building ID 2400
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
96	2' X 4' Ceiling Tile Pinhole and Fissure	1,800	SF	Lunchroom	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
97	2' X 4' Ceiling Tile Pinhole	2,000	SF	1957 addition hallway. Rooms 223, 224, 225, 226, 227, 228, 229, 230, 231	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
98	12" x 12" White Floor Tile	2,800	SF	Rooms 206,212,220,222,223,225, 226,228,230, and 231	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
A	Boiler Insulation			Boiler Room - Removed in 1996	Abated	TSI					
B	Tank Insulation			Boiler Room - Removed in 1996	Abated	TSI					
C	Transite Hanger Insulation	29	LF	Tunnel	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
D	Univent Breeching			Store Room - Not Present	Abated	MISC					
E	Aircell Pipe Insulation	1,000	LF	Throughout Basement, Crawl Space & Tunnel	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
F	Hard Joint Compound off Aircell Pipe Insulation	300	LF	Throughout Basement, Crawl Space & Tunnel	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
G	Paperwrap Pipe Insulation	1,880	LF	Rooms 116, 124, basement elevator lobby, west storage room, and boiler room at south exit	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
H	Hard Joint Compound off Paperwrap Pipe Insulation	5	LF	Rooms 104, 106, 116, 120, 124, and Basement elevator lobby	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
I	Mag Block Insulation			Boiler room - removed in 1996	Abated	TSI					
J	Mag Block Elbows			Boiler room - removed in 1996	Abated	MISC					
K	Vault Door Insulation	20	SF	Main Office room 102	Assumed	TSI	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
L	Tank Insulation			Boiler room	No ACBM	TSI					
M	Tank Insulation Wrap			Boiler Room	No ACBM	TSI					
N	Fiberglass Pipe Insulation Wrap			Boiler Room	No ACBM	TSI					
O	Hard Joint Elbow	5	LF	Kitchen Mgr. Office	Assumed	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

Chicago Public Schools

School Brown School
Address 54 N. Hermitage

Unit 22351
 Chicago, IL, 60612

Building ID 2400
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	05/29/2019
Manager Planner Name	Evan Christian
100-19466	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
001	
002	
003	
004	
005A	
005B	
006	
007	
008	
009	

Chicago Public Schools

School Brown School
Address 54 N. Hermitage

Unit 22351
Chicago, IL, 60612

Building ID 2400
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
010	
011	
012	
013	
014	
015	
016	
017	
018	
018A	
018B	
019	
020	
021	
022	
023	
024	
025	
026	
027	
028	
029	
030	
031	
032	
033	

Chicago Public Schools

School Brown School
Address 54 N. Hermitage

Unit 22351
Chicago, IL, 60612

Building ID 2400
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
034	
035	
036	
037	
038	
039	
040	
041	
042	
043	
044	
045	
046	
047	
048	
049	
050	
051	
052	
053	
054	
055	
056	
057	
058	
059	

Chicago Public Schools

School Brown School
Address 54 N. Hermitage

Unit 22351
 Chicago, IL, 60612

Building ID 2400
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
060	
061	
062	
063	
064	
065	
065A	
066	
067	
068	
069	
070	
071	
072	
073	
074	
075	
076	
077	
078	
079	
080	
081	
082	
083	
084	

Chicago Public Schools

School Brown School
Address 54 N. Hermitage

Unit 22351
 Chicago, IL, 60612

Building ID 2400
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
085	
086	
087	
088	
089	
090	
100	
101	
18C	
18D	
18E	
91	
91M	
92	
93	
94	
95	
96	
97	
98	
A	
B	
C	
D	
E	
F	

Chicago Public Schools

School Brown School
Address 54 N. Hermitage

Unit 22351
Chicago, IL, 60612

Building ID 2400
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
G	
H	
I	
J	
K	
L	
M	
N	
O	

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **001**
MATERIAL DESCRIPTION: **Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout the 1955 building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **001**

MATERIAL DESCRIPTION: **Plaster**

MATERIAL LOCATION: **Throughout the 1955 building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **002**
MATERIAL DESCRIPTION: **1'x1' Random Dot Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **002**
MATERIAL DESCRIPTION: **1'x1' Random Dot Ceiling Tile**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **003**
MATERIAL DESCRIPTION: **1'x1' Fissured Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **003**

MATERIAL DESCRIPTION: **1'x1' Fissured Ceiling Tile**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **004**
MATERIAL DESCRIPTION: **Ceiling Tile (1' x 1')**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **004**
MATERIAL DESCRIPTION: **Ceiling Tile (1' x 1')**
MATERIAL LOCATION: **Kitchen**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005A**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Corridors**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **005A**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile**
MATERIAL LOCATION: **1st Floor Corridors**
MATERIAL QUANTITY: **4500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **005B**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Corridors**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **005B**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile**
MATERIAL LOCATION: **1st Floor Corridors**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **006**
MATERIAL DESCRIPTION: **12"x12" Red VFT**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **No longer present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **006**
MATERIAL DESCRIPTION: **12"x12" Red VFT**
MATERIAL LOCATION: **No longer present**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **007**
MATERIAL DESCRIPTION: **9"x9" Green Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym Hall**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **007**
MATERIAL DESCRIPTION: **9"x9" Green Floor Tile**
MATERIAL LOCATION: **Gym Hall**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **008**
MATERIAL DESCRIPTION: **12"x12" Blue Floor Tile w/ White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **100, 108, & 222**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **008**
MATERIAL DESCRIPTION: **12"x12" Blue Floor Tile w/ White Streaks**
MATERIAL LOCATION: **100, 108, & 222**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **009**
MATERIAL DESCRIPTION: **12"x12" Tan VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 209, 210, 220, 105 and 1st Floor Corridor**
MATERIAL QUANTITY: **9800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **009**
MATERIAL DESCRIPTION: **12"x12" Tan VFT**
MATERIAL LOCATION: **Rooms 209, 210, 220, 105 and 1st Floor Corridor**
MATERIAL QUANTITY: **9800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **010**
MATERIAL DESCRIPTION: **9"x9" Black Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Repair**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Physical Damage
Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Custodial Closet on First Floor**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **100** DAMAGE UNITS: **SF**
COMMENTS: **Damage in custodial closet on 1st and 2nd floor**

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **010**
MATERIAL DESCRIPTION: **9"x9" Black Floor Tile**
MATERIAL LOCATION: **Custodial Closet on First Floor**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **100** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Repair

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **011**
MATERIAL DESCRIPTION: **Tan Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Rooms 103 - No room 103 (in 2013)**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed**

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **011**

MATERIAL DESCRIPTION: **Tan Linoleum**

MATERIAL LOCATION: **Rooms 103 - No room 103 (in 2013)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **012**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Green Flecks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 205, 211, 231, 225, 226, 227, 228, 230 & 231**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **012**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Green Flecks**
MATERIAL LOCATION: **Rooms 205, 211, 231, 225, 226, 227, 228, 230 & 231**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **013**
MATERIAL DESCRIPTION: **12"x12" White VFT w/Red & Black Flecks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 104, 125, 126, 128, 130, 202, 206, 214, 216, 224**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Not observed in Room 206**

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **013**
MATERIAL DESCRIPTION: **12"x12" White VFT w/Red & Black Flecks**
MATERIAL LOCATION: **Rooms 104, 125, 126, 128, 130, 202, 206, 214, 216, 224**
MATERIAL QUANTITY: **5000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **014**
MATERIAL DESCRIPTION: **9"x9" Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Corridors**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **014**
MATERIAL DESCRIPTION: **9"x9" Tan Floor Tile**
MATERIAL LOCATION: **2nd Floor Corridors**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **015**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen, Cafeteria & 1st Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed**

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **015**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile Mastic**
MATERIAL LOCATION: **Kitchen, Cafeteria & 1st Floor Corridors**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **016**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen & Cafeteria**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not observed**

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **016**

MATERIAL DESCRIPTION: **12"x12" White Floor Tile Mastic**

MATERIAL LOCATION: **Kitchen & Cafeteria**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **017**
MATERIAL DESCRIPTION: **12"x12" Blue Floor Tile w/ White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 100, 108 and 222**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **017**
MATERIAL DESCRIPTION: **12"x12" Blue Floor Tile w/ White Streaks Mastic**
MATERIAL LOCATION: **Rooms 100, 108 and 222**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **018**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 209, 210, 220, 105, 203 & 1st Floor Corridor**
MATERIAL QUANTITY: **9800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **018**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 209, 210, 220, 105, 203 & 1st Floor Corridor**
MATERIAL QUANTITY: **9800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **019**
MATERIAL DESCRIPTION: **9"x9" Black Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Custodial Closet on 1st Floor**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **019**
MATERIAL DESCRIPTION: **9"x9" Black Floor Tile Mastic**
MATERIAL LOCATION: **Custodial Closet on 1st Floor**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **020**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Green Flecks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 205, 211, 231, 225, 226, 227, 228, 230 & 231**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **020**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Green Flecks Mastic**
MATERIAL LOCATION: **Rooms 205, 211, 231, 225, 226, 227, 228, 230 & 231**
MATERIAL QUANTITY: **4200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **021**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Red &Blk Flecks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 104, 125,126, 128, 130, 202, 206, 214, 216, & 224**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **021**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Red &Blk Flecks Mastic**
MATERIAL LOCATION: **Rooms 104, 125,126, 128, 130, 202, 206, 214, 216, & 224**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **022**
MATERIAL DESCRIPTION: **9"x9" Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Corridors**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **022**
MATERIAL DESCRIPTION: **9"x9" Tan Floor Tile Mastic**
MATERIAL LOCATION: **2nd Floor Corridors**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **023**
MATERIAL DESCRIPTION: **Floor Tile Beneath 12"x12" Floor Tile - Abated**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **023**

MATERIAL DESCRIPTION: **Floor Tile Beneath 12"x12" Floor Tile - Abated**

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **024**
MATERIAL DESCRIPTION: **HA 23 Floor Tile Mastic - Abated**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **024**

MATERIAL DESCRIPTION: **HA 23 Floor Tile Mastic - Abated**

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **025**
MATERIAL DESCRIPTION: **Tile Beneath HA23 Tiles - Abated**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **025**

MATERIAL DESCRIPTION: **Tile Beneath HA23 Tiles - Abated**

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **026**
MATERIAL DESCRIPTION: **HA 25 Floor Tile Mastic - Abated**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **026**

MATERIAL DESCRIPTION: **HA 25 Floor Tile Mastic - Abated**

MATERIAL LOCATION: **Kitchen**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **027**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Black Flecks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 200 & 223**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **027**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Black Flecks**
MATERIAL LOCATION: **Rooms 200 & 223**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **028**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Black Flecks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 200 & 223**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **028**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Black Flecks Mastic**
MATERIAL LOCATION: **Rooms 200 & 223**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **029**
MATERIAL DESCRIPTION: **12"x12" Multi-Beige Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 216 and 124**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **029**
MATERIAL DESCRIPTION: **12"x12" Multi-Beige Floor Tile**
MATERIAL LOCATION: **Rooms 216 and 124**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **030**
MATERIAL DESCRIPTION: **12"x12" Multi-Beige Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 124 and 216**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **030**
MATERIAL DESCRIPTION: **12"x12" Multi-Beige Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 124 and 216**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **031**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Black & Gray Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Material not observed in Room 216**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **031**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Black & Gray Streaks**
MATERIAL LOCATION: **Material not observed in Room 216**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **032**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Blk & Gray Strks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 216**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **032**

MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Blk & Gray Strks Mastic**

MATERIAL LOCATION: **Room 216**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **033**
MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Brown Specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 105, 106,109, 110, 112, 116, 120, 123 & 205**
MATERIAL QUANTITY: **7200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **033**
MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Brown Specks**
MATERIAL LOCATION: **Rooms 105, 106,109, 110, 112, 116, 120, 123 & 205**
MATERIAL QUANTITY: **7200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **034**
MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Brn Specks - Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Rooms 105, 106,109, 110, 112, 116, 120, 123 & 205**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **034**

MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Brn Specks - Mastic**

MATERIAL LOCATION: **Rooms 105, 106,109, 110, 112, 116, 120, 123 & 205**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **035**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 205**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **035**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile**
MATERIAL LOCATION: **Room 205**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **036**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 205**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **036**
MATERIAL DESCRIPTION: **12"x12" Tan Floor Tile Mastic**
MATERIAL LOCATION: **Room 205**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **037**
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile w/White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 122**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **037**
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile w/White Streaks**
MATERIAL LOCATION: **Room 122**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **038**
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile w/White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 122**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **038**
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile w/White Streaks Mastic**
MATERIAL LOCATION: **Room 122**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **039**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Red & Brown Flecks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 208 & 211**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **039**
MATERIAL DESCRIPTION: **12"x12" White Floor Tile w/Red & Brown Flecks**
MATERIAL LOCATION: **Rooms 208 & 211**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **040**
MATERIAL DESCRIPTION: **12"x12" White FT w/Red & Brown Flecks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 208 & 211**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **040**
MATERIAL DESCRIPTION: **12"x12" White FT w/Red & Brown Flecks Mastic**
MATERIAL LOCATION: **Rooms 208 & 211**
MATERIAL QUANTITY: **1600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **041**
MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Brown Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 109, 110 & 116**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **041**
MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Brown Streaks**
MATERIAL LOCATION: **Rooms 109, 110 & 116**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **042**
MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Brn Strks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 109, 110 & 116**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **042**
MATERIAL DESCRIPTION: **12"x12" Off-White Floor Tile w/Brn Strks Mastic**
MATERIAL LOCATION: **Rooms 109, 110 & 116**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **043**
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile w/Black Flecks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 114, 124**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **043**
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile w/Black Flecks**
MATERIAL LOCATION: **Room 114, 124**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **044**
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile w/Black Flecks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 114 and 124**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **044**
MATERIAL DESCRIPTION: **12"x12" Gray Floor Tile w/Black Flecks Mastic**
MATERIAL LOCATION: **Rooms 114 and 124**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **045**
MATERIAL DESCRIPTION: **Cinder Block**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **045**

MATERIAL DESCRIPTION: **Cinder Block**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **046**
MATERIAL DESCRIPTION: **Cinder Block Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **046**
MATERIAL DESCRIPTION: **Cinder Block Mortar**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **047**
MATERIAL DESCRIPTION: **Finished Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **047**

MATERIAL DESCRIPTION: **Finished Brick Mortar**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **048**
MATERIAL DESCRIPTION: **Non Skid Strips**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building Stairways**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **048**
MATERIAL DESCRIPTION: **Non Skid Strips**
MATERIAL LOCATION: **Throughout Building Stairways**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **049**
MATERIAL DESCRIPTION: **4" Black Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout the 1955 Building Corridors & Classrooms**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **049**
MATERIAL DESCRIPTION: **4" Black Baseboard**
MATERIAL LOCATION: **Throughout the 1955 Building Corridors & Classrooms**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **050**
MATERIAL DESCRIPTION: **4" Black Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout the 1955 Building Corridors & Classrooms**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **050**
MATERIAL DESCRIPTION: **4" Black Baseboard Mastic**
MATERIAL LOCATION: **Throughout the 1955 Building Corridors & Classrooms**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **051**
MATERIAL DESCRIPTION: **Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout the 1955 Building Stairways**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **051**

MATERIAL DESCRIPTION: **Terrazzo**

MATERIAL LOCATION: **Throughout the 1955 Building Stairways**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **052**
MATERIAL DESCRIPTION: **4" Black Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout the 1957 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **052**

MATERIAL DESCRIPTION: **4" Black Baseboard**

MATERIAL LOCATION: **Throughout the 1957 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **053**
MATERIAL DESCRIPTION: **4" Black Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout the 1957 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **053**

MATERIAL DESCRIPTION: **4" Black Baseboard Mastic**

MATERIAL LOCATION: **Throughout the 1957 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **054**
MATERIAL DESCRIPTION: **Terrazzo Wall Panel**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **054**

MATERIAL DESCRIPTION: **Terrazzo Wall Panel**

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **055**
MATERIAL DESCRIPTION: **Terrazzo Basin**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **055**

MATERIAL DESCRIPTION: **Terrazzo Basin**

MATERIAL LOCATION: **Engineer's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **056**
MATERIAL DESCRIPTION: **Finished Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **056**
MATERIAL DESCRIPTION: **Finished Brick Mortar**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **057**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 209, 223, 226, 230, and 228**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **057**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Room 209, 223, 226, 230, and 228**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **058**
MATERIAL DESCRIPTION: **Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout the 1957 Building Stairways**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **058**
MATERIAL DESCRIPTION: **Terrazzo**
MATERIAL LOCATION: **Throughout the 1957 Building Stairways**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **059**
MATERIAL DESCRIPTION: **Vibration Absorbers**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Fan Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **059**

MATERIAL DESCRIPTION: **Vibration Absorbers**

MATERIAL LOCATION: **1st Floor Fan Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **060**
MATERIAL DESCRIPTION: **Exterior Brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **The 1955 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **060**

MATERIAL DESCRIPTION: **Exterior Brick**

MATERIAL LOCATION: **The 1955 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **061**
MATERIAL DESCRIPTION: **Exterior Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **The 1955 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **061**

MATERIAL DESCRIPTION: **Exterior Brick Mortar**

MATERIAL LOCATION: **The 1955 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **062**
MATERIAL DESCRIPTION: **Exterior Brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **The 1957 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **062**

MATERIAL DESCRIPTION: **Exterior Brick**

MATERIAL LOCATION: **The 1957 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **063**
MATERIAL DESCRIPTION: **Exterior Brick Mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **The 1957 Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **063**

MATERIAL DESCRIPTION: **Exterior Brick Mortar**

MATERIAL LOCATION: **The 1957 Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **064**
MATERIAL DESCRIPTION: **1'x1' Replacement Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **064**

MATERIAL DESCRIPTION: **1'x1' Replacement Ceiling Tile**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **065**
MATERIAL DESCRIPTION: **1'x1' Fissured Ceiling Tile Adhesive (Tile Removed)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **065**

MATERIAL DESCRIPTION: **1'x1' Fissured Ceiling Tile Adhesive (Tile Removed)**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **065A**
MATERIAL DESCRIPTION: **9"x9" Green Floor Tile w/White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym Hall**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **065A**

MATERIAL DESCRIPTION: **9"x9" Green Floor Tile w/White Streaks Mastic**

MATERIAL LOCATION: **Gym Hall**

MATERIAL QUANTITY: **200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **066**
MATERIAL DESCRIPTION: **Ceramic Tile Grout**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout the 1955 Building Washrooms, Entrances & Engineer's Office**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **066**
MATERIAL DESCRIPTION: **Ceramic Tile Grout**
MATERIAL LOCATION: **Throughout the 1955 Building Washrooms, Entrances & Engineer's Office**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **067**
MATERIAL DESCRIPTION: **Dark Gray Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Office (102)**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **067**
MATERIAL DESCRIPTION: **Dark Gray Carpet Mastic**
MATERIAL LOCATION: **Office (102)**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **068**
MATERIAL DESCRIPTION: **Exterior Door Caulk - Non AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **068**

MATERIAL DESCRIPTION: **Exterior Door Caulk - Non AHERA**

MATERIAL LOCATION: **Exterior of Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **069**
MATERIAL DESCRIPTION: **Insulation Inside of Fire Doors**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Entrances/Exits and Boiler Room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **069**
MATERIAL DESCRIPTION: **Insulation Inside of Fire Doors**
MATERIAL LOCATION: **Entrances/Exits and Boiler Room**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **070**
MATERIAL DESCRIPTION: **Roofing Material - Non AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **070**

MATERIAL DESCRIPTION: **Roofing Material - Non AHERA**

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **071**
MATERIAL DESCRIPTION: **Roof Flashing - Non AHERA**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **071**

MATERIAL DESCRIPTION: **Roof Flashing - Non AHERA**

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **072**
MATERIAL DESCRIPTION: **12" x 12" Dark Aqua Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Cafeteria, Kitchen and Teacher's Lunch Room**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **072**
MATERIAL DESCRIPTION: **12" x 12" Dark Aqua Floor Tile**
MATERIAL LOCATION: **Cafeteria, Kitchen and Teacher's Lunch Room**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **073**
MATERIAL DESCRIPTION: **12" x 12" Dark Aqua Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Cafeteria, Kitchen, & Teacher's Lunchroom**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **073**
MATERIAL DESCRIPTION: **12" x 12" Dark Aqua Floor Tile Mastic**
MATERIAL LOCATION: **Cafeteria, Kitchen, & Teacher's Lunchroom**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **074**
MATERIAL DESCRIPTION: **12" x 12" Light Aqua Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Cafeteria, Kitchen, & Teacher's Lunchroom**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **074**
MATERIAL DESCRIPTION: **12" x 12" Light Aqua Floor Tile**
MATERIAL LOCATION: **Cafeteria, Kitchen, & Teacher's Lunchroom**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **075**
MATERIAL DESCRIPTION: **12" x 12" Light Aqua Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Cafeteria, Kitchen, & Teacher's Lunchroom**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **075**
MATERIAL DESCRIPTION: **12" x 12" Light Aqua Floor Tile Mastic**
MATERIAL LOCATION: **Cafeteria, Kitchen, & Teacher's Lunchroom**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **076**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **127, 131, and MDF Room**
MATERIAL QUANTITY: **1350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **Not observed**

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **076**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**
MATERIAL LOCATION: **127, 131, and MDF Room**
MATERIAL QUANTITY: **1350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **077**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **127, 131, and MDF Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **077**

MATERIAL DESCRIPTION: **12" x 12" White Floor Tile Mastic**

MATERIAL LOCATION: **127, 131, and MDF Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **078**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **226**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Not observed**

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **078**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
MATERIAL LOCATION: **226**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **079**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **206**
MATERIAL QUANTITY: **744** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Not observed**

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **079**
MATERIAL DESCRIPTION: **Brown Carpet Mastic**
MATERIAL LOCATION: **206**
MATERIAL QUANTITY: **744** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **080**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown Floor Tile with White Streaks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **As Patches in Rooms 124, 130, & 202**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **Rubber material in room 130**

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **080**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown Floor Tile with White Streaks**
MATERIAL LOCATION: **As Patches in Rooms 124, 130, & 202**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **081**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown VFT w/ White Streaks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **As Patches in Rooms 124, 130, & 202**

MATERIAL QUANTITY: **50**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____

Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **081**
MATERIAL DESCRIPTION: **12" x 12" Dark Brown VFT w/ White Streaks Mastic**
MATERIAL LOCATION: **As Patches in Rooms 124, 130, & 202**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **082**
MATERIAL DESCRIPTION: **Linoleum on Counters**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **205**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **082**

MATERIAL DESCRIPTION: **Linoleum on Counters**

MATERIAL LOCATION: **205**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **083**
MATERIAL DESCRIPTION: **Linoleum Adhesive on Counters**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **205**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **083**

MATERIAL DESCRIPTION: **Linoleum Adhesive on Counters**

MATERIAL LOCATION: **205**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **084**
MATERIAL DESCRIPTION: **Gray Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **212**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **084**

MATERIAL DESCRIPTION: **Gray Carpet Mastic**

MATERIAL LOCATION: **212**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **085**
MATERIAL DESCRIPTION: **Mastic on Wall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Tremolite** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **205**
MATERIAL QUANTITY: **5** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Not observed**

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **085**
MATERIAL DESCRIPTION: **Mastic on Wall**
MATERIAL LOCATION: **205**
MATERIAL QUANTITY: **5** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **086**
MATERIAL DESCRIPTION: **12" x 12" Tan w/Red Streaks VFT**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 120**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **086**
MATERIAL DESCRIPTION: **12" x 12" Tan w/Red Streaks VFT**
MATERIAL LOCATION: **Room 120**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **087**
MATERIAL DESCRIPTION: **12" x 12" Tan w/Red Streaks VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 120**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **087**
MATERIAL DESCRIPTION: **12" x 12" Tan w/Red Streaks VFT Mastic**
MATERIAL LOCATION: **Room 120**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **088**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 225, and 226**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **088**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
MATERIAL LOCATION: **Rooms 225, and 226**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **089**
MATERIAL DESCRIPTION: **Chalkboard/Posterboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1955 Building (E) - Throughout All Classrooms**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **089**
MATERIAL DESCRIPTION: **Chalkboard/Posterboard Adhesive**
MATERIAL LOCATION: **1955 Building (E) - Throughout All Classrooms**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **090**
MATERIAL DESCRIPTION: **Chalkboard/Posterboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1957 Building West Wing - Throughout All Classrooms**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **090**
MATERIAL DESCRIPTION: **Chalkboard/Posterboard Adhesive**
MATERIAL LOCATION: **1957 Building West Wing - Throughout All Classrooms**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **91**
MATERIAL DESCRIPTION: **9"x9" Blue/Tan Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gymnasium**
MATERIAL QUANTITY: **170** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **91**
MATERIAL DESCRIPTION: **9"x9" Blue/Tan Floor Tile**
MATERIAL LOCATION: **Gymnasium**
MATERIAL QUANTITY: **170** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **91M**
MATERIAL DESCRIPTION: **9"x9" Blue/Tan Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gymnasium**
MATERIAL QUANTITY: **170** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **91M**
MATERIAL DESCRIPTION: **9"x(9" Blue/Tan Floor Tile Mastic**
MATERIAL LOCATION: **Gymnasium**
MATERIAL QUANTITY: **170** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **92**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office, 210, 212, 228, and Office Area 21**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **92**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Main Office, 210, 212, 228, and Office Area 21**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **93**
MATERIAL DESCRIPTION: **Black Sink Undercoat**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 100, 106, 110, 112, 114, 116, 120, 122, 124, 126, 128, 130, 131, 127, 109, 125, 123, 200, 216**

MATERIAL QUANTITY: **95** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **93**
MATERIAL DESCRIPTION: **Black Sink Undercoat**
MATERIAL LOCATION: **Room 100, 106, 110, 112, 114, 116, 120, 122, 124, 126, 128, 130, 131, 127, 109, 125, 123, 200, 216**
MATERIAL QUANTITY: **95** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **94**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 223, 226, 230, 228**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **94**
MATERIAL DESCRIPTION: **Drywall Joint Compound**
MATERIAL LOCATION: **Rooms 223, 226, 230, 228**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **95**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 223, 226, 230, 228**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **95**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Rooms 223, 226, 230, 228**
MATERIAL QUANTITY: **900** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **96**
MATERIAL DESCRIPTION: **2' X 4' Ceiling Tile Pinhole and Fissure**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **96**
MATERIAL DESCRIPTION: **2' X 4' Ceiling Tile Pinhole and Fissure**
MATERIAL LOCATION: **Lunchroom**
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **97**
MATERIAL DESCRIPTION: **2' X 4' Ceiling Tile Pinhole**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1957 addition hallway. Rooms 223, 224, 225, 226, 227, 228, 229, 230, 231**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **97**
MATERIAL DESCRIPTION: **2' X 4' Ceiling Tile Pinhole**
MATERIAL LOCATION: **1957 addition hallway. Rooms 223, 224, 225, 226, 227, 228, 229, 230, 231**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **A**
MATERIAL DESCRIPTION: **Boiler Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room - Removed in 1996**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **A**

MATERIAL DESCRIPTION: **Boiler Insulation**

MATERIAL LOCATION: **Boiler Room - Removed in 1996**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **B**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room - Removed in 1996**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **B**

MATERIAL DESCRIPTION: **Tank Insulation**

MATERIAL LOCATION: **Boiler Room - Removed in 1996**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Transite Hanger Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Tunnel**
MATERIAL QUANTITY: **29** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **C**

MATERIAL DESCRIPTION: **Transite Hanger Insulation**

MATERIAL LOCATION: **Tunnel**

MATERIAL QUANTITY: **29**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Univent Breaching**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Store Room - Not Present**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **Univent Breeching**

MATERIAL LOCATION: **Store Room - Not Present**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Basement, Crawl Space & Tunnel**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **E**
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**
MATERIAL LOCATION: **Throughout Basement, Crawl Space & Tunnel**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Hard Joint Compound off Aircell Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Basement, Crawl Space & Tunnel**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Hard Joint Compound off Aircell Pipe Insulation**
MATERIAL LOCATION: **Throughout Basement, Crawl Space & Tunnel**
MATERIAL QUANTITY: **300** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Paperwrap Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 116, 124, basement elevator lobby, west storage room, and boiler room at south exit**
MATERIAL QUANTITY: **1880** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**
COMMENTS: **Not observed in Room 116 and 124**

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Paperwrap Pipe Insulation**
MATERIAL LOCATION: **Rooms 116, 124, basement elevator lobby, west storage room, and boiler room at south exit**
MATERIAL QUANTITY: **1880** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Hard Joint Compound off Paperwrap Pipe Insulation**
HISTORICAL AHERA DAMAGE CATEGORY: **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 104, 106, 116, 120, 124, and Basement elevator lobby**
MATERIAL QUANTITY: **5** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS: **Not observed in Room 104, 106, 116, 120, and 124**

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **H**
MATERIAL DESCRIPTION: **Hard Joint Compound off Paperwrap Pipe Insulation**
MATERIAL LOCATION: **Rooms 104, 106, 116, 120, 124, and Basement elevator lobby**
MATERIAL QUANTITY: **5** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**
MATERIAL DESCRIPTION: **Mag Block Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room - removed in 1996**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **I**

MATERIAL DESCRIPTION: **Mag Block Insulation**

MATERIAL LOCATION: **Boiler room - removed in 1996**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **J**
MATERIAL DESCRIPTION: **Mag Block Elbows**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room - removed in 1996**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **J**

MATERIAL DESCRIPTION: **Mag Block Elbows**

MATERIAL LOCATION: **Boiler room - removed in 1996**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Vault Door Insulation**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office room 102**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No entry**

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **K**
MATERIAL DESCRIPTION: **Vault Door Insulation**
MATERIAL LOCATION: **Main Office room 102**
MATERIAL QUANTITY: **20** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**
MATERIAL DESCRIPTION: **Tank Insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **L**

MATERIAL DESCRIPTION: **Tank Insulation**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**
MATERIAL DESCRIPTION: **Tank Insulation Wrap**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **M**

MATERIAL DESCRIPTION: **Tank Insulation Wrap**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**
MATERIAL DESCRIPTION: **Fiberglass Pipe Insulation Wrap**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **N**

MATERIAL DESCRIPTION: **Fiberglass Pipe Insulation Wrap**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**
MATERIAL DESCRIPTION: **Hard Joint Elbow**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Kitchen Mgr. Office**
MATERIAL QUANTITY: **5** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**
COMMENTS: **Not observed**

Inspector's Signature: _____ Date: 05/02/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **0**

MATERIAL DESCRIPTION: **Hard Joint Elbow**

MATERIAL LOCATION: **Kitchen Mgr. Office**

MATERIAL QUANTITY: **5**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **018B**
MATERIAL DESCRIPTION: **12" x 12" Light Blue Floor Tile**
MATERIAL LOCATION: **Classrooms 220,222,226,228 and 230**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **018B**

MATERIAL DESCRIPTION: **12" x 12" Light Blue Floor Tile**

MATERIAL LOCATION: **Classrooms 220,222,226,228 and 230**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **18D**
MATERIAL DESCRIPTION: **12" x 12" Dark Red Floor Tile**
MATERIAL LOCATION: **Room 223,225,231,212 and 206**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **18D**

MATERIAL DESCRIPTION: **12" x 12" Dark Red Floor Tile**

MATERIAL LOCATION: **Room 223,225,231,212 and 206**

MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **98**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**
MATERIAL LOCATION: **Rooms 206,212,220,222,223,225, 226,228,230, and 231**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **98**
MATERIAL DESCRIPTION: **12" x 12" White Floor Tile**
MATERIAL LOCATION: **Rooms 206,212,220,222,223,225, 226,228,230, and 231**
MATERIAL QUANTITY: **2800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **101**

MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile Mastic**

MATERIAL LOCATION: **Mdf room**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUIDLING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **18E**
MATERIAL DESCRIPTION: **Mastic Associated with HA's 18A, 18B, 18C, 18D, and 98**
MATERIAL LOCATION: **Rooms 206,212,220,222,223,225, 226,228,230, and 231**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **18E**

MATERIAL DESCRIPTION: **Mastic Associated with HA's 18A, 18B, 18C, 18D, and 98**

MATERIAL LOCATION: **Rooms 206,212,220,222,223,225, 226,228,230, and 231**

MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **18C**
MATERIAL DESCRIPTION: **12" x 12" Red Floor Tile**
MATERIAL LOCATION: **Room 223,225,231,212 and 206**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **18C**
MATERIAL DESCRIPTION: **12" x 12" Red Floor Tile**
MATERIAL LOCATION: **Room 223,225,231,212 and 206**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Ciniata Hester**
SCHOOL NAME: **Brown School** INSPECTION DATE: **5/2/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **018A**
MATERIAL DESCRIPTION: **12" x 12" Cobalt Blue Floor Tile**
MATERIAL LOCATION: **Classrooms 220, 222, 226, 228, and 230**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **LOW** CONDITION:
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
ACCESSIBILITY: **Within Reach** DAMAGE REASON:
DAMAGE QUANTITY: **0** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **05/02/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **018A**
MATERIAL DESCRIPTION: **12" x 12" Cobalt Blue Floor Tile**
MATERIAL LOCATION: **Classrooms 220, 222, 226, 228, and 230**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **05/29/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **22351** BUILDING ID: **2400**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Brown School** REVIEW DATE: **5/29/2019**
ADDRESS: **54 N. Hermitage** IDPH LICENSE NO: **100-08696**

HOMOGENEOUS AREA: **100**

MATERIAL DESCRIPTION: **12" x 12" Tan Floor Tile**

MATERIAL LOCATION: **Mdf Room**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **05/29/2019**

APPENDIX B

Inspector and Management Planner Licenses

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Building Inspector Initial

Occupational Training & Supply, Inc. certifies that

Ciniata Hester


has successfully completed the Asbestos Building Inspector Initial course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/22/2019 - 1/24/2019

Exam Date: 1/24/2019

Expiration Date: 1/24/2020

Certificate Number: ABI1901240284

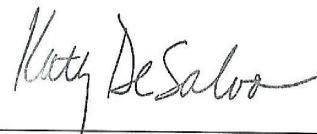

Kathy DeSalvo, Director



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

CINIATA R HESTER
10651 S. SANGAMON ST
CHICAGO, IL 60643

3/5/2019


ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 08696

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ID NUMBER		ISSUED	EXPIRES	ENDORSEMENTS	TC EXPIRES
100 - 08696		3/5/2019	05/15/2020	INSPECTOR	1/24/2020
CINIATA R HESTER 10651 S. SANGAMON ST CHICAGO, IL 60643 Environmental Health				PROJECT MANAGER AIR SAMPLING PROFESSIONAL	8/25/2018
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.					

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024159


Katy DeSalvo, Director

Reliable
Environmental
Solutions, Inc. **RES**

This is to certify that **Evan Christian**

*has on January 28 & 29, 2016, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Initial Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: January 28 & 29, 2016

Examination Date: January 29, 2016

Expiration Date: January 29, 2017

Certificate Number: MP/0103

William S. Williams

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ www.ReliableEnv.com

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/19/2019

Exam Date: 11/19/2019

Expiration Date: 11/19/2020

Certificate Number: BIR1911192384


Kathy DeSalvo, Director



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 19466

ISSUED
4/12/2019

EXPIRES
05/15/2020

EVAN I CHRISTIAN
3024 N RACINE AVE, APT 2
CHICAGO, IL 60657



Environmental Health

ENDORSEMENTS

TC EXPIRES

INSPECTOR

11/28/2019

MANAGEMENT PLANNER

1/5/2019

PROJECT MANAGER

2/5/2020

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 1/7/2019

Exam Date: 1/7/2019


Expiration Date: 1/7/2020

Certificate Number: MPR1901070063


Kathy DeSalvo, Director

Evan Christian

Illinois Licensed Project Manager, and Air Sampling Professional

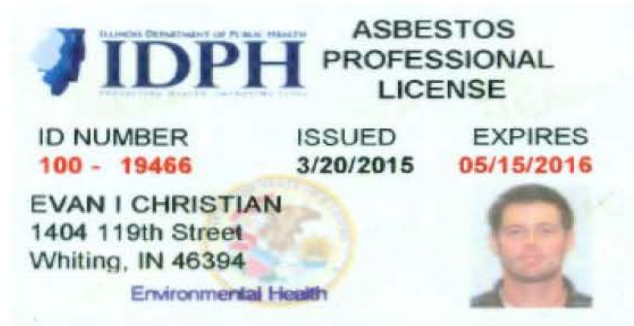

ENDORSEMENTS	TC EXPIRES
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	12/12/2015
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed