

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH  
AHERA THREE YEAR REINSPECTION  
ASBESTOS ABATEMENT PROGRAM  
SCHOOL INFORMATION FORM**

**SECTION I**

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299  
SCHOOL ID NUMBER: 14-016-2990-2293  
SCHOOL NAME: Kellogg School  
ADDRESS OF SCHOOL: 9241 S Leavitt  
CITY: Chicago, IL, 60620

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/23/2016**

**If the address on this form is different than the address of the building, submit a written explanation.**

---

**SECTION II** (Please type or print)

**PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:**

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 272  
IDPH INSPECTOR LICENSE NUMBER: 100-19717  
IDPH LICENSED INSPECTOR NAME(Please Print): Shaquille Crews  
IDPH MP LICENSE NUMBER: 100-09870  
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Todd Huffer

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

*Signature of Designated Person*

*Date*

**SECTION III**

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: \_\_\_\_\_

School has been closed. Date closed: \_\_\_\_\_

School building has been demolished. Date: \_\_\_\_\_

School building is asbestos free since last reinspection: \_\_\_\_\_

**Please explain in writing why the school building is now asbestos free and include the supporting documentation.**

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

**Explain in writing if the address of the building is different than the address on this form:**

**THREE-YEAR REINSPECTION**

**CHICAGO SCHOOL DIST 299**

**Kellogg School**

9241 S Leavitt  
Chicago, IL, 60620

Unit: 23971  
Building ID: 4240

IDPH ID Number: 14-016-2990-2293

**REPORT DATE:**

Tuesday, October 01, 2019

**Prepared for:**

**Chicago Public Schools  
42 West Madison Street  
Chicago, IL 60602**

**Prepared by:**

**TEM Environmental, Inc.**

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL  
REQUIRED BY FEDERAL LAW**

August 7, 2019

Mr. Glen E. Garner  
Asbestos Program  
Illinois Department of Public Health  
525 West Jefferson Street  
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299              Unit: 23971                      Region: 06                      IDPH ID:14-016-2990-2293

School: Kellogg School    Building ID: 4240

Address: 9241 S Leavitt

Chicago, IL, 60620

Building Contact: Cottonaro, Matthew

Contact Phone:773 587 4019

Current Building Owners: Chicago Public Schools

Review Date: 09/05/2019

Inspector: Shaquille Crews

Inspector IDPH License: 100-19717

Management Planner: Todd Huffer

Management Planner IDPH License: 100-09870

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,  
TEM Environmental, Inc.

Todd Huffer  
100-09870

## **Environmental Notification to Occupants**

To: Faculty, Staff and Parents  
From: Chicago Public Schools  
Date: August 07, 2019

RE: Kellogg School, Unit 23971  
9241 S Leavitt  
Chicago, IL, 60620

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Kellogg School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Kellogg School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

## **Table of Contents**

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

### **APPENDICES:**

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

## SCHOOL AND INSPECTION INFORMATION

### 1. School Information

School: Kellogg School Unit: 23971 Region: 06  
Address: 9241 S Leavitt Chicago, IL, 60620  
IDPH ID: 14-016-2990-2293 Building ID: 4240  
Contact: Cottonaro, Matthew Phone: 773 587 4019

### 2. Description of Facility

Original Construction: 1937 Additional Construction: 1954  
Total Square Footage: 18315 No of Floors: 2  
Current Occupancy: 272

### 3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197  
Address: 42 West Madison Street  
Chicago, IL 60602

### 4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.  
Contact: Steven Geneser  
Address 174 N. Brandon Drive  
Glendale Heights, IL, 60139  
Phone: 630-790-0880 Fax: 630-790-0882

### 5. Inspector

Inspector Name: Shaquille Crews

Inspector IDPH license # 100-19717

Signature:  
Date: 8/7/2019

### 6. Management Planner

Management Planner Name: Todd Huffer

Management Planner IDPH license # 100-09870

Signature:  
Date: 09/05/2019

### 7. Review Date:09/05/2019

### 8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

## II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Kellogg School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4240:

C	Aircell Pipe Insulation
H	Aircell Duct Insulation
I	Horse Hair Duct Insulation

B. The following new homogenous areas have been identified for Building 4240:

37	Blue Carpet Mastic
38	4" Black Baseboard
38A	4" Black Baseboard Mastic
39	4" Beige Baseboard
39A	4" Beige Baseboard



C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01B	12x12 Taupe Floor Tile
01C	12x12 Crème Floor Tile
01D	12x12 Blue Floor Tile
07C	12x12 Crème Floor Tile Mastic
07D	12x12 Blue Floor Tile Mastic
10	1x1 Acoustical Ceiling Tile Mastic
17	Brown Hardcoat Plaster
18	Brown Hardcoat Plaster
19	12x12 Blue Floor Tile
20	Blue Carpet Mastic
21	Brown Baseboard
21A	Brown Baseboard Mastic
22	2x2 Ceiling Tile
23	12"X 12" White Floor Tile
24	12"X 12" White Floor Tile Mastic
25	Vinyl Flooring Mastic
26	2'X 2' Ceiling Tile
27	Brown, Orange & Tan Patterned Ceramic Tile Grout
28	Brown, Orange & Tan Patterned Ceramic Tile Adhesive
29	Grey Speckled Terrazzo
30	1'x1' White Ceiling Tile
31	12x12 Tan Streaked Vinyl Floor Tile
31A	12x12 Tan Streaked Vinyl Floor Tile Mastic
32	12x12 Tan Streaked Vinyl Floor Tile
32A	12x12 Tan Streaked Vinyl Floor Tile Mastic
33	12x12 Blue Streaked Vinyl Floor Tile
33A	12x12 Blue Streaked Vinyl Floor Tile Mastic
34	12x12 Blue Streaked Vinyl Floor Tile
34A	12x12 Blue Streaked Vinyl Floor Tile Mastic
35	12x12 Yellow Vinyl Floor Tile
35A	12x12 Yellow Vinyl Floor Tile Mastic
36	12x12 Gray Vinyl Floor Tile
36A	12x12 Gray Vinyl Floor Tile Mastic
37	Blue Carpet Mastic
38	4" Black Baseboard
38A	4" Black Baseboard Mastic
39	4" Beige Baseboard
39A	4" Beige Baseboard
I	Horse Hair Duct Insulation
S	Horsehair Duct Insulation

The following areas were deemed to be inaccessible:

07C	12x12 Crème Floor Tile Mastic
07D	12x12 Blue Floor Tile Mastic
08B	12x12 Taupe Floor Tile Mastic
10	1x1 Acoustical Ceiling Tile Mastic
17	Brown Hardcoat Plaster
18	Brown Hardcoat Plaster
20	Blue Carpet Mastic
22	2x2 Ceiling Tile
24	12"X 12" White Floor Tile Mastic
28	Brown, Orange & Tan Patterned Ceramic Tile Adhesive
31A	12x12 Tan Streaked Vinyl Floor Tile Mastic
32A	12x12 Tan Streaked Vinyl Floor Tile Mastic
33A	12x12 Blue Streaked Vinyl Floor Tile Mastic
34A	12x12 Blue Streaked Vinyl Floor Tile Mastic
35A	12x12 Yellow Vinyl Floor Tile Mastic
36A	12x12 Gray Vinyl Floor Tile Mastic
37	Blue Carpet Mastic
38A	4" Black Baseboard Mastic
C	Aircell Pipe Insulation
I	Horse Hair Duct Insulation
L	Aircell Pipe Insulation
M	Aircell Joints
N	Cardboard Pipe Insulation
O	Cardboard joints
S	Horsehair Duct Insulation
T	Mag Duct Insulation

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Shaquille Crews, IDPH License # 100-19717. The Management Plan was updated by Todd Huffer, IDPH License # 100-09870. Inspector and Management Planner Licenses are included in Appendix B.

### **III. METHODOLOGY**

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

### **IV. ABATEMENT HISTORY**

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

### **V. REASSESSMENTS AND RECOMMENDATIONS**

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

### **VI. CONCLUSIONS**

The Kellogg School Building 4240 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

**Table I**  
**Inspector's Reinspection Findings**

---

# Chicago Public Schools

School Kellogg School Unit 23971 Building ID 4240

Address 9241 S Leavitt Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
01A	12x12 Orange Speckled Floor Tile ABATED			1937 Building- 1st & 2nd Floor Corridors	ABATED	MISC		None						Low
01B	12x12 Taupe Floor Tile	500	SF	Room 205 (Rooms 200, 201, 201B, 203, 100, 101, 103 - Abated)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
01C	12x12 Crème Floor Tile	690	SF	Room 200	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
01D	12x12 Blue Floor Tile	1,005	SF	Room 201 (202, Teacher's Lounge- Abated)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
02	White Hardcoat Plaster			1937 Building Walls	NO_ACBM	SURFACE								
06	Hardcoat Plaster			1954 Addition- Walls	NO_ACBM	SURFACE								
07A	12x12 Orange Speckled Floor Tile Mastic ABATED			1937 Building- 1st & 2nd Floor Corridor	ABATED	MISC		None						Low
07B	12x12 Taupe Floor Tile Mastic	500	SF	Room 205 (Rooms 200, 201, 201B, 203, 100, 101, 103- Abated))	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07C	12x12 Crème Floor Tile Mastic	690	SF	Room 200	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07D	12x12 Blue Floor Tile Mastic	1,005	SF	Rooms 201 (202, Teachers' Lounge- Abated)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08A	12x12 Orange Speckled Floor Tile Mastic ABATED			1954 Addition- 1st & 2nd Floor Corridors	ABATED	MISC		None						Low
08B	12x12 Taupe Floor Tile Mastic	600	SF	Room 205, Lunchroom Office, Stage Wings	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09A	12x12 Orange Speckled Floor Tile ABATED			1954 Addition- 1st & 2nd Floor Corridors	ABATED	MISC		None						
09B	12x12 Taupe Floor Tile	600	SF	Room 205, Lunchroom Office, Stage Wings	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
10	1x1 Acoustical Ceiling Tile Mastic	1,000	SF	Library	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
11	9x9 Black Floor Tile (under existing Floor Tile) ABATED			1937 Building- 2nd Floor Corridor	ABATED	MISC		None						
12	9x9 Red Floor Tile (under existing Floor			1937 Building- 2nd	ABATED	MISC		None						Low

# Chicago Public Schools

School Kellogg School Unit 23971 Building ID 4240

Address 9241 S Leavitt Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
	Tile) ABATED			Floor Corridor										
13	9x9 Black Floor Tile Mastic (under existing Floor Tile) ABATED			1937 Building- 2nd Floor Corridor	ABATED	MISC		None						Low
14	9x9 Red Floor Tile Mastic (under existing Floor Tile) ABATED			1937 Building- 2nd Floor Corridor	ABATED	MISC		None						Low
15	Interior Window Glazing ABATED 2002			1937 Building- All Windows	ABATED	MISC								
16	Interior Window Glazing ABATED 2002			1954 Addition- All Windows	ABATED	MISC								
17	Brown Hardcoat Plaster	23,200	SF	1937 Building- Walls	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
18	Brown Hardcoat Plaster	8,400	SF	1954 Addition- Walls	ASSUMED	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
19	12x12 Blue Floor Tile	2,000	SF	Room 102	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
20	Blue Carpet Mastic	1,000	SF	Main Office, Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	Brown Baseboard	14	LF	Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21A	Brown Baseboard Mastic	14	LF	Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
22	2x2 Ceiling Tile	2,100	SF	Gym	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
23	12"X 12" White Floor Tile	3,500	SF	Mobile Unit- Rooms 001, 002, 003, 004, Corridor, Water Heater Closet, Closets	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
24	12"X 12" White Floor Tile Mastic	3,500	SF	Mobile Unit- Rooms 001, 002, 003, 004, Corridor, Water Heater Closet, Closets	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
25	Vinyl Flooring Mastic	1,000	SF	Mobile Unit- Washrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	2'X 2' Ceiling Tile	3,500	SF	Throughout Mobile Unit	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
27	Brown, Orange & Tan Patterned Ceramic Tile Grout	2,408	SF	1st & 2nd Floor Girls' & Boys' Washrooms, Gym Washrooms, West-Northeast-Southeast	ASSUMED	MISC	N	LOC	6		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Kellogg School Unit 23971 Building ID 4240

Address 9241 S Leavitt Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				& Gym Entrances										
28	Brown, Orange & Tan Patterned Ceramic Tile Adhesive	2,408	SF	1st & 2nd Floor Girl's & Boy's Washrooms, Gym Washrooms, West-Northeast-Southeast & Gym Entrances	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
29	Grey Speckled Terrazzo	1,000	SF	North & South Stairwells	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	1'x1' White Ceiling Tile	3,624	SF	2nd Floor Library	ASSUMED	MISC	Y	NONE	0		No	ACBM with the potential for damage		LOW
31	12x12 Tan Streaked Vinyl Floor Tile	1,800	SF	1937 Building- 1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
31A	12x12 Tan Streaked Vinyl Floor Tile Mastic	1,800	SF	1937 Building- 1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	12x12 Tan Streaked Vinyl Floor Tile	350	SF	1937 Building- 1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
32A	12x12 Tan Streaked Vinyl Floor Tile Mastic	350	SF	1954 Addition- 1st Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
33	12x12 Blue Streaked Vinly Floor Tile	7,000	SF	1937 Building- 2nd Floor Corridor, Room 100, 101, 102, 103, 104, 105, 200, 201, 201B, 203, 204	ASSUMED	MISC	N	LOC	4		No	ACBM with the potential for damage		MODERATE
33A	12x12 Blue Streaked Vinyl Floor Tile Mastic	2,600	SF	1937 Building- 2nd Floor Corridor, Rooms 100, 101, 102, 103, 104, 105, 200, 201, 201B, 203, 204	ASSUMED	MISC	N	LOC	4		No	ACBM with the potential for damage		LOW
34	12x12 Blue Streaked Vinyl Floor Tile	2,500	SF	1954 Addition- 2nd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
34A	12x12 Blue Streaked Vinyl Floor Tile Mastic	2,500	SF	1954 Addition- 2nd Floor Corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	12x12 Yellow Vinyl Floor Tile	150	SF	Teachers' Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
35A	12x12 Yellow Vinyl Floor Tile Mastic	150	SF	Teachers' Lounge	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	12x12 Gray Vinyl Floor Tile	500	SF	Room 202 & Stairs to Stage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
36A	12x12 Gray Vinyl Floor Tile Mastic	500	SF	Room 202 & Stairs to Stage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	Blue Carpet Mastic	1,000	SF	Principal's & Assistant Principal's	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW





# Chicago Public Schools

School Kellogg School Unit 23971 Building ID 4240

Address 9241 S Leavitt Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Basement										
Q	Boiler Gasket ABATED 2002			1937 Building-Basement	ABATED	TSI								
R	Boiler Brick ABATED 2002			1937 Building-Basement	ABATED	TSI								
S	Horsehair Duct Insulation	140	SF	1954 Addition-Basement	ASSUMED	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW
T	Mag Duct Insulation	4	SF	1937 Building-Crawlspace (No Access)	CHR	TSI	Y	NONE	0		No	ACBM with the potential for damage		LOW

# Chicago Public Schools

School Kellogg School Unit 23971 Building ID 4240

Address 9241 S Leavitt Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

Reinspection Date <b>8/7/2019</b>
Inspector Name <b>Shaquille Crews</b>
<b>100-19717</b> <b>5/15/2020</b>
Inspector's IDPH License Number / Expiration Date

### Inspector's Comments

HA Number:	Inspector Comments:
01A	
01B	ABATED From Rooms 200, 201, 201B, 203, 100, 101 & 103
01C	Material Not Observed 2019
01D	ABATED From Room 202 & Teachers' Lounge
02	
06	
07A	
07B	ABATED From Rooms 200, 201, 201B, 203, 100, 101 & 103
07C	Not observed 2019
07D	ABATED from Room 202 & Teachers' Lounge
08A	
08B	
09A	
09B	
10	Not Observed 2019
11	
12	
13	
14	
15	
16	
17	
18	

# Chicago Public Schools

School Kellogg School Unit 23971 Building ID 4240

Address 9241 S Leavitt Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
19	
20	
21	Not Observed 2019
21A	Not Observed 2019
22	
23	
24	
25	
26	
27	Approximately 6 SF of Damage
28	
29	
30	
31	
31A	
32	
32A	
33	Approximately 4 SF of Damage to Tile in Room 101
33A	Approximately 4 SF of Damaged Tile in Room 101
34	
34A	
35	Material was Not Observed. There is currently Ceramic Tile in the Teachers' Longe
35A	Material was Not Observed. There is currently Ceramic Tile in the Teachers' Longe
36	
36A	
37	
38	
38A	
39	

# Chicago Public Schools

School Kellogg School Unit 23971 Building ID 4240

Address 9241 S Leavitt Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

*Inspector's Comments are Summarized at the End of the Report*

---

HA Number:	Inspector Comments:
39A	
C	7 LF of Damage Throughout Basement & Crawlspace, Tears and Exposed Ends
D	
E	
F	
G	
H	Approximately 10 SF of Aircell Duct Insulation is Damaged Throughout Basement, with tears and exposed areas where it has been cut into
I	There is approximately 2 SF of Damage within the Crawlspace
K	
L	
M	
N	
O	
P	
Q	
R	
S	
T	

**Table II**

**Management Planner's Review**

---

# Chicago Public Schools

**School** Kellogg School  
**Address** 9241 S Leavitt

**Unit** 23971  
Chicago, IL, 60620

**Building ID** 4240  
**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01A	12x12 Orange Speckled Floor Tile ABATED			1937 Building- 1st & 2nd Floor Corridors	Abated	MISC					
01B	12x12 Taupe Floor Tile	500	SF	Room 205 (Rooms 200, 201, 201B, 203, 100, 101, 103 -Abated)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01C	12x12 Crème Floor Tile	690	SF	Room 200	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
01D	12x12 Blue Floor Tile	1,005	SF	Room 201 (202, Teacher's Lounge- Abated)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02	White Hardcoat Plaster			1937 Building Walls	No ACBM	SURFACE					
06	Hardcoat Plaster			1954 Addition- Walls	No ACBM	SURFACE					
07A	12x12 Orange Speckled Floor Tile Mastic ABATED			1937 Building- 1st & 2nd Floor Corridor	Abated	MISC					
07B	12x12 Taupe Floor Tile Mastic	500	SF	Room 205 (Rooms 200, 201, 201B, 203, 100, 101, 103- Abated))	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07C	12x12 Crème Floor Tile Mastic	690	SF	Room 200	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07D	12x12 Blue Floor Tile Mastic	1,005	SF	Rooms 201 (202, Teachers' Lounge- Abated)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08A	12x12 Orange Speckled Floor Tile Mastic ABATED			1954 Addition- 1st & 2nd Floor Corridors	Abated	MISC					
08B	12x12 Taupe Floor Tile Mastic	600	SF	Room 205, Lunchroom Office, Stage Wings	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09A	12x12 Orange Speckled Floor Tile ABATED			1954 Addition- 1st & 2nd Floor Corridors	Abated	MISC					
09B	12x12 Taupe Floor Tile	600	SF	Room 205, Lunchroom Office, Stage Wings	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	1x1 Acoustical Ceiling Tile Mastic	1,000	SF	Library	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	9x9 Black Floor Tile (under existing Floor Tile) ABATED			1937 Building- 2nd Floor Corridor	Abated	MISC					
12	9x9 Red Floor Tile (under existing Floor Tile) ABATED			1937 Building- 2nd Floor Corridor	Abated	MISC					
13	9x9 Black Floor Tile Mastic (under existing Floor Tile) ABATED			1937 Building- 2nd Floor Corridor	Abated	MISC					
14	9x9 Red Floor Tile Mastic (under existing Floor Tile) ABATED			1937 Building- 2nd Floor Corridor	Abated	MISC					
15	Interior Window Glazing ABATED 2002			1937 Building- All Windows	Abated	MISC					
16	Interior Window Glazing ABATED 2002			1954 Addition- All Windows	Abated	MISC					

# Chicago Public Schools

School Kellogg School  
Address 9241 S Leavitt

Unit 23971  
Chicago, IL, 60620

Building ID 4240  
Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
17	Brown Hardcoat Plaster	23,200	SF	1937 Building- Walls	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
18	Brown Hardcoat Plaster	8,400	SF	1954 Addition- Walls	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12x12 Blue Floor Tile	2,000	SF	Room 102	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	Blue Carpet Mastic	1,000	SF	Main Office, Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
21	Brown Baseboard	14	LF	Principal's Office	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
21A	Brown Baseboard Mastic	14	LF	Principal's Office	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
22	2x2 Ceiling Tile	2,100	SF	Gym	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
23	12"X 12" White Floor Tile	3,500	SF	Mobile Unit- Rooms 001, 002, 003, 004, Corridor, Water Heater Closet, Closets	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
24	12"X 12" White Floor Tile Mastic	3,500	SF	Mobile Unit- Rooms 001, 002, 003, 004, Corridor, Water Heater Closet, Closets	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
25	Vinyl Flooring Mastic	1,000	SF	Mobile Unit- Washrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	2'X 2' Ceiling Tile	3,500	SF	Throughout Mobile Unit	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
27	Brown, Orange & Tan Patterned Ceramic Tile Grout	2,408	SF	1st & 2nd Floor Girls' & Boys' Washrooms, Gym Washrooms, West-Northeast-Southeast & Gym Entrances	Assumed	MISC	No	6	SF	6 ACBM with the potential for damage	Repair
28	Brown, Orange & Tan Patterned Ceramic Tile Adhesive	2,408	SF	1st & 2nd Floor Girl's & Boy's Washrooms, Gym Washrooms, West-Northeast-Southeast & Gym Entrances	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
29	Grey Speckled Terrazzo	1,000	SF	North & South Stairwells	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	1'x1' White Ceiling Tile	3,624	SF	2nd Floor Library	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31	12x12 Tan Streaked Vinyl Floor Tile	1,800	SF	1937 Building- 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
31A	12x12 Tan Streaked Vinyl Floor Tile Mastic	1,800	SF	1937 Building- 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	12x12 Tan Streaked Vinyl Floor Tile	350	SF	1937 Building- 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32A	12x12 Tan Streaked Vinyl Floor Tile Mastic	350	SF	1954 Addition- 1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
33	12x12 Blue Streaked Vinyl Floor Tile	7,000	SF	1937 Building- 2nd Floor Corridor, Room 100, 101, 102, 103, 104, 105, 200, 201, 201B, 203, 204	Assumed	MISC	No	4	SF	6 ACBM with the potential for damage	Follow O&M Plan
33A	12x12 Blue Streaked Vinyl Floor Tile Mastic	2,600	SF	1937 Building- 2nd Floor Corridor, Rooms 100, 101, 102, 103, 104, 105, 200, 201, 201B, 203, 204	Assumed	MISC	No	4	SF	6 ACBM with the potential for damage	Follow O&M Plan

# Chicago Public Schools

School Kellogg School  
Address 9241 S Leavitt

Unit 23971  
Chicago, IL, 60620

Building ID 4240  
Region 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
34	12x12 Blue Streaked Vinyl Floor Tile	2,500	SF	1954 Addition- 2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34A	12x12 Blue Streaked Vinyl Floor Tile Mastic	2,500	SF	1954 Addition- 2nd Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	12x12 Yellow Vinyl Floor Tile	150	SF	Teachers' Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35A	12x12 Yellow Vinyl Floor Tile Mastic	150	SF	Teachers' Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	12x12 Gray Vinyl Floor Tile	500	SF	Room 202 & Stairs to Stage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36A	12x12 Gray Vinyl Floor Tile Mastic	500	SF	Room 202 & Stairs to Stage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Blue Carpet Mastic	1,000	SF	Principal's & Assistant Principal's Offices	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	4" Black Baseboard	300	LF	Gymnasium	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
38A	4" Black Baseboard Mastic	300	LF	Gymnasium	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
39	4" Beige Baseboard	3,000	LF	Mobile Unit	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
39A	4" Beige Baseboard	3,000	LF	Mobile Unit	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
C	Aircell Pipe Insulation	1,132	LF	1937 Building- Basement	Chrysotile	TSI	Yes	7	LF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
D	Aircell Joints	152	LF	1937 Building- Basement	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
E	Cardboard Pipe Insulation	800	LF	1954 Building- Crawlspace (No Access)	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
F	Cardboard Joints	84	FITTING	1937 Building- Basement	Chrysotile	TSI	Yes	0	FITTING	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
G	Mag Block Pipe Insulation	35	LF	1937 Building- Basement	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
H	Aircell Duct Insulation	800	SF	1937 Building- Basement	Chrysotile	TSI	Yes	10	SF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
I	Horse Hair Duct Insulation	600	SF	1937 Building- Basement	Assumed	TSI	Yes	2	SF	1 Damaged or significantly damaged friable thermal system insulating ACBM	Repair
K	Insulation in Fire Rated Doors	6	EA	Gym & Basement	Chrysotile	TSI	No	0	EA	6 ACBM with the potential for damage	Follow O&M Plan
L	Aircell Pipe Insulation	80	LF	1954 Addition- Basement	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
M	Aircell Joints	16	FITTING	1954 Addition- Basement	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
N	Cardboard Pipe Insulation	20	LF	1937 Building- Basement	Chrysotile	TSI	Yes	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
O	Cardboard joints	5	FITTING	1954 Addition- Basement	Chrysotile	TSI	Yes	0	FITTING	6 ACBM with the potential for damage	Follow O&M Plan
P	Incinerator Insulation			1937 Building- Basement	No ACBM	TSI					
Q	Boiler Gasket ABATED 2002			1937 Building- Basement	Abated	TSI					
R	Boiler Brick ABATED 2002			1937 Building- Basement	Abated	TSI					



# Chicago Public Schools

**School** Kellogg School  
**Address** 9241 S Leavitt

**Unit** 23971  
 Chicago, IL, 60620

**Building ID** 4240  
**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
S	Horsehair Duct Insulation	140	SF	1954 Addition- Basement	Assumed	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
T	Mag Duct Insulation	4	SF	1937 Building- Crawlspace (No Access)	Chrysotile	TSI	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Review Date	09/05/2019
Manager Planner Name	Todd Huffer

HA Number	Management Comments
01A	

# Chicago Public Schools

**School** Kellogg School  
**Address** 9241 S Leavitt

**Unit** 23971  
 Chicago, IL, 60620

**Building ID** 4240  
**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

100-09870	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
01B	
01C	
01D	
02	
06	
07A	
07B	
07C	
07D	
08A	
08B	
09A	
09B	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
21A	

# Chicago Public Schools

**School** Kellogg School  
**Address** 9241 S Leavitt

**Unit** 23971  
 Chicago, IL, 60620

**Building ID** 4240  
**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
22	
23	
24	
25	
26	
27	patch and repair damaged area and continue O&M
28	
29	
30	
31	
31A	
32	
32A	
33	Patch & Repair damaged material and continue O&M
33A	pathc and repair damaged material and continue O&M
34	
34A	
35	Tile may be under ceramic tile
35A	
36	
36A	
37	
38	
38A	
39	
39A	

# Chicago Public Schools

**School** Kellogg School  
**Address** 9241 S Leavitt

**Unit** 23971  
 Chicago, IL, 60620

**Building ID** 4240  
**Region** 06

## ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

### Management Planner's Review Table II

**Managing Environmental Consultant (MEC)** TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

### *Management Planner's Comments Summarized at the End of the Report*

HA Number	Management Comments
C	Patch & Repair damaged insulation and continue O&M
D	
E	
F	
G	
H	Patch and Repair insulation and continue to follow O&M
I	Patch and Repair damaged material and continue O&M
K	
L	
M	
N	
O	
P	
Q	
R	
S	
T	

# Chicago Public Schools

TEM Environmental, Inc.

## 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01A**  
MATERIAL DESCRIPTION: **12x12 Orange Speckled Floor Tile ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated**    FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **1937 Building- 1st & 2nd Floor Corridors**

MATERIAL QUANTITY:    MATERIAL UNITS:

DAMAGE QUANTITY:    DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **01A**  
MATERIAL DESCRIPTION: **12x12 Orange Speckled Floor Tile ABATED**  
MATERIAL LOCATION: **1937 Building- 1st & 2nd Floor Corridors**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Room 205 (Rooms 200, 201, 201B, 203, 100, 101, 103 -Abated)**

MATERIAL QUANTITY: **500**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS: **ABATED From Rooms 200, 201, 201B, 203, 100, 101 & 103**

Inspector's Signature: \_\_\_\_\_

Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **01B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile**  
MATERIAL LOCATION: **Room 205 (Rooms 200, 201, 201B, 203, 100, 101, 103 -Abated)**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01C**  
MATERIAL DESCRIPTION: **12x12 Crème Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Room 200**  
MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Material Not Observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **01C**  
MATERIAL DESCRIPTION: **12x12 Crème Floor Tile**  
MATERIAL LOCATION: **Room 200**  
MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01D**  
MATERIAL DESCRIPTION: **12x12 Blue Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Room 201 (202, Teacher's Lounge- Abated)**  
MATERIAL QUANTITY: **1005** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **ABATED From Room 202 & Teachers' Lounge**

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **01D**  
MATERIAL DESCRIPTION: **12x12 Blue Floor Tile**  
MATERIAL LOCATION: **Room 201 (202, Teacher's Lounge- Abated)**  
MATERIAL QUANTITY: **1005** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**  
MATERIAL DESCRIPTION: **White Hardcoat Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1937 Building Walls**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **02**

MATERIAL DESCRIPTION: **White Hardcoat Plaster**

MATERIAL LOCATION: **1937 Building Walls**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**  
MATERIAL DESCRIPTION: **Hardcoat Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1954 Addition- Walls**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **Hardcoat Plaster**

MATERIAL LOCATION: **1954 Addition- Walls**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **12x12 Orange Speckled Floor Tile Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **1937 Building- 1st & 2nd Floor Corridor**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **07A**  
MATERIAL DESCRIPTION: **12x12 Orange Speckled Floor Tile Mastic ABATED**  
MATERIAL LOCATION: **1937 Building- 1st & 2nd Floor Corridor**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 205 (Rooms 200, 201, 201B, 203, 100, 101, 103- Abated))**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **ABATED From Rooms 200, 201, 201B, 203, 100, 101 & 103**

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **07B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile Mastic**  
MATERIAL LOCATION: **Room 205 (Rooms 200, 201, 201B, 203, 100, 101, 103- Abated))**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07C**  
MATERIAL DESCRIPTION: **12x12 Crème Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 200**  
MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**  
COMMENTS: **Not observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **07C**  
MATERIAL DESCRIPTION: **12x12 Crème Floor Tile Mastic**  
MATERIAL LOCATION: **Room 200**  
MATERIAL QUANTITY: **690** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07D**  
MATERIAL DESCRIPTION: **12x12 Blue Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Rooms 201 (202, Teachers' Lounge- Abated)**  
MATERIAL QUANTITY: **1005**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS: **ABATED from Room 202 & Teachers' Lounge**

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **07D**  
MATERIAL DESCRIPTION: **12x12 Blue Floor Tile Mastic**  
MATERIAL LOCATION: **Rooms 201 (202, Teachers' Lounge- Abated)**  
MATERIAL QUANTITY: **1005** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08A**  
MATERIAL DESCRIPTION: **12x12 Orange Speckled Floor Tile Mastic ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **1954 Addition- 1st & 2nd Floor Corridors**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **08A**  
MATERIAL DESCRIPTION: **12x12 Orange Speckled Floor Tile Mastic ABATED**  
MATERIAL LOCATION: **1954 Addition- 1st & 2nd Floor Corridors**  
MATERIAL QUANTITY: MATERIAL UNITS:  
DAMAGE QUANTITY: DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 205, Lunchroom Office, Stage Wings**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **08B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile Mastic**  
MATERIAL LOCATION: **Room 205, Lunchroom Office, Stage Wings**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09A**  
MATERIAL DESCRIPTION: **12x12 Orange Speckled Floor Tile ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1954 Addition- 1st & 2nd Floor Corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **09A**

MATERIAL DESCRIPTION: **12x12 Orange Speckled Floor Tile ABATED**

MATERIAL LOCATION: **1954 Addition- 1st & 2nd Floor Corridors**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Room 205, Lunchroom Office, Stage Wings**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **09B**  
MATERIAL DESCRIPTION: **12x12 Taupe Floor Tile**  
MATERIAL LOCATION: **Room 205, Lunchroom Office, Stage Wings**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **1x1 Acoustical Ceiling Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Library**  
MATERIAL QUANTITY: **1000**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS: **Not Observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **10**  
MATERIAL DESCRIPTION: **1x1 Acoustical Ceiling Tile Mastic**  
MATERIAL LOCATION: **Library**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**  
MATERIAL DESCRIPTION: **9x9 Black Floor Tile (under existing Floor Tile) ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **9x9 Black Floor Tile (under existing Floor Tile) ABATED**

MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**  
MATERIAL DESCRIPTION: **9x9 Red Floor Tile (under existing Floor Tile) ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **9x9 Red Floor Tile (under existing Floor Tile) ABATED**

MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**  
MATERIAL DESCRIPTION: **9x9 Black Floor Tile Mastic (under existing Floor Tile) ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **9x9 Black Floor Tile Mastic (under existing Floor Tile) ABATED**

MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**  
MATERIAL DESCRIPTION: **9x9 Red Floor Tile Mastic (under existing Floor Tile) ABATED**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated**    FRIABLE:

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor**

MATERIAL QUANTITY:    MATERIAL UNITS:

DAMAGE QUANTITY:    DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **9x9 Red Floor Tile Mastic (under existing Floor Tile) ABATED**

MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**  
MATERIAL DESCRIPTION: **Interior Window Glazing ABATED 2002**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1937 Building- All Windows**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Interior Window Glazing ABATED 2002**

MATERIAL LOCATION: **1937 Building- All Windows**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**  
MATERIAL DESCRIPTION: **Interior Window Glazing ABATED 2002**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1954 Addition- All Windows**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Interior Window Glazing ABATED 2002**

MATERIAL LOCATION: **1954 Addition- All Windows**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Brown Hardcoat Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1937 Building- Walls**  
MATERIAL QUANTITY: **23200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **17**  
MATERIAL DESCRIPTION: **Brown Hardcoat Plaster**  
MATERIAL LOCATION: **1937 Building- Walls**  
MATERIAL QUANTITY: **23200** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Brown Hardcoat Plaster**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1954 Addition- Walls**  
MATERIAL QUANTITY: **8400**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **18**  
MATERIAL DESCRIPTION: **Brown Hardcoat Plaster**  
MATERIAL LOCATION: **1954 Addition- Walls**  
MATERIAL QUANTITY: **8400** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **12x12 Blue Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 102**  
MATERIAL QUANTITY: **2000**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **19**  
MATERIAL DESCRIPTION: **12x12 Blue Floor Tile**  
MATERIAL LOCATION: **Room 102**  
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Blue Carpet Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Main Office, Principal's Office**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **20**  
MATERIAL DESCRIPTION: **Blue Carpet Mastic**  
MATERIAL LOCATION: **Main Office, Principal's Office**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**  
MATERIAL DESCRIPTION: **Brown Baseboard**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Principal's Office**  
MATERIAL QUANTITY: **14** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**  
COMMENTS: **Not Observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **Brown Baseboard**

MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY: **14**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21A**  
MATERIAL DESCRIPTION: **Brown Baseboard Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Principal's Office**  
MATERIAL QUANTITY: **14** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**  
COMMENTS: **Not Observed 2019**

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **21A**  
MATERIAL DESCRIPTION: **Brown Baseboard Mastic**  
MATERIAL LOCATION: **Principal's Office**  
MATERIAL QUANTITY: **14** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **2x2 Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **22**  
MATERIAL DESCRIPTION: **2x2 Ceiling Tile**  
MATERIAL LOCATION: **Gym**  
MATERIAL QUANTITY: **2100** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **12"X 12" White Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Mobile Unit- Rooms 001, 002, 003, 004, Corridor, Water Heater Closet, Closets**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **23**  
MATERIAL DESCRIPTION: **12"X 12" White Floor Tile**  
MATERIAL LOCATION: **Mobile Unit- Rooms 001, 002, 003, 004, Corridor, Water Heater Closet, Closets**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **12"X 12" White Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Mobile Unit- Rooms 001, 002, 003, 004, Corridor, Water Heater Closet, Closets**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **24**  
MATERIAL DESCRIPTION: **12"X 12" White Floor Tile Mastic**  
MATERIAL LOCATION: **Mobile Unit- Rooms 001, 002, 003, 004, Corridor, Water Heater Closet, Closets**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Vinyl Flooring Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Mobile Unit- Washrooms**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **25**  
MATERIAL DESCRIPTION: **Vinyl Flooring Mastic**  
MATERIAL LOCATION: **Mobile Unit- Washrooms**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **2'X 2' Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY: **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Throughout Mobile Unit**  
MATERIAL QUANTITY: **3500**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **26**  
MATERIAL DESCRIPTION: **2'X 2' Ceiling Tile**  
MATERIAL LOCATION: **Throughout Mobile Unit**  
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **Brown, Orange & Tan Patterned Ceramic Tile Grout**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st & 2nd Floor Girls' & Boys' Washrooms, Gym Washrooms, West-Northeast-Southeast & Gym Entrances**

MATERIAL QUANTITY: **2408**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **6**

DAMAGE UNITS: **SF**

COMMENTS: **Approximately 6 SF of Damage**

Inspector's Signature: \_\_\_\_\_

Date: 08/07/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **27**  
MATERIAL DESCRIPTION: **Brown, Orange & Tan Patterned Ceramic Tile Grout**  
MATERIAL LOCATION: **1st & 2nd Floor Girls' & Boys' Washrooms, Gym Washrooms, West-Northeast-Southeast & Gym Entrances**  
MATERIAL QUANTITY: **2408** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **6** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

patch and repair damaged area and continue O&M

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **Brown, Orange & Tan Patterned Ceramic Tile Adhesive**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1st & 2nd Floor Girl's & Boy's Washrooms, Gym Washrooms, West-Northeast-Southeast & Gym Entrances**

MATERIAL QUANTITY: **2408**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: 08/07/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **28**  
MATERIAL DESCRIPTION: **Brown, Orange & Tan Patterned Ceramic Tile Adhesive**  
MATERIAL LOCATION: **1st & 2nd Floor Girl's & Boy's Washrooms, Gym Washrooms, West-Northeast-Southeast & Gym Entrances**  
MATERIAL QUANTITY: **2408** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **Grey Speckled Terrazzo**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **North & South Stairwells**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **29**  
MATERIAL DESCRIPTION: **Grey Speckled Terrazzo**  
MATERIAL LOCATION: **North & South Stairwells**  
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **1'x1' White Ceiling Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **2nd Floor Library**  
MATERIAL QUANTITY: **3624** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **30**  
MATERIAL DESCRIPTION: **1'x1' White Ceiling Tile**  
MATERIAL LOCATION: **2nd Floor Library**  
MATERIAL QUANTITY: **3624** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12x12 Tan Streaked Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1937 Building- 1st Floor Corridor**  
MATERIAL QUANTITY: **1800**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **31**  
MATERIAL DESCRIPTION: **12x12 Tan Streaked Vinyl Floor Tile**  
MATERIAL LOCATION: **1937 Building- 1st Floor Corridor**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31A**  
MATERIAL DESCRIPTION: **12x12 Tan Streaked Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1937 Building- 1st Floor Corridor**  
MATERIAL QUANTITY: **1800**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **31A**  
MATERIAL DESCRIPTION: **12x12 Tan Streaked Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **1937 Building- 1st Floor Corridor**  
MATERIAL QUANTITY: **1800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12x12 Tan Streaked Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1937 Building- 1st Floor Corridor**  
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **32**  
MATERIAL DESCRIPTION: **12x12 Tan Streaked Vinyl Floor Tile**  
MATERIAL LOCATION: **1937 Building- 1st Floor Corridor**  
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32A**  
MATERIAL DESCRIPTION: **12x12 Tan Streaked Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1954 Addition- 1st Floor Corridor**  
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **32A**  
MATERIAL DESCRIPTION: **12x12 Tan Streaked Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **1954 Addition- 1st Floor Corridor**  
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12x12 Blue Streaked Vinly Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**

MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor, Room 100, 101, 102, 103, 104, 105, 200, 201, 201B, 203, 204**

MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **4** DAMAGE UNITS: **SF**

COMMENTS: **Approximately 4 SF of Damage to Tile in Room 101**

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **33**  
MATERIAL DESCRIPTION: **12x12 Blue Streaked Vinly Floor Tile**  
MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor, Room 100, 101, 102, 103, 104, 105, 200, 201, 201B, 203, 204**  
MATERIAL QUANTITY: **7000** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **4** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Patch & Repair damaged material and continue O&M

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33A**  
MATERIAL DESCRIPTION: **12x12 Blue Streaked Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor, Rooms 100, 101, 102, 103, 104, 105, 200, 201, 201B, 203, 204**

MATERIAL QUANTITY: **2600** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **4** DAMAGE UNITS: **SF**

COMMENTS: **Approximately 4 SF of Damaged Tile in Room 101**

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **33A**  
MATERIAL DESCRIPTION: **12x12 Blue Streaked Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **1937 Building- 2nd Floor Corridor, Rooms 100, 101, 102, 103, 104, 105, 200, 201, 201B, 203, 204**  
MATERIAL QUANTITY: **2600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **4** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

pathc and repair damaged material and continue O&M

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12x12 Blue Streaked Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1954 Addition- 2nd Floor Corridor**  
MATERIAL QUANTITY: **2500**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **34**  
MATERIAL DESCRIPTION: **12x12 Blue Streaked Vinyl Floor Tile**  
MATERIAL LOCATION: **1954 Addition- 2nd Floor Corridor**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34A**  
MATERIAL DESCRIPTION: **12x12 Blue Streaked Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1954 Addition- 2nd Floor Corridor**  
MATERIAL QUANTITY: **2500**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **34A**  
MATERIAL DESCRIPTION: **12x12 Blue Streaked Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **1954 Addition- 2nd Floor Corridor**  
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **12x12 Yellow Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Teachers' Lounge**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Material was Not Observed. There is currently Ceramic Tile in the Teachers' Longe**

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **35**  
MATERIAL DESCRIPTION: **12x12 Yellow Vinyl Floor Tile**  
MATERIAL LOCATION: **Teachers' Lounge**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Tile may be under ceramic tile

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35A**  
MATERIAL DESCRIPTION: **12x12 Yellow Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Teachers' Lounge**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Material was Not Observed. There is currently Ceramic Tile in the Teachers' Longe**

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **35A**  
MATERIAL DESCRIPTION: **12x12 Yellow Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **Teachers' Lounge**  
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12x12 Gray Vinyl Floor Tile**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **Room 202 & Stairs to Stage**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **36**  
MATERIAL DESCRIPTION: **12x12 Gray Vinyl Floor Tile**  
MATERIAL LOCATION: **Room 202 & Stairs to Stage**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36A**  
MATERIAL DESCRIPTION: **12x12 Gray Vinyl Floor Tile Mastic**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Room 202 & Stairs to Stage**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **36A**  
MATERIAL DESCRIPTION: **12x12 Gray Vinyl Floor Tile Mastic**  
MATERIAL LOCATION: **Room 202 & Stairs to Stage**  
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **1132** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **7** DAMAGE UNITS: **LF**

COMMENTS: **7 LF of Damage Throughout Basement & Crawlspace, Tears and Esposed Ends**

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **C**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **1132** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **7** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Patch & Repair damaged insulation and continue O&M

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Aircell Joints**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **152** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **D**  
MATERIAL DESCRIPTION: **Aircell Joints**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **152** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1954 Building- Crawlspace (No Access)**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **E**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
MATERIAL LOCATION: **1954 Building- Crawlspace (No Access)**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Cardboard Joints**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **84** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **F**  
MATERIAL DESCRIPTION: **Cardboard Joints**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **84** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **35** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **G**  
MATERIAL DESCRIPTION: **Mag Block Pipe Insulation**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **35** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Aircell Duct Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON: **Physical Damage**  
DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **10** DAMAGE UNITS: **SF**

COMMENTS: **Approximately 10 SF of Aircell Duct Insulation is Damaged Throughout Basement, with tears and exposed areas where it has been cut into**

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **H**  
MATERIAL DESCRIPTION: **Aircell Duct Insulation**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **10** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Patch and Repair insulation and continue to follow O&M

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **Horse Hair Duct Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **1 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **1. Damaged or significantly damaged friable thermal system insulating ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **2** DAMAGE UNITS: **SF**

COMMENTS: **There is approximately 2 SF of Damage within the Crawlspace**

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **I**  
MATERIAL DESCRIPTION: **Horse Hair Duct Insulation**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **2** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

#### **Follow O&M Plan**

Comments:

Patch and Repair damaged material and continue O&M

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Insulation in Fire Rated Doors**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **Gym & Basement**  
MATERIAL QUANTITY: **6** MATERIAL UNITS: **EA**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **K**  
MATERIAL DESCRIPTION: **Insulation in Fire Rated Doors**  
MATERIAL LOCATION: **Gym & Basement**  
MATERIAL QUANTITY: **6** MATERIAL UNITS: **EA**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **EA**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **L**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1954 Addition- Basement**  
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **L**  
MATERIAL DESCRIPTION: **Aircell Pipe Insulation**  
MATERIAL LOCATION: **1954 Addition- Basement**  
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **Aircell Joints**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile**    FRIABLE: **Yes**

---

### RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1954 Addition- Basement**  
MATERIAL QUANTITY: **16**    MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **M**  
MATERIAL DESCRIPTION: **Aircell Joints**  
MATERIAL LOCATION: **1954 Addition- Basement**  
MATERIAL QUANTITY: **16** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **N**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **N**  
MATERIAL DESCRIPTION: **Cardboard Pipe Insulation**  
MATERIAL LOCATION: **1937 Building- Basement**  
MATERIAL QUANTITY: **20** MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **0**  
MATERIAL DESCRIPTION: **Cardboard joints**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1954 Addition- Basement**  
MATERIAL QUANTITY: **5** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **0**  
MATERIAL DESCRIPTION: **Cardboard joints**  
MATERIAL LOCATION: **1954 Addition- Basement**  
MATERIAL QUANTITY: **5** MATERIAL UNITS: **FITTING**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **FITTING**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **P**  
MATERIAL DESCRIPTION: **Incinerator Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **No ACBM**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1937 Building- Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **P**

MATERIAL DESCRIPTION: **Incinerator Insulation**

MATERIAL LOCATION: **1937 Building- Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **Q**  
MATERIAL DESCRIPTION: **Boiler Gasket ABATED 2002**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated** FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1937 Building- Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_

Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **Q**

MATERIAL DESCRIPTION: **Boiler Gasket ABATED 2002**

MATERIAL LOCATION: **1937 Building- Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **R**  
MATERIAL DESCRIPTION: **Boiler Brick ABATED 2002**  
HISTORICAL AHERA DAMAGE CATEGORY  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION:  
ASBESTOS TYPE: **Abated**    FRIABLE:

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1937 Building- Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **R**

MATERIAL DESCRIPTION: **Boiler Brick ABATED 2002**

MATERIAL LOCATION: **1937 Building- Basement**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **S**  
MATERIAL DESCRIPTION: **Horsehair Duct Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Assumed**    FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1954 Addition- Basement**  
MATERIAL QUANTITY: **140**    MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**    DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **S**  
MATERIAL DESCRIPTION: **Horsehair Duct Insulation**  
MATERIAL LOCATION: **1954 Addition- Basement**  
MATERIAL QUANTITY: **140** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School** INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

## INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **T**  
MATERIAL DESCRIPTION: **Mag Duct Insulation**  
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**  
HISTORICAL DAMAGE REASON:  
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**  
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

---

## RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**  
MATERIAL LOCATION: **1937 Building- Crawlspace (No Access)**  
MATERIAL QUANTITY: **4** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: 08/07/2019

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23971** BUIDLING ID: **4240**  
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School** REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt** IDPH LICENSE NO: **100-19717**

---

HOMOGENEOUS AREA: **T**  
MATERIAL DESCRIPTION: **Mag Duct Insulation**  
MATERIAL LOCATION: **1937 Building- Crawlspace (No Access)**  
MATERIAL QUANTITY: **4** MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

**Follow O&M Plan**

Comments:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23971**      BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**      INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**      IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **Blue Carpet Mastic**

MATERIAL LOCATION: **Principal's & Assistant Principal's Offices**

MATERIAL QUANTITY: **1000**      MATERIAL UNITS: **SF**

MATERIAL CATEGORY: **MISC**      FRIABLE:

ASBESTOS TYPE: **Assumed**

DISTURBANCE POTENTIAL: **LOW**      CONDITION:

AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**

ACCESSIBILITY: **Not Reachable**      DAMAGE REASON:  
DAMAGE REASON:  
DAMAGE REASON:

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23971**      BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School**      REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt**      IDPH LICENSE NO: **100-19717**

HOMOGENEOUS AREA: **37**  
MATERIAL DESCRIPTION: **Blue Carpet Mastic**  
MATERIAL LOCATION: **Principal's & Assistant Principal's Offices**  
MATERIAL QUANTITY: **1000**      MATERIAL UNITS: **SF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **SF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23971**      BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**      INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**      IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **4" Black Baseboard**  
MATERIAL LOCATION: **Gymnasium**  
MATERIAL QUANTITY: **300**      MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **MISC**      FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23971**      BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School**      REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt**      IDPH LICENSE NO: **100-19717**

HOMOGENEOUS AREA: **38**  
MATERIAL DESCRIPTION: **4" Black Baseboard**  
MATERIAL LOCATION: **Gymnasium**  
MATERIAL QUANTITY: **300**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**    UNIT NUMBER: **23971**    BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**    AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**    INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**    IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **4" Beige Baseboard**  
MATERIAL LOCATION: **Mobile Unit**  
MATERIAL QUANTITY: **3000**    MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **MISC**    FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**    CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**    DAMAGE REASON:  
DAMAGE QUANTITY: **0**    DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23971**      BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School**      REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt**      IDPH LICENSE NO: **100-19717**

HOMOGENEOUS AREA: **39**  
MATERIAL DESCRIPTION: **4" Beige Baseboard**  
MATERIAL LOCATION: **Mobile Unit**  
MATERIAL QUANTITY: **3000**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23971**      BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**      INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**      IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **39A**  
MATERIAL DESCRIPTION: **4" Beige Baseboard**  
MATERIAL LOCATION: **Mobile Unit**  
MATERIAL QUANTITY: **3000**      MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **MISC**      FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Within Reach**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23971**      BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School**      REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt**      IDPH LICENSE NO: **100-19717**

HOMOGENEOUS AREA: **39A**  
MATERIAL DESCRIPTION: **4" Beige Baseboard**  
MATERIAL LOCATION: **Mobile Unit**  
MATERIAL QUANTITY: **3000**      MATERIAL UNITS: **LF**  
DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**

# Chicago Public Schools

TEM Environmental, Inc.  
2019 AHERA REINSPECTION

## Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23971**      BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**      AHERA INSPECTOR: **Shaquille Crews**  
SCHOOL NAME: **Kellogg School**      INSPECTION DATE: **8/7/2019**  
ADDRESS: **9241 S Leavitt**      IDPH LICENSE NO: **100-19717**

---

### INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **38A**  
MATERIAL DESCRIPTION: **4" Black Baseboard Mastic**  
MATERIAL LOCATION: **Gymnasium**  
MATERIAL QUANTITY: **300**      MATERIAL UNITS: **LF**  
MATERIAL CATEGORY: **MISC**      FRIABLE:  
ASBESTOS TYPE: **Assumed**  
DISTURBANCE POTENTIAL: **LOW**      CONDITION:  
AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**  
ACCESSIBILITY: **Not Reachable**      DAMAGE REASON:  
DAMAGE QUANTITY: **0**      DAMAGE REASON:  
DAMAGE UNITS: **LF**  
COMMENTS:

Inspector's Signature: \_\_\_\_\_ Date: **08/07/2019**

# Chicago Public Schools

## TEM Environmental, Inc. 2019 AHERA REINSPECTION

### Management Planner Review Form

LEA NAME: **Chicago Public Schools**      UNIT NUMBER: **23971**      BUILDING ID: **4240**  
CITY/STATE: **Chicago, Illinois**      MANAGEMENT PLANNER: **Todd Huffer**  
SCHOOL NAME: **Kellogg School**      REVIEW DATE: **9/5/2019**  
ADDRESS: **9241 S Leavitt**      IDPH LICENSE NO: **100-19717**

HOMOGENEOUS AREA: **38A**

MATERIAL DESCRIPTION: **4" Black Baseboard Mastic**

MATERIAL LOCATION: **Gymnasium**

MATERIAL QUANTITY: **300**      MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**      DAMAGE UNITS: **LF**

---

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: \_\_\_\_\_ Date: **09/05/2019**



# Chicago Public Schools

TEM Environmental, Inc.  
*2019 AHERA REINSPECTION*

# APPENDIX B

## Inspector and Management Planner Licenses

---

# CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that SHAQUILLE CREWS  
has completed the ASBESTOS INSPECTOR'S INITIAL course and successfully passed the  
examination on 01/30/2019 with a minimum score of 70% or better. Training was in accordance  
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:  
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

01/28/2019-01/30/2019

Course Dates:

01/30/2020

Expires:

1901BI01

Certificate Number:



**PUBLIC HEALTH & SAFETY** Inc.

Environmental and Occupational Services  
27 E Ashland Ave., Chicago, IL 60607

[www.public-health-safety.com](http://www.public-health-safety.com)

Office 312-491-0081  
Fax 312-421-2901

Director of Training

Nicholas J. Penoff

Doctor of Public Health


Phone: 312-491-0081

FORM # A-010

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

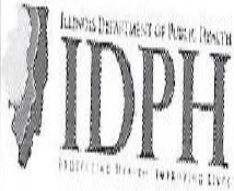

**ASBESTOS  
PROFESSIONAL  
LICENSE**

ID NUMBER  
100 - 19717

ISSUED  
4/16/2019

EXPIRES  
05/15/2020

**SHAQUILLE CREWS**  
12823 S GREEN  
CHICAGO, IL 60643

Environmental Health



**ENDORSEMENTS**

**TC EXPIRES**

INSPECTOR

1/30/2020

PROJECT MANAGER

3/29/2020

AIR SAMPLING PROFESSIONAL

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

2015



# OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

## Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Todd Huffer**


has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024161

  
\_\_\_\_\_  
Kathy DeSalvo, Director

2016



# OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

## Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Todd Huffer**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 1/27/2016

Exam Date: 1/27/2016

Expiration Date: 1/27/2017

Certificate Number: MPR1601270318

Kathy DeSalvo, Director

# Todd Huffer

Illinois Licensed Asbestos Inspector, Management Planner,  
Project Manager, and Air Sampling Professional



## ASBESTOS PROFESSIONAL LICENSE

ID NUMBER	ISSUED	EXPIRES
100 - 09870	3/16/2015	05/15/2016

TODD T HUFFER  
315 HATLEN COURT  
MT. PROSPECT, IL 60056

Environmental Health



### ENDORSEMENTS

### TC EXPIRES

INSPECTOR	12/2/2015
MANAGEMENT PLANNER	2/20/2016
PROJECT MANAGER	12/11/2015
AIR SAMPLING PROFESSIONAL	

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

**CARNOW  
CONIBEAR**

2018



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ [www.otssafety.com](http://www.otssafety.com)

# Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

**Todd Huffer**

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/20/2018

Exam Date: 11/20/2018

Expiration Date: 11/20/2019

Certificate Number: BIR1811203166

---

Kathy DeSalvo, Director



2018



**OCCUPATIONAL TRAINING & SUPPLY, INC.**

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

# Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

**Todd Huffer**

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/20/2018

Exam Date: 11/20/2018

Expiration Date: 11/20/2019

Certificate Number: MPR1811203185


---

Kathy DeSalvo, Director

# COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

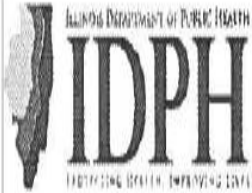

## ASBESTOS PROFESSIONAL LICENSE

ID NUMBER	ISSUED	EXPIRES
100 - 09870	4/19/2019	05/15/2020

**TODD T HUFFER**  
315 HATLEN COURT  
MT. PROSPECT, IL 60056  
Environmental Health



### ENDORSEMENTS

INSPECTOR

MANAGEMENT PLANNER

PROJECT MANAGER

AIR SAMPLING PROFESSIONAL

### TC EXPIRES

11/30/2018

11/30/2018

11/15/2018

**Alteration of this license shall result in legal action**  
This license issued under authority of the State of Illinois  
Department of Public Health  
This license is valid only when accompanied by a valid  
training course certificate.

# APPENDIX C

## Laboratory Accreditations

---

# APPENDIX D

## Laboratory Results

---

# APPENDIX E

## Chain of Custody Forms

---

## Three-Year Reinspection Key to Terms

	<b>CODE</b>	<b>KEY</b>
<b>MATERIAL</b>		
	ACBM	Asbestos Containing Building Materials
<b>MATERIAL CATEGORY</b>		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
<b>MATERIAL UNITS</b>		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
<b>DAMAGE TYPE</b>		
	Loc	Localized
	Dist	Distributed