

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2294
SCHOOL NAME: Kershaw School
ADDRESS OF SCHOOL: 6450 S. Lowe
CITY: Chicago, IL, 60621

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED **3/14/2016**

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 256
IDPH INSPECTOR LICENSE NUMBER: 100-09106
IDPH LICENSED INSPECTOR NAME(Please Print): Michael Hasier
IDPH MP LICENSE NUMBER: 100-00746
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Amy Williams

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Kershaw School

6450 S. Lowe
Chicago, IL, 60621

Unit: 23991
Building ID: 4270

IDPH ID Number: 14-016-2990-2294

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

TEM Environmental, Inc.

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

September 23, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 23991 Region: 05 IDPH ID:14-016-2990-2294

School: Kershaw School Building ID: 4270

Address: 6450 S. Lowe
Chicago, IL, 60621

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 10/18/2019

Inspector: Michael Hasier
Management Planner: Amy Williams

Inspector IDPH License: 100-09106
Management Planner IDPH License: 100-00746

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,
TEM Environmental, Inc.

Amy Williams
100-00746

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: September 23, 2019

RE: Kershaw School, Unit 23991
6450 S. Lowe
Chicago, IL, 60621

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Kershaw School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Kershaw School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Kershaw School Unit: 23991 Region: 05
Address: 6450 S. Lowe Chicago, IL, 60621
IDPH ID: 14-016-2990-2294 Building ID: 4270
Contact: Phone:

2. Description of Facility

Original Construction: 1962 Additional Construction:
Total Square Footage: 51900 No of Floors: 2
Current Occupancy: 256

3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Glendale Heights, IL, 60139
Phone: 630-790-0880 Fax: 630-790-0882

5. Inspector

Inspector Name: Michael Hasier

Inspector IDPH license # 100-09106

Signature:
Date: 9/23/2019

6. Management Planner

Management Planner Name: Amy Williams

Management Planner IDPH license # 100-00746

Signature:
Date: 10/18/2019

7. Review Date:10/18/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Kershaw School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 4270:

B. The following new homogenous areas have been identified for Building 4270:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

02A	12X12 CELING TILE FISSURED PINDOT
02B	12X12 CELING TILE IRREGULAR PINDOT
07A	12X12 BEIGE FLOOR TILE
07B	12X12 BROWN W/BEIGE FLOOR TILE
07C	12X12 BEIGE BROWN FLOOR TILE
09C	12X12 BEIGE BROWN FLOOR TILE MASTIC
10A	9X9 DARK BROWN w/WHITE MASTIC
10B	9X9 TAN W/ BROWN MASTIC
10C	9X9 LIGHT BLUE w/GRAY AND WHITE SPECKS MASTIC
10D	9X9 GRAY w/WHITE SPECKS MASTIC
10E	9X9 GRAY w/WHITE SWIRL FLOOR TILE MASTIC
11	VIBRATION CONNECTORS
14	12x12 Cream w/Specks Floor Tile
15	12x12 Cream w/Specks Floor Tile Mastic
18	12x12 Brown w/White Specks
19	12x12 Brown w/White Specks Floor Tile Mastic
25	2x2 Ceiling Tile
27	24x24 White Acoustical Ceiling Tile
29	Purple Multicolor Carpet Mastic
31	Purple Carpet Mastic
33	Blue Carpet Mastic
34	Purple/Green Multicolor Carpet Mastic
35	Blue Mix Carpet Mastic
38	Blue Carpet Mastic
39	12"x12" Orange w/Specks Vinyl Floor Tile
39A	12"x12" Orange w/Specks Vinyl Floor Tile Mastic
40	12"x12" Creme w/Specks Vinyl Floor Tile
40A	12"x12" Creme w/Specks Vinyl Floor Tile Mastic
41	12" x 12" Light Blue w/Specks Floor Tile
42	Mastic ass'd w/12"X12" Light Blue w/Specks Floor Tile
43	Burgundy Carpet Mastic

The following areas were deemed to be inaccessible:

09A	12x12 BEIGE FLOOR TILE MASTIC
09C	12X12 BEIGE BROWN FLOOR TILE MASTIC
10	9X9 BROWN SPECKLED FLOOR TILE MASTIC

10A	9X9 DARK BROWN w/WHITE MASTIC
10B	9X9 TAN W/ BROWN MASTIC
10C	9X9 LIGHT BLUE w/GRAY AND WHITE SPECKS MASTIC
10D	9X9 GRAY w/WHITE SPECKS MASTIC
10E	9X9 GRAY w/WHITE SWIRL FLOOR TILE MASTIC
15	12x12 Cream w/Specks Floor Tile Mastic
19	12x12 Brown w/White Specks Floor Tile Mastic
29	Purple Multicolor Carpet Mastic
31	Purple Carpet Mastic
33	Blue Carpet Mastic
34	Purple/Green Multicolor Carpet Mastic
35	Blue Mix Carpet Mastic
38	Blue Carpet Mastic
39A	12"x12" Orange w/Specks Vinyl Floor Tile Mastic
40A	12"x12" Creme w/Specks Vinyl Floor Tile Mastic
42	Mastic ass'd w/12"X12" Light Blue w/Specks Floor Tile
43	Burgundy Carpet Mastic

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Michael Hasier, IDPH License # 100-09106. The Management Plan was updated by Amy Williams, IDPH License # 100-00746. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Kershaw School Building 4270 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Kershaw School Unit 23991 Building ID 4270

Address 6450 S. Lowe Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
02	12X12 CELING TILE PINDOT (REGULAR PATTERN) ABATED			2ND FLOOR CORRIDOR	ABATED	MISC								
02A	12X12 CELING TILE FISSURED PINDOT	1,000	SF	THROUGHOUT - PATCHES	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
02B	12X12 CELING TILE IRREGULAR PINDOT	50,000	SF	THROUGHOUT BUILDING	ASSUMED	MISC	Y	DIST	100		No	Damaged or significantly damaged friable misc. ACBM	5	LOW
04	WHITE HARDCOAT PLASTER	2,000	SF	KITCHEN STORAGE AND STAGE	CHR	SURFACE	N	NONE	0		No	ACBM with the potential for damage		LOW
07	12x12 Beige Speckle Floor Tile ABATED			1st Floor Corridor (Abated)	ABATED	MISC								
07A	12X12 BEIGE FLOOR TILE	1,200	SF	KITCHEN OFFICE, ROOM 212	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07B	12X12 BROWN W/BEIGE FLOOR TILE	200	SF	ROOM 212	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07C	12X12 BEIGE BROWN FLOOR TILE	150	SF	2ND FLOOR CORRIDOR (PATCHING NEAR RESTROOMS)	ASSUMED	MISC	N	LOC	10		No	ACBM with the potential for damage	3	LOW
08	9x9 BROWN SPECKLED FLOOR TILE	200	SF	Auditorium, Teachers' Lounge, Room 200 Closet	CHR	MISC	N	LOC	6		No	ACBM with the potential for damage	3	LOW
08A	9"x9" DARK BROWN W/WHITE FLOOR TILE (PART OF CHECKERBOARD PATTERN)	850	SF	LUNCHROOM, 105, 107, 108, 109, 110, 111, 112, 208, 210	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08B	9"X9" TAN W/ BROWN FLOOR TILE	88	SF	LUNCHROOM (CHECKERBOARD), OFFICE AND STORAGE	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08C	9"X9" LIGHT BLUE W/ GRAY AND WHITE FLOOR TILE	400	SF	KITCHEN	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08D	9X9 GRAY W/WHITE SPECKS FLOOR TILE	3,500	SF	1ST & 2ND FLOOR CORRIDORS	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08E	9X9 GRAY w/WHITE SWIRL FLOOR TILE	17,350	SF	ROOMS: 100, 102, 105, 107, 109, 110, 111, 108, 112, 208, 210	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09A	12x12 BEIGE FLOOR TILE MASTIC	1,000	SF	KITCHEN OFFICE	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09B	12"X12" BROWN w/BEIGE FLOOR TILE MASTIC-NOT OBSERVED			ROOM 212	CHR	MISC		None						Low

Chicago Public Schools

School Kershaw School Unit 23991 Building ID 4270

Address 6450 S. Lowe Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Hallway in Modular Building										
24	2" Cream Baseboard Mastic ABATED			Classrooms and Hallway in Modular Building	ABATED	MISC		None						
25	2x2 Ceiling Tile	200	SF	2nd Floor Corridor	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
26	4" Cream Baseboard ABATED			Bathrooms in Modular Building	ABATED	MISC		None						
27	24x24 White Acoustical Ceiling Tile	4,000	SF	1st & 2nd Floor Corridors	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
28	Purple Multicolor Carpet-NOT SUSPECT			Main Office, Assistant Principal's Office	NOT_TEST ED	MISC								
29	Purple Multicolor Carpet Mastic	600	SF	Main Office, Assistant Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	Purple Carpet-NOT SUSPECT			Principal's Office		MISC								Low
31	Purple Carpet Mastic	600	SF	Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	Blue Carpet-NOT SUSPECT			Library (Room 106)		MISC								
33	Blue Carpet Mastic	1,512	SF	Library (Room 106)	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
34	Purple/Green Multicolor Carpet Mastic	500	SF	Room 106	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	Blue Mix Carpet Mastic	500	SF	Room 103 & 106, Counselor's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	Ductwork Insulation ABATED			Fan Room	ABATED	TSI								
37	Blue Carpet-NOT SUSPECT			Room 103		MISC								
38	Blue Carpet Mastic	330	SF	Room 103	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39	12"x12" Orange w/Specks Vinyl Floor Tile	200	SF	Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
39A	12"x12" Orange w/Specks Vinyl Floor Tile Mastic	200	SF	Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	12"x12" Creme w/Specks Vinyl Floor Tile	700	SF	Rooms 209 & 211	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40A	12"x12" Creme w/Specks Vinyl Floor Tile Mastic	1,500	SF	Rooms 209 & 212	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	12" x 12" Light Blue w/Specks Floor Tile	950	SF	Room 200	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	Mastic ass'd w/12"X12" Light Blue	950	SF	Room 200	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Kershaw School Unit 23991 Building ID 4270

Address 6450 S. Lowe Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 9/23/2019
Inspector Name Michael Hasier
100-09106 5/15/2020
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
02	
02A	
02B	
04	
07	
07A	
07B	
07C	Damage is Located in 2nd Floor Corridor
08	Damage Located in Room 200- Server Room
08A	
08B	
08C	
08D	
08E	
09A	
09B	Not Observed Multiple Years
09C	
10	
10A	
10B	
10C	
10D	
10E	

Chicago Public Schools

School Kershaw School Unit 23991 Building ID 4270

Address 6450 S. Lowe Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	Not A Suspect Material
29	
30	Not A Suspect Material
31	
32	Not A Suspect Material
33	
34	
35	
36	
37	Not A Suspect Material
38	
39	

Chicago Public Schools

School Kershaw School Unit 23991 Building ID 4270

Address 6450 S. Lowe Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
39A	
40	
40A	
41	
42	
43	
D	

Table II

Management Planner's Review

Chicago Public Schools

School Kershaw School

Unit 23991

Building ID 4270

Address 6450 S. Lowe

Chicago, IL, 60621

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
02	12X12 CELING TILE PINDOT (REGULAR PATTERN) ABATED			2ND FLOOR CORRIDOR	Abated	MISC					
02A	12X12 CELING TILE FISSURED PINDOT	1,000	SF	THROUGHOUT - PATCHES	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
02B	12X12 CELING TILE IRREGULAR PINDOT	50,000	SF	THROUGHOUT BUILDING	Assumed	MISC	Yes	100	SF	4 Damaged or significantly damaged friable misc. ACBM	Remove
04	WHITE HARDCOAT PLASTER	2,000	SF	KITCHEN STORAGE AND STAGE	Chrysotile	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	12x12 Beige Speckle Floor Tile ABATED			1st Floor Corridor (Abated)	Abated	MISC					
07A	12X12 BEIGE FLOOR TILE	1,200	SF	KITCHEN OFFICE, ROOM 212	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07B	12X12 BROWN W/BEIGE FLOOR TILE	200	SF	ROOM 212	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07C	12X12 BEIGE BROWN FLOOR TILE	150	SF	2ND FLOOR CORRIDOR (PATCHING NEAR RESTROOMS)	Assumed	MISC	No	10	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	9x9 BROWN SPECKLED FLOOR TILE	200	SF	Auditorium, Teachers' Lounge, Room 200 Closet	Chrysotile	MISC	No	6	SF	6 ACBM with the potential for damage	Follow O&M Plan
08A	9"x9" DARK BROWN W/WHITE FLOOR TILE (PART OF CHECKERBOARD PATTERN)	850	SF	LUNCHROOM, 105, 107, 108, 109, 110, 111, 112, 208, 210	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08B	9"X9" TAN W/ BROWN FLOOR TILE	88	SF	LUNCHROOM (CHECKERBOARD), OFFICE AND STORAGE	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08C	9"X9" LIGHT BLUE W/ GRAY AND WHITE FLOOR TILE	400	SF	KITCHEN	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08D	9X9 GRAY W/WHITE SPECKS FLOOR TILE	3,500	SF	1ST & 2ND FLOOR CORRIDORS	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08E	9X9 GRAY w/WHITE SWIRL FLOOR TILE	17,350	SF	ROOMS: 100, 102, 105, 107, 109, 110, 111, 108, 112, 208, 210	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09A	12x12 BEIGE FLOOR TILE MASTIC	1,000	SF	KITCHEN OFFICE	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09B	12"X12" BROWN w/BEIGE FLOOR TILE MASTIC-NOT OBSERVED			ROOM 212	Chrysotile	MISC					
09C	12X12 BEIGE BROWN FLOOR TILE MASTIC	150	SF	2ND FLOOR CORRIDOR (PATCHING NEAR RESTROOM)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	9X9 BROWN SPECKLED FLOOR TILE MASTIC	500	SF	TEACHERS LOUNGE, AUDITORIUM	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10A	9X9 DARK BROWN w/WHITE MASTIC	850	SF	LUNCHROOM, 105, 107, 108, 109, 110, 111, 112, 201-211	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10B	9X9 TAN W/ BROWN MASTIC	1,000	SF	LUNCHROOM (CHECKERBOARD)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10C	9X9 LIGHT BLUE w/GRAY AND WHITE SPECKS MASTIC	400	SF	KITCHEN	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Kershaw School

Unit 23991

Building ID 4270

Address 6450 S. Lowe

Chicago, IL, 60621

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
10D	9X9 GRAY w/WHITE SPECKS MASTIC	3,500	SF	1ST & 2ND FLOOR CORRIDORS	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10E	9X9 GRAY w/WHITE SWIRL FLOOR TILE MASTIC	19,000	SF	ROOMS: 100, 102, 105, 107, 109, 110, 111, 108, 112, 200-211	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	VIBRATION CONNECTORS	80	LF	FAN ROOM 2ND FLOOR	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
12	FLUE PATCHING (ABATED)			BOILER ROOM	Abated	TSI					
13	Brown Carpet Mastic ABATED			Assistant Principal's Office	Abated	MISC					
14	12x12 Cream w/Specks Floor Tile	1,500	SF	1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	12x12 Cream w/Specks Floor Tile Mastic	1,500	SF	1st Floor Corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
16	12x12 Salmon Floor Tile ABATED			Book Storage	Abated	MISC					
17	12x12 Salmon Floor Tile Mastic ABATED			Book Storage	Abated	MISC					
18	12x12 Brown w/White Specks	250	SF	Faculty Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
19	12x12 Brown w/White Specks Floor Tile Mastic	250	SF	Faculty Lounge	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
20	Blue Carpet Mastic ABATED			Main Office, Room 103	Abated	MISC					
21	12x12 Cream w/Tan Specks Floor Tile ABATED			Modular Building	Abated	MISC					
22	12x12 Cream w/Tan Specks Floor Tile Mastic ABATED			Modular Building	Abated	MISC					
23	2" Cream Baseboard ABATED			Classrooms and Hallway in Modular Building	Abated	MISC					
24	2" Cream Baseboard Mastic ABATED			Classrooms and Hallway in Modular Building	Abated	MISC					
25	2x2 Ceiling Tile	200	SF	2nd Floor Corridor	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
26	4" Cream Baseboard ABATED			Bathrooms in Modular Building	Abated	MISC					
27	24x24 White Acoustical Ceiling Tile	4,000	SF	1st & 2nd Floor Corridors	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
28	Purple Multicolor Carpet-NOT SUSPECT			Main Office, Assistant Principal's Office	Not Tested	MISC					
29	Purple Multicolor Carpet Mastic	600	SF	Main Office, Assistant Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	Purple Carpet-NOT SUSPECT			Principal's Office		MISC					
31	Purple Carpet Mastic	600	SF	Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
32	Blue Carpet-NOT SUSPECT			Library (Room 106)		MISC					
33	Blue Carpet Mastic	1,512	SF	Library (Room 106)	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
34	Purple/Green Multicolor Carpet Mastic	500	SF	Room 106	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	Blue Mix Carpet Mastic	500	SF	Room 103 & 106, Counselor's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	Ductwork Insulation ABATED			Fan Room	Abated	TSI					

Chicago Public Schools

School Kershaw School
Address 6450 S. Lowe

Unit 23991
 Chicago, IL, 60621

Building ID 4270
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
37	Blue Carpet-NOT SUSPECT			Room 103		MISC					
38	Blue Carpet Mastic	330	SF	Room 103	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	12"x12" Orange w/Specks Vinyl Floor Tile	200	SF	Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39A	12"x12" Orange w/Specks Vinyl Floor Tile Mastic	200	SF	Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	12"x12" Creme w/Specks Vinyl Floor Tile	700	SF	Rooms 209 & 211	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40A	12"x12" Creme w/Specks Vinyl Floor Tile Mastic	1,500	SF	Rooms 209 & 212	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	12" x 12" Light Blue w/Specks Floor Tile	950	SF	Room 200	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	Mastic ass'd w/12"X12" Light Blue w/Specks Floor Tile	950	SF	Room 200	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
43	Burgundy Carpet Mastic	223	SF	Assistant Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
D	Joint Insulation of Fiberglass Insulated Pipes (ABATED)			Throughout Facility, Including Classroom Ceiling Soffitts in North Wing, First Floor Classrooms, Pipe Chases	Abated	TSI					

Chicago Public Schools

School Kershaw School
Address 6450 S. Lowe

Unit 23991
 Chicago, IL, 60621

Building ID 4270
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Review Date	10/18/2019
Manager Planner Name	Amy Williams
100-00746	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
02	
02A	
02B	
04	
07	
07A	
07B	
07C	
08	
08A	
08B	
08C	
08D	
08E	
09A	
09B	
09C	
10	
10A	
10B	
10C	

Chicago Public Schools

School Kershaw School
Address 6450 S. Lowe

Unit 23991
Chicago, IL, 60621

Building ID 4270
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
10D	
10E	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	

Chicago Public Schools

School Kershaw School
Address 6450 S. Lowe

Unit 23991
Chicago, IL, 60621

Building ID 4270
Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
35	
36	
37	
38	
39	
39A	
40	
40A	
41	
42	
43	
D	

Chicago Public Schools

TEM Environmental, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUILDING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **12X12 CELING TILE PINDOT (REGULAR PATTERN) ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **2ND FLOOR CORRIDOR**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **02**

MATERIAL DESCRIPTION: **12X12 CELING TILE PINDOT (REGULAR PATTERN) ABATED**

MATERIAL LOCATION: **2ND FLOOR CORRIDOR**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02A**
MATERIAL DESCRIPTION: **12X12 CELING TILE FISSURED PINDOT**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **THROUGHOUT - PATCHES**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **02A**
MATERIAL DESCRIPTION: **12X12 CELING TILE FISSURED PINDOT**
MATERIAL LOCATION: **THROUGHOUT - PATCHES**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02B**
MATERIAL DESCRIPTION: **12X12 CELING TILE IRREGULAR PINDOT**
HISTORICAL AHERA DAMAGE CATEGORY **4 Damaged or significantly damaged friable misc. ACBM**
HISTORICAL DAMAGE REASON: **Physical Damage**
HISTORICAL RESPONSE ACTION: **Remove**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Physical Damage**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **THROUGHOUT BUILDING**
MATERIAL QUANTITY: **50000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **100** DAMAGE UNITS: **SF**
COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **02B**
MATERIAL DESCRIPTION: **12X12 CELING TILE IRREGULAR PINDOT**
MATERIAL LOCATION: **THROUGHOUT BUILDING**
MATERIAL QUANTITY: **50000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **100** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **WHITE HARDCOAT PLASTER**
HISTORICAL AHERA DAMAGE CATEGORY **6 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **KITCHEN STORAGE AND STAGE**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **WHITE HARDCOAT PLASTER**
MATERIAL LOCATION: **KITCHEN STORAGE AND STAGE**
MATERIAL QUANTITY: **2000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **12x12 Beige Speckle Floor Tile ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **1st Floor Corridor (Abated)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **07**

MATERIAL DESCRIPTION: **12x12 Beige Speckle Floor Tile ABATED**

MATERIAL LOCATION: **1st Floor Corridor (Abated)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07A**
MATERIAL DESCRIPTION: **12X12 BEIGE FLOOR TILE**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **KITCHEN OFFICE, ROOM 212**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **07A**
MATERIAL DESCRIPTION: **12X12 BEIGE FLOOR TILE**
MATERIAL LOCATION: **KITCHEN OFFICE, ROOM 212**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07B**
MATERIAL DESCRIPTION: **12X12 BROWN W/BEIGE FLOOR TILE**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **ROOM 212**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **07B**
MATERIAL DESCRIPTION: **12X12 BROWN W/BEIGE FLOOR TILE**
MATERIAL LOCATION: **ROOM 212**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07C**
MATERIAL DESCRIPTION: **12X12 BEIGE BROWN FLOOR TILE**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2ND FLOOR CORRIDOR (PATCHING NEAR RESTROOMS)**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **10** DAMAGE UNITS: **SF**
COMMENTS: **Damage is Located in 2nd Floor Corridor**

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **07C**
MATERIAL DESCRIPTION: **12X12 BEIGE BROWN FLOOR TILE**
MATERIAL LOCATION: **2ND FLOOR CORRIDOR (PATCHING NEAR RESTROOMS)**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **10** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **9x9 BROWN SPECKLED FLOOR TILE**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with potential for significant damage**
HISTORICAL DAMAGE REASON: **Deterioration**
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON: **Deterioration**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Auditorium, Teachers' Lounge, Room 200 Closet**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **6** DAMAGE UNITS: **SF**
COMMENTS: **Damage Located in Room 200- Server Room**

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **9x9 BROWN SPECKLED FLOOR TILE**
MATERIAL LOCATION: **Auditorium, Teachers' Lounge, Room 200 Closet**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **6** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08A**
MATERIAL DESCRIPTION: **9"x9" DARK BROWN W/WHITE FLOOR TILE (PART OF CHECKERBOARD PATTERN)**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **LUNCHROOM, 105, 107, 108, 109, 110, 111, 112, 208, 210**

MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **08A**
MATERIAL DESCRIPTION: **9"x9" DARK BROWN W/WHITE FLOOR TILE (PART OF CHECKERBOARD PATTERN)**
MATERIAL LOCATION: **LUNCHROOM, 105, 107, 108, 109, 110, 111, 112, 208, 210**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08B**
MATERIAL DESCRIPTION: **9"X9" TAN W/ BROWN FLOOR TILE**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **LUNCHROOM (CHECKERBOARD), OFFICE AND STORAGE**
MATERIAL QUANTITY: **88** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **08B**
MATERIAL DESCRIPTION: **9"X9" TAN W/ BROWN FLOOR TILE**
MATERIAL LOCATION: **LUNCHROOM (CHECKERBOARD), OFFICE AND STORAGE**
MATERIAL QUANTITY: **88** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08C**
MATERIAL DESCRIPTION: **9"X9" LIGHT BLUE W/ GRAY AND WHITE FLOOR TILE**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **KITCHEN**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **08C**
MATERIAL DESCRIPTION: **9"X9" LIGHT BLUE W/ GRAY AND WHITE FLOOR TILE**
MATERIAL LOCATION: **KITCHEN**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08D**
MATERIAL DESCRIPTION: **9X9 GRAY W/WHITE SPECKS FLOOR TILE**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1ST & 2ND FLOOR CORRIDORS**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **08D**
MATERIAL DESCRIPTION: **9X9 GRAY W/WHITE SPECKS FLOOR TILE**
MATERIAL LOCATION: **1ST & 2ND FLOOR CORRIDORS**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08E**
MATERIAL DESCRIPTION: **9X9 GRAY w/WHITE SWIRL FLOOR TILE**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **ROOMS: 100, 102, 105, 107, 109, 110, 111, 108, 112, 208, 210**
MATERIAL QUANTITY: **17350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **08E**
MATERIAL DESCRIPTION: **9X9 GRAY w/WHITE SWIRL FLOOR TILE**
MATERIAL LOCATION: **ROOMS: 100, 102, 105, 107, 109, 110, 111, 108, 112, 208, 210**
MATERIAL QUANTITY: **17350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09A**
MATERIAL DESCRIPTION: **12x12 BEIGE FLOOR TILE MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **KITCHEN OFFICE**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **09A**
MATERIAL DESCRIPTION: **12x12 BEIGE FLOOR TILE MASTIC**
MATERIAL LOCATION: **KITCHEN OFFICE**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09B**
MATERIAL DESCRIPTION: **12"X12" BROWN w/BEIGE FLOOR TILE MASTIC-NOT OBSERVED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **ROOM 212**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not Observed Multiple Years**

Inspector's Signature: _____

Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **09B**
MATERIAL DESCRIPTION: **12"X12" BROWN w/BEIGE FLOOR TILE MASTIC-NOT OBSERVED**
MATERIAL LOCATION: **ROOM 212**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09C**
MATERIAL DESCRIPTION: **12X12 BEIGE BROWN FLOOR TILE MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2ND FLOOR CORRIDOR (PATCHING NEAR RESTROOM)**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **09C**
MATERIAL DESCRIPTION: **12X12 BEIGE BROWN FLOOR TILE MASTIC**
MATERIAL LOCATION: **2ND FLOOR CORRIDOR (PATCHING NEAR RESTROOM)**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **9X9 BROWN SPECKLED FLOOR TILE MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **TEACHERS LOUNGE, AUDITORIUM**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **9X9 BROWN SPECKLED FLOOR TILE MASTIC**
MATERIAL LOCATION: **TEACHERS LOUNGE, AUDITORIUM**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10A**
MATERIAL DESCRIPTION: **9X9 DARK BROWN w/WHITE MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **LUNCHROOM, 105, 107, 108, 109, 110, 111, 112, 201-211**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **10A**
MATERIAL DESCRIPTION: **9X9 DARK BROWN w/WHITE MASTIC**
MATERIAL LOCATION: **LUNCHROOM, 105, 107, 108, 109, 110, 111, 112, 201-211**
MATERIAL QUANTITY: **850** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10B**
MATERIAL DESCRIPTION: **9X9 TAN W/ BROWN MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **LUNCHROOM (CHECKERBOARD)**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **10B**
MATERIAL DESCRIPTION: **9X9 TAN W/ BROWN MASTIC**
MATERIAL LOCATION: **LUNCHROOM (CHECKERBOARD)**
MATERIAL QUANTITY: **1000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10C**
MATERIAL DESCRIPTION: **9X9 LIGHT BLUE w/GRAY AND WHITE SPECKS MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **KITCHEN**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **10C**
MATERIAL DESCRIPTION: **9X9 LIGHT BLUE w/GRAY AND WHITE SPECKS MASTIC**
MATERIAL LOCATION: **KITCHEN**
MATERIAL QUANTITY: **400** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10D**
MATERIAL DESCRIPTION: **9X9 GRAY w/WHITE SPECKS MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1ST & 2ND FLOOR CORRIDORS**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **10D**
MATERIAL DESCRIPTION: **9X9 GRAY w/WHITE SPECKS MASTIC**
MATERIAL LOCATION: **1ST & 2ND FLOOR CORRIDORS**
MATERIAL QUANTITY: **3500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10E**
MATERIAL DESCRIPTION: **9X9 GRAY w/WHITE SWIRL FLOOR TILE MASTIC**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **ROOMS: 100, 102, 105, 107, 109, 110, 111, 108, 112, 200-211**
MATERIAL QUANTITY: **19000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **10E**
MATERIAL DESCRIPTION: **9X9 GRAY w/WHITE SWIRL FLOOR TILE MASTIC**
MATERIAL LOCATION: **ROOMS: 100, 102, 105, 107, 109, 110, 111, 108, 112, 200-211**
MATERIAL QUANTITY: **19000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **VIBRATION CONNECTORS**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **FAN ROOM 2ND FLOOR**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **VIBRATION CONNECTORS**
MATERIAL LOCATION: **FAN ROOM 2ND FLOOR**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **FLUE PATCHING (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **BOILER ROOM**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **FLUE PATCHING (ABATED)**
MATERIAL LOCATION: **BOILER ROOM**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Brown Carpet Mastic ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Assistant Principal's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **Brown Carpet Mastic ABATED**

MATERIAL LOCATION: **Assistant Principal's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12x12 Cream w/Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **12x12 Cream w/Specks Floor Tile**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12x12 Cream w/Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **12x12 Cream w/Specks Floor Tile Mastic**
MATERIAL LOCATION: **1st Floor Corridor**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **12x12 Salmon Floor Tile ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Book Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **12x12 Salmon Floor Tile ABATED**

MATERIAL LOCATION: **Book Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **12x12 Salmon Floor Tile Mastic ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Book Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **12x12 Salmon Floor Tile Mastic ABATED**

MATERIAL LOCATION: **Book Storage**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12x12 Brown w/White Specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Faculty Lounge**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **12x12 Brown w/White Specks**
MATERIAL LOCATION: **Faculty Lounge**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12x12 Brown w/White Specks Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Faculty Lounge**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **12x12 Brown w/White Specks Floor Tile Mastic**
MATERIAL LOCATION: **Faculty Lounge**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Blue Carpet Mastic ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Office, Room 103**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Blue Carpet Mastic ABATED**

MATERIAL LOCATION: **Main Office, Room 103**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUILDING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **12x12 Cream w/Tan Specks Floor Tile ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Modular Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **12x12 Cream w/Tan Specks Floor Tile ABATED**

MATERIAL LOCATION: **Modular Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUILDING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **12x12 Cream w/Tan Specks Floor Tile Mastic ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Modular Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **12x12 Cream w/Tan Specks Floor Tile Mastic ABATED**

MATERIAL LOCATION: **Modular Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **2" Cream Baseboard ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Classrooms and Hallway in Modular Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUILDING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **2" Cream Baseboard ABATED**

MATERIAL LOCATION: **Classrooms and Hallway in Modular Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **2" Cream Baseboard Mastic ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Classrooms and Hallway in Modular Building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUILDING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **2" Cream Baseboard Mastic ABATED**

MATERIAL LOCATION: **Classrooms and Hallway in Modular Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **2x2 Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **2nd Floor Corridor**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **2x2 Ceiling Tile**
MATERIAL LOCATION: **2nd Floor Corridor**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **4" Cream Baseboard ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Bathrooms in Modular Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUILDING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **26**

MATERIAL DESCRIPTION: **4" Cream Baseboard ABATED**

MATERIAL LOCATION: **Bathrooms in Modular Building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **24x24 White Acoustical Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st & 2nd Floor Corridors**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **24x24 White Acoustical Ceiling Tile**
MATERIAL LOCATION: **1st & 2nd Floor Corridors**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Purple Multicolor Carpet-NOT SUSPECT**
HISTORICAL AHERA DAMAGE CATEGORY **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Not Tested** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Main Office, Assistant Principal's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not A Suspect Material**

Inspector's Signature: _____

Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Purple Multicolor Carpet-NOT SUSPECT**

MATERIAL LOCATION: **Main Office, Assistant Principal's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Purple Multicolor Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office, Assistant Principal's Office**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Purple Multicolor Carpet Mastic**
MATERIAL LOCATION: **Main Office, Assistant Principal's Office**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **Purple Carpet-NOT SUSPECT**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not A Suspect Material**

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **Purple Carpet-NOT SUSPECT**

MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Purple Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **Purple Carpet Mastic**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **600** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Blue Carpet-NOT SUSPECT**
HISTORICAL AHERA DAMAGE CATEGORY: **ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Library (Room 106)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not A Suspect Material**

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **Blue Carpet-NOT SUSPECT**

MATERIAL LOCATION: **Library (Room 106)**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library (Room 106)**
MATERIAL QUANTITY: **1512** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
MATERIAL LOCATION: **Library (Room 106)**
MATERIAL QUANTITY: **1512** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Purple/Green Multicolor Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 106**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Purple/Green Multicolor Carpet Mastic**
MATERIAL LOCATION: **Room 106**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Blue Mix Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 103 & 106, Counselor's Office**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Blue Mix Carpet Mastic**
MATERIAL LOCATION: **Room 103 & 106, Counselor's Office**
MATERIAL QUANTITY: **500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Ductwork Insulation ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Fan Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **36**

MATERIAL DESCRIPTION: **Ductwork Insulation ABATED**

MATERIAL LOCATION: **Fan Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Blue Carpet-NOT SUSPECT**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 103**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not A Suspect Material**

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **37**

MATERIAL DESCRIPTION: **Blue Carpet-NOT SUSPECT**

MATERIAL LOCATION: **Room 103**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 103**
MATERIAL QUANTITY: **330** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Blue Carpet Mastic**
MATERIAL LOCATION: **Room 103**
MATERIAL QUANTITY: **330** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **12"x12" Orange w/Specks Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **12"x12" Orange w/Specks Vinyl Floor Tile**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39A**
MATERIAL DESCRIPTION: **12"x12" Orange w/Specks Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **39A**
MATERIAL DESCRIPTION: **12"x12" Orange w/Specks Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Principal's Office**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUILDING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **12"x12" Creme w/Specks Vinyl Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 209 & 211**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **12"x12" Creme w/Specks Vinyl Floor Tile**
MATERIAL LOCATION: **Rooms 209 & 211**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40A**
MATERIAL DESCRIPTION: **12"x12" Creme w/Specks Vinyl Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 209 & 212**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **40A**
MATERIAL DESCRIPTION: **12"x12" Creme w/Specks Vinyl Floor Tile Mastic**
MATERIAL LOCATION: **Rooms 209 & 212**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUILDING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12" x 12" Light Blue w/Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 200**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **09/23/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12" x 12" Light Blue w/Specks Floor Tile**
MATERIAL LOCATION: **Room 200**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Mastic ass'd w/12"X12" Light Blue w/Specks Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 200**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **Mastic ass'd w/12"X12" Light Blue w/Specks Floor Tile**
MATERIAL LOCATION: **Room 200**
MATERIAL QUANTITY: **950** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Burgundy Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Assistant Principal's Office**
MATERIAL QUANTITY: **223** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Burgundy Carpet Mastic**
MATERIAL LOCATION: **Assistant Principal's Office**
MATERIAL QUANTITY: **223** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Kershaw School** INSPECTION DATE: **9/23/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Joint Insulation of Fiberglass Insulated Pipes (ABATED)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL: **Low**

MATERIAL LOCATION: **Throughout Facility, Including Classroom Ceiling Soffitts in North Wing, First Floor Classrooms, Pipe Chases**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 09/23/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **23991** BUIDLING ID: **4270**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Kershaw School** REVIEW DATE: **10/18/2019**
ADDRESS: **6450 S. Lowe** IDPH LICENSE NO: **100-09106**

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Joint Insulation of Fiberglass Insulated Pipes (ABATED)**
MATERIAL LOCATION: **Throughout Facility, Including Classroom Ceiling Soffitts in North Wing, First Floor Classrooms, Pipe Chases**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/18/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that MICHAEL HASIER
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 05/01/2019 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

05/01/2019
Course Dates:
05/01/2020
Expires:
1905BIR02
Certificate Number:



Office: 312-491-0081
Fax: 312-421-2901

Director of Training
Nicholas J. Peneff
Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License



ASBESTOS PROFESSIONAL LICENSE

ENDORSEMENTS	TC EXPIRES
SUPERVISOR/WORKER	3/1/2020
INSPECTOR	5/1/2020

ID NUMBER	ISSUED	EXPIRES
100 - 09106	5/8/2019	05/15/2020

MICHAEL S HASIER
444 OLD BARN RD., APT. B
BARRINGTON, IL 60010

Environmental Health



PROJECT MANAGER 3/1/2020

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

**Reliable
Environmental
Solutions, Inc. RES**

This is to certify that **Amy J. Williams**

*has on 04/03/19, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Building Inspector Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: April 03, 2019

COURSE LENGTH: 4 HOURS

Examination Date: April 03, 2019

Expiration Date: April 03, 2020

William S. Williams

Certificate Number: BIR/0808

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ www.ReliableEnv.com



2539 Vandalia Street, Collinsville, IL 62234 * Phone: 618-855-8764

Environmental and Occupational Safety & Health Training

Does hereby certify

William Williams

4211 Westgate Drive, Springfield, IL 62711

*Has successfully completed and passed the course examination with at least
70% for re-accreditation under AHERA (Title II)*

Asbestos Management Planner Refresher


Class Date: 02/15/2019
Examination Date: 02/15/2019
STC Certificate Number: STC-20190215-000527AMPR
Certification Expiration: 02/15/2020

David M. Mendoza – President/Training Director
Certified Environmental Specialist
OSHA Authorized Instructor

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

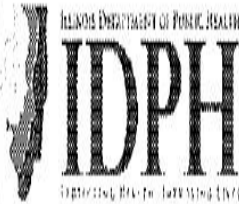

ASBESTOS PROFESSIONAL LICENSE

ENDORSEMENTS

TC EXPIRES

ID NUMBER	ISSUED	EXPIRES
100 - 00746	4/11/2019	05/15/2020

INSPECTOR

4/21/2019

MANAGEMENT PLANNER

4/21/2019

PROJECT MANAGER

4/2/2020


AIR SAMPLING PROFESSIONAL

AMY J WILLIAMS

1408 S CLAY

JACKSONVILLE, IL 62650

Environmental Health

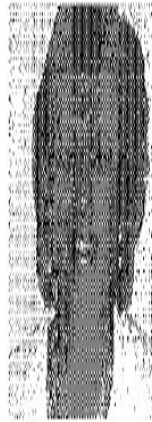

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed