

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2290
SCHOOL NAME: Johnson School
ADDRESS OF SCHOOL: 1420 S. Albany
CITY: Chicago, IL, 60623

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 2/19/2016

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 352
IDPH INSPECTOR LICENSE NUMBER: 100-09969
IDPH LICENSED INSPECTOR NAME(Please Print): Dionne Carey
IDPH MP LICENSE NUMBER: 100-19466
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Evan Christian

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Johnson School

1420 S. Albany
Chicago, IL, 60623

Unit: 26231
Building ID: 6940

IDPH ID Number: 14-016-2990-2290

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

Carnow, Conibear and Associates

600 West Van Buren St., Ste 500

Chicago, Il, 60607

Phone (312) 762-2900

Fax (312) 782-5145

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

April 11, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

Carnow, Conibear and Associates, Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 3, 4 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 26231 Region: 03 IDPH ID:14-016-2990-2290

School: Johnson School Building ID: 6940

Address: 1420 S. Albany

Chicago, IL, 60623

Building Contact: Gorges, John

Contact Phone:773-329-7309

Current Building Owners: Chicago Public Schools

Review Date: 04/20/2019

Inspector: Dionne Carey

Inspector IDPH License: 100-09969

Management Planner: Evan Christian

Management Planner IDPH License: 100-19466

If you have any questions or comments, please contact us at (312) 762-2900

Sincerely,
Carnow, Conibear and Associates

Evan Christian
100-19466

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: April 11, 2019

RE: Johnson School, Unit 26231
1420 S. Albany
Chicago, IL, 60623

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Johnson School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Johnson School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Johnson School Unit: 26231 Region: 03
Address: 1420 S. Albany Chicago, IL, 60623
IDPH ID: 14-016-2990-2290 Building ID: 6940
Contact: Gorges, John Phone: 773-329-7309

2. Description of Facility

Original Construction: 1972 Additional Construction:
Total Square Footage: 14841 No of Floors: 1
Current Occupancy: 352

3. LEA Designated Person

Contact: Robert Christlieb Phone: (773) 553-3197
Address: 42 West Madison Street
Chicago, IL 60602

4. Managing Environmental Consultant

MEC: Carnow, Conibear and Associates
Contact: Doug McCormick
Address 600 West Van Buren St., Ste 500
Chicago, IL, 60607
Phone: (312) 762-2900 Fax: (312) 782-5145

5. Inspector

Inspector Name: Dionne Carey

Inspector IDPH license # 100-09969

Signature:
Date: 4/11/2019

6. Management Planner

Management Planner Name: Evan Christian

Management Planner IDPH license # 100-19466

Signature:
Date: 04/20/2019

7. Review Date:04/20/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

Carnow, Conibear and Associates was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Johnson School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 6940:

43	Drywall
44	Joint Compound
45	2'x4' White Ceiling Tile
5N	12" x 12" Medium Blue Mix Floor Tile
89	9"x9" brown vft
89M	9"x9" brown vft mastic
90	Laminated Wood Adhesive

B. The following new homogenous areas have been identified for Building 6940:

- 89 9"x9" brown vft
- 89M 9"x9" brown vft mastic
- 90 Laminated Wood Adhesive

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

23	Roof flashing (Non-AHERA)
24	Roof base (Non-AHERA)
25	Sink Undercoating
26	Linoleum
27	Linoleum Adhesive
28	Blue/Brown/Peach Carpet Adhesive
29	Vault Door Lining
30	5" Black Baseboard
31	5" Black Baseboard Adhesive
32	Blue/Pink Carpet Adhesive
33	Stair Nosing
34	Stair Nosing Adhesive
35	Blue Ceramic Tile & Grout
36	Blue Ceramic Tile Mastic
37	Brown & White VFT and Grout
38	Brown & Whhite VFT Mastic
39	Blue & Tan Ceramic Tile and Grout
40	Brown & Tan Ceramic Tile Mastic
41	12" x 12" Blue Floor Tile
42	12" x 12" Blue Floor Tile Mastic
43	Drywall
44	Joint Compound
45	2'x4' White Ceiling Tile
50	12" x 12" Light Brown Mix Floor Tile
5A	12"x12" peach floor tile
5C	12"x12" light blue floor tile
5D	12"x12" dark blue floor tile
5E	12"x12" dark brown speckled floor tile
5F	12"x12" pink floor tile
5G	12"x12" white speckled floor tile
5H	12"x12" light brown speckled floor tile
5I	12"x12" tan floor tile
5J	12"x12" black floor tile
5L	12" x 12" Peach Mix Floor Tile
5M	12" x 12" Gray Mix Floor Tile
5N	12" x 12" Medium Blue Mix Floor Tile
5P	12" x 12" White w/Lt. Brown Floor Tile
80	12" x 12" Light Brown Mix Floor Tile Mastic
81	12"x12" White w/Brown Floor Tile
82	12"x12" White w/Brown Floor Tile Mastic
83	Blue w/Multicolored specks Carpet Adhesive
84	Drywall and Joint Compound

85	Vibration Isolators
86	Tectum Ceiling Panels
87	12"x12" Grey w/Brown Specks
88	12"x12" Grey w/Brown Specks Mastic
89	9"x9" brown vft
89M	9"x9" brown vft mastic
8L	12" x 12" Peach Mix Floor Tile Mastic
8M	12" x 12" Gray Mix Floor Tile Mastic
8N	12" x 12" Medium Blue Mix Floor Tile Mastic
8P	12" x 12" White w/Lt. Brown Floor Tile Mastic
90	Laminated Wood Adhesive

The following areas were deemed to be inaccessible:

20	Interior window caulk
27	Linoleum Adhesive
29	Vault Door Lining
31	5" Black Baseboard Adhesive
34	Stair Nosing Adhesive
36	Blue Ceramic Tile Mastic
38	Brown & Whhite VFT Mastic
40	Brown & Tan Ceramic Tile Mastic
42	12" x 12" Blue Floor Tile Mastic
45	2'x4' White Ceiling Tile
80	12" x 12" Light Brown Mix Floor Tile Mastic
82	12"x12" White w/Brown Floor Tile Mastic
83	Blue w/Multicolored specks Carpet Adhesive
85	Vibration Isolators
88	12"x12" Grey w/Brown Specks Mastic
89M	9"x9" brown vft mastic
8B	12"x12" green w/white floor tile mastic
8E	12"x12" dark brown speckled floor tile mastic
8G	12"x12" white speckled floor tile mastic
8H	12"x12" light brown speckled floor tile mastic
8I	12"x12" tan floor tile mastic
8K	12"x12" brown w/white streaks floor tile mastic
8L	12" x 12" Peach Mix Floor Tile Mastic
8M	12" x 12" Gray Mix Floor Tile Mastic
8N	12" x 12" Medium Blue Mix Floor Tile Mastic
8P	12" x 12" White w/Lt. Brown Floor Tile Mastic
90	Laminated Wood Adhesive

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Dionne Carey, IDPH License # 100-09969. The Management Plan was updated by Evan Christian, IDPH License # 100-19466. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Johnson School Building 6940 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Johnson School Unit 26231 Building ID 6940

Address 1420 S. Albany Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
10	2'x4' white ceiling tile			Throughout building	NO_ACBM									
11	2'x4' white ceiling tile w/groves			Room 102 - Parent Room	NO_ACBM									
12	1'x1' white ceiling tile			Engineer's office	NO_ACBM									
13	1'x1' white ceiling tile mastic			Engineer's office	NO_ACBM									
14	Drywall			Engineer's office	NO_ACBM									
15	Plaster			Throughout building	NO_ACBM									
16	Black baseboard			Throughout building	NO_ACBM									
17	Black baseboard mastic			Throughout building	NO_ACBM									
18	Exterior brick			Exterior of building	NO_ACBM									
19	Exterior brick mortar			Exterior of building	NO_ACBM									
20	Interior window caulk	4,000	LF	Throughout building	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
21	Exterior window caulk (Non-AHERA)			Exterior of building	CHR	MISC								
22	Exterior window glaze (Non-AHERA)			Exterior	CHR	MISC								
23	Roof flashing (Non-AHERA)			Exterior roof	ASSUMED	MISC								
24	Roof base (Non-AHERA)			Exterior roof	ASSUMED	MISC								
25	Sink Undercoating	5	SF	Art Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
26	Linoleum	210	SF	Bookshelves in all Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
27	Linoleum Adhesive	210	SF	Bookshelves in all Classrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
28	Blue/Brown/Peach Carpet Adhesive			Room 305	ASSUMED	MISC		None						
29	Vault Door Lining	32	SF	Main Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
30	5" Black Baseboard	80	LF	Main Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
31	5" Black Baseboard Adhesive	80	LF	Main Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
32	Blue/Pink Carpet Adhesive			Principal's Office	ASSUMED	MISC								
33	Stair Nosing	150	LF	Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		MODERATE
34	Stair Nosing Adhesive	150	SF	Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
35	Blue Ceramic Tile & Grout	800	SF	1,2,3,4, Floors Boys and Girls Bathrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
36	Blue Ceramic Tile Mastic	800	SF	1,2,3,4, Boys and Girls Bathrooms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
37	Brown & White VFT and Grout	150	SF	1,2,3,4 Floor Handicapped Toilets	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
38	Brown & White VFT Mastic	150	SF	1,2,3,4, Floor Handicapped Toilets	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Johnson School Unit 26231 Building ID 6940

Address 1420 S. Albany Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
39	Blue & Tan Ceramic Tile and Grout	40	SF	Slop Sinks in Cafeteria	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
40	Brown & Tan Ceramic Tile Mastic	40	SF	Slop Sinks in Cafeteria	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
41	12" x 12" Blue Floor Tile	700	SF	Rm 305	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
42	12" x 12" Blue Floor Tile Mastic	700	SF	Room 305	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
43	Drywall	40,000	SF	Throughout Building	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		MODERATE
44	Joint Compound	40,000	SF	Throughout Building	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
45	2'x4' White Ceiling Tile	40,000	SF	Throughout Building	ASSUMED	MISC	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
50	12" x 12" Light Brown Mix Floor Tile	72	SF	Patches in 1st Floor Corridor, Gym & Rm 101	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5A	12"x12" peach floor tile	10,000	SF	4th floor janitor's closet, 4th Flr Corridor, 4th Flr Classrms, Janitors Closets, Teacher's Washrms	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5B	12"x12" green w/white floor tile	125	SF	3rd floor teacher's washroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5C	12"x12" light blue floor tile	8,000	SF	3rd flr Corridor, Classrooms, Janitor's Closets, Mechanical Areas	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5D	12"x12" dark blue floor tile	11,000	SF	West stairwell, 2nd Flr Corridor, Classrms, Teacher's Washrm, Janitor's Closets, Mechanical Areas	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5E	12"x12" dark brown speckled floor tile	2,500	SF	1st floor corridor, Women's Teacher Washroom, South Stairway	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5F	12"x12" pink floor tile	2,300	SF	Rm. 101, Main Office Areas,	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Johnson School Unit 26231 Building ID 6940

Address 1420 S. Albany Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Basement Corridor, Engineer's Office, Kitchen Areas										
5G	12"x12" white speckled floor tile	2,750	SF	Counseling room next to Main Office, Gym, Gym Stage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5H	12"x12" light brown speckled floor tile	2,500	SF	Counseling room next to the Main Office, Gym & Gym Stage	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5I	12"x12" tan floor tile	50	SF	1st floor corridor	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5J	12"x12" black floor tile	1,500	SF	North and West stairwells	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5K	12"X12" brown w/white streaks floor tile	100	SF	West stairwell	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5L	12" x 12" Peach Mix Floor Tile	210	SF	Patches in 4th Floor Hallway, Rooms 401, 402, 403, 404, 406	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5M	12" x 12" Gray Mix Floor Tile	140	SF	Patches in 3rd Floor Hall and Room 301	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
5N	12" x 12" Medium Blue Mix Floor Tile	200	SF	Patches in 2nd Floor Hall, 201, 203, 204, 205, 206, 207, 208	ASSUMED	MISC	N	LOC	30		Yes	Damaged or significantly damaged friable misc. ACBM	5	LOW
5P	12" x 12" White w/Lt. Brown Floor Tile	1,632	SF	Cafeteria	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
80	12" x 12" Light Brown Mix Floor Tile Mastic	72	SF	Patches in 1st Floor Corridor, Gym & Rm 101	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
81	12"x12" White w/Brown Floor Tile	1,500	SF	Gym & Rm 101	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
82	12"x12" White w/Brown Floor Tile Mastic	1,500	SF	Gym & Rm 101	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
83	Blue w/Multicolored specks Carpet Adhesive	800	SF	Library Rooms 303 & 304	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
84	Drywall and Joint Compound	1,200	SF	Cafeteria	ASSUMED	MISC	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
85	Vibration Isolators	100	LF	Every Floor Above Ceiling	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
86	Tectum Ceiling Panels	3,000	SF	Gym	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
87	12"x12" Grey w/Brown Specks	350	SF	South Stairway 1st	ASSUMED	MISC	N	NONE	0		No	ACBM with the		LOW

Chicago Public Schools

School Johnson School Unit 26231 Building ID 6940

Address 1420 S. Albany Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				Floor Landing								potential for damage		
88	12"x12" Grey w/Brown Specks Mastic	350	SF	South Stairway 1st Floor Landing	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
89	9"x9" brown vft	75	SF	Gym storage room	ASSUMED	MISC	N	LOC	75		Yes	ACBM with potential for significant damage	3	MODERATE
89M	9"x9" brown vft mastic	75	SF	Gym storage room	ASSUMED	MISC	N	LOC	75		Yes	ACBM with potential for significant damage	3	MODERATE
8A	12"x12" peach floor tile mastic			4th floor janitor's closet, 4th flr corridor, 4th flr classrooms, 4th flr teacher's washroom	NO_ACBM									
8B	12"x12" green w/white floor tile mastic	125	SF	3rd floor teachers washroom	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
8C	12"x12" light blue floor tile mastic			3rd floor janitor's closet & store room, 3rd Floor	NO_ACBM									
8D	12"x12" dark blue floor tile mastic			West stairwell, 2nd floor corridor & room 203, All Classrooms on 2nd Floor	NO_ACBM									
8E	12"x12" dark brown speckled floor tile mastic	2,500	SF	1st floor corridor & women's washroom & south stairwell	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
8F	12"x12" pink floor tile mastic			Room 101, Main Office, Kitchen Areas, Engineer's Washrm, Basement Corridor	NO_ACBM									
8G	12"x12" white speckled floor tile mastic	2,750	SF	Counselor's room, Gym, Office & Gym stage	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
8H	12"x12" light brown speckled floor tile mastic	2,500	SF	Counselor's room, Gym & Gym stage	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
8I	12"x12" tan floor tile mastic	50	SF	1st floor corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
8J	12"x12" black floor tile mastic	1,500	SF	West and North stairwells	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
8K	12"x12" brown w/white streaks floor tile mastic	100	SF	West stairwell	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
8L	12" x 12" Peach Mix Floor Tile Mastic	210	SF	Patches in 4th Floor Hallway, Rooms 401, 402, 403, 404,	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Johnson School Unit 26231 Building ID 6940

Address 1420 S. Albany Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 4/11/2019
Inspector Name Dionne Carey
100-09969 5/15/2020
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	Not observed
29	Not observed
30	
31	
32	Not observed

Chicago Public Schools

School Johnson School Unit 26231 Building ID 6940

Address 1420 S. Albany Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
33	
34	
35	
36	
37	Handicapped restroom and teacher's restroom are the same restroom, no change
38	Handicapped restroom and teacher's restroom are the same restroom, no change
39	No change
40	No change
41	No change
42	No change
43	No change
44	No change
45	No change
50	No change
5A	No change
5B	Not observed
5C	
5D	
5E	
5F	Not observed in Room 101 - possibly below carpet, Principal's office has wood laminant floor for 7 years, kitchen area 50SF of damage
5G	Tile observed and the same tile located in lunchroom (800SF)
5H	
5I	
5J	
5K	
5L	No change
5M	
5N	Damage in NW Janitor's closet

Chicago Public Schools

School Johnson School Unit 26231 Building ID 6940

Address 1420 S. Albany Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
5P	
80	
81	
82	
83	
84	No change
85	
86	
87	
88	
89	Picture of material needs to be taken
89M	Picture of material needs to be taken
8A	
8B	Not observed
8C	
8D	
8E	
8F	
8G	Not observed in gym
8H	
8I	
8J	
8K	
8L	No change
8M	
8N	
8P	
90	
C	

Chicago Public Schools

School Johnson School Unit 26231 Building ID 6940

Address 1420 S. Albany Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900 Fax: (312) 782-5145

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
D	
F	
G	

Table II

Management Planner's Review

Chicago Public Schools

School Johnson School
Address 1420 S. Albany

Unit 26231
Chicago, IL, 60623

Building ID 6940
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
10	2'x4' white ceiling tile			Throughout building	No ACBM						
11	2'x4' white ceiling tile w/groves			Room 102 - Parent Room	No ACBM						
12	1'x1' white ceiling tile			Engineer's office	No ACBM						
13	1'x1' white ceiling tile mastic			Engineer's office	No ACBM						
14	Drywall			Engineer's office	No ACBM						
15	Plaster			Throughout building	No ACBM						
16	Black baseboard			Throughout building	No ACBM						
17	Black baseboard mastic			Throughout building	No ACBM						
18	Exterior brick			Exterior of building	No ACBM						
19	Exterior brick mortar			Exterior of building	No ACBM						
20	Interior window caulk	4,000	LF	Throughout building	Chrysotile	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
21	Exterior window caulk (Non-AHERA)			Exterior of building	Chrysotile	MISC					
22	Exterior window glaze (Non-AHERA)			Exterior	Chrysotile	MISC					
23	Roof flashing (Non-AHERA)			Exterior roof	Assumed	MISC					
24	Roof base (Non-AHERA)			Exterior roof	Assumed	MISC					
25	Sink Undercoating	5	SF	Art Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
26	Linoleum	210	SF	Bookshelves in all Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
27	Linoleum Adhesive	210	SF	Bookshelves in all Classrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
28	Blue/Brown/Peach Carpet Adhesive			Room 305	Assumed	MISC					
29	Vault Door Lining	32	SF	Main Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
30	5" Black Baseboard	80	LF	Main Office	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
31	5" Black Baseboard Adhesive	80	LF	Main Office	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
32	Blue/Pink Carpet Adhesive			Principal's Office	Assumed	MISC					
33	Stair Nosing	150	LF	Gym	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
34	Stair Nosing Adhesive	150	SF	Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
35	Blue Ceramic Tile & Grout	800	SF	1,2,3,4, Floors Boys and Gilrs Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
36	Blue Ceramic Tile Mastic	800	SF	1,2,3,4, Boys and Girls Bathrooms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
37	Brown & White VFT and Grout	150	SF	1,2,3,4 Floor Handicapped Toilets	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
38	Brown & Whhite VFT Mastic	150	SF	1,2,3,4, Floor Handicapped Toilets	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
39	Blue & Tan Ceramic Tile and Grout	40	SF	Slop Sinks in Cafeteria	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
40	Brown & Tan Ceramic Tile Mastic	40	SF	Slop Sinks in Cafeteria	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
41	12" x 12" Blue Floor Tile	700	SF	Rm 305	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
42	12" x 12" Blue Floor Tile Mastic	700	SF	Room 305	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Johnson School
Address 1420 S. Albany

Unit 26231
Chicago, IL, 60623

Building ID 6940
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, Il, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
43	Drywall	40,000	SF	Throughout Building	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
44	Joint Compound	40,000	SF	Throughout Building	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
45	2'x4' White Ceiling Tile	40,000	SF	Throughout Building	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
50	12" x 12" Light Brown Mix Floor Tile	72	SF	Patches in 1st Floor Corridor, Gym & Rm 101	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5A	12"x12" peach floor tile	10,000	SF	4th floor janitor's closet, 4th Flr Corridor, 4th Flr Classrms, Janitors Closets, Teacher's Washrms	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5B	12"x12" green w/white floor tile	125	SF	3rd floor teacher's washroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5C	12"x12" light blue floor tile	8,000	SF	3rd flr Corridor, Classrooms, Janitor's Closets, Mechanical Areas	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5D	12"x12" dark blue floor tile	11,000	SF	West stairwell, 2nd Flr Corridor, Classrms, Teacher's Washrm, Janitor's Closets, Mechanical Areas	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5E	12"x12" dark brown speckled floor tile	2,500	SF	1st floor corridor, Women's Teacher Washroom, South Stairway	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5F	12"x12" pink floor tile	2,300	SF	Rm. 101, Main Office Areas, Basement Corridor, Engineer's Office, Kitchen Areas	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5G	12"x12" white speckled floor tile	2,750	SF	Counseling room next to Main Office, Gym, Gym Stage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5H	12"x12" light brown speckled floor tile	2,500	SF	Counseling room next to the Main Office, Gym & Gym Stage	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5I	12"x12" tan floor tile	50	SF	1st floor corridor	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5J	12"x12" black floor tile	1,500	SF	North and West stairwells	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5K	12"X12" brown w/white streaks floor tile	100	SF	West stairwell	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5L	12" x 12" Peach Mix Floor Tile	210	SF	Patches in 4th Floor Hallway, Rooms 401, 402, 403, 404, 406	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5M	12" x 12" Gray Mix Floor Tile	140	SF	Patches in 3rd Floor Hall and Room 301	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
5N	12" x 12" Medium Blue Mix Floor Tile	200	SF	Patches in 2nd Floor Hall, 201, 203, 204, 205, 206, 207, 208	Assumed	MISC	No	30	SF	4 Damaged or significantly damaged friable misc. ACBM	Remove

Chicago Public Schools

School Johnson School
Address 1420 S. Albany

Unit 26231
Chicago, IL, 60623

Building ID 6940
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
5P	12" x 12" White w/Lt. Brown Floor Tile	1,632	SF	Cafeteria	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
80	12" x 12" Light Brown Mix Floor Tile Mastic	72	SF	Patches in 1st Floor Corridor, Gym & Rm 101	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
81	12"x12" White w/Brown Floor Tile	1,500	SF	Gym & Rm 101	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
82	12"x12" White w/Brown Floor Tile Mastic	1,500	SF	Gym & Rm 101	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
83	Blue w/Multicolored specks Carpet Adhesive	800	SF	Library Rooms 303 &304	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
84	Drywall and Joint Compound	1,200	SF	Cafeteria	Assumed	MISC	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
85	Vibration Isolators	100	LF	Every Floor Above Ceiling	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
86	Tectum Ceiling Panels	3,000	SF	Gym	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
87	12"x12" Grey w/Brown Specks	350	SF	South Stairway 1st Floor Landing	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
88	12"x12" Grey w/Brown Specks Mastic	350	SF	South Stairway 1st Floor Landing	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
89	9"x9" brown vft	75	SF	Gym storage room	Assumed	MISC	No	75	SF	5 ACBM with potential for significant damage	Remove
89M	9"x9" brown vft mastic	75	SF	Gym storage room	Assumed	MISC	No	75	SF	5 ACBM with potential for significant damage	Remove
8A	12"x12" peach floor tile mastic			4th floor janitor's closet, 4th flr corridor, 4th flr classrooms, 4th flr teacher's washroom	No ACBM						
8B	12"x12" green w/white floor tile mastic	125	SF	3rd floor teacher's washroom	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8C	12"x12" light blue floor tile mastic			3rd floor janitor's closet & store room, 3rd Floor	No ACBM						
8D	12"x12" dark blue floor tile mastic			West stairwell, 2nd floor corridor & room 203, All Classrooms on 2nd Floor	No ACBM						
8E	12"x12" dark brown speckled floor tile mastic	2,500	SF	1st floor corridor & women's washroom & south stairwell	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8F	12"x12" pink floor tile mastic			Room 101, Main Office, Kitchen Areas, Engineer's Washrm, Basement Corridor	No ACBM						
8G	12"x12" white speckled floor tile mastic	2,750	SF	Counselor's room, Gym, Office & Gym stage	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8H	12"x12" light brown speckled floor tile mastic	2,500	SF	Counselor's room, Gym & Gym stage	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8I	12"x12" tan floor tile mastic	50	SF	1st floor corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8J	12"x12" black floor tile mastic	1,500	SF	West and North stairwells	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8K	12"x12" brown w/white streaks floor tile mastic	100	SF	West stairwell	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	

Chicago Public Schools

School Johnson School
Address 1420 S. Albany

Unit 26231
 Chicago, IL, 60623

Building ID 6940
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
8L	12" x 12" Peach Mix Floor Tile Mastic	210	SF	Patches in 4th Floor Hallway, Rooms 401, 402, 403, 404, 406	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8M	12" x 12" Gray Mix Floor Tile Mastic	140	SF	Patches in 3rd Floor Hall and Room 301	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8N	12" x 12" Medium Blue Mix Floor Tile Mastic	200	SF	Patches in 2nd Floor Hall, 201, 203, 204, 205, 206, 207, 208	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
8P	12" x 12" White w/Lt. Brown Floor Tile Mastic	1,632	SF	Cafeteria	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
90	Laminated Wood Adhesive	100	SF	Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
C	Tank wrap			Mechanical room	Abated	TSI					
D	Water main insulation			Boiler room	Abated	TSI					
F	Elbows on fiberglass pipe runs	250	LF	Throughout basement, above gym ceiling, gym	Chrysotile	TSI	Yes	0	LF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
G	Boiler gasket			Boiler room	No ACBM						

Chicago Public Schools

School Johnson School
Address 1420 S. Albany

Unit 26231
 Chicago, IL, 60623

Building ID 6940
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

Review Date	04/20/2019
Manager Planner Name	Evan Christian
100-19466	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	

Chicago Public Schools

School Johnson School
Address 1420 S. Albany

Unit 26231
Chicago, IL, 60623

Building ID 6940
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
50	
5A	
5B	
5C	
5D	
5E	
5F	
5G	
5H	
5I	
5J	

Chicago Public Schools

School Johnson School
Address 1420 S. Albany

Unit 26231
 Chicago, IL, 60623

Building ID 6940
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
5K	
5L	
5M	
5N	Sample the damaged floor tile and associated mastic if positive for acbm remove and replace damaged floor tile and associated mastic in the NW Janitor closet and continue O&M
5P	
80	
81	
82	
83	
84	
85	
86	
87	
88	
89	Sample the damaged floor tile and associated mastic if positive for acbm remove and replace damaged floor tile and associated mastic in gym storage room
89M	See HA 89
8A	
8B	
8C	
8D	
8E	
8F	
8G	
8H	

Chicago Public Schools

School Johnson School
Address 1420 S. Albany

Unit 26231
Chicago, IL, 60623

Building ID 6940
Region 03

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) Carnow, Conibear and Associates

600 West Van Buren St., Ste 500 Chicago, IL, 60607

Phone: (312) 762-2900

Fax: (312) 782-5145

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
8I	
8J	
8K	
8L	
8M	
8N	
8P	
90	
C	
D	
F	
G	

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **2'x4' white ceiling tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **10**

MATERIAL DESCRIPTION: **2'x4' white ceiling tile**

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **2'x4' white ceiling tile w/groves**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 102 - Parent Room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **11**

MATERIAL DESCRIPTION: **2'x4' white ceiling tile w/groves**

MATERIAL LOCATION: **Room 102 - Parent Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **1'x1' white ceiling tile**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **1'x1' white ceiling tile**

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **1'x1' white ceiling tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **13**

MATERIAL DESCRIPTION: **1'x1' white ceiling tile mastic**

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **14**

MATERIAL DESCRIPTION: **Drywall**

MATERIAL LOCATION: **Engineer's office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Plaster**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **15**

MATERIAL DESCRIPTION: **Plaster**

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Black baseboard**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Black baseboard**

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Black baseboard mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **17**

MATERIAL DESCRIPTION: **Black baseboard mastic**

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **18**
MATERIAL DESCRIPTION: **Exterior brick**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **18**

MATERIAL DESCRIPTION: **Exterior brick**

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **19**
MATERIAL DESCRIPTION: **Exterior brick mortar**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____

Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **19**

MATERIAL DESCRIPTION: **Exterior brick mortar**

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **20**
MATERIAL DESCRIPTION: **Interior window caulk**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout building**
MATERIAL QUANTITY: **4000** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **20**

MATERIAL DESCRIPTION: **Interior window caulk**

MATERIAL LOCATION: **Throughout building**

MATERIAL QUANTITY: **4000**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **21**
MATERIAL DESCRIPTION: **Exterior window caulk (Non-AHERA)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **21**

MATERIAL DESCRIPTION: **Exterior window caulk (Non-AHERA)**

MATERIAL LOCATION: **Exterior of building**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **22**
MATERIAL DESCRIPTION: **Exterior window glaze (Non-AHERA)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Chrysotile** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **22**

MATERIAL DESCRIPTION: **Exterior window glaze (Non-AHERA)**

MATERIAL LOCATION: **Exterior**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **23**
MATERIAL DESCRIPTION: **Roof flashing (Non-AHERA)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior roof**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **23**

MATERIAL DESCRIPTION: **Roof flashing (Non-AHERA)**

MATERIAL LOCATION: **Exterior roof**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **24**
MATERIAL DESCRIPTION: **Roof base (Non-AHERA)**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Exterior roof**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **24**

MATERIAL DESCRIPTION: **Roof base (Non-AHERA)**

MATERIAL LOCATION: **Exterior roof**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **25**
MATERIAL DESCRIPTION: **Sink Undercoating**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Art Room**
MATERIAL QUANTITY: **5** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **25**

MATERIAL DESCRIPTION: **Sink Undercoating**

MATERIAL LOCATION: **Art Room**

MATERIAL QUANTITY: **5**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Linoleum**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Bookshelves in all Classrooms**
MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **26**
MATERIAL DESCRIPTION: **Linoleum**
MATERIAL LOCATION: **Bookshelves in all Classrooms**
MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Linoleum Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Bookshelves in all Classrooms**
MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **27**
MATERIAL DESCRIPTION: **Linoleum Adhesive**
MATERIAL LOCATION: **Bookshelves in all Classrooms**
MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **28**
MATERIAL DESCRIPTION: **Blue/Brown/Peach Carpet Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 305**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed**

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **28**

MATERIAL DESCRIPTION: **Blue/Brown/Peach Carpet Adhesive**

MATERIAL LOCATION: **Room 305**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **29**
MATERIAL DESCRIPTION: **Vault Door Lining**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office**
MATERIAL QUANTITY: **32** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **Not observed**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **29**

MATERIAL DESCRIPTION: **Vault Door Lining**

MATERIAL LOCATION: **Main Office**

MATERIAL QUANTITY: **32**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **30**
MATERIAL DESCRIPTION: **5" Black Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **30**

MATERIAL DESCRIPTION: **5" Black Baseboard**

MATERIAL LOCATION: **Main Office**

MATERIAL QUANTITY: **80**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **31**
MATERIAL DESCRIPTION: **5" Black Baseboard Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office**
MATERIAL QUANTITY: **80** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **31**

MATERIAL DESCRIPTION: **5" Black Baseboard Adhesive**

MATERIAL LOCATION: **Main Office**

MATERIAL QUANTITY: **80**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **32**
MATERIAL DESCRIPTION: **Blue/Pink Carpet Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: **Not observed**

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **32**

MATERIAL DESCRIPTION: **Blue/Pink Carpet Adhesive**

MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Stair Nosing**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **33**
MATERIAL DESCRIPTION: **Stair Nosing**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **34**
MATERIAL DESCRIPTION: **Stair Nosing Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **34**

MATERIAL DESCRIPTION: **Stair Nosing Adhesive**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY: **150**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **35**
MATERIAL DESCRIPTION: **Blue Ceramic Tile & Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1,2,3,4, Floors Boys and Gilrs Bathrooms**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **35**

MATERIAL DESCRIPTION: **Blue Ceramic Tile & Grout**

MATERIAL LOCATION: **1,2,3,4, Floors Boys and Gilrs Bathrooms**

MATERIAL QUANTITY: **800**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Blue Ceramic Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1,2,3,4, Boys and Girls Bathrooms**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **36**
MATERIAL DESCRIPTION: **Blue Ceramic Tile Mastic**
MATERIAL LOCATION: **1,2,3,4, Boys and Girls Bathrooms**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Brown & White VFT and Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1,2,3,4 Floor Handicapped Toilets**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Handicapped restroom and teacher's restroom are the same restroom, no change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **37**
MATERIAL DESCRIPTION: **Brown & White VFT and Grout**
MATERIAL LOCATION: **1,2,3,4 Floor Handicapped Toilets**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Brown & Whhite VFT Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1,2,3,4, Floor Handicapped Toilets**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Handicapped restroom and teacher's restroom are the same restroom, no change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **38**
MATERIAL DESCRIPTION: **Brown & Whhite VFT Mastic**
MATERIAL LOCATION: **1,2,3,4, Floor Handicapped Toilets**
MATERIAL QUANTITY: **150** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **39**
MATERIAL DESCRIPTION: **Blue & Tan Ceramic Tile and Grout**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Slop Sinks in Cafeteria**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **39**

MATERIAL DESCRIPTION: **Blue & Tan Ceramic Tile and Grout**

MATERIAL LOCATION: **Slop Sinks in Cafeteria**

MATERIAL QUANTITY: **40**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **40**
MATERIAL DESCRIPTION: **Brown & Tan Ceramic Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Slop Sinks in Cafeteria**
MATERIAL QUANTITY: **40** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **40**

MATERIAL DESCRIPTION: **Brown & Tan Ceramic Tile Mastic**

MATERIAL LOCATION: **Slop Sinks in Cafeteria**

MATERIAL QUANTITY: **40**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12" x 12" Blue Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm 305**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **41**
MATERIAL DESCRIPTION: **12" x 12" Blue Floor Tile**
MATERIAL LOCATION: **Rm 305**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12" x 12" Blue Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Room 305**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **42**
MATERIAL DESCRIPTION: **12" x 12" Blue Floor Tile Mastic**
MATERIAL LOCATION: **Room 305**
MATERIAL QUANTITY: **700** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Drywall**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **43**
MATERIAL DESCRIPTION: **Drywall**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **44**
MATERIAL DESCRIPTION: **Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **44**

MATERIAL DESCRIPTION: **Joint Compound**

MATERIAL LOCATION: **Throughout Building**

MATERIAL QUANTITY: **40000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **45**
MATERIAL DESCRIPTION: **2'x4' White Ceiling Tile**
MATERIAL LOCATION: **Throughout Building**
MATERIAL QUANTITY: **40000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Patches in 1st Floor Corridor, Gym & Rm 101**
MATERIAL QUANTITY: **72** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **50**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Mix Floor Tile**
MATERIAL LOCATION: **Patches in 1st Floor Corridor, Gym & Rm 101**
MATERIAL QUANTITY: **72** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5A**
MATERIAL DESCRIPTION: **12"x12" peach floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **4th floor janitor's closet, 4th Flr Corridor, 4th Flr Classrms, Janitors Closets, Teacher's Washrms**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5A**
MATERIAL DESCRIPTION: **12"x12" peach floor tile**
MATERIAL LOCATION: **4th floor janitor's closet, 4th Flr Corridor, 4th Flr Classrms, Janitors Closets, Teacher's Washrms**
MATERIAL QUANTITY: **10000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5B**
MATERIAL DESCRIPTION: **12"x12" green w/white floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd floor teacher's washroom**
MATERIAL QUANTITY: **125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **Not observed**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5B**
MATERIAL DESCRIPTION: **12"x12" green w/white floor tile**
MATERIAL LOCATION: **3rd floor teacher's washroom**
MATERIAL QUANTITY: **125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5C**
MATERIAL DESCRIPTION: **12"x12" light blue floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd flr Corridor, Classrooms, Janitor's Closets, Mechanical Areas**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5C**
MATERIAL DESCRIPTION: **12"x12" light blue floor tile**
MATERIAL LOCATION: **3rd flr Corridor, Classrooms, Janitor's Closets, Mechanical Areas**
MATERIAL QUANTITY: **8000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5D**
MATERIAL DESCRIPTION: **12"x12" dark blue floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **West stairwell, 2nd Flr Corridor, Classrms, Teacher's Washrm, Janitor's Closets, Mechanical Areas**

MATERIAL QUANTITY: **11000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5D**
MATERIAL DESCRIPTION: **12"x12" dark blue floor tile**
MATERIAL LOCATION: **West stairwell, 2nd Flr Corridor, Classrms, Teacher's Washrm, Janitor's Closets, Mechanical Areas**
MATERIAL QUANTITY: **11000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5E**
MATERIAL DESCRIPTION: **12"x12" dark brown speckled floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st floor corridor, Women's Teacher Washroom, South Stairway**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5E**
MATERIAL DESCRIPTION: **12"x12" dark brown speckled floor tile**
MATERIAL LOCATION: **1st floor corridor, Women's Teacher Washroom, South Stairway**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5F**
MATERIAL DESCRIPTION: **12"x12" pink floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rm. 101, Main Office Areas, Basement Corridor, Engineer's Office, Kitchen Areas**
MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Not observed in Room 101 - possibly below carpet, Principal's office has wood laminant floor for 7 years, kitchen area 50SF of damage**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5F**
MATERIAL DESCRIPTION: **12"x12" pink floor tile**
MATERIAL LOCATION: **Rm. 101, Main Office Areas, Basement Corridor, Engineer's Office, Kitchen Areas**
MATERIAL QUANTITY: **2300** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5G**
MATERIAL DESCRIPTION: **12"x12" white speckled floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Counseling room next to Main Office, Gym, Gym Stage**
MATERIAL QUANTITY: **2750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Tile observed and the same tile located in lunchroom (800SF)**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5G**
MATERIAL DESCRIPTION: **12"x12" white speckled floor tile**
MATERIAL LOCATION: **Counseling room next to Main Office, Gym, Gym Stage**
MATERIAL QUANTITY: **2750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5H**
MATERIAL DESCRIPTION: **12"x12" light brown speckled floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Counseling room next to the Main Office, Gym & Gym Stage**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5H**
MATERIAL DESCRIPTION: **12"x12" light brown speckled floor tile**
MATERIAL LOCATION: **Counseling room next to the Main Office, Gym & Gym Stage**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5I**
MATERIAL DESCRIPTION: **12"x12" tan floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st floor corridor**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5I**
MATERIAL DESCRIPTION: **12"x12" tan floor tile**
MATERIAL LOCATION: **1st floor corridor**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5J**
MATERIAL DESCRIPTION: **12"x12" black floor tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **North and West stairwells**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5J**
MATERIAL DESCRIPTION: **12"x12" black floor tile**
MATERIAL LOCATION: **North and West stairwells**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5K**
MATERIAL DESCRIPTION: **12"X12" brown w/white streaks floor tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and its condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **West stairwell**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5K**
MATERIAL DESCRIPTION: **12"X12" brown w/white streaks floor tile**
MATERIAL LOCATION: **West stairwell**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5L**
MATERIAL DESCRIPTION: **12" x 12" Peach Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Patches in 4th Floor Hallway, Rooms 401, 402, 403, 404, 406**
MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5L**
MATERIAL DESCRIPTION: **12" x 12" Peach Mix Floor Tile**
MATERIAL LOCATION: **Patches in 4th Floor Hallway, Rooms 401, 402, 403, 404, 406**
MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5M**
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Patches in 3rd Floor Hall and Room 301**
MATERIAL QUANTITY: **140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5M**
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile**
MATERIAL LOCATION: **Patches in 3rd Floor Hall and Room 301**
MATERIAL QUANTITY: **140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5N**
MATERIAL DESCRIPTION: **12" x 12" Medium Blue Mix Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **4 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **4. Damaged or significantly damaged friable misc. ACBM**

DAMAGE REASON: **Physical Damage
Water**
DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Patches in 2nd Floor Hall, 201, 203, 204, 205, 206, 207, 208**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**
COMMENTS: **Damage in NW Janitor's closet**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5N**
MATERIAL DESCRIPTION: **12" x 12" Medium Blue Mix Floor Tile**
MATERIAL LOCATION: **Patches in 2nd Floor Hall, 201, 203, 204, 205, 206, 207, 208**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **30** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Sample the damaged floor tile and associated mastic if positive for acbm remove and replace damaged floor tile and associated mastic in the NW Janitor closet and continue O&M

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **5P**
MATERIAL DESCRIPTION: **12" x 12" White w/Lt. Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Cafeteria**
MATERIAL QUANTITY: **1632** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **5P**
MATERIAL DESCRIPTION: **12" x 12" White w/Lt. Brown Floor Tile**
MATERIAL LOCATION: **Cafeteria**
MATERIAL QUANTITY: **1632** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Patches in 1st Floor Corridor, Gym & Rm 101**
MATERIAL QUANTITY: **72** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **80**
MATERIAL DESCRIPTION: **12" x 12" Light Brown Mix Floor Tile Mastic**
MATERIAL LOCATION: **Patches in 1st Floor Corridor, Gym & Rm 101**
MATERIAL QUANTITY: **72** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **81**
MATERIAL DESCRIPTION: **12"x12" White w/Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym & Rm 101**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **81**
MATERIAL DESCRIPTION: **12"x12" White w/Brown Floor Tile**
MATERIAL LOCATION: **Gym & Rm 101**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **82**
MATERIAL DESCRIPTION: **12"x12" White w/Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym & Rm 101**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **82**
MATERIAL DESCRIPTION: **12"x12" White w/Brown Floor Tile Mastic**
MATERIAL LOCATION: **Gym & Rm 101**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **83**
MATERIAL DESCRIPTION: **Blue w/Multicolored specks Carpet Adhesive**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Library Rooms 303 &304**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **83**
MATERIAL DESCRIPTION: **Blue w/Multicolored specks Carpet Adhesive**
MATERIAL LOCATION: **Library Rooms 303 &304**
MATERIAL QUANTITY: **800** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **84**
MATERIAL DESCRIPTION: **Drywall and Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Cafeteria**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **84**

MATERIAL DESCRIPTION: **Drywall and Joint Compound**

MATERIAL LOCATION: **Cafeteria**

MATERIAL QUANTITY: **1200**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **85**
MATERIAL DESCRIPTION: **Vibration Isolators**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Every Floor Above Ceiling**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **85**

MATERIAL DESCRIPTION: **Vibration Isolators**

MATERIAL LOCATION: **Every Floor Above Ceiling**

MATERIAL QUANTITY: **100**

MATERIAL UNITS: **LF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **86**
MATERIAL DESCRIPTION: **Tectum Ceiling Panels**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Gym**
MATERIAL QUANTITY: **3000** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **86**

MATERIAL DESCRIPTION: **Tectum Ceiling Panels**

MATERIAL LOCATION: **Gym**

MATERIAL QUANTITY: **3000**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **87**
MATERIAL DESCRIPTION: **12"x12" Grey w/Brown Specks**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **South Stairway 1st Floor Landing**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **87**
MATERIAL DESCRIPTION: **12"x12" Grey w/Brown Specks**
MATERIAL LOCATION: **South Stairway 1st Floor Landing**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **88**
MATERIAL DESCRIPTION: **12"x12" Grey w/Brown Specks Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **South Stairway 1st Floor Landing**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **88**
MATERIAL DESCRIPTION: **12"x12" Grey w/Brown Specks Mastic**
MATERIAL LOCATION: **South Stairway 1st Floor Landing**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8A**
MATERIAL DESCRIPTION: **12"x12" peach floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **4th floor janitor's closet, 4th flr corridor, 4th flr classrooms, 4th flr teacher's washroom**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8A**
MATERIAL DESCRIPTION: **12"x12" peach floor tile mastic**
MATERIAL LOCATION: **4th floor janitor's closet, 4th flr corridor, 4th flr classrooms, 4th flr teacher's washroom**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8B**
MATERIAL DESCRIPTION: **12"x12" green w/white floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **3rd floor teacher's washroom**
MATERIAL QUANTITY: **125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **Not observed**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8B**
MATERIAL DESCRIPTION: **12"x12" green w/white floor tile mastic**
MATERIAL LOCATION: **3rd floor teacher's washroom**
MATERIAL QUANTITY: **125** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8C**
MATERIAL DESCRIPTION: **12"x12" light blue floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **3rd floor janitor's closet & store room,3rd Floor**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8C**

MATERIAL DESCRIPTION: **12"x12" light blue floor tile mastic**

MATERIAL LOCATION: **3rd floor janitor's closet & store room,3rd Floor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8D**
MATERIAL DESCRIPTION: **12"x12" dark blue floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **West stairwell, 2nd floor corridor & room 203, All Classrooms on 2nd Floor**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8D**

MATERIAL DESCRIPTION: **12"x12" dark blue floor tile mastic**

MATERIAL LOCATION: **West stairwell, 2nd floor corridor & room 203, All Classrooms on 2nd Floor**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8E**
MATERIAL DESCRIPTION: **12"x12" dark brown speckled floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st floor corridor & women's washroom & south stairwell**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8E**
MATERIAL DESCRIPTION: **12"x12" dark brown speckled floor tile mastic**
MATERIAL LOCATION: **1st floor corridor & women's washroom & south stairwell**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8F**
MATERIAL DESCRIPTION: **12"x12" pink floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Room 101, Main Office, Kitchen Areas, Engineer's Washrm, Basement Corridor**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8F**
MATERIAL DESCRIPTION: **12"x12" pink floor tile mastic**
MATERIAL LOCATION: **Room 101, Main Office, Kitchen Areas, Engineer's Washrm, Basement Corridor**
MATERIAL QUANTITY: MATERIAL UNITS:
DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8G**
MATERIAL DESCRIPTION: **12"x12" white speckled floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Counselor's room, Gym, Office & Gym stage**
MATERIAL QUANTITY: **2750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **Not observed in gym**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8G**
MATERIAL DESCRIPTION: **12"x12" white speckled floor tile mastic**
MATERIAL LOCATION: **Counselor's room, Gym, Office & Gym stage**
MATERIAL QUANTITY: **2750** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8H**
MATERIAL DESCRIPTION: **12"x12" light brown speckled floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Counselor's room, Gym & Gym stage**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8H**
MATERIAL DESCRIPTION: **12"x12" light brown speckled floor tile mastic**
MATERIAL LOCATION: **Counselor's room, Gym & Gym stage**
MATERIAL QUANTITY: **2500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8I**
MATERIAL DESCRIPTION: **12"x12" tan floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **1st floor corridor**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8I**
MATERIAL DESCRIPTION: **12"x12" tan floor tile mastic**
MATERIAL LOCATION: **1st floor corridor**
MATERIAL QUANTITY: **50** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8J**
MATERIAL DESCRIPTION: **12"x12" black floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **West and North stairwells**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8J**
MATERIAL DESCRIPTION: **12"x12" black floor tile mastic**
MATERIAL LOCATION: **West and North stairwells**
MATERIAL QUANTITY: **1500** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8K**
MATERIAL DESCRIPTION: **12"x12" brown w/white streaks floor tile mastic**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **West stairwell**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8K**
MATERIAL DESCRIPTION: **12"x12" brown w/white streaks floor tile mastic**
MATERIAL LOCATION: **West stairwell**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8L**
MATERIAL DESCRIPTION: **12" x 12" Peach Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Patches in 4th Floor Hallway, Rooms 401, 402, 403, 404, 406**
MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**
COMMENTS: **No change**

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8L**
MATERIAL DESCRIPTION: **12" x 12" Peach Mix Floor Tile Mastic**
MATERIAL LOCATION: **Patches in 4th Floor Hallway, Rooms 401, 402, 403, 404, 406**
MATERIAL QUANTITY: **210** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8M**
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Patches in 3rd Floor Hall and Room 301**
MATERIAL QUANTITY: **140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8M**
MATERIAL DESCRIPTION: **12" x 12" Gray Mix Floor Tile Mastic**
MATERIAL LOCATION: **Patches in 3rd Floor Hall and Room 301**
MATERIAL QUANTITY: **140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8N**
MATERIAL DESCRIPTION: **12" x 12" Medium Blue Mix Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Patches in 2nd Floor Hall, 201, 203, 204, 205, 206, 207, 208**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8N**
MATERIAL DESCRIPTION: **12" x 12" Medium Blue Mix Floor Tile Mastic**
MATERIAL LOCATION: **Patches in 2nd Floor Hall, 201, 203, 204, 205, 206, 207, 208**
MATERIAL QUANTITY: **200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **8P**
MATERIAL DESCRIPTION: **12" x 12" White w/Lt. Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Cafeteria**
MATERIAL QUANTITY: **1632** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **8P**
MATERIAL DESCRIPTION: **12" x 12" White w/Lt. Brown Floor Tile Mastic**
MATERIAL LOCATION: **Cafeteria**
MATERIAL QUANTITY: **1632** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **C**
MATERIAL DESCRIPTION: **Tank wrap**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Mechanical room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **C**

MATERIAL DESCRIPTION: **Tank wrap**

MATERIAL LOCATION: **Mechanical room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **D**
MATERIAL DESCRIPTION: **Water main insulation**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **D**

MATERIAL DESCRIPTION: **Water main insulation**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Elbows on fiberglass pipe runs**
HISTORICAL AHERA DAMAGE CATEGORY **7 Any remaining friable ACBM or friable suspect ACBM**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Chrysotile** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **MODERATE**
MATERIAL LOCATION: **Throughout basement, above gym ceiling, gym**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **F**
MATERIAL DESCRIPTION: **Elbows on fiberglass pipe runs**
MATERIAL LOCATION: **Throughout basement, above gym ceiling, gym**
MATERIAL QUANTITY: **250** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **G**
MATERIAL DESCRIPTION: **Boiler gasket**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **No ACBM** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **G**

MATERIAL DESCRIPTION: **Boiler gasket**

MATERIAL LOCATION: **Boiler room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26231	BUILDING ID:	6940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Dionne Carey		
SCHOOL NAME:	Johnson School	INSPECTION DATE:	4/11/2019		
ADDRESS:	1420 S. Albany	IDPH LICENSE NO:	100-09969		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	89		
MATERIAL DESCRIPTION:	9"x9" brown vft		
MATERIAL LOCATION:	Gym storage room		
MATERIAL QUANTITY:	75	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	MODERATE	CONDITION:	
AHERA DAMAGE CATEGORY:	5 ACBM with potential for significant damage		
ACCESSIBILITY:	Barely Reachable	DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	75	DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			
Picture of material needs to be taken			

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **89**
MATERIAL DESCRIPTION: **9"x9" brown vft**
MATERIAL LOCATION: **Gym storage room**
MATERIAL QUANTITY: **75** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **75** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Sample the damaged floor tile and associated mastic if positive for acbm remove and replace damaged floor tile and associated mastic in gym storage room

Management Planner's Signature: _____ Date: 04/20/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26231	BUILDING ID:	6940
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Dionne Carey		
SCHOOL NAME:	Johnson School	INSPECTION DATE:	4/11/2019		
ADDRESS:	1420 S. Albany	IDPH LICENSE NO:	100-09969		

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA:	90		
MATERIAL DESCRIPTION:	Laminated Wood Adhesive		
MATERIAL LOCATION:	Principal's Office		
MATERIAL QUANTITY:	100	MATERIAL UNITS:	SF
MATERIAL CATEGORY:	MISC	FRIABLE:	
ASBESTOS TYPE:	Assumed		
DISTURBANCE POTENTIAL:	LOW	CONDITION:	
AHERA DAMAGE CATEGORY:	6 ACBM with the potential for damage		
ACCESSIBILITY:	Not Reachable	DAMAGE REASON:	
		DAMAGE REASON:	
DAMAGE QUANTITY:	0	DAMAGE REASON:	
		DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____

Date: 04/11/2019

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **90**

MATERIAL DESCRIPTION: **Laminated Wood Adhesive**

MATERIAL LOCATION: **Principal's Office**

MATERIAL QUANTITY: **100** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:

Management Planner's Signature: _____ Date: **04/20/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Inspector Assessment Form (New Homogeneous Area)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUIDLING ID: **6940**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Dionne Carey**
SCHOOL NAME: **Johnson School** INSPECTION DATE: **4/11/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

INFORMATION FROM CURRENT INSPECTION

HOMOGENEOUS AREA: **89M**
MATERIAL DESCRIPTION: **9"x9" brown vft mastic**
MATERIAL LOCATION: **Gym storage room**
MATERIAL QUANTITY: **75** MATERIAL UNITS: **SF**
MATERIAL CATEGORY: **MISC** FRIABLE:
ASBESTOS TYPE: **Assumed**
DISTURBANCE POTENTIAL: **MODERATE** CONDITION:
AHERA DAMAGE CATEGORY: **5 ACBM with potential for significant damage**
ACCESSIBILITY: **Not Reachable** DAMAGE REASON:
DAMAGE QUANTITY: **75** DAMAGE REASON:
DAMAGE UNITS: **SF**
COMMENTS:
Picture of material needs to be taken

Inspector's Signature: _____ Date: **04/11/2019**

Chicago Public Schools

Carnow, Conibear and Associates

2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26231** BUILDING ID: **6940**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Evan Christian**
SCHOOL NAME: **Johnson School** REVIEW DATE: **4/20/2019**
ADDRESS: **1420 S. Albany** IDPH LICENSE NO: **100-09969**

HOMOGENEOUS AREA: **89M**
MATERIAL DESCRIPTION: **9"x9" brown vft mastic**
MATERIAL LOCATION: **Gym storage room**
MATERIAL QUANTITY: **75** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **75** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

COMMENTS:
See HA 89

Management Planner's Signature: _____ Date: **04/20/2019**

APPENDIX B

Inspector and Management Planner Licenses



525-535 West Jefferson Street • Springfield, Illinois 62761-0001 • www.dph.illinois.gov

4/18/2016

DIONNE L CAREY WALKER

211 Somerset Drive
Streamwood, IL 60107

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 09969

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

ASBESTOS PROFESSIONAL LICENSE			ENDORSEMENTS	TC EXPIRES
	ID NUMBER 100 - 09969	ISSUED 4/18/2016	INSPECTOR	3/11/2017
DIONNE L CAREY WALKER 211 Somerset Drive Streamwood, IL 60107 Environmental Health	EXPIRES 05/15/2017		PROJECT MANAGER AIR SAMPLING PROFESSIONAL	3/12/2017
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.				

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB


has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 1/4/2019

Exam Date: 1/4/2019

Expiration Date: 1/4/2020

Certificate Number: BIR1901040041

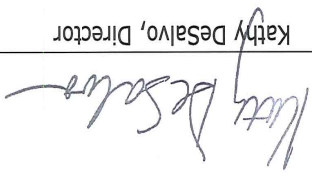
Kathy Desalvo, Director

Occupational Training & Supply, Inc. certifies that
Dionne L.C. Walker

Asbestos Building Inspector Refresher

OCCUPATIONAL TRAINING & SUPPLY, INC.
7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com




2019



525-535 West Jefferson Street • Springfield, Illinois 62761

DIONNE L CAREY WALKER
 211 SOMERSET DRIVE
 STREAMWOOD, IL 60107

1/18/2019

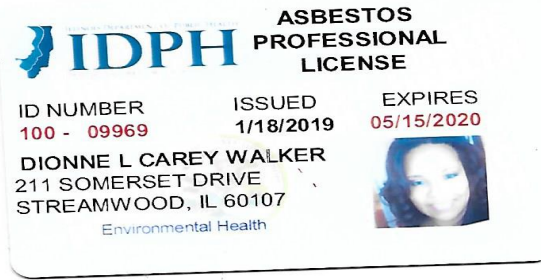

ASBESTOS PROFESSIONAL LICENSE ID NUMBER: 09969

Enclosed is your Asbestos Professional License. Please note the expiration date on the card and in the image depicted below.

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License

 <p>ASBESTOS PROFESSIONAL LICENSE</p>			<p>ENDORSEMENTS</p>		<p>TC EXPIRES</p>
<p>ID NUMBER 100 - 09969</p>	<p>ISSUED 1/18/2019</p>	<p>EXPIRES 05/15/2020</p>	<p>INSPECTOR</p>		<p>1/4/2020</p>
<p>DIONNE L CAREY WALKER 211 SOMERSET DRIVE STREAMWOOD, IL 60107 Environmental Health</p> 			<p>PROJECT MANAGER AIR SAMPLING PROFESSIONAL</p>		<p>1/5/2020</p>
<p>Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.</p>					

If you have any questions or need further assistance, contact the Asbestos Program at (217)782-3517 or fax (217)785-5897.

Our WEB address is: dph.illinois.gov/topics-services/environmental-health-protection/asbestos
 EMAIL Address: dph.asbestos@illinois.gov

PROTECTING HEALTH, IMPROVING LIVES
Nationally Accredited by PHAB

JAINA ASSOCIATES

THIS IS TO CERTIFY
THAT

DIONNE L. CAREY

HAS SUCCESSFULLY COMPLETED THE SAMPLING AND EVALUATING ASBESTOS AIRBORNE
DUST - NIOSH 582 EQUIVALENT TRAINING COURSE, AND PASSED THE EXAMINATION WITH
A SCORE OF 70% OR ABOVE FOR THE PURPOSE OF CERTIFICATION.

COURSE DATE: May 14 to 17, 2005

EXAM DATE: May 17, 2005

LOCATION: GSG Environmental, Inc.
855 West Adams Street, Suite 200
Chicago, Illinois 60607

DIRECTOR
OF TRAINING:


SANJIV JAIN

CERTIFICATE No.: 05JA-051405
IDPH COURSE PROVIDER No.: 038

2015



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/2/2015

Exam Date: 12/2/2015

Expiration Date: 12/2/2016

Certificate Number: BIR1512024159


Katy DeSalvo, Director

Reliable
Environmental
Solutions, Inc. **RES**

This is to certify that **Evan Christian**

*has on January 28 & 29, 2016, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Management Planner Initial Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: January 28 & 29, 2016

Examination Date: January 29, 2016

Expiration Date: January 29, 2017

Certificate Number: MP/0103

William S. Williams

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ www.ReliableEnv.com

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that
Evan Christian

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 11/19/2019

Exam Date: 11/19/2019

Expiration Date: 11/19/2020

Certificate Number: BIR1911192384


Kathy DeSalvo, Director



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 19466

ISSUED
4/12/2019

EXPIRES
05/15/2020

EVAN I CHRISTIAN
3024 N RACINE AVE, APT 2
CHICAGO, IL 60657



Environmental Health

ENDORSEMENTS

TC EXPIRES

INSPECTOR

11/28/2019

MANAGEMENT PLANNER

1/5/2019

PROJECT MANAGER

2/5/2020

AIR SAMPLING PROFESSIONAL

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

2019



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Management Planner Refresher

Occupational Training & Supply, Inc. certifies that

Evan Christian

has successfully completed the Asbestos Management Planner Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Course Date: 1/7/2019

Exam Date: 1/7/2019


Expiration Date: 1/7/2020

Certificate Number: MPR1901070063


Kathy DeSalvo, Director

Evan Christian

Illinois Licensed Project Manager, and Air Sampling Professional

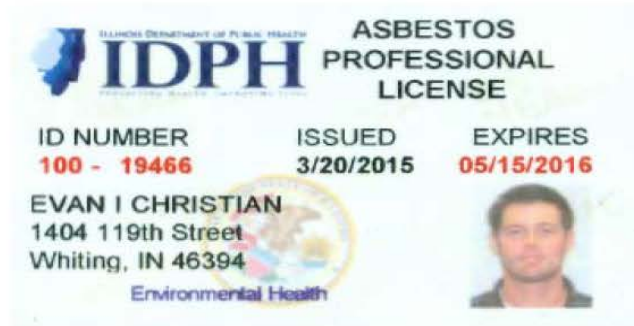

ENDORSEMENTS	TC EXPIRES
PROJECT MANAGER AIR SAMPLING PROFESSIONAL	12/12/2015
Alteration of this license shall result in legal action This license issued under authority of the State of Illinois Department of Public Health This license is valid only when accompanied by a valid training course certificate.	

**CARNOW
CONIBEAR**

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed