

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-2479
SCHOOL NAME: Tanner School
ADDRESS OF SCHOOL: 7350 S Evans
CITY: Chicago, IL, 60619

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 2/29/2016

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II (Please type or print)

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 345
IDPH INSPECTOR LICENSE NUMBER: 100-09106
IDPH LICENSED INSPECTOR NAME(Please Print): Michael Hasier
IDPH MP LICENSE NUMBER: 100-00746
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Amy Williams

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Tanner School

7350 S Evans
Chicago, IL, 60619

Unit: 26281
Building ID: 6970

IDPH ID Number: 14-016-2990-2479

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

TEM Environmental, Inc.

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

Amy Williams
100-00746

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: September 30, 2019

RE: Tanner School, Unit 26281
7350 S Evans
Chicago, IL, 60619

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Tanner School, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Tanner School, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Tanner School
Address: 7350 S Evans
IDPH ID: 14-016-2990-2479
Contact:

Unit: 26281
Chicago, IL, 60619
Building ID: 6970
Phone:

Region: 05

2. Description of Facility

Original Construction: 1963
Total Square Footage: 52920
Current Occupancy: 345

Additional Construction:
No of Floors: 3

3. LEA Designated Person

Contact: Robert Christlieb
Address: 42 West Madison Street
Chicago, IL 60602

Phone: (773) 553-3197

4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Glendale Heights, IL, 60139
Phone: 630-790-0880

Fax: 630-790-0882

5. Inspector

Inspector Name: Michael Hasier

Inspector IDPH license # 100-09106

Signature:
Date: 9/30/2019

6. Management Planner

Management Planner Name: Amy Williams

Management Planner IDPH license # 100-00746

Signature:
Date: 10/24/2019

7. Review Date:10/24/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Tanner School. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas(HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 6970:

15	Popcorn Ceiling
16	Sink Insulation
D	Pipe Fittings

B. The following new homogenous areas have been identified for Building 6970:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

02	12x12 Floor Tile Gray w/Gray Specks
02A	12x12 Gray Floor Tile
05	Sleeve for Vibration Duct
06	Brown Baseboard
07	Brown Baseboard Mastic
10	12X12 White w/Brown Specks Floor Tile
10A	12x12 White w/Brown Specks Floor Tile Mastic
11	12x12 Pink w/Specks Floor Tile
11A	12x12 Pink w/Specks Floor Tile Mastic
12	Floor Tile and Mastic - Not Observed
13	12x12 Blue Mottle Floor Tile
14	12x12 Blue Mottle Floor Tile Mastic
15	Popcorn Ceiling
16	Sink Insulation
17	Spray-On Acoustical Plaster

The following areas were deemed to be inaccessible:

05	Sleeve for Vibration Duct
07	Brown Baseboard Mastic
08	9x9 Gray Floor Tile Mastic
08A	9x9 Light Brown w/Specks Floor Tile Mastic
08B	9x9 Beige Floor Tile Mastic
08C	9x9 Floor Tile Mastic
08D	9x9 Brown Vinyl Floor Tile Mastic
09	12x12 Gray w/Gray Specks Floor Tile Mastic
09A	12x12 Gray Floor Tile Mastic
10A	12x12 White w/Brown Specks Floor Tile Mastic
11A	12x12 Pink w/Specks Floor Tile Mastic
14	12x12 Blue Mottle Floor Tile Mastic
B	Pipe Fittings

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by Michael Hasier, IDPH License # 100-09106. The Management Plan was updated by Amy Williams, IDPH License # 100-00746. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:	7/3/2019
	7/3/2019
	7/3/2019
	7/3/2019
	7/3/2019

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Tanner School Building 6970 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Tanner School Unit 26281 Building ID 6970

Address 7350 S Evans Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
02	12x12 Floor Tile Gray w/Gray Specks	1,836	SF	1st Floor Corridor South	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
02A	12x12 Gray Floor Tile	122	SF	Stage Entrance/LR Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
03	9x9 Gray w/White Specks Floor Tile	3,840	SF	Gymnasium	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
03A	9x9 Light Brown w/Specks Floor Tile	500	SF	Lunchroom Manager's Office, Kitchen Storeroom Next to Boiler Room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
03B	9x9 Beige Floor Tile	968	SF	Kitchen and Serving Area	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
03C	9x9 Dark Brown Vinyl Floor Tile	42	SF	East Stage Storage	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
03D	9x9 Brown Vinyl Floor Tile	90	SF	Rear Stage Entrance	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
03E	9x9 Orange Vinyl Floor Tile ABATED			Janitor's Locker Room	ABATED	MISC								
05	Sleeve for Vibration Duct	15	SF	Fan Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
06	Brown Baseboard	180	SF	Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
07	Brown Baseboard Mastic	180	LF	Lunchroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08	9x9 Gray Floor Tile Mastic	3,840	SF	Gymnasium	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08A	9x9 Light Brown w/Specks Floor Tile Mastic	500	SF	Kitchen Storeroom next to Boiler Room, Lunchroom Manager's Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08B	9x9 Beige Floor Tile Mastic	968	SF	Kitchen and Serving Area	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08C	9x9 Floor Tile Mastic	42	SF	East Stage Storage	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08D	9x9 Brown Vinyl Floor Tile Mastic	90	SF	Rear Stage Entrance	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
08E	9x9 Orange Floor Tile Mastic - EXPOSED	72	SF	Janitor's Locker Room	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09	12x12 Gray w/Gray Specks Floor Tile Mastic	1,836	SF	1st Floor South Corridor	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
09A	12x12 Gray Floor Tile Mastic	122	SF	Stage Entrance/ LR Office	CHR	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
10	12X12 White w/Brown Specks Floor Tile	40,000	SF	Throughout School	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Tanner School Unit 26281 Building ID 6970

Address 7350 S Evans Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
10A	12x12 White w/Brown Specks Floor Tile Mastic	40,000	SF	Throughout School	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	12x12 Pink w/Specks Floor Tile	786	SF	1st, 2nd & 3rd Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11A	12x12 Pink w/Specks Floor Tile Mastic	786	SF	1st, 2nd & 3rd Floor Corridors	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	Floor Tile and Mastic - Not Observed			Storage Room 109B	ASSUMED	MISC								
13	12x12 Blue Mottle Floor Tile	1,400	SF	Rooms 103B & 105	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
14	12x12 Blue Mottle Floor Tile Mastic	1,400	SF	Rooms 103B & 105	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	Popcorn Ceiling	1,300	SF	Elevator Lobby 1st, 2nd & 3rd Floor	ASSUMED	SURFACE	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW
16	Sink Insulation	15	SF	Rooms 105 & 304	ASSUMED	SURFACE	N	NONE	0		Yes	ACBM with the potential for damage		LOW
17	Spray-On Acoustical Plaster	37,000	SF	Throughout Corridors & Classrooms	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
B	Pipe Fittings	150	LF	1st, 2nd & 3rd Floor Janitors' Closets (Access Panel to Bathroom Pipe Chases), Engineer's Office	CHR	TSI	Y	DIST	30		No	Damaged or significantly damaged friable thermal system insulating ACBM	3	MODERATE
C	Mag Block Insulation (Removed) ABATED			Boiler Room	ABATED	TSI								
D	Pipe Fittings	70	JOINTS	Fan Room	CHR	TSI	Y	NONE	0		Yes	Any remaining friable ACBM or friable suspect ACBM		LOW

Chicago Public Schools

School Tanner School Unit 26281 Building ID 6970

Address 7350 S Evans Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date	<u>9/30/2019</u>
Inspector Name	<u>Michael Hasier</u>
<u>100-09106</u>	<u>5/15/2020</u>
Inspector's IDPH License Number / Expiration Date	

Inspector's Comments

HA Number:	Inspector Comments:
02	
02A	
03	
03A	
03B	
03C	
03D	
03E	
05	
06	
07	
08	
08A	
08B	
08C	
08D	
08E	
09	
09A	
10	
10A	
11	
11A	

Chicago Public Schools

School Tanner School **Unit** 26281 **Building ID** 6970

Address 7350 S Evans **Region** 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA Number:	Inspector Comments:
12	Not Observed 2019
13	
14	
15	
16	
17	
B	
C	
D	

Table II

Management Planner's Review

Chicago Public Schools

School Tanner School

Unit 26281

Building ID 6970

Address 7350 S Evans

Chicago, IL, 60619

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
02	12x12 Floor Tile Gray w/Gray Specks	1,836	SF	1st Floor Corridor South	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02A	12x12 Gray Floor Tile	122	SF	Stage Entrance/LR Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	9x9 Gray w/White Specks Floor Tile	3,840	SF	Gymnasium	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03A	9x9 Light Brown w/Specks Floor Tile	500	SF	Lunchroom Manager's Office, Kitchen Storeroom Next to Boiler Room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03B	9x9 Beige Floor Tile	968	SF	Kitchen and Serving Area	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03C	9x9 Dark Brown Vinyl Floor Tile	42	SF	East Stage Storage	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03D	9x9 Brown Vinyl Floor Tile	90	SF	Rear Stage Entrance	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03E	9x9 Orange Vinyl Floor Tile ABATED			Janitor's Locker Room	Abated	MISC					
05	Sleeve for Vibration Duct	15	SF	Fan Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	Brown Baseboard	180	SF	Lunchroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	Brown Baseboard Mastic	180	LF	Lunchroom	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
08	9x9 Gray Floor Tile Mastic	3,840	SF	Gymnasium	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08A	9x9 Light Brown w/Specks Floor Tile Mastic	500	SF	Kitchen Storeroom next to Boiler Room, Lunchroom Manager's Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08B	9x9 Beige Floor Tile Mastic	968	SF	Kitchen and Serving Area	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08C	9x9 Floor Tile Mastic	42	SF	East Stage Storage	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08D	9x9 Brown Vinyl Floor Tile Mastic	90	SF	Rear Stage Entrance	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08E	9x9 Orange Floor Tile Mastic - EXPOSED	72	SF	Janitor's Locker Room	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	12x12 Gray w/Gray Specks Floor Tile Mastic	1,836	SF	1st Floor South Corridor	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09A	12x12 Gray Floor Tile Mastic	122	SF	Stage Entrance/ LR Office	Chrysotile	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10	12X12 White w/Brown Specks Floor Tile	40,000	SF	Throughout School	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
10A	12x12 White w/Brown Specks Floor Tile Mastic	40,000	SF	Throughout School	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	12x12 Pink w/Specks Floor Tile	786	SF	1st, 2nd & 3rd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11A	12x12 Pink w/Specks Floor Tile Mastic	786	SF	1st, 2nd & 3rd Floor Corridors	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	Floor Tile and Mastic - Not Observed			Storage Room 109B	Assumed	MISC					
13	12x12 Blue Mottle Floor Tile	1,400	SF	Rooms 103B & 105	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
14	12x12 Blue Mottle Floor Tile Mastic	1,400	SF	Rooms 103B & 105	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	Popcorn Ceiling	1,300	SF	Elevator Lobby 1st, 2nd & 3rd Floor	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
16	Sink Insulation	15	SF	Rooms 105 & 304	Assumed	SURFACE	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
17	Spray-On Acoustical Plaster	37,000	SF	Throughout Corridors & Classrooms	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
B	Pipe Fittings	150	LF	1st, 2nd & 3rd Floor Janitors' Closets	Chrysotile	TSI	Yes	30	LF	1 Damaged or significantly damaged	Repair

Chicago Public Schools

School Tanner School

Unit 26281

Building ID 6970

Address 7350 S Evans

Chicago, IL, 60619

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
				(Access Panel to Bathroom Pipe Chases), Engineer's Office						friable thermal system insulating ACBM	
C	Mag Block Insulation (Removed) ABATED			Boiler Room	Abated	TSI					
D	Pipe Fittings	70	JOINTS	Fan Room	Chrysotile	TSI	Yes	0	JOINTS	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan

Chicago Public Schools

School Tanner School

Unit 26281

Building ID 6970

Address 7350 S Evans

Chicago, IL, 60619

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Review Date	10/24/2019
Manager Planner Name	Amy Williams
100-00746	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
02	
02A	
03	
03A	
03B	
03C	
03D	
03E	
05	
06	
07	
08	
08A	
08B	
08C	
08D	
08E	
09	
09A	
10	
10A	
11	
11A	
12	
13	
14	

Chicago Public Schools

School Tanner School

Unit 26281

Building ID 6970

Address 7350 S Evans

Chicago, IL, 60619

Region 05

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Management Comments
15	
16	
17	
B	
C	
D	

Chicago Public Schools

TEM Environmental, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02		
MATERIAL DESCRIPTION:	12x12 Floor Tile Gray w/Gray Specks		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor Corridor South		
MATERIAL QUANTITY:	1836	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	02				
MATERIAL DESCRIPTION:	12x12 Floor Tile Gray w/Gray Specks				
MATERIAL LOCATION:	1st Floor Corridor South				
MATERIAL QUANTITY:	1836	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/24/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	02A		
MATERIAL DESCRIPTION:	12x12 Gray Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stage Entrance/LR Office		
MATERIAL QUANTITY:	122	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	02A		
MATERIAL DESCRIPTION:	12x12 Gray Floor Tile		
MATERIAL LOCATION:	Stage Entrance/LR Office		
MATERIAL QUANTITY:	122	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	03		
MATERIAL DESCRIPTION:	9x9 Gray w/White Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gymnasium		
MATERIAL QUANTITY:	3840	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA: **03**

MATERIAL DESCRIPTION: **9x9 Gray w/White Specks Floor Tile**

MATERIAL LOCATION: **Gymnasium**

MATERIAL QUANTITY: **3840**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	03A		
MATERIAL DESCRIPTION:	9x9 Light Brown w/Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom Manager's Office, Kitchen Storeroom Next to Boiler Room		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	03A		
MATERIAL DESCRIPTION:	9x9 Light Brown w/Specks Floor Tile		
MATERIAL LOCATION:	Lunchroom Manager's Office, Kitchen Storeroom Next to Boiler Room		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	03B		
MATERIAL DESCRIPTION:	9x9 Beige Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen and Serving Area		
MATERIAL QUANTITY:	968	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	03B				
MATERIAL DESCRIPTION:	9x9 Beige Floor Tile				
MATERIAL LOCATION:	Kitchen and Serving Area				
MATERIAL QUANTITY:	968	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	03C		
MATERIAL DESCRIPTION:	9x9 Dark Brown Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	East Stage Storage		
MATERIAL QUANTITY:	42	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	03C		
MATERIAL DESCRIPTION:	9x9 Dark Brown Vinyl Floor Tile		
MATERIAL LOCATION:	East Stage Storage		
MATERIAL QUANTITY:	42	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	03D		
MATERIAL DESCRIPTION:	9x9 Brown Vinyl Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rear Stage Entrance		
MATERIAL QUANTITY:	90	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	03D		
MATERIAL DESCRIPTION:	9x9 Brown Vinyl Floor Tile		
MATERIAL LOCATION:	Rear Stage Entrance		
MATERIAL QUANTITY:	90	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26281** BUILDING ID: **6970**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **Michael Hasier**
SCHOOL NAME: **Tanner School** INSPECTION DATE: **9/30/2019**
ADDRESS: **7350 S Evans** IDPH LICENSE NO: **100-09106**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03E**
MATERIAL DESCRIPTION: **9x9 Orange Vinyl Floor Tile ABATED**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Abated** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Janitor's Locker Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: **09/30/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA: **03E**

MATERIAL DESCRIPTION: **9x9 Orange Vinyl Floor Tile ABATED**

MATERIAL LOCATION: **Janitor's Locker Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	05		
MATERIAL DESCRIPTION:	Sleeve for Vibration Duct		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Fan Room		
MATERIAL QUANTITY:	15	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA: **05**

MATERIAL DESCRIPTION: **Sleeve for Vibration Duct**

MATERIAL LOCATION: **Fan Room**

MATERIAL QUANTITY: **15**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	06		
MATERIAL DESCRIPTION:	Brown Baseboard		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA: **06**

MATERIAL DESCRIPTION: **Brown Baseboard**

MATERIAL LOCATION: **Lunchroom**

MATERIAL QUANTITY:	180	MATERIAL UNITS:	SF
--------------------	------------	-----------------	-----------

DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
------------------	----------	---------------	-----------

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	07		
MATERIAL DESCRIPTION:	Brown Baseboard Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Lunchroom		
MATERIAL QUANTITY:	180	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA: 07

MATERIAL DESCRIPTION: Brown Baseboard Mastic

MATERIAL LOCATION: Lunchroom

MATERIAL QUANTITY: 180

MATERIAL UNITS: LF

DAMAGE QUANTITY: 0

DAMAGE UNITS: LF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/24/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	9x9 Gray Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Gymnasium		
MATERIAL QUANTITY:	3840	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	08		
MATERIAL DESCRIPTION:	9x9 Gray Floor Tile Mastic		
MATERIAL LOCATION:	Gymnasium		
MATERIAL QUANTITY:	3840	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/24/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08A		
MATERIAL DESCRIPTION:	9x9 Light Brown w/Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen Storeroom next to Boiler Room, Lunchroom Manager's Office		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	08A		
MATERIAL DESCRIPTION:	9x9 Light Brown w/Specks Floor Tile Mastic		
MATERIAL LOCATION:	Kitchen Storeroom next to Boiler Room, Lunchroom Manager's Office		
MATERIAL QUANTITY:	500	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08B		
MATERIAL DESCRIPTION:	9x9 Beige Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Kitchen and Serving Area		
MATERIAL QUANTITY:	968	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	08B		
MATERIAL DESCRIPTION:	9x9 Beige Floor Tile Mastic		
MATERIAL LOCATION:	Kitchen and Serving Area		
MATERIAL QUANTITY:	968	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08C		
MATERIAL DESCRIPTION:	9x9 Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	East Stage Storage		
MATERIAL QUANTITY:	42	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA: **08C**

MATERIAL DESCRIPTION: **9x9 Floor Tile Mastic**

MATERIAL LOCATION: **East Stage Storage**

MATERIAL QUANTITY: **42**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08D		
MATERIAL DESCRIPTION:	9x9 Brown Vinyl Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rear Stage Entrance		
MATERIAL QUANTITY:	90	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	08D				
MATERIAL DESCRIPTION:	9x9 Brown Vinyl Floor Tile Mastic				
MATERIAL LOCATION:	Rear Stage Entrance				
MATERIAL QUANTITY:	90	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/24/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	08E		
MATERIAL DESCRIPTION:	9x9 Orange Floor Tile Mastic - EXPOSED		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Janitor's Locker Room		
MATERIAL QUANTITY:	72	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	08E		
MATERIAL DESCRIPTION:	9x9 Orange Floor Tile Mastic - EXPOSED		
MATERIAL LOCATION:	Janitor's Locker Room		
MATERIAL QUANTITY:	72	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	12x12 Gray w/Gray Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st Floor South Corridor		
MATERIAL QUANTITY:	1836	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	09		
MATERIAL DESCRIPTION:	12x12 Gray w/Gray Specks Floor Tile Mastic		
MATERIAL LOCATION:	1st Floor South Corridor		
MATERIAL QUANTITY:	1836	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	09A		
MATERIAL DESCRIPTION:	12x12 Gray Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Stage Entrance/ LR Office		
MATERIAL QUANTITY:	122	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	09A				
MATERIAL DESCRIPTION:	12x12 Gray Floor Tile Mastic				
MATERIAL LOCATION:	Stage Entrance/ LR Office				
MATERIAL QUANTITY:	122	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	12X12 White w/Brown Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout School		
MATERIAL QUANTITY:	40000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	10		
MATERIAL DESCRIPTION:	12X12 White w/Brown Specks Floor Tile		
MATERIAL LOCATION:	Throughout School		
MATERIAL QUANTITY:	40000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	10A		
MATERIAL DESCRIPTION:	12x12 White w/Brown Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout School		
MATERIAL QUANTITY:	40000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	10A				
MATERIAL DESCRIPTION:	12x12 White w/Brown Specks Floor Tile Mastic				
MATERIAL LOCATION:	Throughout School				
MATERIAL QUANTITY:	40000	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	12x12 Pink w/Specks Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Corridors		
MATERIAL QUANTITY:	786	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	11		
MATERIAL DESCRIPTION:	12x12 Pink w/Specks Floor Tile		
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Corridors		
MATERIAL QUANTITY:	786	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/24/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	11A		
MATERIAL DESCRIPTION:	12x12 Pink w/Specks Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Corridors		
MATERIAL QUANTITY:	786	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	11A				
MATERIAL DESCRIPTION:	12x12 Pink w/Specks Floor Tile Mastic				
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Corridors				
MATERIAL QUANTITY:	786	MATERIAL UNITS:	SF		
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/24/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	12	
MATERIAL DESCRIPTION:	Floor Tile and Mastic - Not Observed	
HISTORICAL AHERA DAMAGE CATEGORY		
HISTORICAL DAMAGE REASON:		
HISTORICAL RESPONSE ACTION:		
ASBESTOS TYPE:	Assumed	FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Storage Room 109B

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS: Not Observed 2019

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA: **12**

MATERIAL DESCRIPTION: **Floor Tile and Mastic - Not Observed**

MATERIAL LOCATION: **Storage Room 109B**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	13		
MATERIAL DESCRIPTION:	12x12 Blue Mottle Floor Tile		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 103B & 105		
MATERIAL QUANTITY:	1400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	13		
MATERIAL DESCRIPTION:	12x12 Blue Mottle Floor Tile		
MATERIAL LOCATION:	Rooms 103B & 105		
MATERIAL QUANTITY:	1400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/24/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	12x12 Blue Mottle Floor Tile Mastic		
HISTORICAL AHERA DAMAGE CATEGORY	6 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 103B & 105		
MATERIAL QUANTITY:	1400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	14		
MATERIAL DESCRIPTION:	12x12 Blue Mottle Floor Tile Mastic		
MATERIAL LOCATION:	Rooms 103B & 105		
MATERIAL QUANTITY:	1400	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	Popcorn Ceiling		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Elevator Lobby 1st, 2nd & 3rd Floor		
MATERIAL QUANTITY:	1300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	15		
MATERIAL DESCRIPTION:	Popcorn Ceiling		
MATERIAL LOCATION:	Elevator Lobby 1st, 2nd & 3rd Floor		
MATERIAL QUANTITY:	1300	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: 10/24/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	16		
MATERIAL DESCRIPTION:	Sink Insulation		
HISTORICAL AHERA DAMAGE CATEGORY	6 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	No

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Rooms 105 & 304		
MATERIAL QUANTITY:	15	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA: **16**

MATERIAL DESCRIPTION: **Sink Insulation**

MATERIAL LOCATION: **Rooms 105 & 304**

MATERIAL QUANTITY: **15**

MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0**

DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	Spray-On Acoustical Plaster		
HISTORICAL AHERA DAMAGE CATEGORY	7 Any remaining friable ACBM or friable suspect ACBM		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Assumed	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Throughout Corridors & Classrooms		
MATERIAL QUANTITY:	37000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	17		
MATERIAL DESCRIPTION:	Spray-On Acoustical Plaster		
MATERIAL LOCATION:	Throughout Corridors & Classrooms		
MATERIAL QUANTITY:	37000	MATERIAL UNITS:	SF
DAMAGE QUANTITY:	0	DAMAGE UNITS:	SF

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	B		
MATERIAL DESCRIPTION:	Pipe Fittings		
HISTORICAL AHERA DAMAGE CATEGORY	1 Damaged or significantly damaged friable thermal system insulating ACM		
HISTORICAL DAMAGE REASON:	Deterioration		
HISTORICAL RESPONSE ACTION:	Remove		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be 1. **Damaged or significantly damaged friable thermal system insulating ACM**

DAMAGE REASON:	Deterioration		
DISTURBANCE POTENTIAL:	MODERATE		
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Janitors' Closets (Access Panel to Bathroom Pipe Chases), Engineer's Office		
MATERIAL QUANTITY:	150	MATERIAL UNITS:	LF
DAMAGE QUANTITY:	30	DAMAGE UNITS:	LF
COMMENTS:			

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	B				
MATERIAL DESCRIPTION:	Pipe Fittings				
MATERIAL LOCATION:	1st, 2nd & 3rd Floor Janitors' Closets (Access Panel to Bathroom Pipe Chases), Engineer's Office				
MATERIAL QUANTITY:	150	MATERIAL UNITS:	LF		
DAMAGE QUANTITY:	30	DAMAGE UNITS:	LF		

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Remove

Comments:

Management Planner's Signature: _____ Date: 10/24/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	C		
MATERIAL DESCRIPTION:	Mag Block Insulation (Removed) ABATED		
HISTORICAL AHERA DAMAGE CATEGORY			
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:			
ASBESTOS TYPE:	Abated	FRIABLE:	

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: Boiler Room

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

COMMENTS:

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA: **C**

MATERIAL DESCRIPTION: **Mag Block Insulation (Removed) ABATED**

MATERIAL LOCATION: **Boiler Room**

MATERIAL QUANTITY:

MATERIAL UNITS:

DAMAGE QUANTITY:

DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	AHERA INSPECTOR:	Michael Hasier		
SCHOOL NAME:	Tanner School	INSPECTION DATE:	9/30/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA:	D		
MATERIAL DESCRIPTION:	Pipe Fittings		
HISTORICAL AHERA DAMAGE CATEGORY	7 ACBM with the potential for damage		
HISTORICAL DAMAGE REASON:			
HISTORICAL RESPONSE ACTION:	Follow O&M Plan		
ASBESTOS TYPE:	Chrysotile	FRIABLE:	Yes

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL:	LOW		
MATERIAL LOCATION:	Fan Room		
MATERIAL QUANTITY:	70	MATERIAL UNITS:	JOINTS
DAMAGE QUANTITY:	0	DAMAGE UNITS:	JOINTS

COMMENTS:

Inspector's Signature: _____ Date: 09/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME:	Chicago Public Schools	UNIT NUMBER:	26281	BUILDING ID:	6970
CITY/STATE:	Chicago, Illinois	MANAGEMENT PLANNER:	Amy Williams		
SCHOOL NAME:	Tanner School	REVIEW DATE:	10/24/2019		
ADDRESS:	7350 S Evans	IDPH LICENSE NO:	100-09106		

HOMOGENEOUS AREA:	D		
MATERIAL DESCRIPTION:	Pipe Fittings		
MATERIAL LOCATION:	Fan Room		
MATERIAL QUANTITY:	70	MATERIAL UNITS:	JOINTS
DAMAGE QUANTITY:	0	DAMAGE UNITS:	JOINTS

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **10/24/2019**

Chicago Public Schools

TEM Environmental, Inc.

2019 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

CERTIFICATE OF ACHIEVEMENT ASBESTOS ABATEMENT

Accredited by the Illinois Department of Public Health

This is to certify that MICHAEL HASIER
has completed the ASBESTOS INSPECTOR'S REFRESHER course and successfully passed the
examination on 05/01/2019 with a minimum score of 70% or better. Training was in accordance
with U.S. E.P.A. 40 CFR 763 Subpart E, Appendix C, Asbestos Containing Materials in Schools:
Model Accreditation Plan, TSCA II, Authorized by both AHERA & ASHARA.

05/01/2019

Course Dates:

05/01/2020

Expires:

1905BIR02

Certificate Number:



PUBLIC HEALTH & SAFETY inc.

Environmental and Occupational Services
375 S. Arland Ave., Chicago, IL 60607

www.public-health-safety.com

Office: 312-491-0081
Fax: 312-421-2901

Director of Training

Nicholas J. Peneff

Doctor of Public Health

Phone: 312-491-0081

FORM # A-010B

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License



ASBESTOS PROFESSIONAL LICENSE

ENDORSEMENTS

TO EXPIRES

SUPERVISOR/WORKER

3/1/2020

INSPECTOR

5/1/2020

ID NUMBER

ISSUED

EXPIRES

100 - 09106

5/8/2019

05/15/2020

PROJECT MANAGER

3/1/2020

AIR SAMPLING PROFESSIONAL

MICHAEL S HASLER

444 OLD BARN RD., APT. B
BARRINGTON, IL 60010

Environmental Health



Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health

This license is valid only when accompanied by a valid
training course certificate.

Reliable
Environmental
Solutions, Inc. **RES**

This is to certify that **Amy J. Williams**

*has on 04/03/19, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Building Inspector Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: April 03, 2019

COURSE LENGTH: 4 HOURS

Examination Date: April 03, 2019

Expiration Date: April 03, 2020

Certificate Number: BIR/0808

William S. Williams

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ www.ReliableEnv.com



2539 Vandalia Street, Collinsville, IL 62234 * Phone: 618-855-8764

Environmental and Occupational Safety & Health Training

Does hereby certify

William Williams

4211 Westgate Drive, Springfield, IL 62711

*Has successfully completed and passed the course examination with at least
70% for re-accreditation under AHERA (Title II)*

Asbestos Management Planner Refresher

Class Date: 02/15/2019
Examination Date: 02/15/2019
STC Certificate Number: STC-20190215-000527AMPR
Certification Expiration: 02/15/2020

David M. Mendoza – President/Training Director
Certified Environmental Specialist
OSHA Authorized Instructor

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License



ASBESTOS PROFESSIONAL LICENSE

ENDORSEMENTS

TC EXPIRES

INSPECTOR

4/21/2019

ID NUMBER

ISSUED

EXPIRES

100 - 00746

4/11/2019

05/15/2020

MANAGEMENT PLANNER

4/21/2019

PROJECT MANAGER

4/2/2020


AIR SAMPLING PROFESSIONAL

AMY J WILLIAMS

1408 S CLAY

JACKSONVILLE, IL 62650

Environmental Health

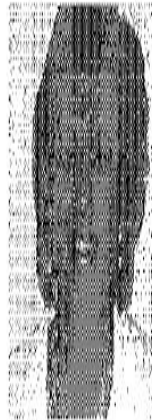

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed