

**ILLINOIS DEPARTMENT OF PUBLIC HEALTH
AHERA THREE YEAR REINSPECTION
ASBESTOS ABATEMENT PROGRAM
SCHOOL INFORMATION FORM**

SECTION I

NAME OF SCHOOL DISTRICT: CHICAGO SCHOOL DIST 299
SCHOOL ID NUMBER: 14-016-2990-3519
SCHOOL NAME: Barbara Vick Center
ADDRESS OF SCHOOL: 2554 West 113th Street
CITY: Chicago, IL, 60655

DATE LAST THREE YEAR REINSPECTION WAS COMPLETED 2/29/2016

If the address on this form is different than the address of the building, submit a written explanation.

SECTION II *(Please type or print)*

PLEASE COMPLETE THE FOLLOWING FOR YOUR THREE YEAR REINSPECTION:

DATE REINSPECTION COMPLETED: 10/1/2019 ENROLLMENT 378
IDPH INSPECTOR LICENSE NUMBER: 100-05763
IDPH LICENSED INSPECTOR NAME(Please Print): John O'Brien
IDPH MP LICENSE NUMBER: 100-00746
IDPH LICENSED MANAGEMENT PLANNER NAME (Please Print): Amy Williams

DESIGNATED PERSON (Please Print): Robert Christlieb PHONE: (773) 553-3197



10/1/2019

Signature of Designated Person

Date

SECTION III

PLEASE COMPLETE THE FOLLOWING INFORMATION FOR ANY CHANGES WITHIN THE SCHOOL DISTRICT.

School building has been sold. Date of Sale: _____

School has been closed. Date closed: _____

School building has been demolished. Date: _____

School building is asbestos free since last reinspection: _____

Please explain in writing why the school building is now asbestos free and include the supporting documentation.

If a new school building has been added to the district, submit either an exclusionary statement or a management plan and inspection report. Include the complete name, address and city of school building.

Explain in writing if the address of the building is different than the address on this form:

THREE-YEAR REINSPECTION

CHICAGO SCHOOL DIST 299

Barbara Vick Center

2554 West 113th Street
Chicago, IL, 60655

Unit: 26731
Building ID: 2920

IDPH ID Number: 14-016-2990-3519

REPORT DATE:

Tuesday, October 01, 2019

Prepared for:

**Chicago Public Schools
42 West Madison Street
Chicago, IL 60602**

Prepared by:

TEM Environmental, Inc.

174 N. Brandon Drive

Glendale Heights, IL, 60139

Phone 630-790-0880

Fax 630-790-0882

**DO NOT REMOVE FROM SCHOOL
REQUIRED BY FEDERAL LAW**

August 30, 2019

Mr. Glen E. Garner
Asbestos Program
Illinois Department of Public Health
525 West Jefferson Street
Springfield, Illinois 62761

Re: Chicago Public Schools - 2019 Three-Year Reinspections

Dear Mr. Glen:

TEM Environmental, Inc. , Managing Environmental Consultant (MEC), conducted the Three-Year Reinspections and performed management plan updates for the Chicago Public Schools (CPS) facilities in Region 5, 6 Elementary Schools. Please update your records with the following information.

School District: 299 Unit: 26731 Region: 06 IDPH ID:14-016-2990-3519

School: Barbara Vick Center Building ID: 2920

Address: 2554 West 113th Street

Chicago, IL, 60655

Building Contact:

Contact Phone:

Current Building Owners: Chicago Public Schools

Review Date: 09/26/2019

Inspector: John O'Brien

Inspector IDPH License: 100-05763

Management Planner: Amy Williams

Management Planner IDPH License: 100-00746

If you have any questions or comments, please contact us at 630-790-0880

Sincerely,
TEM Environmental, Inc.

Amy Williams
100-00746

Environmental Notification to Occupants

To: Faculty, Staff and Parents
From: Chicago Public Schools
Date: August 30, 2019

RE: Barbara Vick Center, Unit 26731
2554 West 113th Street
Chicago, IL, 60655

Dear Faculty, Staff and Parents,

This letter is to notify you that the 2019 asbestos three year re-inspection has been completed at Barbara Vick Center, following the Federal Asbestos Hazard Emergency Response Act (AHERA), 40 CFR Part 763, Subpart E and is available for your review at the main office of the school.

Although asbestos-containing materials have been identified at Barbara Vick Center, there is no reason to believe that any threat to the health of students or staff exists at this time. CPS will continue to carefully monitor the condition of asbestos-containing materials and if conditions warrant, all appropriate steps will be taken to maintain the health and safety of all building occupants.

If you have any questions regarding this matter or require additional information, please feel free to contact Robert Christlieb, the designated Local Education Authority's Designated Person at (773) 553-3197 .

Table of Contents

- I. School and Inspection Information
- II. Executive Summary
- III. Methodology
- IV. Abatement History
- V. Reassessments and Recommendations
- VI. Conclusions

Table I: Inspector's Reinspection Findings

Table II: Management Planner's Review

APPENDICES:

- Appendix A: Assessment Sheets, Drawings and Photos
- Appendix B: Inspector and Management Planner Licenses
- Appendix C: Laboratory Accreditations
- Appendix D: Laboratory Results
- Appendix E: Chain of Custody Forms

SCHOOL AND INSPECTION INFORMATION

1. School Information

School: Barbara Vick Center
Address: 2554 West 113th Street
IDPH ID: 14-016-2990-3519
Contact: Unit: 26731 Chicago, IL, 60655
Building ID: 2920
Phone: Region: 06

2. Description of Facility

Original Construction: 0
Total Square Footage: 9300
Current Occupancy: 378
Additional Construction:
No of Floors: 3

3. LEA Designated Person

Contact: Robert Christlieb
Address: 42 West Madison Street
Chicago, IL 60602
Phone: (773) 553-3197

4. Managing Environmental Consultant

MEC: TEM Environmental, Inc.
Contact: Steven Geneser
Address 174 N. Brandon Drive
Glendale Heights, IL, 60139
Phone: 630-790-0880
Fax: 630-790-0882

5. Inspector

Inspector Name: John O'Brien

Inspector IDPH license # 100-05763

Signature:
Date: 8/30/2019

6. Management Planner

Management Planner Name: Amy Williams

Management Planner IDPH license # 100-00746

Signature:
Date: 09/26/2019

7. Review Date:09/26/2019

8. LEA Designated Person's Acknowledgement

The reinspection report and recommendations have been received by me and appropriate action will be taken by the School District.

Signature:



Date: 10/1/2019

Name: Robert Christlieb

II. EXECUTIVE SUMMARY

TEM Environmental, Inc. was retained by the Chicago Public Schools (CPS) to perform a three-year asbestos reinspection of the Barbara Vick Center. This inspection was conducted in accordance with the United States Environmental Protection Agency (USEPA) Asbestos Hazard Emergency Response Act (AHERA) part 763.85 (b), and the ongoing Operations and Maintenance Program (O&M) originally designed in the School's Asbestos Management Plan. The purpose of this three-year reinspection is to record any condition changes in the asbestos-containing building material (ACBM) in the school since the previous three-year reinspection and the six-month periodic surveillance, to identify, assess, and include any Homogeneous Areas (HA) not identified in the Management Plan, and to recommend an appropriate response action to manage asbestos.

The inspector conducted a three-year reinspection of this facility under Illinois Department of Public Health (IDPH) school reinspection requirements and AHERA, sections 763.85 and 763.88. The main building and each addition to the main building, if constructed at different dates, were inspected separately. Laboratory accreditations are included in Appendix C, laboratory results are included in Appendix D, and chain of custody forms are included in Appendix E.

Note: During previous inspections, some of the HA(s) were identified together as 9" x 9" floor tile (FT), mastics assoc. with 9" x 9" FT, 12" x 12" FT, mastics assoc. with 12" x 12" FT, pipe insulation, etc. Some of these HA(s) have been re-identified by areas that are uniform in color, texture, construction date, application date, and general appearance.

The inspector has determined the following:

A. The following HAs have changed assessment categories for Building 2920:

B. The following new homogenous areas have been identified for Building 2920:

C. This reinspection covered only physically accessible and visible areas and materials that were identified in the LEA's management plan. The following materials were concealed and/or contained in areas that were inaccessible for sampling and have been classified as Assumed:

01	12"x12" Tan & Brown Speckled Floor Tile
02	12"x12" Tan & Brown Speckled Floor Tile Mastic
03	12"x12" Brown Floor Tile
04	12"x12" Brown Floor Tile Mastic
05	Drywall/Tape & Joint Compound
06	2'x4' Suspended Ceiling Tile
07	Vinyl Baseboard
08	Vinyl Baseboard Mastic
09	Plaster - Not Observed
10	Carpet Mastic
11	Black Boards
12	Sink Undercoating
13	Troweled on Ceiling Material
14	Insulation in Fire Doors
15	Window Caulk
16	Window Glaze
17	Door Caulking
62	Grey Terrazzo

The following areas were deemed to be inaccessible:

Materials were also listed as "assumed" if they were in good condition and sampling was not conducted to avoid damage.

This reinspection was conducted by John O'Brien, IDPH License # 100-05763. The Management Plan was updated by Amy Williams, IDPH License # 100-00746. Inspector and Management Planner Licenses are included in Appendix B.

III. METHODOLOGY

Tasks performed on-site included the following:

1. Review current management plan, identify HA(s) and extract appropriate information.
2. Examine and verify abatement records.
3. Touch and visually and physically reinspect and reassess the condition of all friable known or assumed ACBM.
4. Touch and visually and physically reinspect all non-friable known or assumed ACBM to determine whether these materials have become friable since the last inspection or periodic surveillance.
5. Identify any condition changes that may affect Hazard ranking of known ACBM or Assumed ACBM, as well as any HA(s) that have become friable since the last reinspection.
6. Collect bulk samples from each newly discovered friable HA or previously assumed and submit for laboratory analysis.
7. Tabulate reinspection findings and submit for management planner review and recommendations with appropriate response actions based on the AHERA Damage Category of the ACBM.
8. Submit reinspection findings and management planner recommendations to the LEA within thirty (30) days for inclusion into the management plan.

IV. ABATEMENT HISTORY

The information collected from the existing management plan and inspection report(s) and from interviews with the school official revealed that the following asbestos abatement was conducted at the school since the previous Three year Reinspection.

Abatement Dates:

V. REASSESSMENTS AND RECOMMENDATIONS

The reassessments and recommendations are summarized in Tables I and II on the following pages. Detailed Hazard Assessment Sheets and Drawings and Photos (if applicable) are included in Appendix A.

VI. CONCLUSIONS

The Barbara Vick Center Building 2920 Three-Year reinspection has been completed and response actions have been recommended for both friable and non-friable materials. Atimely execution of the response actions recommended will enable the LEA and the Designated Person(s) to effectively manage the existing ACBM.

This three-year reinspection report should be inspected in the current Management plan at the CPS Central Office, and one (1) copy should be kept at the school for use when planning any renovation and/or demolition activities in areas where ACBM has been identified. Also, periodic surveillance documentation and any summary reports from any response actions that are executed at the school should be used to update the Management Plan.

Table I
Inspector's Reinspection Findings

Chicago Public Schools

School Barbara Vick Center Unit 26731 Building ID 2920

Address 2554 West 113th Street Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

HA No	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Type	Damage Quantity	Damage Units	Change in Assessment Category	Damage Category	Damage Reason	Disturbance Potential
				102, 103, 104, 105, 106										
10	Carpet Mastic	350	SF	Main Office and Principal's Office	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
11	Black Boards	480	SF	101, 102, 103, 104, 105, 106	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
12	Sink Undercoating	30	SF	Rooms 101, 102, 103, 104, 105, 106 & 111	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
13	Troweled on Ceiling Material	130	SF	Main Office	ASSUMED	SURFACE	Y	NONE	0		No	Any remaining friable ACBM or friable suspect ACBM		LOW
14	Insulation in Fire Doors	140	SF	Boiler Room, Crawlspace, Main Office, Case Management Room, Security Room	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
15	Window Caulk	510	LF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
16	Window Glaze	510	LF	Throughout Facility	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
17	Door Caulking	100	LF	Entrance to Building	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW
62	Grey Terrazzo	1,200	SF	Corridor, Restroom/Converted Restroom	ASSUMED	MISC	N	NONE	0		No	ACBM with the potential for damage		LOW

Chicago Public Schools

School Barbara Vick Center Unit 26731 Building ID 2920

Address 2554 West 113th Street Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Reinspection Date 8/30/2019
Inspector Name John O'Brien
100-05763 5/15/2020
Inspector's IDPH License Number / Expiration Date

Inspector's Comments

HA Number:	Inspector Comments:
01	
02	
03	
04	
05	
06	
07	
08	
09	Not Observed 2019
10	
11	
12	
13	Not Observed, Above Drop Ceiling
14	
15	
16	
17	
62	

Chicago Public Schools

School Barbara Vick Center **Unit** 26731 **Building ID** 2920

Address 2554 West 113th Street **Region** 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Inspector's Reinspection Findings Table 1

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880 Fax: 630-790-0882

Inspector's Comments are Summarized at the End of the Report

Table II

Management Planner's Review

Chicago Public Schools

School Barbara Vick Center
Address 2554 West 113th Street

Unit 26731
 Chicago, IL, 60655

Building ID 2920
Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
01	12"x12" Tan & Brown Speckled Floor Tile	14,628	SF	Kitchen, Multipurpose Room, 101, 102, 103, 104, 105, 106, 107, 111, Main Office & Storage and Case Management Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
02	12"x12" Tan & Brown Speckled Floor Tile Mastic	14,628	SF	Kitchen, Multipurpose Room, 101, 102, 103, 104, 105, 106, 107, 111, Main Office & Storage and Case Management Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
03	12"x12" Brown Floor Tile	70	SF	Janitor's Closet, North Vestibule	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
04	12"x12" Brown Floor Tile Mastic	70	SF	Janitor's Closet, North Vestibule	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
05	Drywall/Tape & Joint Compound	2,379	SF	Hallway, Entrances, 101, Main Office, Restrooms and Supply Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
06	2'x4' Suspended Ceiling Tile	6,803	SF	Kitchen, Multipurpose Room, 101, 102, 103, 104, 105, 106, 111, Main Office & Storage, Case Management Room	Assumed	MISC	Yes	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
07	Vinyl Baseboard	1,424	SF	Rooms 101, 102, 103, 104, 105, 106, 111, Kitchen, Multipurpose Room, Main Office & Storage, Case Management Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
08	Vinyl Baseboard Mastic	1,424	SF	Rooms 101, 102, 103, 104, 105, 106, 111, Kitchen, Multipurpose Room, Main Office & Storage, Case Management Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
09	Plaster - Not Observed			Kitchen, Multipurpose Room, 102, 103, 104, 105, 106	Assumed	SURFACE					
10	Carpet Mastic	350	SF	Main Office and Principal's Office	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
11	Black Boards	480	SF	101, 102, 103, 104, 105, 106	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
12	Sink Undercoating	30	SF	Rooms 101, 102, 103, 104, 105, 106 & 111	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
13	Troweled on Ceiling Material	130	SF	Main Office	Assumed	SURFACE	Yes	0	SF	7 Any remaining friable ACBM or friable suspect ACBM	Follow O&M Plan
14	Insulation in Fire Doors	140	SF	Boiler Room, Crawlspace, Main Office, Case Management Room, Security Room	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan
15	Window Caulk	510	LF	Throughout Facility	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Barbara Vick Center
Address 2554 West 113th Street

Unit 26731
 Chicago, IL, 60655

Building ID 2920
Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

HA Number	Material Description	Material Quantity	Material Units	Material Location	Asbestos Type	Material Category	Friable	Damage Quantity	Damage Units	Damage Category	Response
16	Window Glaze	510	LF	Throughout Facility	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
17	Door Caulking	100	LF	Entrance to Building	Assumed	MISC	No	0	LF	6 ACBM with the potential for damage	Follow O&M Plan
62	Grey Terrazzo	1,200	SF	Corridor, Restroom/Converted Restroom	Assumed	MISC	No	0	SF	6 ACBM with the potential for damage	Follow O&M Plan

Chicago Public Schools

School Barbara Vick Center
Address 2554 West 113th Street

Unit 26731
 Chicago, IL, 60655

Building ID 2920
Region 06

ASBESTOS REINSPECTION FINDINGS AND RECOMMENDATIONS

Management Planner's Review Table II

Managing Environmental Consultant (MEC) TEM Environmental, Inc.

174 N. Brandon Drive Glendale Heights, IL, 60139

Phone: 630-790-0880

Fax: 630-790-0882

Management Planner's Comments Summarized at the End of the Report

Review Date	09/26/2019
Manager Planner Name	Amy Williams
100-00746	5/15/2020
Manager IDPH License No/Expiration	

HA Number	Management Comments
01	
02	
03	
04	
05	
06	
07	
08	
09	
10	
11	
12	
13	
14	
15	
16	
17	
62	

Chicago Public Schools

TEM Environmental, Inc.

2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUILDING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **12"x12" Tan & Brown Speckled Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY: **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen, Multipurpose Room, 101, 102, 103, 104, 105, 106, 107, 111, Main Office & Storage and Case Management Room**

MATERIAL QUANTITY: **14628** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **01**
MATERIAL DESCRIPTION: **12"x12" Tan & Brown Speckled Floor Tile**
MATERIAL LOCATION: **Kitchen, Multipurpose Room, 101, 102, 103, 104, 105, 106, 107, 111, Main Office & Storage and Case Management Room**
MATERIAL QUANTITY: **14628** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **12"x12" Tan & Brown Speckled Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen, Multipurpose Room, 101, 102, 103, 104, 105, 106, 107, 111, Main Office & Storage and Case Management Room**

MATERIAL QUANTITY: **14628** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **02**
MATERIAL DESCRIPTION: **12"x12" Tan & Brown Speckled Floor Tile Mastic**
MATERIAL LOCATION: **Kitchen, Multipurpose Room, 101, 102, 103, 104, 105, 106, 107, 111, Main Office & Storage and Case Management Room**
MATERIAL QUANTITY: **14628** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Janitor's Closet, North Vestibule**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **03**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile**
MATERIAL LOCATION: **Janitor's Closet, North Vestibule**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Janitor's Closet, North Vestibule**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **04**
MATERIAL DESCRIPTION: **12"x12" Brown Floor Tile Mastic**
MATERIAL LOCATION: **Janitor's Closet, North Vestibule**
MATERIAL QUANTITY: **70** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **Drywall/Tape & Joint Compound**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Hallway, Entrances, 101, Main Office, Restrooms and Supply Room**
MATERIAL QUANTITY: **2379** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **05**
MATERIAL DESCRIPTION: **Drywall/Tape & Joint Compound**
MATERIAL LOCATION: **Hallway, Entrances, 101, Main Office, Restrooms and Supply Room**
MATERIAL QUANTITY: **2379** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **2'x4' Suspended Ceiling Tile**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Kitchen, Multipurpose Room, 101, 102, 103, 104, 105, 106, 111, Main Office & Storage, Case Management Room**

MATERIAL QUANTITY: **6803** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **06**
MATERIAL DESCRIPTION: **2'x4' Suspended Ceiling Tile**
MATERIAL LOCATION: **Kitchen, Multipurpose Room, 101, 102, 103, 104, 105, 106, 111, Main Office & Storage, Case Management Room**
MATERIAL QUANTITY: **6803** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **Vinyl Baseboard**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 101, 102, 103, 104, 105, 106, 111, Kitchen, Multipurpose Room, Main Office & Storage, Case Management Room**

MATERIAL QUANTITY: **1424** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **07**
MATERIAL DESCRIPTION: **Vinyl Baseboard**
MATERIAL LOCATION: **Rooms 101, 102, 103, 104, 105, 106, 111, Kitchen, Multipurpose Room, Main Office & Storage, Case Management Room**
MATERIAL QUANTITY: **1424** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**

MATERIAL LOCATION: **Rooms 101, 102, 103, 104, 105, 106, 111, Kitchen, Multipurpose Room, Main Office & Storage, Case Management Room**

MATERIAL QUANTITY: **1424** MATERIAL UNITS: **SF**

DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **08**
MATERIAL DESCRIPTION: **Vinyl Baseboard Mastic**
MATERIAL LOCATION: **Rooms 101, 102, 103, 104, 105, 106, 111, Kitchen, Multipurpose Room, Main Office & Storage, Case Management Room**
MATERIAL QUANTITY: **1424** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **09**
MATERIAL DESCRIPTION: **Plaster - Not Observed**
HISTORICAL AHERA DAMAGE CATEGORY
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION:
ASBESTOS TYPE: **Assumed** FRIABLE:

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be .

DAMAGE REASON:

DISTURBANCE POTENTIAL:

MATERIAL LOCATION: **Kitchen, Multipurpose Room, 102, 103, 104, 105, 106**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

COMMENTS: **Not Observed 2019**

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **09**

MATERIAL DESCRIPTION: **Plaster - Not Observed**

MATERIAL LOCATION: **Kitchen, Multipurpose Room, 102, 103, 104, 105, 106**

MATERIAL QUANTITY: MATERIAL UNITS:

DAMAGE QUANTITY: DAMAGE UNITS:

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Carpet Mastic**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office and Principal's Office**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **10**
MATERIAL DESCRIPTION: **Carpet Mastic**
MATERIAL LOCATION: **Main Office and Principal's Office**
MATERIAL QUANTITY: **350** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Black Boards**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **101, 102, 103, 104, 105, 106**
MATERIAL QUANTITY: **480** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUILDING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **11**
MATERIAL DESCRIPTION: **Black Boards**
MATERIAL LOCATION: **101, 102, 103, 104, 105, 106**
MATERIAL QUANTITY: **480** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Sink Undercoating**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Rooms 101, 102, 103, 104, 105, 106 & 111**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **12**
MATERIAL DESCRIPTION: **Sink Undercoating**
MATERIAL LOCATION: **Rooms 101, 102, 103, 104, 105, 106 & 111**
MATERIAL QUANTITY: **30** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Troweled on Ceiling Material**
HISTORICAL AHERA DAMAGE CATEGORY **7 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **Yes**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **7. Any remaining friable ACBM or friable suspect ACBM**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Main Office**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS: **Not Observed, Above Drop Ceiling**

Inspector's Signature: _____ Date: **08/30/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **13**
MATERIAL DESCRIPTION: **Troweled on Ceiling Material**
MATERIAL LOCATION: **Main Office**
MATERIAL QUANTITY: **130** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Insulation in Fire Doors**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Boiler Room, Crawlspace, Main Office, Case Management Room, Security Room**
MATERIAL QUANTITY: **140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **14**
MATERIAL DESCRIPTION: **Insulation in Fire Doors**
MATERIAL LOCATION: **Boiler Room, Crawlspace, Main Office, Case Management Room, Security Room**
MATERIAL QUANTITY: **140** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Window Caulk**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **510** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **15**
MATERIAL DESCRIPTION: **Window Caulk**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **510** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Window Glaze**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **510** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc. 2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **16**
MATERIAL DESCRIPTION: **Window Glaze**
MATERIAL LOCATION: **Throughout Facility**
MATERIAL QUANTITY: **510** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Door Caulking**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Entrance to Building**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUILDING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **17**
MATERIAL DESCRIPTION: **Door Caulking**
MATERIAL LOCATION: **Entrance to Building**
MATERIAL QUANTITY: **100** MATERIAL UNITS: **LF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **LF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Inspector Assessment Form (REASSESSMENT)

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** AHERA INSPECTOR: **John O'Brien**
SCHOOL NAME: **Barbara Vick Center** INSPECTION DATE: **8/30/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

INFORMATION FROM PREVIOUS INSPECTION

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Grey Terrazzo**
HISTORICAL AHERA DAMAGE CATEGORY **6 ACBM with the potential for damage**
HISTORICAL DAMAGE REASON:
HISTORICAL RESPONSE ACTION: **Follow O&M Plan**
ASBESTOS TYPE: **Assumed** FRIABLE: **No**

RESULTS OF REINSPECTION AND REASSESSMENT

This homogeneous area was re-inspected and reassessed in accordance with Section 763.85 and 763.88 of AHERA and it's condition HAS NOT CHANGED when compared to the conditions of the last AHERA reinspection.

The current AHERA DAMAGE CATEGORY is determined to be **6. ACBM with the potential for damage**

DAMAGE REASON:

DISTURBANCE POTENTIAL: **LOW**
MATERIAL LOCATION: **Corridor, Restroom/Converted Restroom**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

COMMENTS:

Inspector's Signature: _____ Date: 08/30/2019

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

Management Planner Review Form

LEA NAME: **Chicago Public Schools** UNIT NUMBER: **26731** BUIDLING ID: **2920**
CITY/STATE: **Chicago, Illinois** MANAGEMENT PLANNER: **Amy Williams**
SCHOOL NAME: **Barbara Vick Center** REVIEW DATE: **9/26/2019**
ADDRESS: **2554 West 113th Street** IDPH LICENSE NO: **100-05763**

HOMOGENEOUS AREA: **62**
MATERIAL DESCRIPTION: **Grey Terrazzo**
MATERIAL LOCATION: **Corridor, Restroom/Converted Restroom**
MATERIAL QUANTITY: **1200** MATERIAL UNITS: **SF**
DAMAGE QUANTITY: **0** DAMAGE UNITS: **SF**

In accordance with Sections 763.88 and 763.90 of the Asbestos Hazard Emergency Response Act (AHERA) the LEA must select a management planner to review the results of the inspection and assessment and recommend appropriate response actions. The original inspection of the above identified homogeneous area has been reviewed in accordance with Sections 763.88 and 763.90 with the following recommendations.

The RESPONSE ACTION recommendation is:

Follow O&M Plan

Comments:

Management Planner's Signature: _____ Date: **09/26/2019**

Chicago Public Schools

TEM Environmental, Inc.
2019 AHERA REINSPECTION

APPENDIX B

Inspector and Management Planner Licenses

2018



OCCUPATIONAL TRAINING & SUPPLY, INC.

7233 S. Adams Street ♦ Willowbrook, IL 60527 ♦ (630) 655-3900 ♦ www.otssafety.com

Asbestos Building Inspector Refresher

Occupational Training & Supply, Inc. certifies that

John O'Brien

has successfully completed the Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. The course is accredited by the Illinois Department of Public Health and Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency response Act (AHERA) and TSCA Title II.

Course Date: 12/7/2018

Exam Date: 12/7/2018

Expiration Date: 12/7/2019

Certificate Number: BIR1812073381

Kathy DeSalvo, Director



**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 05763

ISSUED
4/10/2019

EXPIRES
05/15/2020

JOHN O'BRIEN
445 N PARK BLVD., APT 3J
GLEN ELLYN, IL 60137



Environmental Health

ENDORSEMENTS

TC EXPIRES

INSPECTOR

12/7/2019

PROJECT MANAGER
AIR SAMPLING PROFESSIONAL

11/10/2019

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

Reliable
Environmental
Solutions, Inc. **RES**

This is to certify that **Amy J. Williams**

*has on 04/03/19, in Springfield, Illinois,
completed the requirements for asbestos accreditation under Section 206 of TSCA Title II*

Asbestos Building Inspector Refresher Training

*as accredited by the State of Illinois and approved by the U.S.E.P.A. under 40 CFR 763 (AHERA)
and passed the associated examination with a score of 70% or higher*

Course Date: April 03, 2019

COURSE LENGTH: 4 HOURS

Examination Date: April 03, 2019

Expiration Date: April 03, 2020

William S. Williams

Certificate Number: BIR/0808

Training Program Manager, William S. Williams

4211 Westgate Drive, Springfield, Illinois ☐ 217.787.9800 ☐ 217.787.9801 FAX ☐ www.ReliableEnv.com



2539 Vandalia Street, Collinsville, IL 62234 * Phone: 618-855-8764

Environmental and Occupational Safety & Health Training

Does hereby certify

William Williams

4211 Westgate Drive, Springfield, IL 62711

*Has successfully completed and passed the course examination with at least
70% for re-accreditation under AHERA (Title II)*

Asbestos Management Planner Refresher

Class Date: 02/15/2019
Examination Date: 02/15/2019
STC Certificate Number: STC-20190215-000527AMPR
Certification Expiration: 02/15/2020

David M. Mendoza – President/Training Director
Certified Environmental Specialist
OSHA Authorized Instructor

COPY OF THE ASBESTOS PROFESSIONAL LICENSE

Front of License

Back of License



ASBESTOS PROFESSIONAL LICENSE

ENDORSEMENTS

TC EXPIRES

ID NUMBER ISSUED EXPIRES
100 - 00746 4/11/2019 05/15/2020

INSPECTOR 4/21/2019

MANAGEMENT PLANNER 4/21/2019

PROJECT MANAGER 4/2/2020


AIR SAMPLING PROFESSIONAL

AMY J WILLIAMS

1408 S CLAY

JACKSONVILLE, IL 62650

Environmental Health

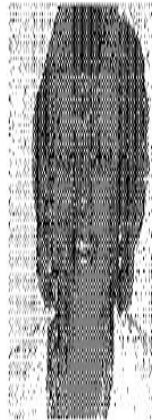

Alteration of this license shall result in legal action
This license issued under authority of the State of Illinois
Department of Public Health
This license is valid only when accompanied by a valid
training course certificate.

APPENDIX C

Laboratory Accreditations

APPENDIX D

Laboratory Results

APPENDIX E

Chain of Custody Forms

Three-Year Reinspection Key to Terms

	CODE	KEY
MATERIAL		
	ACBM	Asbestos Containing Building Materials
MATERIAL CATEGORY		
	MISC	Miscellaneous
	SURF	Surfacing
	TSI	Thermal System Insulation
MATERIAL UNITS		
	LF	Linear Feet
	SF	Square Feet
	CF	Cubic Feet
DAMAGE TYPE		
	Loc	Localized
	Dist	Distributed